


QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 03/06/2026
Our Ref: 00037561/PHILB
Your Ref: 45750/1

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Ms Svitlana Voitenko**

We refer to your instructions received on **02 June 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

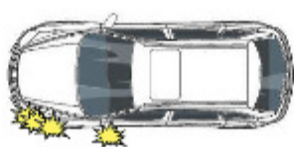Vehicle: HONDA JAZZ HS-T IMA CVT		Colour: Blue	Speedo:	Miles
Reg No: KE13XRT	Registered: Jan 2025	Type: 5 Door Hatchback	Trans: CVT	
Vin No: GP1-1230766	MOT Exp:	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno	
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested	
Audio: Not Seen	Manf'd: 2013			Spare Tyre Not Know
Brakes: Not Known	Tax Exp:			Centre Belt Not Tested
Steering: Not Known	Fuel:			
Extras: Not Seen	C.C.: 1339			
Air Bags Deployed: Not Known	BHP: 97.9	L/H/F Belt Not Tested	L/H/R Belt Not Tested	
Damage: Light Collision/Impact LH Front	Incident: 12/04/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno	
Vehicle Value: £6,100.00		Repair Cost: £2,837.38 inc VAT	(46.51% of PAV)	Roadworthy: Yes

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light collision/impact damage to the left hand front.

ENGINEER'S COMMENTS

The engineer has inspected this vehicle from images supplied by the principal only, the repair costs have been based on the images received and therefore may not be accurate if further damage is found, condition details and service records have not been checked in relation to the pre-accident value.

The valuation for the purpose of this report has been calculated using an estimated mileage from the vehicles MOT history at the time of loss.

VEHICLE HISTORY CHECK

According to the Experian database; According to the Experian database; Vehicle imported from outside the EU on date of first registration. in the UK in 2025. The year of manufacture is 2013.

REPAIR SCHEDULE

New parts required:-Panel Sundries, Car Care Kit, Glass Lifting Tape, Sundry Parts

Repairable parts:-Front Bumper, R/Door Mirror Hsg

Repaint only parts:-Two Coat Metallic, Front Bumper Repair Paint Plastic, De Nib & Polish. Per Panel, Preparation



For Pre-Painting

Specialist/Sundry charges:-Bsi Compliance, Hybrid Recharge, Geometry Check, Epa, Repair Methods

Blend only parts:-R/F Wing Surface Paint

Remove And Refit parts:-Description, Front Bumper Lower Grille, R/F Bumper Bracket, Front Bumper, Right Headlamp, Lower Front Bumper Spoiler, Adjust Headlamp, Radiator Grille, Right Repeater Lamp Lens, Right Front Wing Moulding Rear

Parts to check:-Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vacuum, Power Down Ev/Hybrid, Electric Risk Assess

COST OF REPAIRS

No estimate has been obtained for repairing the vehicle but, **subject to further damage found during dismantling**, we have calculated the time involved in such a repair using Audatex and we consider that a reasonable labour charge would be £1,449.07. The cost of the paint and materials would be £611.22, The cost of the replacement parts would be approximately £53.08, The specialist/sundry charges would be £251.11, and the VAT liability on the total would amount to some £472.90 giving a total repair cost of £2,837.38 including VAT **subject to undisclosed damage**. The labour charge is based on 17.4 hours at a rate of £83.28 per hour.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in the UK in 01/01/2025, although we understand that it was first manufactured in 2013. There are no guide values for vehicles of this age and type. We place the pre-accident value of this particular vehicle at £6,100.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £2,850.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We confirm that we have not authorised repairs on your behalf and our actions in this matter remain without prejudice.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy. **The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.**

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of



Phil Birch ATA VDA
Exclusive Vehicle Assessors



ClientFrontWheelArchDamages3-V1.jpeg



3_ClientFrontWheelArchDamages1-V1.jpeg




5_ClientVehicleFront-V1.jpeg



4_ClientVehicleWingMirrorDamages-V1.jpeg



2_ClientFrontWheelArchDamages2-V1.jpeg

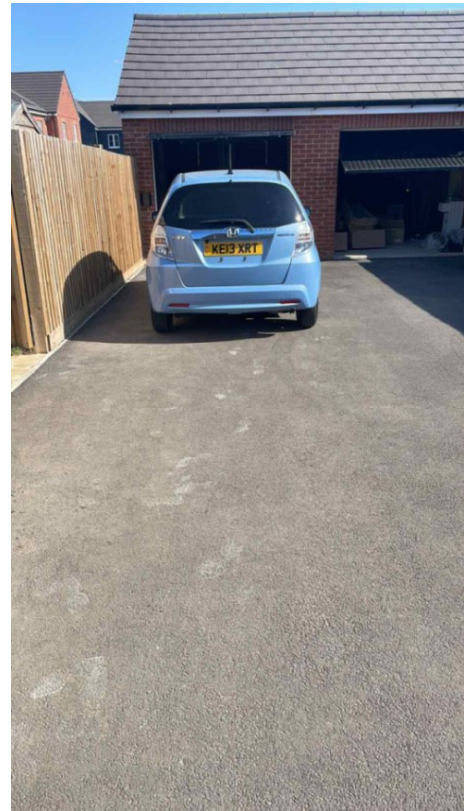

6_ClientVehicleRear-V1.jpeg