

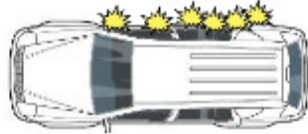
QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 20/04/2026
Our Ref: 00034732/MATTG
Your Ref: 44636/1

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Mr Peter Hutchin**

We refer to your instructions received on **17 April 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: LAND ROVER RANGE ROVER EVOQUE		Colour: WHITE	Speedo: 85215 Miles	
Reg No: J22UCH	Registered: Mar 2015	Type: Estate	Trans: Automatic	
Vin No: SALVA2AE2FH041080	MOT Exp:	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno	
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested	
Audio: Not Seen	Manfd: 2015			
Brakes: Not Known	Tax Exp:			Spare Tyre Not Known
Steering: Not Known	Fuel: Diesel			Centre Belt Not Tested
Extras: Not Seen	C.C.: 2179			
Air Bags Deployed: Not Known	BHP: 190	L/H/F Belt Not Tested	L/H/R Belt Not Tested	
Damage: Moderate Collision/Impact RH Side Complete Vehicle	Incident: 11/04/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno	
Vehicle Value: £10,367.00		Repair Cost: £4,434.59 inc VAT (42.78% of PAV)	Roadworthy: No	

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the right hand side complete vehicle.

ENGINEER'S COMMENTS

The engineer has inspected this vehicle from images supplied by the principal only, the repair costs have been based on the images received and therefore may not be accurate if further damage is found, condition details and service records have not been checked in relation to the pre-accident value.

VEHICLE HISTORY CHECK

According to the Experian database; there is a plate change on record

REPAIR SCHEDULE

New parts required:-R/R Wheel, R/R Tyre, Panel Sundries, Car Care Kit, Glass Lifting Tape, Sundry Parts

Repairable parts:-R/F Door Lower, R/R Door Lower

Repaint only parts:-R/F Door Lower Repair Painting <50%, R/R Door Lower Repair Painting <50%, De Nib &



Polish. Per Panel, Preparation For Pre-Painting

Specialist/Sundry charges:-Bsi Compliance, Adas Methods, Geometry Check, Epa, Corrosion Protection Materials External

Blend only parts:-R/F Outer Handle Surface Paint Plast., R/R Outer Handle Surface Paint Plast., R/R Door Extension Surface Paint Plast.

Remove And Refit parts:-Description, Additional Time For Separate Workshop, Right Front Door Trim, Right Front Outer Door Handle, Right Rear Door Trim, Right Rear Outer Door Handle, Remove And Refit R/R W-Arch Moulding, Right Rear Wheel, Refit Rim And/Or R/Rr Tyre, Corrosion Prote To 2 Panels

Parts to check:-Adas Exploration, Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vaccum, Est Pre Wash

COST OF REPAIRS

No estimate has been obtained for repairing the vehicle but, **subject to further damage found during dismantling**, we have calculated the time involved in such a repair using Audatex and we consider that a reasonable labour charge would be £1,999.36. The cost of the paint and materials would be £619.68, The cost of the replacement parts would be approximately £830.26, The specialist/sundry charges would be £246.19, and the VAT liability on the total would amount to some £739.10 giving a total repair cost of £4,434.59 including VAT **subject to undisclosed damage**. The labour charge is based on 19.4 hours at a rate of £103.06 per hour.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 01/03/2015. The corresponding Percayso Guide (model code: 3463) adjusted retail value for vehicles of this type and age in the April 2026 guide is £10,367.00 at 85215 Miles, trade value is £8,708.00 and mid value is £9,537.50. We place the pre-accident value of this particular vehicle at £10,367.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £4,450.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We confirm that we have not authorised repairs on your behalf and our actions in this matter remain without prejudice.

REPAIR DURATION

We consider that this repair will take some 5 to 6 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle was not roadworthy at the time of our inspection as a result of the damage sustained due to wheel damage which will require a geo check.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of

 .

Jeff Parr CAE AMIMI
Exclusive Vehicle Assessors



4_CLVDamage-V1-4.jpg



Mileage-V1.jpg



1_CLVDamage-V1.jpg



2_CLVDamage-V1-2.jpg



2_VIN-V1.jpg



3_CLVDamage-V1-3.jpg