

Our Ref: qdos221402

Your Ref: LN/14408/1

Date: 23/08/2022

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

REPAIRABLE REPORT

Dear Sirs


RE: Road traffic Accident: Karen Reid: 17/08/2022

In accordance with your instructions received on 23/08/2022 requesting us to provide an independent accident damage report, we assessed the damage on 23/08/2022. Vehicle located at Image based assessment. Our findings are as detailed below:


Make	VAUXHALL	Registration	BV64HYJ
Model	INSIGNIA SRI CDTI A	Status	Repair
Category		Salvage Value	
Repair Cost	£3,014.00	Legal Status	Unroadworthy
Engineer Value	£4,752.00	Impact Magnitude	Moderate



Impact Area

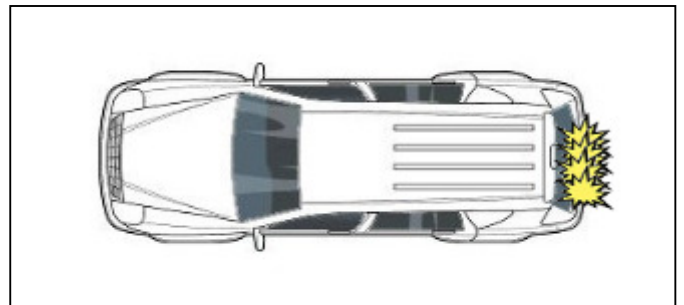

Document produced
using the EVA system

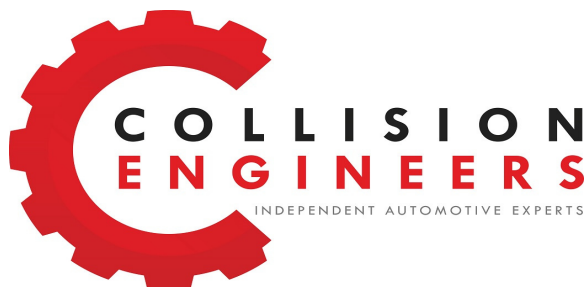

Our Ref: qdos221402

Your Ref: LN/14408/1

Date: 23/08/2022

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the rear.

ENGINEER'S COMMENTS

23/08/2022 - Please note the vehicle is unroadworthy due to the damaged/insecure exhaust.

VEHICLE HISTORY CHECK

23/08/2022 - According to the Experian database; Category S total loss claim Structural Damage See the Condition details An entry exists on the MIAFTR register to this effect dated 29/11/2021, loss dated 04/11/2021

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

RESERVE

We consider that a repair reserve of £3,025.00 would be reasonable on this occasion.


Vehicle Data

Retail Value	£5,940.00
Trade Value	£3,910.00
Engineer's Value	£4,752.00
Glass's Code	L4PF
VIN	W0LGS8EM7E1188227
Odometer	124044
Engine	1956
Fuel	Diesel
Extras	
Condition	Good
Unrelated Damage	

Main new parts required

Rear Bumper Lining
Rear Bumper Reinforcement
Left Rear Bumper Outer Bracket
Left Rear Bumper Inner Bracket
Left Rear Bumper Inner Side Distance-Sensor
Rear Bumper Lining Clip
Rear bumper lining Nut

Rear Bumper Impact Absorber/Filler
Rear Bumper Protective Moulding
Right Rear Bumper Outer Bracket
Rear Bumper Repair Kit
Right Rear Bumper Inner Side Distance-Sensor
Rear Bumper Lining Screw
Main Exhaust Silencer

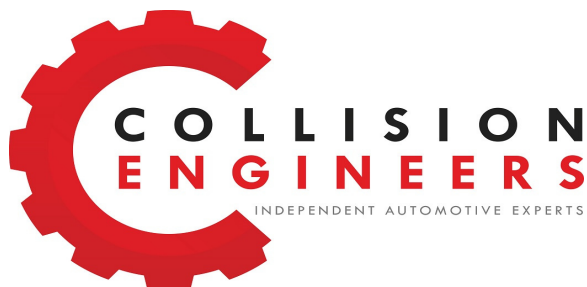

Our Ref: qdos221402

Your Ref: LN/14408/1

Date: 23/08/2022

Repairs required

Boot Lid/Tailgate Cover

Additional operations

Repair Method Research Allowance
System Diagnostic Check (Pre Repair)
De-Nib/Polish
Final Inspection & Road Test
Paint Tailgate Cover, Lower
Paint Left Rear Bumper Distance-Sensor
Paint Prep. synthetics (on vehicle without pre-painting)
Paint Sample colour creation (1)

System Diagnostic Check (Post Repair)
Car Care Kit
Environmental Charge
Wash/Clean
Paint Rear Bumper k/e
Paint Right Rear Bumper Distance-Sensor
Paint Colour mixing (1)

Repair Cost Calculations

Hours	9.50
Hourly Rate	£62.50
Total Labour	£593.75
Parts	£1,321.24
Paint/Materials	£486.68
Specialist/Other	£110.00
Sub total	£2,511.67
Vat	£502.33
Total Estimated Cost	£3,014.00