

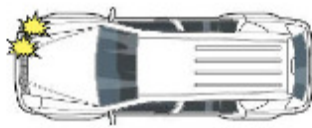
Miss Lynn Lancaster
Hartford Marina, Banks End
Wyton
Huntingdon
Cambridgeshire
PE28 2AA

Date: 25/02/2026
Our Ref: 00030595/DME
Your Ref: EHR96863 \ OS92101560606

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Miss Lynn Lancaster**

We refer to your instructions received on **16 February 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: AUDI A4 ALLROAD TDI QUATTRO A		Colour: White	Speedo: 126023 Miles	
Reg No: N12LCL	Registered: Nov 2014	Type: 5 Door Estate	Trans: Automatic	
Vin No: WAUZZZ8K3FA024915	MOT Exp:	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno	
Mods: Not Seen	Cond: Average	R/H/F Belt Not Tested	R/H/R Belt Not Tested	
Audio: Not Seen	Manfd: 2014			
Brakes: Not Known	Tax Exp:			Spare Tyre Not Known
Steering: Not Known	Fuel: Diesel			Centre Belt Not Tested
Extras: Not Seen	C.C.: 1968			
Air Bags Deployed: Not Known	BHP: 174	L/H/F Belt Not Tested	L/H/R Belt Not Tested	
Damage: Light to Moderate Collision/Impact RH Front	Incident: 15/02/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno	
Vehicle Value: £6,256.00		Repair Cost: £3,491.36 inc VAT (55.81% of PAV)	Roadworthy: Yes	

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF DAMAGE

The vehicle has suffered light to moderate collision impact to the right hand front.

ENGINEER'S COMMENTS

I can confirm repairs have been authorised via Audatex in accordance with your original instructions.

Authority sent via Audatex.

VEHICLE HISTORY CHECK

25/02/2026 - According to the Experian database; there is a plate change on record

REPAIR SCHEDULE

New parts required:-R/F Bumper Cover, Grille, Right Headlamp, Osf PDC Ring, Sundries

Repaint only parts:-R/F Bumper Cover New Part Paint K1r, Polish Wing/Bonnet Repair Painting <50%, De Nib Per



Panel, Pre-Painting Sundry Materials, Preparation for Pre-Painting

Specialist/Sundry charges:-Bs10125, Car Care Kit, E.P.A. Charge, Methods Research, Pas2060, Energy Supplement, Pre Repair Collect, Post Repair Delivery

Remove And Refit parts:-Front Bumper Cover, Renew R/F Bumper Cover, Radiator Grille, Right Headlamp, Renew R/Headlamp (Removed), Align Front Fog Lamps, Ice Shut Down, Bumper 2 Man Lift, Road Test And Quality Control, Specialist Vehicle Diag Post Check, Specialist Vehicle Diag Pre Check, Specialist Adas

COST OF REPAIRS

An Audatex estimate has been obtained from Ld Autovogue Ltd, Unit 18-21 Ironside Way Norfolk, NR, Hingham, Norfolk, NR9 4LF (Tel. 01953 454181) in the sum of £958.46 labour plus parts at manufacturer's list prices plus £152.14 for paint and materials plus £585.62 for specialist/sundry charges. Having calculated the time involved in this repair I consider this to be reasonable. The labour charge is based on 9.3 hours at a rate of £103.06 per hour. I have also agreed that the cost of paint and materials will be limited to £152.14. The cost of the necessary replacement parts will be approximately £1,539.57, the specialist/sundry charges will be £259.30, the VAT liability on this repair will amount to some £581.89 giving a total repair cost of £3,491.36 including VAT **subject to any undisclosed damage. I am pleased to confirm that I have achieved total gross savings in this matter of £391.58.**

OTHER DAMAGE

I noted the following damage on the vehicle:- Evidence of previous repairs to the front bumper and the bonnet area.

REPAIRER VAT STATUS

I am informed that the repairer is registered for VAT

PRE-INCIDENT CONDITION

The vehicle is considered to be in average condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to me the vehicle was first registered in 05/11/2014.

The corresponding Glass's Guide (model code: 8Y7G) adjusted retail value for vehicles of this type and age in the February 2026 guide is £6,256.00 at 126000 Miles, trade value is £3,777.00.

I place the pre-accident value of this particular vehicle at £6,256.00 bearing in mind the condition described herein.

RESERVE

I consider that a repair reserve of £3,500.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

I am pleased to confirm that I have authorised the repairers to proceed with the work via Audatex in accordance with your instructions, on the 25th February 2026, on your behalf.

REPAIR DURATION

I consider that this repair will take some 3 to 4 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In my opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy. **The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.**

For & on behalf of

TIM CLARKE

Tim Clarke IMI VDA Accreditation, C.A.E., M.I.M.I.
Exclusive Vehicle Assessors