

Our Ref: qdos221402

Your Ref: LN/14408/1

Date: 23/08/2022

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

REPAIRABLE REPORT

Dear Sirs


RE: Road traffic Accident: Karen Reid: 17/08/2022

In accordance with your instructions received on 23/08/2022 requesting us to provide an independent accident damage report, we assessed the damage on 23/08/2022. Vehicle located at Image based assessment. Our findings are as detailed below:


Make	VAUXHALL	Registration	BV64HYJ
Model	INSIGNIA SRI CDTI A	Status	Repair
Category		Salvage Value	
Repair Cost	£3,014.00	Legal Status	Unroadworthy
Engineer Value	£4,752.00	Impact Magnitude	Moderate



Impact Area

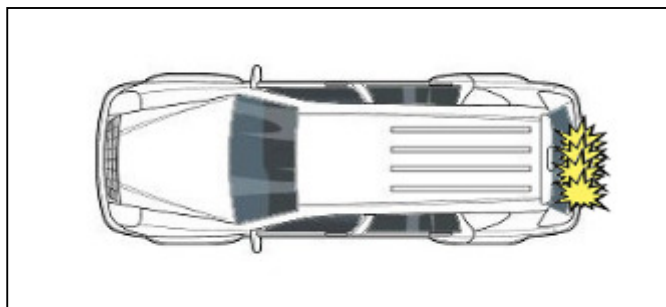

Document produced
using the EVA system

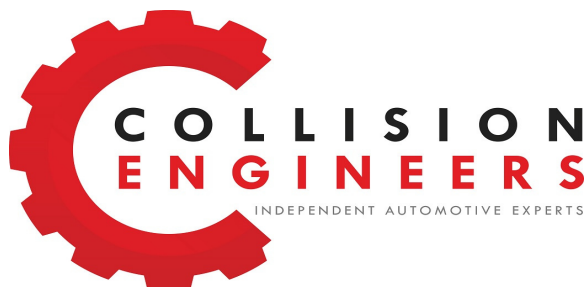

Our Ref: qdos221402

Your Ref: LN/14408/1

Date: 23/08/2022

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the rear.

ENGINEER'S COMMENTS

23/08/2022 - Please note the vehicle is unroadworthy due to the damaged/insecure exhaust.

VEHICLE HISTORY CHECK

23/08/2022 - According to the Experian database; Category S total loss claim Structural Damage See the Condition details An entry exists on the MIAFTR register to this effect dated 29/11/2021, loss dated 04/11/2021

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

RESERVE

We consider that a repair reserve of £3,025.00 would be reasonable on this occasion.


Vehicle Data

Retail Value	£5,940.00
Trade Value	£3,910.00
Engineer's Value	£4,752.00
Glass's Code	L4PF
VIN	W0LGS8EM7E1188227
Odometer	124044
Engine	1956
Fuel	Diesel
Extras	
Condition	Good
Unrelated Damage	

Main new parts required

Rear Bumper Lining
Rear Bumper Reinforcement
Left Rear Bumper Outer Bracket
Left Rear Bumper Inner Bracket
Left Rear Bumper Inner Side Distance-Sensor
Rear Bumper Lining Clip
Rear bumper lining Nut

Rear Bumper Impact Absorber/Filler
Rear Bumper Protective Moulding
Right Rear Bumper Outer Bracket
Rear Bumper Repair Kit
Right Rear Bumper Inner Side Distance-Sensor
Rear Bumper Lining Screw
Main Exhaust Silencer

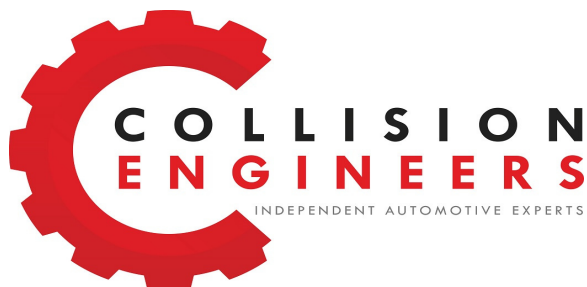

Our Ref: qdos221402

Your Ref: LN/14408/1

Date: 23/08/2022

Repairs required

Boot Lid/Tailgate Cover


Additional operations

Repair Method Research Allowance
System Diagnostic Check (Pre Repair)
De-Nib/Polish
Final Inspection & Road Test
Paint Tailgate Cover, Lower
Paint Left Rear Bumper Distance-Sensor
Paint Prep. synthetics (on vehicle without pre-painting)
Paint Sample colour creation (1)

System Diagnostic Check (Post Repair)
Car Care Kit
Environmental Charge
Wash/Clean
Paint Rear Bumper k/e
Paint Right Rear Bumper Distance-Sensor
Paint Colour mixing (1)

Repair Cost Calculations

Hours	9.50
Hourly Rate	£62.50
Total Labour	£593.75
Parts	£1,321.24
Paint/Materials	£486.68
Specialist/Other	£110.00
Sub total	£2,511.67
Vat	£502.33
Total Estimated Cost	£3,014.00

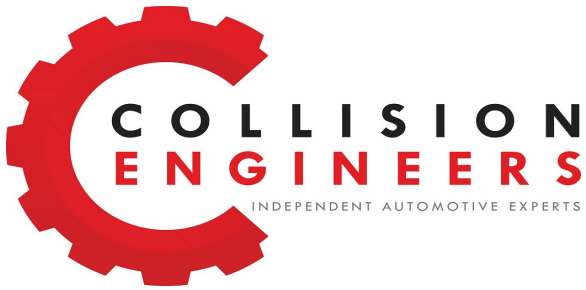

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



4741591b-1549-4225-ae77-
91064a49a6dd.jpg



4aa670cf-b82b-4b5a-9399-
a4bd3ad5560f.jpg

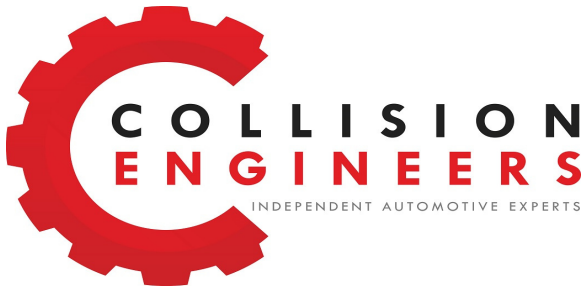

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



6e564c13-cc72-45ed-9062-
5d012085d538.ipa



7eea3ce7-9532-4f60-a7ae-
84d9e6b80ea5.jpg

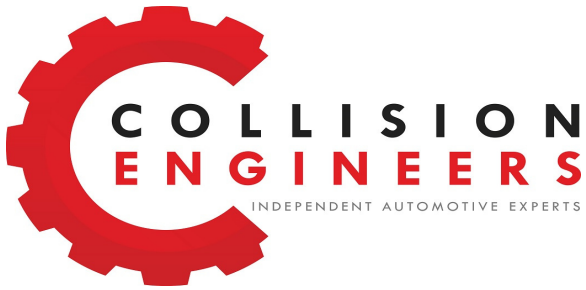

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



7eea3ce7-9532-4f60-a7ae-84d9e6b80ea5-1.jpg



5319d9eb-3625-49eb-a15b-28a43fe22740.jpg

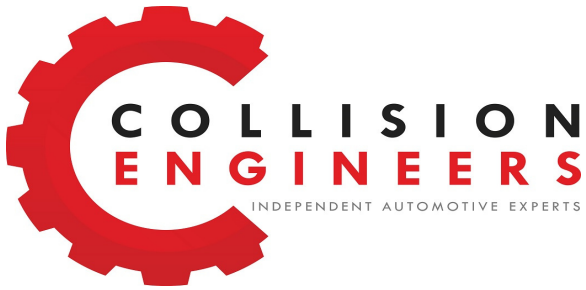

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



5319d9eb-3625-49eb-a15b-28a43fe22740-1.ipa



6354cd5f-9c36-480d-bdfd-0438c09706e9.jpg

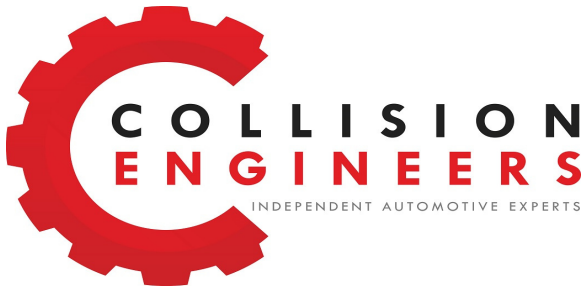

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



6387d757-54ea-493b-9fb0-
c2b649ac7aaa.ipq



cf10d4b-52e6-4c8e-93c2-
213b3456fcd2.jpg

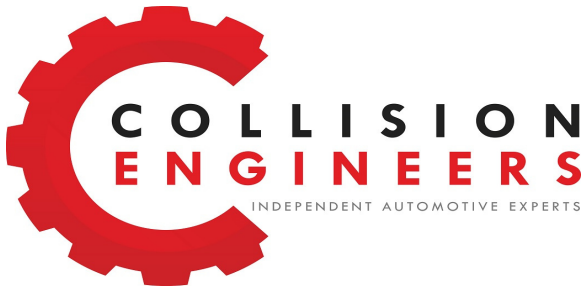

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



cfd10d4b-52e6-4c8e-93c2-213b3456fcd2-1.jpg



e829ca27-921b-4bb3-80de-830ecbd35fb0.jpg

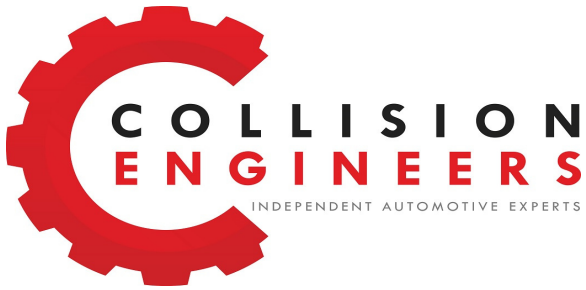

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



fe04fcf7-f7c4-4907-9edf-
2445d6e86673.ipa



163e8351-3282-46aa-a319-
441511186eb2.jpg

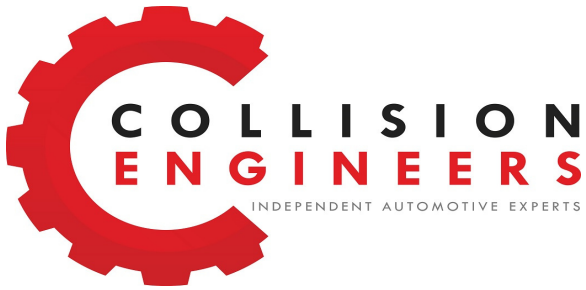

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



261a9fff-3115-454e-ad9c-
b6c931698f98.ipq



06855968-f747-41b2-8b44-
aba41406c5d5.jpg

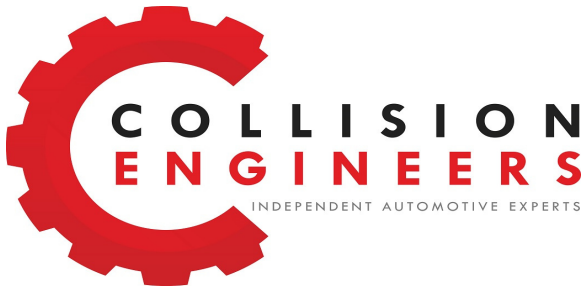

Our Ref: qdos221402

Your Ref: LN/14408/1


Date: 23/08/2022



06855968-f747-41b2-8b44-aba41406c5d5-1.jpg



2ab8095d-7e3b-4c5c-83c4-1a55e4762001
(1).jpg

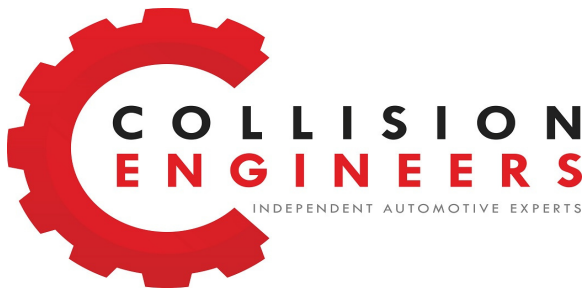

Our Ref: qdos221402

Your Ref: LN/14408/1

Date: 23/08/2022

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully



A Patterson - A Patterson M.Inst.IAEA
engineers@collisionengineers.co.uk

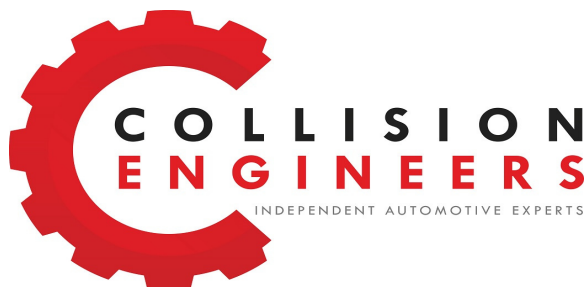

Our Ref: qdos221402

Your Ref: LN/14408/1

Date: 23/08/2022

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

Fee Note

BV64HYJ.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

Agreed Fee: £100.00

Sub Total: £100.00

VAT: £20.00

Total Due: £120.00

Payment

Please make cheques payable to Collision Engineers and quote reference qdos221402.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o QDOS Assistance confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10