

Flanders Loft



FY 2026 RESERVE STUDY AND MAINTENANCE SCHEDULE

PREPARED FOR:

**Flanders Loft Community
Association
c/o
Bluestone Real Estate
Services**

PROJECT NUMBER:

23-040

REPORT DATE:

November 4, 2025

FINAL

PREPARED BY:

FORENSIC
BUILDING CONSULTANTS

WWW.FORENSICBUILDING.COM

12901 SE 97TH AVE. SUITE 310

CLACKAMAS, OR 97015

(P) 503.772.1114

(F) 503.772.4039

This Page Left Intentionally Blank

TABLE OF CONTENTS

EXECUTIVE SUMMARY	4
GENERAL ASSESSMENT OF RESERVE FUND STATUS	5
Estimated Reserve Fund Balance	5
Recommended Reserve Fund Contribution	5
RESERVE FUND CONTRIBUTION ANALYSIS.....	6
Threshold Chart	6
Year End Balance Chart	7
Percent Funded Chart	8
Recommended Cash Flow – Annual	9
RESERVE STUDY PARAMETERS	10
Note Regarding Inflation	10
Property Site Overview	11
Satellite Image	11
Building Elevation Photographs	12
Reserve Study Exclusions	14
COMPONENT INVENTORY	15
Explanatory Notes	15
Component List – Summary	16
Expenditures – Annual List	18
Expenditures – Matrix	22
Component List – Full Detail	28
APPENDIX A	64
Maintenance Schedule	65
APPENDIX B	73
Purpose Of Report.....	74
Standard Terms And Definitions.....	75
Overview Of Capital Planning Tools	77
Reserve Study Methodology	81
Disclosures And Limitations	83

EXECUTIVE SUMMARY

Client Name:	Flanders Loft Community Association c/o Bluestone Real Estate Services	Property Name:	Flanders Loft (Property)
Client Address:	4915 SW Griffith Dr. Suite 300 Beaverton, OR 97005	Property Address:	725 NW Flanders St Portland, OR 97209
Report Type:	Level 2 Reserve Study Update & Maintenance Plan	Report Date:	November 4, 2025

Dear Flanders Loft Community Association:

As requested, Forensic Building Consultants (Forensic) has prepared a 30-year Reserve Study and Maintenance Schedule for Flanders Loft.

The following report consists of the following:

- 1) A physical analysis of the current condition of a limited representative sample of the Property's commonly owned building components, and
- 2) A financial analysis of the Association's current reserve fund balance, contribution, and anticipated replacement schedule, and
- 3) A recommended maintenance schedule for the commonly owned building components.

The intent of this Reserve Study is to evaluate the results of the physical and financial analyses to help the Association assess their current reserve funding and to arrive at an appropriate annual reserve fund contribution for the Property, based on the anticipated replacements and renewals of major commonly owned building components over the next thirty (30) years.

RESERVE STUDY SCOPE

This Reserve Study (RS) update is limited to information provided by the Association, previous reserve study updates, and other reports which provide information on the current condition of the components included in this study. Note that this study's scope is limited to the following:

- **Update with Site Visit (Level II)** – The reserve provider conducts a component inventory (verification only, not quantification unless new components have been added to the inventory), a condition assessment (based upon on-site visual observations), and life and valuation estimates to determine both the “fund status and “funding plan.”

GENERAL ASSESSMENT OF RESERVE FUND STATUS

ESTIMATED RESERVE FUND BALANCE

The estimated starting fiscal year reserve fund balance of \$317,949.90 places the reserve fund at an approximately 54% funding level. Ideally, a reserve fund would be approximately 80 to 100% funded, meaning that most or all depreciation of existing components is held in reserve. Currently, the Association appears to be at a low risk for special assessment should any unplanned expenses or component failures occur.

RECOMMENDED RESERVE FUND CONTRIBUTION

The recommended reserve fund contribution has been calculated to meet all projected expenses and maintain a positive threshold throughout the 30 years of this report.

A contribution of \$53,045 in fiscal year 2026 followed by 3% annual increases is recommended to meet the above criteria and is projected to an ending balance of approximately \$624,694 in fiscal year 2055.

Costs provided in this report are estimates based on currently available information. Forensic strongly recommends the Association determine the scope of any upcoming projects and obtain bids from multiple qualified vendors to ensure adequate funding.

Recommended Annual Reserve Fund Contributions	
FY 2026	\$ 53,045
FY 2027 - FY 2055	3% annual increases


See '**Recommended Cash Flow – Annual**' for more detailed information.

RESERVE FUND CONTRIBUTION ANALYSIS

THRESHOLD CHART

For the purposes of this report, threshold is defined as the difference between a fiscal year's beginning balance and its projected expenses. Negative thresholds can lead to deferral of projects due to lack of available funds. recommended contribution maintains a positive threshold throughout the 30 years of this study, as illustrated in the graph below.


The 'Current' annual thresholds are based on the FY2025 contribution of \$51,500 with no annual increases.

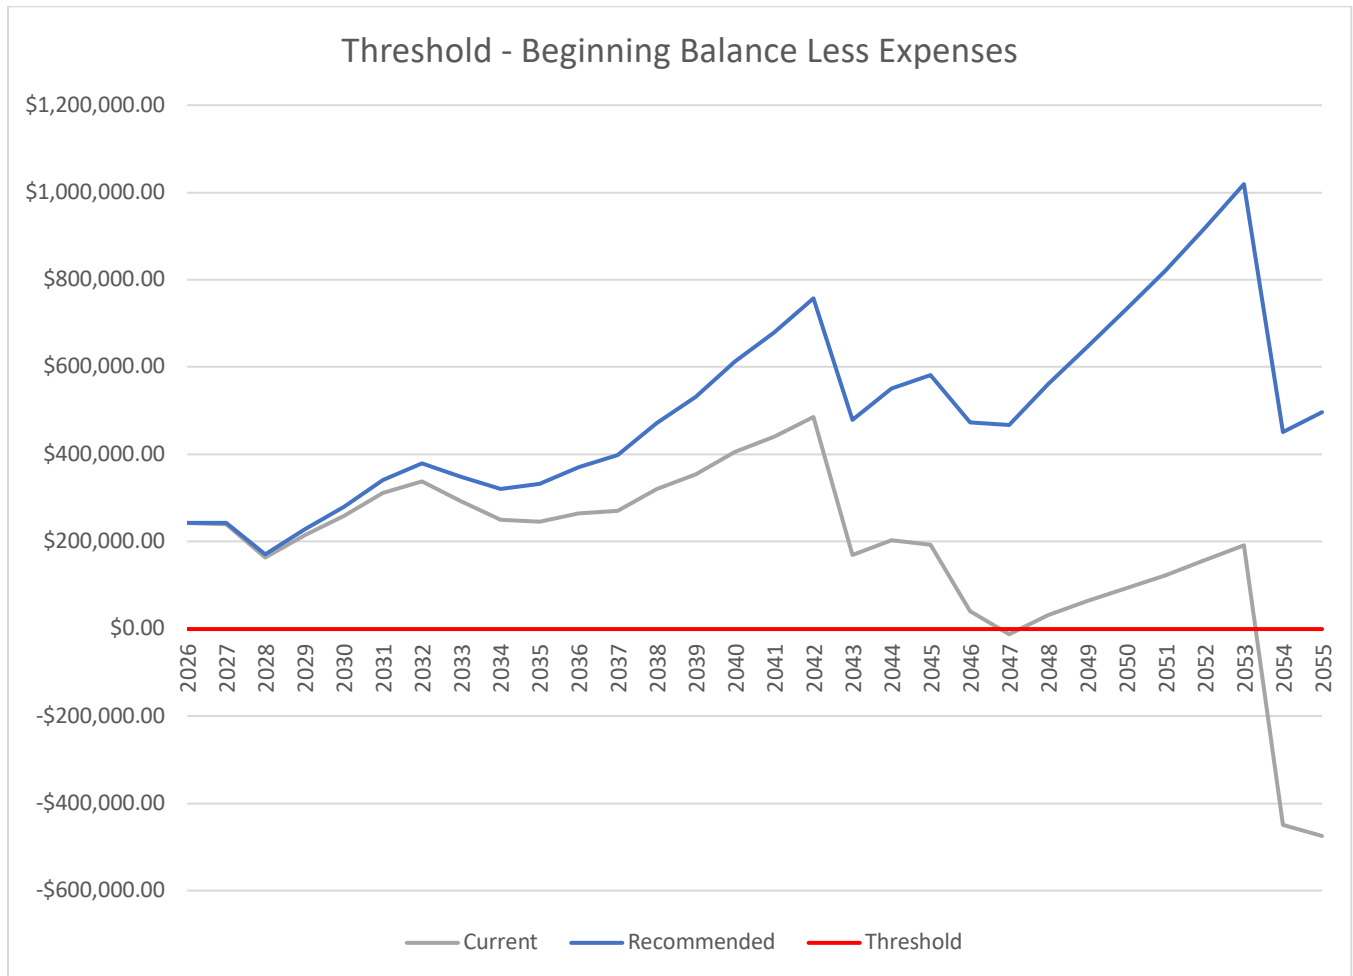

YEAR END BALANCE CHART

The annual ending balances of both the current and recommended funding plan are illustrated below.


The 'Current' annual year-end balances are based on the FY2025 contribution of \$51,500 with no annual increases.

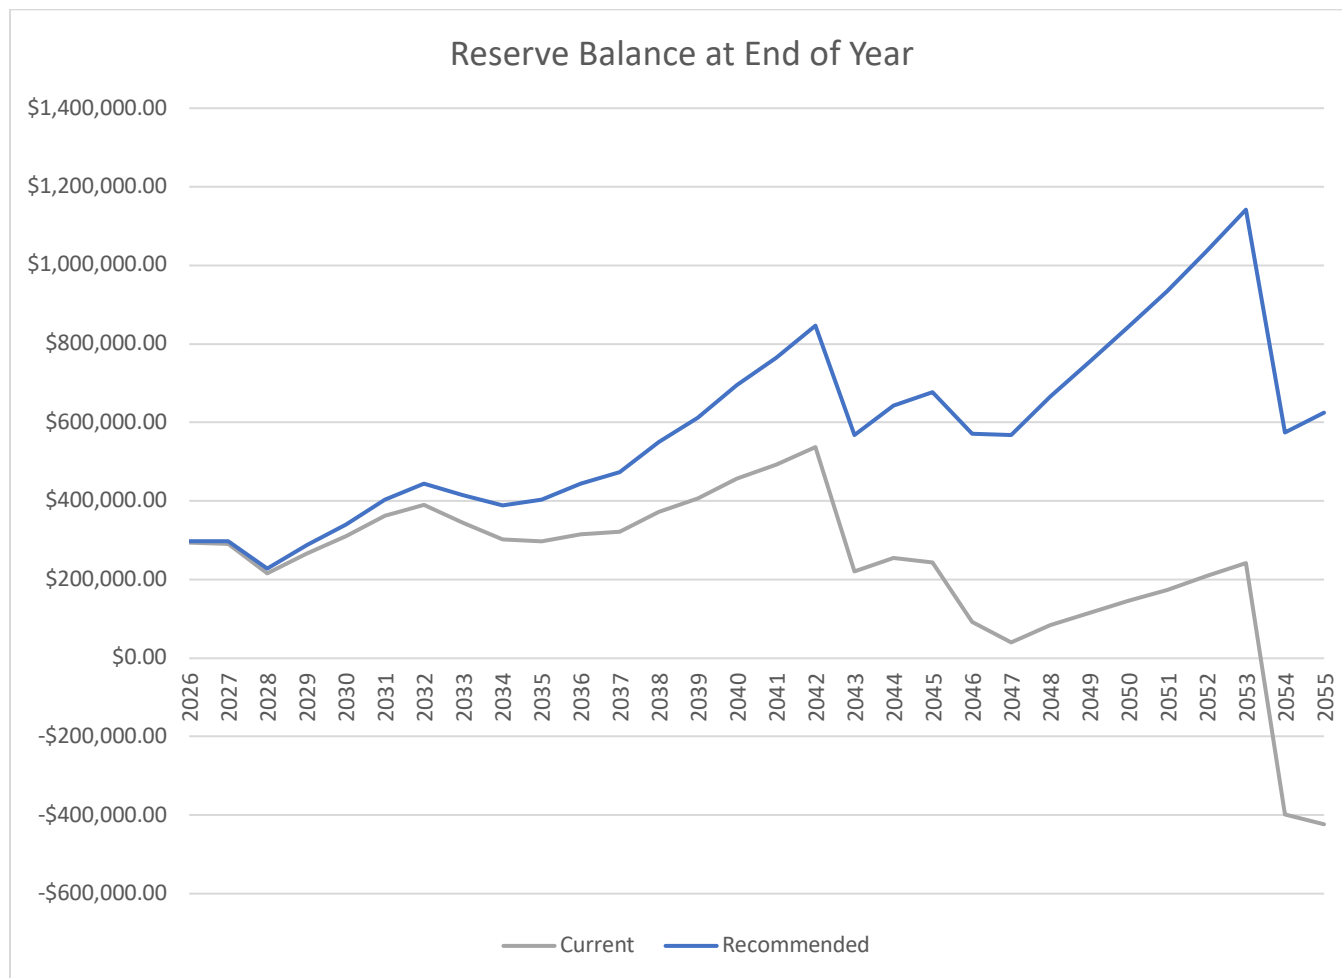

PERCENT FUNDED CHART

The recommended contribution schedule will lead to an approximately 100% funded reserve by 2054 as illustrated in the graph below.

The 'Current' annual percent funded is based on the FY2025 contribution of \$51,500 with no annual increases.

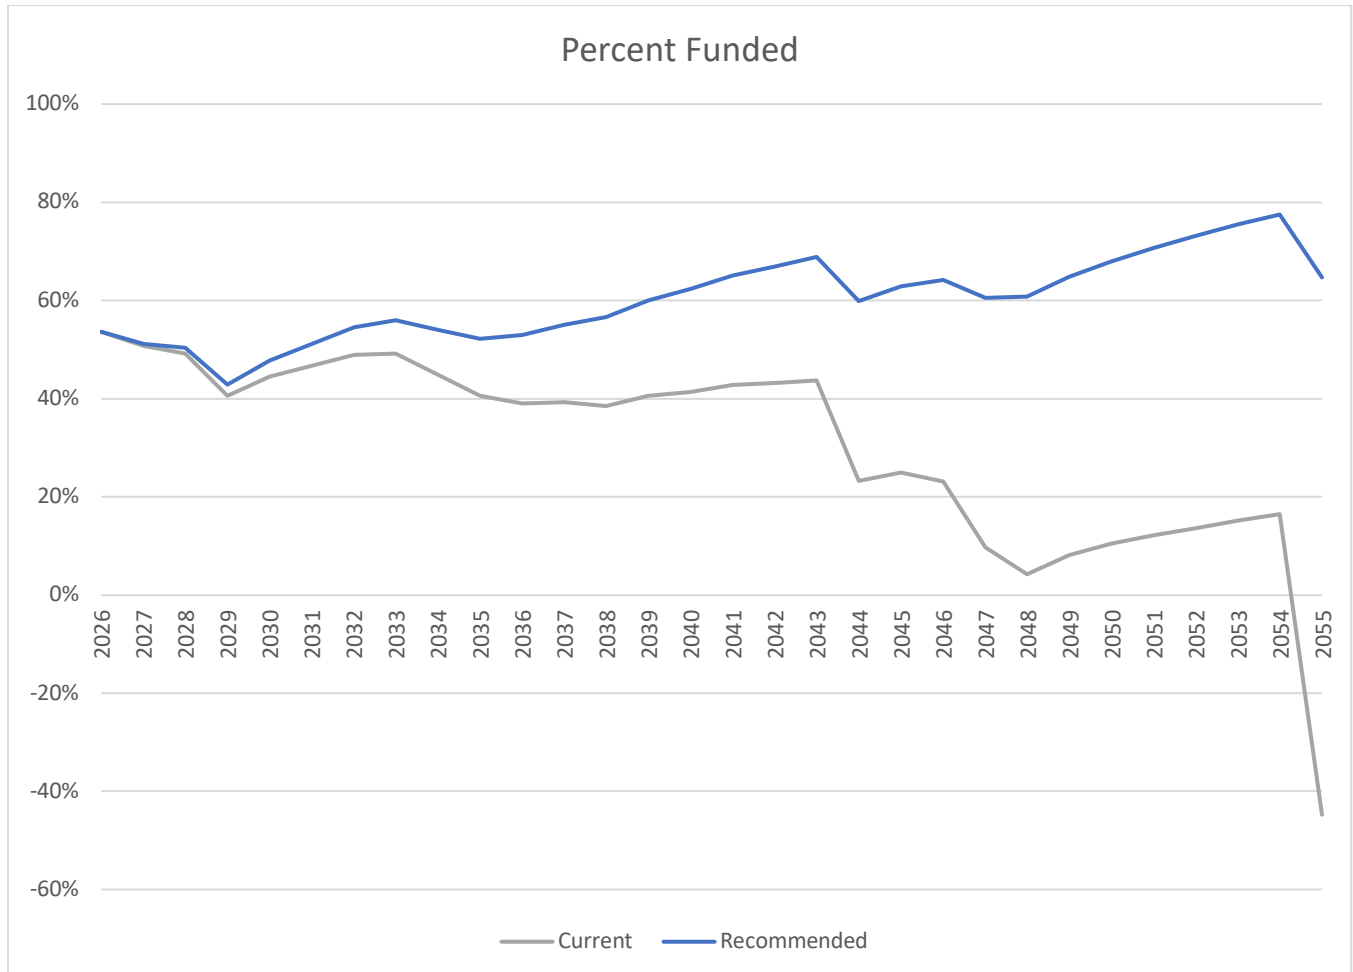

RECOMMENDED CASH FLOW – ANNUAL

EXPLANATORY NOTES

The recommended cash flow projections provided here have been calculated based on the recommended cash flow detailed under ‘General Assessment of Reserve Fund Status’.

	2026	2027	2028	2029	2030	2031	2032	2033	2034	2035
Begin Balance	317,950	297,224	316,939	227,690	286,811	340,220	403,386	444,698	414,529	388,909
Contribution	53,045	54,636	56,275	57,964	59,703	61,494	63,339	65,239	67,196	69,212
Average Per Unit	1,965	2,024	2,084	2,147	2,211	2,278	2,346	2,416	2,489	2,563
Percent Change	0.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%
Interest	1,229	1,307	923	1,157	1,395	1,673	1,858	1,733	1,613	1,666
Less Expenditures	75,000	36,229	146,447	0	7,689	0	23,885	97,141	94,429	56,476
Ending Balance	297,224	316,939	227,690	286,811	340,220	403,386	444,698	414,529	388,909	403,310

	2036	2037	2038	2039	2040	2041	2042	2043	2044	2045
Begin Balance	403,310	443,271	473,758	549,512	612,318	695,495	764,966	846,272	568,530	643,337
Contribution	71,288	73,427	75,630	77,898	80,235	82,643	85,122	87,675	90,306	93,015
Average Per Unit	2,640	2,720	2,801	2,885	2,972	3,061	3,153	3,247	3,345	3,445
Percent Change	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%
Interest	1,836	1,970	2,297	2,577	2,942	3,251	3,609	2,424	2,689	2,842
Less Expenditures	33,163	44,910	2,174	17,669	0	16,423	7,425	367,842	18,187	62,121
Ending Balance	443,271	473,758	549,512	612,318	695,495	764,966	846,272	568,530	643,337	677,073

	2046	2047	2048	2049	2050	2051	2052	2053	2054	2055
Begin Balance	677,073	571,704	597,438	665,273	753,611	843,031	934,709	1,037,362	1,141,751	574,159
Contribution	95,805	98,679	101,640	104,689	107,830	111,065	114,396	117,828	121,363	125,004
Average Per Unit	3,548	3,655	3,764	3,877	3,994	4,114	4,237	4,364	4,495	4,630
Percent Change	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%
Interest	2,389	2,474	2,765	3,152	3,546	3,951	4,403	4,864	2,434	2,538
Less Expenditures	203,564	75,420	36,570	19,503	21,956	23,338	16,146	18,303	691,390	77,006
Ending Balance	571,704	597,438	665,273	753,611	843,031	934,709	1,037,362	1,141,751	574,159	624,694

RESERVE STUDY PARAMETERS

The following data (provided by the Association) forms the basis for the funding model inputs.

Level of Service:	Level 2 (Reserve Study Update – With Site Visit)	Description:	Reserve Study includes Component Inventory, Life and Valuation Estimates, Fund Status & Funding Plan
Fiscal Year Start:	January 1, 2026	Fiscal Year End:	December 31, 2026
Model Interest Rate:	0.45 %	Inflation Rate:	2.15 %
FY2026 Estimated Reserve Fund Beginning Balance:	\$ 317,949.90	FY2025 Reserve Fund Contribution:	\$ 51,500
Funding Parameters:	Maintain positive thresholds	Number of Units:	25 Residential 2 Commercial
Property Occupancy Type:	Condominiums	Date of Original Construction:	1921, with the loft addition/renovation occurring in 1998
General Description of Property: - The Property consists of a single six (6) story building with no basement. The building is of concrete and wood frame construction. - Exterior wall assemblies are a mixture of fiber cement panel siding, stucco/EIFS, and corrugated steel panels. - The roof is a built-up roof membrane with limited areas of asphalt shingles. A fluid applied membrane has been applied to the built-up roofing in 2023. - Balconies are a mix of metal balconies on floors 2 and 3, and waterproof pedestrian coated balconies on floors 4 and 6.			

NOTE REGARDING INFLATION


Unprecedented inflation levels over the last fiscal year have proven problematic regarding future inflation models. Future costs have been projected at a historically stable 2.15% annual rate of inflation, however, annual inflation in the near term may prove to be higher.

While Forensic always recommends annual reserve study updates, it is even more important in the coming years to perform annual reserve study updates to accurately account for inflation and maintain a healthy reserve fund status.

PROPERTY SITE OVERVIEW

SATELLITE IMAGE

The aerial image below, obtained from Google Maps, illustrates the overall site conditions at the Property. Note that this image is orientated with “North” corresponding with the top of the page.

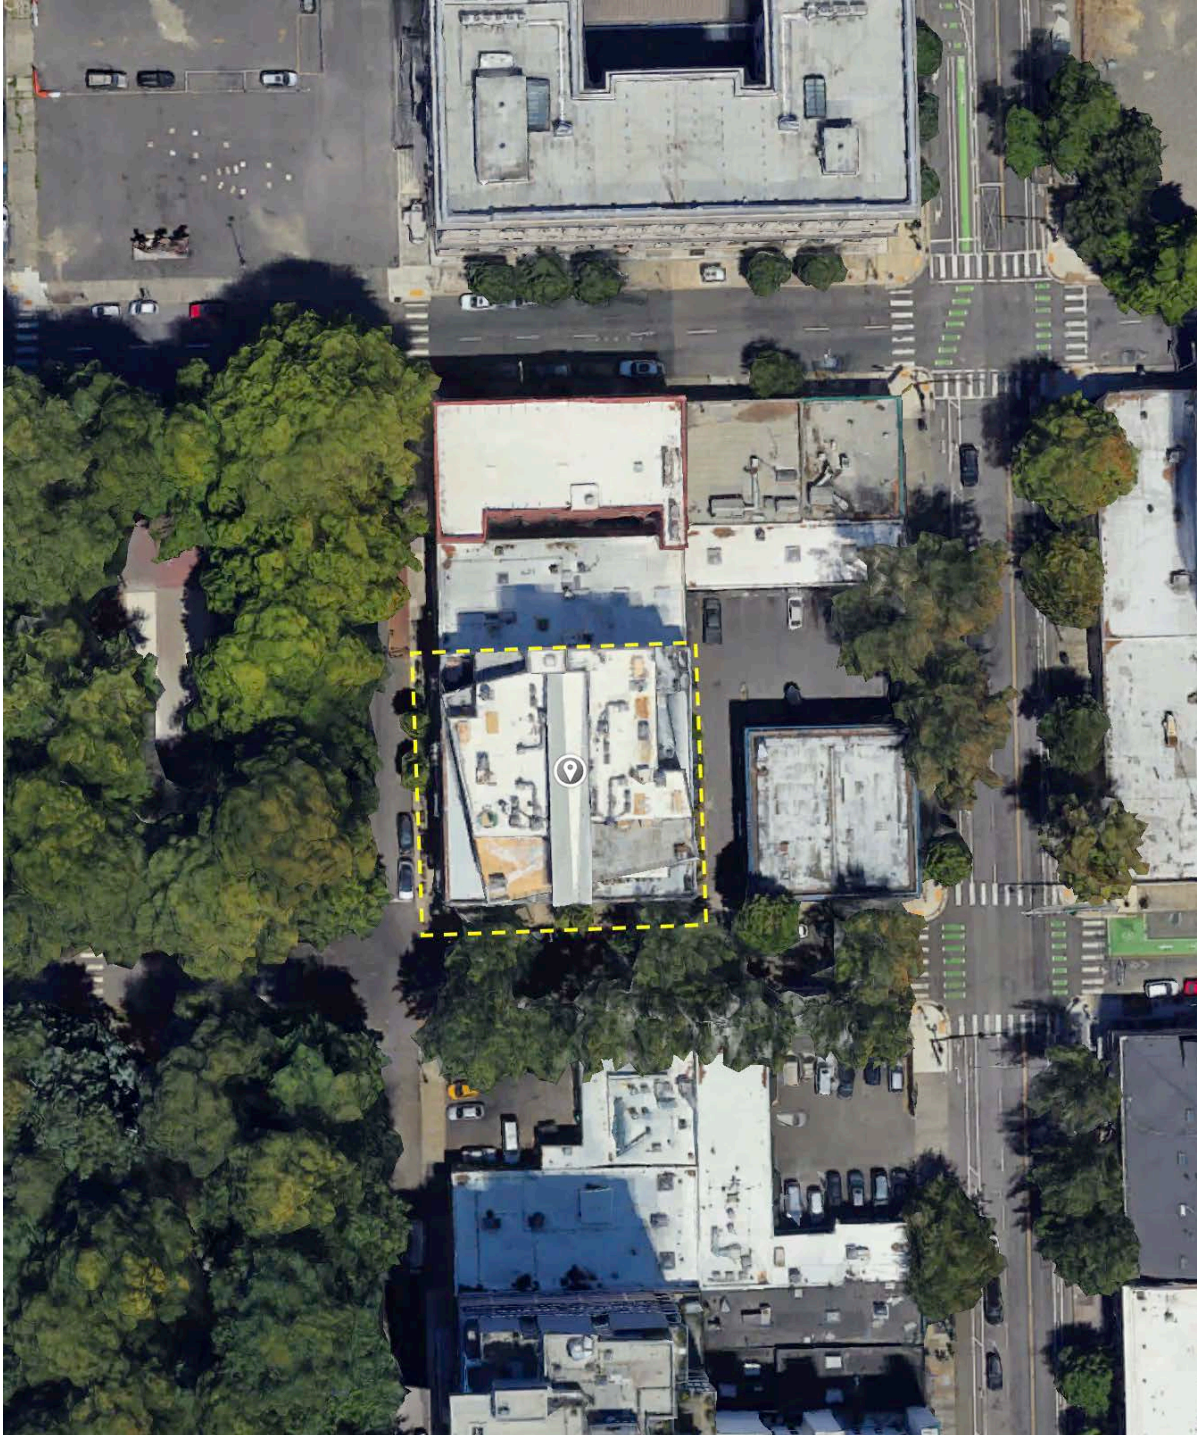

BUILDING ELEVATION PHOTOGRAPHS



South Elevation



South-West Elevation



West Elevation



East Elevation

RESERVE STUDY EXCLUSIONS

EXPLANATORY NOTES

The following components and systems have been excluded from this Reserve Study. Any pricing and component information for these systems contained within this report was provided by the Association, was included only for budgeting purposes, and has not been independently assessed or verified by Forensic:

- Site Utilities
- Foundation and Concealed Structural Components
- Mechanical and HVAC Systems
- Low-Voltage Electrical Systems
- Emergency Power Systems
- Plumbing Systems
- Fire Detection and Alarm Systems
- Fire Suppression Systems
- Electrical Systems
- Accessibility Items

These systems (where they exist) will likely require periodic renewal and replacement during the next 30 years. However, the condition assessment and verification of replacement costs of these systems are beyond the scope of this Reserve Study.

It is recommended that the Association and their Community Management firm have these systems evaluated by qualified professionals prior to inclusion in future Reserve Studies for the Property.

COMPONENT INVENTORY

EXPLANATORY NOTES

To compile the 30-year funding forecast, this reserve study estimates the expected useful life (EUL) and remaining useful life (RUL) of the various building components and systems (components) included within the scope of the study and provides estimated replacement or renewal costs for those components.

Each common element component is identified as being primarily in one of four categories, and an appropriate modification to the components' remaining useful life (RUL) was made for each, based on the actual condition and nature of the component

Interior Component (Aesthetic):	Maximum 100% extension of expected useful life (EUL)	Exterior Component (Aesthetic):	Maximum 50% extension of expected useful life (EUL)
Interior Component (Performance):	Maximum 50% extension of expected useful life (EUL)	Exterior Component (Performance):	Maximum 25% extension of expected useful life (EUL)

Note that the component inventory tables on the following pages incorporate the abbreviations and terminology listed below:

- **Replace Date** – First anticipated replacement date for a given component, based upon RUL
- **Basis Cost** – The cost of a given component per unit of measurement
- **Quantity** – Quantity of a given component with unit of measurement
- **Current Cost** – Current cost of replacement for a given component
- **Adj Life** – Adjusted expected useful life of given component
- **Rem Life (RUL)** – Remaining useful life of given component
- **Future Cost** – Future cost of replacement for a given component based on replacement date and inflation

COMPONENT LIST – SUMMARY

Components Component	Replace Date	Basis Cost	Quantity	Current Cost	Adj Life	Rem Life	Future Cost
Building Components							
Building Envelope Sealing	01/01/2027	\$ 18,295.32	1 Total	\$ 18,295	29:00	1:00	\$ 18,693
				18,295			18,693
Contingency							
Insurance - Deductible	01/01/2026	\$ 25,000.00	1 Total	\$ 25,000	1:00	0:00	\$ 25,000
				25,000			25,000
Decks and Railings							
Balconies - Steel - Refurbish	01/01/2043	\$ 476.94	16 Ea	\$ 7,631	20:00	17:00	\$ 10,995
Decks - 4th Floor - Waterproof Coating	01/01/2043	16.43	1,846 SF	30,330	20:00	17:00	43,698
Decks - 6th Floor - Waterproof Coating	01/01/2043	16.43	3,110 SF	51,097	20:00	17:00	73,619
Decks - Railings - Repair	01/01/2034	5,299.34	1 Total	5,299	36:00	8:00	6,293
				94,357			134,605
Doors and Windows							
Door - Lobby - Replacement	01/01/2032	\$ 1,679.93	1 Total	\$ 1,680	34:00	6:00	\$ 1,911
Doors - Common Area - Exterior - Repla	01/01/2043	1,594.45	6 Ea	9,567	45:00	17:00	13,783
Doors - Common Area - Interior - Replac	01/01/2047	698.80	18 Ea	12,578	49:00	21:00	19,748
Doors - Panic Bars - Replacement	01/01/2032	494.83	12 Ea	5,938	34:00	6:00	6,755
Windows - Lobby Area - Replacement	01/01/2032	10,079.58	1 Total	10,080	34:00	6:00	11,466
				39,843			53,664
Equipment							
Elevator - Upgrade	01/01/2028	\$ 118,993.95	1 Total	\$ 118,994	37:00	2:00	\$ 124,218
Elevator Cab - Refurbish	01/01/2036	13,111.65	1 Total	13,112	37:00	10:00	16,254
Parking Garage - Overhead Door - Repla	01/01/2035	5,244.66	1 Total	5,245	31:00	9:00	6,363
Parking Garage - Overhead Door Lifter -	01/01/2039	13,364.00	1 Total	13,364	15:00	13:00	17,669
Stairway - Pressurization System - Repla	01/01/2046	82,470.98	1 Allow	82,471	25:00	20:00	126,730
				233,185			291,234
Fencing/Security							
Security Camera System - Repairs	01/01/2033	\$ 11,899.39	1 Total	\$ 11,899	8:00	7:00	\$ 13,830
Security System - Call Box - Replacemen	01/01/2036	13,640.71	1 Total	13,641	15:00	10:00	16,909
				25,540			30,740
Fire Suppression Systems							
Fire Alarm - Annunciation Panel - Replac	01/01/2042	\$ 1,966.73	1 Total	\$ 1,967	20:00	16:00	\$ 2,773
Fire Detection System - Replacement	01/01/2026	50,000.00	1 Allow	50,000	27:00	0:00	50,000
Fire Suppression / Wet Sprinkler: Repair	01/01/2035	15,420.00	1 Allow	15,420	10:00	9:00	18,709
				67,387			71,482
Gutters and Downspouts							
Gutters & Downspouts - Replacement	01/01/2048	\$ 2,822.29	1 Total	\$ 2,822	25:00	22:00	\$ 4,527
				2,822			4,527

COMPONENT LIST – SUMMARY

Components Component	Replace Date	Basis Cost	Quantity	Current Cost	Adj Life	Rem Life	Future Cost
Inspections							
Building Envelope Inspection	01/01/2027	\$ 3,298.84	1 Total	\$ 3,299	15:00	1:00	\$ 3,370
				3,299			3,370
Interior Furnishings							
Flooring - Replacement	01/01/2035	\$ 4.88	2,550 SF	\$ 12,444	10:00	9:00	\$ 15,098
				12,444			15,098
Lighting							
Lights - Stairwell LED	01/01/2028	\$ 164.94	8 Ea	\$ 1,320	30:00	2:00	\$ 1,377
				1,320			1,377
Mailboxes							
Mailboxes - Replacement	01/01/2054	\$ 1,677.25	1 Total	\$ 1,677	55:00	28:00	\$ 3,061
				1,677			3,061
Painting							
Exterior - Painting	01/01/2027	\$ 5.36	6,000 SF	\$ 32,160	22:00	1:00	\$ 32,858
Interior - Painting	01/01/2035	13,439.43	1 Total	13,439	10:00	9:00	16,306
Parking Garage - Painting	01/01/2030	7,055.70	1 Total	7,056	21:00	4:00	7,689
Parking Garage - Restripe	01/01/2028	1,679.93	1 Total	1,680	23:00	2:00	1,754
				54,335			58,607
Roofing							
Roof - 3 Tab Composition - Replacemen	01/01/2053	\$ 7.14	1,200 SF	\$ 8,568	30:00	27:00	\$ 15,302
Roof - Built-up With Mineral Cap - Repla	01/01/2043	2,066.74	75 Square	155,006	20:00	17:00	223,326
Roof - Silicone Coating - Refresh	01/01/2033	70,000.00	1 Lsum	70,000	10:00	7:00	81,358
				233,574			319,987
Siding							
Siding - Composite Panels - Replacemen	01/01/2054	\$ 19.25	18,000 SF	\$ 346,500	50:00	28:00	\$ 632,287
Siding - Corrugated Metal - Replacemen	01/01/2054	12.37	974 SF	12,048	50:00	28:00	21,986
Siding - Stucco/EIFS - Replacement	01/01/2034	12.37	6,000 SF	74,220	30:00	8:00	88,136
				432,768			742,409
				1,245,846			1,773,853

EXPENDITURES – ANNUAL LIST

Date	Component	Code	Service Date	Estimated Life	Expenditure
Year : 2026					
01/01/2026	Fire Detection System - Replacement	910-000-0020	01/01/1999	27:00	\$ 50,000.00
01/01/2026	Insurance - Deductible	910-000-0023		1:00	25,000.00
					75,000.00
Year : 2027					
01/01/2027	Building Envelope Inspection	910-000-0003	01/01/2012	15:00	\$ 3,370.47
01/01/2027	Building Envelope Sealing	910-000-0004	01/01/1998	29:00	18,692.57
01/01/2027	Exterior - Painting	910-000-0018	01/01/2005	22:00	32,858.29
					54,921.33
Year : 2028					
01/01/2028	Elevator - Upgrade	910-000-0016	01/01/1991	37:00	\$ 124,217.51
01/01/2028	Lights - Stairwell LED	910-000-0025		30:00	1,377.44
01/01/2028	Parking Garage - Restripe	910-000-0039	01/01/2005	23:00	1,753.68
					127,348.63
Year : 2030					
01/01/2030	Parking Garage - Painting	910-000-0038	01/01/2009	21:00	\$ 7,688.75
					7,688.75
Year : 2032					
01/01/2032	Building Envelope Inspection	910-000-0003	01/01/2027	5:00	\$ 3,752.62
01/01/2032	Door - Lobby - Replacement	910-000-0010	01/01/1998	34:00	1,911.02
01/01/2032	Doors - Panic Bars - Replacement	910-000-0015	01/01/1998	34:00	6,754.78
01/01/2032	Windows - Lobby Area - Replacement	910-000-0054	01/01/1998	34:00	11,466.12
					23,884.54
Year : 2033					
01/01/2033	Parking Garage - Restripe	910-000-0039	01/01/2028	5:00	\$ 1,952.51
01/01/2033	Roof - Silicone Coating - Refresh	910-000-0056		10:00	81,358.11
01/01/2033	Security Camera System - Repairs	910-000-0048	01/01/2025	8:00	13,830.17
					97,140.79
Year : 2034					
01/01/2034	Decks - Railings - Repair	910-000-0009	01/01/1998	36:00	\$ 6,292.94
01/01/2034	Siding - Stucco/EIFS - Replacement	910-000-0052	01/01/2004	30:00	88,135.88
					94,428.82

EXPENDITURES – ANNUAL LIST

Date	Component	Code	Service Date	Estimated Life	Expenditure
Year : 2035					
01/01/2035	Fire Suppression / Wet Sprinkler: Repairs	910-000-0055	01/01/2025	10:00	\$ 18,708.77
01/01/2035	Flooring - Replacement	910-000-0021	01/01/2025	10:00	15,098.05
01/01/2035	Interior - Painting	910-000-0024	01/01/2025	10:00	16,305.78
01/01/2035	Parking Garage - Overhead Door - Replacem	910-000-0036	01/01/2004	31:00	6,363.24
					56,475.84
Year : 2036					
01/01/2036	Elevator Cab - Refurbish	910-000-0017	01/01/1999	37:00	\$ 16,253.51
01/01/2036	Security System - Call Box - Replacement	910-000-0049	01/01/2021	15:00	16,909.34
					33,162.85
Year : 2037					
01/01/2037	Building Envelope Inspection	910-000-0003	01/01/2032	5:00	\$ 4,178.11
01/01/2037	Exterior - Painting	910-000-0018	01/01/2027	10:00	40,731.91
					44,910.02
Year : 2038					
01/01/2038	Parking Garage - Restripe	910-000-0039	01/01/2033	5:00	\$ 2,173.90
					2,173.90
Year : 2039					
01/01/2039	Parking Garage - Overhead Door Lifter - Rep	910-000-0037	01/01/2024	15:00	\$ 17,669.05
					17,669.05
Year : 2041					
01/01/2041	Security Camera System - Repairs	910-000-0048	01/01/2033	8:00	\$ 16,423.26
					16,423.26
Year : 2042					
01/01/2042	Building Envelope Inspection	910-000-0003	01/01/2037	5:00	\$ 4,651.84
01/01/2042	Fire Alarm - Annunciation Panel - Replacem	910-000-0019	01/01/2022	20:00	2,773.37
					7,425.21
Year : 2043					
01/01/2043	Balconies - Steel - Refurbish	910-000-0001	01/01/2023	20:00	\$ 10,994.52
01/01/2043	Decks - 4th Floor - Waterproof Coating	910-000-0005	01/01/2023	20:00	43,698.03
01/01/2043	Decks - 6th Floor - Waterproof Coating	910-000-0007	01/01/2023	20:00	73,619.11
01/01/2043	Doors - Common Area - Exterior - Replacem	910-000-0013	01/01/1998	45:00	13,783.35
01/01/2043	Parking Garage - Restripe	910-000-0039	01/01/2038	5:00	2,420.38

EXPENDITURES – ANNUAL LIST

Date	Component	Code	Service Date	Estimated Life	Expenditure
01/01/2043	Roof - Built-up With Mineral Cap - Replace	910-000-0043	01/01/2023	20:00	\$ 223,326.22
					367,841.61
Year : 2044					
01/01/2044	Decks - Railings - Repair	910-000-0009	01/01/2034	10:00	\$ 7,800.88
01/01/2044	Parking Garage - Painting	910-000-0038	01/01/2030	14:00	10,386.32
					18,187.20
Year : 2045					
01/01/2045	Fire Suppression / Wet Sprinkler: Repairs	910-000-0055	01/01/2035	10:00	\$ 23,191.83
01/01/2045	Flooring - Replacement	910-000-0021	01/01/2035	10:00	18,715.89
01/01/2045	Interior - Painting	910-000-0024	01/01/2035	10:00	20,213.03
					62,120.75
Year : 2046					
01/01/2046	Fire Detection System - Replacement	910-000-0020	01/01/2026	20:00	\$ 76,833.31
01/01/2046	Stairway - Pressurization System - Replacem	910-000-0047	01/01/2021	25:00	126,730.37
					203,563.68
Year : 2047					
01/01/2047	Building Envelope Inspection	910-000-0003	01/01/2042	5:00	\$ 5,179.28
01/01/2047	Building Envelope Sealing	910-000-0004	01/01/2027	20:00	28,724.24
01/01/2047	Doors - Common Area - Interior - Replacem	910-000-0014	01/01/1998	49:00	19,748.49
01/01/2047	Exterior - Painting	910-000-0018	01/01/2037	10:00	50,492.23
					104,144.24
Year : 2048					
01/01/2048	Gutters & Downspouts - Replacement	910-000-0022	01/01/2023	25:00	\$ 4,527.30
01/01/2048	Parking Garage - Restripe	910-000-0039	01/01/2043	5:00	2,694.81
					7,222.11
Year : 2049					
01/01/2049	Security Camera System - Repairs	910-000-0048	01/01/2041	8:00	\$ 19,502.54
					19,502.54
Year : 2050					
01/01/2050	Elevator Cab - Refurbish	910-000-0017	01/01/2036	14:00	\$ 21,955.98
					21,955.98

EXPENDITURES – ANNUAL LIST

Date	Component	Code	Service Date	Estimated Life	Expenditure
Year : 2051					
01/01/2051	Security System - Call Box - Replacement	910-000-0049	01/01/2036	15:00	\$ 23,337.88
					<u>23,337.88</u>
Year : 2052					
01/01/2052	Building Envelope Inspection	910-000-0003	01/01/2047	5:00	\$ 5,766.53
01/01/2052	Doors - Panic Bars - Replacement	910-000-0015	01/01/2032	20:00	10,379.84
					<u>16,146.37</u>
Year : 2053					
01/01/2053	Parking Garage - Restripe	910-000-0039	01/01/2048	5:00	\$ 3,000.36
01/01/2053	Roof - 3 Tab Composition - Replacement	910-000-0042	01/01/2023	30:00	15,302.48
					<u>18,302.84</u>
Year : 2054					
01/01/2054	Decks - Railings - Repair	910-000-0009	01/01/2044	10:00	\$ 9,670.15
01/01/2054	Mailboxes - Replacement	910-000-0035	01/01/1999	55:00	3,060.62
01/01/2054	Parking Garage - Overhead Door Lifter - Rep	910-000-0037	01/01/2039	15:00	24,386.41
01/01/2054	Siding - Composite Panels - Replacement	910-000-0050	01/01/2004	50:00	632,287.48
01/01/2054	Siding - Corrugated Metal - Replacement	910-000-0051	01/01/2004	50:00	21,985.69
					<u>691,390.35</u>
Year : 2055					
01/01/2055	Fire Suppression / Wet Sprinkler: Repairs	910-000-0055	01/01/2045	10:00	\$ 28,749.13
01/01/2055	Flooring - Replacement	910-000-0021	01/01/2045	10:00	23,200.66
01/01/2055	Interior - Painting	910-000-0024	01/01/2045	10:00	25,056.54
					<u>77,006.33</u>

EXPENDITURES – MATRIX

Category	2026	2027	2028	2029	2030	2031	2032	2033	2034	2035
Building Components										
Building Envelope Sealing		18,693								
	0	18,693	0	0	0	0	0	0	0	0
Contingency										
Insurance - Deductible	25,000									
	25,000	0	0	0	0	0	0	0	0	0
Decks and Railings										
Decks - Railings - Repair									6,293	
	0	0	0	0	0	0	0	0	6,293	0
Doors and Windows										
Door - Lobby - Replacement							1,911			
Doors - Panic Bars - Replacement							6,755			
Windows - Lobby Area - Replacement							11,466			
	0	0	0	0	0	0	20,132	0	0	0
Equipment										
Elevator - Upgrade			124,218							
Parking Garage - Overhead Door - Rep										6,363
	0	0	124,218	0	0	0	0	0	0	6,363
Fencing/Security										
Security Camera System - Repairs								13,830		
	0	0	0	0	0	0	0	13,830	0	0
Fire Suppression Systems										
Fire Detection System - Replacement	50,000									
Fire Suppression / Wet Sprinkler: Rep										18,709
	50,000	0	0	0	0	0	0	0	0	18,709

EXPENDITURES – MATRIX

Category	2026	2027	2028	2029	2030	2031	2032	2033	2034	2035
Inspections										
Building Envelope Inspection		3,370					3,753			
	0	3,370	0	0	0	0	3,753	0	0	0
Interior Furnishings										
Flooring - Replacement										15,098
	0	0	0	0	0	0	0	0	0	15,098
Lighting										
Lights - Stairwell LED			1,377							
	0	0	1,377	0	0	0	0	0	0	0
Painting										
Exterior - Painting		32,858								
Interior - Painting										16,306
Parking Garage - Painting					7,689					
Parking Garage - Restripe			1,754					1,953		
	0	32,858	1,754	0	7,689	0	0	1,953	0	16,306
Roofing										
Roof - Silicone Coating - Refresh								81,358		
	0	0	0	0	0	0	0	81,358	0	0
Siding										
Siding - Stucco/EIFS - Replacement									88,136	
	0	0	0	0	0	0	0	0	88,136	0
	75,000	54,921	127,349	0	7,689	0	23,885	97,141	94,429	56,476

EXPENDITURES – MATRIX

Category	2036	2037	2038	2039	2040	2041	2042	2043	2044	2045
Decks and Railings										
Balconies - Steel - Refurbish								10,995		
Decks - 4th Floor - Waterproof Coatin								43,698		
Decks - 6th Floor - Waterproof Coatin								73,619		
Decks - Railings - Repair									7,801	
	0	0	0	0	0	0	0	128,312	7,801	0
Doors and Windows										
Doors - Common Area - Exterior - Repl								13,783		
	0	0	0	0	0	0	0	13,783	0	0
Equipment										
Elevator Cab - Refurbish	16,254									
Parking Garage - Overhead Door Lifter				17,669						
	16,254	0	0	17,669	0	0	0	0	0	0
Fencing/Security										
Security Camera System - Repairs						16,423				
Security System - Call Box - Replacem	16,909									
	16,909	0	0	0	0	16,423	0	0	0	0
Fire Suppression Systems										
Fire Alarm - Annunciation Panel - Repl							2,773			
Fire Suppression / Wet Sprinkler: Rep										23,192
	0	0	0	0	0	0	2,773	0	0	23,192
Inspections										
Building Envelope Inspection		4,178					4,652			
	0	4,178	0	0	0	0	4,652	0	0	0

EXPENDITURES – MATRIX

Category	2036	2037	2038	2039	2040	2041	2042	2043	2044	2045
Interior Furnishings										
Flooring - Replacement										18,716
	0	0	0	0	0	0	0	0	0	18,716
Painting										
Exterior - Painting		40,732								
Interior - Painting										20,213
Parking Garage - Painting									10,386	
Parking Garage - Restripe			2,174					2,420		
	0	40,732	2,174	0	0	0	0	2,420	10,386	20,213
Roofing										
Roof - Built-up With Mineral Cap - Rep								223,326		
	0	0	0	0	0	0	0	223,326	0	0
	33,163	44,910	2,174	17,669	0	16,423	7,425	367,842	18,187	62,121

EXPENDITURES – MATRIX

Category	2046	2047	2048	2049	2050	2051	2052	2053	2054	2055
Building Components										
Building Envelope Sealing		28,724								
	0	28,724	0	0	0	0	0	0	0	0
Decks and Railings										
Decks - Railings - Repair									9,670	
	0	0	0	0	0	0	0	0	9,670	0
Doors and Windows										
Doors - Common Area - Interior - Repl		19,748								
Doors - Panic Bars - Replacement							10,380			
	0	19,748	0	0	0	0	10,380	0	0	0
Equipment										
Elevator Cab - Refurbish					21,956					
Parking Garage - Overhead Door Lifter									24,386	
Stairway - Pressurization System - Rep	126,730									
	126,730	0	0	0	21,956	0	0	0	24,386	0
Fencing/Security										
Security Camera System - Repairs				19,503						
Security System - Call Box - Replacem						23,338				
	0	0	0	19,503	0	23,338	0	0	0	0
Fire Suppression Systems										
Fire Detection System - Replacement	76,833									
Fire Suppression / Wet Sprinkler: Rep										28,749
	76,833	0	0	0	0	0	0	0	0	28,749
Gutters and Downspouts										
Gutters & Downspouts - Replacement			4,527							
	0	0	4,527	0	0	0	0	0	0	0

EXPENDITURES – MATRIX

Category	2046	2047	2048	2049	2050	2051	2052	2053	2054	2055
Inspections										
Building Envelope Inspection		5,179					5,767			
	0	5,179	0	0	0	0	5,767	0	0	0
Interior Furnishings										
Flooring - Replacement										23,201
	0	0	0	0	0	0	0	0	0	23,201
Mailboxes										
Mailboxes - Replacement									3,061	
	0	0	0	0	0	0	0	0	3,061	0
Painting										
Exterior - Painting		50,492								
Interior - Painting										25,057
Parking Garage - Restripe			2,695					3,000		
	0	50,492	2,695	0	0	0	0	3,000	0	25,057
Roofing										
Roof - 3 Tab Composition - Replaceme								15,302		
	0	0	0	0	0	0	0	15,302	0	0
Siding										
Siding - Composite Panels - Replacem									632,287	
Siding - Corrugated Metal - Replacem									21,986	
	0	0	0	0	0	0	0	0	654,273	0
	203,564	104,144	7,222	19,503	21,956	23,338	16,146	18,303	691,390	77,006

COMPONENT LIST – FULL DETAIL

Building Envelope Sealing

Item Number	4
Type	Common Area
Category	Building Components
Measurement Basis	Total
Estimated Useful Life	20 Years
Basis Cost	\$ 18,295.32
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0004		01/01/1998	01/01/2027	1:00	29:00	1	18,295.32	18,692.57
							18,295.32	18,692.57

Comments

This provision is for the sealing of the building envelope.

Sealant joints were observed by Forensic to be in overall good condition.

Insurance - Deductible

Item Number	23
Type	Common Area
Category	Contingency
Measurement Basis	Total
Estimated Useful Life	1 Year
Basis Cost	\$ 25,000.00
Tracking	Logistical
Method	One Time

Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0023			01/01/2026	0:00	1:00	1	25,000.00	25,000.00
							25,000.00	25,000.00

Comments

This component is for the insurance deductible in the event a claim is made.

Many Associations include the insurance deductible in the reserve study as a component. Generally this amount is \$10,000 but can vary based on insurance coverages.

The insurance deductible component is only included as an expenditure in the first year of the study.

FY2025 Update: Updated the cost from \$5,000 to \$25,000

Balconies - Steel - Refurbish

Item Number	1
Type	Common Area
Category	Decks and Railings
Measurement Basis	Ea
Estimated Useful Life	20 Years
Basis Cost	\$ 476.94
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0001		01/01/2023	01/01/2043	17:00	20:00	16	7,631.04	10,994.52
							7,631.04	10,994.52

Comments


This component funds for minor repairs to the steel balconies, including tightening of fasteners and paint refresh.

The cost and useful life estimates are based on information provided by the Association.

The cost basis a general per balcony allowance.

Decks - 4th Floor - Waterproof Coating

Item Number	5
Type	Common Area
Category	Decks and Railings
Measurement Basis	SF
Estimated Useful Life	20 Years
Basis Cost	\$ 16.43
Tracking	Logistical
Method	Adjusted

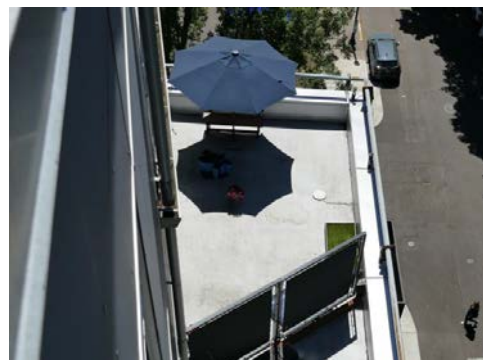

Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0005		01/01/2023	01/01/2043	17:00	20:00	1,846	30,329.78	43,698.03
							30,329.78	43,698.03

Comments

This component funds for the repair/replacement of the waterproof pedestrian coating installed at the 4th floor exterior decks.
The cost and useful life estimates are based on information provided by the Association.

Decks - 6th Floor - Waterproof Coating

Item Number	7
Type	Common Area
Category	Decks and Railings
Measurement Basis	SF
Estimated Useful Life	20 Years
Basis Cost	\$ 16.43
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0007		01/01/2023	01/01/2043	17:00	20:00	3,110	51,097.30	73,619.11
							51,097.30	73,619.11

Comments


This component funds for the replacement of the waterproof pedestrian coating installed at the 6th floor decks.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Decks - Railings - Repair

Item Number	9
Type	Common Area
Category	Decks and Railings
Measurement Basis	Total
Estimated Useful Life	10 Years
Basis Cost	\$ 5,299.34
Tracking	Logistical
Method	Adjusted

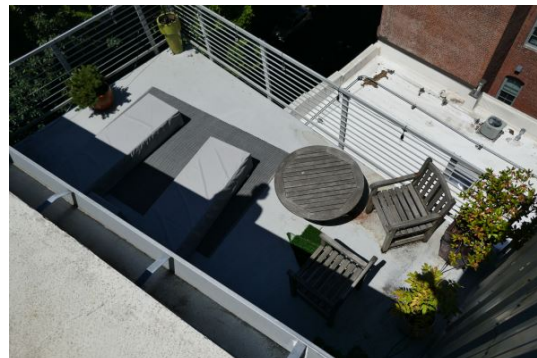

Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0009		01/01/1998	01/01/2034	8:00	36:00	1	5,299.34	6,292.94
							5,299.34	6,292.94

Comments

This component funds for the replacement of the steel railings on the 4th through the 6th floor of the building.

The cost and useful life estimates are based on information provided by the Association.

Door - Lobby - Replacement

Item Number	10
Type	Common Area
Category	Doors and Windows
Measurement Basis	Total
Estimated Useful Life	30 Years
Basis Cost	\$ 1,679.93
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0010		01/01/1998	01/01/2032	6:00	34:00	1	1,679.93	1,911.02
							1,679.93	1,911.02

Comments

This component funds for the replacement of the lobby area door.

The count of 1 lobby area double pane glass and aluminum door is per the prior reserve study.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Doors - Common Area - Exterior - Replacement

Item Number	13
Type	Common Area
Category	Doors and Windows
Measurement Basis	Ea
Estimated Useful Life	30 Years
Basis Cost	\$ 1,594.45
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0013		01/01/1998	01/01/2043	17:00	45:00	6	9,566.70	13,783.35
							9,566.70	13,783.35

Comments

This component funds for the replacement of the common area exterior doors.

The count of 6 exterior doors is per the prior reserve study.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Doors - Common Area - Interior - Replacement

Item Number	14
Type	Common Area
Category	Doors and Windows
Measurement Basis	Ea
Estimated Useful Life	30 Years
Basis Cost	\$ 698.80
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0014		01/01/1998	01/01/2047	21:00	49:00	18	12,578.40	19,748.49
							12,578.40	19,748.49

Comments

This component funds for the replacement of the common area interior doors.

Doors were observed by Forensic to be in good condition and the useful life has been extended.


The count of 18 interior doors is per the prior reserve study.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Doors - Panic Bars - Replacement

Item Number	15
Type	Common Area
Category	Doors and Windows
Measurement Basis	Ea
Estimated Useful Life	20 Years
Basis Cost	\$ 494.83
Tracking	Logistical
Method	Adjusted

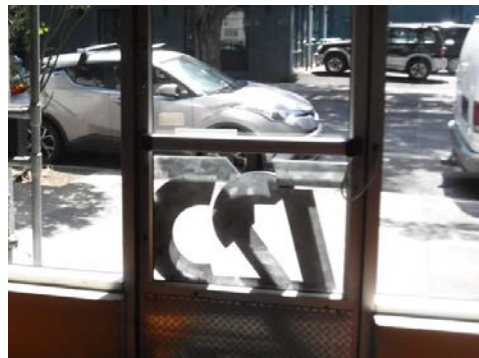

Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0015		01/01/1998	01/01/2032	6:00	34:00	12	5,937.96	6,754.78
							5,937.96	6,754.78

Comments

This component funds for the replacement of the panic bars on the common area doors. Observed to be in good condition and useful life has been extended.

The count of 14 panic bars is per the prior reserve study. Panic bars were added to the lobby entrance door in 2021.

The cost and useful life estimates are based on information provided by the Association. This item has been delayed per the Association.

The Association should obtain a bid to confirm this cost. prior reserve study.

Windows - Lobby Area - Replacement

Item Number	54
Type	Common Area
Category	Doors and Windows
Measurement Basis	Total
Estimated Useful Life	25 Years
Basis Cost	\$ 10,079.58
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0054		01/01/1998	01/01/2032	6:00	34:00	1	10,079.58	11,466.12
							10,079.58	11,466.12

Comments

This component funds for the replacement of the any of the lobby area windows.

According to the Association, \$265.65 of window repairs was completed by O'Merrick, LLC in 2018.

The cost and useful life estimates are based on information provided by the Association.

This item has been delayed per the Association.

The Association should obtain a bid to confirm this cost.

Elevator - Upgrade

Item Number	16
Type	Common Area
Category	Equipment
Measurement Basis	Total
Estimated Useful Life	35 Years
Basis Cost	\$ 118,993.95
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0016		01/01/1991	01/01/2028	2:00	37:00	1	118,993.95	124,217.51
							118,993.95	124,217.51

Comments

This component funds for the modernization of the elevators and includes all mechanical systems, ADA and state standards, phone systems, fire alarm systems, and infra-red alerts.

The cost and useful life estimates are per Eric at Kone Elevators (503) 652-1011 ext. 25.

The Association should obtain a bid to confirm this cost.

Elevator Cab - Refurbish

Item Number	17
Type	Common Area
Category	Equipment
Measurement Basis	Total
Estimated Useful Life	14 Years
Basis Cost	\$ 13,111.65
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0017		01/01/1999	01/01/2036	10:00	37:00	1	13,111.65	16,253.51
							13,111.65	16,253.51

Comments

This component funds for the re-finishing of the floor and walls in the elevator and any other work needed to refurbish to like-new condition, including any painting or ceiling work, and wall and doorway covers (plastic/polycart - polished aluminum) and pads.

The cost and useful life estimates are based on information provided by the Association.

This item has been delayed per the Association.

The Association should obtain a bid to confirm this cost.

Parking Garage - Overhead Door - Replacement

Item Number	36
Type	Common Area
Category	Equipment
Measurement Basis	Total
Estimated Useful Life	25 Years
Basis Cost	\$ 5,244.66
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0036		01/01/2004	01/01/2035	9:00	31:00	1	5,244.66	6,363.24
							5,244.66	6,363.24

Comments

This component funds for the removal and replacement of the 6 panel 10' wide by 12' high perforated panel aluminum door.

FY2025 Update: Association reported replacement of the overhead door springs.

Parking Garage - Overhead Door Lifter - Replacemet

Item Number	37
Type	Common Area
Category	Equipment
Measurement Basis	Total
Estimated Useful Life	15 Years
Basis Cost	\$ 13,364.00
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0037		01/01/2024	01/01/2039	13:00	15:00	1	13,364.00	17,669.05
							13,364.00	17,669.05

Comments

This component funds for the replacement of the door operator.

FY2025 Update: Metro Overhead Door replaced the door operator with a LiftMaster HCTDUL at a total cost of \$12,753.

Stairway - Pressurization System - Replacement

Item Number	47
Type	Common Area
Category	Equipment
Measurement Basis	Allow
Estimated Useful Life	25 Years
Basis Cost	\$ 82,470.98
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0047		01/01/2021	01/01/2046	20:00	25:00	1	82,470.98	126,730.37
							82,470.98	126,730.37

Comments

This component funds for the replacement of the mechanical fan system.
Recently replaced in 2022.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Security Camera System - Repairs

Item Number	48
Type	Common Area
Category	Fencing/Security
Measurement Basis	Total
Estimated Useful Life	8 Years
Basis Cost	\$ 11,899.39
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0048		01/01/2025	01/01/2033	7:00	8:00	1	11,899.39	13,830.17
							11,899.39	13,830.17

Comments

This component funds for an allowance for any work required on the security system.

According to the prior reserve study, 4 new cameras were being added in 2012.

According to the Association, \$9,592 was spent on security camera installations in 2018. This was completed by Metro Overhead Door.

According to the Association, 3 new cameras have been installed in 2021 as part of a security upgrade by Metro Access Control at a cost \$4,462.00.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Security System - Call Box - Replacement

Item Number	49
Type	Common Area
Category	Fencing/Security
Measurement Basis	Total
Estimated Useful Life	15 Years
Basis Cost	\$ 13,640.71
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0049		01/01/2021	01/01/2036	10:00	15:00	1	13,640.71	16,909.34
							13,640.71	16,909.34

Comments

This component funds for the replacement of the security call box system.

According to the Association, the call box and existing card readers were upgraded and card readers were added to the lobby/stairwell door, elevator, and SW garage pedestrian door in 2021 as part of a security upgrade. The work was performed by Metro Access Control.

The cost and useful life estimates are based on information provided by the Association.

Fire Alarm - Annunciation Panel - Replacement

Item Number	19
Type	Common Area
Category	Fire Suppression Systems
Measurement Basis	Total
Estimated Useful Life	20 Years
Basis Cost	\$ 1,966.73
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0019		01/01/2022	01/01/2042	16:00	20:00	1	1,966.73	2,773.37
							1,966.73	2,773.37

Comments

This component funds for the replacement of the fire alarm annunciation panel.

The cost and useful life estimates are per Steve Barry with Action Technology.

This item has been delayed per the Association.

The Association should obtain a bid to confirm this cost.

Fire Detection System - Replacement

Item Number	20
Type	Common Area
Category	Fire Suppression Systems
Measurement Basis	Allow
Estimated Useful Life	20 Years
Basis Cost	\$ 50,000.00
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0020		01/01/1999	01/01/2026	0:00	27:00	1	50,000.00	50,000.00
							50,000.00	50,000.00

Comments

This component funds for the replacement of the fire detection system.

The Association should obtain a bid to confirm this cost.

FY2025 Update: Deferred from 2024 to 2025.

FY2026 Update: Cost updated from onsite conversation with Association representatives and moved to 2026.

Fire Suppression / Wet Sprinkler: Repairs

Item Number	55
Type	Common Area
Category	Fire Suppression Systems
Measurement Basis	Allow
Estimated Useful Life	10 Years
Basis Cost	\$ 15,420.00
Tracking	Logistical
Method	Adjusted

Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0055		01/01/2025	01/01/2035	9:00	10:00	1	15,420.00	18,708.77
							15,420.00	18,708.77

Comments

Funding for periodic major repairs to the existing wet sprinkler fire suppression systems.

The Association reported \$15,000 repairs in 2025. This report assumes similar expenses every 10 years.

Gutters & Downspouts - Replacement

Item Number	22
Type	Common Area
Category	Gutters and Downspouts
Measurement Basis	Total
Estimated Useful Life	25 Years
Basis Cost	\$ 2,822.29
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0022		01/01/2023	01/01/2048	22:00	25:00	1	2,822.29	4,527.30
							2,822.29	4,527.30

Comments

This component funds for the replacement of the gutters and downspouts on the penthouse portion of the building and decks. Replaced in 2023 as part of the roof membrane installation.

The cost and useful life estimates are based on information provided by the Association.

This item has been delayed per the Association.

The Association should obtain a bid to confirm this cost.

Building Envelope Inspection

Item Number	3
Type	Common Area
Category	Inspections
Measurement Basis	Total
Estimated Useful Life	5 Years
Basis Cost	\$ 3,298.84
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0003		01/01/2012	01/01/2027	1:00	15:00	1	3,298.84	3,370.47
							3,298.84	3,370.47

Comments

This provision is for a building envelope inspection. Generally, the life of the building envelope is greater than 30 years. We recommend the Association perform an inspection to determine the current condition of the system. Once the condition is known the reserve study should be updated.

Industry specialists recommend a building envelope inspection every 3-5 years.

Flooring - Replacement

Item Number	21
Type	Common Area
Category	Interior Furnishings
Measurement Basis	SF
Estimated Useful Life	10 Years
Basis Cost	\$ 4.88
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0021		01/01/2025	01/01/2035	9:00	10:00	2,550	12,444.00	15,098.05
							12,444.00	15,098.05

Comments

This component funds for the replacement of the carpet flooring on the second and third floors. Replaced in 2023.

Previous reserve study estimated 2,550 square feet of carpeting.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Lights - Stairwell LED

Item Number	25
Type	Common Area
Category	Lighting
Measurement Basis	Ea
Estimated Useful Life	30 Years
Basis Cost	\$ 164.94
Tracking	Logistical
Method	One Time

Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0025			01/01/2028	2:00	30:00	8	1,319.52	1,377.44
							1,319.52	1,377.44

Comments

Funding for replacement of the center stairwell fluorescent light fixtures with 8' LED lighting.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Mailboxes - Replacement

Item Number	35
Type	Common Area
Category	Mailboxes
Measurement Basis	Total
Estimated Useful Life	30 Years
Basis Cost	\$ 1,677.25
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0035		01/01/1999	01/01/2054	28:00	55:00	1	1,677.25	3,060.62
							1,677.25	3,060.62

Comments

This component funds for the replacement of the mailboxes in the lobby area.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Exterior - Painting

Item Number	18
Type	Common Area
Category	Painting
Measurement Basis	SF
Estimated Useful Life	10 Years
Basis Cost	\$ 5.36
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0018		01/01/2005	01/01/2027	1:00	22:00	6,000	32,160.00	32,858.29
							32,160.00	32,858.29

Comments

Painting includes all siding, railings, stairways, decks, flashings and exposed areas, including but not limited to stucco surfaces.

According to the prior reserve study, the cost is based on an allocation of total interior and exterior painting costs of \$34,000.

In 2018, the Association spent \$1,123.50 on building exterior painting. This was done by O'Merrick, LLC.

The useful life estimates are based on information provided by the Association.

The cost is based on a per square foot estimate from a local vendor.

The Association should obtain a bid to confirm this cost.

Interior - Painting

Item Number	24
Type	Common Area
Category	Painting
Measurement Basis	Total
Estimated Useful Life	10 Years
Basis Cost	\$ 13,439.43
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0024		01/01/2025	01/01/2035	9:00	10:00	1	13,439.43	16,305.78
							13,439.43	16,305.78

Comments

This component funds for the painting of the common area rooms, hall, lobby, and stairwell.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

FY2026 Update: During on site update, it was reported that the 2nd and 3rd floor interior hallway and carpet will be replaced prior to the beginning of FY2026.

Parking Garage - Painting

Item Number	38
Type	Common Area
Category	Painting
Measurement Basis	Total
Estimated Useful Life	14 Years
Basis Cost	\$ 7,055.70
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0038		01/01/2009	01/01/2030	4:00	21:00	1	7,055.70	7,688.75
							7,055.70	7,688.75

Comments

This component funds for the painting of the garage interior, including the janitorial room.

The cost and useful life estimates are based on information provided by the Association.

This item has been delayed per the Association.

The Association should obtain a bid to confirm this cost.

Parking Garage - Restripe

Item Number	39
Type	Common Area
Category	Painting
Measurement Basis	Total
Estimated Useful Life	5 Years
Basis Cost	\$ 1,679.93
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0039		01/01/2005	01/01/2028	2:00	23:00	1	1,679.93	1,753.68
							1,679.93	1,753.68

Comments

This component funds of the maintenance and restriping of the garage area.

The cost and useful life estimates are based on information provided by the Association.

This item has been delayed per the Association.

The Association should obtain a bid to confirm this cost.

Roof - 3 Tab Composition - Replacement

Item Number	42
Type	Common Area
Category	Roofing
Measurement Basis	SF
Estimated Useful Life	30 Years
Basis Cost	\$ 7.14
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0042		01/01/2023	01/01/2053	27:00	30:00	1,200	8,568.00	15,302.48
							8,568.00	15,302.48

Comments

This component funds for the replacement of the 3 tab asphalt composition roofing. Replaced in 2023.

According to the prior reserve study, there is 1,200 square feet of 3 tab roofing.

Replaced in FY2023 with Owens Corning 50 Year Shingles for \$7,800

The cost and useful life estimates are based on information provided by the Association.

This item has been delayed per the Association.

The Association should obtain a bid to confirm this cost.

Roof - Built-up With Mineral Cap - Replacement

Item Number	43
Type	Common Area
Category	Roofing
Measurement Basis	Square
Estimated Useful Life	20 Years
Basis Cost	\$ 2,066.74
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0043		01/01/2023	01/01/2043	17:00	20:00	75	155,005.50	223,326.22
							155,005.50	223,326.22

Comments

This component funds for the replacement of the existing roofing to the decking, repairs to decking and correction of pooling as needed, and installation of three ply built-up with mineral cap, together with perimeter and penetration flashing.

A silicone liquid applied membrane was installed in 2023 at the cost of \$61,200 to extend the life of the existing roofing.

It was noted in the prior study that the roof was damaged at HVAC pads when new equipment was installed (with possible water penetration issues). Also noted was that the roof was repaired by Snyder Roofing, including selected field repair, perimeter flashing, and gutters and downspouts.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Roof - Silicone Coating - Refresh

Item Number	56
Type	Common Area
Category	Roofing
Measurement Basis	Lsum
Estimated Useful Life	10 Years
Basis Cost	\$ 70,000.00
Tracking	Logistical
Method	One Time



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0056			01/01/2033	7:00	10:00	1	70,000.00	81,358.11
							70,000.00	81,358.11

Comments

Funding for refresh/application of the silicone coating/membrane applied to extend the life of the existing built up roofing.

This was applied in 2023 and the Association is intending to refresh the coating after 10 years to hopefully extend the life of the built up roofing for a total of 20 years.

Siding - Composite Panels - Replacement

Item Number	50
Type	Common Area
Category	Siding
Measurement Basis	SF
Estimated Useful Life	50 Years
Basis Cost	\$ 19.25
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0050		01/01/2004	01/01/2054	28:00	50:00	18,000	346,500.00	632,287.48
							346,500.00	632,287.48

Comments

This component funds for the replacement of the composite siding of the penthouse portion of the building and includes hauling away of debris.

According to the prior reserve study, there is 18,000 square feet of siding panels.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Siding - Corrugated Metal - Replacement

Item Number	51
Type	Common Area
Category	Siding
Measurement Basis	SF
Estimated Useful Life	50 Years
Basis Cost	\$ 12.37
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0051		01/01/2004	01/01/2054	28:00	50:00	974	12,048.38	21,985.69
							12,048.38	21,985.69

Comments

This component funds for the replacement of the corrugated siding at the penthouse portion of the building.

According to the prior reserve study, there is 974 square feet of corrugated metal.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

Siding - Stucco/EIFS - Replacement

Item Number	52
Type	Common Area
Category	Siding
Measurement Basis	SF
Estimated Useful Life	30 Years
Basis Cost	\$ 12.37
Tracking	Logistical
Method	Adjusted



Code	Desc.	Service Date	Replace Date	Rem Life	Adj Life	Quantity	Current Cost	Future Cost
910-000-0052		01/01/2004	01/01/2034	8:00	30:00	6,000	74,220.00	88,135.88
							74,220.00	88,135.88

Comments

This component funds for the replacement of the stucco siding at the 4th floor (breezeway) and under the windows on the ground level of the building and includes hauling away of debris.

This item was observed to be in good condition by Forensic.

According to the prior reserve study, there is 6,000 square feet of stucco siding.

The cost and useful life estimates are based on information provided by the Association.

The Association should obtain a bid to confirm this cost.

APPENDIX A

MAINTENANCE SCHEDULE

MAINTENANCE SCHEDULE

The following recommendations are intended to provide general guidelines for the Association and individual Unit Owners to follow regarding the maintenance and preservation of their property. Recommendations for maintenance of any component that is not the responsibility of the Association are provided here as a courtesy for the individual owners to assist in maintenance of their Unit; they are not intended to imply any responsibility by the Association. Owners are encouraged to refer to the Association's declarations and bylaws if there is any question of responsibility for any individual components.

These recommendations are based on industry standard best practices, refined by Forensic experience.

Each component is unique, and is subject to unique conditions, which may require an accelerated maintenance, renewal, or replacement schedule. The Association should inspect and replace these components as needed.

The Association should contact their community manager and/or maintenance manager if they discover or believe there to be water leakage or premature deterioration of a component or assembly.

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
BUILDING APPURTENANCES		
Decks and Railings	Inspect for debris build-up and organic growth. Debris retains moisture, which accelerates decay and water damage, and buildup hides repair needs. Clean deck and railing surfaces appropriate	Semi-annually (spring and fall)
Deck Surfaces	Deck surfaces should be inspected after cleaning. On waterproof deck coatings, look for peeling or worn areas. Deck coatings often require maintenance every few years to maintain their effectiveness. On wood surfaces, look for deteriorated finish coat and decay. On concrete, look for cracks and erosion.	Annually (spring)
Deck Framing	Deck framing should be inspected for decay, particularly under treads, at bases in contact with the ground, and other areas where moisture can accumulate. Older buildings often have framing that would not meet modern standards, so maintaining existing components can save expensive replacements which must meet modern building codes.	Bi-Annually (spring)
Decks and Railings	Inspect for loose, missing, or cracked components, decay, and trip hazards. Note that older railings are unlikely to meet modern standards for safe height and infill spacing, so maintenance is even more important.	Annually (spring)
Metal Railings	Inspect metal components for rust or paint failure. Clean rust and loose material from metal using wire brush, dust cloth, and vacuum. Refinishing is generally needed periodically to prevent corrosion, particularly in wetter climates. A qualified contractor should be retained to refinish railings properly for anything more than minor repairs and touchups.	Annually (spring)

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
EXTERIOR SEALANTS AND FINISHES		
Exterior Finish Paint	Inspect for cracking, peeling, blistering, or other evidence of paint failure. Prep and clean loose material from wall surface using a dust cloth and vacuum. Apply compatible touch-up paint to entire wall surface in between architectural breaks (corner to corner or joint to joint). Spray and back-roll paint using a low-pressure sprayer (30-50 psi) with a 50° fan-shaped tip. Brush trims, edges, and protruding surfaces. Always test an inconspicuous surface first to confirm color matching of new finishes to existing finishes. Protect adjacent building components and landscaping that may be damaged by paint overspray.	Annually (fall)
Exterior Sealant Joints	At all windows, doors, garage doors, decks, balconies, railings, scuppers, wall penetrations, siding to trim junctions, and other building exterior dynamic and static sealant joints: Inspect for sealant failure (open voids) or degradation (“chalking” or cracking). Re-seal “pinhole” sealant failure areas with compatible sealant materials.	Semi-annually (spring and fall)
Exterior Sealant Joints	At more extensive areas of sealant failure or degradation, remove existing sealant and clean debris and loose material from joint using a wire brush, dust cloth, and vacuum. Install new sealant that is compatible with adjacent materials (Sonolastic 750 VLM by Sonneborn is recommended). Sealant joints should be dimensioned, installed, and tooled per ASTM C1193 specifications. Dynamic sealant joints featuring a closed-cell backer rod should be installed between dissimilar materials per ASTM E2112 specifications. Despite industry standards and manufacturer instructions, contractors frequently fail to properly dimension and construct dynamic sealant joints, which often leads to premature adhesion failure which can allow water infiltration. Regularly monitor sealant repair areas for recurrence of failure, degradation, or staining.	
Exterior Sealant Joints (temporary)	Remove and replace temporary sealant joint applications (installed during winter) as necessary.	Annually (spring)

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
Fluid-Applied Traffic Coatings	Inspect for cracking, peeling, blistering, or other evidence of failure. Consult and follow manufacturer instructions for inspection and maintenance schedules. Warranties often depend on adhering to the reapplication schedule.	Annually (fall)
EXTERIOR WALLS		
Electrical Outlets	Inspect for damaged covers and loose receptacles.. Test ground fault circuit interrupters and reset.	Semi-annually (spring and fall)
Exterior Lighting Fixtures	Inspect for operability and electrical shorts. Replace lamps as necessary.	Semi-annually (summer and winter)
Wall Penetrations	Inspect wall penetration seals and gaskets for cracks or damage and repair or replace as needed. For any repair involving electrical connections, a licensed electrician should be used.	Semi-annually (spring and fall)
Exterior Walls (General)	Inspect exterior wall surfaces for organic growth or graffiti. Clean wall surfaces as necessary with a compatible granulated soap/mild detergent applied using a low-pressure sprayer (30-50 psi) with a 50° fan-shaped tip. Never use muriatic acid or petroleum-based cleaners or solvents. Scrub problematic wall surfaces vigorously with a stiff bristle brush (do not use a wire brush) and rinse thoroughly using a garden hose or low-pressure sprayer (200-300 psi) with a 25° - 50° fan-shaped tip. Do not allow cleaning solution to dry on building components. Always test an inconspicuous surface first to confirm the effect that scrubbing and application of cleaning solution will have on various building components. Protect adjacent building components and landscaping that may be damaged by cleaning solution.	Semi-annually (spring and fall)
Exterior Wall Surfaces	Inspect exterior wall surfaces for damaged, loose, or missing components, decay, storm damage, or other weather-resistance deficiencies.	Semi-annually (spring and fall)
Finish coats	Finish coat maintenance is important to preserving the weather – resistance and value of exterior surfaces. Repainting of exterior walls should be scheduled to occur after exterior cleaning and repairs and after maintenance of sealants.	

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
Interior Surfaces	Inspect accessible interior surfaces for microbial growth, moisture staining, or evidence of water leakage to the interior. Regularly monitor locations that exhibit wetness/dampness, color differences, swelling/warping, blistering/cracking, abnormal odors, or failure of previous repairs.	Semi-annually (spring and fall)
Building Enclosure Condition Assessment	Have a building enclosure condition assessment conducted to identify problems and develop solutions.	Bi-annually
Animals	Inspect exterior wall surfaces for presence of bird or insect nests.	Semi-annually (spring and fall)
Foundations	Inspect for cracking, spalling, settlement, or damage caused by salt/de-icing chemicals. Patch or repair as necessary, following American Concrete Institute (ACI) concrete repair protocol. Regularly monitor concrete repair areas for recurrence of cracking or spalling. Ensure all crawlspace vents are kept open all year-round.	Annually (spring)
Hose Bibs	Inspect all vent screens for openings that could allow rodent access and repair as needed. Disconnect hoses and drain hose bibs when not in use and prior to winter weather. Winterize hose bibs as necessary in advance of freezing temperatures.	Annually (fall)

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
FENESTRATION UNITS		
Windows and Doors (General)	Inspect weather stripping for continuity and air leakage. Replace if worn.	Annually (fall)
Glazing	Inspect for missing, cracked, or broken glazing components, or other damage to window or door unit, including evidence of forced entry. Have repairs done by qualified contractor.	Annually (fall)
Hardware	Inspect window and door hardware for operability and closer adjustment. Lubricate operable window and door hinges.	Annually (spring)
Interior Surfaces	Inspect interior surfaces for microbial growth, moisture staining, or evidence of water leakage to the interior.	Semi-annually (spring and fall)
Exterior Surfaces	Clean exterior surfaces with compatible cleaning solution.	Semi-annually (spring and fall)
Window Screens	Repair holes in window screens and wash screens with compatible cleaning solution.	Annually (spring)

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
ROOFS		
Exhaust Vents	Inspect for proper operation of dampers or louvers, blockage by debris, or evidence of birds/rodents. Clean exhaust vents and screens as necessary.	Monthly
Gutters and Downspouts	Inspect for debris build-up and organic growth. Clean gutters and downspouts as necessary.	Semi-annually (spring and fall)
Gutters and Downspouts	Identify and regularly monitor locations affected by recurring debris-build up or standing water.	Semi-annually (spring and fall)
Gutters and Downspouts	Inspect for damaged, loose, or missing components, as well as leaking joints.	Semi-annually (spring and fall)
Roof Surfaces (General)	Inspect roof surfaces for organic growth or debris build-up. Clean roof surfaces as necessary per roofing manufacturer recommendations. Be careful to avoid water infiltration to roof and wall assemblies while cleaning. Never use muriatic acid or petroleum-based cleaners or solvents. Rinse thoroughly using a garden hose or low-pressure sprayer (200-300 psi) with a 25° - 50° fan-shaped tip from above. Do not allow cleaning solution to dry on building components. Always test an inconspicuous surface first to confirm the effect that scrubbing and application of cleaning solution will have on various building components. Protect adjacent building components and landscaping that may be damaged by cleaning solution.	Semi-annually (spring and fall)
Roof Surfaces	Inspect roof surfaces for damaged, loose, or missing components, storm damage, or other weather-resistance deficiencies.	Semi-annually (spring and fall)
Roof Surfaces	Inspect roof surfaces for presence of bird or insect nests.	Semi-annually (spring and fall)
SITEWORK		
Asphalt Paving	Patch all cracks in asphalt greater than 1/4" in width with hot-applied crack sealer.	Annually (spring)
Asphalt Paving	Monitor oil leaks that will disintegrate asphalt. Repair source of leak.	Annually (spring)
Catch Basins and Trench Drains	Inspect for debris build-up and organic growth. Clean catch basins or trench drains regularly. Inspect for positive drainage.	Semi-annually (spring and fall)

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
Concrete Flatwork	Inspect for debris build-up and organic growth. Clean concrete flatwork surfaces as necessary.	Semi-annually (spring and fall)
Concrete Flatwork	Inspect for cracking, spalling, settlement, trip hazards, or damage caused by salt/de-icing chemicals. Patch or repair as necessary.	Annually (spring)
Fencing and Railings	Inspect metal components for rust or paint failure. Clean rust and loose material from metal using wire brush, dust cloth, and vacuum. Prep and repaint with two coats of compatible rust-inhibiting primer. Following application of primer and finish, apply compatible clear coat waterproof sealer to areas of work to help prevent additional corrosion.	Annually (spring)
Fencing and Railings	Inspect base of wood fence pickets for debris build-up and clearance to soil. Remove debris and modify soil as necessary to maintain adequate clearance.	Semi-annually (spring and fall)
Gates	Inspect metal components for rust or paint failure. Clean rust and loose material from metal using wire brush, dust cloth, and vacuum. Prep and repaint with two coats of compatible rust-inhibiting primer. Following application of primer and finish, apply compatible clear coat waterproof sealer to areas of work to help prevent additional corrosion.	Annually (spring)
Irrigation Systems	Blow out sprinkler lines and inspect backflow devices for operability.	Annually (fall)
Irrigation Systems	Inspect electronic timers for operability and electric shorts.	Annually (spring)
Irrigation Systems	Redirect sprinkler heads away from building surfaces.	Annually (spring)
Landscaping	Inspect soil finish grade for proper drainage away from structure. Fill in low areas as necessary to allow for 5% minimum positive slope away from structure.	Semi-annually (spring and fall)
Landscaping	Inspect soil finish grade for blockage of masonry veneer weep provisions at base of wall locations.	Semi-annually (spring and fall)
Landscaping	Inspect for plants growing on or too close to structure. Trim or remove plants as necessary to maintain minimum 6" clearance to structure.	Semi-annually (spring and fall)
Light Poles	Inspect light poles for operability. Replace lamps as necessary.	Semi-annually (summer and winter)

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
Exterior Metal	Inspect metal components for rust or paint failure. Clean rust and loose material from metal using wire brush, dust cloth, and vacuum. Prep and repaint with two coats of compatible rust-inhibiting primer. Following application of primer and finish, apply compatible clear coat waterproof sealer to areas of work to help prevent additional corrosion.	Annually (spring)
Mailboxes	Inspect for loose, missing or cracked components, rot, sharp edges, and other damage. Repair or replace as necessary.	Annually (spring)
Retaining Walls (Masonry)	Inspect wall surfaces for loose or missing masonry units.	Annually (spring)
Retaining Walls	If visual evidence indicates the wall has shifted over time, consult a structural engineer or qualified contractor.	
Masonry	Inspect masonry joints for failed mortar and cracking. Consult a qualified masonry contractor for an estimate of means and costs.	Annually (spring)
Masonry	Inspect masonry surfaces for presence of efflorescent staining. Clean efflorescence from wall surfaces as necessary with solution consisting of 1 part white household vinegar to 5 parts water, applied using a low-pressure sprayer (30-50 psi) with a 50° fan-shaped tip. Never use muriatic acid or petroleum-based cleaners or solvents. Scrub problematic wall surfaces vigorously with a stiff bristle brush (do not use a wire brush) and rinse thoroughly with clean water using a garden hose or low-pressure sprayer (200-300 psi) with a 25° - 50° fan-shaped tip. Do not allow cleaning solution to dry on building components. Always test an inconspicuous surface first to confirm the effect that scrubbing and application of cleaning solution will have on various building components. Protect adjacent building components and landscaping that may be damaged by cleaning solution.	Annually (spring)
Masonry	Avoid use of de-icing chemicals on surfaces immediately adjacent to masonry veneer.	Throughout winter

COMPONENT	MAINTENANCE ACTION(S) REQUIRED	FREQUENCY
COMMON AREAS		
Deck Furnishings	Inspect for loose, missing, or cracked components, rot, sharp edges, and other damage.	Annually (spring)
Metal	Inspect metal components for rust or paint failure. Clean rust and loose material from metal using wire brush, dust cloth, and vacuum. Prep and repaint with two coats of compatible rust-inhibiting primer. Following application of primer and finish, apply compatible clear coat waterproof sealer to areas of work to help prevent additional corrosion.	Annually (spring)
HVAC Units	Inspect exhaust vent fans for operability, electrical shorts, and debris-build up. Follow all manufacturer instructions for Clean or replace HVAC system filters.	Semi-annually (prior to summer and winter)
Interior Walls and Ceilings	Inspect for microbial growth, moisture-staining, holes, cracking, graffiti, or other damage. Regularly monitor locations that exhibit wetness/dampness, color differences, swelling/warping, blistering/cracking, abnormal odors, or failure of previous repairs. Have a building enclosure condition assessment conducted by a consultant to identify problems and develop solutions.	Annually (summer)
Interior Furnishings	Inspect for loose, missing, or cracked components, sharp edges, and other damage. Repair or replace as needed.	Annually (summer)
Interior Lighting Fixtures	Inspect for operability and electrical shorts. Replace lamps as necessary.	
Water Heaters	Consult manufacturer service guide for the unit for required maintenance schedules. Gas: Monitor for any signs of restricted exhaust venting, particularly when other appliances are operating. Ensure CO monitors are in place and operational by testing as indicated by manufacturer. Heat-Pump: Air filters generally must be cleaned every two weeks for maximum efficiency. Condensate must be properly routed to a secondary drain.	Year-round
Water Heaters	Ensure Temperature-Pressure Relief Valve is not releasing liquid (sign of failure) and outflow is plumbed to a safe secondary drain location.	Annually
Water Heaters	Drip pans and drains should be monitored for moisture regularly.	Year-round

APPENDIX B

IMPORTANT INFORMATION

PURPOSE OF REPORT

A MULTI-PURPOSE TOOL

This reserve study report is an important part of the Association's budgetary process. Following the recommendations contained within this report should ensure the Association's smooth budgetary transitions from one fiscal year to the next, and either decrease or eliminate the need for "special assessments".

In addition, this reserve study serves a variety of useful purposes:

- Following the recommendations of a reserve study performed by a professional consultant can protect the Board of Directors in a community from personal liability concerning reserve components and reserve funding
- A reserve study is required by your accountant during the preparation of the Association's annual audit.
- A reserve study is often requested by lending institutions during the process of loan applications, both for the community and, in many cases, the individual owners
- The reserve study report is also a detailed inventory of the Association's major assets and serves as a management tool for scheduling, coordinating and planning future repairs and replacements
- The reserve study report is a tool that can assist the Board in fulfilling its legal and fiduciary obligations for maintaining the community in a state of good repair. If a community is operating on a special assessment basis, it cannot guarantee that an assessment, when needed, will be passed. Therefore, it cannot guarantee its ability to perform the required repairs or replacements to those major components for which the association is obligated.
- Since the reserve study includes measurements and cost estimates of the Association's assets, the detail reports may be used to evaluate the accuracy and price of contractor bids when assets are due to be repaired or replaced.
- The reserve study is an annual disclosure to the membership concerning the financial condition of the Association, and may be used as a "consumers' guide" by prospective purchasers
- The reserve study report provides a record of the time, cost, and quantities of past reserve replacements. At times, the Association's management company and Boards of Directors are transitory, which may result in the loss of these important records.

STANDARD TERMS AND DEFINITIONS

Adjustment to Useful Life – Once the Estimated Useful Life (EUL) is determined, it may be adjusted, up or down, by this separate figure for the current cycle of replacement. This will allow for a current period adjustment without affecting the estimated replacement cycles for future replacements.

Annual Assessment Increase – This represents the percentage rate at which the Association will increase its assessment to reserves at the end of each year. For example, in order to accumulate \$10,000 in 10 years, you could set aside \$1,000 per year. As an alternative, you could set aside \$795 the first year and increase that amount by 5% each year until the year of replacement. In either case you arrive at the same amount. The idea is that you start setting aside a lower amount and increase that number each year in accordance with the planned percentage. Ideally this figure should be equal to the rate of inflation. It can, however, be used to aid those Associations that have not set aside appropriate reserves in the past, by making the initial year's allocation less formidable.

Annual Fixed Reserves – An optional figure, which if used, will override the normal process of allocating reserves to each asset.

Budget Year Beginning/Ending – The budgetary year for which the report is prepared. For Associations with fiscal years ending December 31st, the monthly contribution figures indicated are for the 12-month period beginning 1/1/20xx and ending 12/31/20xx.

Component – The individual line items in the reserve study, developed or updated in the Physical Analysis. These elements form the building blocks for the reserve study. Components typically are: 1) Association responsibility, 2) with limited useful life expectancies, 3) predictable Remaining Useful Life expectancies, 4) above a minimum threshold cost, and 5) as required by local codes.

Component Inventory – The task of selecting and qualifying reserve components. This task can be accomplished through on-site visual, review of Property design and organizational documents, a review of established Property precedents, and discussion with appropriate Association representative(s).

Condition Assessment – The task of evaluating the current condition of the component based on observed or reported characteristics.

Current Replacement Cost – The estimated Replacement Cost effective at the beginning of the fiscal year for which the report is being prepared.

Estimated Useful Life (EUL) – The estimated useful life of a component based upon industry standards, manufacturer specifications, visual inspection, location, usage, association standards and prior history. All of these factors are taken into consideration when tailoring the estimated useful life to the particular component. For example, the carpeting in a hallway or elevator (a heavy traffic area) will not have the same life as the identical carpeting in a seldom-used meeting room or office.

Financial Analysis – The portion of a Reserve Study where current status of the Reserves (measured as cash or Percent Funded) and a recommended Reserve contribution rate (Reserve Funding Plan) are derived, and the projected Reserve income and expense over time is presented. The Financial Analysis is one of the two parts of a Reserve Study.

Funding Plan – An Association's plan to provide income to a Reserve Fund to offset anticipated expenditures from that fund.

Funding Principles –

- Sufficient Funds When Required
- Stable Contribution Rate over the Years
- Evenly Distributed Contributions over the Years
- Fiscally Responsible

Future Replacement Cost – The estimated cost to repair or replace the component at the end of its estimated useful life based upon the current replacement cost and inflation.

Inflation – This figure is used to approximate the future cost to repair or replace each component in the report. The current cost for each component is compounded on an annual basis by the number of remaining years to replacement, and the total is used in calculating the monthly reserve contribution that will be necessary to accumulate the required funds in time for replacement.

Interest Contribution (After Taxes) – The interest that should be earned on the reserves, net of taxes, based upon their beginning reserve balance and monthly contributions for one year. This figure is averaged for budgeting purposes.

Investment Yield Before Taxes – The average interest rate anticipated by the Association based upon its current investment practices.

Life and Valuation Estimates – The task of estimating Useful Life, Remaining Useful Life, and Repair or Replacement Costs for the Reserve components.

Number of Units and/or Phases – As applicable, the number of units and/or phases included in this version of the report.

Physical Analysis – The portion of the Reserve Study where the Component Inventory, Condition Assessment, and Life and Valuation Estimate tasks are performed. This represents one of the two parts of the Reserve Study.

Placed-In-Service Date – The month and year that the component was placed-in-service. This may be the construction date, the first escrow closure date in a given phase, or the date of the last servicing or replacement.

Projected Reserve Balance – The anticipated reserve balance on the first day of the fiscal year for which this report has been prepared. This is based upon information provided and not audited.

Remaining Useful Life (RUL) – The estimated time, in years, that a reserve component can be expected to continue to serve its intended function. Projects anticipated to occur in the initial year have “zero” Remaining Useful Life.

Replacement Cost – The cost of replacing, repairing, or restoring a Reserve Component to its original functional condition. The Current Replacement Cost would be the cost to replace, repair, or restore the component during that particular year.

Replacement Year – The year that the component is scheduled to be replaced. The appropriate funds will be available by the first day of the fiscal year for which replacement is anticipated.

Reserve Balance – Actual or projected funds as of a particular point in time that the Association has identified for use to defray the future repair or replacement of those major components which the Association is obligated to maintain. Also known as Reserves, Reserve Accounts, Cash Reserves. Based upon information provided and not audited.

Reserve Provider – An individual who prepares Reserve Studies.

Reserve Study – A budget planning tool which identifies the current status of the Reserve Fund and a stable and equitable Funding Plan to offset the anticipated future major common area expenditures. The Reserve Study consists of two parts: the Physical Analysis and the Financial Analysis.

OVERVIEW OF CAPITAL PLANNING TOOLS

INTRODUCTION

Preparing the annual budget and overseeing the Association's finances are perhaps the most important responsibilities of board members. The annual operating and reserve budgets reflect the planning and goals of the association and set the level and quality of service for all of the Association's activities.

FUNDING OPTIONS

When a major repair or replacement is required in a community, an Association has essentially four options available to address the expenditure:

- **Option 1** – The first, and only logical means that the Board of Directors has to ensure its ability to maintain the components for which it is obligated, is by assessing an adequate level of reserves as part of the regular membership assessment, thereby distributing the cost of the replacements uniformly over the entire membership. The community is not only comprised of present members, but also future members. Any decision by the Board of Directors to adopt a calculation method or funding plan which would disproportionately burden future members in order to make up for past reserve deficits, would be a breach of its fiduciary responsibility to those future members. Unlike individuals determining their own course of action, the board is responsible to the “community” as a whole.

Whereas, if the association was setting aside reserves for this purpose, using the vehicle of the regularly assessed membership dues, it would have had the full term of the life of the roof, for example, to accumulate the necessary moneys. Additionally, those contributions would have been evenly distributed over the entire membership and would have earned interest as part of that contribution

- **Option 2** – The second option is for the association to acquire a loan from a lending institution in order to affect the required repairs. In many cases, banks will lend to an association using “future homeowner assessments” as collateral for the loan. With this method, the current board is pledging the future assets of an association. They are also incurring the additional expense of interest fees along with the original principal amount. In the case of a \$150,000 roofing replacement, the association may be required to pay back the loan over a three to five year period, with interest.
- **Option 3** – The third option, too often used, is simply to defer the required repair or replacement. This option, which is not recommended, can create an environment of declining property values due to expanding lists of deferred maintenance items and the association's financial inability to keep pace with the normal aging process of the common area components. This, in turn, can have a seriously negative impact on sellers in the association by making it difficult, or even impossible, for potential buyers to obtain financing from lenders. Increasingly, lending institutions are requesting copies of the association's most recent reserve study before granting loans, either for the association itself, a prospective purchaser, or for an individual within such an association.
- **Option 4** – The fourth option is to pass a “special assessment” to the membership in an amount required to cover the expenditure. When a special assessment is passed, the association has the authority and responsibility to collect the assessments, even by means of foreclosure, if necessary. However, an association considering a special assessment cannot guarantee that an assessment, when needed, will be passed. Consequently, the association cannot guarantee its ability to perform the required repairs or replacements to those major components for which it is obligated when the need arises. Additionally, while relatively new communities require very little in the way of major “reserve” expenditures, associations reaching 12 to 15 years of age and older, find many components reaching the end of their effective useful lives. These required expenditures, all accruing at the same time, could be devastating to an association's overall budget.

TYPES OF RESERVE STUDIES

Most reserve studies fit into one of three categories:

- **Full Reserve Study (Level I)** – The reserve provider reviews community bylaws and original construction documents (when available) to produce a component inventory, a condition assessment (based upon on-site visual observations), and life and value estimates to determine both a “fund status” and “funding plan.”
- **Update with Site Inspection (Level II)** – The reserve provider conducts a component inventory (verification only, not quantification unless new components have been added to the inventory), a condition assessment (based upon on-site visual observations), and life and valuation estimates to determine both the “fund status and “funding plan.”
- **Update without Site Inspection (Level III)** – The reserve provider conducts life and valuation estimates to determine the “fund status” and “funding plan.”

THE RESERVE STUDY: A PHYSICAL AND FINANCIAL ANALYSIS

There are two components of a reserve study – a physical analysis and a financial analysis:

- **Physical Analysis** – During the physical analysis, a reserve study provider evaluates information regarding the physical status and repair/replacement cost of the association’s major common area components. To do so, the provider conducts a component inventory, a condition assessment, and life and valuation estimates.
- **Financial Analysis** – The financial analysis assesses the association’s reserve balance or “fund status” (measured in cash or as percent fully funded) to determine a recommendation for the appropriate reserve contribution rate in the future, known as the “funding plan”.

DEVELOPING A COMPONENT LIST

The budget process begins with full inventory of all the major components for which the association is responsible. The determination of whether an expense should be labeled as operational, reserve, or excluded altogether is sometimes subjective. Since this labeling may have a major impact on the financial plans of the association, subjective determinations should be minimized. We suggest the following considerations when labeling an expense.

OPERATIONAL EXPENSES

Occur at least annually, no matter how large the expense, and can be budgeted for effectively each year. They are characterized as being reasonably predictable, both in terms of frequency and cost. Operational expenses include all minor expenses, which would not otherwise adversely affect an operational budget from one year to the next. Examples of operational expenses include:

- **Utilities** – Electricity, gas, water, telephone, cable TV
- **Administrative** – Supplies, bank service charges, dues & publications, licenses/permits/fees, insurance(s)
- **Services** – Landscaping, pool maintenance, street sweeping, accounting, reserve study
- **Repair Expenses** – Tile roof repairs, equipment repairs, minor concrete repairs, operating contingency

RESERVE EXPENSES

These are major expenses that occur other than annually, and which must be budgeted for in advance to ensure the availability of the necessary funds in time for their use. Reserve expenses are reasonably predictable both in terms of frequency and cost. However, they may include significant components that have an indeterminable but potential liability that may be demonstrated as a likely occurrence. They are expenses that, when incurred, would have a significant effect on the smooth operation of the budgetary process from one year to the next if they were not reserved for in advance.

Examples of reserve expenses include:

- Roof Replacements
- Park/Play Equipment
- Painting
- Pool/Spa Re-plastering
- Deck Resurfacing
- Pool Equipment Replacement
- Fencing Replacement
- Pool Furniture Replacement
- Asphalt Seal Coating
- Tennis Court Resurfacing
- Asphalt Repairs
- Lighting Replacement
- Asphalt Overlays
- Insurance(s)
- Equipment Replacement
- Reserve Study
- Interior Furnishings

BUDGETING NORMALLY EXCLUDED

Repairs or replacements of components which are deemed to have an estimated useful life equal to or exceeding the estimated useful life of the facility or community itself or exceeding the legal life of the community as defined in an association's governing documents. Examples include the complete replacement of elevators, tile roofs, wiring and plumbing. Also excluded are insignificant expenses that may be covered either by an operating or reserve contingency, or otherwise in a general maintenance fund. Expenses that are necessitated by acts of nature, accidents or other occurrences that are more properly insured for, rather than reserved for, are also excluded.

Construction defects and other conditions which result in major performance deficiencies cannot be modeled or accurately budgeted for as part of a standard reserve fund analysis.

PREPARING THE RESERVE STUDY

Once the reserve components have been identified and quantified, their respective replacement costs, useful lives, and remaining lives must be assigned so that a funding schedule can be constructed. Replacement costs and useful lives can be found in published manuals such as construction estimators, appraisal handbooks, and valuation guides. Remaining lives are calculated from the useful lives and ages of assets and adjusted according to conditions such as design, manufactured quality, usage, exposure to the elements and maintenance history.

By following the recommendations of an effective reserve study, the association should avoid any major shortfalls. However, to remain accurate, the report should be updated on an annual basis to reflect such changes as shifts in economic parameters, additions of phases or components, or expenditures of reserve funds. The association can assist in simplifying the reserve study update process by keeping accurate records of these changes throughout the year.

FUNDING METHODS

From the simplest to the most complex, reserve study providers use many different computational processes to calculate reserve requirements. However, there are two basic processes identified as industry standards – the cash flow method and the component method:

- **Cash Flow Method** – Develops a reserve-funding plan where contributions to the reserve fund are designed to offset the variable annual expenditures from the reserve fund. Different reserve funding plans are tested against the actual anticipated schedule of reserve expenses until the desired funding goal is achieved. This method sets up a “window” in which all future anticipated replacement costs are computed, based upon the individual lives of the components under consideration.
- **Component Method** – Develops a reserve-funding plan where the total contribution is based upon the sum of contributions for individual components. The component method is the more conservative of the two funding options. This assures that the association will achieve and maintain an ideal level of reserve over time. This method also allows for computations on individual components in the analysis. The Component Funding Model Projection is based upon the component methodology.

FUNDING STRATEGIES

Current Assessment Funding Model – This method is also based upon the cash flow funding concept. The initial reserve assessment is set at the association’s current fiscal year funding level and a 30-year projection is calculated to illustrate the adequacy of the current funding over time

RESERVE STUDY METHODOLOGY

PHYSICAL ANALYSIS METHODOLOGY

Throughout the course of Forensic's physical analysis of the Property, the following methods were employed:

- **Review of Background Information** – The following background information was reviewed by Forensic as part of the Reserve Study preparation for the Property:
 - Previous reserve study report
 - Declarations and governing documents provided by HOA board
- **Component Inventory Generation** – The component inventory was developed to include commonly-owned building components or systems, all or part of which will normally require major maintenance, repair, or replacement in more than 1 and less than 30 years, as well as the finish paint application for those included components.

Please note that the inventory specifically did not include the components or systems listed in the "Reserve Study Exclusions" section of this report, as well as the following

- Items that can be funded from the general budget
 - Common elements whose responsibility does not include all of the unit owners
 - Items with an expected useful life (EUL) and/or remaining useful life (RUL) greater than 30 years
 - Items that lack a predictable EUL and/or RUL
 - Items with a replacement cost less than the minimum threshold of \$1,000
- **Visual Site Inspection** – In order to evaluate and document the current physical condition of the Property, Forensic performed a visual review of the unconcealed and accessible surfaces of the components listed in the "Component Inventory" section of this report. For multiple components, Forensic reviewed a sufficient representative sample of that component (as determined by our professional judgment) in order to make quantity or useful life determinations.

At no time during Forensic's time on site at the Property were destructive or invasive testing methods employed in order to observe the condition of concealed building components or systems. As such, the concealed conditions associated with the components listed in the "Component Inventory" section of this report are not included as part of this Reserve Study.

- **Component Quantity Determinations** – Forensic utilized multiple methods to determine component quantities (depending on the component), including field take-off estimates, partial take-offs from construction drawings, and evaluation of the component quantities provided in previous reserve studies.
- **Component Useful Life Determinations** – Forensic utilized multiple methods to determine component EUL values (depending on the component), including typical useful life tables provided by Fannie Mae, databases provided by Reserve Analyst software, product manufacturer literature, modification of the component quantities provided in previous reserve studies, and Forensic's professional judgment. RUL values were determined by subtracting the current age of each component (based on the in-service date provided by the Association or previous reserve study) from the EUL.

FINANCIAL ANALYSIS METHODOLOGY

Throughout the course of Forensic's financial analysis of the Property, the following methods were employed:

- **Financial Parameter Determinations** – In order to perform the financial analysis component of this Reserve Study, Forensic relied upon the values provided by the Association for the fiscal year start/end dates, reserve fund starting balance, reserve fund contribution rate, interest rate, and tax rate. Forensic determined an appropriate inflation rate based upon the 12-month moving average inflation rate, as provided by the U.S. Bureau of Labor Statistics. The 30-year planning horizon incorporated in this Reserve Study is based upon State of Oregon requirements.
- **Component Replacement Cost Determinations** – Forensic utilized multiple methods to determine component current replacement cost values (depending on the component), including current RS Means data for Facility Repair and Maintenance and Commercial Renovation, product manufacturer and vendor literature, adjustment of costing information provided in previous reserve studies, and Forensic's professional judgment. Future replacement cost values were determined by projecting the current replacement cost values out to their RUL replacement year(s), as modified by the inflation rate determined by Forensic.

Funding Model Projections and Computations – Forensic utilized the mathematical modeling capabilities of F7 software to generate the Annual Expenditure Summary, Current Assessment Funding Model Projection, and the Suggested Funding Model Projection via the "Cash Flow Method."

DISCLOSURES AND LIMITATIONS

GENERAL INFORMATION

Forensic's Reserve Study of the Property has been prepared in general conformance with the following industry association standards:

- ASTM E 2018-08 "Standard Guide for Property Condition Assessments: Baseline Property Condition Assessment Process," (2008).
- Community Associations Institute (CAI) Research Foundation, "Best Practices: Report #1 Reserve Studies/Management"
- Community Associations Institute (CAI), "National Reserve Study Standards," (2009)
- Fannie Mae "Expected Useful Life Tables," developed by On-Sight Insight of Needham, MA
- "Fannie Mae Physical Needs Assessment Guidance to the Property Evaluator"

This document has been provided pursuant to an agreement containing restrictions on its use. No part of this document may be copied or distributed, in any form or by any means, nor disclosed to third parties without the expressed written permission of Forensic. The Association shall have the right to reproduce and distribute copies of this report, or the information contained within, as may be required for compliance with all applicable regulations.

COMPLIANCE WITH STATE REGULATIONS

This Reserve Study was prepared in general compliance with all applicable state requirements. Please refer to the appropriate appendix to this report for detailed information regarding specific state requirements. Note that this Reserve Study was prepared by a building envelope consultant, suitably qualified by knowledge, skill, and experience to act as a Reserve Study Professional. Please refer to the appropriate appendix to this report for detailed information regarding provider qualifications.

CONFLICTS OF INTEREST

Forensic has no financial interest in the Association. Forensic is unaware of any potential conflict of interest that may negatively impact the veracity or accuracy of this report.

BASIC ASSUMPTIONS

This reserve study and the parameters under which it has been completed are based upon information provided to us in part by representatives of the Association, its contractors, assorted vendors, specialist and independent contractors, the Community Association Institute (CAI), and various construction pricing and scheduling manuals including, but not limited to: Marshall & Swift Valuation Service, RS Means Facilities Maintenance & Repair Cost Data, RS Means Commercial Renovation Cost Data, National Construction Estimator, National Repair & Remodel Estimator, Dodge Cost Manual and McGraw-Hill Professional. Additionally, costs are obtained from numerous vendor catalogues, actual quotations or historical costs, and our own experience as a building envelope consultant.

It has been assumed, unless otherwise noted in this report, that components will not be subjected to extraordinary usage or be exposed to any problematic operational environments, that all components have been designed and constructed properly, and that each estimated useful life (EUL) will approximate that of the norm per industry standards and/or manufacturer's specifications. In some cases, estimates may have been used on components, which have an indeterminable but potential liability to the Association. The decision for the inclusion of these as well as all components considered is left to the Association.

It has also been assumed that the Association will employ a high standard of ongoing maintenance to facilitate EUL expectations for individual components, and that those components have been constructed and placed in service in such a manner as to facilitate reasonable access for ongoing maintenance and inspection purposes.

RESERVE STUDY UPDATES

We recommend that your reserve study be updated on an annual basis due to fluctuating interest rates, inflationary changes, and the unpredictable nature of the lives of many of the components under consideration. All of the information collected during our inspection of the Property and computations made subsequently in preparing this Reserve Study are retained in our computer files. Therefore, annual updates may be completed quickly and inexpensively each year. A visual site inspection is recommended every three (3) years in order to more accurately update your Reserve Study.

In addition, any of the parameters and estimates used in this Reserve Study may be changed at your request, after which we will provide a revised Study as an additional service billed on an hourly basis.

This Reserve Study is provided as an aid for planning purposes and not as an accounting tool. Since it deals with events yet to take place, there is no assurance that the results enumerated within it will, in fact, occur as describe.

DOCUMENT REVISIONS

Forensic reserves the rights to amend, modify, and/or re-issue this document as more information is reviewed or as additional Property site visits proceed. This document is intended solely for use by our client and should, in any event, be reproduced only in its entirety, with the "Disclaimers and Limitations" section included.

We appreciate your confidence in Forensic and we look forward to addressing any questions or concerns that you may have regarding the contents of this reserve study. Please do not hesitate to contact Forensic at (503) 772-1114 or info@forensicbuilding.com if we can be of further assistance. Thank you.

Respectfully submitted,

FORENSIC BUILDING CONSULTANTS



Toby C. White
Vice President and Director of Technical Services



James Erdahl
Building Science Technician, Reserve Analyst

End Of Document