Print

Exit

INTERIOR PANELS / TRIM UPPER INSTRUMENT PANEL REMOVAL

PROCEDURE

■ 1. PRECAUTION

Click hereVehicle Interior>INTERIOR PANELS / TRIM>UPPER INSTRUMENT PANEL>PRECAUTION

2.DISCONNECT FRONT DOOR OPENING TRIM WEATHERSTRIP LH

62312B

a. Disconnect the front door opening trim weatherstrip LH.

■ 3.REMOVE FRONT PILLAR GARNISH LH


62212

Click hereVehicle Interior>INTERIOR PANELS / TRIM>ROOF HEADLINING>REMOVAL

4.REMOVE NO. 1 INSTRUMENT PANEL SPEAKER PANEL SUB-ASSEMBLY


55408F

a.

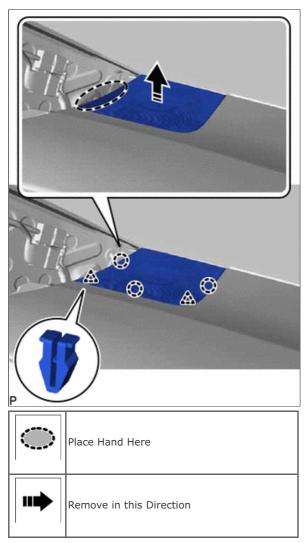

Disengage the 2 clips and 3 claws as shown in the illustration.

b.

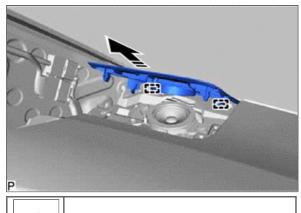

Ш Remove in this Direction

Disengage the 2 guides to remove the No. 1 instrument panel speaker panel sub-assembly as shown in the illustration.

5.REMOVE FRONT NO. 2 SPEAKER ASSEMBLY (for LH Side)

86160P

Click hereAudio / Visual / Telematics>AUDIO / VIDEO>INSTRUMENT PANEL SPEAKER>REMOVAL

6.DISCONNECT FRONT DOOR OPENING TRIM WEATHERSTRIP RH

62311B

Disconnect the front door opening trim weatherstrip RH.

7.REMOVE FRONT PILLAR GARNISH RH

62211


HINT:

Use the same procedure as for the LH side.

8.REMOVE NO. 2 INSTRUMENT PANEL SPEAKER PANEL SUB-ASSEMBLY

55409F


a.

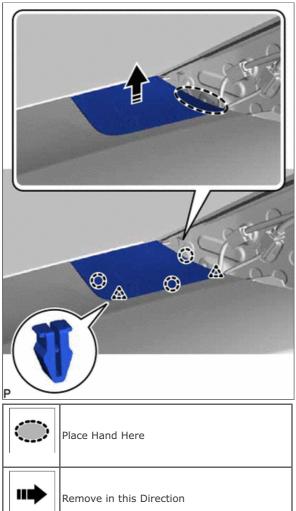



Disengage the 2 clips and 3 claws as shown in the illustration.

b.

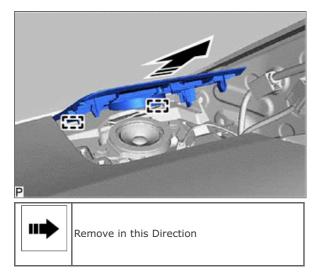

Disengage the 2 guides to remove the No. 2 instrument panel speaker panel sub-assembly as shown in the illustration.

9.REMOVE FRONT NO. 2 SPEAKER ASSEMBLY (for RH Side)

86160P


HINT:

Use the same procedure as for the LH side.


10.REMOVE INSTRUMENT CLUSTER FINISH PANEL END (w/ Headup Display)

55414A

a.

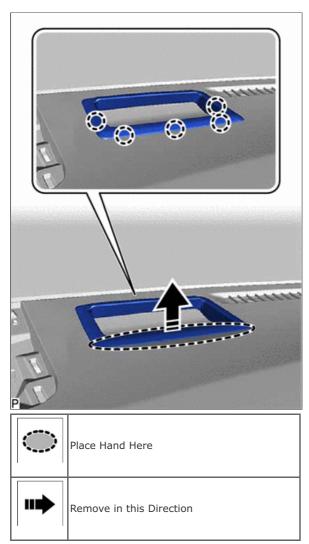

Disengage the 5 claws as shown in the illustration.

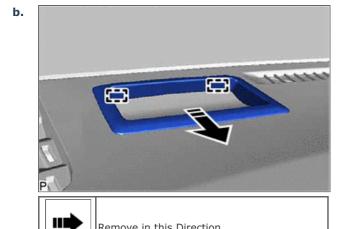

Remove in this Direction


Disengage the 2 guides to remove the instrument cluster finish panel end as shown in the illustration.


■ 11.REMOVE INSTRUMENT CLUSTER FINISH PANEL ASSEMBLY

55410C

Click hereVehicle Interior>METER / GAUGE / DISPLAY>COMBINATION METER>REMOVAL

12.REMOVE UPPER INSTRUMENT PANEL ASSEMBLY

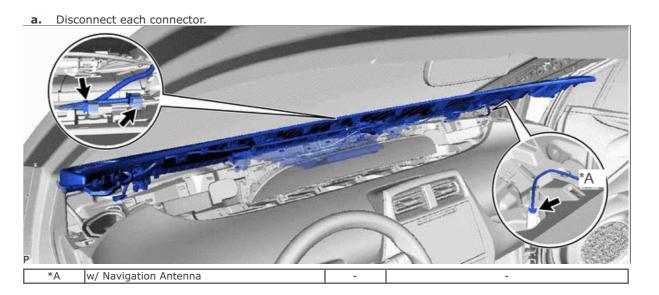

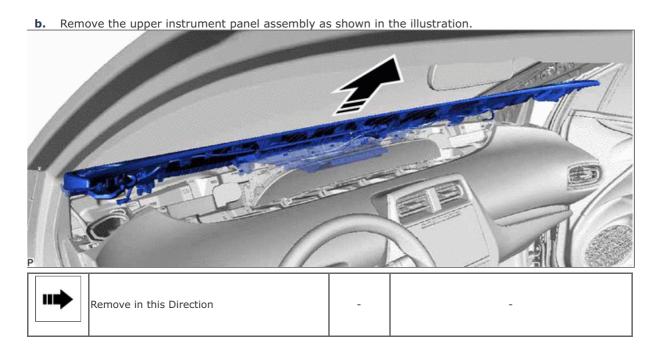

NOTICE:

Do not damage the upper instrument panel assembly.

| 2012 TOYOTA MOTOR CORPORATION. All Rights Reserved. | |
|---|--|
| | |

 $\,\cdot\,\,$ Do not allow the wire harnesses to interfere with the surrounding parts.