



Urbanbuild Co
Building • Pest • Drone
INSPECTIONS

Property and Timber Pest Report

Inspection Date: 23 Apr 2025

Property Address: 32 Richardson Street Chelmer 4068



Contents

Inspection Details	3
General description of property	4
Accessibility	8
Property Inspection Report	
Summary	13
Significant Items	14
Additional comments	16
Conclusion	64
Timber Pest Inspection Report	
Summary	66
Significant Items	67
Conclusion	70
Risk management options	70
Definitions to help you better understand this report	72
Terms on which this report was prepared	74

If you have any queries with this report or require further information, please do not hesitate to contact the person who carried out the inspection.

Inspection Details

Property Address: 32 Richardson Street Chelmer 4068

Date: 23 Apr 2025

Client

Name: The Property Owner

Email Address: admin@hauss.com.au

Phone Number:

Consultant

Name: Alwin Fung

Email Address: inspections@urbanbuildco.com.au

Licence / Registration Number: 76349

Company Name: Urbanbuild Co

Company Address: PO Box 3382 Norman Park QLD 4170

Company Phone Number: 0426828810

General description of property

Building Type:	Detached house
----------------	----------------

Storeys:	Two storey
----------	------------

Building age (approx):	2 Years
------------------------	---------

Smoke detectors:	7 fitted, but not tested IMPORTANT NOTE - The adequacy and testing of smoke detectors is outside the scope of this standard inspection and report. Accordingly, it is strongly recommended that a further inspection be undertaken by a suitably qualified person.
------------------	---

Siting of the building:	Towards the front of a medium block
-------------------------	-------------------------------------

Gradient:	The land is relatively flat
-----------	-----------------------------

Site drainage:	The site appears to be adequately drained
----------------	---

Access:	Easy pedestrian and vehicular access
---------	--------------------------------------

Main utility services:	Electricity, Sewerage, Mains water
------------------------	------------------------------------

Occupancy status:	Occupied
-------------------	----------

Furnished:	Fully furnished
------------	-----------------

Strata or company title properties:	Unknown
-------------------------------------	---------

Orientation of the property:	The facade of the building faces south Note. For the purpose of this report the façade of the building contains the main entrance door.
------------------------------	--

Weather conditions:	Dry
---------------------	-----

Primary method of construction

Main building – floor construction:	Suspended timber framed, Slab on ground, Balcony
Main building – wall construction:	Timber framed, Internal gypsum plasterboard, Fibre cement sheet cladding., Linear fibre cement cladding, Wall frames- pine timber.
Main building – roof construction:	Finished with sheet metal roofing, Engineered truss- Pine timber., Anti-condensation and thermal barrier installed under roof material. , Thermal insulation installed to ceiling.
Other timber building elements:	Doors, Skirting, Window frames, Architraves
Other building elements:	Alfresco Outdoor Area, Balcony
Overall standard of construction:	High
Overall quality of workmanship and materials: High	
Level of maintenance:	Well maintained

Special conditions or instructions

Special requirements, requests or instructions given by the client or the client's representative -

There are no special conditions or instructions

Accommodation and significant ancillaries

STOREY	LIVING ROOMS	BEDROOMS	BATHROOM / ENSUITE	SEPARATE TOILET	KITCHEN	LAUNDRY	POOL*	OTHER	NAME OF OTHER
Ground	1	0	0	1	1	1	0	0	
First	1	4	2	1	0	0	0	1	
Totals	2	4	2	2	1	1	0	1	

Parking

TYPE	OFF STREET PARKING SPACES (UNCOVERED)	GARAGE (COVERED)	CARPORT (COVERED)
Attached	0	2	0
Detached	0	0	0
Totals	0	2	0

Inspection Agreement

AS 4349.1-2007 and 4349.3-2010 require that an inspection agreement be entered into between the inspector & the client prior to the conduct of the inspection. This agreement sets out specific limitations on the scope of the inspection and on limits that apply in carrying it out. Where specific State or Territory requirements apply in addition to the scope of work in this agreement, or where the inspector and client agree to additional matters being covered, that additional scope is listed at the end of this agreement. It is assumed that the existing use of the building will continue.

AS 4349.1 - 2007 requires that the basis for comparison is a building of similar age and similar type to the subject building and which is in reasonable condition, having been adequately maintained over the life of the building. This means that building being inspected may not comply with Australian Standards, building regulations or specific state or territory requirements applicable at the time of the inspection

Inspection agreement supplied: Sent

Terminology

The definitions below apply to the types of defects associated with individual items / parts or inspection areas -

Damage	The building material or item has deteriorated or is not fit for its designed purpose
Distortion, warping, twisting	The item has moved out of shape or moved from its position
Water penetration, Dampness	Moisture has gained access to unplanned and / or unacceptable areas
Material Deterioration	The item is subject to one or more of the following defects; rusting, rotting, corrosion, decay
Operational	The item or part does not function as expected
Installation	The installation of an item is unacceptable, has failed or is absent

Scope of inspection

BUILDING INSPECTION

This is a visual Building Inspection Report carried out in accordance with AS4349.1 -2007. The purpose of this inspection is to provide advice to the Client regarding the condition of the Building & Site at the time of inspection. The report covers only safety hazards, major defects, and a general impression regarding the extent of minor defects. The building was compared with a building that was constructed in accordance with the generally accepted practice at the time of construction and which has been maintained such that there has been no significant loss of strength and serviceability.

TIMBER PEST INSPECTION

This Visual Timber Pest Inspection & Report is in accordance with Australian Standard 4349.3 -Inspection of Buildings Part 3: Timber Pest Inspections. This Report only deals with the detection or non-detection of Timber Pest Attack and Conditions Conducive to Timber Pest Attack discernible at the time of inspection. The inspection was limited to the Readily Accessible Areas of the Building & Site and was based on a visual examination of surface work (excluding furniture and stored items), and the carrying out of Tests.

Accessibility

Unless noted in “Special Conditions or Instructions”, the inspection only covered the Readily Accessible Areas of the Building and Site (see Note below).

Note. With strata and company title properties, the inspection was limited to the interior and the immediate exterior of the particular residence inspected. Common property was not inspected.

“Readily Accessible Areas” means areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. The term ‘readily accessible’ also includes:

(a) accessible subfloor areas on a sloping site where the minimum clearance is not less than 150 mm high, provided that the area is not more than 2 metres from a point with conforming clearance (i.e. 400 mm high by 600 mm wide); and

(b) areas at the eaves of accessible roof spaces that are within the consultant’s unobstructed line of sight and within arm’s length from a point with conforming clearance (i.e. 600 mm high by 600 mm wide).

“Building and Site” means the inspection of the nominated residence together with relevant features including any car accommodation, detached laundry, ablution facilities and garden sheds, retaining walls more than 700 mm high, paths and driveways, steps, fencing, earth, embankments, surface water drainage and stormwater run-off within 30 m of the building, but within the property boundaries.

For the Timber Pest Report, the term “Building and Site” is extended to include the main building (or main buildings in the case of a building complex) and all timber structures (such as outbuildings, landscaping, retaining walls, fences, bridges, trees and stumps with a diameter greater than 100 mm and timber embedded in soil) and the land within the property boundaries up to a distance of 50 metres from the main building(s).

The inspection did not include areas, which were inaccessible, not readily accessible or obstructed at the time of inspection. Areas, which are not normally accessible, were not inspected and include - but not limited to - the interior of a flat roof or beneath a suspended floor filled with earth. Obstructions are defined as any condition or physical limitation which inhibits or prevents inspection and may include – but are not limited to – roofing, fixed ceilings, wall linings, floor coverings, fixtures, fittings, furniture, clothes, stored articles/materials, thermal insulation, sarking, pipe/duct work, builder’s debris, vegetation, pavements or earth.

Areas Inspected

The inspection covered the Readily Accessible Areas of the property

- Building interior
- Building exterior
- Roof exterior
- Roof space
- The site

Areas not inspected

The inspection did not include areas, which were inaccessible, not readily accessible or obstructed at the time of inspection. The Consultant did not move or remove any obstructions which may be concealing evidence of defects. Areas, which are not normally accessible, were not inspected. Evidence of defects in obstructed or concealed areas may only be revealed when the items are moved or removed or access has been provided.

Obstructions and Limitations

The following obstructions may conceal defects:

- Built-in cupboards
- Ceilings
- Clothing and personal effects
- Floor coverings
- Furniture
- Stored articles
- Stored articles in cupboards
- Wall linings
- Stored articles in wardrobes
- Cladding
- Thermal insulation
- Wall hangings.

Obstructions increase the risk of undetected defects, please see the overall risk rating for undetected defects.

Inaccessible Areas

The following areas were inaccessible:

- Areas of low roof pitch
- Sub floor where ceilings are installed.
- Roof frame where insulation is installed.

Findings Summary

The summary below is used to give a brief overview of observations made in each inspection area. The summary is NEVER to be relied upon as a comprehensive report and the client MUST read the entire report and not rely solely on this summary.

Property Inspection Report

Minor Defect

Bedroom 4	Door stop is detached from wall bracket.
Electrical Services	Fan control cover plates are cracked.
Alfresco Area	Rear sliding stacker door lock handle is ceased.
Kitchen	Range-hood light was flickering at the time of inspection.

For your information

The site	Property is located above street level on relatively flat land.
Driveway	Concrete driveway is in good condition.
Fences	Brick letterbox is in good condition.
Garage	Garage appears in good condition with functional remote door.
Roof exterior	Roof exterior (sheet metal) appears in good condition.
External Walls	Linear fibre cement cladding appears in good condition and well sealed with paint.
Balcony	Balcony appears in good condition with tile finish and aluminium handrail.
Electrical Sub-Board (circuits)	RCD (Electrical safety switches) installed to light and power circuits.
Fences	Timber feature fences are in good condition.
Meter Box	Electrical meter box is installed at front of property with a power pole connection to main lines.
Fences	Timber fences are in good condition.
External Walls	Fibre cement sheet panel cladding appears in good condition and well sealed with paint.

Entry	Entry presents in good condition with upper floor extending over.
The site	Grounds are landscaped with established gardens in good tidy condition.
Alfresco Area	Alfresco area is under roof with tiled floor finish.
Hot Water Unit	Electric hot water unit is functional 246 litre heat pump unit manufactured in unconfirmed year.
Bedroom 1	Bedroom- presents in good condition and has been well maintained.
Ensuite	Ensuite presents in good functional condition and has been well maintained.
Study	Study appears in good condition.
Living area	Living area presents in good condition and has been well maintained.
Bedroom 2	Bedroom- presents in good condition and has been well maintained.
Toilet	Dual flush toilet is in good functional condition.
Bedroom 3	Bedroom- presents in good condition and has been well maintained.
Bathroom	Bathroom- good functional condition and has been well maintained.
Bedroom 4	Bedroom- presents in good condition and has been well maintained.
Hallway	Hallway presents in good condition.
Roofspace	Pine truss roof frame supports metal roofing system.
Laundry	Laundry and facilities appear in good functional condition.
Toilet- Ground Level	Dual flush toilet is in good functional condition.
Living area	Living area presents in good condition and has been well maintained.
Kitchen	Kitchen- good functional condition and has been well maintained.
Air Conditioning Services	Ducted air conditioning unit is functional.
Living area	Ducted air conditioning outlet has confirmed cool air flowing.
Kitchen	Ducted air conditioning outlet has confirmed cool air flowing.
Bedroom 1	Ducted air conditioning outlet has confirmed cool air flowing.

Living area	Ducted air conditioning outlet has confirmed cool air flowing.
-------------	--

Bedroom 2	Ducted air conditioning outlet has confirmed cool air flowing.
-----------	--

Bedroom 3	Ducted air conditioning outlet has confirmed cool air flowing.
-----------	--

Bedroom 4	Ducted air conditioning outlet has confirmed cool air flowing.
-----------	--

Stairwell	Internal stairs and handrail appear in good condition.
-----------	--

Timber Pest Inspection Report

For your information

Kitchen	Original construction physical termite barrier installed.
---------	---

Summary

SUMMARY INFORMATION: The summary below is used to give a brief overview of observations made in each inspection area. The items listed in the summary are noted in detail under the applicable sub headings within the body of the report. The summary is NEVER to be relied upon as a comprehensive report and the client MUST read the entire report and not rely solely on this summary. If there is a discrepancy between the information provided in this summary and that contained within the body of the Report, the information in the body of the Report shall override this summary. (See definitions & information below the summary to help understand the report)

Evidence of Serious Safety Hazard

Not Found

Evidence of Major Defect

Not Found

Evidence of Minor Defect

Found

Additional specialist inspections

It is Strongly Recommended that the following Inspections and Reports be obtained prior to any decision to purchase the Property and/or before settlement. Obtaining these reports will better equip the purchaser to make an informed decision.

Not Applicable

Undetected defect risk assessment

Due to the level of accessibility for inspection including the presence of obstructions, the overall degree of risk of undetected structural damage and conditions conducive to structural damage was considered:

LOW

A further inspection is strongly recommended of those areas that were not readily accessible and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This will involve a separate visit to the site, permission from the owner of the property and additional cost.

Unless stated otherwise, any recommendation or advice given in this Report should be implemented as a matter of urgency.

Significant Items

The following items and matters were reported on in accordance with the Scope of Inspection. For building elements not identified in this Condition Report, monitoring and normal maintenance must be carried out.

Serious Safety Hazard

No evidence was found

Major Defect

No evidence was found

Minor Defect

Minor Defect 1.01

Location: Bedroom 4

Finding: Door stop is detached from wall bracket.

Thread is damaged and will not screw on- replacement required.



Minor Defect 1.02

Location: Electrical Services

Finding: Fan control cover plates are cracked.

These cover plates are an acrylic material- replacement cover plates may be available.

Controls are functional.



Minor Defect 1.03

Location: Alfresco Area

Finding: Rear sliding stacker door lock handle is ceased.

Door is lockable- repairs required to operate this lock from exterior.



Minor Defect 1.04

Location: Kitchen

Finding: Range-hood light was flickering at the time of inspection.

Bulb should be replaced initially, if not functional with new bulb, further repairs or replacement may be necessary.



Additional comments

QBCC HOME WARRANTY INSURANCE POLICY

Ensure you confirm details and expiry of QBCC Home Warranty insurance policy.

This policy covers possible structural defects within the period, and as such we recommend you complete an assessment of entire property at least 6 months prior to expiry date to allow for QBCC processing times of claims.

Contact QBCC directly to discuss your rights and responsibilities on 13 93 33.

SMOKE DETECTOR COMPLIANCE NOTE:

Smoke detectors appear to be installed in compliant locations, however compliance of the system components and unit locations, confirming integrated smoke detectors and 10 year lithium or hard wiring is a mandatory requirement and should be confirmed by Vendor/Agent documentation supplied by a Licenced Electrician or suitably qualified professional.

Recommendations:

1. Smoke detector system should be tested for function at least once within a 12 month period.
2. Smoke detectors should be cleaned regularly- not removed from bracket, a light vacuum of surface is adequate to remove dust build up.
3. Smoke detectors should not be painted.

TERMITE MANAGEMENT SYSTEM NOTE:

Termites are an integral part of the natural environment and ecosystem, however they can encroach on buildings and cause significant damage undetected as they travel from their subterranean habitat via walls, slab penetrations and other components close to, or in direct contact with ground.

Moisture is the main reason termites are attracted to an area, and nearby food source may also provide a suitable nesting site.

Prevention of termite access is a difficult task, so reduction of risk via effective and well maintained termite management is required. Regular termite inspections, typically annually form the basis, and in many cases chemical barriers will reduce risk significantly. The responsible Timber Pest Contractor will advise the interval of ongoing inspections based on the degree of conditions conducive to termite access.

A chemical termite barrier is recommended for all slab on ground properties due to the lack of sub floor access and higher risk of concealed termite access.

We have identified conditions conducive to termites in this report, however termites can access a property from any part of the building or attached structure in direct contact with ground, or adjacent foliage which may bridge any

part of the building or attached structure in direct contact with ground, or adjacent foliage which may bridge any chemical or physical termite barrier.

A warranty should be included with a full barrier chemical system, and we recommend you confirm and adhere to the terms and conditions to maintain warranty.

Recommendations:

1. Install a full perimeter chemical termite barrier around the building to reduce risk of concealed termite access- particularly if the building is a slab on ground construction as there is no visual access to underside of building.
2. Regular termite and other timber pest inspections at no longer than 12 month intervals, or as advised by the current termite management Contractor responsible for the property.
3. If a current chemical termite barrier is installed, consult with the Contractor who installed the system and confirm terms and conditions of any possible warranty. Typically, annual inspections form the basis of any valid warranty- always engage the Contractor who installed the system to conduct these annual inspections as documentation is consistent.

AGE, WEAR AND TEAR NOTE:

Wear and tear of a property refers to incidental damage to walls, ceilings, floor coverings and surfaces generally. Minor scuffs, paint chips and the like are expected in an assessment of a functional property and do not usually attribute to structural defects.

Age refers to natural deterioration of internal and external paint, floor coverings and coatings, materials in wet areas and moving parts such as hinges and locks is also to be expected.

Weather conditions vary with wet/dry, hot/cold and cause building materials to expand and contract to different degrees, at times with resultant minor cracking evident. Other factors may influence the expansion and contraction, and these are addressed in this report if required.

Recommendations:

1. General maintenance and upkeep will reduce the degree of deterioration, and prolong the effective lifespan of building components.
2. Ensuring paint is maintained will preserve timber and steel.
3. Sealing of wet areas will reduce risk of premature deterioration via fungal decay, cleaning of bathroom glass and surface will reduce limescale stains etc.

Ultimately, maintenance and general upkeep of a property will save costs of repairs and replacement in the long term.

For your information

For your information 2.01

Location: The site

Finding: Property is located above street level on relatively flat land.



For your information 2.02

Location: Driveway

Finding: Concrete driveway is in good condition.



For your information 2.03

Location: Fences

Finding: Brick letterbox is in good condition.






For your information 2.04

Location: Garage

Finding: Garage appears in good condition with functional remote door.

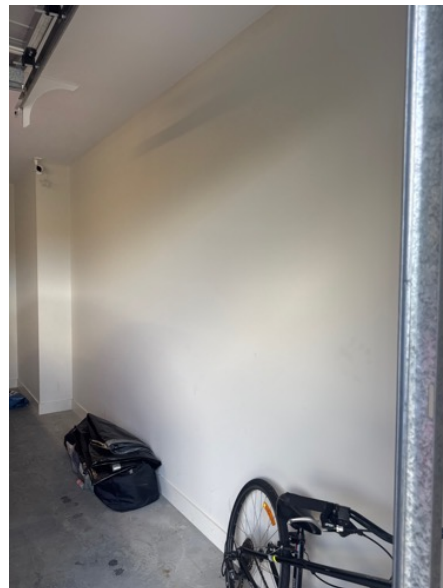



For your information 2.05

Location: Roof exterior

Finding: Roof exterior (sheet metal) appears in good condition.
Corrugated profile.



2025.04.23 | 27°30'58"S 152°58'45"E
24mm f/1.7 1/5000s ISO100

dji MINI 3



2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3




2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3

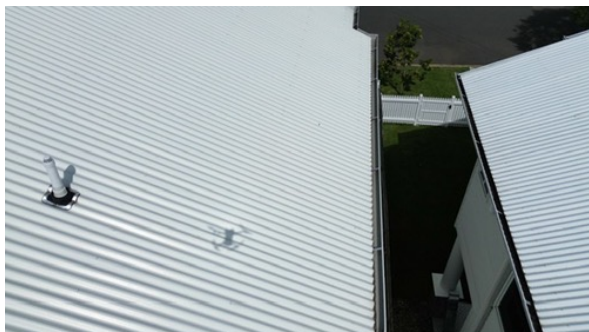

2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'58"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'58"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'58"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'58"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'58"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/3200s ISO100

dji MINI 3



2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3



2025.04.23 | 27°30'59"S 152°58'45"E
24mm f/1.7 1/4000s ISO100

dji MINI 3

For your information 2.06

Location: External Walls

Finding: Linear fibre cement cladding appears in good condition and well sealed with paint.



2025.04.23 | 27°30'58"S 152°58'45"E
24mm f/1.7 1/8000s ISO100

dji MINI 3

For your information 2.07

Location: Balcony

Finding: Balcony appears in good condition with tile finish and aluminium handrail.
Handrail is compliant with minimum height of 1.0m and gaps less than 125mm.






For your information 2.08

Location: Electrical Sub-Board (circuits)

Finding: RCD (Electrical safety switches) installed to light and power circuits.

A Licenced Electrician is recommended to test all circuits to confirm compliance and safety as outside scope of Building Inspector.



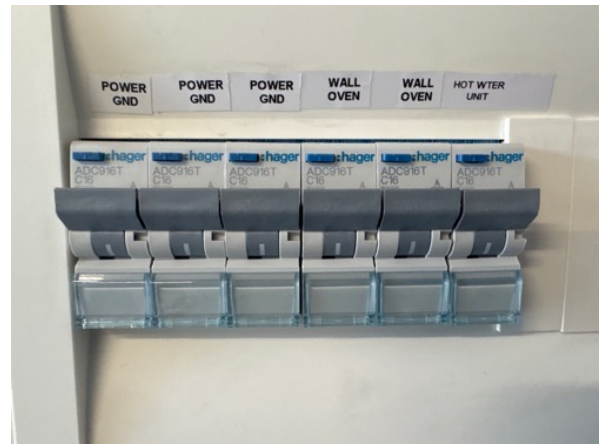

For your information 2.09

Location: Fences

Finding: Timber feature fences are in good condition.



For your information 2.10

Location: Meter Box

Finding: Electrical meter box is installed at front of property with a power pole connection to main lines.
Electrical sub board located inside garage with circuits.



For your information 2.11

Location: Fences

Finding: Timber fences are in good condition.



For your information 2.12

Location: External Walls

Finding: Fibre cement sheet panel cladding appears in good condition and well sealed with paint.








For your information 2.13

Location: Entry

Finding: Entry presents in good condition with upper floor extending over.

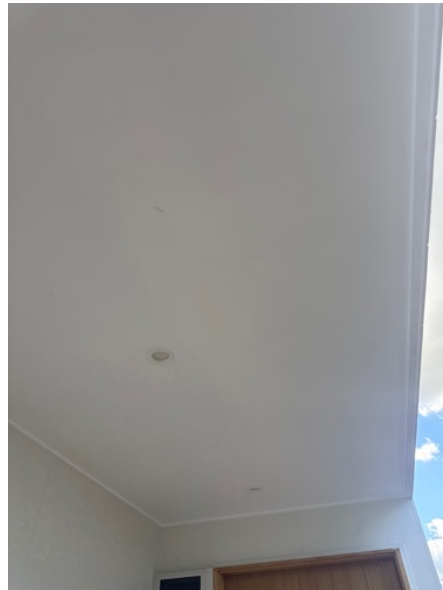



For your information 2.14

Location: The site

Finding: Grounds are landscaped with established gardens in good tidy condition.
Lawn and gardens are maintained.





For your information 2.15

Location: Alfresco Area

Finding: Alfresco area is under roof with tiled floor finish.
Good condition.



For your information 2.16

Location: Hot Water Unit

Finding: Electric hot water unit is functional 246 litre heat pump unit manufactured in unconfirmed year.
Pressure Relief Valve should be operated regularly (3 monthly) to activate valve and flush drain-
this will optimise operation and keep moving parts operational.



Southern Cross Water Heaters Pty Ltd	
Model	Heat Pump Water Heater 250EH1-15
Volume	250EH1-15
Protection class	246L
Assigned water pressure	IPX4
Electrical connection (voltage/frequency)	0.7MPa
Maximum total power by DWH	220V-240V/50Hz
Average power input by HP	1500W
Maximum power input by HP	495W
Power input by electric backup	865W
Refrigerant	1500W
Maximum pressure of refrigerant	R134a/0.74kg
Global Warming Potential (GWP)	2.8MPa
Model number	1430


Heat Pump Water Heater	
Model	250EH1-15
Volume	246L
Protection class	IPX4
Assigned water pressure	0.7MPa
Electrical connection (voltage/frequency)	220V-240V/50Hz
Maximum total power by DWH	1500W
Average power input by HP	495W
Maximum power input by HP	865W
Power input by electric backup	1500W
Refrigerant	R134a/0.74kg
Maximum pressure of refrigerant	2.8MPa
Global Warming Potential (GWP)	1430

For your information 2.17

Location: Bedroom 1

Finding: Bedroom- presents in good condition and has been well maintained.
Smoke detector installed- Vendor to provide smoke detector compliance certification.



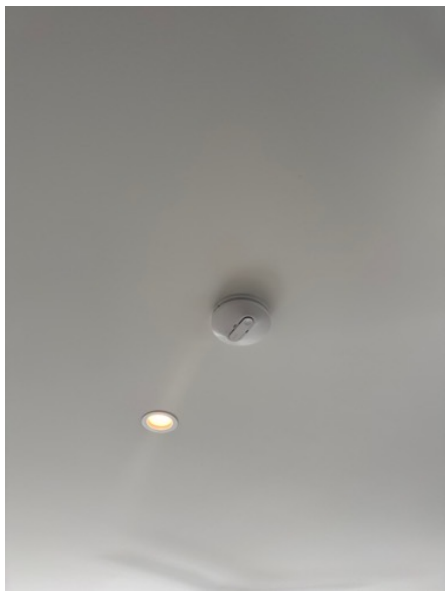

For your information 2.18

Location: Ensuite


Finding: Ensuite presents in good functional condition and has been well maintained.

Vanity bench Top: Stone material.

Shower Screen: Glass.

Ventilation: Natural (window) and mechanical exhaust.

Water pressure is satisfactory with water draining away.

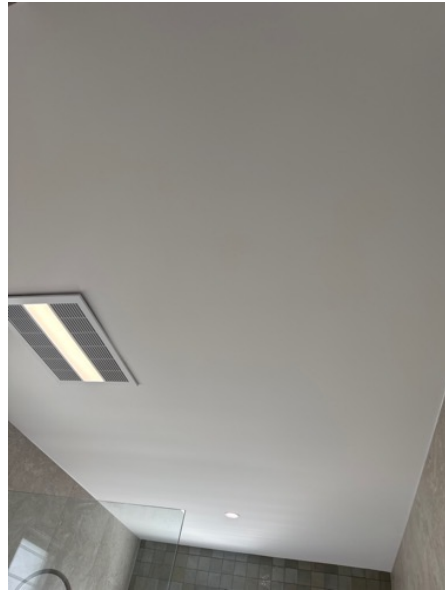







For your information 2.19

Location: Study

Finding: Study appears in good condition.

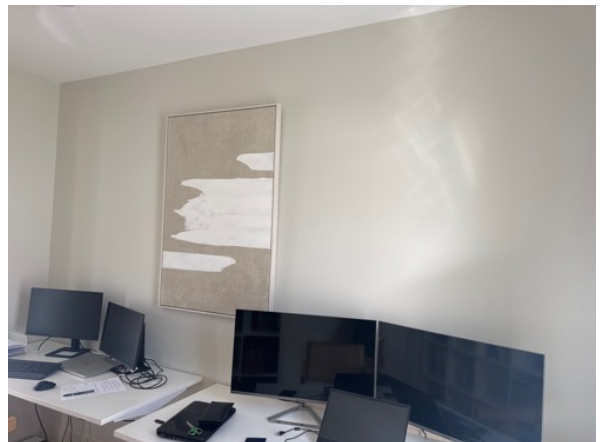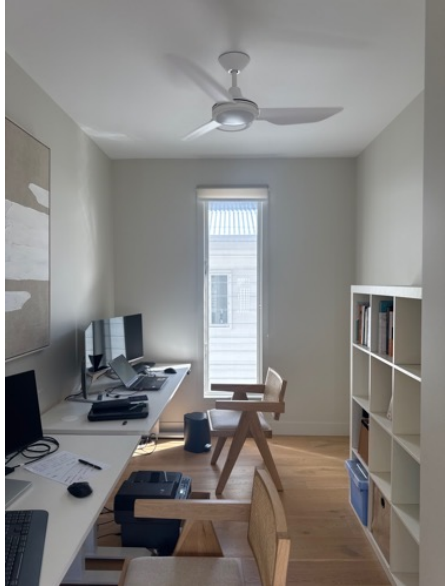



For your information 2.20

Location: Living area

Finding: Living area presents in good condition and has been well maintained.
Good condition.






For your information 2.21

Location: Bedroom 2

Finding: Bedroom- presents in good condition and has been well maintained.
Smoke detector installed- Vendor to provide smoke detector compliance certification.



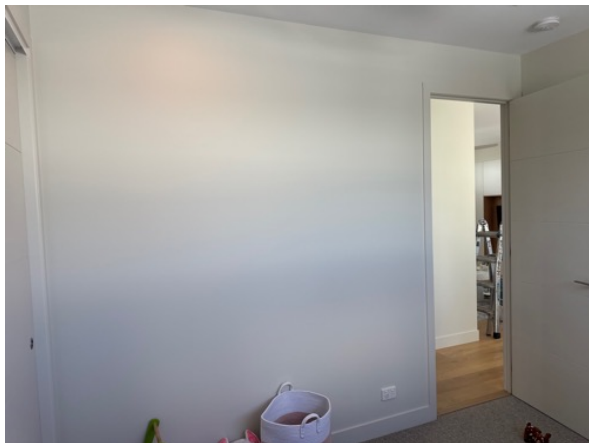

For your information 2.22

Location: Toilet


Finding: Dual flush toilet is in good functional condition.
Half and full flush functional.





For your information 2.23

Location: Bedroom 3

Finding: Bedroom- presents in good condition and has been well maintained.
Smoke detector installed- Vendor to provide smoke detector compliance certification.

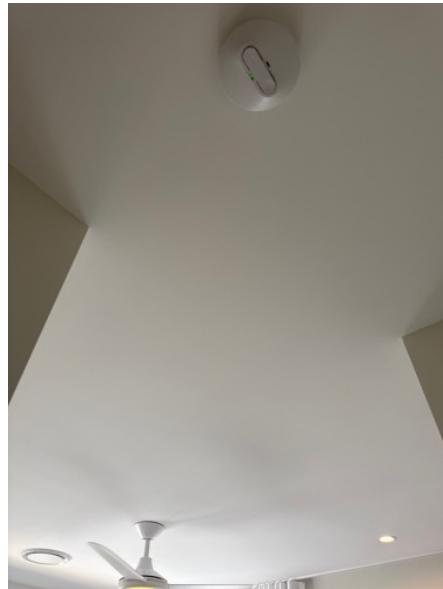

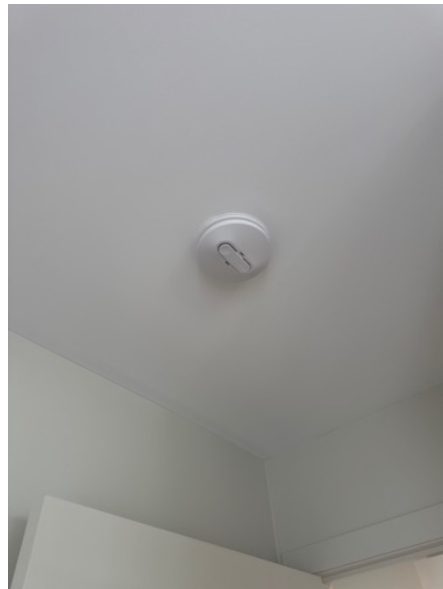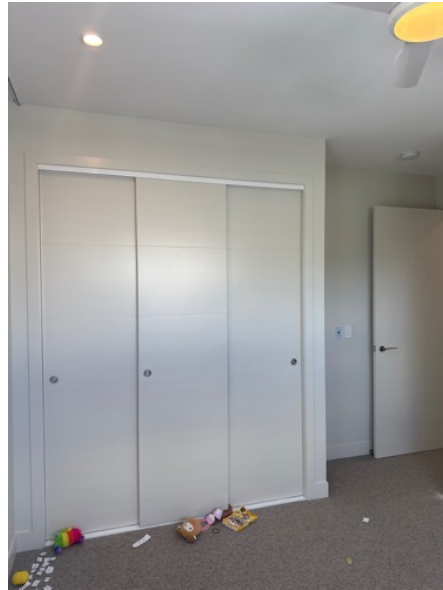

For your information 2.24

Location: Bathroom

Finding: Bathroom- good functional condition and has been well maintained.


Vanity bench Top: Stone material.


Shower Screen: Glass.

Bath: Acrylic.

Ventilation: Natural (window) and mechanical exhaust.

Water pressure is satisfactory with water draining away.

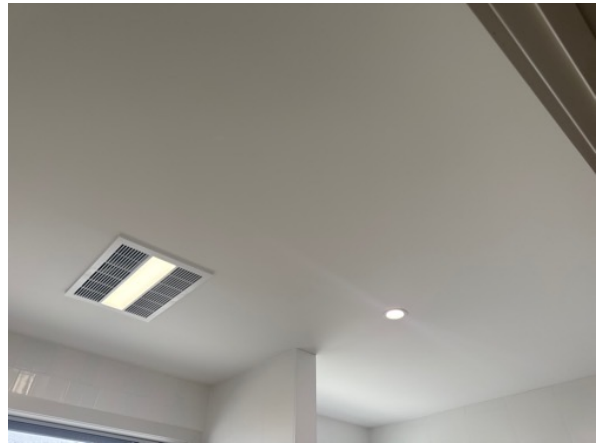



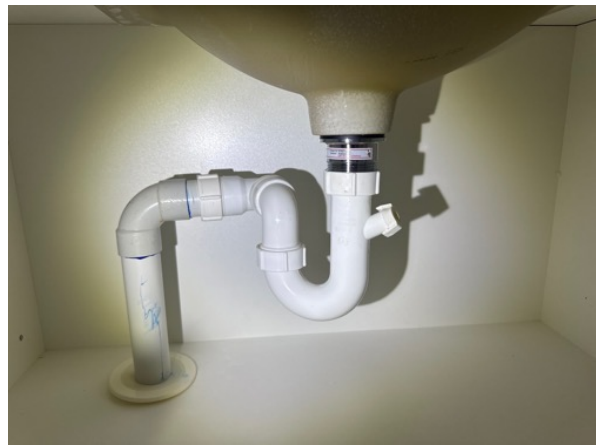





For your information 2.25

Location: Bedroom 4

Finding: Bedroom- presents in good condition and has been well maintained.
Smoke detector installed- Vendor to provide smoke detector compliance certification.

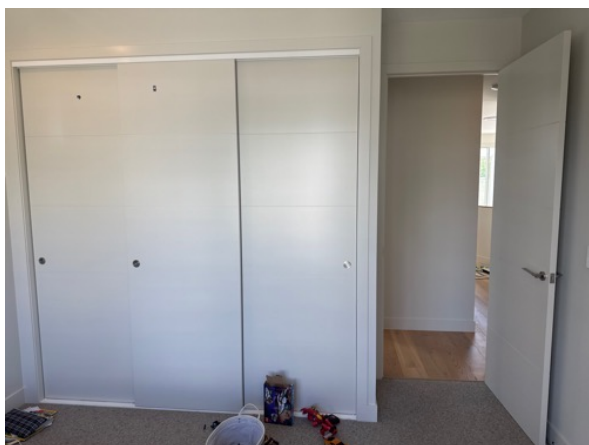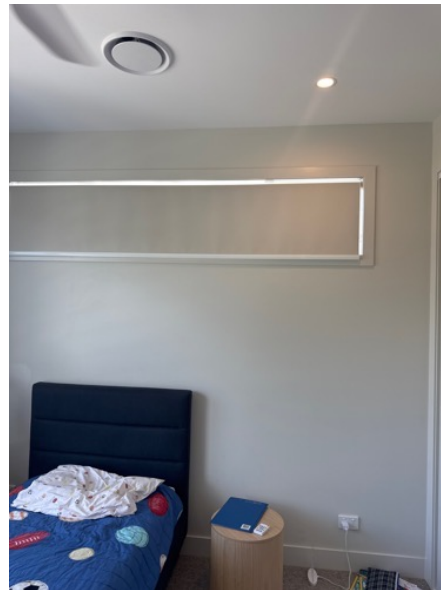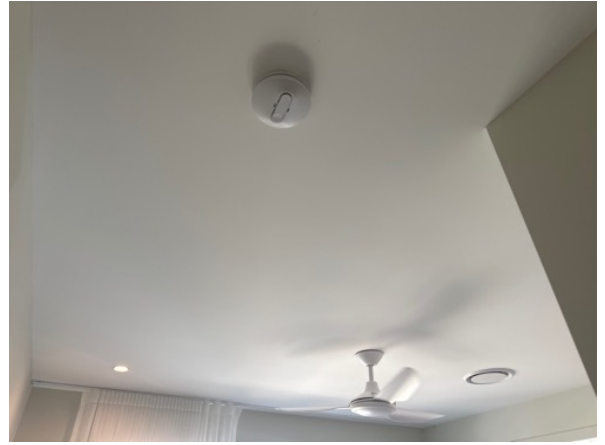

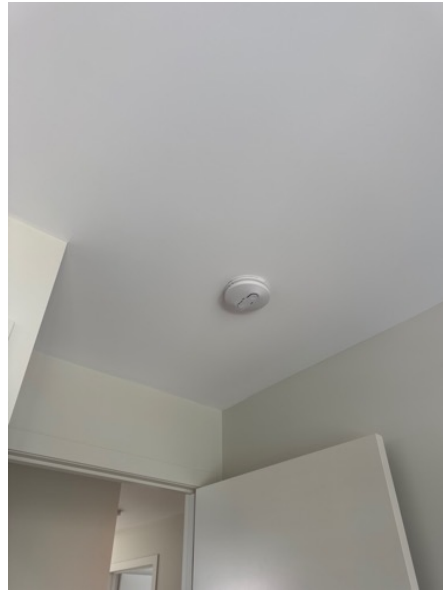

For your information 2.26

Location: Hallway

Finding: Hallway presents in good condition.

Smoke detector installed- Vendor to provide smoke detector compliance certification.





For your information 2.27

Location: Roofspace

Finding: Pine truss roof frame supports metal roofing system.
Appears in good condition with fibreglass thermal insulation installed.







For your information 2.28

Location: Laundry

Finding: Laundry and facilities appear in good functional condition.
Water pressure is satisfactory with water draining away.

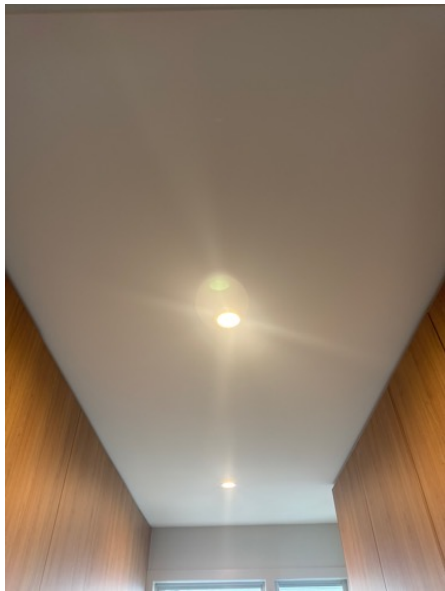


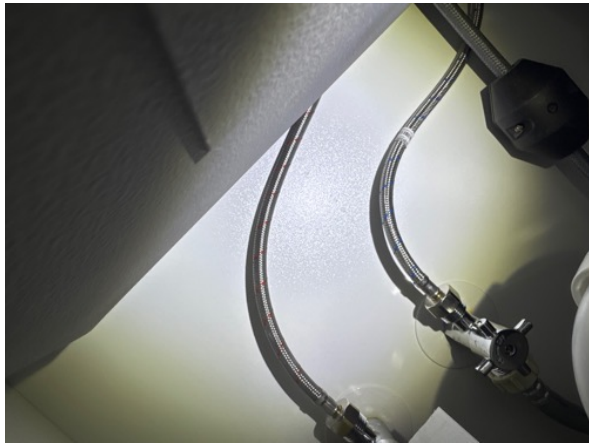

For your information 2.29

Location: Toilet- Ground Level

Finding: Dual flush toilet is in good functional condition.
Half and full flush functional.

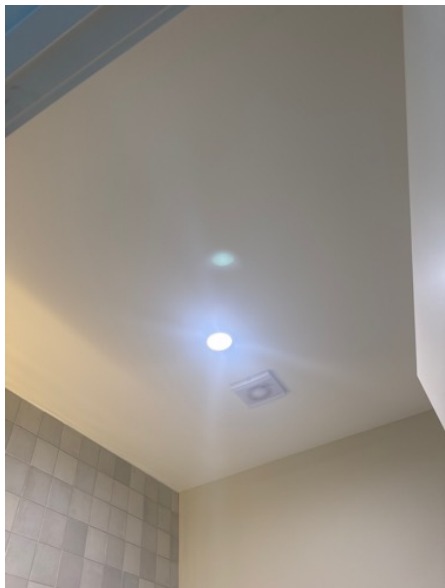




For your information 2.30

Location: Living area

Finding: Living area presents in good condition and has been well maintained.
Good condition.

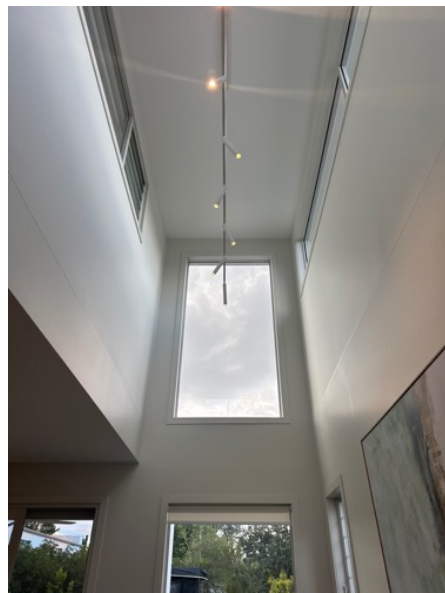



For your information 2.31

Location:

Kitchen

Finding:

Kitchen- good functional condition and has been well maintained.

Bench Top: Stone material.

Cook Top: Electric induction.

Oven: Electric.


Rangehood: Ducted exhaust unit.

Dishwasher: not tested for function- display panel was functional when turned on.

Water pressure is satisfactory with water draining away.





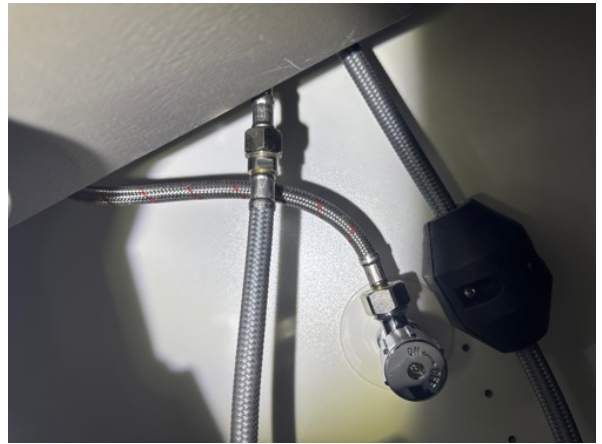

For your information 2.32

Location: Air Conditioning Services

Finding: Ducted air conditioning unit is functional.

Units should be serviced and cleaned regularly to ensure optimal operation and hygiene.



For your information 2.33

Location: Living area

Finding: Ducted air conditioning outlet has confirmed cool air flowing.
Blue colouring of thermal image confirms cool air flow.





For your information 2.34

Location: Kitchen

Finding: Ducted air conditioning outlet has confirmed cool air flowing.
Blue colouring of thermal image confirms cool air flow.



For your information 2.35

Location: Bedroom 1

Finding: Ducted air conditioning outlet has confirmed cool air flowing.
Blue colouring of thermal image confirms cool air flow.



For your information 2.36

Location: Living area

Finding: Ducted air conditioning outlet has confirmed cool air flowing.
Blue colouring of thermal image confirms cool air flow.





For your information 2.37

Location: Bedroom 2

Finding: Ducted air conditioning outlet has confirmed cool air flowing.
Blue colouring of thermal image confirms cool air flow.



For your information 2.38

Location: Bedroom 3

Finding: Ducted air conditioning outlet has confirmed cool air flowing.
Blue colouring of thermal image confirms cool air flow.



For your information 2.39

Location: Bedroom 4


Finding: Ducted air conditioning outlet has confirmed cool air flowing.
Blue colouring of thermal image confirms cool air flow.



For your information 2.40

Location: Stairwell

Finding: Internal stairs and handrail appear in good condition.
Handrail is rigid.

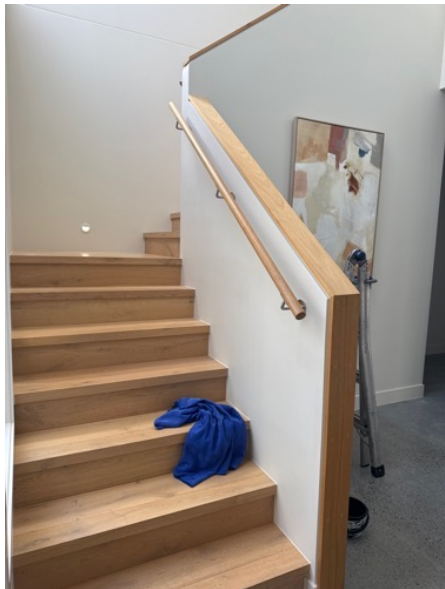

Conclusion

Your attention is drawn to the advice contained in the Terms and Conditions of this Report including any special conditions or instructions that need to be considered in relation to this Report.

In the opinion of this Consultant:

The incidence of Major Defects in this property in comparison to the average condition of similar buildings of approximately the same age that have been reasonably well maintained was considered:

Below average

The incidence of Minor Defects in this property in comparison to the average condition of similar buildings of approximately the same age that have been reasonably well maintained was considered:

Below average

In conclusion, following the inspection of surface work in the readily accessible areas of the property, the overall condition of the building relative to the average condition of similar buildings of approximately the same age that have been reasonably well maintained was considered:

Above average

Building consultant's summary

TWO STOREY TIMBER FRAMED HOUSE

Site assessment of this property has been completed as per request and this report is a summary of findings both positive and others which require attention to repair or maintain the property.

Timber pest inspection completed with visual assessment, acoustic impact testing, moisture meter testing and thermal imaging camera.

Where roof access exceeds that which is considered safe, drone camera assessment has been completed.

The property is a two storey timber framed construction which presents in good functional condition and has been well maintained.

Building Material Summary:

Wall Frames- Pine timber frame.

Sub Floor- Timber.

Cladding- Fibre cement sheet panel and linear cladding.

Roof Frame- Pine truss frame.

Ceiling Insulation- Fibreglass.

Roof Exterior- Corrugated sheet metal.

Internal linings- Plasterboard wall and ceiling linings.

Level of Maintenance- Well maintained.

Some repairs are listed and recommended to be addressed to maintain the good condition of the property.

Smoke detector compliance certification is a requirement of current QLD property sale legislation. This documentation should be provided by Vendor.

A chemical termite barrier is recommended for all properties to reduce the risk of concealed termite access.

Ensure regular timber pest inspections are conducted at no longer than 12 month intervals, or as advised by the responsible termite management system Contractor.

As compared to similar properties of similar vintage and location, the property presents in good tidy condition overall.

Summary

SUMMARY INFORMATION: The summary below is used to give a brief overview of observations made in each inspection area. The items listed in the summary are noted in detail under the applicable sub headings within the body of the report. The summary is NEVER to be relied upon as a comprehensive report and the client MUST read the entire report and not rely solely on this summary. If there is a discrepancy between the information provided in this summary and that contained within the body of the Report, the information in the body of the Report shall override this summary. (See definitions & information below the summary to help understand the report)

Evidence of active (live) termites	Not Found
Evidence of termite activity (including workings) and/or damage	Not Found
Evidence of a possible previous termite management program	Found
Evidence of chemical delignification damage	Not Found
Evidence of fungal decay activity and/or damage	Not Found
Evidence of wood borer activity and/or damage	Not Found
Evidence of conditions conducive to timber pest attack	Not Found
Next inspection to help detect a future termite attack is recommended in	1 Years

Undetected timber pest defect risk assessment

Due to the level of accessibility for inspection including the presence of obstructions, the overall degree of risk of undetected timber pest attack and conditions conducive to timber pest attack was considered:

MODERATE

A further inspection is strongly recommended of those areas that were not readily accessible and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This will involve a separate visit to the site, permission from the owner of the property and additional cost.

Unless stated otherwise, any recommendation or advice given in this Report should be implemented as a matter of urgency.

For further information including advice on how to help protect against financial loss due to timber pest attack.

Significant Items

The following items and matters were reported on in accordance with the Scope of Inspection. For building elements not identified in this Condition Report, monitoring and normal maintenance must be carried out.

Timber pest attack

ACTIVE (LIVE) TERMITES

Important Note. As a delay may exist between the time of an attack and the appearance of telltale signs associated with an attack, it is possible that termite activity and damage exists though not discernible at the time of inspection.

No evidence was found

TERMITE WORKINGS AND/OR DAMAGE

No evidence was found

CHEMICAL DELIGNIFICATION

No evidence was found

FUNGAL DECAY

No evidence was found

WOOD BORERS

No evidence was found

Conditions conducive to timber pest attack

LACK OF ADEQUATE SUBFLOOR VENTILATION

No evidence was found

THE PRESENCE OF EXCESSIVE MOISTURE

No evidence was found

BRIDGING OR BREACHING OF TERMITE MANAGEMENT SYSTEMS AND INSPECTION ZONES

No evidence was found

UNTREATED OR NON-DURABLE TIMBER USED IN A HAZARDOUS ENVIRONMENT

No evidence was found

OTHER CONDITIONS CONDUCTIVE TO TIMBER PEST ATTACK

No evidence was found

Serious Safety Hazards

No evidence of Serious Safety Hazards were found

For your information

SUBTERRANEAN TERMITE MANAGEMENT PROPOSAL

No evidence was found

PREVIOUS TERMITE MANAGEMENT PROGRAM


For your information 3.01

Location: Kitchen

Finding: Original construction physical termite barrier installed.

Ensure termite management maintenance such as clearance of items always from house, trim vegetation, minimum 75mm clear visual inspection area under the termite barrier and adequate drainage of areas adjacent to external walls is maintained.

Refer to attached Termite Management information, and contact the installer of system for further information to reduce risk of concealed termite access.

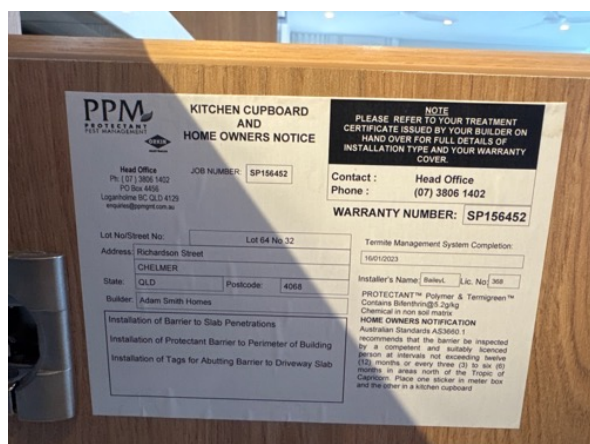

Head Office
Ph: (07) 3806 1402
PO Box 4456
Loganholme BC QLD 4129
enquiries@ppmgt.com.au

JOB NUMBER: SP156452

Lot No/Street No: Lot 64 No 32

Address: Richardson Street
CHELMER

State: QLD Postcode: 4068

Builder: Adam Smith Homes

Installation of Barrier to Slab Penetrations
Installation of Protectant Barrier to Perimeter of Building


CHELMER

State: QLD Postcode: 4068

Builder: Adam Smith Homes

Installation of Barrier to Slab Penetrations
Installation of Protectant Barrier to Perimeter of Building
Installation of Tags for Abutting Barrier to Driveway Slab



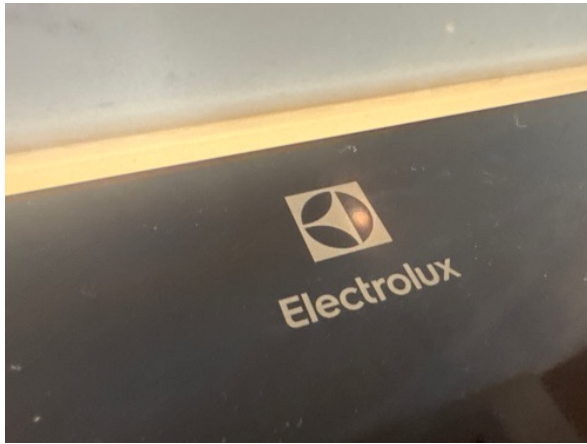

Conclusion

Your attention is drawn to the advice contained in the Terms and Conditions of this Report including any special conditions or instructions that need to be considered in relation to this Report.

The following Timber Pest remediation actions are recommended:

1. No treatment of Timber Pest Attack is required.
2. In addition to this Report a Subterranean Termite Management Proposal to help manage the risk of future subterranean termite access to buildings and structures is recommended.
3. No removal of Conditions Conducive to Timber Pest Attack is necessary.
4. Due to the susceptibility of the property to sustaining Timber Pest Attack the next inspection is recommended in 1 Years

Risk management options


To help protect against financial loss, it is essential that the building owner immediately control or rectify any evidence of destructive timber pest activity or damage identified in this Report. The Client should further investigate any high risk area where access was not gained. It is strongly advised that appropriate steps be taken to remove, rectify or monitor any evidence of conditions conducive to timber pest attack.

To help minimise the risk of any future loss, the Client should consider whether the following options to further protect their investment against timber pest infestation are appropriate for their circumstances:

Undertake thorough regular inspections at intervals not exceeding twelve months or more frequent inspections where the risk of timber pest attack is high or the building type is susceptible to attack. To further reduce the risk of subterranean termite attack, implement a management program in accordance with Australian Standard AS 3660. This may include the installation of a monitoring and/or baiting system, or chemical and/or physical management system. However, AS 3660 stresses that subterranean termites can bridge or breach management systems and inspection zones and that thorough regular inspections of the building are necessary.

If the Client has any queries or concerns regarding this Report, or the Client requires further information on a risk management program, please do not hesitate to contact the person who carried out this Inspection.

Signature of consultant -

A handwritten signature in black ink, appearing to read "Amey". The signature is written in a cursive style with a horizontal line across the middle of the letters.

Definitions to help you better understand this report

----- PROPERTY INSPECTION REPORT -----

“Client” The person or persons, for whom the Inspection Report was carried out or their Principal (i.e. the person or persons for whom the report is being obtained).

“Building Consultant” A person, business or company who is qualified and experienced to undertake a pre-purchase inspection in accordance with Australian Standard AS 4349.1-2007 ‘Inspection of Buildings. Part 1: Pre-Purchase Inspections – Residential Buildings’. The consultant must also meet any Government licensing requirement, where applicable.

“Building and Site” The inspection of the nominated residence together with relevant features including any car accommodation, detached laundry, ablution facilities and garden sheds, retaining walls more than 700 mm high, paths and driveways, steps, fencing, earth, embankments, surface water drainage and stormwater run-off within 30 m of the building, but within the property boundaries.

“Readily Accessible Areas” Areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels or accessible from a 3.6 metre ladder, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. Or where these clearances are not available, areas within the consultant’s unobstructed line of sight and within arm’s length.

“Structure” The loadbearing part of the building, comprising the Primary Elements.

“Primary Elements” Those parts of the building providing the basic loadbearing capacity to the Structure, such as foundations, footings, floor framing, loadbearing walls, beams or columns. The term ‘Primary Elements’ also includes other structural building elements including: those that provide a level of personal protection such as handrails; floor-to-floor access such as stairways; and the structural flooring of the building such as floorboards.

“Structural Damage” A significant impairment to the integrity of the whole or part of the Structure falling into one or more of the following categories:

(a) Structural Cracking and Movement – major (full depth) cracking forming in Primary Elements resulting from differential movement between or within the elements of construction, such as foundations, footings, floors, walls and roofs.

(b) Deformation – an abnormal change of shape of Primary Elements resulting from the application of load(s).

(c) Dampness – the presence of moisture within the building, which is causing consequential damage to Primary Elements.

(d) Structural Timber Pest Damage – structural failure, i.e. an obvious weak spot, deformation or even collapse of timber Primary Elements resulting from attack by one or more of the following wood destroying agents: chemical delignification; fungal decay; wood borers; and termites.

“Conditions Conducive to Structural Damage” Noticeable building deficiencies or environmental factors that may contribute to the occurrence of Structural Damage.

“Secondary Elements” Those parts of the building not providing loadbearing capacity to the Structure, or those non-essential elements which, in the main, perform a completion role around openings in Primary Elements and the building in general such as non-loadbearing walls, partitions, wall linings, ceilings, chimneys, flashings, windows, glazing or doors.

“Finishing Elements” The fixtures, fittings and finishes applied or affixed to Primary Elements and Secondary Elements such as baths, water closets, vanity basins, kitchen cupboards, door furniture, window hardware, render, floor and wall tiles, trim or paint. The term ‘Finishing Elements’ does not include furniture or soft floor coverings such as carpet and

tiles, trim or paint. The term 'Finishing Elements' does not include furniture or soft floor coverings such as carpet and lino.

"Major Defect" A defect of significant magnitude where rectification has to be carried out in order to avoid unsafe conditions, loss of utility or further deterioration of the property.

"Minor Defect" A defect other than a Major Defect.

"Serious Safety Hazard" Any item that may constitute an immediate or imminent risk to life, health or property. Occupational, health and safety or any other consequence of these hazards has not been assessed.

"Tests" Where appropriate the carrying out of tests using the following procedures and instruments:

(a) Dampness Tests means additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be particularly susceptible to damp problems. Instrument testing using electronic moisture detecting meter of those areas and other visible accessible elements of construction showing evidence of dampness was performed.

(b) Physical Tests means the following physical actions undertaken by the consultant: opening and shutting of doors, windows and draws; operation of taps; water testing of shower recesses; and the tapping of tiles and wall plaster."

----- TIMBER PEST INSPECTION REPORT -----

"Timber Pest Attack" Timber Pest Activity and/or Timber Pest Damage.

"Timber Pest Activity" Telltale signs associated with 'active' (live) and/or 'inactive' (absence of live) Timber Pests at the time of inspection.

"Timber Pest Damage" Noticeable impairments to the integrity of timber and other susceptible materials resulting from attack by Timber Pests.

"Major Safety Hazard" Any item that may constitute an immediate or imminent risk to life, health or property resulting directly from Timber Pest Attack. Occupational, health and safety or any other consequence of these hazards has not been assessed.

"Conditions Conducive to Timber Pest Attack" Noticeable building deficiencies or environmental factors that may contribute to the presence of Timber Pests.

"Readily Accessible Areas" Areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels or accessible from a 3.6 metre ladder, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. The term 'readily accessible' also includes:

- (a) accessible subfloor areas on a sloping site where the minimum clearance is not less than 150 mm high, provided that the area is not more than 2 metres from a point with conforming clearance (i.e. 400 mm high by 600 mm wide); and
- (b) areas at the eaves of accessible roof spaces that are within the consultant's unobstructed line of sight and within arm's length from a point with conforming clearance (i.e. 600 mm high by 600 mm wide).

"Client" The person or persons for whom the Timber Pest Report was carried out or their Principal (i.e. the person or persons for whom the report was being obtained).

"Timber Pest Detection Consultant" A person who meets the minimum skills requirement set out in the current Australian Standard AS 4349.3 Inspections of Buildings. Part 3: Timber Pest Inspection Reports or state/territory legislation requirements beyond this Standard, where applicable.

"Building and Site" The main building (or main buildings in the case of a building complex) and all timber structures (such as outbuildings, landscaping, retaining walls, fences, bridges, trees and stumps with a diameter greater than 100 mm and timber embedded in soil) and the land within the property boundaries up to a distance of 50 metres from the main building(s).

"Timber Pests" One or more of the following wood destroying agents which attack timber in service and affect its

“Timber Pests” One or more of the following wood destroying agents which attack timber in service and affect its structural properties:

- (a) Chemical Delignification - the breakdown of timber through chemical action
- (b) Fungal Decay - the microbiological degradation of timber caused by soft rot fungi and decay fungi, but does not include mould, which is a type of fungus that does not structurally damage wood.
- (c) Wood Borers - wood destroying insects belonging to the order ‘Coleoptera’ which commonly attack seasoned timber.
- (d) Termites - wood destroying insects belonging to the order ‘Isoptera’ which commonly attack seasoned timber.

“Tests” Additional attention to the visual examination was given to those accessible areas which the consultant’s experience has shown to be particularly susceptible to attack by Timber Pests. Instrument Testing of those areas and other visible accessible timbers/materials/areas showing evidence of attack was performed.

“Instrument Testing” Where appropriate the carrying out of Tests using the following techniques and instruments:

- (a) electronic moisture detecting meter - an instrument used for assessing the moisture content of building elements;
- (b) stethoscope - an instrument used to hear sounds made by termites within building elements;
- (a) probing - a technique where timber and other materials/areas are penetrated with a sharp instrument (e.g. bradawl or pocket knife), but does not include probing of decorative timbers or finishes, or the drilling of timber and trees; and
- (d) sounding - a technique where timber is tapped with a solid object.

“Subterranean Termite Management Proposal” A written proposal in accordance with Australian Standard AS 3660.2 to treat a known subterranean termite infestation and/or manage the risk of concealed subterranean termite access to buildings and structures.

Terms on which this report was prepared

----- PROPERTY INSPECTION REPORT -----

SERVICE As requested by the Client, the inspection carried out by the Building Consultant (“the Consultant”) was a ‘Standard Property Report’.

PURPOSE OF INSPECTION The purpose of this inspection is to provide advice to the Client regarding the condition of the Building and Site at the time of inspection.

SCOPE OF INSPECTION This Report only covers and deals with any evidence of: Major Defects in the condition of Primary Elements including Structural Damage and Conditions Conducive to Structural Damage; any Major Defect in the condition of Secondary Elements and Finishing Elements; collective (but not individual) Minor Defects; and any Serious Safety Hazard discernible at the time of inspection. The inspection is limited to the Readily Accessible Areas of the Building and Site (see Note below) and is based on a visual examination of surface work (excluding furniture and stored items), and the carrying out of Tests.

Note. With strata and company title properties, the inspection was limited to the interior and the immediate exterior of the particular residence inspected. Common property was not inspected.

ACCEPTANCE CRITERIA The building was compared with a building that was constructed in accordance with the generally accepted practice at the time of construction and which has been maintained such that there has been no significant loss of strength and serviceability.

Unless noted in “Special Conditions or Instructions”, the Report assumes that the existing use of the building will continue.

This Report only records the observations and conclusions of the Consultant about the readily observable state of the property at the time of inspection. The Report therefore cannot deal with:

- (a) possible concealment of defects, including but not limited to, defects concealed by lack of accessibility,

(a) possible concealment of defects, including but not limited to, defects concealed by lack of accessibility, obstructions such as furniture, wall linings and floor coverings, or by applied finishes such as render and paint; and

(b) undetectable or latent defects, including but not limited to, defects that may not be apparent at the time of inspection due to seasonal changes, recent or prevailing weather conditions, and whether or not services have been used some time prior to the inspection being carried out.

These matters outlined above in (a) & (b) are excluded from consideration in this Report.

If the Client has any doubt about the purpose, scope and acceptance criteria on which the Report was based please discuss your concerns with the Consultant on receipt of the Report.

The Client acknowledges that, unless stated otherwise, the Client as a matter of urgency should implement any recommendation or advice given in this Report.

LIMITATIONS

The Client acknowledges:

1. 'Visual only' inspections are not recommended. A visual only inspection may be of limited use to the Client. In addition to a visual inspection, to thoroughly inspect the Readily Accessible Areas of the property requires the Consultant to carry out when ever necessary appropriate Tests.

2. This Report does not include the inspection and assessment of items or matters outside the scope of the requested inspection and report. Other items or matters may be the subject of a Special-Purpose Inspection Report, which is adequately specified (see Exclusions below).

3. This Report does not include the inspection and assessment of items or matters that do not fall within the Consultant's direct expertise.

4. The inspection only covered the Readily Accessible Areas of the property. The inspection did not include areas, which were inaccessible, not readily accessible or obstructed at the time of inspection. Obstructions are defined as any condition or physical limitation which inhibits or prevents inspection and may include – but are not limited to – roofing, fixed ceilings, wall linings, floor coverings, fixtures, fittings, furniture, clothes, stored articles/materials, thermal insulation, sarking, pipe/duct work, builder's debris, vegetation, pavements or earth.

5. Australian Standard AS4349.0-2007 Inspection of Buildings, Part 0: General Requirements recognises that a property report is not a warranty or an insurance policy against problems developing with the building in the future.

6. This Report was produced for the use of the Client. The Consultant is not liable for any reliance placed on this report by any third party.

EXCLUSIONS

The Client acknowledges that this Report does not cover or deal with:

- (i) any individual Minor Defect;
- (ii) solving or providing costs for any rectification or repair work;
- (iii) the structural design or adequacy of any element of construction;
- (iv) detection of wood destroying insects such as termites and wood borers;
- (v) the operation of fireplaces and chimneys;
- (vi) any services including building, engineering (electronic), fire and smoke detection or mechanical;
- (vii) lighting or energy efficiency;
- (viii) any swimming pools and associated pool equipment or spa baths and spa equipment or the like;
- (ix) any appliances such as dishwashers, insinkers, ovens, stoves and ducted vacuum systems;
- (x) a review of occupational, health or safety issues such as asbestos content, the provision of safety glass or the use of lead based paints;
- (xi) a review of environmental or health or biological risks such as toxic mould;
- (xii) whether the building complies with the provisions of any building Act, code, regulation(s) or by-laws;
- (xiii) whether the ground on which the building rests has been filled, is liable to subside, swell or shrink, is subject to landslip or tidal inundation, or if it is flood prone; and
- (xiv) in the case of strata and company title properties, the inspection of common property areas or strata/company records.

records.

Any of the above matters may be the subject of a special-purpose inspection report, which is adequately specified and undertaken by an appropriately qualified inspector.

----- TIMBER PEST INSPECTION REPORT -----

SERVICE As requested by the Client, the inspection carried out by the Timber Pest Detection Consultant ("the Consultant") was a "Pre-Purchase Standard Timber Pest Report".

PURPOSE The purpose of this inspection is to assist the Client to identify and understand any Timber Pest issues observed at the time of inspection.

SCOPE OF INSPECTION This Report only deals with the detection or non detection of Timber Pest Attack and Conditions Conducive to Timber Pest Attack discernible at the time of inspection. The inspection was limited to the Readily Accessible Areas of the Building & Site (see Note below) and was based on a visual examination of surface work (excluding furniture and stored items), and the carrying out of Tests.

Note. With strata and company title properties, the inspection was limited to the interior and the immediate exterior of the particular residence inspected. Common property was not inspected.

ACCEPTANCE CRITERIA Unless noted in "Special Conditions or Instructions", the building being inspected was compared with a similar building. To the Consultant's knowledge the similar building used for comparison was constructed in accordance with generally accepted timber pest management practices and has since been maintained during all its life not to attract or support timber pest infestation.

Unless noted in "Special Conditions or Instructions", this Report assumes that the existing use of the building will continue.

This Report only records the observations and conclusions of the Consultant about the readily observable state of the property at the time of inspection. This Report therefore cannot deal with:

- (a) possible concealment of timber pest attack, including but not limited to, timber pest attack concealed by lack of accessibility, obstructions such as furniture, wall linings and floor coverings, or by applied finishes such as render and paint; and
- (b) undetectable or latent timber pest attack, including but not limited to, timber pest attack that may not be apparent at the time of inspection due to seasonal changes, recent or prevailing weather conditions, and whether or not services have been used some time prior to the inspection being carried out.

These matters outlined above in (a) & (b) are excluded from consideration in this Report.

If the Client has any doubt about the purpose, scope and acceptance criteria on which this Report was based please discuss your concerns with the Consultant on receipt of this Report.

The Client acknowledges that, unless stated otherwise, the Client as a matter of urgency should implement any recommendation or advice given in this Report.

LIMITATIONS

The Client acknowledges:

1. This Report does not include the inspection and assessment of matters outside the scope of the requested inspection and report.
2. The inspection only covered the Readily Accessible Areas of the Building and Site. The inspection did not include areas which were inaccessible, not readily accessible or obstructed at the time of inspection. Obstructions are defined as any condition or physical limitation which inhibits or prevents inspection and may include – but are not limited to – roofing, fixed ceilings, wall linings, floor coverings, fixtures, fittings, furniture, clothes, stored articles/materials, thermal insulation, sarking, pipe/duct work, builder's debris, vegetation, pavements or earth.
3. The detection of drywood termites may be extremely difficult due to the small size of the colonies. No warranty of

insulation, sarking, pipe/duct work, builder's debris, vegetation, pavements or earth.

3. The detection of drywood termites may be extremely difficult due to the small size of the colonies. No warranty of absence of these termites is given.

4. European House Borer (*Hylotrupes bajulus*) attack is difficult to detect in the early stages of infestation as the galleries of boring larvae rarely break through the affected timber surface. No warranty of absence of these borers is given. Regular inspections including the carrying out of appropriate tests are required to help monitor susceptible timbers.

5. This is not a structural damage report. Neither is this a warranty as to the absence of Timber Pest Attack.

6. If the inspection was limited to any particular type(s) of timber pest (e.g. subterranean termites), then this would be the subject of a Special-Purpose Inspection Report, which is adequately specified.

7. This Report does not cover or deal with environmental risk assessment or biological risks not associated with Timber Pests (e.g. toxic mould) or occupational, health or safety issues. Such advice may be the subject of a Special-Purpose Inspection Report which is adequately specified and must be undertaken by an appropriately qualified inspector. The choice of such inspector is a matter for the Client.

8. This Report has been produced for the use of the Client. The Consultant or their firm or company are not liable for any reliance placed on this report by any third party.

EXCLUSIONS

The Client acknowledges that:

1. This Report does not deal with any timber pest preventative or treatment measures, or provide costs for the control, rectification or prevention of attack by timber pests. However, this additional information or advice may be the subject of a timber pest management proposal which is adequately specified.