

Schedule of Condition - 8 October 2026

Project	Riverside Court - Cat B Fit-Out, Phase 2
Client	Halloway Cross Estates Ltd
Address	Riverside Court, 42 Kelham Street, Sheffield S3 8LP
Reference	SOC-2026-10-001
Report date	8 October 2026
Status	Draft - not yet published
Items included	27

SCHEDULE OF CONDITION

Scope and limitations

This is a record of the visible condition of the elements listed, as seen on the date of inspection. It is not a structural survey and not a building survey, and it does not report on any matter outside the visible condition of those elements. No opening up, no dismantling and no testing of any kind was carried out. Concealed or inaccessible areas are excluded, and no opinion is given on them. Nothing in this schedule is a specification, a scope of works or a construction instruction; any repair or replacement must be specified separately before work is carried out.

Not assessed - a person must resolve these

PHOTOGRAPHS CARRYING SEVERAL ITEMS

Each of these takes a page of its own: a numbered pin on the photograph for every item found on it, and those items listed underneath in pin order. An item's entry in the schedule points back at its pin.



Photograph 1 - 7 items on this photograph, 7 pins on this photograph

Findings on this photograph

Pin 1 - Item 21 - The grey rainscreen cladding panels to the principal elevation are visible across all four storeys.

Pin 2 - Item 22 - The curtain walling and window glazing to the elevation, including the full-height glazed entrance bay, are intact.

Pin 3 - Item 23 - A projecting canopy is present over the main entrance doors, finished in a dark soffit.

Pin 4 - Item 24 - The paved approach to the entrance is laid in modular block paving.

Pin 5 - Item 25 - A single column-form bollard luminaire is visible to the left of the paved approach.

Pin 6 - Item 26 - A lighting column is visible at the right-hand edge of the frame, serving the adjacent parking area.

Pin 7 - Item 27 - Ornamental shrub planting and deciduous trees in the beds adjoining the paved approach are visible.

Item 23

Status: Not assessed

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

A projecting canopy is present over the main entrance doors, finished in a dark soffit. The canopy appears generally sound, although the soffit is in shadow and the underside, fixings and drainage outlets cannot be inspected from this position. Minor soiling may be present on the leading edge but cannot be confirmed.

Required action

No action on the evidence available. The canopy soffit, fixings and drainage should be inspected from below at close quarters.



Pin 3 of 7 - photograph 1

A crop of the area this item refers to.

Item 24

Status: Not assessed

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

The paved approach to the entrance is laid in modular block paving. The surface appears level and intact, with no visible cracking, rutting, ponding or missing units. Moss or algae growth is visible in the joints within the landscaped margins, which is typical of the season and the shaded position.

Required action

Routine maintenance. Vegetation should be kept clear of the paving edges to prevent joint opening.



Pin 4 of 7 - photograph 1

A crop of the area this item refers to.

Item 25

Status: Not assessed

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

A single column-form bollard luminaire is visible to the left of the paved approach. The unit appears upright and intact. The lens, wiring and connections cannot be assessed from the photograph, and no assessment of whether the fitting is operational can be made.

Required action

No action on visual evidence. Function should be confirmed under the routine electrical inspection regime.



Pin 5 of 7 - photograph 1

A crop of the area this item refers to.

Item 26


Status: Not assessed

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

A lighting column is visible at the right-hand edge of the frame, serving the adjacent parking area. The column appears upright and painted. The base, door, connections and luminaire cannot be examined at this distance or within the frame.


Required action

No action on the evidence available. Base condition and earthing should be confirmed at close quarters.

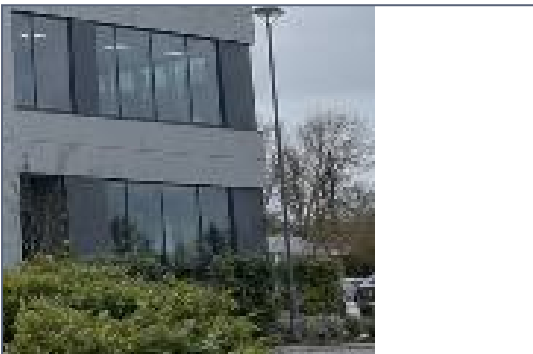

Pin 6 of 7 - photograph 1

A crop of the area this item refers to.

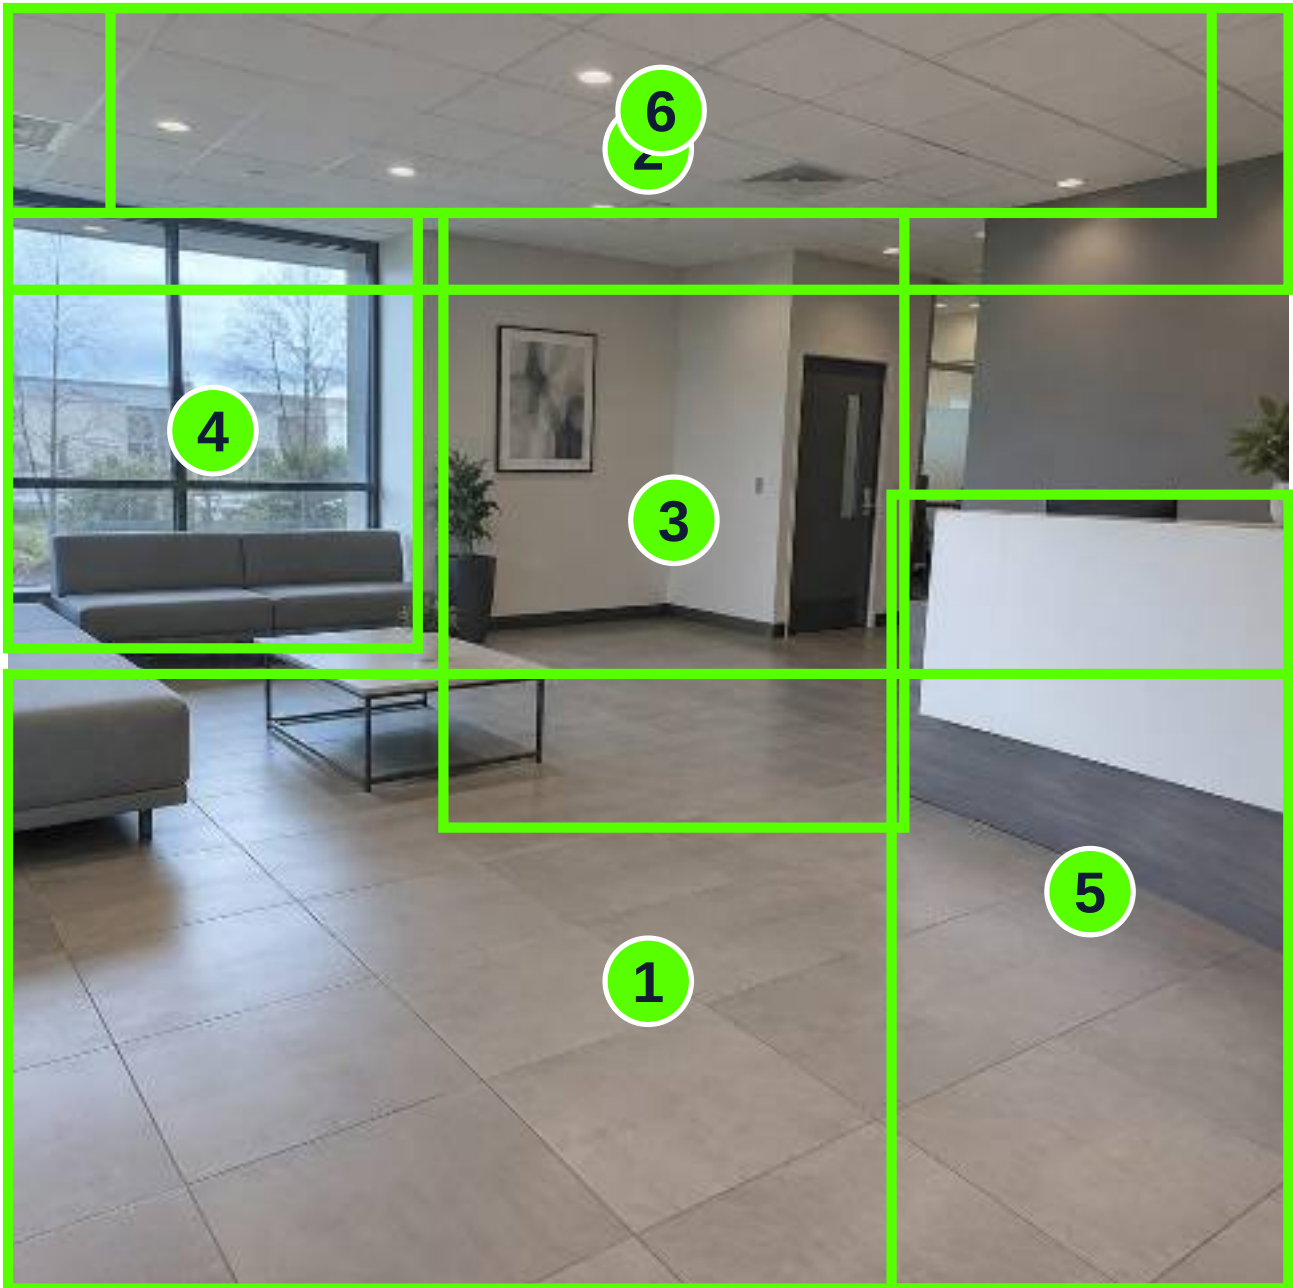

Photograph 3 - 6 items on this photograph, 6 pins on this photograph

Findings on this photograph

Pin 1 - Item 15 - The reception floor is finished in large-format rectangular tiles laid to a regular grid with narrow joints.

Pin 2 - Item 16 - A suspended ceiling of square tiles in a concealed grid spans the reception area, incorporating recessed downlighters...

Pin 3 - Item 17 - Internal partitions are finished in a light neutral paint with a darker contrasting panel to the right-hand wall, and...

Pin 4 - Item 18 - A large fixed glazed screen with dark metal framing forms the left-hand elevation, with a horizontal transom dividing...

Pin 5 - Item 19 - A reception desk occupies the right-hand side of the space, formed of a light-coloured upper face panel over a darker...

Pin 6 - Item 20 - Recessed circular downlighters are set into the ceiling grid and a number are illuminated as shown.

Item 20


Status: Not assessed

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

Recessed circular downlighters are set into the ceiling grid and a number are illuminated as shown. The fittings are flush with the ceiling plane and no damaged or displaced luminaire bezel is visible. The photograph does not show the fittings at sufficient proximity to assess lamp condition, lens cleanliness or emergency lighting provision.

Required action

No action required on the evidence available. Emergency lighting provision should be verified against test records rather than by photograph.

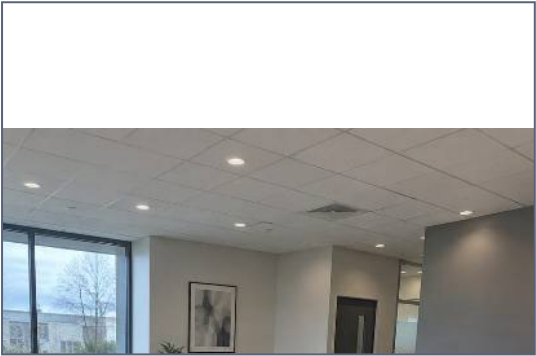

Pin 6 of 6 - photograph 3

A crop of the area this item refers to.

Item 1

Status: Not assessed

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

An entrance matting system of the aluminium rail and heel-resistant insert type is present, formed of parallel tread rails with profiled metal capping edges and mitred corner junctions. The insert material is visibly soiled and darkened across the width, indicating accumulated detritus. The aluminium rails present a bright, sound appearance with no visible distortion, displacement or missing sections within the photographed extent. The mitred junction at the left-hand edge is tight and the capping trim sits flat.

Required action

Routine maintenance is required. The matting inserts are to be cleaned in accordance with the manufacturer's guidance, and the rail fixings are to be checked and the well vacuumed at the next scheduled maintenance visit.



Severity not set

Item 21

Status: Graded - condition assessed

The grey rainscreen cladding panels to the principal elevation are visible across all four storeys. The panel faces appear sound and consistently aligned, with no separation, impact damage, staining or open joints discernible at this viewing distance. The condition of the panel fixings and the substrate behind the panels cannot be determined from the photograph.

Required action

No action. Routine wash-down may be scheduled as part of the standard maintenance regime.



Pin 1 of 7 - photograph 1

A crop of the area this item refers to.

Item 22

Status: Graded - condition assessed

The curtain walling and window glazing to the elevation, including the full-height glazed entrance bay, are intact. No cracked, crazed or displaced panes are visible, and the glazing lines read straight. Reflection and the viewing distance prevent any assessment of sealant condition, gasket condition or any interstitial condensation.

Required action

No action. Sealant and gasket condition should be verified at close quarters as part of routine maintenance.



Pin 2 of 7 - photograph 1

A crop of the area this item refers to.

Item 27

Status: Graded - condition assessed

Ornamental shrub planting and deciduous trees in the beds adjoining the paved approach are visible. The planting is established and the trees are bare, consistent with the dormant season. No obvious dieback, storm damage or fallen material is visible in the beds.


Required action

No action. Seasonal maintenance to continue as programmed.



Pin 7 of 7 - photograph 1

A crop of the area this item refers to.

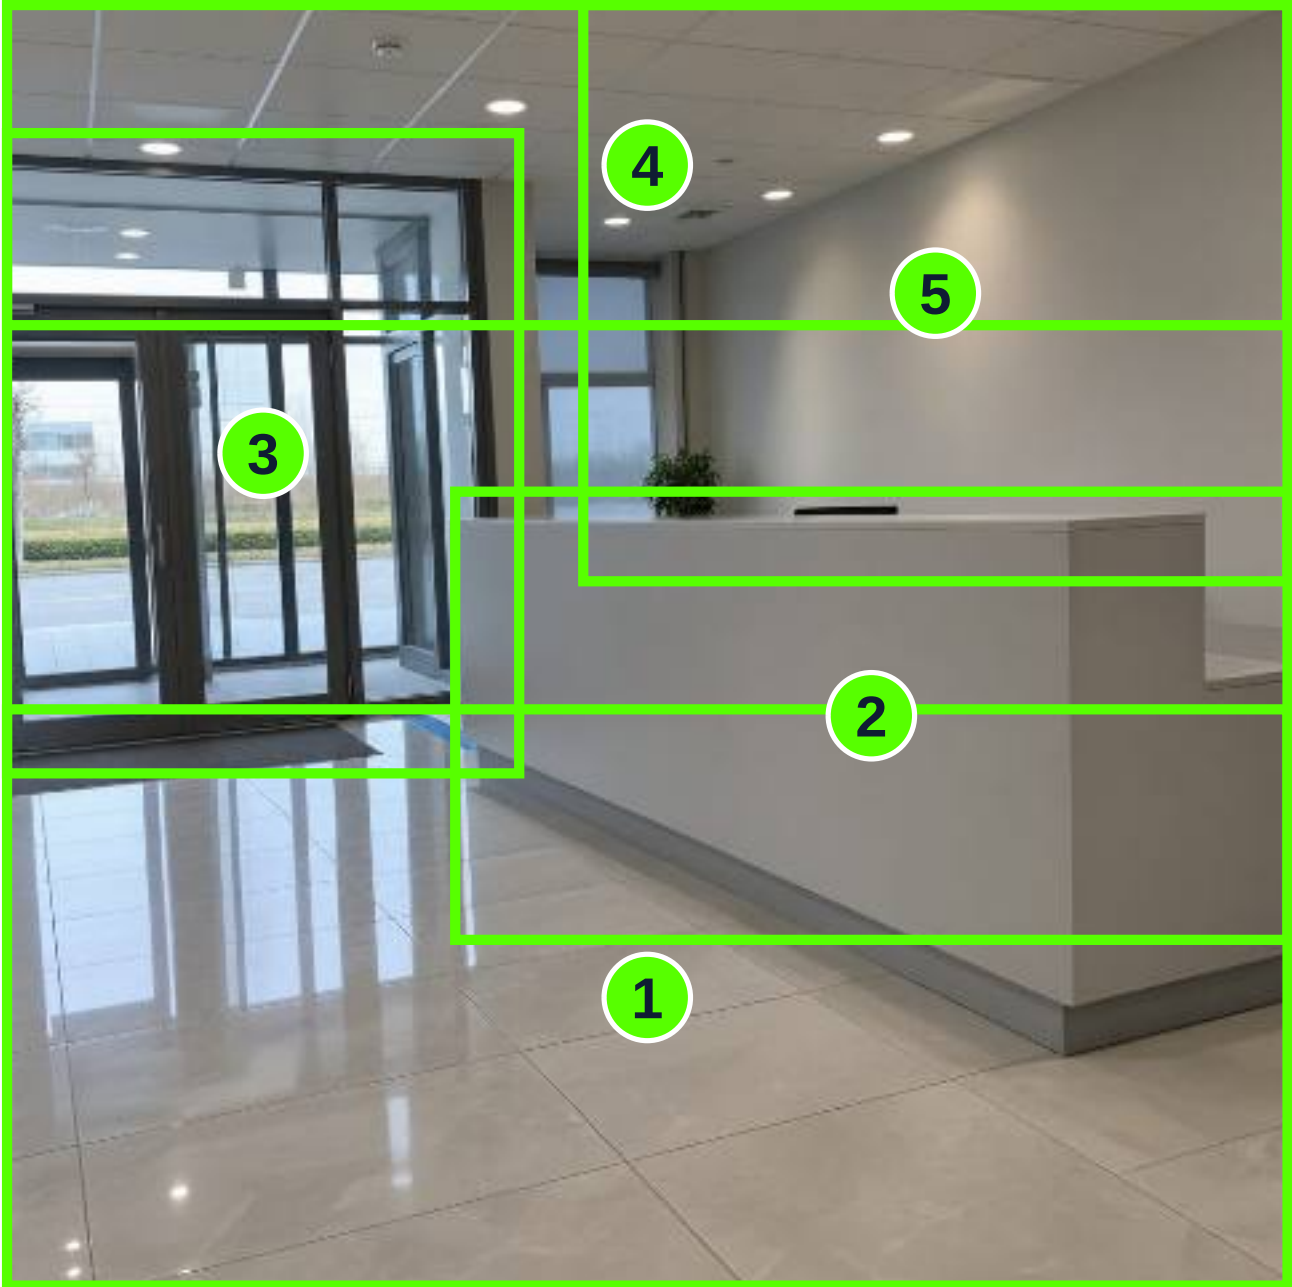

Photograph 2 - 5 items on this photograph, 5 pins on this photograph

Findings on this photograph

- Pin 1 - Item 10 - Reception floor finished with large-format polished stone-effect tiles laid to a grid, with a reflective surface.
- Pin 2 - Item 11 - A white reception desk is present to the centre right of the frame, of solid panel construction with a plain front an...
- Pin 3 - Item 12 - A full-height glazed entrance screen with aluminium frames is present to the left of the frame, comprising double doo...
- Pin 4 - Item 13 - A suspended ceiling of square lay-in tiles is present across the upper portion of the frame, with recessed downlights...
- Pin 5 - Item 14 - The walls to the reception area, including the return wall behind the desk, are finished with a plain painted or appl...


Item 10

Status: Graded - condition assessed

Reception floor finished with large-format polished stone-effect tiles laid to a grid, with a reflective surface. The tiles are visible across the foreground and toward the entrance; the surface appears clean and intact, with no visible cracking, lippage, staining or open joints within the area the photograph supports. Reflections from the ceiling lights and glazing are present, which is inherent to the polished finish. A strip of blue protective tape is present on the floor adjacent to the internal corner of the reception desk; this appears to be a temporary protective measure and is not recorded as a defect.

Required action

No action required to the floor finish. Remove the temporary protective tape once the adjacent work is complete and clean the floor in accordance with the finish manufacturer's recommendations.

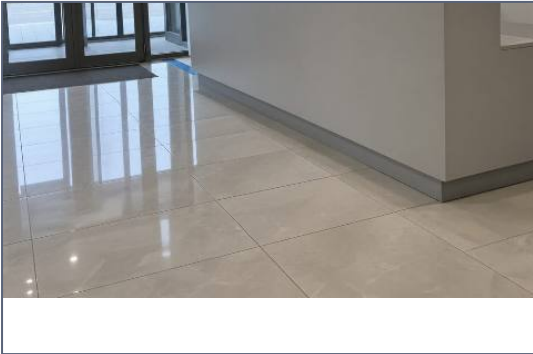

Pin 1 of 5 - photograph 2

A crop of the area this item refers to.

Item 11

Status: Graded - condition assessed

A white reception desk is present to the centre right of the frame, of solid panel construction with a plain front and a matt finish, set on a recessed grey plinth. The desk panels are visible and appear flat and square, with no visible impact damage, joint separation or staining. A plant and a dark object rest on the desk top; both are loose items, not defects. No person is present behind the desk.

Required action

No action required. Maintain the finish under a routine cleaning regime and inspect the plinth and panel joints periodically for movement.



Pin 2 of 5 - photograph 2

A crop of the area this item refers to.

Item 12

Status: Graded - condition assessed

A full-height glazed entrance screen with aluminium frames is present to the left of the frame, comprising double doors and fixed screens with a transom over. The glazing and frames are visible; the glass is clear, the frames appear straight and fully glazed, and no visible breakage, distortion or open joint is supported by the photograph. A mat is laid inside the threshold. The external paving and planting beyond the glazing are visible through the glass.

Required action

No action required to the glazing on the evidence of this photograph. Include the door closers, ironmongery and frame seals in the routine maintenance inspection.



Pin 3 of 5 - photograph 2

A crop of the area this item refers to.


Item 13

Status: Graded - condition assessed

A suspended ceiling of square lay-in tiles is present across the upper portion of the frame, with recessed downlights and a small ceiling-mounted detector. The tiles are visible and appear level and uniform, with no visible sagging, staining, damaged tile or displaced grid member supported by the photograph.

Required action

No action required. Continue routine inspection of the ceiling void and the lighting for the duration of the maintenance regime.

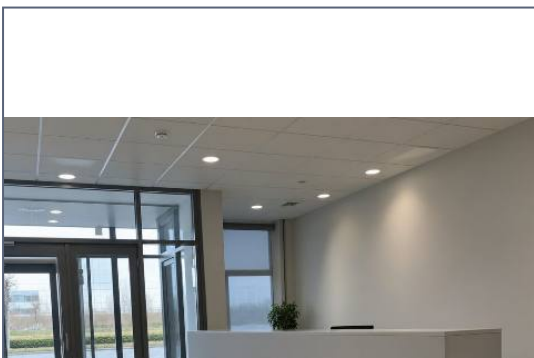

Pin 4 of 5 - photograph 2

A crop of the area this item refers to.

Item 14

Status: Graded - condition assessed

The walls to the reception area, including the return wall behind the desk, are finished with a plain painted or applied lining in a light grey or white tone. The surfaces are visible and appear uniform, with no visible cracking, staining, blistering or impact damage supported by the photograph. Shadowing at the wall and ceiling junction is consistent with the lighting.

Required action

No action required. Maintain under the routine decorative cycle and inspect wall protection in circulation areas as part of planned maintenance.



Pin 5 of 5 - photograph 2

A crop of the area this item refers to.


Item 15

Status: Graded - condition assessed

The reception floor is finished in large-format rectangular tiles laid to a regular grid with narrow joints. Across the area visible in the photograph the tiling is intact and evenly laid, with no visible cracking, lipping, lifting or open joints. The surface is clean and carries a uniform sheen consistent with a recently cleaned floor. The photograph does not permit inspection of the joints at close range or of the floor beneath the furniture.

Required action

No action required. Continue routine cleaning and periodic inspection of joints at floor level.

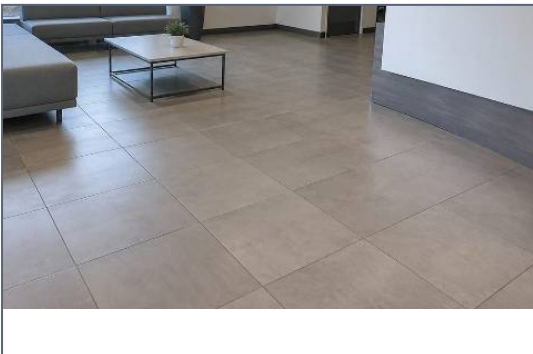

Pin 1 of 6 - photograph 3

A crop of the area this item refers to.


Item 16

Status: Graded - condition assessed

A suspended ceiling of square tiles in a concealed grid spans the reception area, incorporating recessed downlighters and a square diffuser grille. The tiles visible are flat, closely fitted and free of staining, sagging or displacement. The grid lines run true and no tiles are missing within the field of view. The photograph does not permit assessment of the ceiling above the tiles or of the services within the void.

Required action

No action required. Retain routine inspection.

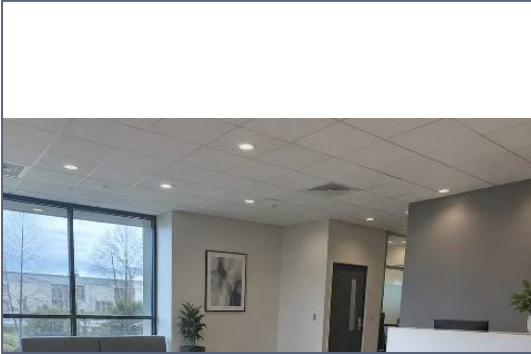

Pin 2 of 6 - photograph 3

A crop of the area this item refers to.

Item 17

Status: Graded - condition assessed

Internal partitions are finished in a light neutral paint with a darker contrasting panel to the right-hand wall, and a dark skirting is fitted at the wall base. The painted surfaces visible appear even and intact, without blistering, cracking or visible marking. The skirting is present and continuous across the visible length. Lighting conditions create shadow variation across the wall plane which limits assessment of fine surface defects.

Required action

No action required. Retain routine decoration cycle.



Pin 3 of 6 - photograph 3

A crop of the area this item refers to.

Item 18

Status: Graded - condition assessed

A large fixed glazed screen with dark metal framing forms the left-hand elevation, with a horizontal transom dividing the units. The glass and framing appear intact from this distance, with no visible crack, seal failure or condensation between panes. The photograph is taken from within the space and does not permit close inspection of the frame, gaskets or perimeter seals, or of any opening light operation.

Required action

No action required. Retain periodic inspection of frame, gaskets and perimeter seals.



Pin 4 of 6 - photograph 3

A crop of the area this item refers to.


Item 19

Status: Graded - condition assessed

A reception desk occupies the right-hand side of the space, formed of a light-coloured upper face panel over a darker plinth return. The visible faces are flush and undamaged with no impact damage, chips or lifting at the joins. Only two faces of the unit are visible in the photograph; the concealed elevations and any service access are not assessable.

Required action

No action required.

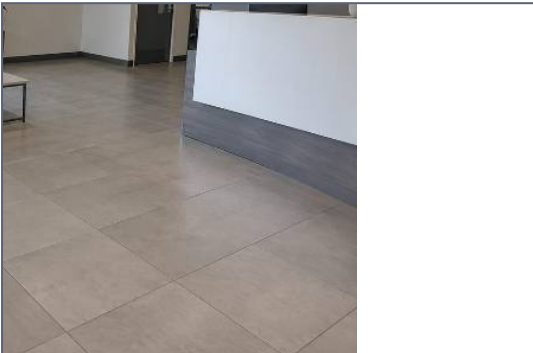

Pin 5 of 6 - photograph 3

A crop of the area this item refers to.


Item 2

Status: Graded - condition assessed

The light grey painted base panel of the counter unit is visible at the front face and the returned left end. The panel is in sound decorative order generally; a dark grey plinth or kick strip runs along the base of the unit and this strip is visibly scuffed and abraded, with the finish worn away in patches along the front elevation and more heavily at the external corner. The corner between the front plinth and the returned end is chipped and the substrate is exposed at the arris.

Required action

Planned repair: prepare and redecorate or replace the plinth/kick strip finish to the affected lengths, with the external corner made good. No action is required to the counter carcass.

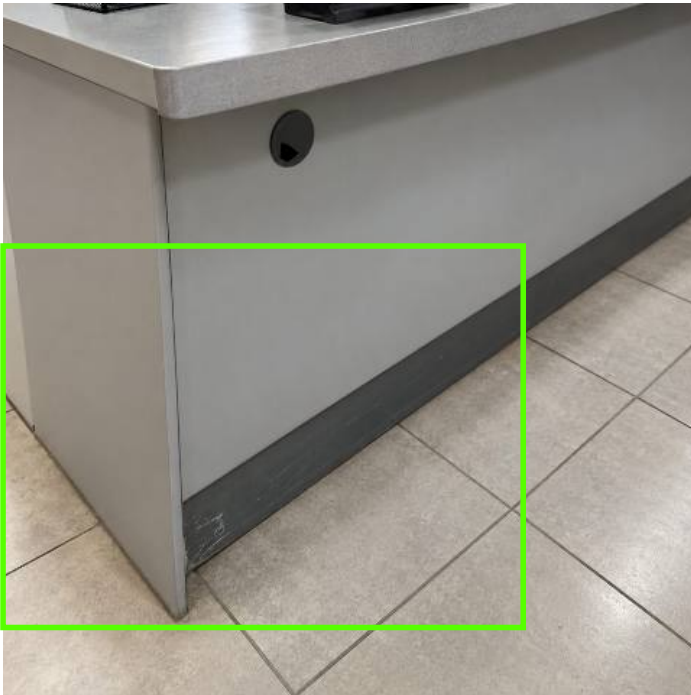


Item 5


Status: Graded - condition assessed

The upholstered seat cushion at the front edge of the armchair is abraded along its leading arris. The woven fabric has worn through to reveal the backing yarns, producing a pale, frayed band approximately 200 mm in length across the front and upper corner of the cushion face. Surrounding fabric remains intact and taut over the foam, with no splitting of the seams and no visible staining, soiling or impact damage. A dark timber or composite leg is visible at the lower left. The floor finish, comprising large-format light tiles with a dark skirting line in the background, is visible beyond the chair and is not the subject of this observation.

Required action

Planned repair. The cushion cover requires replacement, or a matched panel insert to the worn arris, at the next available maintenance visit.

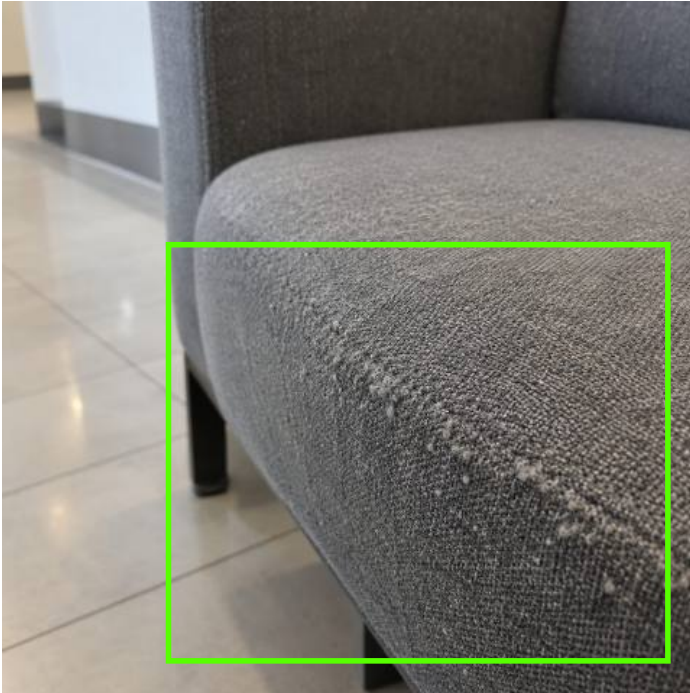

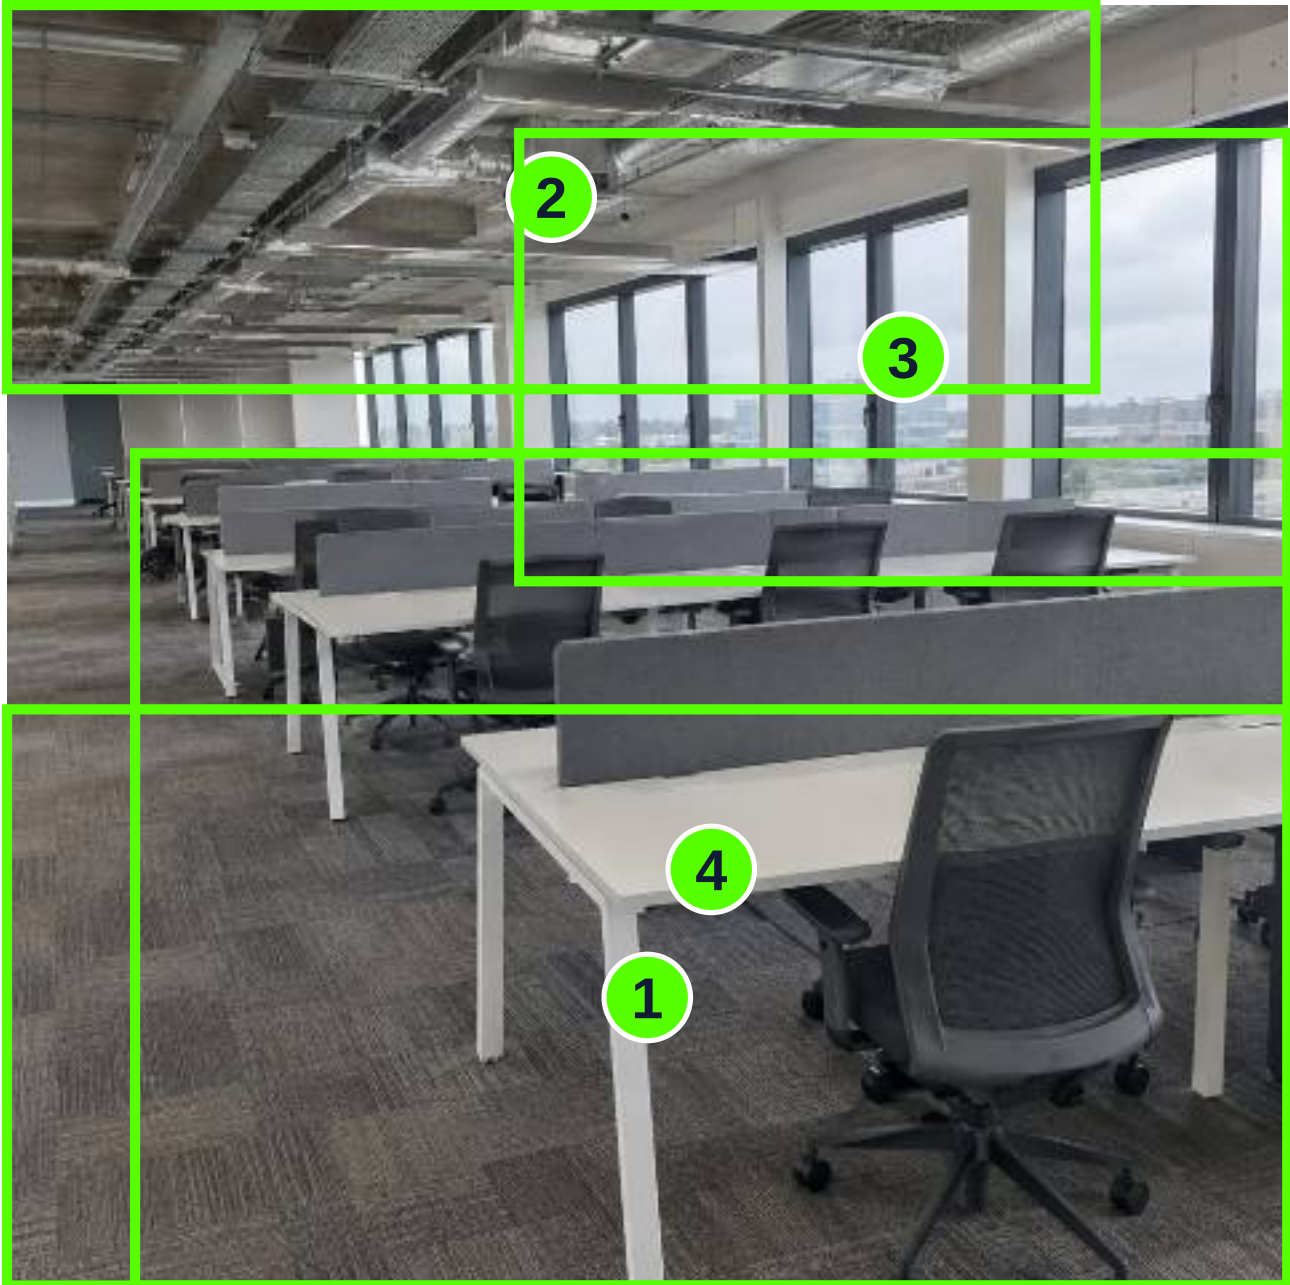

Photograph 7 - 4 items on this photograph, 4 pins on this photograph

Findings on this photograph

Pin 1 - Item 6 - Open-plan office floor finish comprising grey loop-pile carpet tiles laid in a quarter-turn pattern.

Pin 2 - Item 7 - Exposed soffit above the office area with galvanised ductwork, cable tray, pipework and services suspended from hangers.

Pin 3 - Item 8 - Full-height glazed curtain walling to the external elevation, comprising dark-framed units with opening lights.

Pin 4 - Item 9 - Bench desking in white finish with grey fabric screen dividers and mesh-backed task chairs on castors.


Item 6

Status: Graded - condition assessed

Open-plan office floor finish comprising grey loop-pile carpet tiles laid in a quarter-turn pattern. The finish is continuous and appears recently laid, with no visible lifting, fraying, staining, delamination or joint separation within the extent of the view. Minor local soiling is evident in the circulation areas.

Required action

Routine maintenance. Clean in accordance with the manufacturer's maintenance regime and maintain a small stock of replacement tiles for future localised renewal.

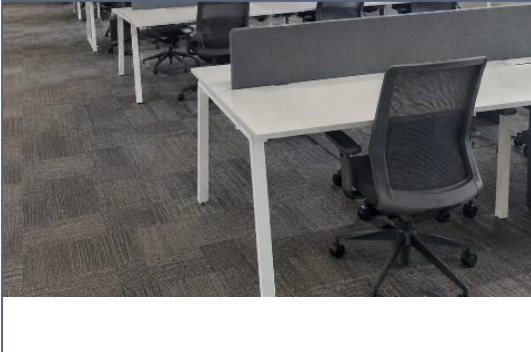

Pin 1 of 4 - photograph 7

A crop of the area this item refers to.


Item 7

Status: Graded - condition assessed

Exposed soffit above the office area with galvanised ductwork, cable tray, pipework and services suspended from hangers. The services are installed in an orderly arrangement. A number of linear light fittings are suspended below the soffit. Damage in the form of dents, impact damage, displaced supports, water staining or corrosion is not evident in the areas visible.

Required action

No action on the visible condition. Confirm support spacings, fire stopping at penetrations and service labelling as part of the completion record before handover.

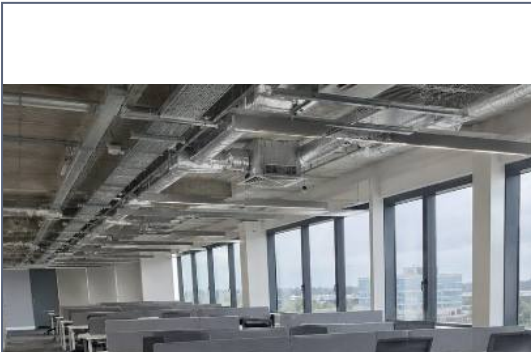

Pin 2 of 4 - photograph 7

A crop of the area this item refers to.

Item 8

Status: Graded - condition assessed

Full-height glazed curtain walling to the external elevation, comprising dark-framed units with opening lights. The frames, gaskets and glazing visible in the elevation appear intact, with no visible cracking, sealant failure, water ingress staining or damaged ironmongery. Reflections in the glass limit the inspection of the lower frame junctions.

Required action

No action on the visible condition. Verify gasket compression, drainage path and perimeter sealant as part of the faade completion inspection.



Pin 3 of 4 - photograph 7

A crop of the area this item refers to.

Item 9

Status: Graded - condition assessed

Bench desking in white finish with grey fabric screen dividers and mesh-backed task chairs on castors. The desking appears recently installed and undamaged, with edge banding intact and leg frames undented. The furniture is in place and the installation reads as complete.


Required action

No action. Record the condition at handover for dilapidations purposes.



Pin 4 of 4 - photograph 7

A crop of the area this item refers to.

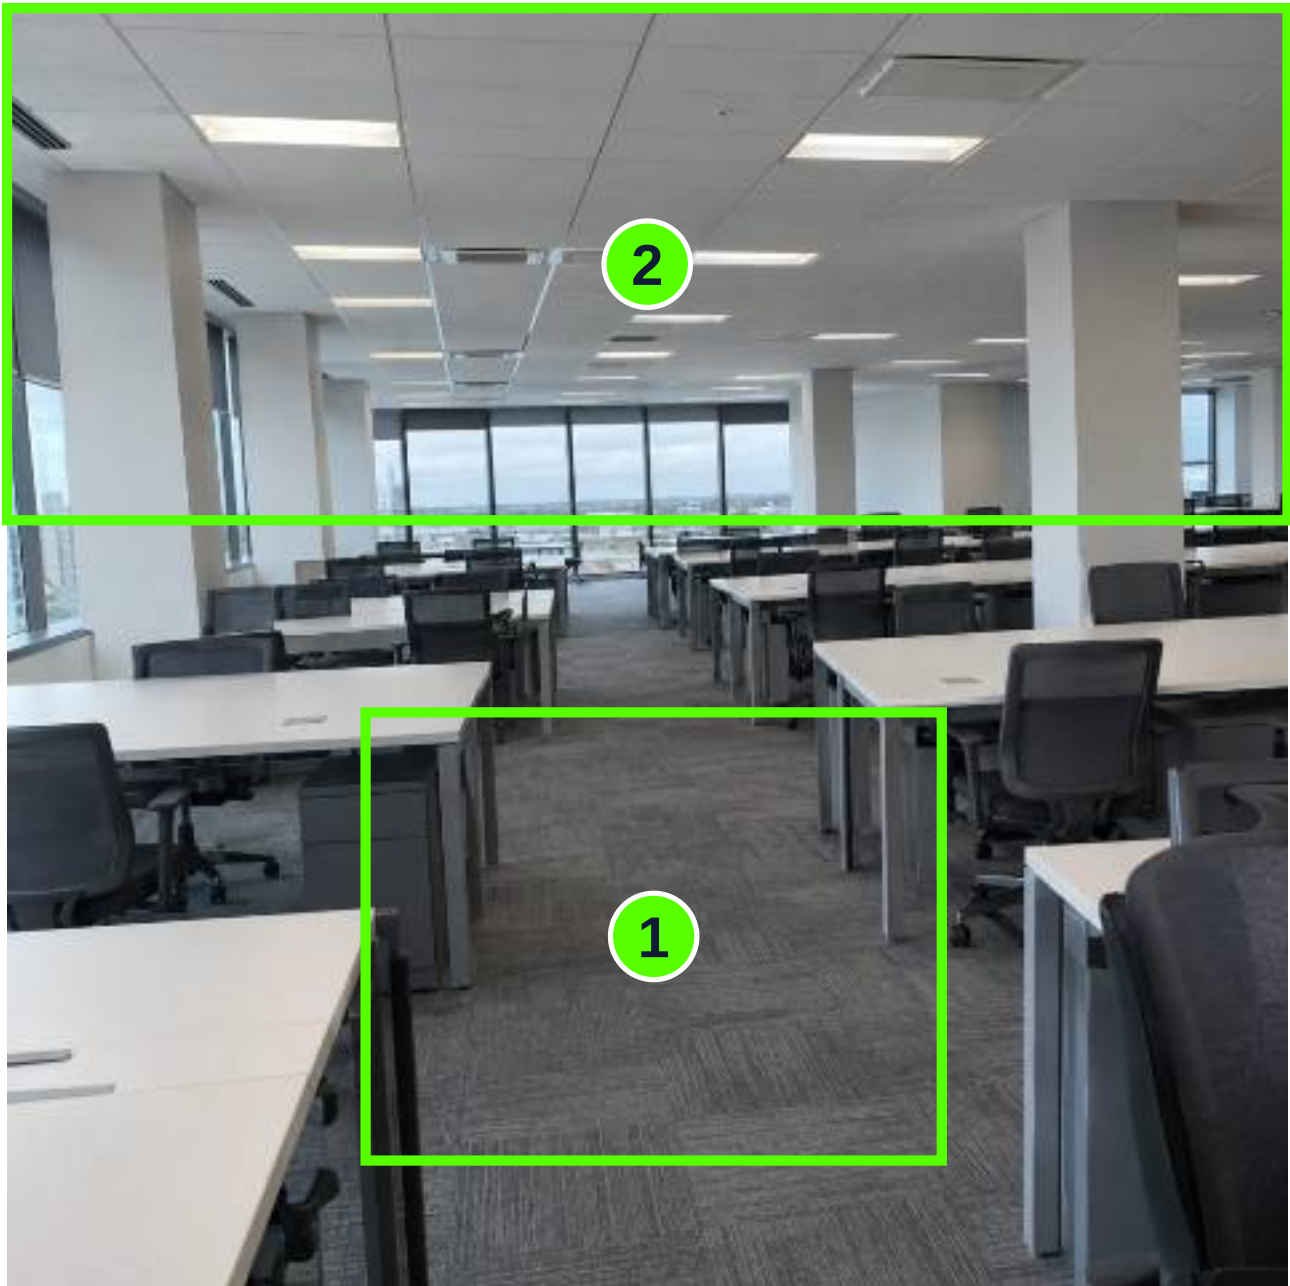

Photograph 8 - 2 items on this photograph, 2 pins on this photograph

Findings on this photograph

Pin 1 - Item 3 - The carpet tiling to the open-plan floor area is visibly stained and discoloured in the central circulation zone, wit...

Pin 2 - Item 4 - The metal grid suspended ceiling is in place and the tiles are generally true and aligned, with recessed luminaires a...


Item 3

Status: Graded - condition assessed

The carpet tiling to the open-plan floor area is visibly stained and discoloured in the central circulation zone, with a dark marking running across the tiles between the desk rows. The staining appears established rather than fresh. The pile across the general floor area is otherwise laid flat and sound, with no visible lifting, open joints or edge fraying at the tiles examined in the foreground.

Required action

Planned maintenance. The stained tiles should be identified and replaced from retained stock, or the affected area accepted as recorded wear, at the next fit-out or dilapidations review.

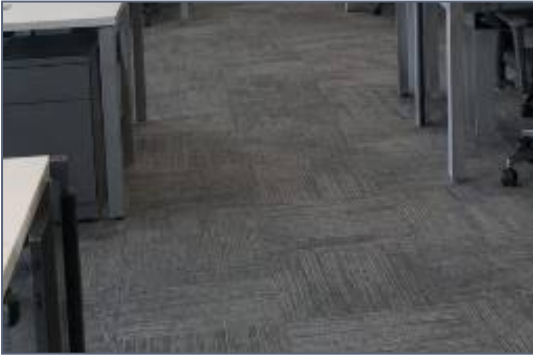

Pin 1 of 2 - photograph 8

A crop of the area this item refers to.


Item 4

Status: Graded - condition assessed

The metal grid suspended ceiling is in place and the tiles are generally true and aligned, with recessed luminaires and diffusers set within the grid. Light fittings are illuminated and appear complete. The visible ceiling plane and grid lines are sound, with no sagging, displaced tiles or open grid apertures apparent in this view.

Required action

No action. Routine maintenance only.

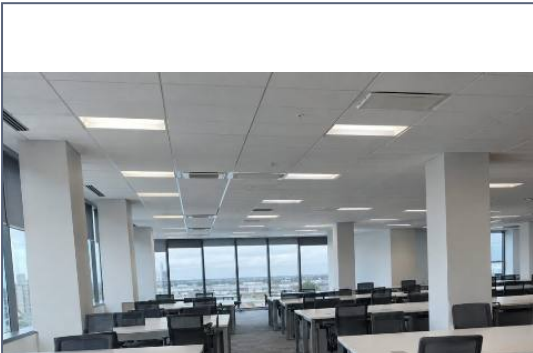

Pin 2 of 2 - photograph 8

A crop of the area this item refers to.

ITEMS BY GRADE

A - Good: 0 B - Satisfactory: 0 C - Fair: 0 D - Poor: 0

0 graded 27 still to be confirmed by a person.