Appendix 7 - Form 2 Tree Risk Assessment Form

Tree Risk Assessment Form 2 Individual Tree Risk Assessment
樹木風險評估表格2 個別樹木風險評估

General Information 基本資料

Dept. / Agency 部門 / 機構	Housing Department	Inspection Officer 巡查人員	Wong Kwok Leung	Post 職位	2023-26_TNS&TY
Project / Contract No.工程 /合約編號	TY_2025_2026_KS20230019			File Ref. 檔案編號	FTA-20260123-F2-21026

Date and Time of Inspection 巡查日期及時間	27/12/2025 (dd/mm/yyyy)	09 (hr)	30 (min)	Last Inspection Date 上次巡查日期	22/10/2024 (dd/mm/yyyy)	Inspection Time Spent 是次巡查所用時間	0.5 hr
						Inspection Frequency 巡查週期	12 months

Tree Information 樹木資料

TMCP Tree ID TMCP樹木編號	202002800062143	Dept. Tree ID 部門樹木編號	FTA-T0012	Tree Species 樹種	Michelia x alba	Triage Colour 分流顏色	Orange
Tree Height(m) 樹高(米)	18	Crown Spread(m) 樹冠闊度(米)	6	No. of Trunk(s) 樹幹數目	1		

DBH of tree trunk(s)(mm) 每枝主幹胸徑(毫米)	1	2	3	4	5	Aggregated DBH (mm) 總胸徑(毫米)
	230	0	0	0	0	230

Tree Status 樹木類別		
☐ Old and Valuable Tree 古樹名木 (OVT No. 古樹名木登記冊編號:)		☐ Other tree 其他樹木
☐ Stonewall Tree 石牆樹 (Tree Register No. 樹木登記編號:)		☐ Brown Root Rot Disease Infected 受褐根病感染
☑ Large Tree (DBH ⩾ 500mm or overall height ⩾ 9m) 大樹 (胸徑 ⩾ 500毫米或高度 ⩾ 9米)		☑ Tree in Confined Site 擠迫地點的樹木

Location Information 位置資料

Masterzone Ref.主區編號	FTA	Location (Chinese) 地點 (中文)	富泰邨
Subzone Ref. 副區編號		Location (English) 地點 (英文)	FU TAI ESTATE
Coordinates 座標	X: 816497.793	Y: 830478.082	
Tree Risk Management Zone Category 樹木風險管理地區類別	Category I	District 地區	Tuen Mun

Location Type 地點類別			
☐ Roadside landscaped area 路旁綠化地區	☑ Tree pit/Tree ring 樹穴/樹圈	☐ Central divider 中央分隔帶	
☐ Public park or recreation venue 公園或康樂場地	☑ Housing estate 屋邨	☐ Government compound 政府建築物	
☐ Planter box 花盆	☐ SIMAR slopes 系統性鑑辨維修責任的斜坡		
☐ Recreational site/facility inside country parks郊野公園內康樂用地或設施			
☐ Unleased/unallocated government land未批租/未撥用的政府土地	☐ Others 其他		

Nearby Utility Post No. 就近公用設施編號:	

Target Assessment 目標物評估

(Please identify no more than five (5) potential Target(s) in the sequence of severity of consequence 請依後果的嚴重性次序選取不多於五個目標物)

Target No. 目標物編號	Target Description 目標物的描述	Target Zone 目標物範圍	Occupancy rate 佔用率	Remove target? 可否移除目標物?	Restrict usage? 可否限制使用?
1	People (pedestrians, facility users, activity participants, etc.)	Within dripline	Frequent	N	N
2	Buildings (residential, commercial, school, utility, covered carparks, etc)	Within 1.5 X Ht.	Constant	N	N

Site Conditions 場地狀況

Topography 地勢	☑ Flat 平地 ☐ Natural terrain 天然山坡 ☐ Man-made slope 人造斜坡 ☐ Retaining wall 擋土牆 ☐ Stonewall 石牆 ☐ Others 其他:
Site changes 場地改變	☑ None 沒有 ☐ Grade change 地表改變 ☐ Site clearing 場地平整 ☐ Others 其他
Soil conditions 土壤情況	☑ Normal 正常 ☐ Compacted 土壤被擠壓 ☐ Water logging 積水 ☐ Hard Paved 硬地鋪面 ☐ Others 其他
Soil crack or crack behind lean 土壤裂縫或裂縫於傾斜部位背後 #	● None 沒有 ○ Yes 有
Restriction within dripline 滴水線範圍內有限制 ⓓ	○ None 沒有 ○ <25% ○ 25-50% ○ 51-75% ● >75%
Tree failure record 樹木倒塌記錄 #	● None 沒有 ○ Yes 有
Brown Root Rot disease record 褐根病記錄 X	● None 沒有 ○ Yes 有
If these items are checked, further assessment by resistograph or tomograph(#), equipment for tree root detection(ⓓ) and/or BRRD/pathogen tests(X) should be arranged when necessary. 若選擇此項，應視乎情況考慮應用微鑽探、聲納探測(#) 、樹根探測工具(ⓓ)及/或褐根病/病源檢測(X)。	
Other observations 其他觀察	

General Conditions 總體概況

Tree vigor 苗壯程度	○ Low 低 # ● Normal 正常 ○ High 高
Lean 傾斜	● None 沒 ○ Yes 有 Angle from vertical 傾斜角度 #(> 15°) ☐ Natural due to phototropism 趨光性 ☐ Self-corrected 已自然修正 ☐ Recent Tilt 新近傾斜# ☐ Response growth 反應生長
Wind exposure 受風情況	○ Protected 受遮擋 ● Partial 部份 ○ Exposed 暴露 ○ Wind funneling 風洞 ○ Others 其他
Wildlife or nesting site 野生動物或鳥巢	● None 沒有 ○ Yes 有
Cable or brace 鋼索或支架	○ None 沒有 ● Yes 有 tree guard
Pruning History 修剪歷史	☐ Cleaned 清理樹冠 ☐ Thinned 疏減樹冠 ☐ Raised 提升樹冠 ☐ Reduced 縮減樹冠 ☐ Structural pruning 結構修剪 ☐ Topped 削頂 ☐ Lion-tailed 獅尾 ☑ Others 其他 N/A
If these items are checked, further assessment by resistograph or tomograph(#) should be arranged when necessary. 若選擇此項，應視乎情況考慮應用微鑽探、聲納探測(#)。	
Other observations 其他觀察	

Crown Conditions 樹冠狀況

Crown density 樹冠密度	● Normal 正常 ○ Sparse 稀疏 (○ <25%# ○ 25% - <50%# ○ 50% - <75%) ☐ Imbalanced crown 樹冠不對稱
Live crown ratio 活冠比	○ <40%# ⊛ ● 41 - 70% ○ >70% **Crown load 樹冠負荷** ● Normal 正常 ○ Heavy 過重 ○ Declined 衰弱#⊛
Foliage 葉片	○ Fallen leaf (Seasonal) 落葉(季節性) ○ Defoliation (Withered) 落葉 (枯萎) ● Normal 正常 ○ Chlorotic 萎黃 N/A % ○ Necrotic 壞死 N/A %
Leaf size 葉片大小	● Normal 正常 ○ Smaller than normal 比正常細小
Dieback twigs 枯枝	○ <5% ● 5 - <25% ○ 25 - 50% ○ >50% ☐ Epicormics 水橫枝 ☐ Hanger 懸吊斷枝 ☐ Pest and disease 病蟲害 X Defoliation Percentage 落葉百分比
If these items are checked, further assessment by resistograph or tomograph(#), equipment for tree root detection(⊛) and/or BRRD/pathogen tests(X) should be arranged when necessary. 若選擇此項，應視乎情況考慮應用微鑽探、聲納探測(#) 、樹根探測工具(⊛)及/或褐根病/病源檢測(X)。	
Other observations 其他觀察	

Branch Conditions 樹枝狀況

☐ Co-dominant branches 等勢枝	☐ Included bark 內夾樹皮	☐ Cross branches 叠枝	☐ Crooks or abrupt bends 不常規彎曲	☐ Sap flow 滲液
☐ Cracks or splits 裂縫或裂開	☐ Decay or cavity 腐爛或樹洞#	☐ Heavy lateral limb 重側枝	☐ Deadwood 枯木	
☐ Canker 潰瘍 ☐ Galls 腫瘤	☐ Burls 節瘤	☐ Wounds or mechanical injury 傷痕或機械破損		
☐ Pest and disease 病蟲害 :		☐ Parasitic or epiphytic plants 寄生或附生植物 :		
☐ Fungal fruiting bodies 真菌子實體 : X		☐ Response growth 反應生長 :		
If these items are checked, further assessment by resistograph or tomograph(#), equipment for tree root detection(⊛) and/or BRRD/pathogen tests(X) should be arranged when necessary. 若選擇此項，應視乎情況考慮應用微鑽探、聲納探測(#) 、樹根探測工具(⊛)及/或褐根病/病源檢測(X)。				
Other observations 其他觀察				

Trunk Conditions 主幹狀況

☐ Cavity 樹洞 #(Width of cavity opening over 1/3 of trunk diameter 樹洞洞口闊度大於主幹直徑1/3)

#1 L 長 ____ (mm) W 闊 ____ (mm) D 深 ____ (mm) Direction 方向 _____ Height above ground 離地面高度 _____

☐ Co-dominant stems 等勢幹#	☐ Included bark 內夾樹皮#	☑ Poor taper 不良漸尖生長	☐ Crooks or abrupt bends 不常規彎曲
☐ Cracks or splits 裂縫或裂開	☐ Abnormal bark crack 不正常樹皮裂紋	☐ Sap flow 滲液	
☐ Canker 潰瘍 ☐ Galls 腫瘤	☐ Burls 節瘤	☑ Wounds or mechanical injury 傷痕或機械破損	
☐ Pest and disease 病蟲害 :	☐ Parasitic or epiphytic plants 寄生或附生植物 :		
☐ Fungal fruiting bodies 真菌子實體 : X	☐ Response growth 反應生長 :		

If these items are checked, further assessment by resistograph or tomograph(#), equipment for tree root detection(●) and/or BRRD/pathogen tests(X) should be arranged when necessary.
若選擇此項，應視乎情況考慮應用微鑽探、聲納探測(#) 、樹根探測工具(●)及/或褐根病/病源檢測(X)。

Other observations 其他觀察	

Root Conditions 根部狀況

☐ Root collar not visible 根脊不現	☐ Cracks or splits 裂縫或裂開	☐ Exposed root根部外露	☐ Root rot 根部腐壞 #●
☐ Cut or pruned roots 根部經切割或截根	☐ Trunk girdling 纏繞樹幹	☐ Girdling root 纏繞根	☐ Dead surface roots 表根枯萎
☐ Root-plate movement 根基移位 #●	☐ Wounds or mechanical injury 傷痕或機械破損		
☐ Pest and disease 病蟲害 :	☐ Parasitic or epiphytic plants 寄生或附生植物 :		
☐ Fungal fruiting bodies 真菌子實體 : X	☐ Response growth 反應生長 :		

If these items are checked, further assessment by resistograph or tomograph(#), equipment for tree root detection(●) and/or BRRD/pathogen tests(X) should be arranged when necessary.
若選擇此項，應視乎情況考慮應用微鑽探、聲納探測(#) 、樹根探測工具(●)及/或褐根病/病源檢測(X)。

Other observations 其他觀察	

Risk Categorisation 風險類別

(Please identify no more than three (3) important Target(s) for no more than three (3) Tree Part 請就不多於三個樹木部份選取不多於三個目標物)

Target No. 目標物編號	Tree Part 樹木部分	Condition(s) of Concern 關注狀況	Part Size (mm) 部位大小 (毫米)	Fall Distance (m) 下墜距離 (米)	Likelihood 可能性			Consequences 後果	Risk rating 風險評級 (Matrix 2: Risk rating matrix 風險評級組合)
					Failure 倒塌	Impact 影響	Failure and Impact 倒塌並影響 (Matrix 1 : Likelihood matrix 可能性組合)		
1	Main trunk/codominant trunk	Poor taper with wound on trunk	230	18	Possible	Medium	Unlikely	Severe	Low
2	Main trunk/codominant trunk	Poor taper with wound on trunk	230	18	Possible	High	Somewhat likely	Minor	Low

* For tree obtained "High" or "Extreme" risk rating after assessment, appropriate mitigation measures should be followed.
*當風險評級組合的結果為"高"或"極高"時，需要安排適當的緩減措施。

Matrix 1: Likelihood matrix 可能性組合

Likelihood of Failure 倒塌的可能性	Likelihood of Impacting Target 影響目標的可能性			
	Very Low 非常低	Low 低	Medium 中等	High 高
Highly Probable 非常可能	Unlikely 很低機會	Somewhat likely 有機會	Likely 較大機會	Very likely 很大機會
Probable 相當可能	Unlikely 很低機會	Unlikely 很低機會	Somewhat likely 有機會	Likely 較大機會
Possible 有可能	Unlikely 很低機會	Unlikely 很低機會	Unlikely 很低機會	Somewhat likely 有機會
Improbable 不太可能	Unlikely 很低機會	Unlikely 很低機會	Unlikely 很低機會	Unlikely 很低機會

Matrix 2: Risk rating matrix 風險評級組合

Likelihood of Failure and Impact 倒塌並影響的可能性	Consequences of Failure 倒塌後果			
	Negligible 微小	Minor 較小	Significant 重大	Severe 嚴重
Very likely 很大機會	Low 低	Moderate 中	High 高	Extreme 極高
Likely 較大機會	Low 低	Moderate 中	High 高	High 高
Somewhat likely 有機會	Low 低	Low 低	Moderate 中	Moderate 中
Unlikely 很低機會	Low 低	Low 低	Low 低	Low 低

* 20 Common Tree Species requiring special attention should be duly considered to be rated at "Probable" or "Highly Probable" depends on the severity of the defects
* 20種需特別注意的常見樹種應視乎缺陷的嚴重性而盡量評為"相當可能"或"非常可能"

Mitigation Measures 緩減措施

Target No. 目標物編號	Tree Part 樹木部分	Mitigation Measures 緩減措施	Anticipated Completion Date 預算完成日期 (dd/mm/yyyy)	Residual Risk* 剩餘風險*
1	Main trunk/codominant trunk	Others 其他 : Defect was insignificant. No mitigation is required.	27/12/2025	Low
2	Main trunk/codominant trunk	Others 其他 : Defect was insignificant. No mitigation is required.	27/12/2025	Low

*The level of "Residual Risk" after proposed mitigation measures against "High" or "Extreme" risking rating shall be lowered to "Moderate" or below, otherwise, the proposed mitigation measures shall be reviewed.
*當執行針對“高”或“極高”水平風險評級的緩減措施後，有關的“剩餘風險”水平必需降至“中”或以下。否則，有關的緩減措施需要檢討。

Notes, explanations, descriptions and supplmentary Information 說明、註解、描述及補充資料

Tree is generally fair in health and structure condition. No observable defect found that pose high potential risk to public. No remedial action is required at the time of inspection.
Tree maintenance works will be deployed when necessary upon monthly tree inspection.

Overall tree risk rating 綜合樹木風險

Low

Overall residual risk 綜合剩餘風險

Low

Advanced assessment 進一步檢查

● No 否

○ Yes 是 Please describe 請描述

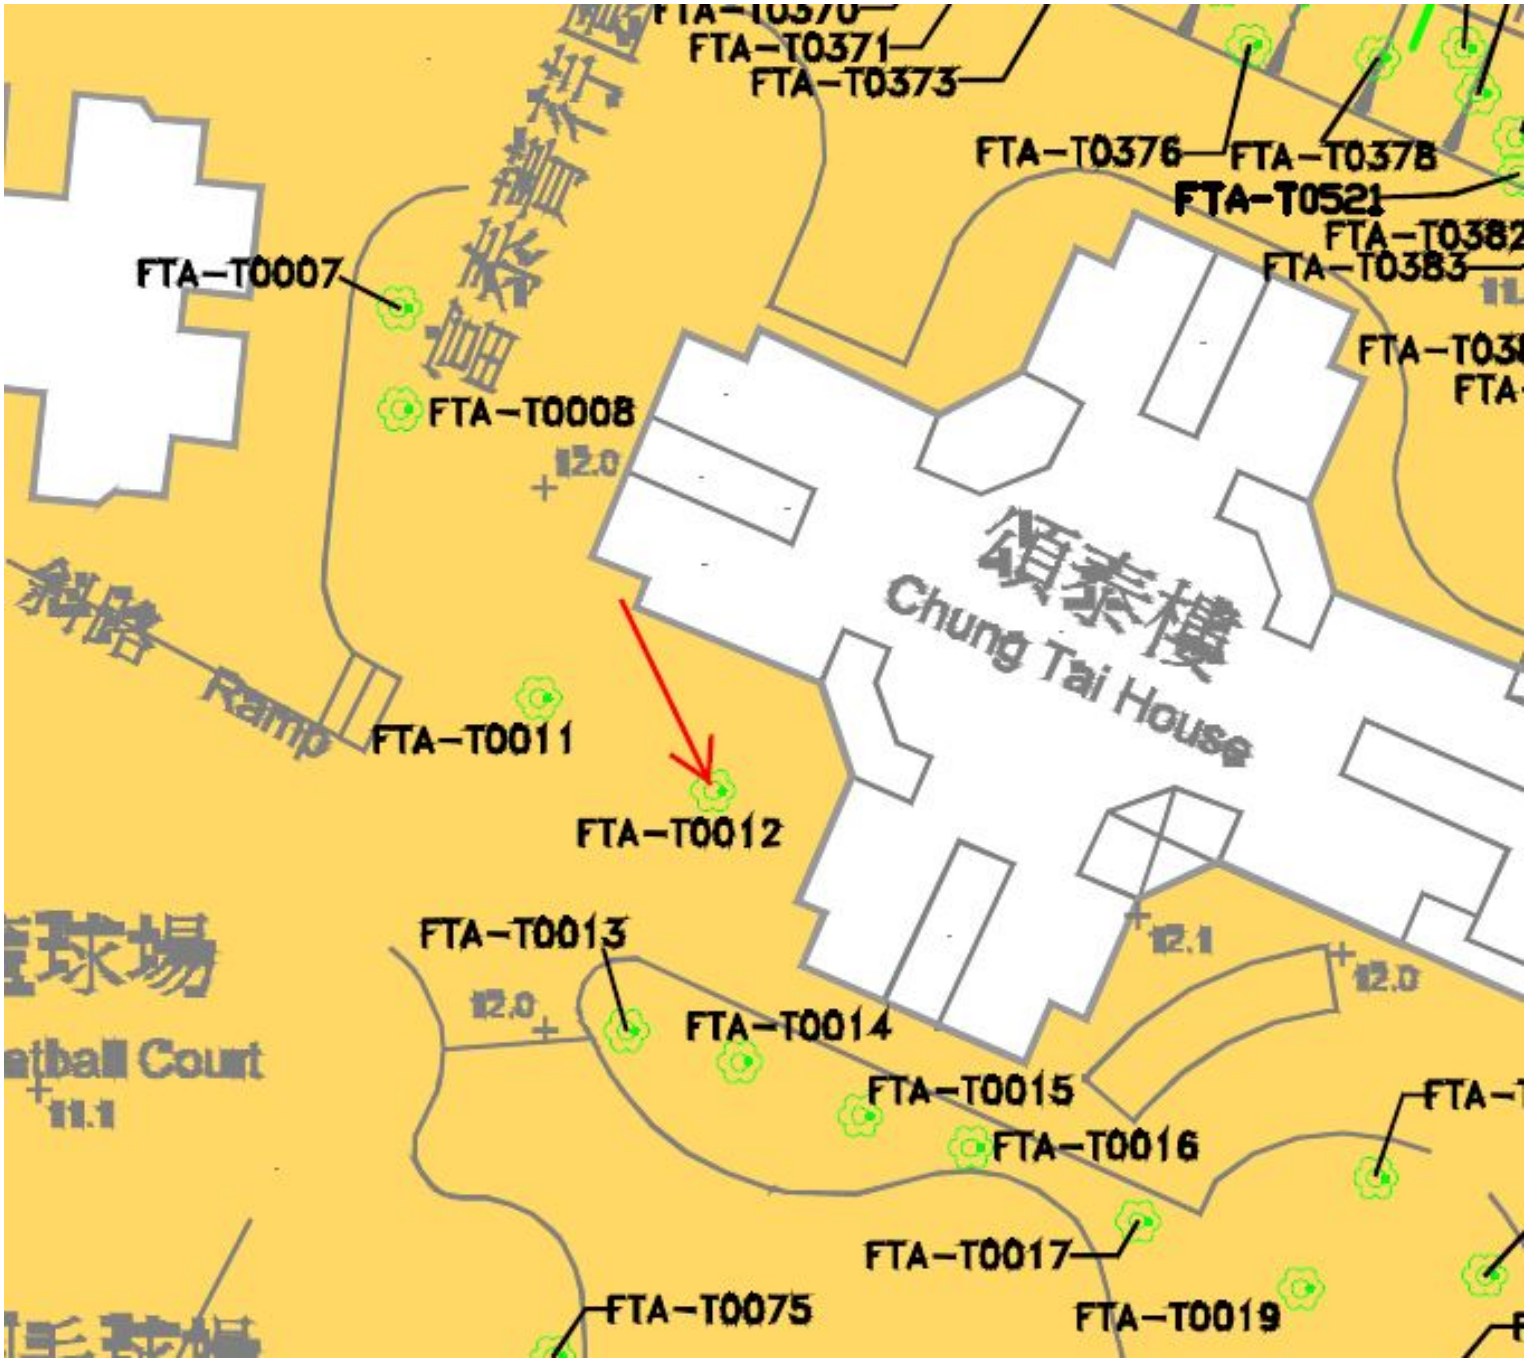
Inspection limitations 檢查限制

☑ None 沒有 ☐ Inaccessible 難以接近 ☐ Climbers 攀緣植物

☐ Root collar buried 根脊被埋 ☐ Others

Next inspection date 下次檢查日期

27/12/2026


FTA-T0371
FTA-T0373
FTA-T0376
FTA-T0378
FTA-T0521
FTA-T0382
FTA-T0383
FTA-T0007
FTA-T0008
12.0
領泰樓
Chung Tai House
斜路
Ramp
FTA-T0011
FTA-T0012
FTA-T0013
12.0
FTA-T0014
12.1
12.0
FTA-T0015
FTA-T0016
FTA-T0017
FTA-T0075
FTA-T0019
11.1


HOPEFUNG
HOPEFUNG ESTATE
27/12/2025 09:34


DANGER
27/12/2025 09:34


27/12/2025 09:34


27/12/2025 09:34


27/12/2025 09:34

Declaration 聲明

I, the Inspection Officer for the above TRA Form 2, confirm that I have inspected the tree(s) at the specified date and time with due diligence, and the information given in the Form(s) is truly reflecting what I observed on site.

本人作為以上個別樹木風險評估(表格2)的巡查人員，確認本人已在本表格所列日期及時間，謹慎小心完成有關樹木的風險評估，而本表格上填入的資料均真確無訛地反映本人在現場觀察所得。

My academic, professional, training records and work experience met the requirements of Inspection Officer (Form 2) in the TRAM Guidelines.

本人的學術、專業、培訓紀錄及相關工作經驗均符合「樹木風險評估及管理安排」指引中對巡查人員的要求。

Name of Inspection Officer:
巡查人員姓名

Wong Kwok Leung
(請以英文正楷書寫)

Date of Form 2 Completed:
完成表格2日期

23/01/2026
(dd/mm/yyyy)

(Please sign on the space provided if the Form 2 is submitted in paper form 若以文本形式遞交表格2，請於以下空位簽名)

Signature of Inspection Officer:
巡查人員簽署:

---------- End of Form 2 ----------
表格2完