AN594

Using the CCP Module(s)

Author: *Mark Palmer*
Microchip Technology Inc.

This application note discusses the operation of a Capture/Compare/PWM (CCP) module, and the interaction of multiple CCP modules with the timer resources.

The (CCP) module is software programmable to operate in one of three modes:

1. A Capture input
2. A Compare output
3. A Pulse Width Modulation (PWM) output

For the CCP module to function, Timer resources must be used in conjunction with the CCP module. The desired CCP mode of operation determines which timer resources are required. Table 1 shows the CCP mode with the corresponding timer resource required. Both the Capture and Compare modes require that Timer1 be operating in timer mode or synchronized counter mode.

Note:	Capture and Compare modes may not operate if Timer1 is operated in the asynchronous counter mode.

TABLE 1: CCP MODE - TIMER RESOURCE

CCP MODE	Timer Resource
Capture	Timer1
Compare	Timer1
PWM	Timer2

CCP OPERATION

The following three sections discuss the operation of the CCP module in each of its modes of operation. There is a simple example program for each mode of operation. The software example for the Capture mode, also uses a second CCP module in Compare mode to generate the signal to capture.

PWM Mode

A Pulse Width Modulation output (Figure 1) is a signal that has a time-base (period) and a time that the output stays high (duty cycle). The period is the duration after which the PWM rising edge repeats itself. The resolution of the PWM output is the granularity with which the duty cycle can be varied. The frequency of a PWM is simply the inverse of the period (1/ period).

FIGURE 2: PWM MODE BLOCK DIAGRAM

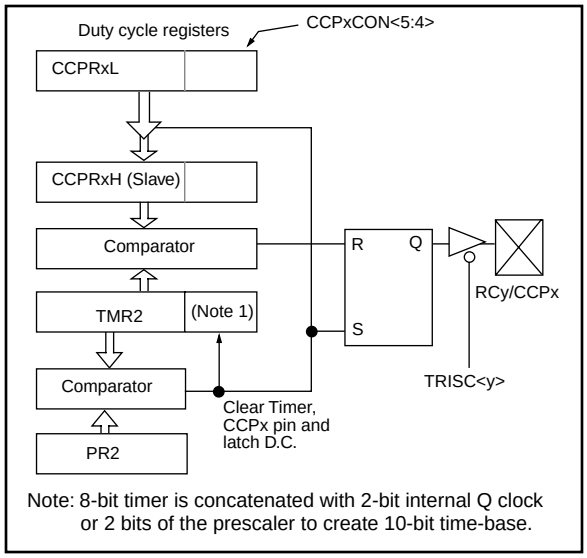

Note: 8-bit timer is concatenated with 2-bit internal Q clock or 2 bits of the prescaler to create 10-bit time-base.

FIGURE 1: PWM OUTPUT

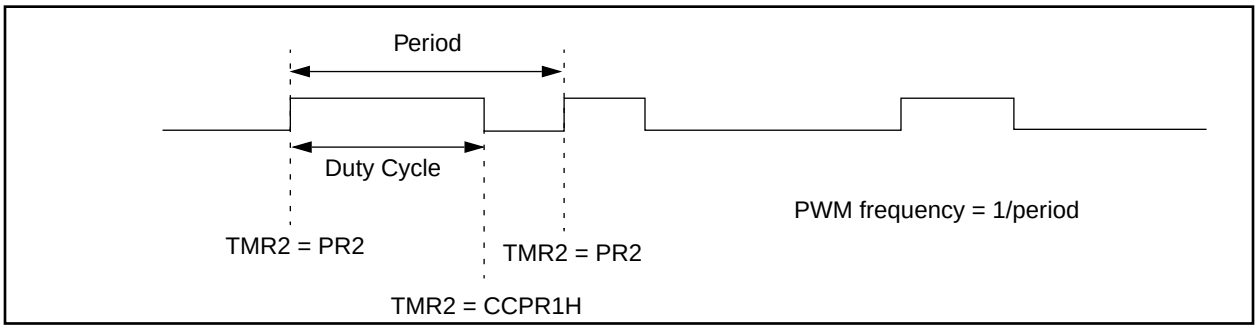

Each CCP module can support one Pulse Width Modulation (PWM) output signal, with minimal software overhead. This PWM signal can attain a resolution of up to 10-bits, from the 8-bit Timer2 module. This gives 1024 steps of variance from an 8-bit overflow counter. This gives a maximum accuracy of Tosc (50 ns, when the device is operated at 20 MHz). Figure 2 shows a block diagram of the CCP module in PWM mode. When the Timer2 overflows (timer = period register), the value in the duty cycle registers (CCPRxL:CCPRxCON<5:4>) is latched into the 10-bit slave latch. A new duty cycle value can be loaded into the duty cycle register(s) at any time, but is only latched into the slave latch when Timer2 = Timer2 Period Register (PR2).

The period of Timer 2 (and PWM) is determined by the frequency of the device, the Timer2 prescaler value (1, 4 or 16), and the Timer2 Period Register. Equation 1 shows the calculation of the PWM period, duty cycle, and the minimum and maximum frequencies.

Appendix A is a program which generates up to a 10-bit PWM output. The PWM period and duty cycle are updated after the overflow of Timer1. Upon the overflow of Timer1, ports A, B and D are read. The 10-bit duty cycle is specified by the value on PORTB:PORTA<1:0>, while the period is specified by the value on PORTD. By setting the conditional assemble flag `PICMaster` to `TRUE`, these values are read from internal registers which are dummy registers for the ports (DUMMY_Px). This allows the software to be verified without the use of hardware and external stimulus.

Since the PWM duty cycle is double buffered, the duty cycle registers are only loaded when there is sufficient time to complete the update of the 10-bit value before the Timer2 = PR2 match occurs. After the duty cycle has been updated and the Timer2 = PR2 match has occurred, the period (stored in the PR2 register) is updated. The operation of the CCP module in PWM mode is similar to the PIC17C42's PWM. Additional concepts of PWM operation can be found in Application Notes AN564 and AN539.

EQUATION 1: PWM PERIOD, DUTY CYCLE, AND FREQUENCIES

PWM Period = [(PR2) + 1] • 4 TOSC • (Timer 2 prescale value)

PWM Duty Cycle = [CCPRxL:CCPRxCON<5:4>] • 4 TOSC • (Timer2 prescale value)

PWM maximum frequency
(High Resolution mode) = 4/(PR2 • TCY)
(Low Resolution mode) = 1/(PR2 • TCY)

PWM minimum frequency
(High Resolution mode) = 4/(PR2 • TCY)
(Low Resolution mode) = 1/(PR2 • TCY)

Table 2 shows the minimum and maximum PWM frequency for different device frequencies. The Timer2 prescaler will be selected to give either the minimum or maximum frequencies as shown.

TABLE 2: PWM FREQUENCY FOR DIFFERENT DEVICE FREQUENCIES

PWM Resolution	20 MHz		10 MHz		2 MHz		Units
	Min	Max	Min	Max	Min	Max	
10-bit	1.22	19.53	0.613	9.77	0.123	1.96	kHz
9-bit	1.22	39.06	0.613	9.77	0.123	3.92	kHz
10-bit	1.22	19.53	0.613	9.77	0.123	1.96	kHz
9-bit	1.22	39.06	0.613	9.77	0.123	3.92	kHz
10-bit	1.22	19.53	0.613	9.77	0.123	1.96	kHz
9-bit	1.22	39.06	0.613	9.77	0.123	3.92	kHz
10-bit	1.22	19.53	0.613	9.77	0.123	1.96	kHz
9-bit	1.22	39.06	0.613	9.77	0.123	3.92	kHz

Compare Mode

In Compare mode, the 16-bit value of Timer1 is compared to the CCPRxH:CCPRxL registers. When these registers match, the S/W configured event occurs on the CCPx pin. The events that can be S/W selected are:

- Clear CCPx pin on match
- Set CCPx pin on match
- Generate S/W interrupt (CCPx pin unchanged)
- Trigger special event (CCPx pin unchanged)
  - CCP1 clears Timer1
  - CCP2 clears Timer1 and sets the A/D's GO/$\overline{\text{DONE}}$ bit

The CCPxM3:CCPxM0 control bits, in register CCPxCON, configures the operation of the CCP module. The compare function must have the data direction of the CCPx pin configured as an output, if the compare event is to control the state of the CCPx pin.

FIGURE 3: COMPARE MODE BLOCK DIAGRAM

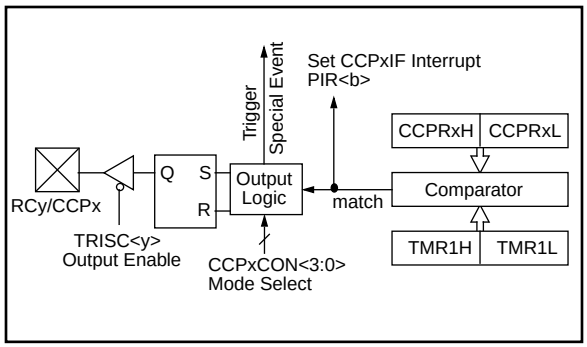

When the CCP module is in the OFF state (CCPxM3:CCPxM0 = 0h), the CCPx output latch is forced to a low level, though the level on the CCPx pin will be determined by the value in the data latch of the port. Figure 3 shows the block diagram of the CCP module in Compare mode.

Appendix B is a program which uses the CCP module to transmit a pulse train dependent on the data byte. Timer1 is used as a free running timer, with each "new" compare value being an offset added to the present CCP compare latch value. The data is transmitted every 600 µs. Each data bit has a sync pulse (High level) of 8.8 µs. Then the data is transmitted as a low pulse. The time duration of the low pulse determines the value of the data bit. A '0' bit is low for 18.8 µs while a '1' bit is low for 37.6 µs. After the last data bit has been transmitted, another sync pulse is transmitted and the output remains low (idle time) until the 600 µs data period has completed. An example of the pulse train for the a data byte of 0x0CA is shown in Figure 4, and has an idle time of 224 µs. These pulse times are based off the device operational frequency. The program header file, `COMP.H`, calculates the values to be loaded into the compare registers from the specified Device_freq. The data to be transmitted is read from PORTB, during the idle time. By setting the conditional assemble flag `PICMaster` to `TRUE`, these values are read from internal registers which are dummy registers for the ports (DUMMY_Px). This allows the software to be verified without the use of hardware and external stimulus.

FIGURE 4: TRANSMIT PULSE TRAIN (DATA = 0x0CA)

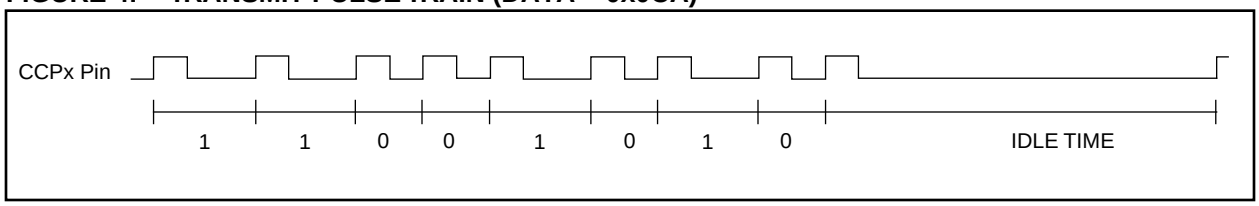

Capture Mode

In Capture mode, the 16-bit value of Timer1 is latched into the CCPRxH:CCPRxL registers, when the S/W configured event occurs on the CCPx pin. The events that can cause a capture are:

- Every falling edge
- Every rising edge
- Every 4th rising edge
- Every 16th rising edge

The CCPxM3:CCPxM0 control bits, in register CCPxCON, configures the operation of the CCP module. The capture function works regardless of the data direction of the CCPx pin (input or output). With the CCPx pin is configured as an output, a write to the CCPx pin (in PORTC) will cause a capture when the capture requirement is met.

FIGURE 5: CAPTURE MODE BLOCK DIAGRAM

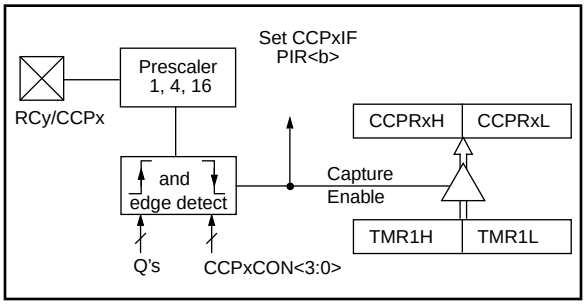

The changing of the Capture mode, via the CCPxM3:CCPxM0 bits, may cause the CCPxIF bit to be set. This "false" interrupt should be cleared (ignored) after changing between capture modes. The CCP prescaler is only cleared by configuring the CCP module into the OFF state (CCPxM3:CCPxM0 = 0h). Figure 5 shows the block diagram of the CCP module in Capture mode. The use of the CCP module in Capture mode is similar to the PIC17C42's capture. Additional concepts of capture operation can be found in Application Note AN545.

Appendix C is a program which implements a 16-bit capture from a free running timer (Timer1). The capture event is configured as each rising edge. The 16-bit capture value is the "new" 16-bit capture value minus the "old" 16-bit capture value. If the time between captures is greater than 2^{16} Timer1 increments, an invalid result will occur. This invalid result is not indicated by the software. After the capture period result is calculated, the "new" capture value is loaded into the "old" register.

The waveform that is captured is generated from a second CCP module in compare mode. The value that is loaded in to the CCPR2H:CCPR2L is read from the PORTB and PORTD registers. By setting the conditional assemble flag `PICMaster` to `TRUE`, these values are read from internal registers which are dummy registers for the ports (DUMMY_Px). This allows the software to be verified without the use of hardware and external stimulus. Figure 6 shows an input into the CCPx pin, and the capture measurement points.

FIGURE 6: EXAMPLE CAPTURE WAVEFORM

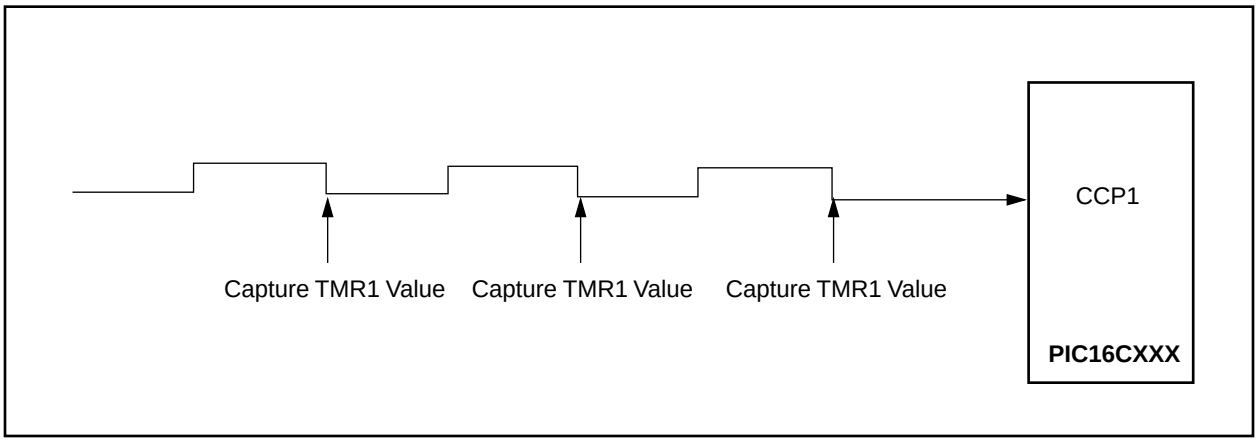

INTERACTION OF CCP MODULES

Due to the modularity of the PIC16CXXX peripherals, future devices with two or more CCP modules on a device are possible. Each CCP module operates independently from the others, though their interaction with the timer resources must be taken into account.

When two or more CCP modules exist on a device, there can be an interaction between the CCP modules. This interaction is shown in Table 3. These interactions do NOT include any interaction (S/W) caused by the main program nor the interrupt service routines of the CCP sources.

Interaction of Two Capture Modes

When two CCP modules are in a Capture mode, Timer1 is the time-base for both captures. This means that they will have the same capture resolution, as determined by the Timer1 prescaler and frequency of the timer/counter clock. This clock can come from an external source (on the RC0/T1OSO/T1CKI pin), but must be synchronized to the device.

Interaction of One Capture Mode and One Compare Mode

When one CCP module is in a Capture mode and a second CCP module is in Compare mode, Timer1 is the time-base for both the captures and the compare. This means that the capture and the compare will have the same resolution, as determined by the Timer1 prescaler and frequency of the timer/counter clock. This clock can come from an external source (on the RC0/T1OSO/T1CKI pin), but must be synchronized to the processor clock. Also, care must be taken in that the compare can be configured to clear TMR1 register (when in special Trigger mode). Care must be taken in system design to ensure that this clearing of the TMR1 register does not have any negative impact on the capture function.

TABLE 3: INTERACTION OF TWO CCP MODULES

CCPx Mode	CCPy Mode	Interaction
Capture	Capture	Same Timer1 time-base.
Capture	Capture	The compare could be configured for trigger special event, which clears the TMR1 register.
Capture	Capture	The compare(s) could be configured for trigger special event, which clears the TMR1 register.
PWM	PWM	The PWMs will have the same frequency, and update rate (Timer2 interrupt).
PWM	Capture	None
PWM	Capture	None

EXAMPLE 1:

ACTION	TIMER1 STATE	COMMENT
CCPR1H:CCPR1L = 0x0465	0x????	
CCP1CON = 0x?B	0x????	CCP1 in Compare - Special Trigger Mode
:		
:	0x0232	
:		
CCPR2H:CCPR2L = 0x0165	0x0333	
CCP2CON = 0x?B	0x0334	CCP2 in Compare - Special Trigger Mode
:		
	0x0465	CCP1 resets TMR1 and CCP1 -
	0x0000	Special Trigger function occurs
:		
	0x0165	CCP2 resets TMR1 and CCP2 -
	0x0000	Special Trigger function occurs
:		
	0x0165	CCP2 resets TMR1 and CCP2 -
	0x0000	Special Trigger function occurs
:		

Interaction of Two Compare Modes

When two CCP modules are in a Compare mode, Timer1 is the time-base for both compares. This means that they will have the same compare resolution, as determined by the Timer1 prescaler and frequency of the timer/counter clock. This clock can come from an external source (on the RC0/T1OSO/T1CKI pin), but must be synchronized to the processor clock. Since the compare modules can be configured to clear TMR1 register (when in special Trigger mode), care must be taken in system design to ensure that this clearing of the TMR1 register does not have any negative impact on the compare function. If both compares are configured with a special trigger, which clears the TMR1 register, then the compare register that is closest to (but greater than) the TMR1 register value is the compare value that will reset the TMR1 register. Example 1 shows a possible case.

Interaction of Two PWM Modes

When two CCP modules are in a PWM mode, Timer2 is the time-base for both PWM outputs. This means that they will have the same PWM frequency and update rates, as determined by the Timer2 prescaler and frequency of the device. The resolution of the two PWMs may be different, since each CCP module has its own CCPxX:CCPxY bits for high resolution mode. These bits are found in the CCPxCON<5:4> register.

CONCLUSION

The Capture/Compare/PWM modules offer enormous flexibility in the use of the device timer resources. As with all resources, care must be taken to ensure that no adverse system complications can occur with the interaction between multiple CCP modules. The programs for simple operation of the various CCP modes should be a good foundation for modifications to suite your particular needs.

Please check the Microchip BBS for the latest version of the source code. Microchip's Worldwide Web Address: www.microchip.com; Bulletin Board Support: MCHIPBBS using CompuServe® (CompuServe membership not required).

APPENDIX A: PWM_1.ASM

```
MPASM 01.40 Released            PWM_1.ASM   1-16-1997  17:35:52         PAGE  1


LOC  OBJECT CODE     LINE SOURCE TEXT
  VALUE

                     00001         LIST    P = 16C74, n = 66
                     00002         ERRORLEVEL  -302
                     00003 ;
                     00004 ;*****************************************************************
                     00005 ;
                     00006 ; This program outputs a PWM signal on the CCP1 pin. The duty cycle and
                     00007 ; period of the PWM is read every time TMR1 overflows.
                     00008 ;    PERIOD     = PORTB
                     00009 ;    DUTY CYCLE = PORTD and PORTE<1:0>
                     00010 ;
                     00011 ; The prescaler of TMR2 is selected by the state of PORTA<1:0> after
                     00012 ; reset    RA1:RA0    Prescaler multiplies Tcyc by
                     00013 ;            0 0       1
                     00014 ;            0 1       4
                     00015 ;            1 x      16
                     00016 ;
                     00017 ;
                     00018 ;       Program = PWM_1.ASM
                     00019 ;       Revision Date:   7-13-94
                     00020 ;                        1-16-97      Compatibility with MPASMWIN 1.40
                     00021 ;
                     00022 ;
                     00023 ;*****************************************************************
                     00024 ;
                     00025 ;
                     00026 ; HARDWARE SETUP
                     00027 ;    PORTA<1:0>   -  Prescaler to TMR2, read only after reset
                     00028 ;    PORTB        -  Period of PWM
                     00029 ;    PORTD        -  Duty Cycle high of PWM (8-bits)
                     00030 ;    PORTE<1:0>   -  Duty Cycle low of PWM (2-bits)
                     00031 ;
                     00032 ;
                     00033             INCLUDE <p16c74.inc>
                     00001         LIST
                     00002 ; P16C74.INC Standard Header File, Ver. 1.00 Microchip Technology, Inc.
                     00318         LIST
                     00034
  00000000           00035 FALSE           EQU     0
  00000001           00036 TRUE            EQU     1
                     00037
                     00038             INCLUDE <PWM.h>
                     00046         list
                     00047
                     00039 ;
  00000001           00040 PICMaster       EQU     TRUE      ; A Debugging Flag
  00000001           00041 Debug           EQU     TRUE      ; A Debugging Flag
  00000001           00042 Debug_PU        EQU     TRUE      ; A Debugging Flag
                     00043 ;
                     00044 ;
                     00045 ; Reset address. Determine type of RESET
                     00046 ;
0000                 00047       org     RESET_V           ; RESET vector location
0000 1683            00048 RESET     BSF     STATUS, RP0   ; Bank 1
0001 188E            00049           BTFSC   PCON,NOT_POR  ; Power-up reset?
```

```
0002 2832           00050           GOTO    START        ; YES
0003 285C           00051           GOTO    OTHER_RESET  ; NO, a WDT or MCLR reset
                    00052 ;
                    00053 ; This is the Periperal Interrupt routine. Need to determine the type
                    00054 ; of interrupt that occurred. The following interrupts are enabled:
                    00055 ;   1.  CCP Capture Occured
                    00056 ;
                    00057     page
0004                00058       org     ISR_V            ; Interrupt vector location
0004                00059 PER_INT_V
0004 1283           00060           BCF     STATUS, RP0  ; Bank 0
0005 180C           00061           BTFSC   PIR1, TMR1IF ; TMR1 Overflow Interrupt occured?
0006 280D           00062           GOTO    T1OVFL       ; YES, Service the TMR1 Interrupt
0007                00063 ERROR1                         ; NO, Error Condition-Unknown Interrupt
0007 1505           00064           BSF     PORTA, 2     ; Toggle a PORT pin
0008 1105           00065           BCF     PORTA, 2
0009 2807           00066           GOTO    ERROR1
                    00067 ;
000A                00068 ERROR2                         ; NO, Error Condition-Unknown Interrupt
000A 1585           00069           BSF     PORTA, 3     ; Toggle a PORT pin
000B 1185           00070           BCF     PORTA, 3
000C 280A           00071           GOTO    ERROR2
                    00072 ;
000D                00073 T1OVFL
000D 100C           00074           BCF     PIR1, TMR1IF ; Clear T1 Overflow Interrupt Flag
                    00075       if (PICMaster )
000E 0853           00076           MOVF    DUMMY_PD, W  ;
                    00077       else
                    00078           MOVF    PORTD, W     ;
                    00079       endif
000F 00D5           00080           MOVWF   DC_HI        ;
                    00081       if (PICMaster )
0010 0854           00082           MOVF    DUMMY_PE, W  ;
                    00083       else
                    00084           MOVF    PORTE, W     ;
                    00085       endif
0011 00D6           00086           MOVWF   DC_LO        ;
                    00087       if (PICMaster )
0012 0851           00088           MOVF    DUMMY_PB, W  ;
                    00089       else
                    00090           MOVF    PORTB, W     ;
                    00091       endif
0013 1683           00092           BSF     STATUS, RP0  ; Bank 1
0014 00A0           00093           MOVWF   T2_PERIOD    ;
0015 1283           00094           BCF     STATUS, RP0  ; Bank 0
                    00095 ;
0016                00096 WAIT_DC
0016 0811           00097           MOVF    TMR2, W      ; Read present TMR2 register value
0017 0212           00098           SUBWF   PR2, W       ; How close is the timer to rolling over
0018 390F           00099           ANDLW   0x0F         ; Does this make it zero?
0019 1903           00100           BTFSC   STATUS, Z    ; If Z is set, near rollover
001A 2816           00101           GOTO    WAIT_DC      ; loop until rolled over
001B 0855           00102           MOVF    DC_HI, W     ; else losd the duty cycle values
001C 0095           00103           MOVWF   CCPR1L       ; Load DC high
001D 300F           00104           MOVLW   0x0F         ;
001E 0597           00105           ANDWF   CCP1CON, F   ; Set the DC low bits
001F 18D6           00106           BTFSC   DC_LO, 1     ;
0020 1697           00107           BSF     CCP1CON, CCP1X;
0021 1856           00108           BTFSC   DC_LO, 0     ;
0022 1617           00109           BSF     CCP1CON, CCP1Y;
0023 108C           00110           BCF     PIR1, TMR2IF ; Clear the TRM2 = PR2 flag
                    00111 ;
0024                00112 WAIT_PR
0024 1C8C           00113           BTFSS   PIR1, TMR2IF ; LOOP waiting for TRM2 = PR2
0025 2824           00114           GOTO    WAIT_PR      ; Need to wait until TMR2 = PR2 so that
                    00115                                ;  Duty Cycle is latched
```

```
0026 1683          00116           BSF     STATUS, RP0  ; Bank 1
0027 300F          00117           MOVLW   0x0F         ; Load TMR2 period with minimum value Fh
0028 0092          00118           MOVWF   PR2          ;
0029 30F0          00119           MOVLW   0xF0         ;
002A 0520          00120           ANDWF   T2_PERIOD, W ; Determine if period needs to be greater
002B 1903          00121           BTFSC   STATUS, Z    ;
002C 2830          00122           GOTO    NO_OFFSET    ; NO, Period is the minimum
002D               00123 PR_OFFSET
002D 300F          00124           MOVLW   0x0F         ; Yes, calculate additional offset
002E 0220          00125           SUBWF   T2_PERIOD, W ;
002F 0792          00126           ADDWF   PR2, F       ; ADD Period offset
                   00127 ;
0030               00128 NO_OFFSET
0030 1283          00129           BCF     STATUS, RP0  ; Bank 0
0031 0009          00130           RETFIE               ; Return / Enable Global Interrupts
                   00131 ;
                   00132     page
                   00133 ;
                   00134 ;*****************************************************************
                   00135 ;*****      Start program here, Power-On Reset occurred.
                   00136 ;*****************************************************************
                   00137 ;
0032               00138 START                          ; POWER_ON Reset (Beginning of program)
0032 1283          00139           BCF     STATUS, RP0  ; Bank 0
0033 018F          00140           CLRF    TMR1H        ;
0034 018E          00141           CLRF    TMR1L        ;
                   00142 ;
0035               00143 MCLR_RESET                     ; A Master Clear Reset
0035 0183          00144           CLRF    STATUS       ; Do initialization (Bank 0)
0036 018B          00145           CLRF    INTCON
0037 018C          00146           CLRF    PIR1
0038 1683          00147           BSF     STATUS, RP0  ; Bank 1
0039 3080          00148           MOVLW   0x80         ;
003A 0081          00149           MOVWF   OPTION_REG   ;
003B 018C          00150           CLRF    PIE1         ; Disable all peripheral interrupts
003C 30FF          00151           MOVLW   0xFF         ;
003D 009F          00152           MOVWF   ADCON1       ; Port A is Digital.
                   00153 ;
                   00154 ;
003E 1283          00155           BCF     STATUS, RP0  ; Bank 0
003F 0185          00156           CLRF    PORTA        ; ALL PORT output should output Low.
0040 0186          00157           CLRF    PORTB
0041 0187          00158           CLRF    PORTC
0042 0188          00159           CLRF    PORTD
0043 0189          00160           CLRF    PORTE
                   00161 ;
0044 1683          00162           BSF     STATUS, RP0  ; Select Bank 1
0045 30FF          00163           MOVLW   0xFF         ;
0046 0085          00164           MOVWF   TRISA        ; RA5 -  0 inputs
0047 0086          00165           MOVWF   TRISB        ; RB7 - 0 inputs
0048 0187          00166           CLRF    TRISC        ; RC Port are outputs
0049 0088          00167           MOVWF   TRISD        ; RD Port are inputs
004A 0089          00168           MOVWF   TRISE        ; RE Port are inputs
004B 0092          00169           MOVWF   PR2          ; Default PWM period
004C 140C          00170           BSF     PIE1, TMR1IE ; Enable TMR1 Interrupt
004D 1283          00171           BCF     STATUS, RP0  ; Select Bank 0
                   00172 ;
004E 300C          00173           MOVLW   0X0C         ; CCP module is in
004F 0097          00174           MOVWF   CCP1CON      ; PWM output mode
                   00175 ;
                   00176 ; Initialize the Special Function Registers (SFR) interrupts
                   00177 ;
0050 018C          00178           CLRF    PIR1         ;
0051 0190          00179           CLRF    T1CON        ;
0052 0192          00180           CLRF    T2CON        ;
                   00181       if (PICMaster )
```

```
0053 1850           00182           BTFSC   DUMMY_PA, 0   ;
                    00183       else
                    00184           BTFSC   PORTA, 0      ;
                    00185       endif
0054 1412           00186           BSF     T2CON, 0      ;
                    00187 ;
                    00188       if (PICMaster )
0055 18D0           00189           BTFSC   DUMMY_PA, 1   ;
                    00190       else
                    00191           BTFSC   PORTA, 1      ;
                    00192       endif
0056 1492           00193           BSF     T2CON, 1      ;
                    00194 ;
0057 170B           00195           BSF     INTCON, PEIE  ; Enable Peripheral Interrupts
0058 178B           00196           BSF     INTCON, GIE   ; Enable all Interrupts
0059 1410           00197           BSF     T1CON, TMR1ON ; Turn Timer 1 ON
005A 1512           00198           BSF     T2CON, TMR2ON ; Turn Timer 2 ON
                    00199 ;
005B 285B           00200 lzz       goto    lzz           ; Loop waiting for TMR1 interrupt
                    00201 ;
                    00202 ; Here is where you do things depending on the type of RESET (Not a
                    00203 ; Power-On Reset).
005C 1E03           00204 OTHER_RESET BTFSS STATUS,NOT_TO ; WDT Time-out?
005D 2807           00205 WDT_TIMEOUT GOTO   ERROR1       ; YES, This is error condition
                    00206       if ( Debug_PU )
005E 2832           00207           goto   START          ; MCLR reset, Goto START
                    00208       else
                    00209           GOTO   MCLR_RESET     ; MCLR reset, Goto MCLR_RESET
                    00210       endif
                    00211 ;
                    00212       if (Debug )
005F 0000           00213 END_START   NOP                 ; END label for debug
                    00214       endif
                    00215 ;
                    00216 ;
07FF                00217     org     PMEM_END            ; End of Program Memory
07FF 2807           00218             GOTO    ERROR1      ; If you get here your program was lost
                    00219
                    00220     end
_XT_OSC                         00003FBD
__16C74                         00000001
lzz                             0000005B


MEMORY USAGE MAP ('X' = Used,  '-' = Unused)

0000 : XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX
0040 : XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX ---------------- ----------------
07C0 : ---------------- ---------------- ---------------- ---------------X

All other memory blocks unused.

Program Memory Words Used:    97
Program Memory Words Free:  3999


Errors   :     0
Warnings :     0 reported,     0 suppressed
Messages :     0 reported,    17 suppressed
```

Please check the Microchip BBS for the latest version of the source code. Microchip's Worldwide Web Address: www.microchip.com; Bulletin Board Support: MCHIPBBS using CompuServe® (CompuServe membership not required).

APPENDIX B: PWM.H

```
    nolist
;*************************************************************************
;
;  This is the custom Header File for the real time clock application note
;   PROGRAM:CLOCK.H
;   Revision:7-13-94
;
;*************************************************************************
; This is used for the ASSEMBLER to recalculate certain frequency
; dependant variables. The value of Dev_Freq must be changed to
; reflect the frequency that the device actually operates at.
;
Dev_Freq        EQU     D'10000000'; Device Frequency is 4 MHz
PULSE_TIME      EQU     (( Dev_Freq / D'4000' ) * D'188' / D'10000' )
;

DB_HI_BYTE      EQU     (HIGH ((( Dev_Freq / 4 ) * 1 / D'1000' ) / 3 ) ) + 1
LCD_INIT_DELAY  EQU     (HIGH ((( Dev_Freq / 4 ) * D'46' / D'10000' ) / 3 ) ) + 1
INNER_CNTR      EQU     40     ; RAM Location
OUTER_CNTR      EQU     41     ; RAM Location
;
T1OSO           EQU     0      ; The RC0 / T1OSO / T1CKI
;
RESET_V         EQU     0x0000 ; Address of RESET Vector
ISR_V           EQU     0x0004 ; Address of Interrupt Vector
PMEM_END        EQU     0x07FF ; Last address in Program Memory
TABLE_ADDR      EQU     0x0400 ; Address where to start Tables
;
COUNTER         EQU     0x021      ;
;
XMIT_DATA       EQU     0x30
DATA_CNT        EQU     0x31
ONES_CNT        EQU     0x32
CCP1_INT_CNT    EQU     0x33
CCPREG_HI       EQU     0x40
CCPREG_LO       EQU     0x41
DUMMY_PA        EQU     0x50
DUMMY_PB        EQU     0x51
DUMMY_PC        EQU     0x52
DUMMY_PD        EQU     0x53
DUMMY_PE        EQU     0x54
DC_HI           EQU     0x55
DC_LO           EQU     0x56
T2_PERIOD       EQU     0xA0
;
    list
```

Please check the Microchip BBS for the latest version of the source code. Microchip's Worldwide Web Address: www.microchip.com; Bulletin Board Support: MCHIPBBS using CompuServe® (CompuServe membership not required).

APPENDIX C: COMP_1.LST

```
MPASM 01.40 Released           COMP_1.ASM   1-16-1997  17:35:21         PAGE  1


LOC  OBJECT CODE     LINE SOURCE TEXT
  VALUE

                     00001         LIST    P = 16C74, n = 66
                     00002         ERRORLEVEL  -302
                     00003 ;
                     00004 ;***********************************************************************
                     00005 ;
                     00006 ; This program outputs a pulse train on the CCP1 pin, as specified by
                     00007 ; the values in the CCPR1H:CCPR1L.
                     00008 ;
                     00009 ;                        ____          ____      __
                     00010 ;  Pulse Train    ___|    |________|    |____|
                     00011 ;  Data Value         <---- 1 ----> <-- 0 -->
                     00012 ;                       ^      ^      ^    ^
                     00013 ;                       |      |      |    |
                     00014 ;                       |  T_ONE_BIT  |  T_ZERO_BIT
                     00015 ;                       |             |
                     00016 ;                   PULSE_TIME    PULSE_TIME
                     00017 ;
                     00018 ;
                     00019 ;       Program = COMP_1.ASM
                     00020 ;       Revision Date:   7-13-94
                     00021 ;                        1-16-97      Compatibility with MPASMWIN 1.40
                     00022 ;
                     00023 ;
                     00024 ;***********************************************************************
                     00025 ;
                     00026 ;
                     00027 ; HARDWARE SETUP
                     00028 ;    PORTB        -  Data to serial transmit on CCP pin
                     00029 ;
                     00030 ;
                     00031             INCLUDE <p16c74.inc>
                     00001         LIST
                     00002 ;P16C74.INC Standard Header File, Version 1.00 Microchip Technology
                     00318         LIST
                     00032
  00000000           00033 FALSE       EQU     0
  00000001           00034 TRUE        EQU     1
                     00035
                     00036             INCLUDE <COMP.h>
                     00052         list
                     00053
                     00037 ;
  00000001           00038 PICMaster   EQU     TRUE        ; A Debugging Flag
  00000001           00039 Debug       EQU     TRUE        ; A Debugging Flag
  00000001           00040 Debug_PU    EQU     TRUE        ; A Debugging Flag
                     00041 ;
                     00042 ;
                     00043 ; Reset address. Determine type of RESET
                     00044 ;
0000                 00045         org     RESET_V             ; RESET vector location
0000 1683            00046 RESET       BSF     STATUS, RP0     ; Bank 1
0001 188E            00047             BTFSC   PCON,NOT_POR    ; Power-up reset?
0002 287C            00048             GOTO    START           ; YES
0003 28BA            00049             GOTO    OTHER_RESET     ; NO, a WDT or MCLR reset
```

```
                00050 ;
                00051 ; This is the Peripheral Interrupt routine. Need to determine the type
                00052 ; of interrupt that occurred. The following interrupts are enabled:
                00053 ;   1.  CCP Capture Occured
                00054 ;
                00055     page
0004            00056         org     ISR_V           ; Interrupt vector location
0004            00057 PER_INT_V
                00058         if ( Debug )
0004 1405       00059             bsf     PORTA, 0    ; Turn on strobe
                00060         endif                   ;
0005 1283       00061             BCF     STATUS, RP0 ; Bank 0
0006 190C       00062             BTFSC   PIR1, CCP1IF ; Compare Interrupt occured?
0007 280E       00063             GOTO    CCP1_INT    ; YES, Service the TMR1 Interrupt
0008            00064 ERROR1                          ; NO, Error Condition-Unknown Interrupt
0008 1505       00065             BSF     PORTA, 2    ; Toggle a PORT pin
0009 1105       00066             BCF     PORTA, 2
000A 2808       00067             GOTO    ERROR1
                00068 ;
000B            00069 ERROR2                          ; NO, Error Condition-Unknown Interrupt
000B 1585       00070             BSF     PORTA, 3    ; Toggle a PORT pin
000C 1185       00071             BCF     PORTA, 3
000D 280B       00072             GOTO    ERROR2
                00073 ;
                00074 ;
                00075 ;*****************************************************************
                00076 ; In the CCP interrupt.
                00077 ; Since timer1 is not cleared on a CCP match, the value in the
                00078 ; CCPR1H:CCPR1L register pair must be updated. This is done with
                00079 ; a 16-bit add. Also after the 1st CCP1 match (CCP1 pin goes high) the
                00080 ; next match will force it low. Depending on the value of the data bit
                00081 ; determines the value add to the CCPR1H:CCPR1L register pair.
                00082 ;
                00083 ; After the data has been transmitted, the pin will have a sync pulse
                00084 ; and then remain low for 300 us.
                00085 ;*****************************************************************
                00086 ;
                00087
000E            00088 CCP1_INT
000E 110C       00089             BCF     PIR1, CCP1IF    ; Clear CCP1 Interrupt Flag
000F 0AB3       00090             INCF    CCP1_INT_CNT, F ;
0010 1C33       00091             BTFSS   CCP1_INT_CNT, 0 ;
0011 2833       00092             GOTO    SYNC_PULSE
0012            00093 DATA_PULSE
0012 03B1       00094             DECF    DATA_CNT, F     ; Decrement the Count of data bits
0013 1903       00095             BTFSC   STATUS, Z       ; Have we transmitted all the Data Bits?
0014 2827       00096             GOTO    PERIOD_DELTA    ; YES, Delay to 300 us
0015 0DB0       00097             RLF     XMIT_DATA, F    ; NO, get next bit to transmit
0016 1803       00098             BTFSC   STATUS, C       ; Is the bit to transmit a '1'?
0017 281F       00099             GOTO    ONE_DATA        ; YES, Stay low for 17.6 us
0018            00100 ZERO_DATA
0018 302F       00101             MOVLW   LOW ( T_ZERO_BIT ) ; NO, Stay low for 8.8 us
0019 0795       00102             ADDWF   CCPR1L, F          ; Update Compare register pair latch
001A 1803       00103             BTFSC   STATUS, C          ;
001B 0A96       00104             INCF    CCPR1H, F          ;
001C 3000       00105             MOVLW   HIGH (T_ZERO_BIT ) ;
001D 0796       00106             ADDWF   CCPR1H, F          ;
001E 287A       00107             GOTO    RET_FIE
                00108 ;
001F            00109 ONE_DATA
001F 305E       00110             MOVLW   LOW ( T_ONE_BIT )  ; Stay low for 17.6 us
0020 0795       00111             ADDWF   CCPR1L, F          ; Update Compare register pair latch
0021 1803       00112             BTFSC   STATUS, C          ;
0022 0A96       00113             INCF    CCPR1H, F          ;
0023 3000       00114             MOVLW   HIGH ( T_ONE_BIT ) ;
0024 0796       00115             ADDWF   CCPR1H, F          ;
```

```
0025 0AB2      00116             INCF    ONES_CNT, F    ; Increment the number of 1's in the byte
0026 287A      00117             GOTO    RET_FIE
               00118 ;
0027           00119 PERIOD_DELTA
0027 0832      00120             MOVF    ONES_CNT, W    ;
0028 390F      00121             ANDLW   0x0F           ; Only want 9 states (0 1s to 8 1s)
0029 0782      00122             ADDWF   PCL, F         ;
002A 283B      00123             GOTO    ZERO_1         ; There was 0 ones in the data byte
002B 2842      00124             GOTO    ONE_1          ; There was 1 one in the data byte
002C 2849      00125             GOTO    TWO_1          ; There was 2 ones in the data byte
002D 2850      00126             GOTO    THREE_1        ; There was 3 ones in the data byte
002E 2857      00127             GOTO    FOUR_1         ; There was 4 ones in the data byte
002F 285E      00128             GOTO    FIVE_1         ; There was 5 ones in the data byte
0030 2865      00129             GOTO    SIX_1          ; There was 6 ones in the data byte
0031 286C      00130             GOTO    SEVEN_1        ; There was 7 ones in the data byte
0032 2873      00131             GOTO    EIGHT_1        ; There was 8 ones in the data byte
               00132 ;
0033           00133 SYNC_PULSE
0033 302F      00134             MOVLW   LOW ( PULSE_TIME ) ;Update Compare register pair latch
0034 0795      00135             ADDWF   CCPR1L, F          ;
0035 1803      00136             BTFSC   STATUS, C          ;
0036 0A96      00137             INCF    CCPR1H, F          ;
0037 3000      00138             MOVLW   HIGH ( PULSE_TIME );
0038 0796      00139             ADDWF   CCPR1H, F          ;
0039 1417      00140             BSF     CCP1CON, 0         ; On Compare match, CCP1 pin = L
003A 0009      00141             RETFIE
               00142 ;
003B           00143 ZERO_1
003B 30EC      00144             MOVLW   LOW ( ZERO_1S )    ; Update Compare register pair latch
003C 0795      00145             ADDWF   CCPR1L, F          ;
003D 1803      00146             BTFSC   STATUS, C          ;
003E 0A96      00147             INCF    CCPR1H, F          ;
003F 3002      00148             MOVLW   HIGH ( ZERO_1S )   ;
0040 0796      00149             ADDWF   CCPR1H, F          ;
0041 287A      00150             GOTO    RET_FIE
               00151 ;
0042           00152 ONE_1
0042 30BD      00153             MOVLW   LOW ( ONE_1S )     ; Update Compare register pair latch
0043 0795      00154             ADDWF   CCPR1L, F          ;
0044 1803      00155             BTFSC   STATUS, C          ;
0045 0A96      00156             INCF    CCPR1H, F          ;
0046 3002      00157             MOVLW   HIGH ( ONE_1S )    ;
0047 0796      00158             ADDWF   CCPR1H, F          ;
0048 287A      00159             GOTO    RET_FIE
               00160 ;
0049           00161 TWO_1
0049 308E      00162             MOVLW   LOW ( TWO_1S )     ; Update Compare register pair latch
004A 0795      00163             ADDWF   CCPR1L, F          ;
004B 1803      00164             BTFSC   STATUS, C          ;
004C 0A96      00165             INCF    CCPR1H, F          ;
004D 3002      00166             MOVLW   HIGH ( TWO_1S )    ;
004E 0796      00167             ADDWF   CCPR1H, F          ;
004F 287A      00168             GOTO    RET_FIE
               00169 ;
0050           00170 THREE_1
0050 305F      00171             MOVLW   LOW ( THREE_1S )   ; Update Compare register pair latch
0051 0795      00172             ADDWF   CCPR1L, F          ;
0052 1803      00173             BTFSC   STATUS, C          ;
0053 0A96      00174             INCF    CCPR1H, F          ;
0054 3002      00175             MOVLW   HIGH ( THREE_1S )  ;
0055 0796      00176             ADDWF   CCPR1H, F          ;
0056 287A      00177             GOTO    RET_FIE
               00178 ;
0057           00179 FOUR_1
0057 3030      00180             MOVLW   LOW ( FOUR_1S )    ; Update Compare register pair latch
0058 0795      00181             ADDWF   CCPR1L, F          ;
```

```
0059 1803       00182             BTFSC   STATUS, C       ;
005A 0A96       00183             INCF    CCPR1H, F       ;
005B 3002       00184             MOVLW   HIGH ( FOUR_1S );
005C 0796       00185             ADDWF   CCPR1H, F       ;
005D 287A       00186             GOTO    RET_FIE
                00187 ;
005E            00188 FIVE_1
005E 3001       00189             MOVLW   LOW ( FIVE_1S ) ; Update Compare register pair latch
005F 0795       00190             ADDWF   CCPR1L, F       ;
0060 1803       00191             BTFSC   STATUS, C       ;
0061 0A96       00192             INCF    CCPR1H, F       ;
0062 3002       00193             MOVLW   HIGH ( FIVE_1S  ;
0063 0796       00194             ADDWF   CCPR1H, F       ;
0064 287A       00195             GOTO    RET_FIE
                00196 ;
0065            00197 SIX_1
0065 30D2       00198             MOVLW   LOW ( SIX_1S )  ; Update Compare register pair latch
0066 0795       00199             ADDWF   CCPR1L, F       ;
0067 1803       00200             BTFSC   STATUS, C       ;
0068 0A96       00201             INCF    CCPR1H, F       ;
0069 3001       00202             MOVLW   HIGH ( SIX_1S ) ;
006A 0796       00203             ADDWF   CCPR1H, F       ;
006B 287A       00204             GOTO    RET_FIE
                00205 ;
006C            00206 SEVEN_1
006C 30A3       00207             MOVLW   LOW ( SEVEN_1S )  ; Update Compare register pair latch
006D 0795       00208             ADDWF   CCPR1L, F         ;
006E 1803       00209             BTFSC   STATUS, C         ;
006F 0A96       00210             INCF    CCPR1H, F         ;
0070 3001       00211             MOVLW   HIGH ( SEVEN_1S ) ;
0071 0796       00212             ADDWF   CCPR1H, F         ;
0072 287A       00213             GOTO    RET_FIE
                00214 ;
0073            00215 EIGHT_1
0073 3074       00216             MOVLW   LOW ( EIGHT_1S )  ; Update Compare register pair latch
0074 0795       00217             ADDWF   CCPR1L, F         ;
0075 1803       00218             BTFSC   STATUS, C         ;
0076 0A96       00219             INCF    CCPR1H, F         ;
0077 3001       00220             MOVLW   HIGH ( EIGHT_1S ) ;
0078 0796       00221             ADDWF   CCPR1H, F         ;
0079 287A       00222             GOTO    RET_FIE
                00223
007A            00224 RET_FIE
007A 1017       00225             BCF     CCP1CON, 0        ; On Compare match, CCP1 pin = H
007B 0009       00226             RETFIE                    ; Return / Enable Global Interrupts
                00227 ;
                00228     page
                00229 ;
                00230 ;*****************************************************************
                00231 ;*****      Start program here, Power-On Reset occurred.
                00232 ;*****************************************************************
                00233 ;
007C            00234 START                               ; POWER_ON Reset (Beginning of program)
007C 1283       00235             BCF     STATUS, RP0     ; Bank 0
007D 018F       00236             CLRF    TMR1H           ;
007E 018E       00237             CLRF    TMR1L           ;
                00238 ;
007F            00239 MCLR_RESET                          ; A Master Clear Reset
007F 1283       00240             BCF     STATUS, RP0     ; Bank 0
0080 0183       00241             CLRF    STATUS          ; Do initialization (Bank 0)
0081 018B       00242             CLRF    INTCON
0082 018C       00243             CLRF    PIR1
0083 1683       00244             BSF     STATUS, RP0     ; Bank 1
0084 3080       00245             MOVLW   0x80            ; Disable PORTB weak pull-ups
0085 0081       00246             MOVWF   OPTION_REG      ;
0086 018C       00247             CLRF    PIE1            ; Disable all peripheral interrupts
```

```
0087 30FF       00248             MOVLW   0xFF            ;
0088 009F       00249             MOVWF   ADCON1          ; Port A is Digital.
                00250 ;
                00251 ;
0089 1283       00252             BCF     STATUS, RP0     ; Bank 0
008A 0185       00253             CLRF    PORTA           ; ALL PORT output should output Low.
008B 0186       00254             CLRF    PORTB
008C 0187       00255             CLRF    PORTC
008D 0188       00256             CLRF    PORTD
008E 0189       00257             CLRF    PORTE
008F 1010       00258             BCF     T1CON, TMR1ON   ; Timer 1 is NOT incrementing
                00259 ;
0090 1683       00260             BSF     STATUS, RP0     ; Select Bank 1
0091 0185       00261             CLRF    TRISA           ; RA5 -  0 outputs
0092 30FF       00262             MOVLW   0xFF            ;
0093 0086       00263             MOVWF   TRISB           ; RB Port are inputs
0094 0187       00264             CLRF    TRISC           ; RC Port are outputs
0095 0188       00265             CLRF    TRISD           ; RD Port are outputs
0096 0189       00266             CLRF    TRISE           ; RE Port are outputs
0097 150C       00267             BSF     PIE1, CCP1IE    ; Enable CCP1 Interrupt
0098 1283       00268             BCF     STATUS, RP0     ; Select Bank 0
                00269 ;
                00270     page
                00271 ;
                00272 ;
                00273 ; Initialize the Special Function Registers (SFR) interrupts
                00274 ;
0099 018C       00275             CLRF    PIR1            ;
009A 0190       00276             CLRF    T1CON           ; Timer mode
009B 170B       00277             BSF     INTCON, PEIE    ; Enable Peripheral Interrupts
009C 178B       00278             BSF     INTCON, GIE     ; Enable all Interrupts
                00279 ;
                00280 ; Set-up timer and compare latches and then turn timer1 on.
                00281 ;
009D 1010       00282             BCF     T1CON, TMR1ON  ; Turn OFF timer1
009E 3041       00283             MOVLW   CCPREG_HI      ; TMR1 = CCPR1H:CCPR1L - 1
009F 008F       00284             MOVWF   TMR1H          ;
00A0 3042       00285             MOVLW   CCPREG_LO      ;
00A1 008E       00286             MOVWF   TMR1L          ;
00A2 038E       00287             DECF    TMR1L, F       ;
00A3 1803       00288             BTFSC   STATUS, C      ;
00A4 038F       00289             DECF    TMR1H, F       ;
00A5 3008       00290             MOVLW   0x08           ; On match CCP1 = H level
00A6 0097       00291             MOVWF   CCP1CON        ;
00A7 3009       00292             MOVLW   0x09           ;
00A8 00B1       00293             MOVWF   DATA_CNT       ; 8-bits to transfer
00A9 01B2       00294             CLRF    ONES_CNT       ; Result after xmit holds the number
00AA 30FF       00295             MOVLW   0xFF           ; of 1's in a byte
00AB 00B3       00296             MOVWF   CCP1_INT_CNT   ; No CCP1 transmit interrups yet
00AC 1410       00297             BSF     T1CON, TMR1ON  ; Turn ON timer1
                00298 ;
                00299 ;
                00300 ; This code segment is an infinite loop that will always transmit the data
                00301 ; contained in the XMIT_DATA register. After each byte is transmitted a
                00302 ; new byte is read. If using PICMASTER (in stand alone mode), this is
                00303 ; read from a register that is updated after a break (at NOP). If in a
                00304 ; system, PORTB is read. All other variables are reinitalized after each
                00305 ; byte.
00AD            00306 NEXT_BYTE
                00307 ;
00AD 0831       00308 WAIT        MOVF    DATA_CNT, w    ;
00AE 1D03       00309             BTFSS   STATUS, Z      ; Is DATA_CNT = 0 ?
00AF 28AD       00310             GOTO    WAIT           ; NO, must wait until YES
00B0 0000       00311             NOP                    ;
                00312         if ( Debug )
00B1 1005       00313             bcf     PORTA, 0       ; Turn off strobe
```

```
                00314         endif                     ;
                00315
                00316         if ( PICMaster )
00B2 0840       00317             MOVF    DUMMY_PB, W    ;
                00318         else
                00319             MOVF    PORTB, W       ;
                00320         endif
00B3 00B0       00321             MOVWF   XMIT_DATA      ; New data to transmit
00B4 30FF       00322             MOVLW   0xFF           ;
00B5 00B3       00323             MOVWF   CCP1_INT_CNT   ;
00B6 3009       00324             MOVLW   0x09           ;
00B7 00B1       00325             MOVWF   DATA_CNT       ;
00B8 01B2       00326             CLRF    ONES_CNT       ;
00B9 28AD       00327             GOTO    NEXT_BYTE      ;
                00328 ;
                00329 ;
                00330 ; Here is where you do things depending on the type of RESET (Not a
                00331 ; Power-On Reset).
00BA 1E03       00332 OTHER_RESET   BTFSS  STATUS,NOT_TO ; WDT Time-out?
00BB 2808       00333 WDT_TIMEOUT   GOTO   ERROR1        ; YES, This is error condition
                00334         if ( Debug_PU )
00BC 287C       00335             goto   START           ; MCLR reset, Goto START
                00336         else
                00337             GOTO   MCLR_RESET      ; MCLR reset, Goto MCLR_RESET
                00338         endif
                00339 ;
                00340         if (Debug )
00BD 0000       00341 END_START     NOP                  ; END label for debug
                00342         endif
                00343 ;
                00344 ;
07FF            00345     org     PMEM_END               ; End of Program Memory
07FF 2808       00346             GOTO    ERROR1         ; If you get here your program was lost
                00347
                00348     end
0000 : XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX
0040 : XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX
0080 : XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXX--
07C0 : ---------------- ---------------- ---------------- ---------------X

All other memory blocks unused.

Program Memory Words Used:   191
Program Memory Words Free:  3905
Errors   :     0
Warnings :     0 reported,     0 suppressed
Messages :     0 reported,    10 suppressed
```

Please check the Microchip BBS for the latest version of the source code. Microchip's Worldwide Web Address: www.microchip.com; Bulletin Board Support: MCHIPBBS using CompuServe® (CompuServe membership not required).

APPENDIX D:

```
    nolist
;*************************************************************************
;
;  This is the custom Header File for the real time clock application note
;   PROGRAM:CLOCK.H
;   Revision:7-13-94
;
;*************************************************************************
; This is used for the ASSEMBLER to recalculate certain frequency
; dependant variables. The value of Dev_Freq must be changed to
; reflect the frequency that the device actually operates at.
;
Dev_Freq    EQU D'10000000'; Device Frequency is 10 MHz
PULSE_TIME  EQU (( Dev_Freq / D'4000' ) * D'188' / D'10000' )
T_ZERO_BIT  EQU (( Dev_Freq / D'4000' ) * D'188' / D'10000' )
T_ONE_BIT   EQU (( Dev_Freq / D'4000' ) * D'376' / D'10000' )
;
ZERO_1S     EQU ((( Dev_Freq / D'4000' ) * (D'6000' - (D'16' * D'188'))) / D'10000' )
ONE_1S      EQU ( ( Dev_Freq / D'4000' ) * (D'6000' - (3 * D'188' + D'14' * D'188')) / D'10000')
TWO_1S      EQU ( ( Dev_Freq / D'4000' ) * (D'6000' - (6 * D'188' + D'12' * D'188')) / D'10000')
THREE_1S    EQU ( ( Dev_Freq / D'4000' ) * (D'6000' - (D'9' * D'188' + D'10' * D'188')) / D'10000')
FOUR_1S     EQU ( ( Dev_Freq / D'4000' ) * (D'6000' - (D'12' * D'188' + 8 * D'188')) / D'10000')
FIVE_1S     EQU ( ( Dev_Freq / D'4000' ) * (D'6000' - (D'15' * D'188' + 6 * D'188')) / D'10000')
SIX_1S      EQU ( ( Dev_Freq / D'4000' ) * (D'6000' - (D'18' * D'188' + 4 * D'188')) / D'10000')
SEVEN_1S    EQU ( ( Dev_Freq / D'4000' ) * (D'6000' - (D'21' * D'188' + 2 * D'188')) / D'10000')
EIGHT_1S    EQU ( ( Dev_Freq / D'4000' ) * (D'6000' - (D'24' * D'188') ) / D'10000' )


DB_HI_BYTE  EQU (HIGH ((( Dev_Freq / 4 ) * 1 / D'1000' ) / 3 ) ) + 1
LCD_INIT_DELAY EQU (HIGH ((( Dev_Freq / 4 ) * D'46' / D'10000' ) / 3 ) ) + 1
INNER_CNTR  EQU  40               ; RAM Location
OUTER_CNTR  EQU  41               ; RAM Location
;
T1OSO       EQU  0                ; The RC0 / T1OSO / T1CKI
;
RESET_V     EQU  0x0000           ; Address of RESET Vector
ISR_V       EQU  0x0004           ; Address of Interrupt Vector
PMEM_END    EQU  0x07FF           ; Last address in Program Memory
TABLE_ADDR  EQU  0x0400           ; Address where to start Tables
;
COUNTER         EQU     0x021     ;
;
XMIT_DATA       EQU     0x30
DATA_CNT        EQU     0x31
ONES_CNT        EQU     0x32
CCP1_INT_CNT    EQU     0x33
DUMMY_PB        EQU     0x40
CCPREG_HI       EQU     0x41
CCPREG_LO       EQU     0x42

;
     list
```

Please check the Microchip BBS for the latest version of the source code. Microchip's Worldwide Web Address: www.microchip.com; Bulletin Board Support: MCHIPBBS using CompuServe® (CompuServe membership not required).

APPENDIX E:

```
MPASM 01.40 Released           CAPT_2.ASM   1-16-1997  17:34:47         PAGE  1


LOC  OBJECT CODE     LINE SOURCE TEXT
  VALUE

                     00001         LIST    P = 16C74, n = 66
                     00002         ERRORLEVEL  -302
                     00003 ;
                     00004 ;***********************************************************************
                     00005 ;
                     00006 ; This program implements a real time clock using the TMR1 module of the
                     00007 ; PIC16CXXX family.
                     00008 ;
                     00009 ;       Program = CAPT_2.ASM
                     00010 ;       Revision Date:   7-19-94
                     00011 ;                        1-16-97      Compatibility with MPASMWIN 1.40
                     00012 ;
                     00013 ;
                     00014 ;***********************************************************************
                     00015 ;
                     00016 ;
                     00017 ; HARDWARE SETUP
                     00018 ;
                     00019 ;           CCP2 Compare Output
                     00020 ;           CCP1 Capture Input
                     00021 ;           CCP2  --->  CCP1
                     00022 ;
                     00023 ;
                     00024             INCLUDE <p16c74.inc>
                     00001         LIST
                     00002 ; P16C74.INC Standard Header File, Ver. 1.00 Microchip Technology, Inc.
                     00318         LIST
                     00025
  00000000           00026 FALSE           EQU     0
  00000001           00027 TRUE            EQU     1
                     00028
                     00029             INCLUDE <CAPT.h>
                     00052         list
                     00030 ;
                     00031 ;
  00000001           00032 PICMaster       EQU     TRUE         ; A Debugging Flag
  00000001           00033 Debug           EQU     TRUE         ; A Debugging Flag
  00000001           00034 Debug_PU        EQU     TRUE         ; A Debugging Flag
                     00035 ;
                     00036 ;
                     00037 ; Reset address. Determine type of RESET
                     00038 ;
0000                 00039         org     RESET_V                 ; RESET vector location
0000 1683            00040 RESET       BSF     STATUS, RP0         ; Bank 1
0001 188E            00041             BTFSC   PCON,NOT_POR        ; Power-up reset?
0002 282F            00042             GOTO    START               ; YES
0003 2861            00043             GOTO    OTHER_RESET         ; NO, a WDT or MCLR reset
                     00044 ;
                     00045 ; This is the Periperal Interrupt routine. Need to determine the type
                     00046 ; of interrupt that occurred. The following interrupts are enabled:
                     00047 ;   1.  CCP1 Capture Occurred
                     00048 ;   2.  CCP2 Compare Occurred
                     00049 ;
                     00050     page
```



```
0004            00051         org     ISR_V              ; Interrupt vector location
0004            00052 PER_INT_V
0004 1283       00053             BCF     STATUS, RP0    ; Bank 0
0005 190C       00054             BTFSC   PIR1, CCP1IF   ; CCP1 Interrupt occurred? (Capture)
0006 281D       00055             GOTO    CAPTURE        ; YES, Service the CCP1 Interrupt
0007 180D       00056             BTFSC   PIR2, CCP2IF   ; CCP2 Interrupt occurred? (Compare)
0008 2811       00057             GOTO    COMPARE        ; YES, Service the CCP2 Interrupt
0009 180C       00058             BTFSC   PIR1, TMR1IF   ; NO, Timer 1 Overflow?
000A 282D       00059             GOTO    T1OVFL         ; YES,
000B            00060 ERROR1                             ; NO, Error Condition-Unknown Interrupt
000B 1488       00061             BSF     PORTD, 1       ; Toggle a PORT pin
000C 1088       00062             BCF     PORTD, 1
000D 280B       00063             GOTO    ERROR1
                00064 ;
000E            00065 ERROR2                             ; NO, Error Condition-Unknown Interrupt
000E 1508       00066             BSF     PORTD, 2       ; Toggle a PORT pin
000F 1108       00067             BCF     PORTD, 2
0010 280E       00068             GOTO    ERROR2
                00069 ;
                00070 ; The Compare generates a Square wave based on the value on PORTB (in
                00071 ; DUMMY_PB) and on PORTD (in DUMMY_PD). PORTB is loaded into low compare
                00072 ; latch and PORTD is loaded into the high compare latch. If the value of
                00073 ; the ports is not changed, a capture overflow condition will occur when
                00074 ; PORTD:PORTB > 7Fh. This overflow is only indicated by the time between
                00075 ; captures being much less then expected.
0011            00076 COMPARE
0011 100D       00077             BCF     PIR2, CCP2IF     ; Clear CCP2 Interrupt Flag
                00078         if ( PICMaster )
0012 0851       00079             MOVF    DUMMY_PB, W      ;
                00080         else
                00081             MOVF    PORTB, W         ;
                00082         endif
0013 079B       00083             ADDWF   CCPR2L, F        ; Update Compare register pair latch
0014 1803       00084             BTFSC   STATUS, C        ;
0015 0A9C       00085             INCF    CCPR2H, F        ;
                00086         if ( PICMaster )
0016 0853       00087             MOVF    DUMMY_PD, W      ;
                00088         else
                00089             MOVF    PORTD, W         ;
                00090         endif
0017 079C       00091             ADDWF   CCPR2H, F        ;
0018 0AB3       00092             INCF    CCP2_INT_CNT, F  ;
0019 141D       00093             BSF     CCP2CON, 0       ; On Compare match, CCP2 pin = L
001A 1C33       00094             BTFSS   CCP2_INT_CNT, 0  ;
001B 101D       00095             BCF     CCP2CON, 0       ; On Compare match, CCP2 pin = H
001C            00096 END_COMPARE
001C 0009       00097             RETFIE                   ; Return / Enable Global Interrupts
                00098
                00099 ;
                00100 ; The result of the new capture minus the old capture is stored in the
                00101 ; new capture registers (CAPT_NEW_H:CAPT_NEW_L)
                00102 ;
001D            00103 CAPTURE
001D 110C       00104       BCF     PIR1, CCP1IF     ; Clear CCP1 Interrupt Flag
001E 0815       00105       MOVF    CCPR1L, W        ; New capture value (low byte)
001F 00C1       00106       MOVWF   CAPT_NEW_L       ;
0020 0816       00107       MOVF    CCPR1H, W        ; New capture value (high byte)
0021 00C0       00108       MOVWF   CAPT_NEW_H       ;
                00109 ;
0022 0843       00110       MOVF    CAPT_OLD_L, W    ;
0023 02C1       00111       SUBWF   CAPT_NEW_L, F    ; Subtract the low bytes of the 2 captures
0024 1C03       00112       BTFSS   STATUS, C        ; Did a borrow occur?
0025 03C0       00113       DECF    CAPT_NEW_H, F    ; YES, Decrement old capture (high byte)
0026 0842       00114       MOVF    CAPT_OLD_H, W    ; New capture value (low byte)
0027 02C0       00115       SUBWF   CAPT_NEW_H, F    ; Subtract the low bytes of the 2 captures
0028 0815       00116 LOAD_OLD    MOVF    CCPR1L, W  ; New capture value (low byte)
```

```
0029 00C3       00117       MOVWF   CAPT_OLD_L      ;
002A 0816       00118       MOVF    CCPR1H, W       ; New capture value (high byte)
002B 00C2       00119       MOVWF   CAPT_OLD_H      ;
002C            00120 END_CAPTURE
002C 0009       00121       RETFIE
                00122 ;
                00123 ;
002D            00124 T1OVFL
002D 100C       00125       BCF     PIR1, TMR1IF    ; Clear T1 Overflow Interrupt Flag
002E 0009       00126       RETFIE                  ; Return / Enable Global Interrupts
                00127 ;
                00128 ;
                00129 ;*******************************************************************
                00130 ;*****      Start program here, Power-On Reset occurred.
                00131 ;*******************************************************************
                00132 ;
002F            00133 START                         ; POWER_ON Reset (Beginning of program)
002F 1283       00134       BCF     STATUS, RP0     ; Bank 0
0030 018F       00135       CLRF    TMR1H           ;
0031 018E       00136       CLRF    TMR1L           ;
                00137 ;
0032            00138 MCLR_RESET                    ; A Master Clear Reset
0032 1283       00139       BCF     STATUS, RP0     ; Bank 0
0033 0183       00140       CLRF    STATUS          ; Do initialization (Bank 0)
0034 018B       00141       CLRF    INTCON
0035 018C       00142       CLRF    PIR1
0036 1683       00143       BSF     STATUS, RP0     ; Bank 1
0037 3000       00144       MOVLW   0x00            ; The LCD module does not like to work w/
0038 0081       00145       MOVWF   OPTION_REG      ;   weak pull-ups
0039 018C       00146       CLRF    PIE1            ; Disable all peripheral interrupts
003A 018D       00147       CLRF    PIE2            ; Disable all peripheral interrupts
003B 30FF       00148       MOVLW   0xFF            ;
003C 009F       00149       MOVWF   ADCON1          ; Port A is Digital.
                00150 ;
                00151 ;
003D 1283       00152       BCF     STATUS, RP0     ; Bank 0
003E 0185       00153       CLRF    PORTA           ; ALL PORT output should output Low.
003F 0186       00154       CLRF    PORTB
0040 0187       00155       CLRF    PORTC
0041 0188       00156       CLRF    PORTD
0042 0189       00157       CLRF    PORTE
0043 1010       00158       BCF     T1CON, TMR1ON   ; Timer 1 is NOT incrementing
                00159 ;
0044 1683       00160       BSF     STATUS, RP0     ; Select Bank 1
0045 0185       00161       CLRF    TRISA           ; RA5 -  0 outputs
0046 30FF       00162       MOVLW   0xFF            ;
0047 0086       00163       MOVWF   TRISB           ; RB7 - 0 inputs
0048 0187       00164       CLRF    TRISC           ; RC Port are outputs
0049 1507       00165       BSF     TRISC, 2        ; CCP1 is an INPUT
004A 0088       00166       MOVWF   TRISD           ; RD Port are inputs
004B 0189       00167       CLRF    TRISE           ; RE Port are outputs
004C 150C       00168       BSF     PIE1, CCP1IE    ; Enable CCP1 Interrupt
004D 140D       00169       BSF     PIE2, CCP2IE    ; Enable CCP2 Interrupt
004E 1283       00170       BCF     STATUS, RP0     ; Select Bank 0
                00171 ;
                00172 ;
                00173 ; Initialize the Special Function Registers (SFR) interrupts
                00174 ;
004F 018C       00175       CLRF    PIR1            ;
0050 018D       00176       CLRF    PIR2            ;
0051 0190       00177       CLRF    T1CON           ; Timer mode
0052 170B       00178       BSF     INTCON, PEIE    ; Enable Peripheral Interrupts
0053 178B       00179       BSF     INTCON, GIE     ; Enable all Interrupts
                00180 ;
                00181 ; Set-up timer and compare latches and then turn timer1 on.
                00182 ;
```

```
0054 1010       00183       BCF     T1CON, TMR1ON     ; Turn OFF timer1
                00184   if ( PICMaster )
0055 0851       00185       MOVF    DUMMY_PB, W       ;
                00186   else
                00187       MOVF    PORTB, W          ;
                00188   endif
0056 079B       00189      ADDWF   CCPR2L, F          ; Update Compare register pair latch
0057 1803       00190      BTFSC   STATUS, C          ;
0058 0A9C       00191      INCF    CCPR2H, F          ;
                00192   if ( PICMaster )
0059 08D3       00193      MOVF    DUMMY_PD, F        ;
                00194   else
                00195      MOVF    PORTD, W           ;
                00196   endif
005A 079C       00197      ADDWF   CCPR2H, F          ;
005B 3008       00198      MOVLW   0x08               ; On match CCP2 = H level
005C 009D       00199      MOVWF   CCP2CON            ;
005D 3005       00200      MOVLW   0x05               ; Capture on every rising edge
005E 0097       00201      MOVWF   CCP1CON            ;
005F 1410       00202      BSF     T1CON, TMR1ON      ; Turn ON timer1
                00203 ;
                00204 ;
                00205 ;
0060 2860       00206 lzz  goto    lzz                ; Loop waiting for interrupts (for use
                00207                                 ;   with PICMASTER)
                00208 ;
                00209 ; Here is where you do things depending on the type of RESET (Not a
                00210 ; Power-On Reset).
0061 1E03       00211 OTHER_RESET   BTFSS  STATUS,NOT_TO ; WDT Time-out?
0062 280B       00212 WDT_TIMEOUT   GOTO   ERROR1        ; YES, This is error condition
                00213   if ( Debug_PU )
0063 282F       00214       goto   START               ; MCLR reset, Goto START
                00215   else
                00216       GOTO   MCLR_RESET          ; MCLR reset, Goto MCLR_RESET
                00217   endif
                00218 ;
                00219   if (Debug )
0064 0000       00220 END_START     NOP                ; END lable for debug
                00221    endif
                00222 ;
                00223 ;
07FF            00224     org     PMEM_END             ; End of Program Memory
07FF 280B       00225             GOTO    ERROR1       ; If you get here your program was lost
                00226
                00227     end
0000 : XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX
0040 : XXXXXXXXXXXXXXXX XXXXXXXXXXXXXXXX XXXXX----------- ----------------
07C0 : ---------------- ---------------- ---------------- ---------------X

All other memory blocks unused.

Program Memory Words Used:   102
Program Memory Words Free:  3994
Errors   :     0
Warnings :     0 reported,     0 suppressed
Messages :     0 reported,    13 suppressed
```

Please check the Microchip BBS for the latest version of the source code. Microchip's Worldwide Web Address: www.microchip.com; Bulletin Board Support: MCHIPBBS using CompuServe® (CompuServe membership not required).

APPENDIX F:

```
    nolist
;*************************************************************************
;
;  This is the custom Header File for the real time clock application note
;   PROGRAM:CLOCK.H
;   Revision:7-19-94
;
;*************************************************************************
; This is used for the ASSEMBLER to recalculate certain frequency
; dependant variables. The value of Dev_Freq must be changed to
; reflect the frequency that the device actually operates at.
;
Dev_Freq        EQU      D'4000000'; Device Frequency is 4 MHz
DB_HI_BYTE      EQU     (HIGH ((( Dev_Freq / 4 ) * 1 / D'1000' ) / 3 ) ) + 1
LCD_INIT_DELAY  EQU     (HIGH ((( Dev_Freq / 4 ) * D'46' / D'10000' ) / 3 ) ) + 1
INNER_CNTR      EQU     40              ; RAM Location
OUTER_CNTR      EQU     41              ; RAM Location
;
T1OSO           EQU     0               ; The RC0 / T1OSO / T1CKI
;
RESET_V         EQU     0x0000          ; Address of RESET Vector
ISR_V           EQU     0x0004          ; Address of Interrupt Vector
PMEM_END        EQU     0x07FF          ; Last address in Program Memory
TABLE_ADDR      EQU     0x0400          ; Address where to start Tables
;
COUNTER         EQU     0x021           ;
CCP2_INT_CNT    EQU     0x33
;
;
; DUMMY_PD:DUMMY_PB contain the value to be loaded into the CCP2 compare registers
; (CCPR2H:CCPR2L)
;
DUMMY_PA        EQU     0x50
DUMMY_PB        EQU     0x51
DUMMY_PC        EQU     0x52
DUMMY_PD        EQU     0x53
DUMMY_PE        EQU     0x54
;
;
; CAPT_NEW_H:CAPT_NEW_L stores the NEW captured value and the result of the
; subtraction between this capture and the previous.
;    CAPT_NEW_H:CAPT_NEW_L  =  CAPT_NEW_H:CAPT_NEW_L - CAPT_OLD_H:CAPT_OLD_L
;
; After all computations the new capture value is moved to the CAPT_OLD_H:CAPT_OLD_L
; in preperation for the next capture value.
;
CAPT_NEW_H      EQU     0x040           ;
CAPT_NEW_L      EQU     0x041           ;
CAPT_OLD_H      EQU     0x042           ;
CAPT_OLD_L      EQU     0x043           ;
;
    list
```

Note the following details of the code protection feature on PICmicro® MCUs.

- The PICmicro family meets the specifications contained in the Microchip Data Sheet.
- Microchip believes that its family of PICmicro microcontrollers is one of the most secure products of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the PICmicro microcontroller in a manner outside the operating specifications contained in the data sheet. The person doing so may be engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable”.
- Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our product.

If you have any further questions about this matter, please contact the local sales office nearest to you.

DNV Certification, Inc. USA — ANSI-RAB QMS ACCREDITED — DNV MSC The Netherlands Accredited by the RvA — DNV — ISO 9001 / QS-9000 REGISTERED FIRM

Microchip received QS-9000 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona in July 1999. The Company’s quality system processes and procedures are QS-9000 compliant for its PICmicro® 8-bit MCUs, KEELOQ® code hopping devices, Serial EEPROMs and microperipheral products. In addition, Microchip’s quality system for the design and manufacture of development systems is ISO 9001 certified.

WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200 Fax: 480-792-7277
Technical Support: 480-792-7627
Web Address: http://www.microchip.com

Rocky Mountain
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7966 Fax: 480-792-7456

Atlanta
500 Sugar Mill Road, Suite 200B
Atlanta, GA 30350
Tel: 770-640-0034 Fax: 770-640-0307

Boston
2 Lan Drive, Suite 120
Westford, MA 01886
Tel: 978-692-3848 Fax: 978-692-3821

Chicago
333 Pierce Road, Suite 180
Itasca, IL 60143
Tel: 630-285-0071 Fax: 630-285-0075

Dallas
4570 Westgrove Drive, Suite 160
Addison, TX 75001
Tel: 972-818-7423 Fax: 972-818-2924

Detroit
Tri-Atria Office Building
32255 Northwestern Highway, Suite 190
Farmington Hills, MI 48334
Tel: 248-538-2250 Fax: 248-538-2260

Kokomo
2767 S. Albright Road
Kokomo, Indiana 46902
Tel: 765-864-8360 Fax: 765-864-8387

Los Angeles
18201 Von Karman, Suite 1090
Irvine, CA 92612
Tel: 949-263-1888 Fax: 949-263-1338

New York
150 Motor Parkway, Suite 202
Hauppauge, NY 11788
Tel: 631-273-5305 Fax: 631-273-5335

San Jose
Microchip Technology Inc.
2107 North First Street, Suite 590
San Jose, CA 95131
Tel: 408-436-7950 Fax: 408-436-7955

Toronto
6285 Northam Drive, Suite 108
Mississauga, Ontario L4V 1X5, Canada
Tel: 905-673-0699 Fax: 905-673-6509

ASIA/PACIFIC

Australia
Microchip Technology Australia Pty Ltd
Suite 22, 41 Rawson Street
Epping 2121, NSW
Australia
Tel: 61-2-9868-6733 Fax: 61-2-9868-6755

China - Beijing
Microchip Technology Consulting (Shanghai) Co., Ltd., Beijing Liaison Office
Unit 915
Bei Hai Wan Tai Bldg.
No. 6 Chaoyangmen Beidajie
Beijing, 100027, No. China
Tel: 86-10-85282100 Fax: 86-10-85282104

China - Chengdu
Microchip Technology Consulting (Shanghai) Co., Ltd., Chengdu Liaison Office
Rm. 2401, 24th Floor,
Ming Xing Financial Tower
No. 88 TIDU Street
Chengdu 610016, China
Tel: 86-28-6766200 Fax: 86-28-6766599

China - Fuzhou
Microchip Technology Consulting (Shanghai) Co., Ltd., Fuzhou Liaison Office
Unit 28F, World Trade Plaza
No. 71 Wusi Road
Fuzhou 350001, China
Tel: 86-591-7503506 Fax: 86-591-7503521

China - Shanghai
Microchip Technology Consulting (Shanghai) Co., Ltd.
Room 701, Bldg. B
Far East International Plaza
No. 317 Xian Xia Road
Shanghai, 200051
Tel: 86-21-6275-5700 Fax: 86-21-6275-5060

China - Shenzhen
Microchip Technology Consulting (Shanghai) Co., Ltd., Shenzhen Liaison Office
Rm. 1315, 13/F, Shenzhen Kerry Centre,
Renminnan Lu
Shenzhen 518001, China
Tel: 86-755-2350361 Fax: 86-755-2366086

Hong Kong
Microchip Technology Hongkong Ltd.
Unit 901-6, Tower 2, Metroplaza
223 Hing Fong Road
Kwai Fong, N.T., Hong Kong
Tel: 852-2401-1200 Fax: 852-2401-3431

India
Microchip Technology Inc.
India Liaison Office
Divyasree Chambers
1 Floor, Wing A (A3/A4)
No. 11, O'Shaugnessey Road
Bangalore, 560 025, India
Tel: 91-80-2290061 Fax: 91-80-2290062

Japan
Microchip Technology Japan K.K.
Benex S-1 6F
3-18-20, Shinyokohama
Kohoku-Ku, Yokohama-shi
Kanagawa, 222-0033, Japan
Tel: 81-45-471- 6166 Fax: 81-45-471-6122

Korea
Microchip Technology Korea
168-1, Youngbo Bldg. 3 Floor
Samsung-Dong, Kangnam-Ku
Seoul, Korea 135-882
Tel: 82-2-554-7200 Fax: 82-2-558-5934

Singapore
Microchip Technology Singapore Pte Ltd.
200 Middle Road
#07-02 Prime Centre
Singapore, 188980
Tel: 65-334-8870 Fax: 65-334-8850

Taiwan
Microchip Technology Taiwan
11F-3, No. 207
Tung Hua North Road
Taipei, 105, Taiwan
Tel: 886-2-2717-7175 Fax: 886-2-2545-0139

EUROPE

Denmark
Microchip Technology Nordic ApS
Regus Business Centre
Lautrup hoj 1-3
Ballerup DK-2750 Denmark
Tel: 45 4420 9895 Fax: 45 4420 9910

France
Microchip Technology SARL
Parc d'Activite du Moulin de Massy
43 Rue du Saule Trapu
Batiment A - ler Etage
91300 Massy, France
Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

Germany
Microchip Technology GmbH
Gustav-Heinemann Ring 125
D-81739 Munich, Germany
Tel: 49-89-627-144 0 Fax: 49-89-627-144-44

Italy
Microchip Technology SRL
Centro Direzionale Colleoni
Palazzo Taurus 1 V. Le Colleoni 1
20041 Agrate Brianza
Milan, Italy
Tel: 39-039-65791-1 Fax: 39-039-6899883

United Kingdom
Arizona Microchip Technology Ltd.
505 Eskdale Road
Winnersh Triangle
Wokingham
Berkshire, England RG41 5TU
Tel: 44 118 921 5869 Fax: 44-118 921-5820

01/18/02