


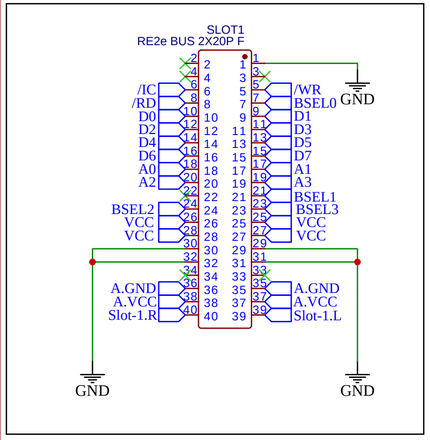


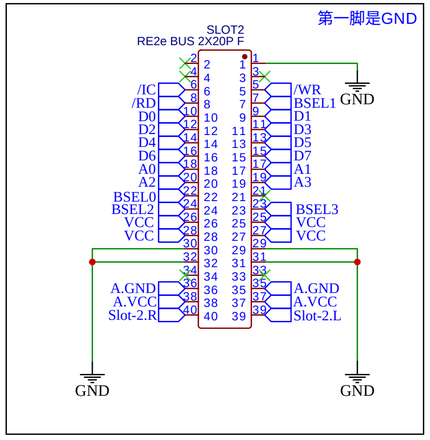

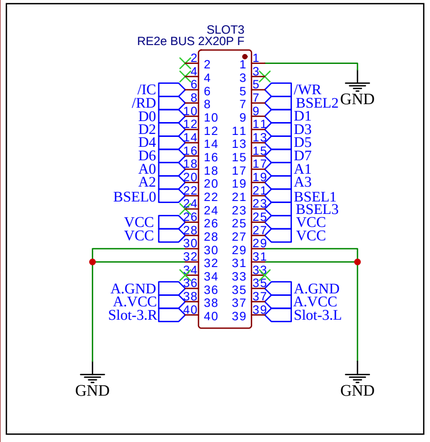

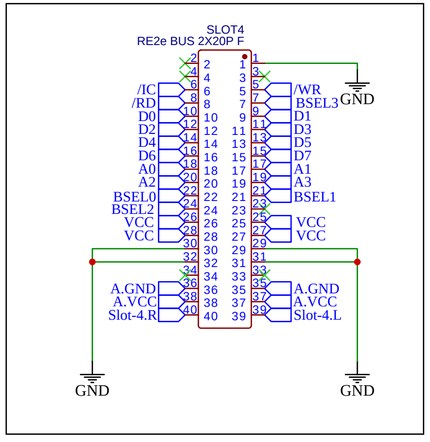

此处电阻需要调整

2024.8.25

1.每个卡板加B0-3
2.精简滤波电容
3.加饻12V
4.轨对轨贴片运放
5.删除SCK
6.电阻电容远离隔离柱
7.加9V输入

2024.8.27 发现饻12V不一定有必要

1.添加TPA6111
2.添加输入电压标识

2024.9.2


1.删除饻12V
2.删除电源输入

2024.9.15

1.删除耳机放大器。

2024.12.13

1.纠正bus线序错误



2021.1.14

1.删除整流桥，BNX，
2.精简滤波电容
3.删除Work-LED
4.删除SCK
5.耳机孔放在电位器左侧以避免干涉
6.添加IB0505S
7.添加自动切换主副电源的电路


2021.1.20


1.测试发现电源切换电路没屌用，删了
2.单USB供电一切正常，插DC发出高频噪音，考虑共地噪音
3.结合旧版本发现必须彻底隔离DC-GND和USB-GND
4.必须添加MCU开关，PIC没必要，仅IAP
5.必须添加电源切换开关二选一。
6.必须拆除所有IAP晶振，那会影响主时钟，否则请用24M
6.PIC考虑使用无源晶振
7.必须下对齐电位器
8.MCU换成LQFP48封装更便宜


2021.1.20


1.测试发现经常性无法启动，发现IAP必须在所有地联通的情况才能启动，短接IB0505S原边和副边的地
2.考虑改USB-CH340模块，让DC供电时整板使用DC电源
3.现阶段只能完美USB供电使用CMOS音源，必须短接IB0505S两个地。
4.或者两个地都不短接，则有概率无法启动
5.两种方案：一是让USB-CH340隔离地，下面不隔离
二是USB和MCU永远公用VCC和GND并且不用稳压，DC供电仅给卡槽使用
6.不隔离，IB0505S严重发烫


TITLE: Sheet_2		REV: 1.0
嘉立创EDA	Company: Your Company	Sheet: 1/1
	Date: 2023-12-10 Drawn By: Denjhang	

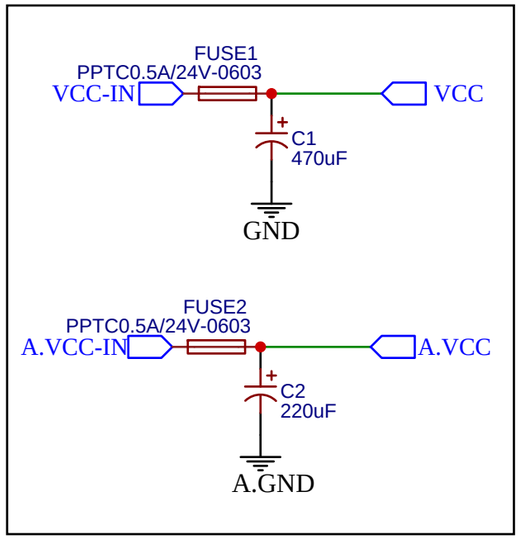

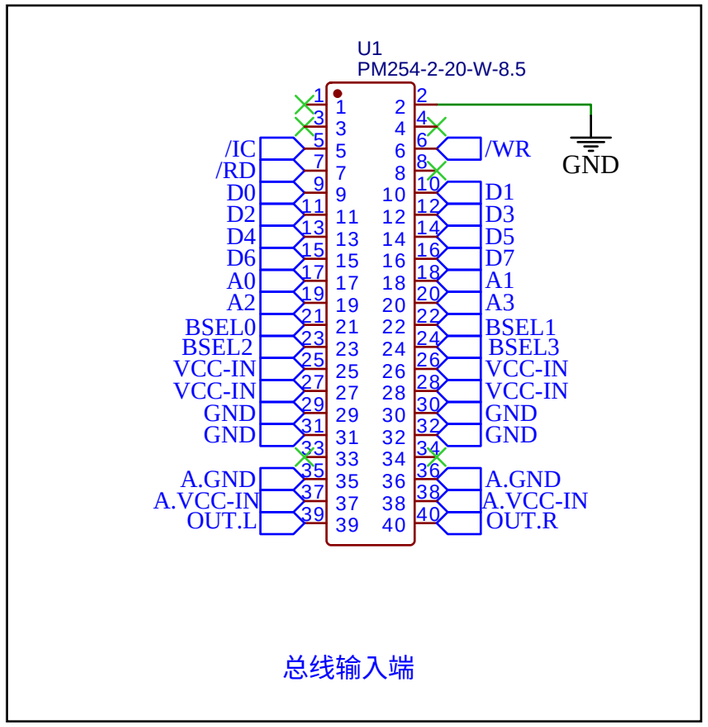


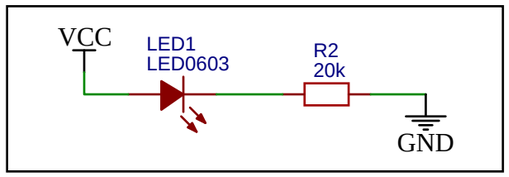


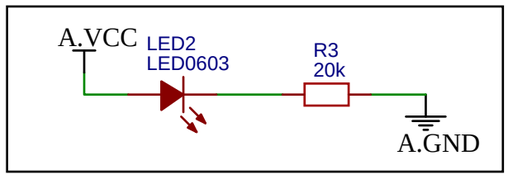


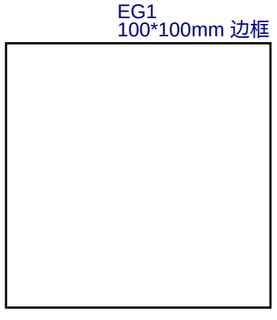



TITLE: Sheet_1		REV: 1.0
嘉立创EDA	Company: Your Company	Sheet: 1/1
	Date: 2023-12-10 Drawn By: Denjhang	

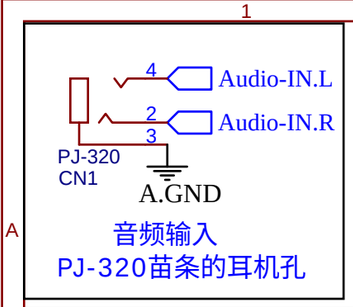


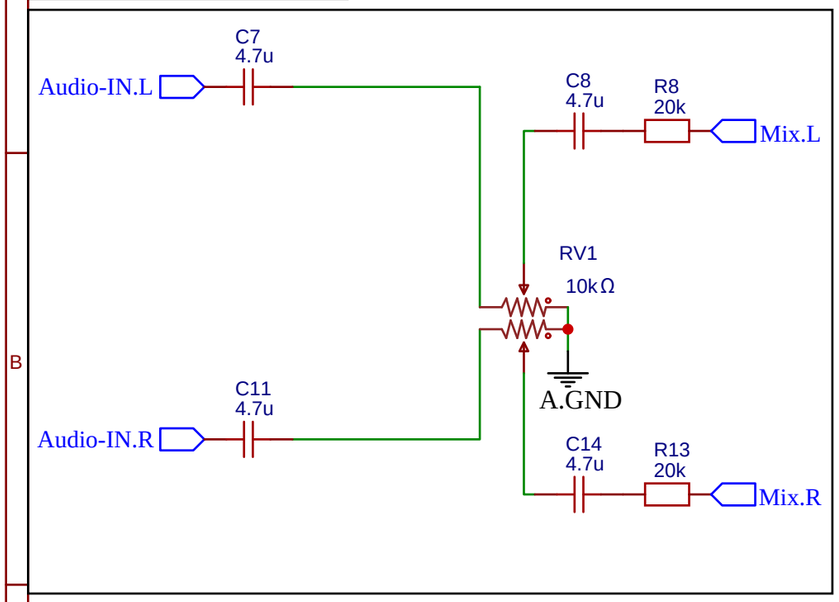


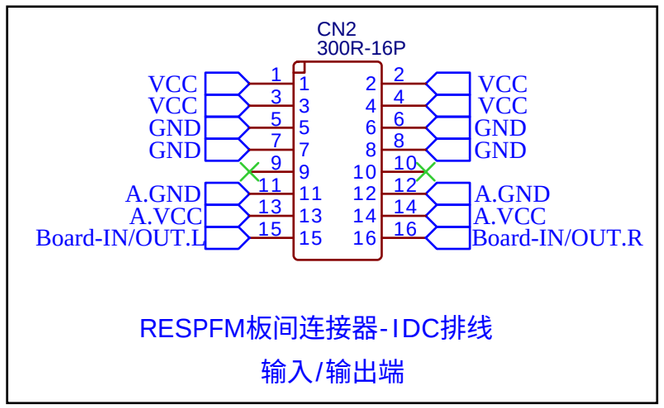


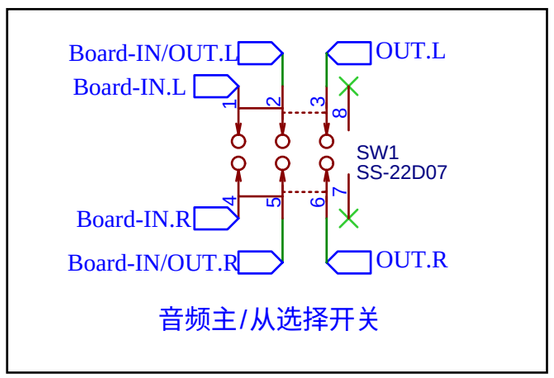































TITLE: Sheet_1		REV: 1.0
嘉立创EDA	Company: Your Company	Sheet: 1/1
	Date: 2023-12-10 Drawn By: Denjhang	

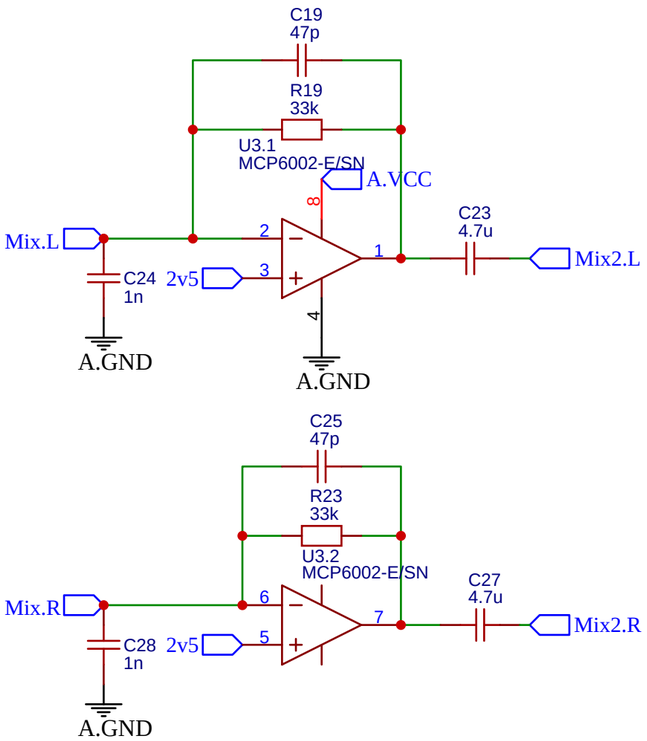

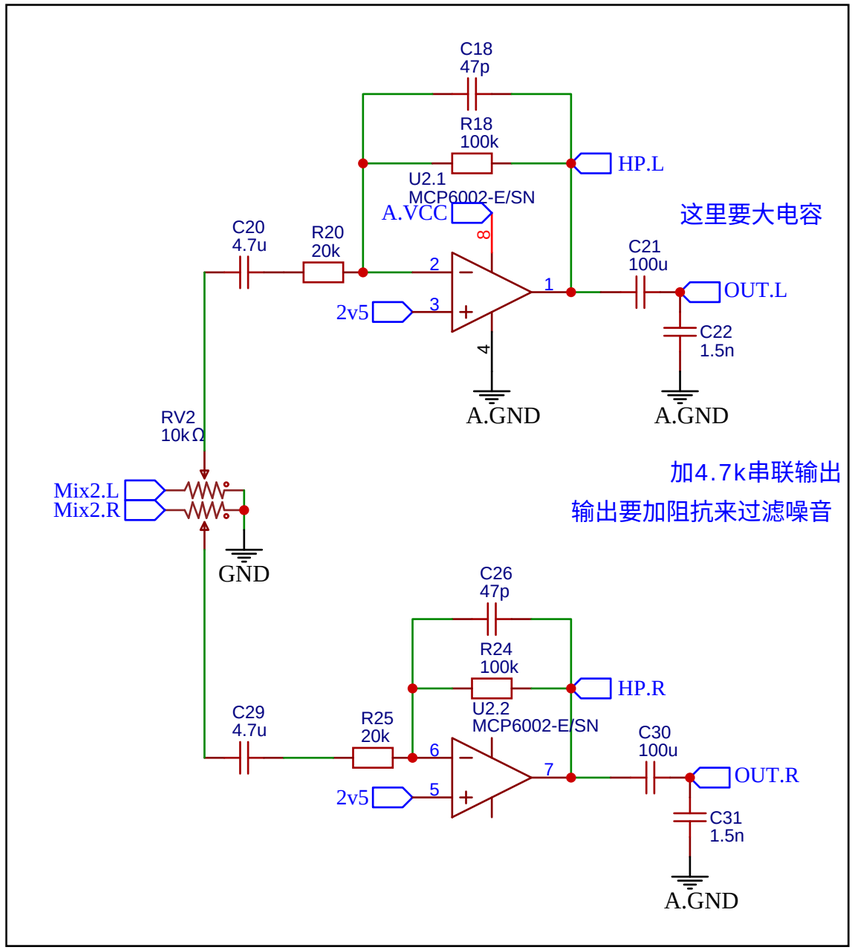


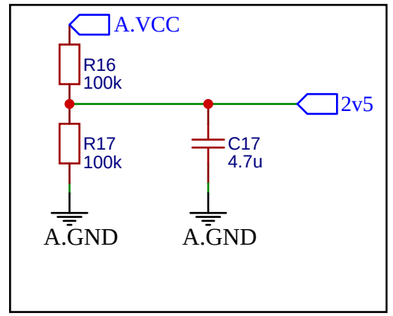


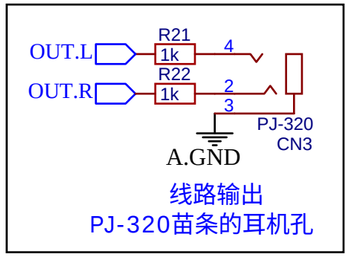

多余

TITLE: Sheet_1		REV: 1.0
嘉立创EDA	Company: Your Company	Sheet: 1/1
	Date: 2023-12-10 Drawn By: Denjhang	

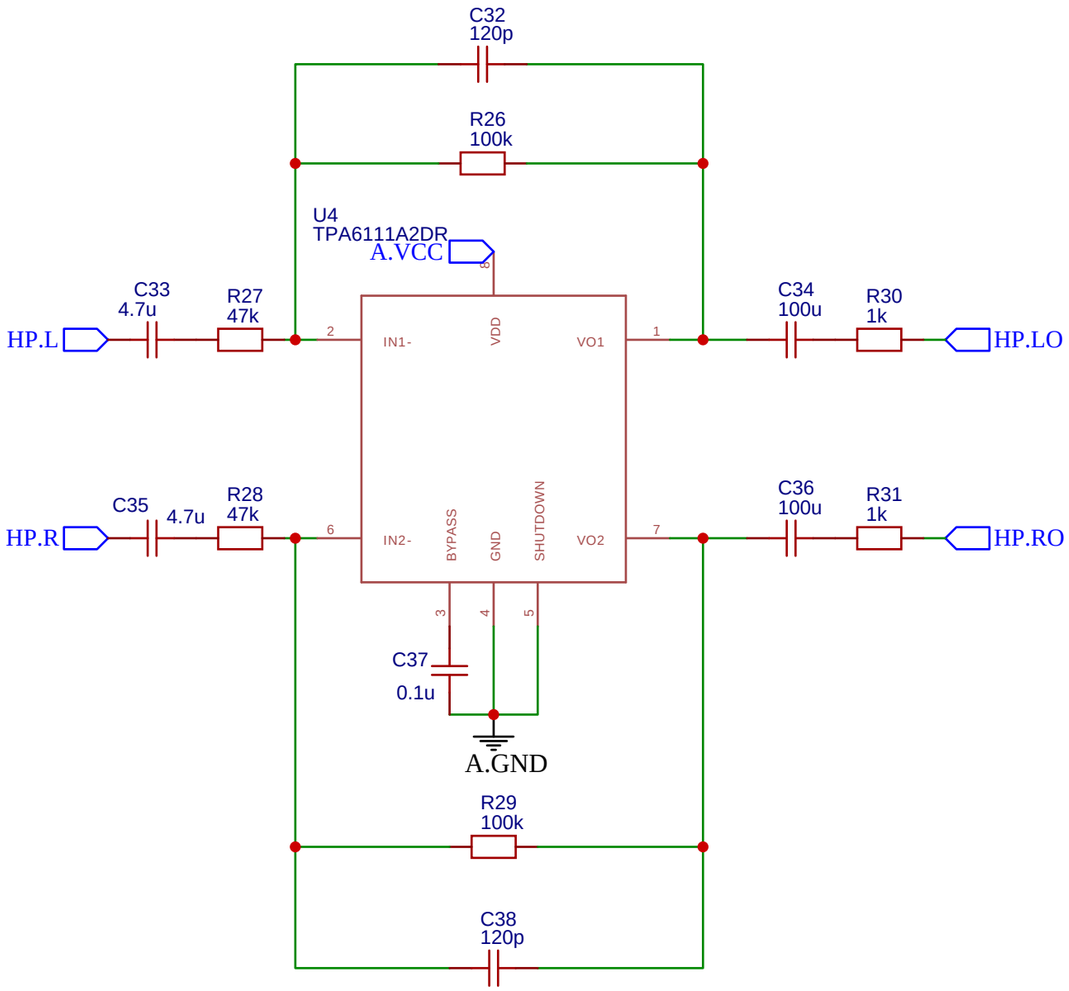

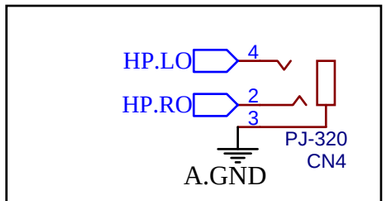

TITLE: Sheet_1		REV: 1.0
嘉立创EDA	Company: Your Company	Sheet: 1/1
	Date: 2025-10-21 Drawn By: Denjhang	