

## CS65K Robotics

Modelling, Planning and Control

Chapter 2: Kinematics

**Section 2.1 – 2.6** 

LECTURE 3: KINEMATICS DIAGRAM AND REPRESENTATION OF ORIENTATION DR. ERIC CHOU

IEEE SENIOR MEMBER



#### Cartesian Coordination

- •The rotation matrix is introduced as the fundamental tool to describe the orientation of a rigid body
- •The three equivalent geometrical meanings of a rotation matrix are explained
- •The rule for composition of elementary rotations is presented



# Kinematics

SECTION 1



#### Kinematics

- •The branch of mechanics concerned with the motion of objects without reference to the forces which cause the motion.
- •Relationship between the joint positions and the end-effector position and orientation

#### Intro to Kinematics

$$d = X_{F} - X_{O} v_{F} = v_{O} + at$$

$$X_{F} = X_{O} + V_{O}t + \frac{1}{2}at^{2}$$

$$d = vt V_{F}^{2} = v_{O}^{2} + 2ad$$



## Representations of orientation

- Rotation matrix
- Euler angles
- Four-parameter representations



## Direct kinematics

- Homogeneous transoformations
- Denavit-Hartenberg convention
- Kinematics of typical manipulator structures



## Inverse kinematics

- Solution of three-link planar arm
- Solution of anthropomorphic arm
- Solution of spherical wrist



# Degree of Freedom

SECTION 2

Soft body




Rigid body







## Terminology

- •Configuration: A specification of the position of all points of a robot
- •C-Space: The space of all configurations
- •DOF: The dimension of the C-Space. (Degree of Freedom)

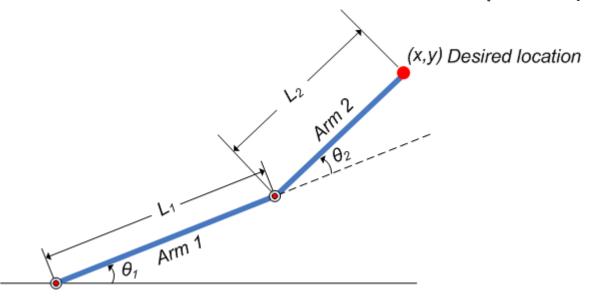

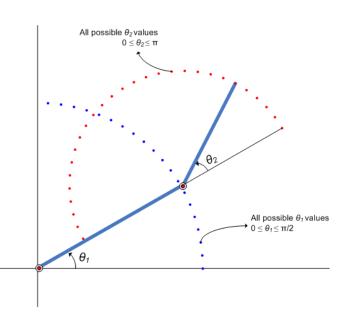


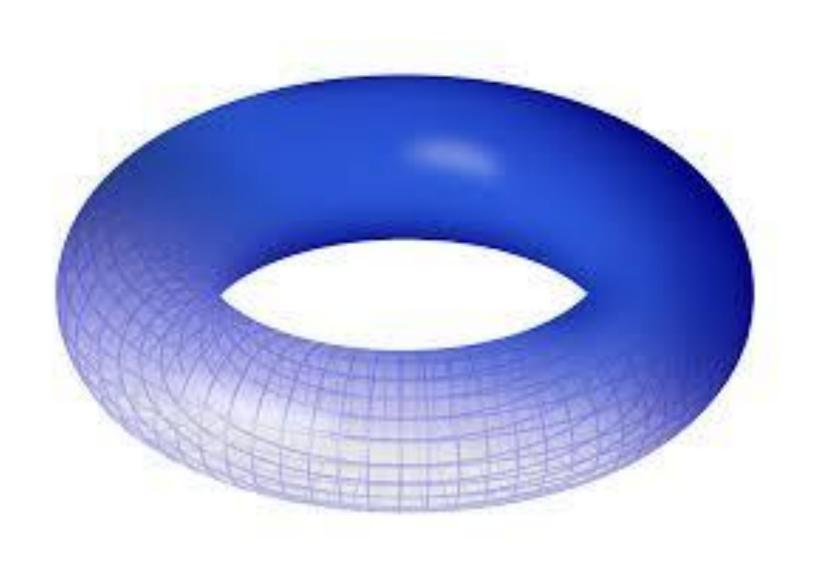



## Degree of Freedom

 $DOF = \sum (freedoms\ of\ points) + \#\ of\ independent\ constraints$ 

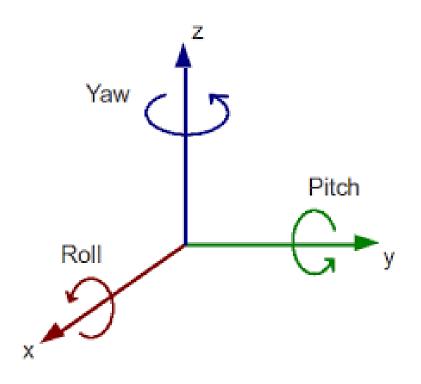

Axis: n

Angle:  $C_2^n$ 



•Prismatic — Allows translation along a single standard axis (x, y, or z). Joint blocks can contain up to three prismatic joint primitives, one for each translational DoF. Prismatic primitives are labelled P\*, where the asterisk denotes the axis of motion, e.g., Px, Py, or Pz.



•Revolute — Allows rotation about a single standard axis (x, y, or z). Joint blocks can contain up to three revolute joint primitives, one for each rotational DoF. Revolute primitives are labelled R\*, where the asterisk denotes the axis of motion, e.g., Rx, Ry, or Rz.



•Spherical — Allows rotation about any 3-D axis, [x, y, z]. Joint blocks contain no more than one spherical primitive, and never in combination with revolute primitives. Spherical primitives are labelled S.



- •Lead Screw Primitive Allows coupled rotation and translation on a standard axis (e.g., z). This primitive converts between rotation at one end and translation at the other. Joint blocks contain no more than one lead screw primitive. Lead screw primitives are labeled LS\*, where the asterisk denotes the axis of motion.
- •Constant Velocity Joint Allows rotation at constant velocity between intersecting though arbitrarily aligned shafts. Joint blocks contain no more than one constant velocity primitive. Constant velocity primitives are labelled CV.

Joint Block	Constraint I	Constraint   Entities   Constr		Entities II	Offsets	Notes
Cartesian Joint					$\theta_I=\theta_{II}=0^\circ$	
Cylindrical Joint	<b>-</b>	11			$d_I = 0$	
Planar Joint	<b>-</b>				$d_I = 0$	
Prismatic Joint	a a a a a a a a a a a a a a a a a a a	//	<b>.</b> ■		$d_I = d_{II} = 0$ $d_I = 0,  \theta_{II} = 90^{\circ}$ $d_I, d_{II} \ge 0$	2
Rectangular Joint	d" d"	::			$d_I, \theta_{II} \geq 0$ $d_I \geq 0, \theta_{II} = 0^{\circ}$	
Revolute Joint	<b>™</b>	00	<b>-</b>		$d_I = 0, d_{II} \ge 0$	3
Spherical Joint	<b>-</b>				$d_I = 0$	

Simscape™ Multibody™ software can successfully import an Autodesk Inventor®assembly model with any joint (all are supported) and the following constraints:

- Angle offset
- Mate/flush →
- •Insert [

Simscape Multibody software can successfully import CAD assemblies whose constraints join these constraint entities:

- Circle/arc
- Cone
- Cylinder
- •Line
- Plane
- Point

Joint Block	Joint Primitives					Joint DoFs		
6-DOF Joint	Px	Ру	Pz		Ry		S	3 T + 3 R
Cartesian Joint	Px	Ру	Pz		Ry			3 T + 0 R
Cylindrical Joint			Pz		Ry	Rz		$1\;T+1\;R$
Planar Joint	Px	Ру			Ry	Rz		2 T + 1 R
Prismatic Joint			Pz		Ry			1 T + 0 R
Rectangular Joint	Px	Ру			Ry			2 T + 0 R
Revolute Joint					Ry	Rz		0 T + 1 R
Spherical Joint					Ry		S	0 T + 3 R
Telescoping Joint			Pz		Ry		S	$1~\mathrm{T} + 3~\mathrm{R}$
Universal Joint				Rx	Ry			0 T + 2 R
Weld Joint					Ry			0 T + 0 R


# Pose of a Rigid Body

SECTION 3



## Position


$$oldsymbol{o}' = egin{bmatrix} o_x' \ o_y' \ o_z' \end{bmatrix}$$

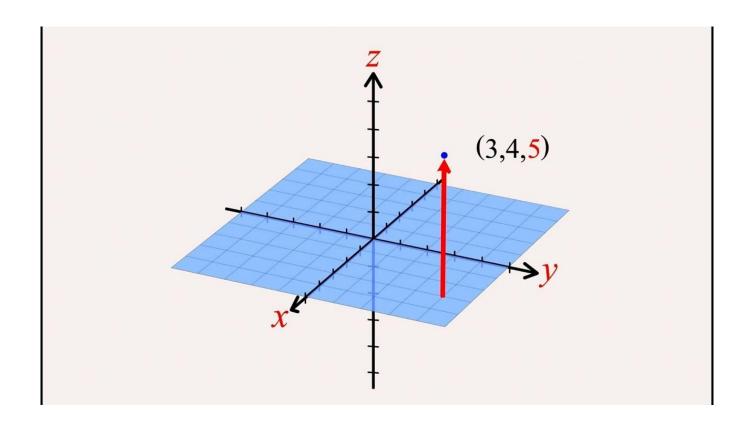



### Orientation

$$oldsymbol{x}' = x_x' oldsymbol{x} + x_y' oldsymbol{y} + x_z' oldsymbol{z} \qquad oldsymbol{y}' = y_x' oldsymbol{x} + y_y' oldsymbol{y} + y_z' oldsymbol{z} \qquad oldsymbol{z}' = z_x' oldsymbol{x} + z_y' oldsymbol{y} + z_z' oldsymbol{z}$$

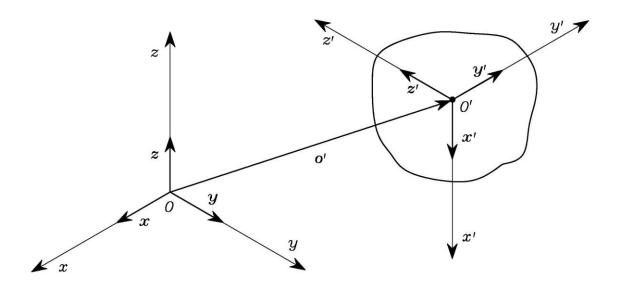

Position and orientation of a rigid body



#### Rotation


#### **Rotation matrix**


$$egin{aligned} oldsymbol{R} &= egin{bmatrix} oldsymbol{x}' & oldsymbol{y}' & oldsymbol{z}' \ oldsymbol{x}' & oldsymbol{y}' & oldsymbol{z}' \ oldsymbol{x}'^T oldsymbol{z} & oldsymbol{y}'^T oldsymbol{x} & oldsymbol{z}'^T oldsymbol{z} \ oldsymbol{x}'^T oldsymbol{z} & oldsymbol{y}'^T oldsymbol{z} & oldsymbol{z}'^T oldsymbol{y} \ oldsymbol{z}'^T oldsymbol{z} & oldsymbol{z}'^T oldsymbol{z} \ old$$




## Orthogonality Property

$$\boldsymbol{R}^T \boldsymbol{R} = \boldsymbol{I} \implies \boldsymbol{R}^T = \boldsymbol{R}^{-1}$$

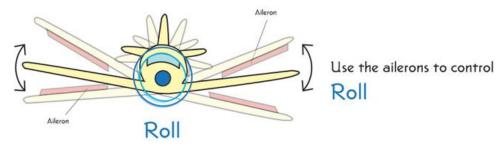

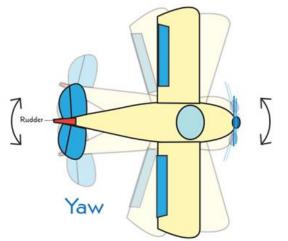

Use the rudder to control Yaw

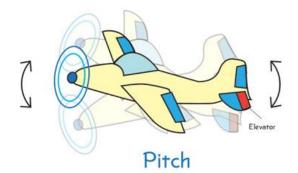

Use the elevators to control Pitch







•rotation of  $\alpha$  about z

$$m{R}_z(lpha) = egin{bmatrix} \coslpha & -\sinlpha & 0 \ \sinlpha & \coslpha & 0 \ 0 & 0 & 1 \end{bmatrix}$$







•rotation of  $\beta$  about y

$$\boldsymbol{R}_{y}(\beta) = \begin{bmatrix} \cos \beta & 0 & \sin \beta \\ 0 & 1 & 0 \\ -\sin \beta & 0 & \cos \beta \end{bmatrix}$$






## Elementary Rotations (Roll)

•rotation of  $\gamma$  about x

$$\boldsymbol{R}_x(\gamma) = \begin{bmatrix} 1 & 0 & 0 \\ 0 & \cos \gamma & -\sin \gamma \\ 0 & \sin \gamma & \cos \gamma \end{bmatrix}$$



## Elementary Rotations II

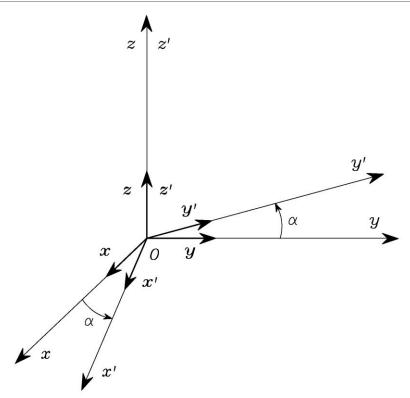

Rotation of frame by an angle about a coordinate axis



# Representation of a Vector



## Representation of a Vector

$$m{p} = egin{bmatrix} p_x \ p_y \ p_z \end{bmatrix} & m{p}' = egin{bmatrix} p_x' \ p_y' \ p_z' \end{bmatrix}$$

$$egin{array}{lll} oldsymbol{p} &=& p_x'oldsymbol{x}'+p_y'oldsymbol{y}'+p_z'oldsymbol{z}' &=& egin{bmatrix} oldsymbol{x}' &oldsymbol{y}' &oldsymbol{z}' \end{bmatrix}oldsymbol{p}' \ &=& oldsymbol{R}oldsymbol{p}' \end{array}$$

$$p' = R^T p$$



## Transformation Matrix


$$p = Rp'$$

The rotation matrix R represents the *transformation matrix* of the vector coordinates in frame O-xyz into the coordinates of the same vector in frame O-x'y'z'. In view of the orthogonality property, the inverse transformation is simply given by


$$p' = R^T p$$
.



## Coordinate Frames

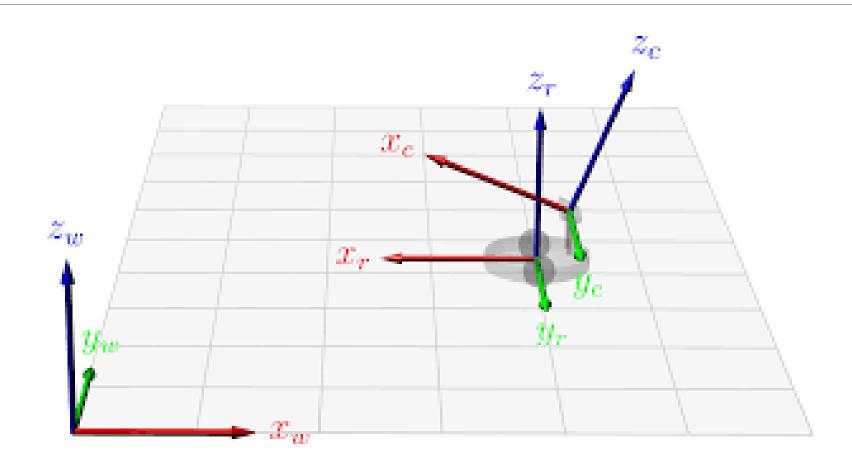




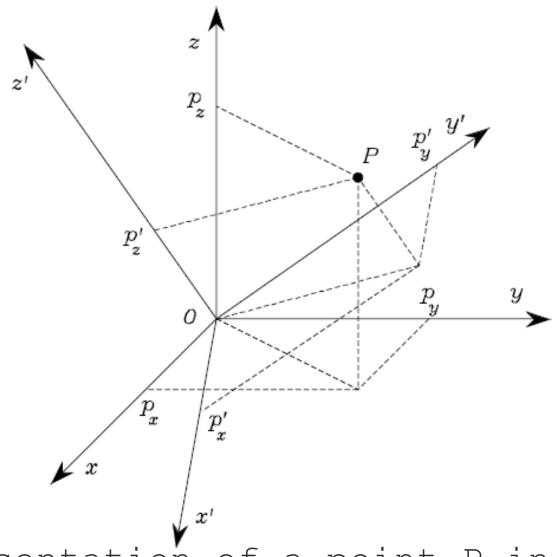

Representation of a point P in two different coordinate frames



## Rotated Frame (2D)

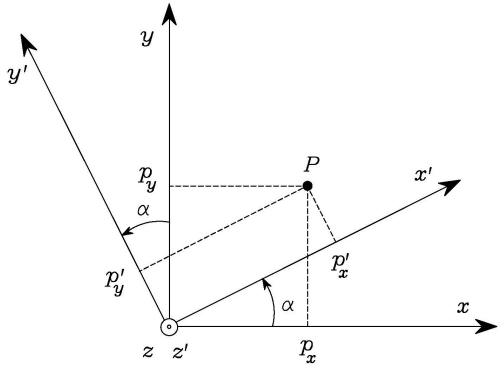

Representation of a point P in rotated frames





## Rotated Frame (2D)

#### Example 2.1

Consider two frames with common origin mutually rotated by an angle  $\alpha$  about the axis z. Let p and p' be the vectors of the coordinates of a point P, expressed in the frames O–xyz and O–x'y'z', respectively. On the basis of simple geometry, the relationship between the coordinates of P in the two frames is

$$p_{x} = p'_{x} \cos \alpha - p'_{y} \sin \alpha$$

$$p_{y} = p'_{x} \sin \alpha + p'_{y} \cos \alpha$$

$$p_{z} = p'_{z}$$

Therefore, the matrix (2.6) represents not only the orientation of a frame with respect to another frame, but it also describes the transformation of a vector from a frame to another frame with the same origin.



## Rotation of a Vector

$$p = Rp'$$

$$p^T p = p'^T R^T R p'$$



# Rotation of a vector of an angle about a coordinate axis

$$p_x = p_x' \cos \alpha - p_y' \sin \alpha$$


$$p_y = p_x' \sin \alpha + p_y' \cos \alpha$$

$$p_z = p'_z$$

$$\boldsymbol{p} = \boldsymbol{R}_z(\alpha)\boldsymbol{p}'$$



# Rotated of a Vector (2D)

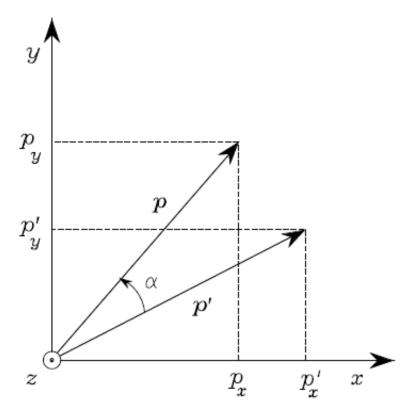

Rotation of a vector





# Rotated of a Vector (2D)

#### Example 2.2

Consider the vector p which is obtained by rotating a vector p' in the plane xy by an angle  $\alpha$  about axis z of the reference frame. Let  $(p'_x, p'_y, p'_z)$  be the coordinates of the vector p'. The vector p has components

$$p_{x} = p'_{x} \cos \alpha - p'_{y} \sin \alpha$$

$$p_{y} = p'_{x} \sin \alpha + p'_{y} \cos \alpha$$

$$p_{z} = p'_{z}$$

It is easy to recognize that p can be expressed as

$$p = R(\alpha)p'$$

where  $Rz(\alpha)$  is the same rotation matrix as in Matrix for Rotation Yaw



### Summary

In sum, a rotation matrix attains three equivalent geometrical meanings:

- It describes the mutual orientation between two coordinate frames; its column vectors are the direction cosines of the axes of the rotated frame with respect to the original frame.
- It represents the coordinate transformation between the coordinates of a point expressed in two different frames (with common origin).
- It is the operator that allows the rotation of a vector in the same coordinate frame.



# Big-X and Big-Y Method for Transformations



#### Transformation

- Mirror (X-axis, Y-axis, Original Point, Line)
- Translation
- Rotation
- Chou's X-Y Method



# Demonstration

CHOU'S X-Y METHOD FOR TRANSFORMATION

# Composition of Rotation Matrices



# Composition of Rotation Matrices

• Given three rotated frames 0, 1, 2

$$egin{align} m{p}^1 &= m{R}_2^1 m{p}^2 \ m{p}^0 &= m{R}_1^0 m{p}^1 \ m{p}^0 &= m{R}_2^0 m{p}^2 \ m{R}_i^j &= (m{R}_j^i)^{-1} = (m{R}_j^i)^T \ \end{pmatrix}$$




# Composition of Rotation Matrices

Rotation with respect to current frame


$$m{R}_2^0 = m{R}_1^0 m{R}_2^1$$

Rotation with respect to fixed frame

$$m{R}_2^0 = m{R}_2^1 m{R}_1^0$$

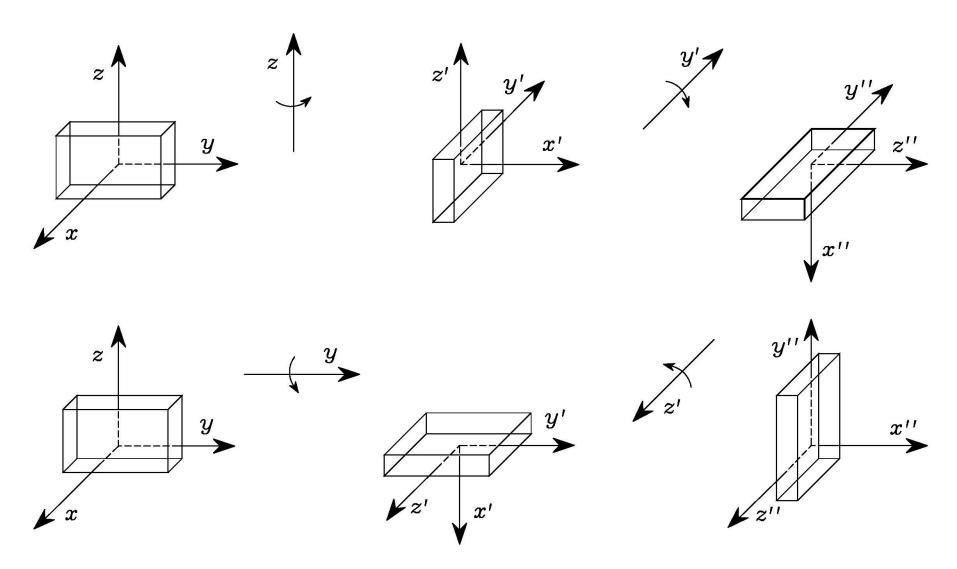

Successive rotations of an object about axes of current frame

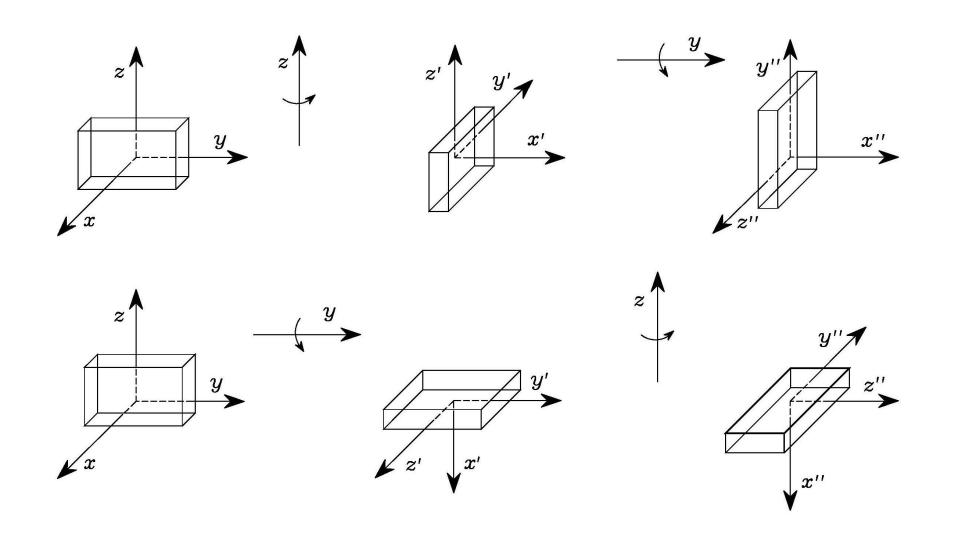

Successive rotations of an object about axes of fixed frame

# Euler Angle

SECTION 7



### Minimal Representations

- •Euler angles are introduced as a minimal representation of orientation
- •RPY angles are presented as an alternative set of Euler angles
- Both direct and inverse formulae are derived for the two sets





# Euler Angles


#### **Rotation matrix**

•9 parameters with 6 constraints


#### Minimal representation of orientation

•3 independent parameters



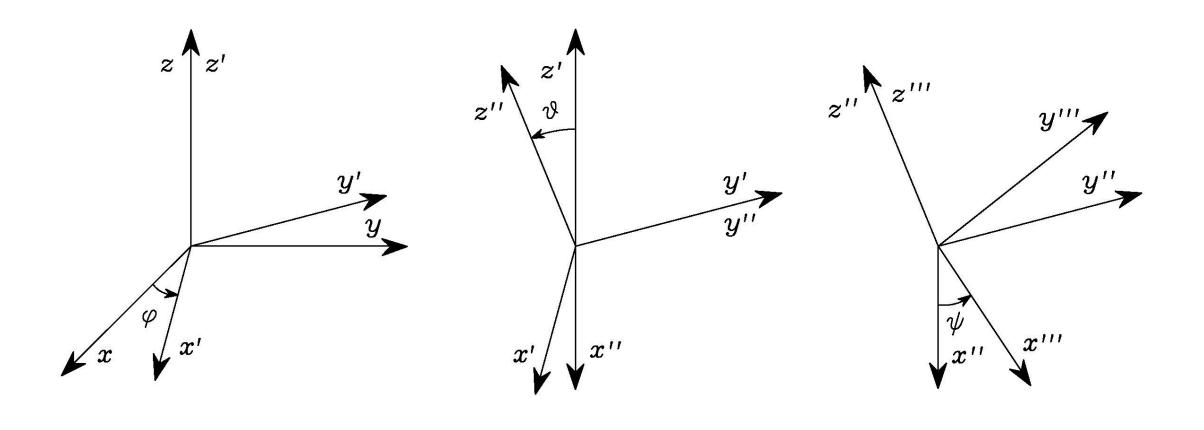

Representation of Euler angles ZYZ

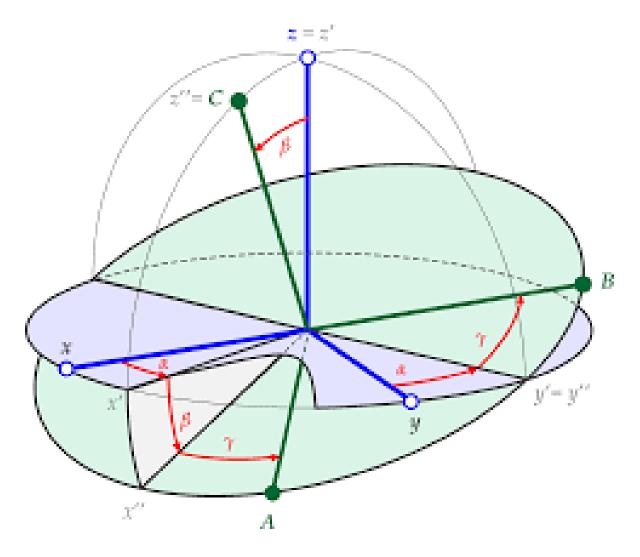

Euler Angles



# Euler Angles

#### **ZYZ** Angles

$$R(\phi) = R_z(\varphi)R_{y'}(\vartheta)R_{z''}(\psi)$$

$$= \begin{bmatrix} \cos \varphi \cos \vartheta \cos \psi - \sin \varphi \sin \psi & -\cos \varphi \cos \vartheta \sin \psi - \sin \varphi \cos \psi & \cos \varphi \sin \vartheta \\ \sin \varphi \cos \vartheta \cos \psi + \cos \varphi \sin \psi & -\sin \varphi \cos \vartheta \sin \psi + \cos \varphi \cos \psi & \sin \varphi \sin \vartheta \\ -\sin \vartheta \cos \psi & \sin \vartheta \sin \psi & \cos \vartheta \end{bmatrix}$$



### ZYZ Angles

The rotation described by *ZYZ angles* is obtained as composition of the following elementary rotations:

- Rotate the reference frame by the angle  $\phi$  about axis z; this rotation is described by the matrix  $R_z(\phi)$  which is formally defined in (2.6).
- Rotate the current frame by the angle  $\theta$  about axis y'; this rotation is described by the matrix  $R_{y'}(\theta)$  which is formally defined in (2.7).
- Rotate the current frame by the angle  $\psi$  about axis z''; this rotation is described by the matrix  $R_{z''}(\psi)$  which is again formally defined in (2.6).



#### Inverse Problem

Given 
$$m{R} = egin{bmatrix} r_{11} & r_{12} & r_{13} \ r_{21} & r_{22} & r_{23} \ r_{31} & r_{32} & r_{33} \end{bmatrix}$$

#### the three ZYZ angles are for

$$\vartheta \in (0, \pi)$$

$$\varphi = \text{Atan2}(r_{23}, r_{13})$$

$$\vartheta = \text{Atan2}\left(\sqrt{r_{13}^2 + r_{23}^2}, r_{33}\right)$$

$$\psi = \text{Atan2}(r_{32}, -r_{31})$$

#### Else for

$$\vartheta \in (-\pi, 0)$$

$$\varphi = \text{Atan2}(-r_{23}, -r_{13})$$

$$\vartheta = \text{Atan2}\left(-\sqrt{r_{13}^2 + r_{23}^2}, r_{33}\right)$$


$$\psi = \text{Atan2}(-r_{32}, r_{31})$$



# RPY Angles

$$R(\phi) = R_{\mathbf{z}}(\varphi)R_{\mathbf{y}}(\vartheta)R_{\mathbf{x}}(\psi)$$

$$= \begin{bmatrix} \cos \varphi \cos \vartheta & \cos \varphi \sin \vartheta \sin \psi - \sin \varphi \cos \psi & \cos \varphi \sin \vartheta \cos \psi + \sin \varphi \sin \psi \\ \sin \varphi \cos \vartheta & \sin \varphi \sin \vartheta \sin \psi + \cos \varphi \cos \psi & \sin \varphi \sin \vartheta \cos \psi - \cos \varphi \sin \psi \\ -\sin \vartheta & \cos \vartheta \sin \psi & \cos \vartheta \cos \psi \end{bmatrix}$$

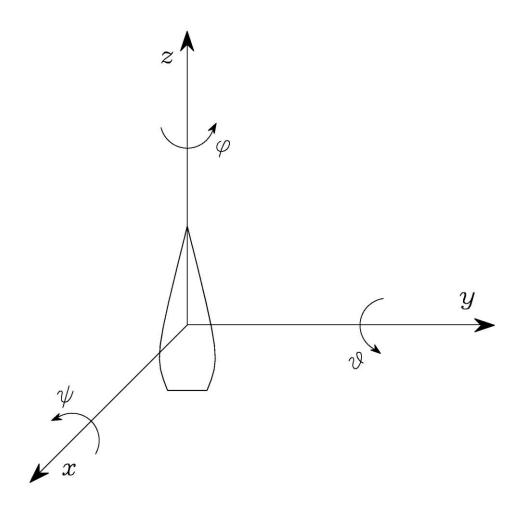

Representation of Roll-Pitch-Yaw angles



#### Inverse Problem

#### Given

$$m{R} = egin{bmatrix} r_{11} & r_{12} & r_{13} \ r_{21} & r_{22} & r_{23} \ r_{31} & r_{32} & r_{33} \end{bmatrix}$$

the three RPY angles are for

$$\vartheta \in (-\pi/2, \pi/2)$$

$$\varphi = \operatorname{Atan2}(r_{21}, r_{11})$$

$$\vartheta = \text{Atan2}\left(-r_{31}, \sqrt{r_{32}^2 + r_{33}^2}\right)$$

$$\psi = \operatorname{Atan2}(r_{32}, r_{33})$$



#### Inverse Problem

else for  $\vartheta \in (\pi/2, 3\pi/2)$ 

$$\varphi = \operatorname{Atan2}(-r_{21}, -r_{11})$$

$$\vartheta = \mathrm{Atan2} igg( -r_{31}, -\sqrt{r_{32}^2 + r_{33}^2} igg)$$

$$\psi = \text{Atan2}(-r_{32}, -r_{33})$$

# Four-parameter Representations



## Four-parameter Representations

- The angle and axis description is introduced as a fourparameter representation of orientation
- •The unit quaternion is adopted as an alternative fourparameter representation or orientation
- Both direct and inverse formulae are derived for the two representations






# Angle and Axis

$$R(\vartheta, r) = R_z(\alpha)R_y(\beta)R_z(\vartheta)R_y(-\beta)R_z(-\alpha)$$

$$\sin \alpha = \frac{r_y}{\sqrt{r_x^2 + r_y^2}} \qquad \cos \alpha = \frac{r_x}{\sqrt{r_x^2 + r_y^2}}$$

$$\sin\beta = \sqrt{r_x^2 + r_y^2} \qquad \cos\beta = r_z$$

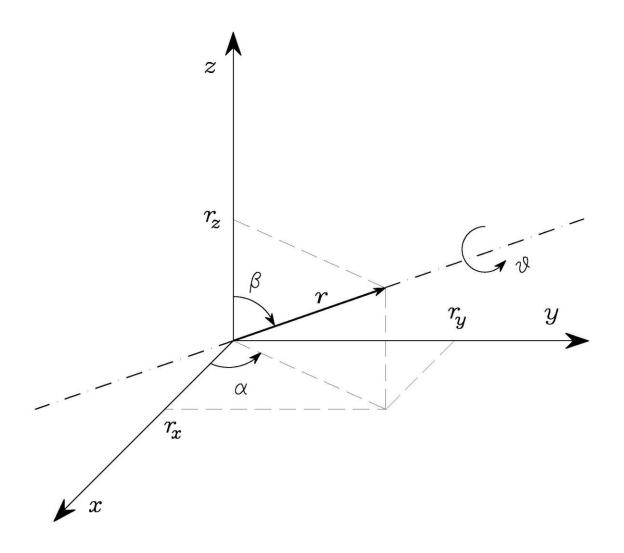

Rotation of an angle about an axis



# Angle and Axis II

$$R(\vartheta, r) = \begin{bmatrix} r_x^2(1 - \cos\vartheta) + \cos\vartheta & r_x r_y(1 - \cos\vartheta) - r_z \sin\vartheta & r_x r_z(1 - \cos\vartheta) + r_y \sin\vartheta \\ r_x r_y(1 - \cos\vartheta) + r_z \sin\vartheta & r_y^2(1 - \cos\vartheta) + \cos\vartheta & r_y r_z(1 - \cos\vartheta) - r_x \sin\vartheta \\ r_x r_z(1 - \cos\vartheta) - r_y \sin\vartheta & r_y r_z(1 - \cos\vartheta) + r_x \sin\vartheta & r_z^2(1 - \cos\vartheta) + \cos\vartheta \end{bmatrix}$$

$$R(-\vartheta, -r) = R(\vartheta, r)$$



#### Inverse Problem

Given 
$$m{R} = egin{bmatrix} r_{11} & r_{12} & r_{13} \ r_{21} & r_{22} & r_{23} \ r_{31} & r_{32} & r_{33} \end{bmatrix}$$

the angle and axis are for  $\sin \vartheta \neq 0$   $r_x^2 + r_y^2 + r_z^2 = 1$ 

$$\vartheta = \cos^{-1}\left(\frac{r_{11} + r_{22} + r_{33} - 1}{2}\right)$$

$$m{r} = rac{1}{2\sinartheta}egin{bmatrix} r_{32} - r_{23} \ r_{13} - r_{31} \ r_{21} - r_{12} \end{bmatrix}$$



#### Unit Quaternion

#### Four-parameter representation

$$Q = \{\eta, \epsilon\}$$

$$\eta = \cos \frac{\vartheta}{2}$$

$$\epsilon = \sin \frac{\vartheta}{2} r$$

with 
$$\eta^2 + \epsilon_x^2 + \epsilon_y^2 + \epsilon_z^2 = 1$$

# $(\vartheta, \boldsymbol{r})$ and $(-\vartheta, -\boldsymbol{r})$ give the same quaternion

$$\boldsymbol{R}(\eta, \epsilon) = \begin{bmatrix} 2(\eta^2 + \epsilon_x^2) - 1 & 2(\epsilon_x \epsilon_y - \eta \epsilon_z) & 2(\epsilon_x \epsilon_z + \eta \epsilon_y) \\ 2(\epsilon_x \epsilon_y + \eta \epsilon_z) & 2(\eta^2 + \epsilon_y^2) - 1 & 2(\epsilon_y \epsilon_z - \eta \epsilon_x) \\ 2(\epsilon_x \epsilon_z - \eta \epsilon_y) & 2(\epsilon_y \epsilon_z + \eta \epsilon_x) & 2(\eta^2 + \epsilon_z^2) - 1 \end{bmatrix}$$



#### Inverse Problem

#### Given

$$m{R} = egin{bmatrix} r_{11} & r_{12} & r_{13} \ r_{21} & r_{22} & r_{23} \ r_{31} & r_{32} & r_{33} \end{bmatrix}$$

$$\eta = \frac{1}{2}\sqrt{r_{11} + r_{22} + r_{33} + 1}$$

the quaternion is for 
$$\eta \geq 0$$
 
$$\epsilon = \frac{1}{2} \begin{bmatrix} \operatorname{sgn}(r_{32} - r_{23})\sqrt{r_{11} - r_{22} - r_{33} + 1} \\ \operatorname{sgn}(r_{13} - r_{31})\sqrt{r_{22} - r_{33} - r_{11} + 1} \\ \operatorname{sgn}(r_{21} - r_{12})\sqrt{r_{33} - r_{11} - r_{22} + 1} \end{bmatrix}$$



#### Inverse Problem II

Quaternion extracted from  $\mathbf{R}^{-1} = \mathbf{R}^T$ 

$$Q^{-1} = \{\eta, -\epsilon\}$$

Quaternion product

$$Q_1 * Q_2 = \{ \eta_1 \eta_2 - \epsilon_1^T \epsilon_2, \eta_1 \epsilon_2 + \eta_2 \epsilon_1 + \epsilon_1 \times \epsilon_2 \}$$



# Further Insights


- 1. Find the rotation matrix corresponding to the set of Euler angles ZXZ.
- 2. Discuss the inverse solution for the Euler angles ZYZ in the case  $\sin(\theta)$ .
- 3. Discuss the inverse solution for the Roll-Pitch-Yaw angles in the case  $cos(\vartheta)$ . Verify the formula for the rotation matrix corresponding to the rotation by an angle about an arbitrary axis.
- 4. Verify the inverse formulae for the angle and the unit vector of the axis corresponding to a rotation matrix. Find inverse formulae in the case of  $\sin(\vartheta)$ .
- 5. Verify the formula for the rotation matrix corresponding to the unit quaternion.
- 6. Verify the inverse formulae for the unit quaternion corresponding to a rotation matrix.



# Kinematics Diagram – Robot Model



# **Robots Computing Model**

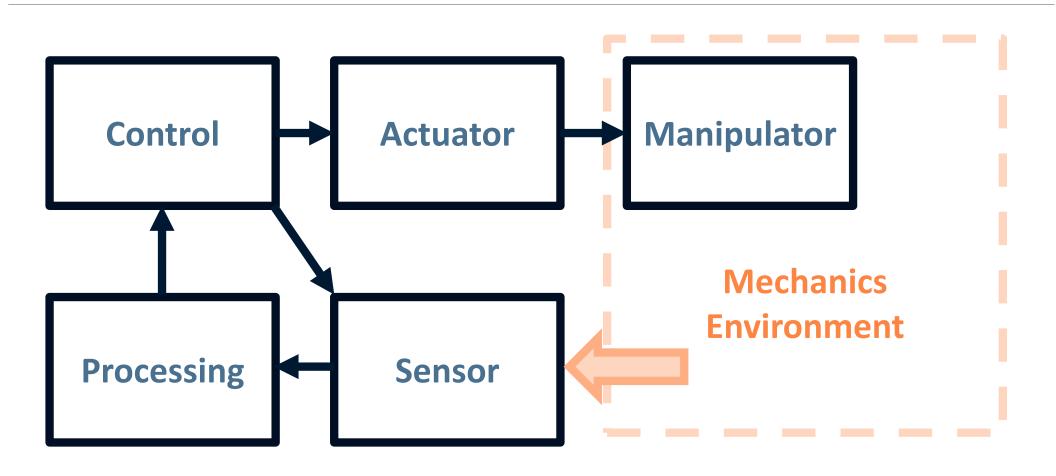



## Robot Arm is a Manipulator


- •A robot arm receive control signals from an actuator which can be a
  - Remote Control,
  - Cell Phone,
  - PC, or
  - Mouse
- •A Robot Arm is manipulated to perform a certain task.



# Kinematics Diagram – Kinematics Diagram Design



#### Robot Arm consists of Joints and Links

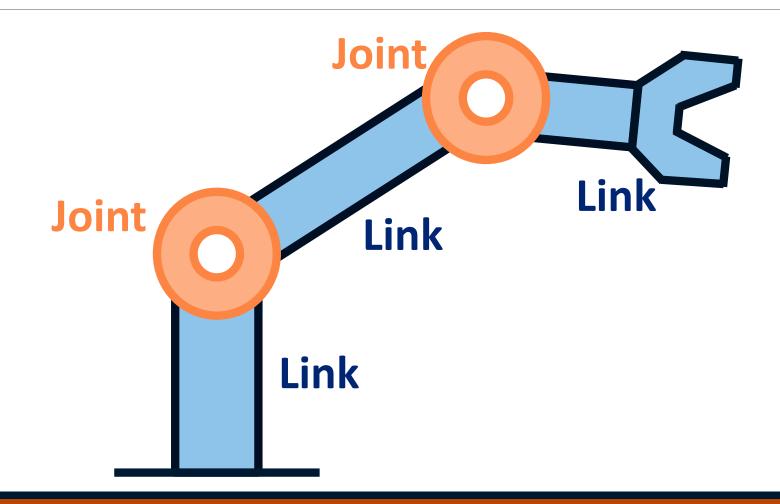





#### Robot Arm consists of Joints and Links



**Prismatic Joint** 





Link




#### Kinematics Diagram


- •2 D Model
- •3 D Model



#### 3D Model

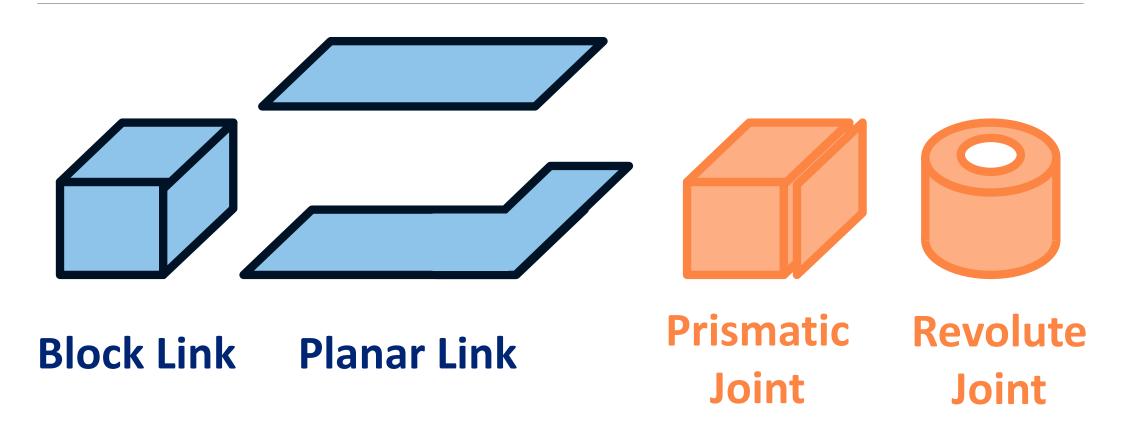


# **Example Robot Arm 1**

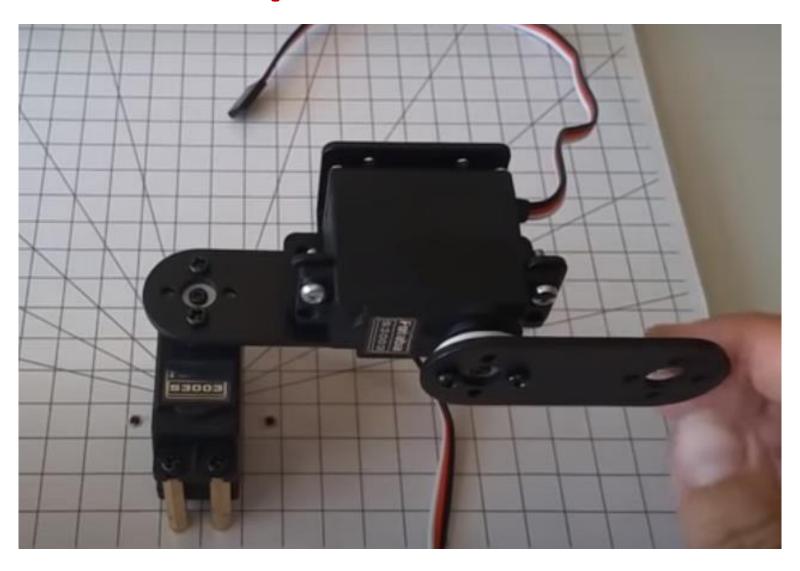




# Kinematics Diagram (3D)

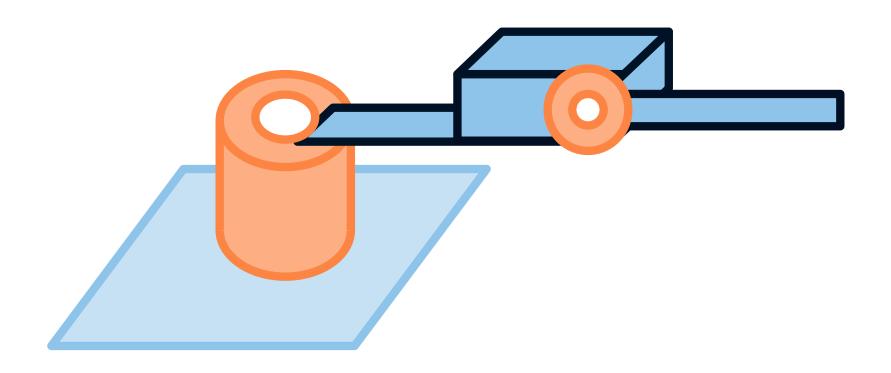




### Kinematics Diagram (2D Top View)

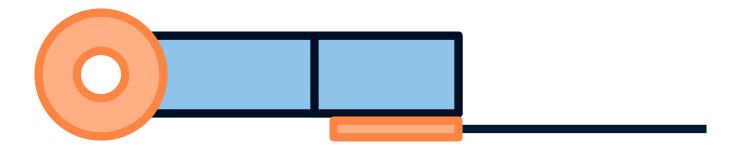



#### Kinematics Diagram (2D From View)

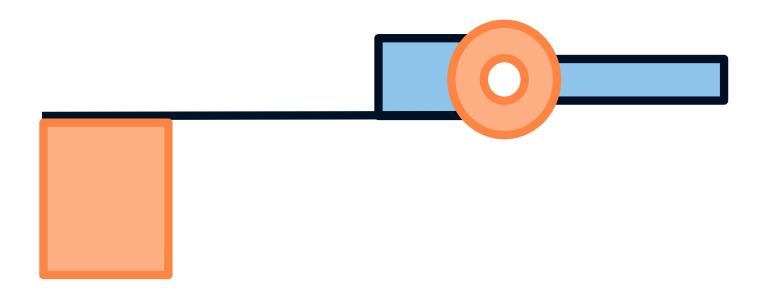




# Kinematics Diagram – Axis-Assignment



# Kinematics Diagram (3D) Joint (Z)

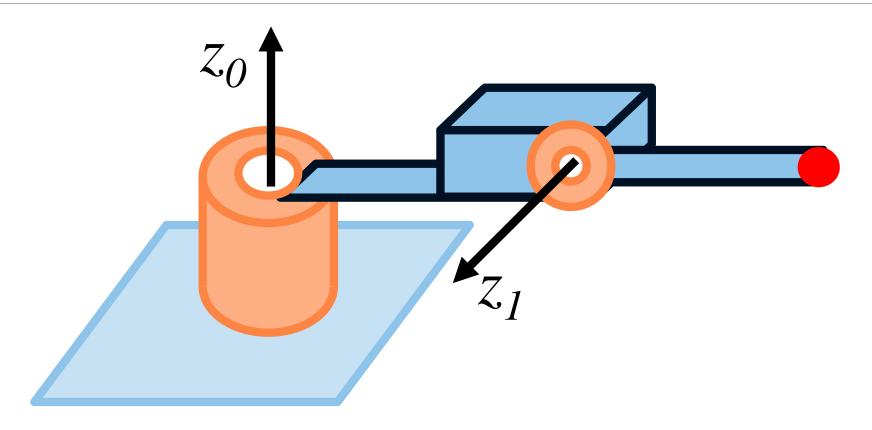









# Kinematics Diagram (3D) Joint(x)

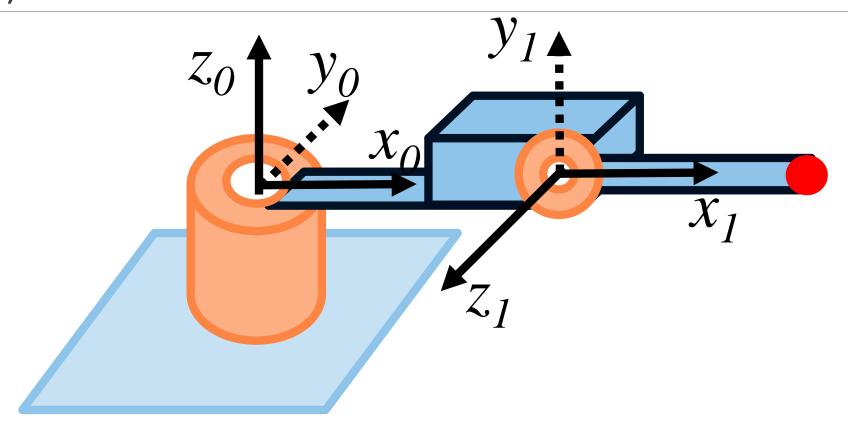






## Right Hand Rule

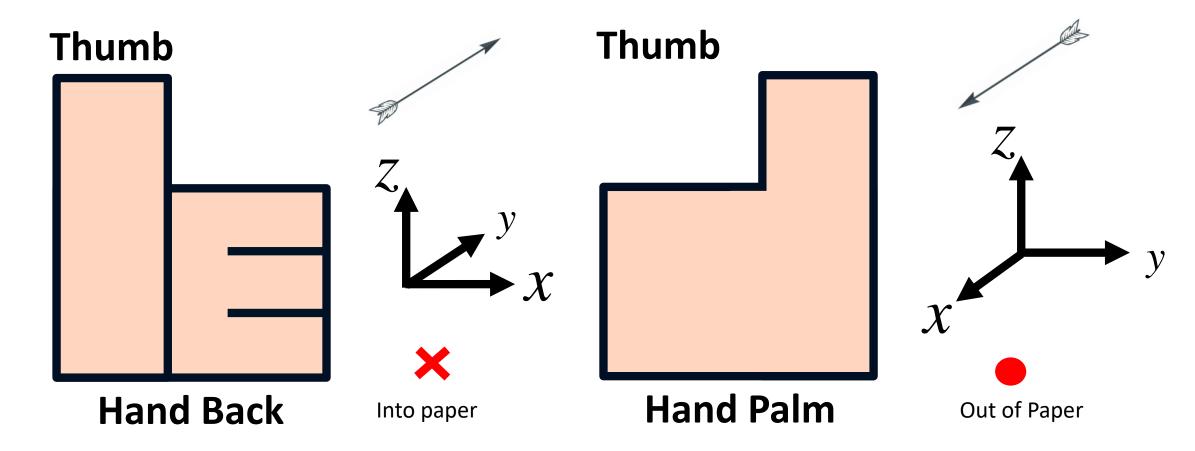



# Right Hand Rule

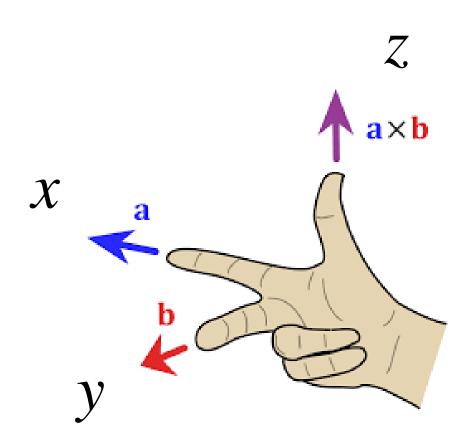



#### Rule # 1:

•The Z-Axis must be the axis of rotation for a revolute join, or the direction of motion for a prismatic joint.



#### Rule # 2:

- •The X-axis:
  - The X-axis must be perpendicular both to its own z-axis, and the z-axis of the frame before it.



#### Rule # 3:

•All frames must follow the right-hand rule. (Cross-product)



#### Rule # 4:


•Each X-axis must intersect the Z-axis of the frame before it.

# Kinematics Diagram – Case Study



#### Kinematics Diagram (3D)

Parameters (a: distance from the previous joint)

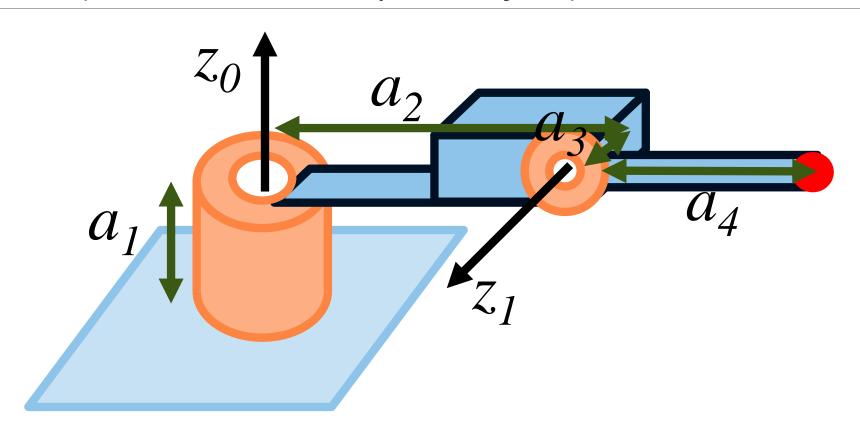








#### Kinematics Diagram (3D)


Parameters ( $\alpha$ : angle of a z joint to previous x axis)

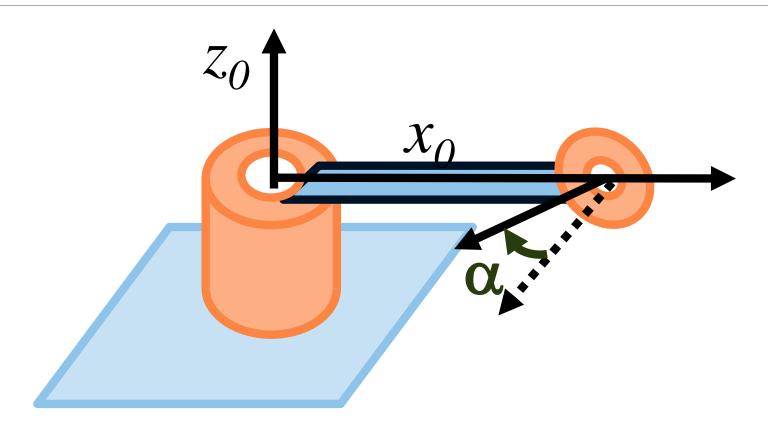





# **Example Robot Arm 2**

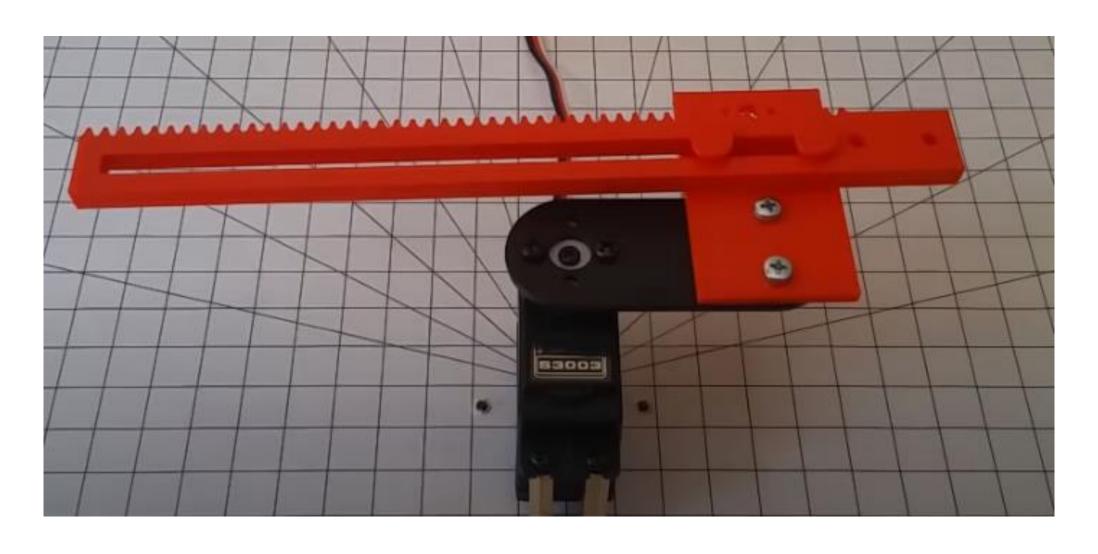




#### Joint Variable

•The value that changes when a joint moves.



## Kinematics Diagram (3D) Joint Variables - angle $\theta$

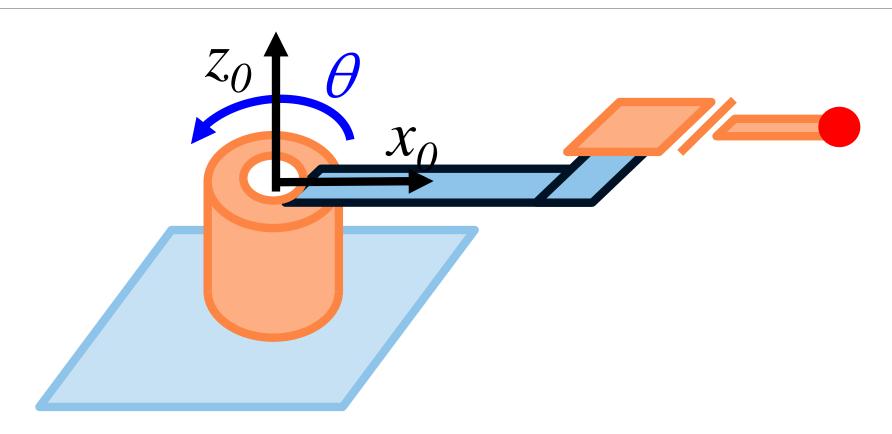







### Kinematics Diagram (3D) Joint Variables - displacement d

