



Home Survey – Level 2

—



Contents

A	About the Inspection and Report
B	Overall Opinion
C	About the Property
D	Outside the Property
E	Inside the Property
F	Services
G	Grounds (including shared areas for flats)
H	Issues for Your Legal Advisers
I	Risks
J	Surveyor's Declaration
L	Description of the Home Survey – Level 2
M	Typical house diagram
N	Photographic Record

Condition Ratings

To help describe the condition of the property, we give condition ratings to the main parts (the 'elements') of the building, garage and some parts outside. Some elements can be made up of several different parts. In the element boxes, we describe the part that has the worst condition rating first and then briefly outline the condition of the other parts.

1

Condition Rating 1

No repair is currently needed. The property must be maintained in the normal way.

2

Condition Rating 2

Defects that need repairing or replacing but are not considered to be either serious or urgent. The property must be maintained in the normal way.

3

Condition Rating 3

Defects that are serious and/or need to be repaired, replaced or investigated urgently. Failure to do so could risk serious safety issues or severe long-term damage to your property. Written quotations for repairs should be obtained prior to legal commitment to purchase.

NI

Not Inspected

The element was not inspected and the reason is given in the report. This may be because access was restricted or the element was not present at the property.

About This Report

This Home Survey has been produced by a surveyor who has written this report for you to use. If you decide not to act on the advice in this report, you do this at your own risk.

This Home Survey aims to help you:

- Make a reasoned and informed decision on whether to go ahead with buying the property
- Take account of any repairs or replacements the property needs
- Consider what further advice you should take before committing to purchase the property

Approach to the Inspection

We carry out only a visual inspection. This means that we do not take up carpets, floor coverings or floorboards, move furniture or remove the contents of cupboards. We do not remove secured panels or undo electrical fittings.

We inspect the inside and outside of the main building and all permanent outbuildings, but we do not force or open up the fabric. We also inspect the parts of the electricity, gas/oil, water, heating and drainage services that can be seen, but we do not test them.

We note in our report if we are not able to check any parts of the property that the inspection would normally cover. If we are concerned about these parts, the report will tell you about any further investigations that are needed.

A About the Inspection and Report

SURVEYOR NAME

RICS NUMBER

COMPANY NAME

CLIENT'S NAME

PROPERTY ADDRESS

DATE OF INSPECTION

TIME OF INSPECTION (OPTIONAL)

WEATHER CONDITIONS (OPTIONAL)

PRECEDING WEATHER / GROUND
CONDITIONS (OPTIONAL)

PROPERTY TYPE

Semi-detached house

APPROXIMATE YEAR OF CONSTRUCTION

TENURE

NUMBER OF STOREYS

REPORT REFERENCE NUMBER (OPTIONAL)

RELATED PARTY DISCLOSURE

STATUS OF THE PROPERTY (OPTIONAL)



Fig. 1

B Overall Opinion

Important note: To get a balanced impression of the property, we strongly recommend that you read all sections of the report, in particular the further-investigations and recommendations section at the end, and discuss this with us if required.

This inspection identified **1** item requiring **urgent attention**, **8** items that **need attention but are not serious**, and **16** elements with **no current issues**. See the summary below and the body of this report for full detail.

R

Documents to request

Documents we may suggest you request from the seller before signing contracts. Check these documents are supplied by your solicitor.

REF	ELEMENT	DOCUMENT
E3	Walls and partitions	Document to be confirmed
F1	Electricity	Electrical Installation Condition Report (EICR)
F2	Gas/Oil	Landlord/Home Owner Gas Safety Record (CP12)

Condition Rating Summary

3

Elements that require urgent attention

These elements have defects that are serious and/or need to be repaired, replaced or investigated urgently.

REF	ELEMENT	SECTION
D9	Other	Outside the Property

2

Elements that require attention but are not serious or urgent

These elements have defects that need repairing or replacing but are not considered to be either serious or urgent.

REF	ELEMENT	SECTION
D3	Rainwater pipes and gutters	Outside the Property

D4	Main walls	Outside the Property
D6	Outside doors (including patio doors)	Outside the Property
D7	Conservatory and porches	Outside the Property
D8	Other joinery and finishes	Outside the Property
E2	Ceilings	Inside the Property
F6	Drainage	Services
G2	Permanent outbuildings and other structures	Grounds

1

Elements with no current issues

No repair is currently needed. The elements listed here must be maintained in the normal way.

REF	ELEMENT	SECTION
D2	Roof coverings	Outside the Property
D5	Windows	Outside the Property
E1	Roof structure	Inside the Property
E3	Walls and partitions	Inside the Property
E4	Floors	Inside the Property
E6	Built-in fittings	Inside the Property
E7	Woodwork	Inside the Property
E8	Bathroom fittings	Inside the Property
F1	Electricity	Services
F2	Gas/Oil	Services
F3	Water	Services
F4	Heating	Services
F5	Water heating	Services
G4	Trees	Grounds
G5	Boundaries, retaining walls, and fences	Grounds
G6	Driveways and paths	Grounds

NI

Elements not inspected

We carry out a visual inspection, so a number of elements may not have been inspected.

REF	ELEMENT	SECTION
D1	Chimney stacks	Outside the Property
E5	Fireplaces, chimney breasts and flues	Inside the Property
E9	Other	Inside the Property
F7	Common services	Services
G1	Garage	Grounds
G3	Other outdoor elements	Grounds
G7	Other grounds features	Grounds
G8	Common / Shared areas	Grounds

C About the Property

CONSTRUCTION

Semi-detached house understood to have been constructed around 1970, with a single-storey rear extension added around 1985. Brick cavity walls (approx. 300mm thick) with cavity wall insulation, concrete tile pitched roof with UPVC guttering and downpipes, predominantly double glazed windows (some single glazing to toilet and entrance door), and a polycarbonate-roofed conservatory to the rear.

APPROXIMATE YEAR EXTENDED

1985 (single-storey rear extension)

APPROXIMATE YEAR CONVERTED

N/A

INFORMATION RELEVANT TO FLATS AND MAISONNET TES

N/A

ACCOMMODATION

Ground floor: 1 Reception, 1 Kitchen, 1 WC, 1 Other
First floor: 3 Bedrooms, 1 Bathroom
Entrance hall/corridor to ground floor and landing to first floor (not included in room counts above).

ENERGY EFFICIENCY RATING

EPC Rating: C, EPC valid until 2035 EPC: The surveyor has not prepared the Energy Performance Certificate (EPC) as part of the RICS Home Survey – Level 2 (survey and valuation) service for the property and cannot comment upon the accuracy of this third-party report as we are not qualified EPC assessors.

ISSUES RELATING TO THE ENERGY EFFICIENCY RATING

EPC inspection was a desk-based survey only. Singleglazed front sash windows reduce thermal performance; the buyer may wish to budget for secondary glazing or sympathetic replacement subject to local conservation guidance.

MAINS SERVICES

Mains electricity (meter beneath stairs, service records to be confirmed), mains gas (meter on side elevation), mains water, and mains drainage (foul water manhole located within conservatory).

CENTRAL HEATING

Panel radiators present throughout (single panel to hall, bedrooms and bathroom; double panel to lounge and kitchen). Boiler/heating source not identified or accessed during the inspection.

OTHER SERVICES OR ENERGY SOURCES	No solar PV, no battery storage, no LPG.
OTHER ENERGY MATTERS (OPTIONAL)	Loft insulation appears to be approximately 270mm mineral wool, broadly in line with current Part L recommendations.
GROUNDINGS	Rear garden is fenced (timber fencing to side and rear boundaries, approx. 1.6m-1.8m high) with a lawned area and variety of planting, a brick-built shed, and a gated rear access leading towards open fields/parkland.
LOCATION	Semi-detached house located at 64 Wintringham Road, St Neots, Cambridgeshire, with rear garden backing onto open fields/parkland.
FACILITIES	Primary schools, and parks within walking distance.
LOCAL ENVIRONMENT	Quiet residential street with on-street parking. No notable environmental concerns identified during the inspection.

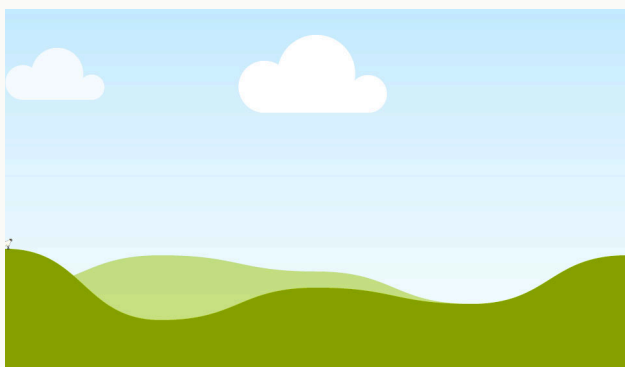


Fig. 2

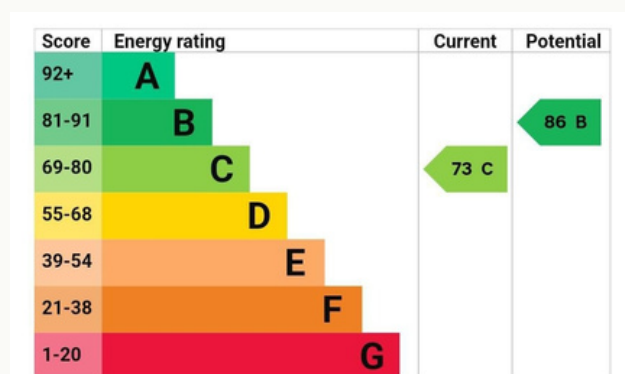


Fig. 3

Environmental Summary

This data is retrieved directly from publicly available UK government sources and displayed without interpretation or modification. ~~It does not constitute a formal environmental search, desk study, or professional assessment. Always recommend that clients commission formal environmental searches through their legal adviser before exchange of contracts.~~

Flood Risk

Flood Zone	Flood Zone 2
Surface Water Flood Risk	Data not available
Historic Flooding (250m)	Recorded flood events within 250m (2 records)

Active Flood Warnings (3km)	None
-----------------------------	------

Ground Conditions

Bedrock Geology	Oxford Clay Formation — Mudstone
-----------------	----------------------------------

Superficial Deposits	River Terrace Deposits, 1 to 2 — Sand and gravel
----------------------	--

Land Use

Historic Landfill (500m)	None found within search area
--------------------------	-------------------------------

Active Waste Sites (500m)	None found within search area
---------------------------	-------------------------------

Planning

Conservation Area	Not within a conservation area
-------------------	--------------------------------

Coordinates: 52.225914, -0.259534

Data sources: Environment Agency Flood Map for Planning, Risk of Flooding from Surface Water, Historic Flood Map, Real Time Flood Monitoring; British Geological Survey 1:50,000 Geology; DLUHC Planning Data; Ordnance Survey. Contains public sector information licensed under the Open Government Licence v3.0.

Data retrieved: 29 July 2026

D Outside the Property

D1 Chimney stacks

NI

REASON NOT INSPECTED

No chimney stack present - the property has no open fireplace and is served by a gas combination boiler only.

D2 Roof coverings

1

DESCRIPTION

Concrete roof tiles installed to the main pitched roof, with UPVC guttering. The roof was visually inspected from ground level only. No significant defects identified during the visual inspection.

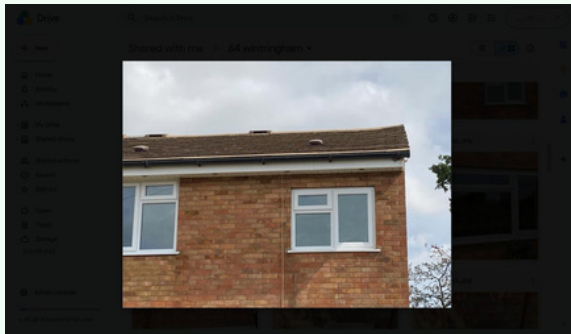


Fig. 4

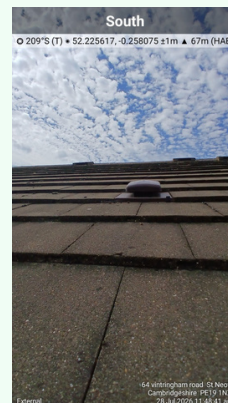


Fig. 5

D3 Rainwater pipes and gutters

2

DESCRIPTION

UPVC guttering and downpipes installed around the property.

DEFECTS

Rear rainwater downpipe appears incorrectly fitted and requires adjustment. Gutter observed to be partially blocked with debris/leaves.

RECOMMENDATIONS

Adjust/refit the rear downpipe and clear guttering of debris to ensure effective rainwater disposal and prevent water ingress to the building fabric.

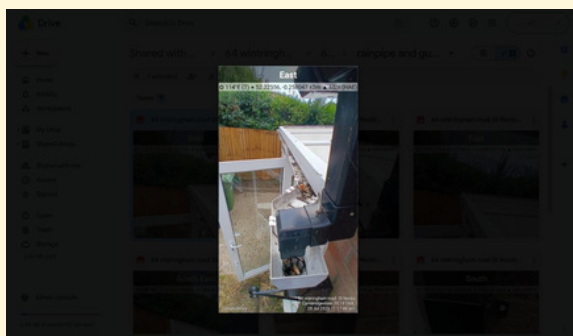


Fig. 6



Fig. 7

D4 Main walls**2****DESCRIPTION**

Cavity brick main walls with external cavity wall insulation present. Brickwork and mortar appeared generally dry at the time of inspection, with cavity wall insulation present.

DEFECTS

Mortar deterioration and higher moisture readings (approximately 10-13%) noted beneath the planted area to the front elevation. A Wi-Fi cable was also observed fixed externally above the damp proof course (DPC), approximately 150mm above ground level. External electrical wiring nearby appeared untidy.

RECOMMENDATIONS

Review external service penetrations and cable fixings to ensure they do not compromise the building fabric or damp protection. Monitor areas of mortar deterioration and repair where necessary. External electrical wiring should be inspected by a qualified electrician.

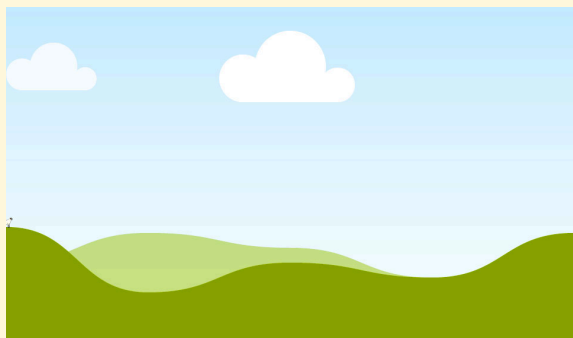


Fig. 8



Fig. 9

D5 Windows

1

DESCRIPTION

Double-glazed UPVC windows installed throughout the majority of the property, generally estimated to date from between 2002-2022. No significant defects identified during the visual inspection. Note: the toilet window is single glazed (see D8/E notes).

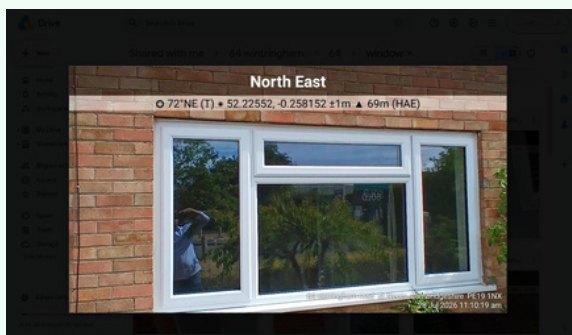


Fig. 10



Fig. 11

D6 Outside doors (including patio doors)

2

DESCRIPTION

Front entrance UPVC door with feature glazing to the door pane, beneath a canopy porch.

DEFECTS

Rear entrance timber door is single glazed, which may provide reduced thermal performance and security compared with modern double-glazed doors.

RECOMMENDATIONS

Consider upgrading to a double-glazed door for improved security and thermal performance, if not already planned.

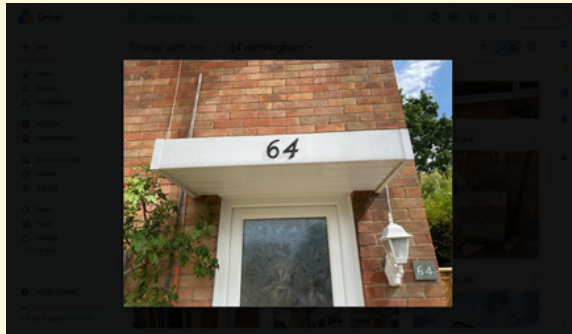


Fig. 12



Fig. 13

D7 Conservatory and porches**2****DESCRIPTION**

Rear conservatory with polycarbonate roof covering and double-glazed units, estimated to date from around January 2021. A foul water drainage manhole is located within the conservatory, adjacent to the rear external wall, serving the ground floor toilet and first floor bathroom drainage system.

DEFECTS

Silicone sealant appears incomplete in some areas around the conservatory, which may allow water ingress.

RECOMMENDATIONS

Sealant should be renewed where necessary and monitored for signs of leakage.

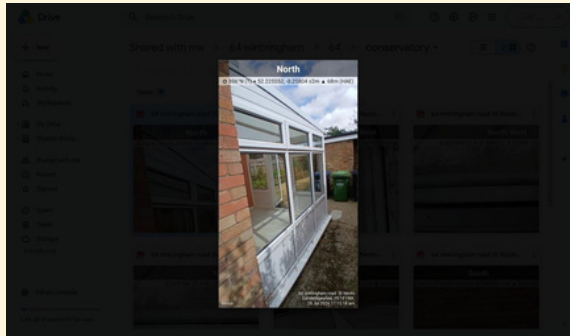


Fig. 14

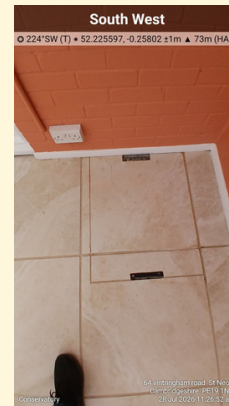


Fig. 15

D8 Other joinery and finishes

2

DESCRIPTION

Ground floor toilet window installed. and extractor fan not present

DEFECTS

Single glazed window installed to the ground floor toilet, which may provide reduced thermal performance compared with modern double glazing.

D9 Other

3

DESCRIPTION

Structural observation - rear extension movement. The single-storey rear extension is understood to have been constructed around 1985.

Concrete Crack on the front right-side corner: There is a visible crack running across the concrete slab starting right near the outer brick corner. Over time, water ingress into this crack could cause further settling or freeze-thaw damage.

Dampness & Surface Wear: The concrete shows uneven weathering, potential water staining, and aggregate exposure, typical for aged outdoor concrete paths.

Brickwork & Threshold: The brick porch corner and white UPVC door structure appear intact, though checking the seal/pointing where the concrete meets the brick base is advisable.

DEFECTS

Signs of movement were noted to the external wall of rear extension during the inspection, including a noticeable horizontal line at damp-proof course (DPC) level on the rear elevation, which may be indicative of historic settlement or movement. Based on the visual inspection, there was no clear evidence to suggest ongoing progressive movement; however, this cannot be confirmed without further investigation. It is noted that there is reportedly an existing insurance claim relating to this movement.

RECOMMENDATIONS

We recommend that the purchaser instructs a Structural Engineer to undertake a detailed structural assessment of the rear extension. This should establish the cause and extent of the movement, confirm whether it is historic or ongoing, assess the structural stability of the extension, and specify any remedial works that may be required. The findings of the Structural Engineer should be considered before exchanging contracts, and full details of the existing insurance claim relating to this movement should be obtained via the legal advisers.

URGENCY / SAFETY RISK

Potential structural movement to the rear extension could affect the stability of the structure if progressive. Further investigation by a Structural Engineer is required before exchange of contracts to rule out ongoing risk.

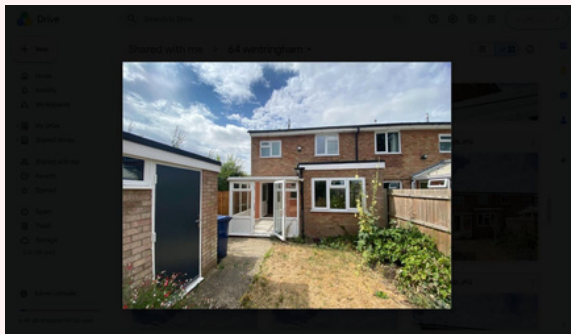


Fig. 16



Fig. 17

E Inside the Property

E1 Roof structure

1

DESCRIPTION

Timber roof structure viewed via loft access on the first floor landing. Loft insulation present. No significant defects identified during the visual inspection; no signs of water penetration or timber decay noted.

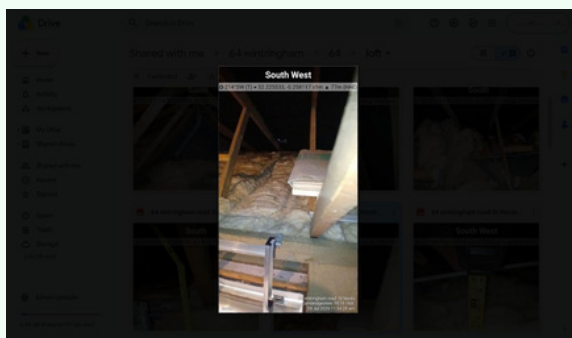


Fig. 18

E2 Ceilings

2

DESCRIPTION

Plastered ceilings throughout, generally in fair condition. Ceiling height in the entrance hall measured approximately 2300mm.

DEFECTS

Minor hairline gaps/cracking noted between the coving and ceiling near the understairs area in the entrance hall.

RECOMMENDATIONS

Monitor for any progression or signs of movement; minor cosmetic repair only likely needed.

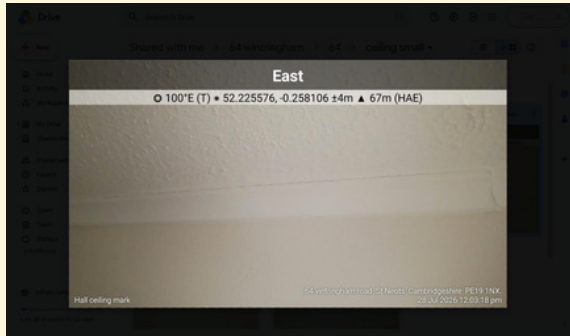


Fig. 19



Fig. 20

E3 Walls and partitions

1

DESCRIPTION

plastered over masonry on ground floor and first floor.



Fig. 21

E4 Floors

1

DESCRIPTION

Concrete floors at ground level; solid concrete to kitchen extension. First floor of timber joists.



Fig. 22

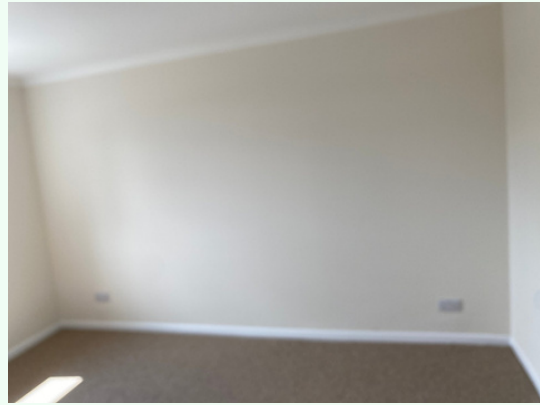


Fig. 23

E5 Fireplaces, chimney breasts and flues

NI

REASON NOT INSPECTED

No chimney breast present - the property has no open fireplace and is served by a gas combination boiler only.

E6 Built-in fittings

1

DESCRIPTION

Modern fitted kitchen, cabinets and laminate worktops.



Fig. 24



Fig. 25

E7 Woodwork

1

DESCRIPTION

The internal doors, skirting boards and architraves are predominantly of the original timber construction and have been painted. The internal joinery was generally found to be in satisfactory condition.



Fig. 26

E8 Bathroom fittings

1

DESCRIPTION

The property benefits from a first-floor family bathroom comprising a bath, wash hand basin and WC. The sanitary fittings present at the time of the inspection, with no significant defects observed during the visual assessment.

The bathroom is fitted with an extractor fan and an electric shower. General wear and tear is consistent with the age and use of the property. Routine maintenance, including the inspection and renewal of sealant around sanitary fittings where necessary, is recommended to minimise the risk of water ingress.



Fig. 27



Fig. 28

E9 Other

NI

REASON NOT INSPECTED

No other interior elements requiring separate assessment.

F Services

Services are generally hidden within the construction of the property. Our inspection of the services is therefore limited to the visible parts of the installations that can be seen without risk of causing damage to the property.

F1 Electricity

1

⚠ Safety warning: The Electrical Safety Council recommends that you should get a registered electrician to check the property and its electrical fittings at least every ten years, or on change of occupancy. All electrical installations deteriorate with age and use. For your safety, have the installation inspected and tested by a registered electrician.

DESCRIPTION

Consumer unit (fuse box) and electricity meter located within a cupboard off the entrance hall. Electricity meter also present; external electrical wiring to the front elevation appeared untidy and should be inspected by a qualified electrician.

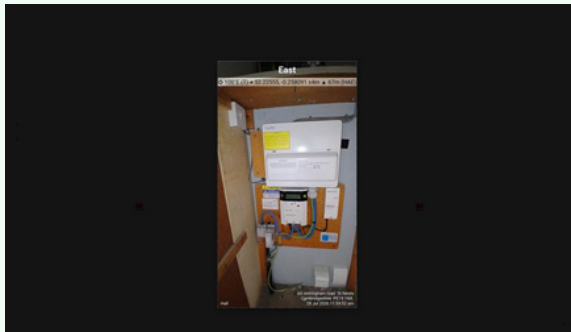


Fig. 29

F2 Gas/Oil

1

⚠ Safety warning: All gas appliances and flues should be regularly inspected, tested and serviced by a Gas Safe registered engineer. This includes gas fires, boilers, cookers and any other gas appliance. If you suspect a gas leak, contact the National Gas Emergency Service immediately on 0800 111 999.

DESCRIPTION

Gas meter located on the side elevation wall, within an external meter box. No significant defects identified during the visual inspection.



Fig. 30

F3 Water

1

DESCRIPTION

Stopcock located within the kitchen. Water flow appeared satisfactory at the time of inspection. No significant defects identified.

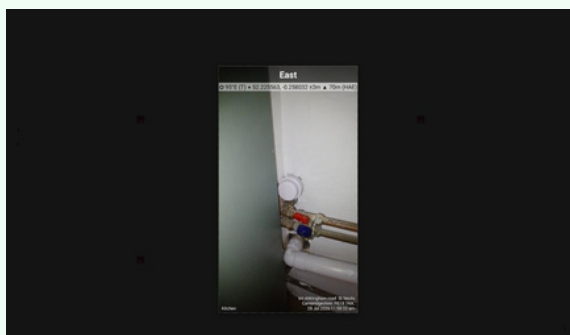


Fig. 31

F4 Heating

1

DESCRIPTION

Gas combination boiler (Glow-worm) located within the property, serving central heating and hot water. Appears to be a relatively modern high-efficiency condensing boiler. No significant defects identified during the visual inspection; service history and warranty documentation should be confirmed.

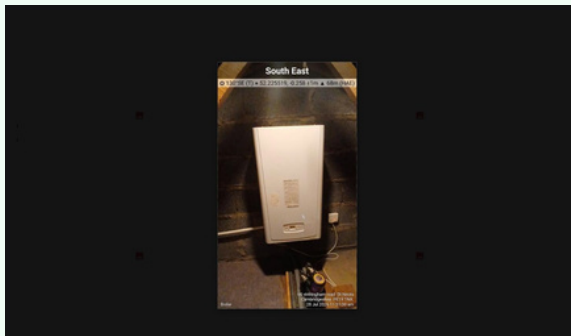


Fig. 32

F5 Water heating

1

DESCRIPTION

Hot water provided via the gas combination boiler (see Heating above). No hot water cylinder present. No significant defects identified.

F6 Drainage

2

DESCRIPTION

Foul water manhole/Inspection chamber located within the conservatory, adjacent to the rear external wall, serving the ground floor toilet and first floor bathroom drainage system.

DEFECTS

The inspection chamber could not be opened because the cover was sealed. As a result, the condition of the

drainage chamber and underground drainage system could not be assessed.

RECOMMENDATIONS

An inspection chamber is located within the conservatory. This is not uncommon in properties, its position within an enclosed space may increase the risk of odour escape, leakage and restricted access for maintenance. The chamber should be kept accessible and monitored for signs of defects. If there is any evidence of drainage problems or before undertaking significant alterations, a specialist CCTV drain survey is recommended to assess the condition of the underground drainage system.

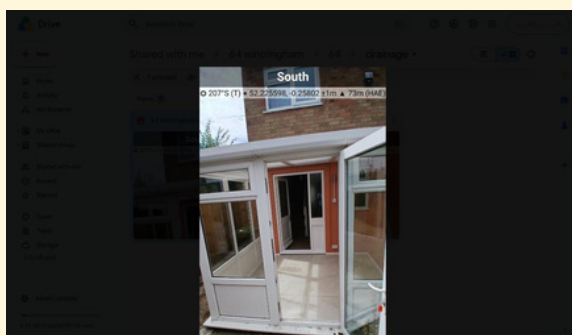


Fig. 33

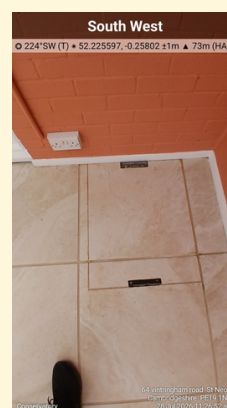


Fig. 34

F7 Common services

NI

REASON NOT INSPECTED

Not applicable - this is a self-contained semi-detached house with no shared or common services.

G Grounds (including shared areas for flats)

G1 Garage

NI

REASON NOT INSPECTED

No Garage Present

G2 Permanent outbuildings and other structures

2

DESCRIPTION

A brick-built storage outbuilding is located to the rear of the property, measuring approximately 2.91m x 2.06m externally. The outbuilding is fitted with a light fitting and internal storage units.

A crack was noted to the upper right-hand side of the rear wall. The crack may be associated with minor movement, localised masonry failure, thermal movement, or other causes.

DEFECTS

The defect should be monitored to establish whether there is any evidence of ongoing movement, such as widening, displacement, or associated cracking internally. If the cracking deteriorates or there are concerns regarding stability, further investigation by a suitable building professional or structural engineer is recommended. If the cracking deteriorates or there are concerns regarding stability, further investigation by a suitable building professional or structural engineer is recommended.



Fig. 35



Fig. 36



Fig. 37

G3 Other outdoor elements

NI

REASON NOT INSPECTED

No other significant outdoor elements.

G4 Trees

1

DESCRIPTION

Mature shrub at the front boundary; no significant trees within 10m of the property.



Fig. 38

G5 Boundaries, retaining walls, and fences

1

DESCRIPTION

Timber fencing installed to the side and rear boundaries, approximately 1.6m-1.8m high, with a rear gate providing access towards open fields/parkland. No significant defects identified during the visual inspection.

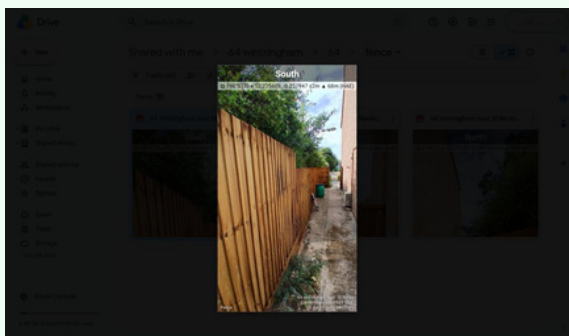


Fig. 39

G6 Driveways and paths

1

DESCRIPTION

Concrete-paved front path. Rear patio constructed with exposed aggregate concrete paving. Condition appeared generally satisfactory at the time of inspection, subject to normal wear and maintenance requirements.

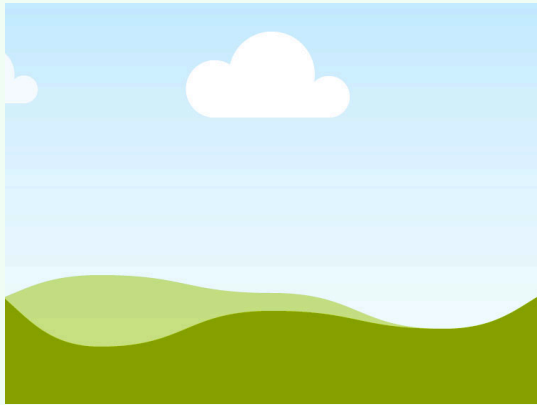


Fig. 40

G7 Other grounds features

NI

REASON NOT INSPECTED

No other grounds features.

G8 Common / Shared areas

NI

REASON NOT INSPECTED

No common or shared areas.

H Issues for Your Legal Advisers

REGULATION

The rear single-storey extension appears to have been added approximately 30 years ago; we recommend your legal advisers request copies of any Building Regulation completion certificates, planning consents or FENSA certificates for the replacement uPVC windows to the rear.

GUARANTEES

Please ask your legal advisers to confirm: (a) any boiler installation certificate and gas safety record, (b) any electrical installation guarantees, and any roof works guarantees that may have been issued at the time of the slate replacements.

OTHER MATTERS

Potential structural movement to the rear extension could affect the stability of the structure if progressive. Further investigation by a Structural Engineer is required before exchange of contracts to rule out ongoing risk.

I Risks

RISKS TO THE BUILDING

No indicators of ongoing subsidence, heave, or significant structural movement were observed within the principal structure at the time of the inspection.

A historic movement was noted to the rear extension DPC level. Although there was no clear evidence of active movement during the inspection, its long-term stability cannot be confirmed by a visual inspection alone. A suitably qualified structural engineer should confirm that the movement is historic and stable, particularly if there are concerns regarding previous movement or if alterations are proposed.

RISKS TO THE GROUNDS

No significant trees within influencing distance of the foundations. No invasive plant species (Japanese knotweed, giant hogweed) observed during the inspection.

RISKS TO PEOPLE

The consumer unit and electrical installation require inspection and testing by a suitably qualified electrician to confirm their condition, safety and compliance. An Electrical Installation Condition Report (EICR) is recommended (see Section F1).

No evidence of asbestos-containing materials (ACMs) was identified within the visible and readily accessible areas inspected. However, this was not an asbestos survey, and the presence of concealed ACMs cannot be ruled out. Appropriate precautions should therefore be taken before carrying out any intrusive works, alterations or demolition.

OTHER RISKS OR HAZARDS

No other risks identified.

J Surveyor's Declaration

DECLARATION

I confirm that I have personally inspected the property and prepared this RICS Home Survey – Level 2 Report. I am suitably qualified and experienced to undertake residential property inspections of this nature and hold appropriate Professional Indemnity Insurance in respect of the services provided.

This report has been prepared in accordance with the RICS Home Survey Standard and represents my independent professional opinion based on the condition of the property at the time of the inspection.

WAS AI USED IN THIS REPORT? No

AI USE
No AI tools were used in the preparation of this report.

Surveyor & signature

SURVEYOR SIGNATURE (NAME)

Sajan Varghese

PHONE NUMBER

07852332121

QUALIFICATIONS (OPTIONAL)
AssocRICS

SURVEYOR'S ADDRESS

Pinnacle House Business Centre
Newark Road

EMAIL

info@bretwaydesigns.com

DATE THIS REPORT WAS PRODUCED

30 July 2026

SIGNATURE



L – Description of the Home Survey – Level 2

The Service

The Home Survey – Level 2 is produced by a qualified surveyor who has the skills, knowledge and experience to survey and report on residential properties. The service includes a physical inspection of the property (a visual inspection of accessible areas without any invasive investigation) and a written report based on the findings.

The Inspection

The surveyor inspects the inside and outside of the main building and all permanent outbuildings, but does not force or open up the fabric. The inspection is carried out without moving heavy furniture, floor coverings, or the contents of cupboards. The surveyor does not remove secured panels or undo electrical fittings.

The surveyor also inspects the parts of the electricity, gas/oil, water, heating and drainage services that can be seen, but does not test them. The surveyor does not carry out specialist investigations.

Dangerous Materials, Contamination and Environmental Hazards

The surveyor will advise the client if they suspect, but cannot confirm, that asbestos or other potentially hazardous materials are present in the property. The Control of Asbestos Regulations 2012 place legal duties on the dutyholder of non-domestic premises and the common parts of multi-occupied residential buildings to manage asbestos. Suspected asbestos-containing materials should be inspected and tested by a qualified specialist before any work that might disturb them.

The surveyor does not make any enquiries about contamination or other environmental hazards. However, if the surveyor suspects a problem, a further investigation will be recommended. The property is not tested for radon; a radon test should be arranged if the property is located in a radon-affected area (information from UKradon.org).

The Condition Ratings

The condition of the property is assessed using a rating system from 1 to 3, plus NI (Not Inspected). The ratings are described in full at the beginning of this report. The rating reflects the condition at the date of inspection.

Issues for Your Legal Advisers

The surveyor does not act as a legal adviser. Where the surveyor identifies issues that your legal advisers may need to investigate further, these are noted in the Issues for Your Legal Advisers section of this report. You should ensure that your legal advisers investigate these matters before you commit to purchasing the property.

Risks

The surveyor identifies risks to the condition of the building, to the grounds, or to the safety of people using the property. These risks are noted in the Risks section of this report. If any serious risks are identified, you should take appropriate advice before exchange of contracts.

Standard Terms of Engagement

- 1.The service. The Home Survey – Level 2 service comprises a physical inspection of the property and a written report based on that inspection, prepared in accordance with the RICS Home Survey Standard (2021). The Surveyor will follow the Standard’s mandatory inspection requirements and report on the matters set out in this report.
- 2.The surveyor. The Surveyor undertaking the inspection and producing the report is qualified to carry out a Home Survey – Level 2 and is a member of the Royal Institution of Chartered Surveyors (RICS). The Surveyor will provide an objective, independent and impartial report.
- 3.Before the inspection. The Client should advise the Surveyor before the inspection of any specific concerns about the property and any documents (planning consents, building regulations approvals, guarantees, leases, service charge details, etc.) that may be relevant. The Surveyor relies on access being available to the property and to the parts that the inspection is to cover.
- 4.Payment. The fee for the service is agreed in writing before the inspection takes place. Payment is due in accordance with the engagement letter. The report will not be issued until payment has been received in cleared funds, unless otherwise agreed in writing.
- 5.Cancellation. Where the Client is a consumer for the purposes of the Consumer Contracts (Information, Cancellation and Additional Charges) Regulations 2013, the Client has a 14-day cancellation period from the date of the engagement letter during which the contract may be cancelled. If the Client expressly requests the inspection to take place within that 14-day period, the right to cancel may be lost once the service is fully performed. Nothing in these terms affects the Client’s statutory rights under the Consumer Rights Act 2015.
- 6.Liability. This report has been prepared by a surveyor (“the Surveyor”) solely for the use of the person named as the client in this report (“the Client”). The Surveyor owes no duty of care to any third party and any such party relies on this report at their own risk. The report is confidential to the Client and the Client’s professional advisers and should not be disclosed to any other party without the Surveyor’s written consent. The Surveyor’s liability is limited to the extent set out in the engagement letter.

Complaints Handling Procedure

The Surveyor operates a complaints handling procedure, a copy of which is available on request. If the Client is not satisfied with any aspect of the service, a complaint should be made in writing to the Surveyor in the first instance. If the complaint is not resolved to the Client’s satisfaction, it may be referred to the RICS Dispute Resolution Service.

M – Typical House Diagram

This diagram shows the standard part labels used throughout this report. Your property may not have every element shown — the actual elements present are detailed in sections D–G.



Illustration is schematic — it shows where labels apply in principle, not the specific construction of your property. Internal elements such as ceilings (E2), floors (E4), fireplaces (E5) and bathroom fittings (E8) are not shown.

Photographic Record

A – About the Inspection and Report

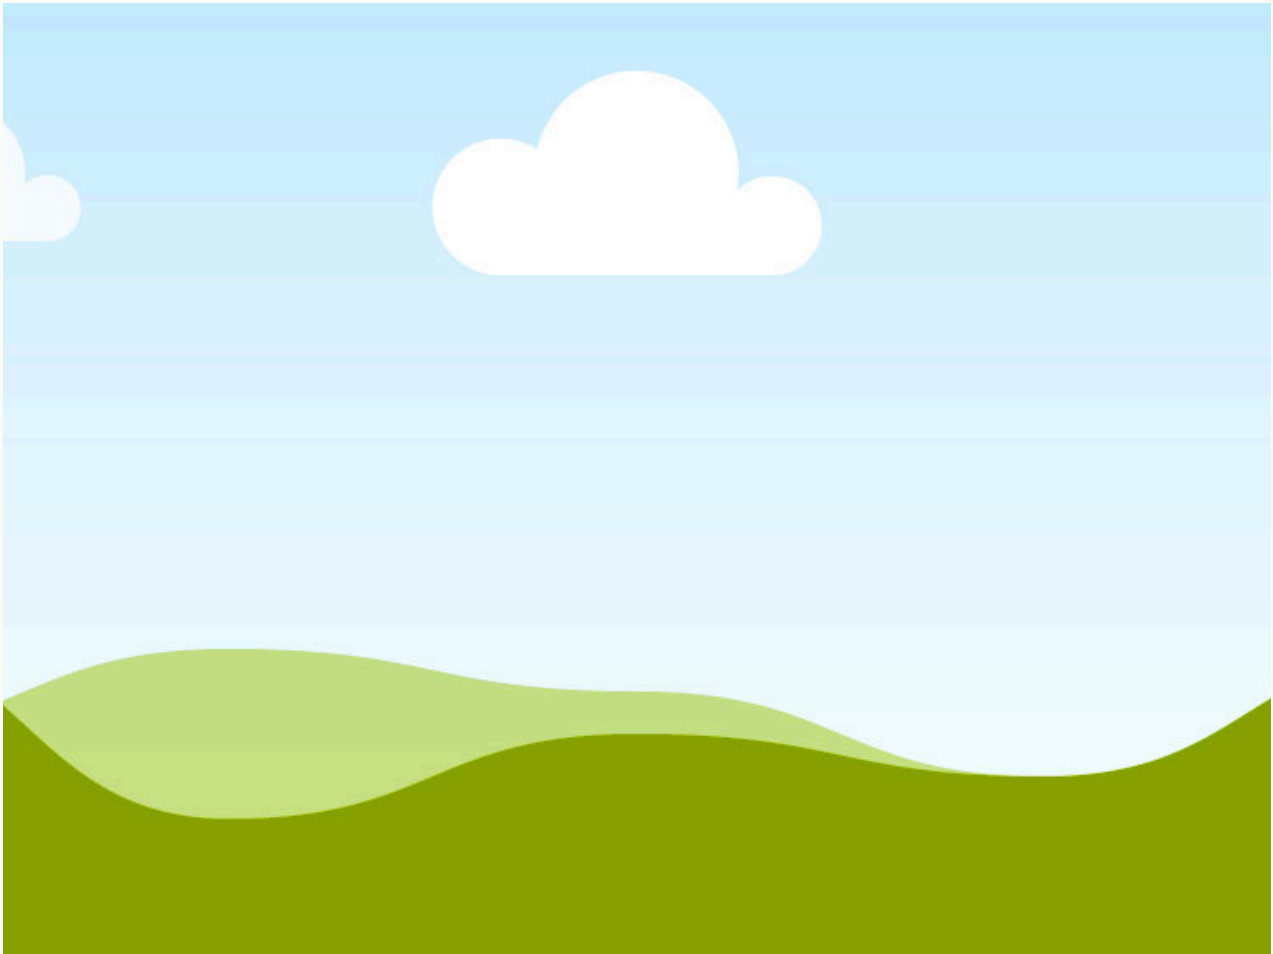


Fig. 1

C – About the Property

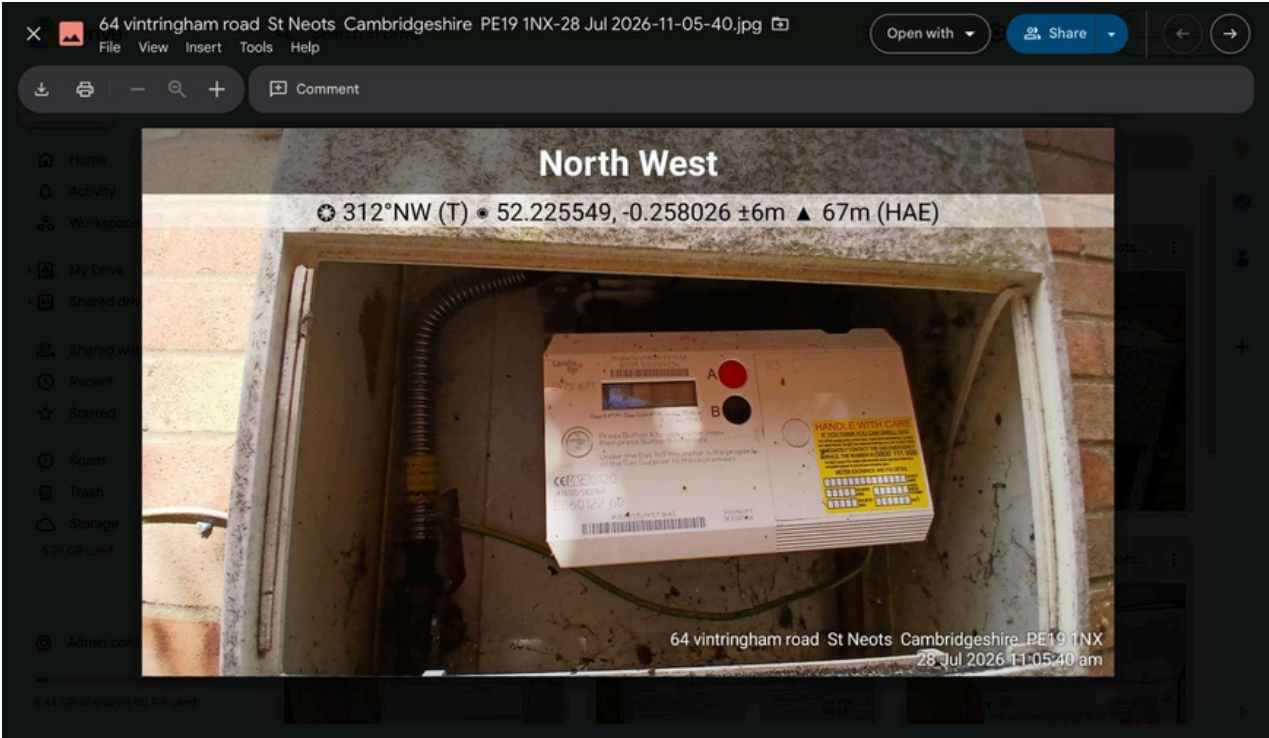


Fig. 2

Score	Energy rating	Current	Potential
92+	A		
81-91	B		86 B
69-80	C	73 C	
55-68	D		
39-54	E		
21-38	F		
1-20	G		

Fig. 3

D2 – Roof coverings

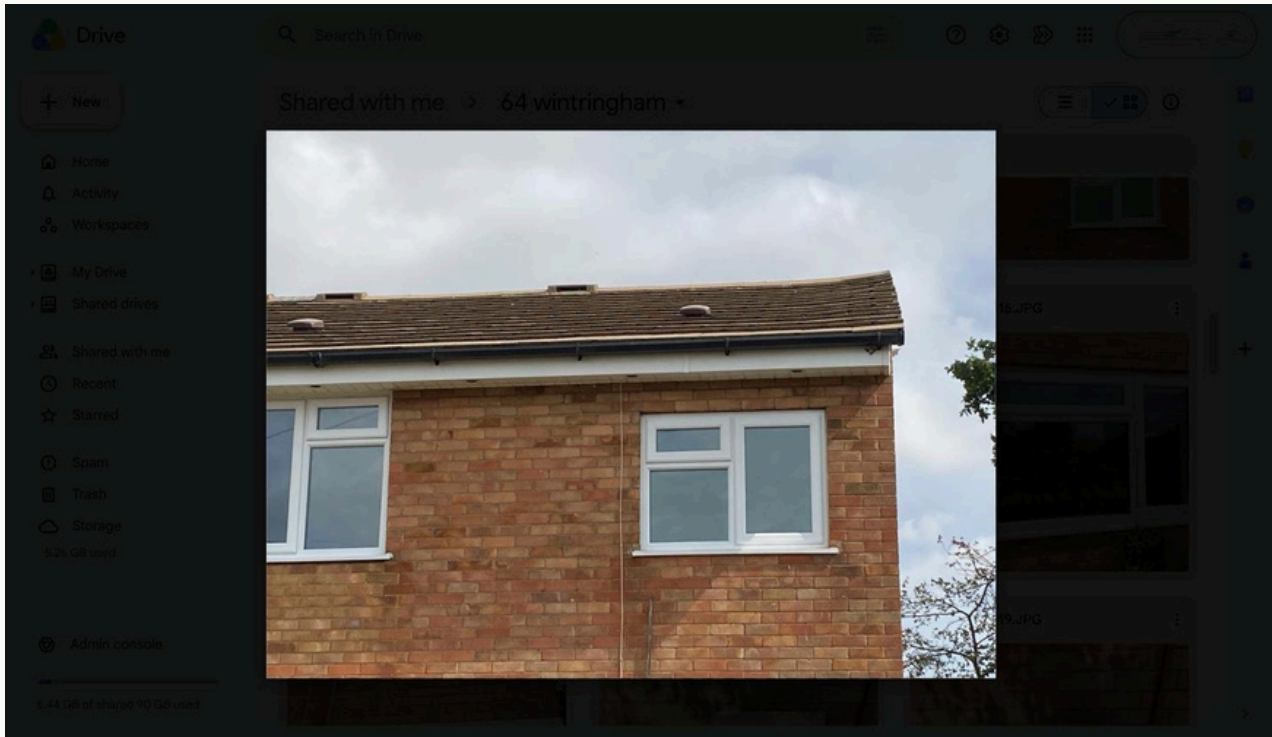


Fig. 4



Fig. 5

D3 – Rainwater pipes and gutters

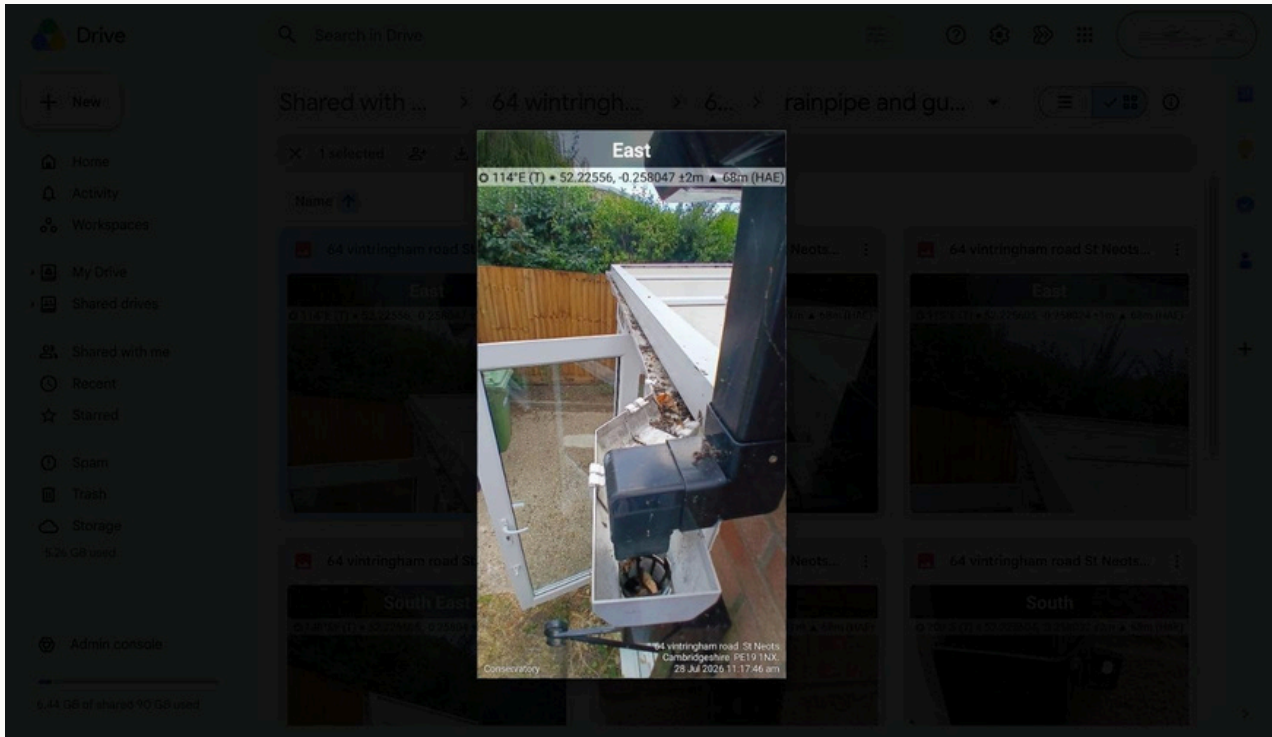


Fig. 6



Fig. 7

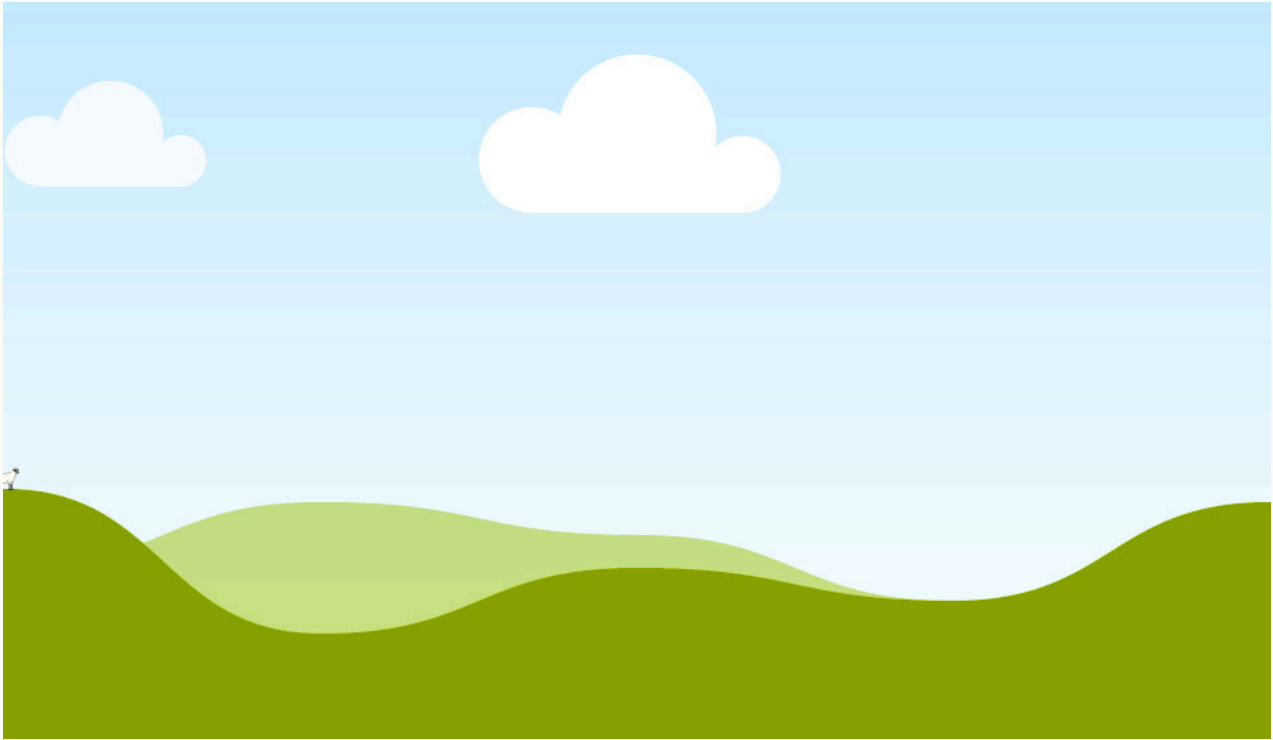


Fig. 8

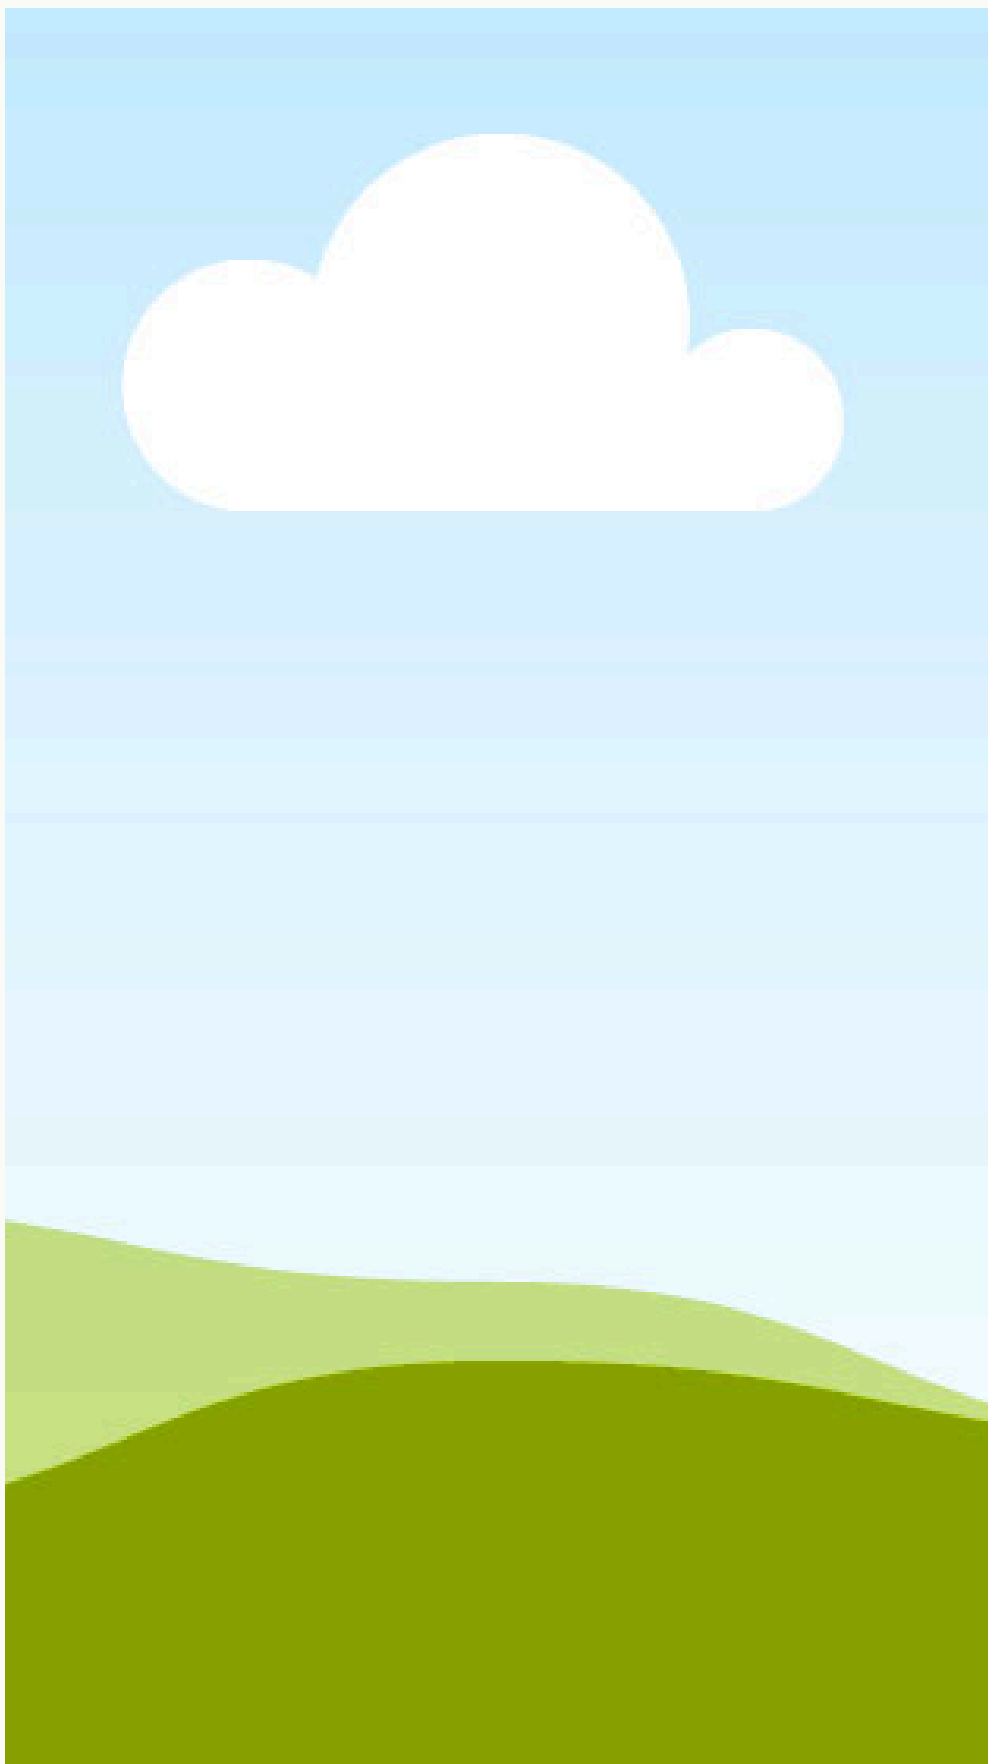


Fig. 9

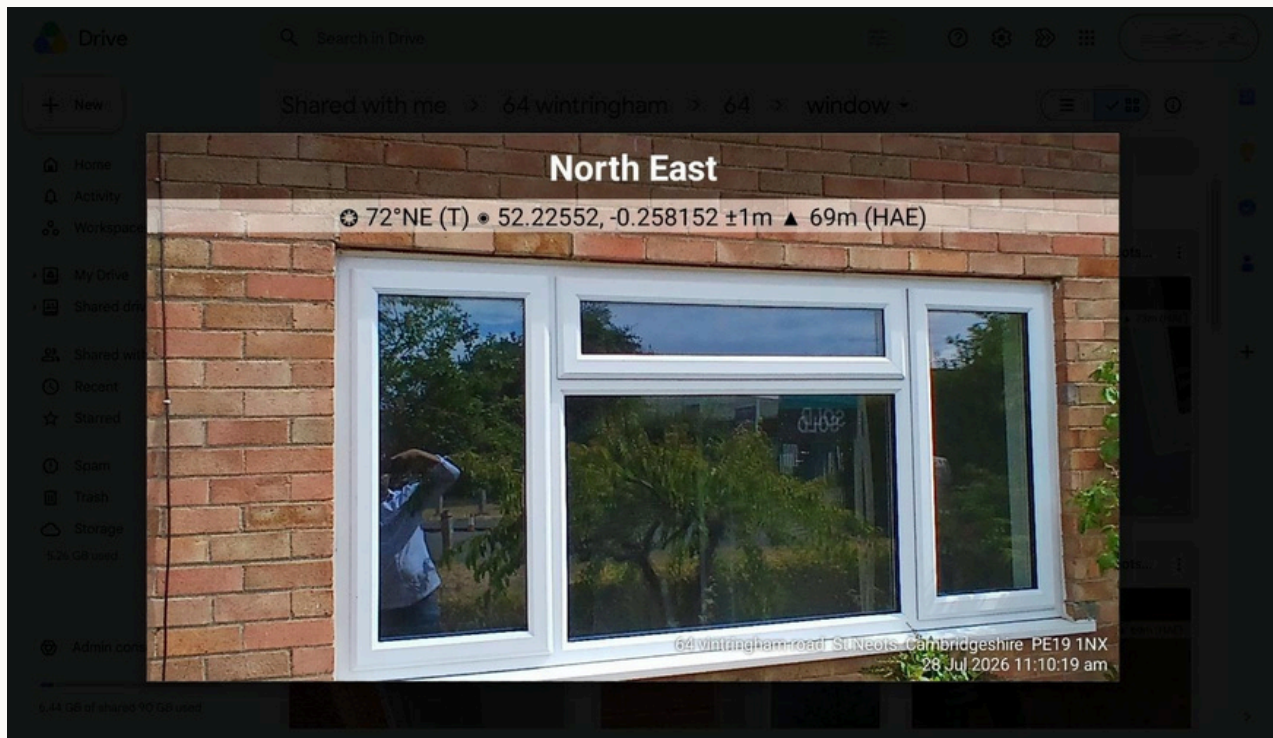


Fig. 10



Fig. 11

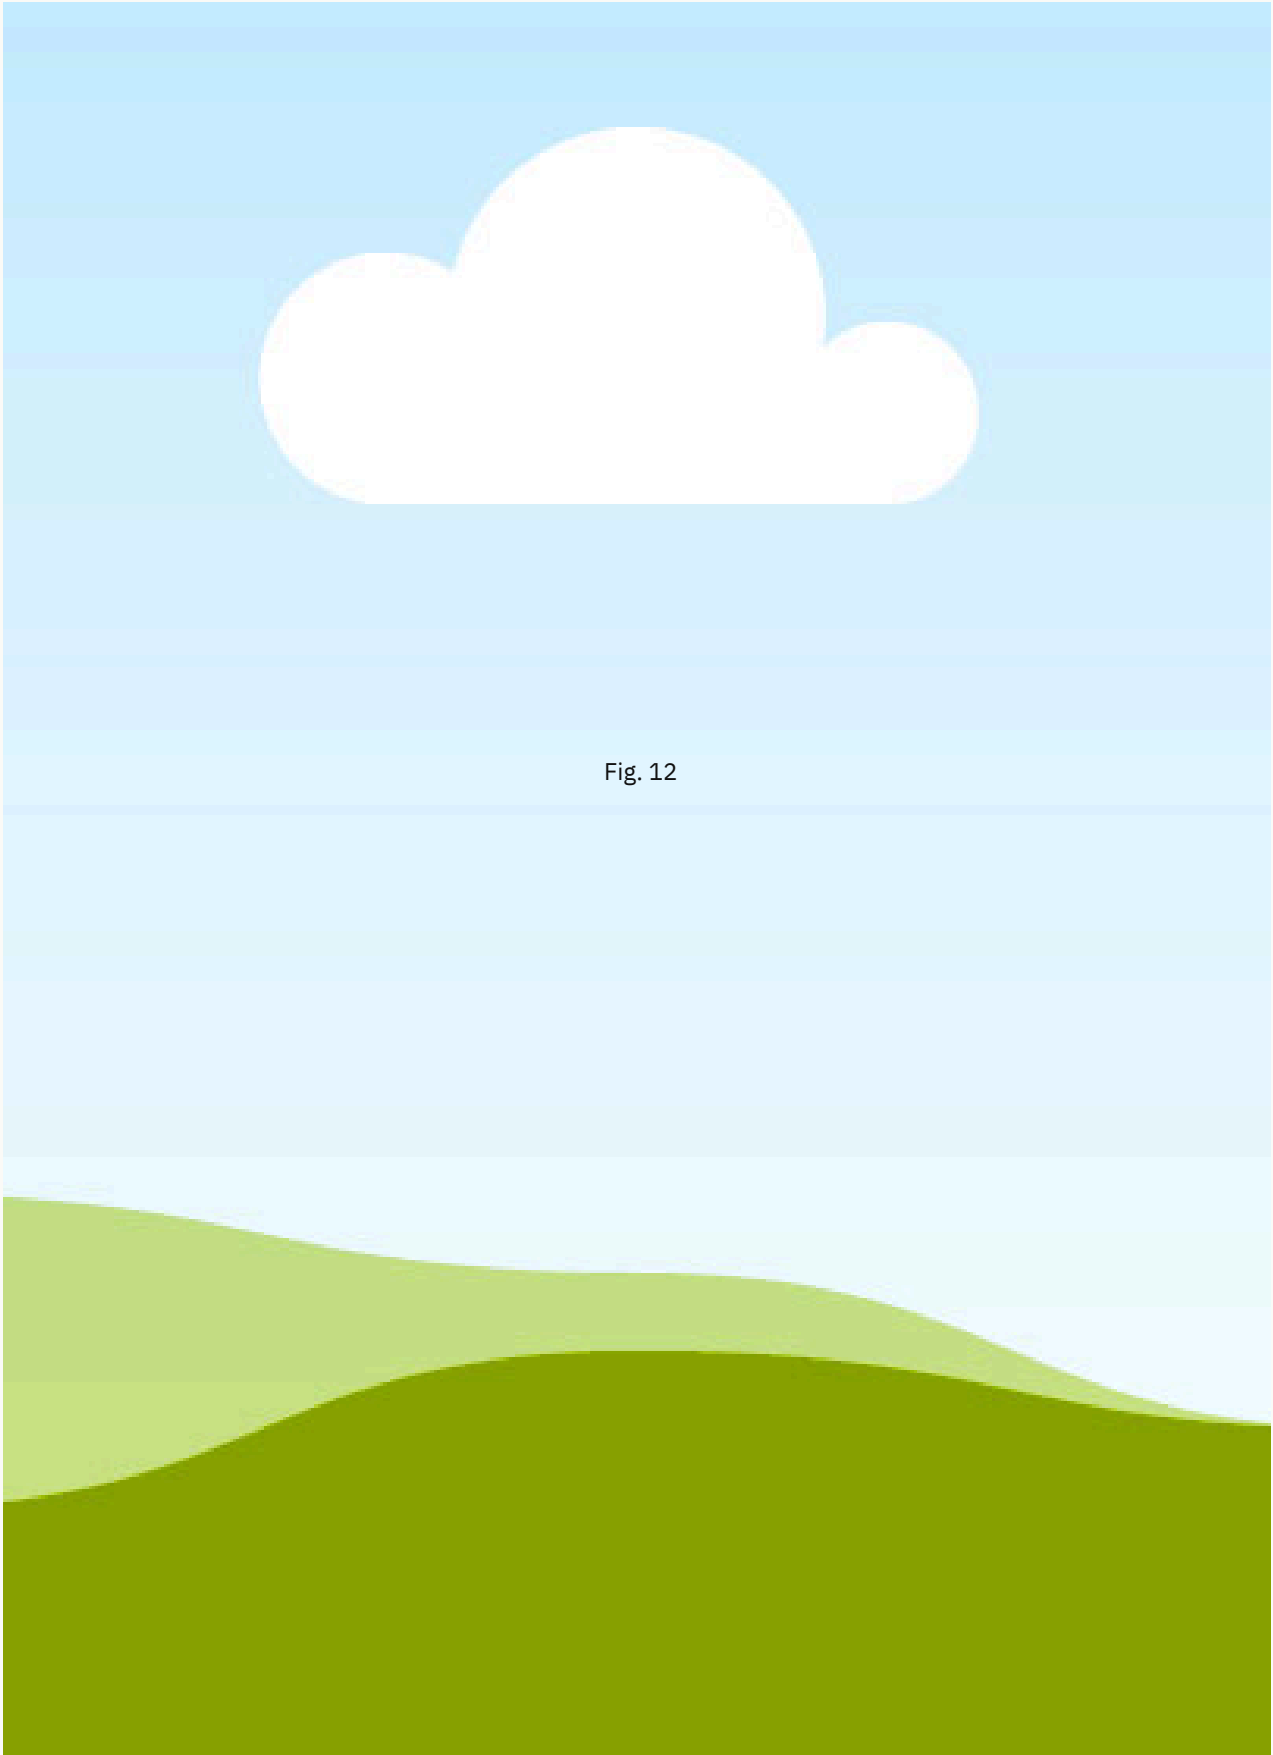


Fig. 12

Fig. 13

D7 – Conservatory and porches

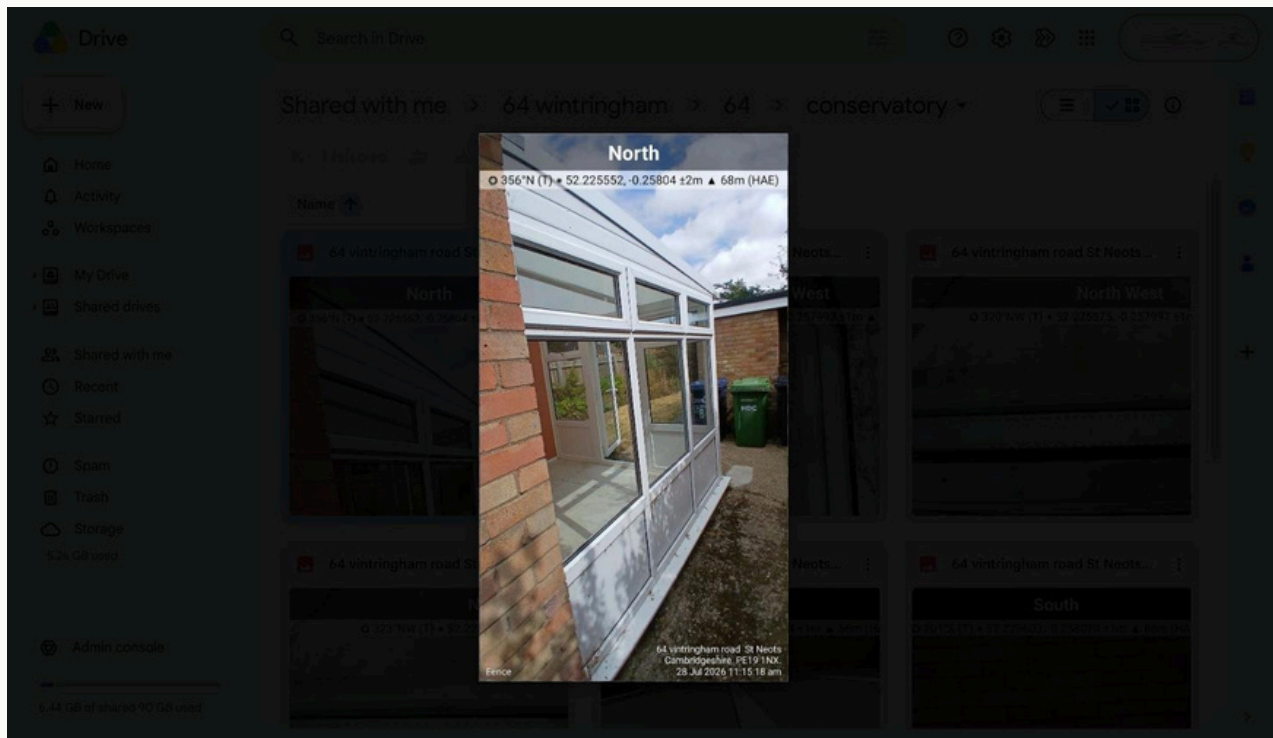


Fig. 14

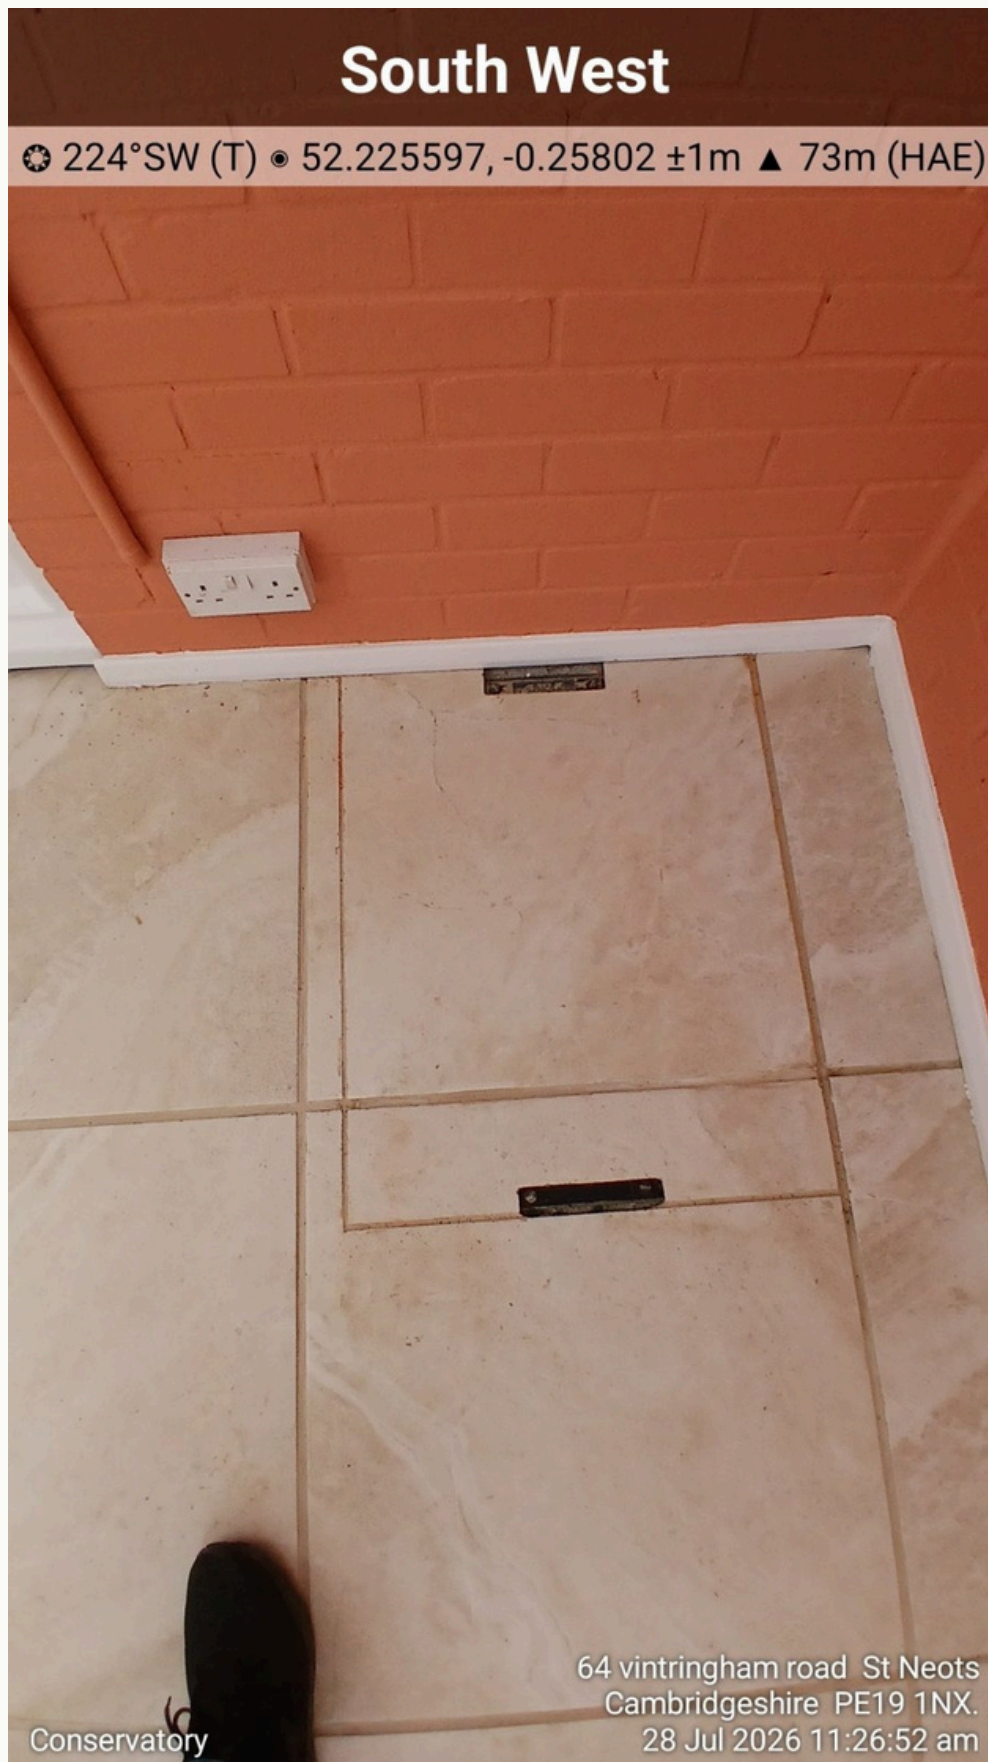


Fig. 15



Fig. 16



Fig. 17

E1 – Roof structure

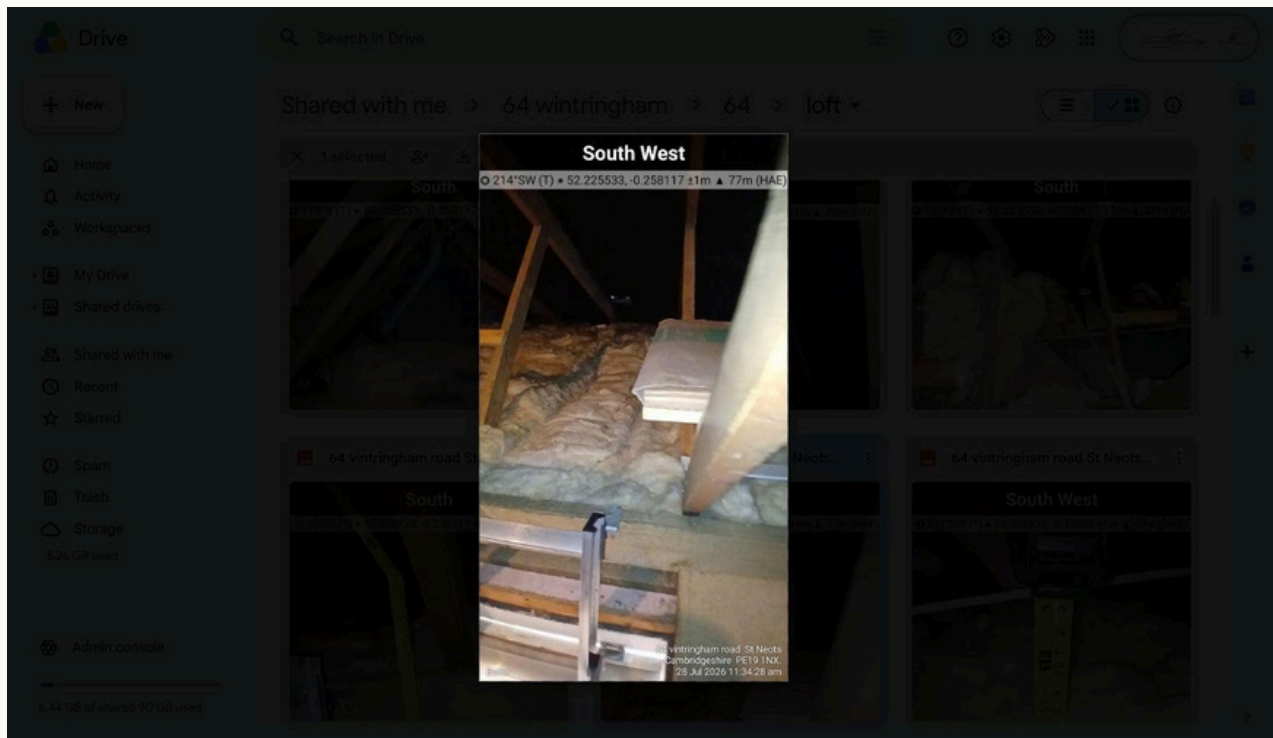


Fig. 18

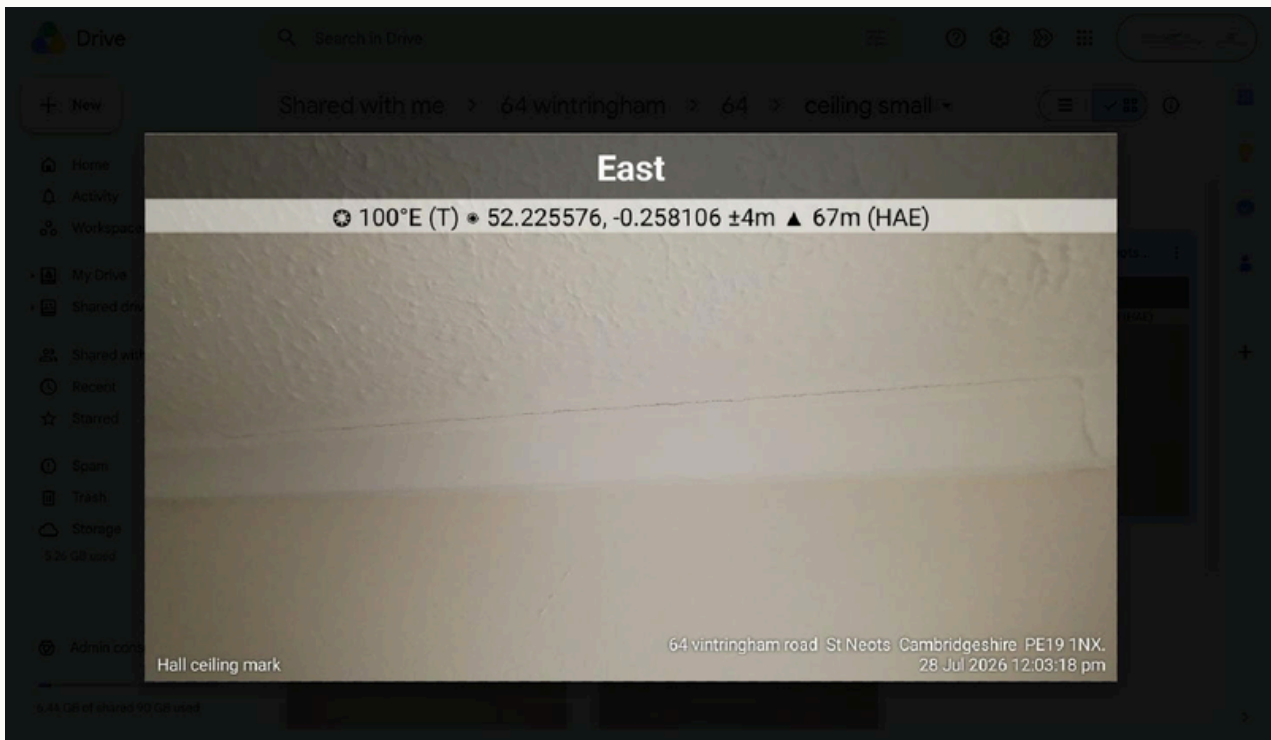


Fig. 19



Fig. 20



Fig. 21



Fig. 22



Fig. 23



Fig. 24



Fig. 25



Fig. 26



Fig. 27



Fig. 28



Fig. 29

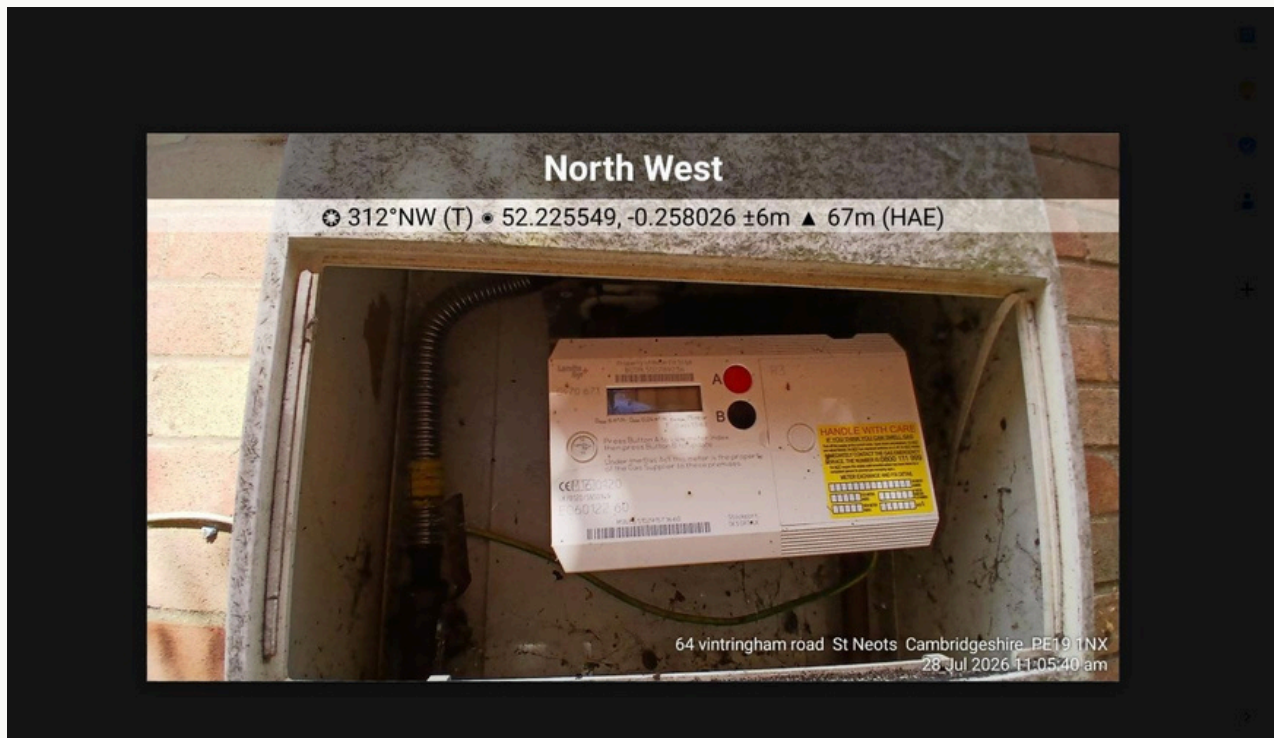


Fig. 30

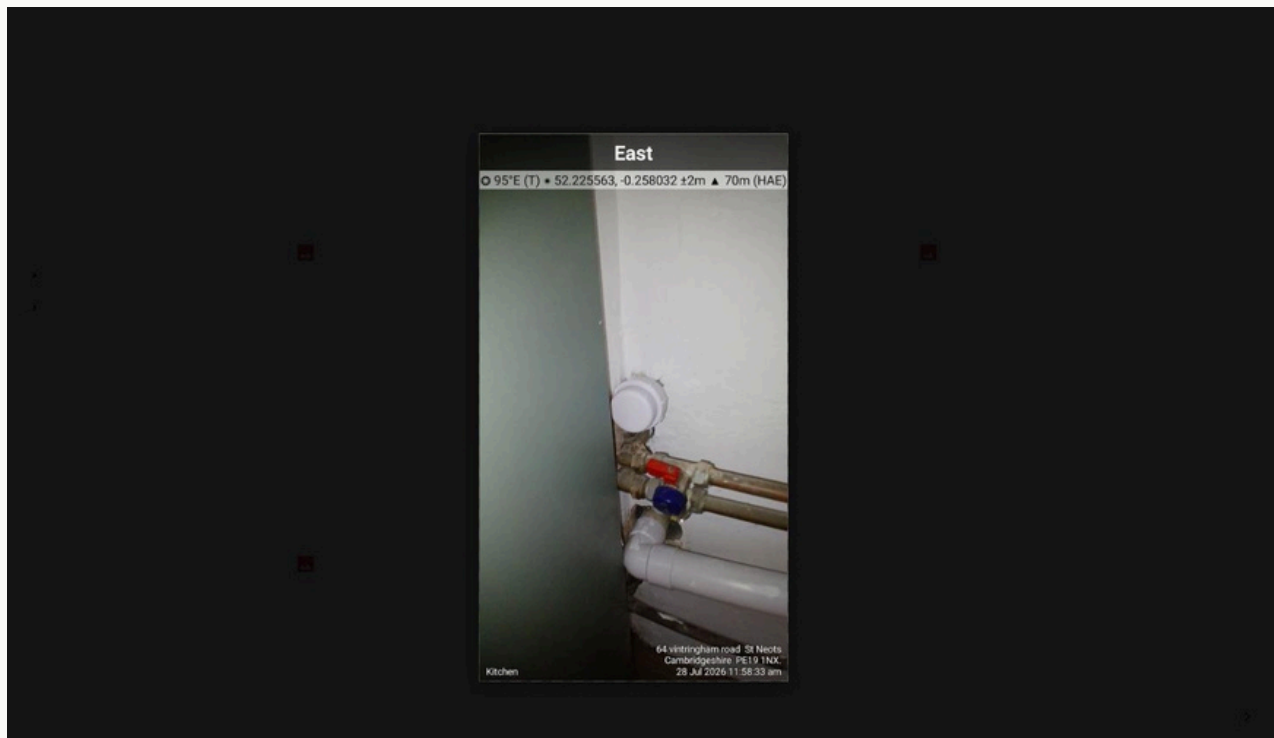


Fig. 31

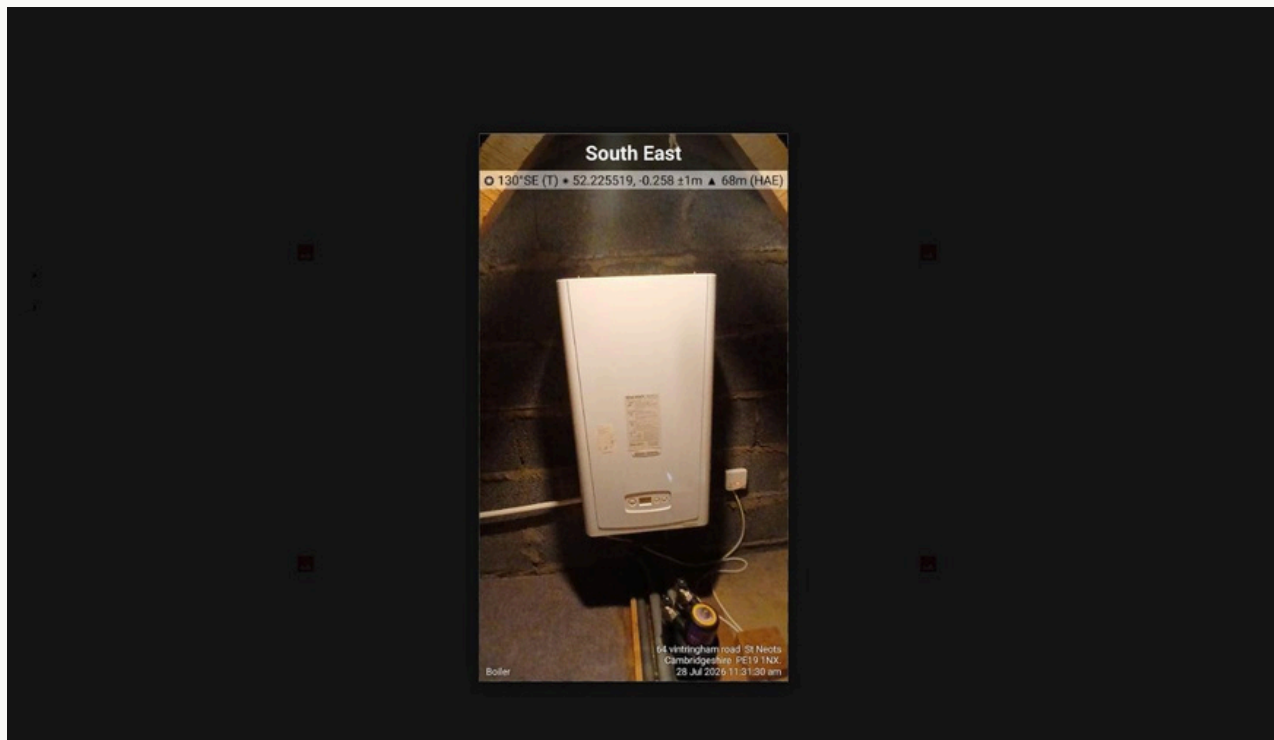


Fig. 32

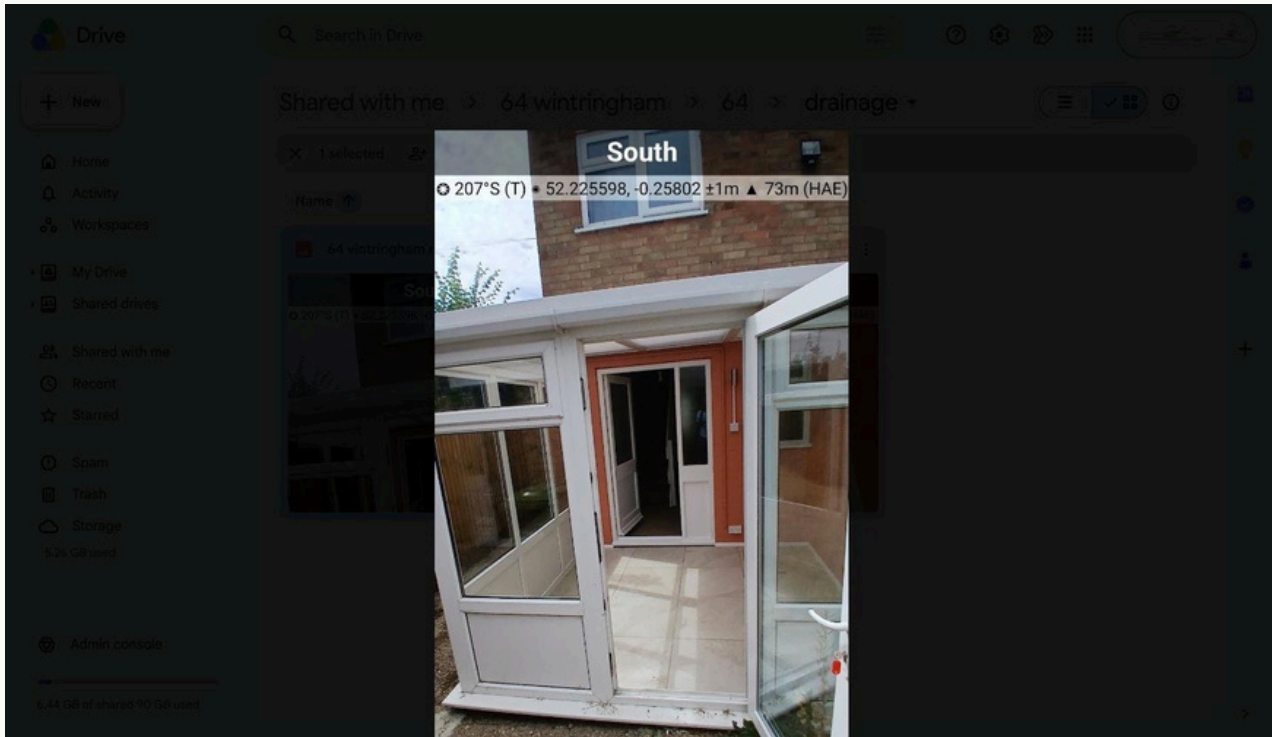


Fig. 33

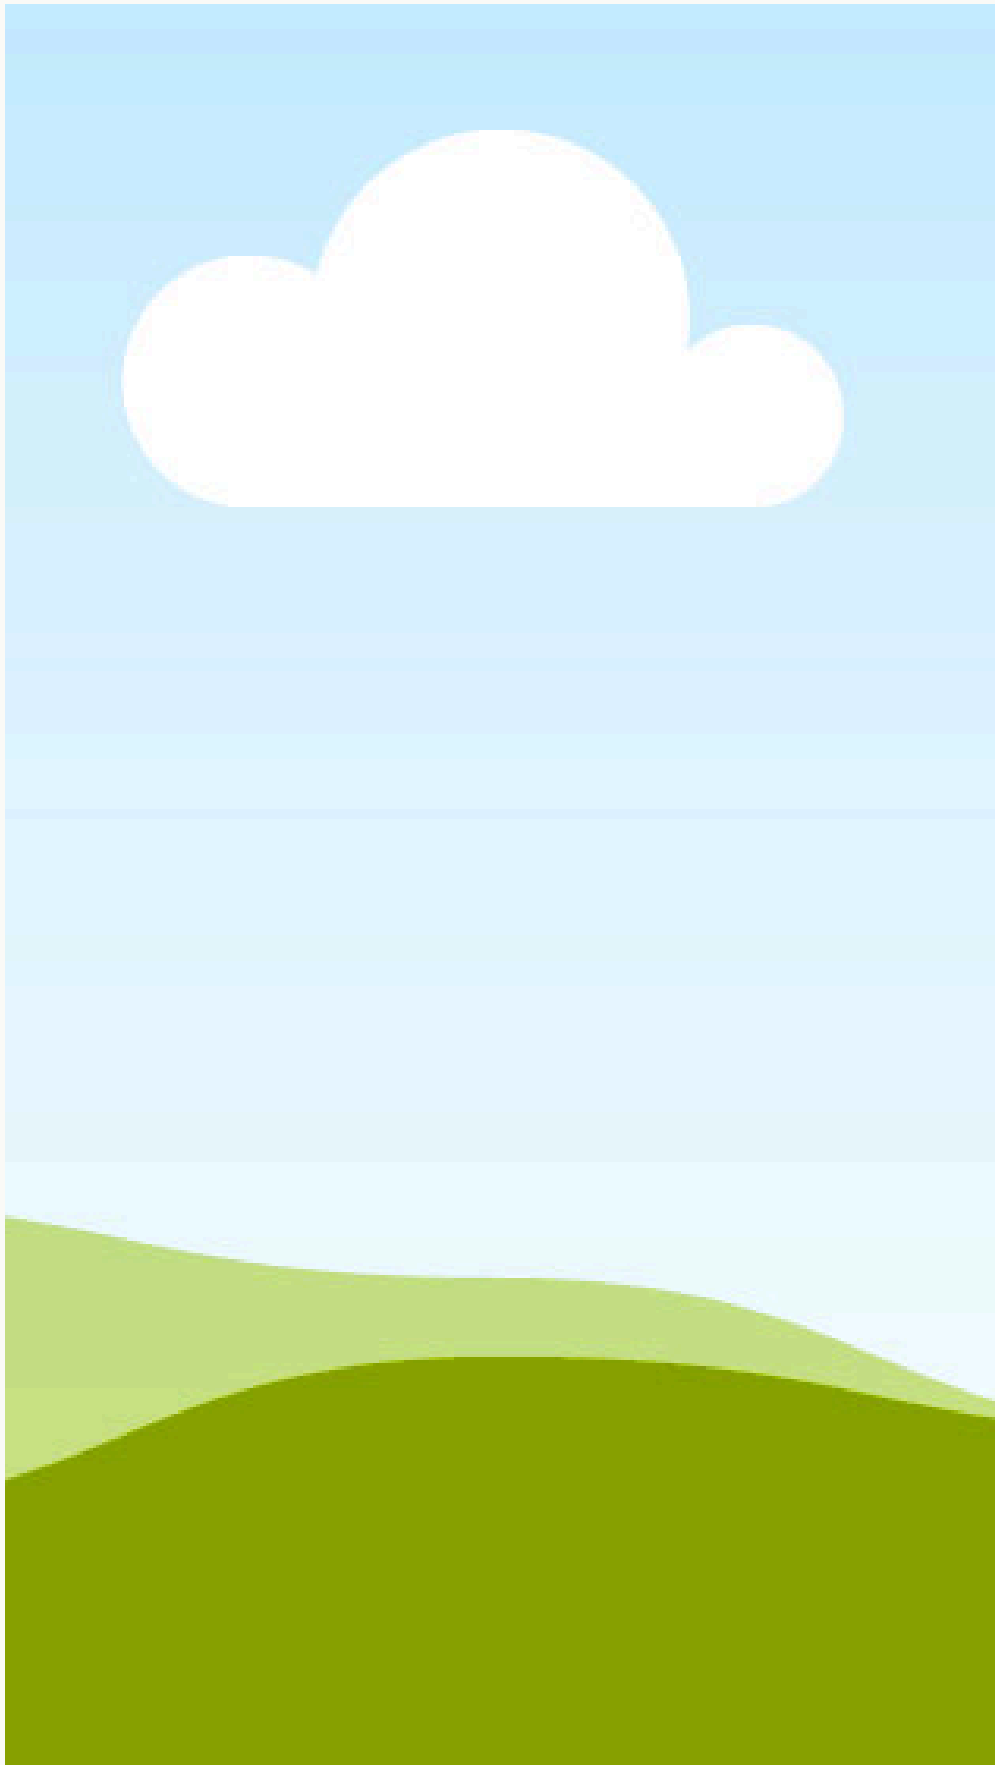


Fig. 34



Fig. 35



Fig. 36

South

☼ 205°S (T) ● 52.225625, -0.257965 ±1m ▲ 68m (HAE)



Garage

64 vintringham road St Neots
Cambridgeshire PE19 1NX.
28 Jul 2026 11:24:51 am

Fig. 37



Fig. 38

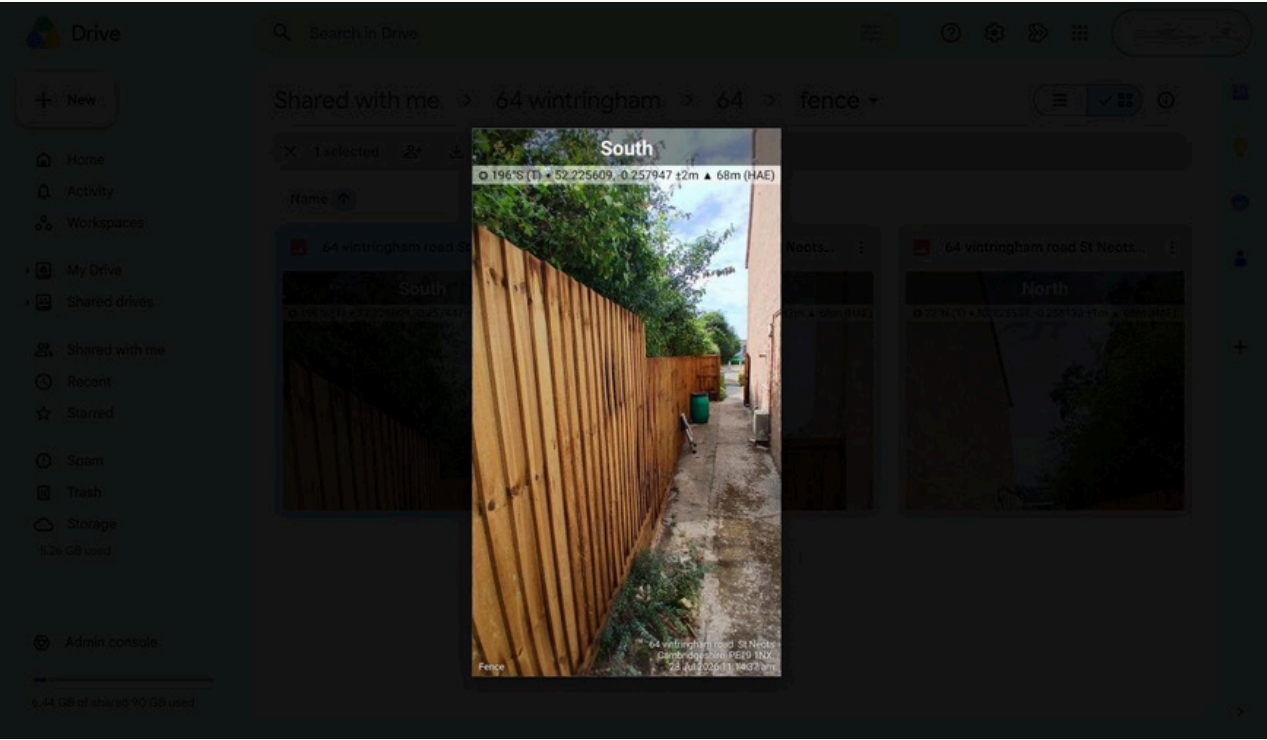


Fig. 39



Fig. 40