Home Survey – Level 3

REFERENCE
0103

Contents

A About the Inspection

B Overall Opinion

C About the Property

D Outside the Property

E Inside the Property

F Services

G Grounds (including shared areas for flats)

H Issues for Your Legal Advisers

I Risks

K Surveyor's Declaration

M Description of the Home Survey – Level 3

N Typical house diagram

O Photographic Record

Condition Ratings

To help describe the condition of the property, we give condition ratings to the main parts (the 'elements') of the building, garage and some parts outside. Some elements can be made up of several different parts. In the element boxes, we describe the part that has the worst condition rating first and then briefly outline the condition of the other parts.

1

Condition Rating 1

No repair is currently needed. The property must be maintained in the normal way.

2

Condition Rating 2

Defects that need repairing or replacing but are not considered to be either serious or urgent. The property must be maintained in the normal way.

3

Condition Rating 3

Defects that are serious and/or need to be repaired, replaced or investigated urgently. Failure to do so could risk serious safety issues or severe long-term damage to your property. Written quotations for repairs should be obtained prior to legal commitment to purchase.

NI

Not Inspected

The element was not inspected and the reason is given in the report. This may be because access was restricted or the element was not present at the property.

About This Report

This Home Survey has been produced by a surveyor who has written this report for you to use. If you decide not to act on the advice in this report, you do this at your own risk.

This Home Survey aims to help you:

- Make a reasoned and informed decision on whether to go ahead with buying the property
- Take account of any repairs or replacements the property needs
- Consider what further advice you should take before committing to purchase the property

Approach to the Inspection

We carry out only a visual inspection. This means that we do not take up carpets, floor coverings or floorboards, move furniture or remove the contents of cupboards. We do not remove secured panels or undo electrical fittings.

We inspect the inside and outside of the main building and all permanent outbuildings, but we do not force or open up the fabric. We also inspect the parts of the electricity, gas/oil, water, heating and drainage services that can be seen, but we do not test them.

We note in our report if we are not able to check any parts of the property that the inspection would normally cover. If we are concerned about these parts, the report will tell you about any further investigations that are needed.

A About the Inspection

SURVEYOR NAME

RICS NUMBER

COMPANY NAME

CLIENT'S NAME

DATE OF INSPECTION

TIME OF INSPECTION (OPTIONAL)

TENURE

NUMBER OF STOREYS

REPORT REFERENCE NUMBER (OPTIONAL)

RELATED PARTY DISCLOSURE

PROPERTY ADDRESS

WEATHER CONDITIONS (OPTIONAL)

PRECEDING WEATHER / GROUND CONDITIONS (OPTIONAL)

STATUS OF PROPERTY WHEN INSPECTED (OPTIONAL)

Occupied and furnished

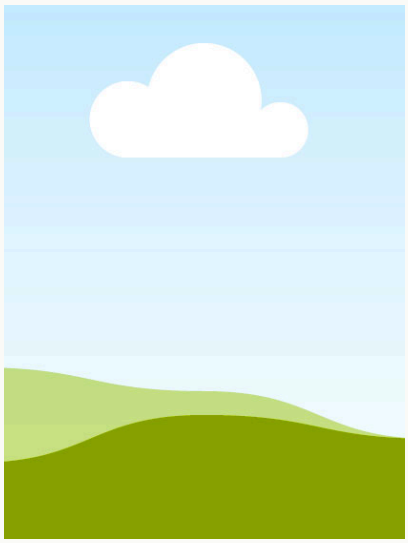

Fig. 1

B Overall Opinion

Important note: To get a balanced impression of the property, we strongly recommend that you read all sections of the report, in particular the further-investigations and recommendations section at the end, and discuss this with us if required.

This inspection identified **0** items requiring **urgent attention**, **11** items that **need attention but are not serious**, and **17** elements with **no current issues**. See the summary below and the body of this report for full detail.

R

Documents to request

Documents we may suggest you request from the seller before signing contracts. Check these documents are supplied by your solicitor.

REF	ELEMENT	DOCUMENT
E7	Woodwork (for example, staircase joinery)	Document to be confirmed

Condition Rating Summary

2

Elements that require attention but are not serious or urgent

These elements have defects that need repairing or replacing but are not considered to be either serious or urgent.

REF	ELEMENT	SECTION
D2	Roof coverings	Outside the Property
D3	Rainwater pipes and gutters	Outside the Property
D4	Main walls	Outside the Property
D8	Other joinery and finishes	Outside the Property
D9	Other	Outside the Property
E1	Roof structure	Inside the Property
E8	Bathroom fittings	Inside the Property
F1	Electricity	Services
G2	Permanent outbuildings and other structures	Grounds

G4	Trees	Grounds
G7	Other grounds features	Grounds

1 Elements with no current issues

No repair is currently needed. The elements listed here must be maintained in the normal way.

REF	ELEMENT	SECTION
D5	Windows	Outside the Property
D6	Outside doors (including patio doors)	Outside the Property
D7	Conservatory and porches	Outside the Property
E2	Ceilings	Inside the Property
E3	Walls and partitions	Inside the Property
E4	Floors	Inside the Property
E6	Built-in fittings	Inside the Property
E7	Woodwork (for example, staircase joinery)	Inside the Property
F2	Gas/Oil	Services
F3	Water	Services
F4	Heating	Services
F5	Water heating	Services
F6	Drainage	Services
F7	Common services	Services
G5	Boundaries, retaining walls, and fences	Grounds
G6	Driveways and paths	Grounds
G8	Common / Shared areas	Grounds

NI Elements not inspected

We carry out a visual inspection, so a number of elements may not have been inspected.

REF	ELEMENT	SECTION
D1	Chimney stacks	Outside the Property

E5	Fireplaces, chimney breasts and flues	Inside the Property
G1	Garage	Grounds
G3	Other outdoor elements	Grounds

C About the Property

TYPE OF PROPERTY	End-terrace house
APPROXIMATE YEAR BUILT	1998
YEAR EXTENDED (IF APPLICABLE)	N/A
YEAR CONVERTED (IF APPLICABLE)	N/A
INFORMATION RELEVANT TO FLATS AND MAISONET TES	N/A

CONSTRUCTION

ACCOMMODATION

MEANS OF ESCAPE

EPC RATING (IF KNOWN)

ENERGY EFFICIENCY ISSUES

MAINS SERVICES

CENTRAL HEATING	Panel radiators are present throughout (double panel in the open kitchen/diner, double panelled radiators are ground floor lounge, first floor bedrooms and bathroom). The boiler/heating source was not identified or accessed during the inspection.
OTHER SERVICES / ENERGY SOURCES	No solar PV, no battery storage, no LPG.
OTHER ENERGY MATTERS (OPTIONAL)	Loft insulation appears to be approximately 100mm mineral wool. Need to top up the insulation over all 270mm in line with current Part L recommendations
GROUNDS	The rear and right-side garden is enclosed by 1.8 m high painted closed-board timber fencing. The left-side boundary is formed by timber fencing approximately 1.8 m high. A timber-built shed with a flat felt roof, measuring approximately 3.3 x 1.4m, 2.1 m high, is located to the rear right side of the rear garden. A timber door for rear access from the front is provided on the left side, with the rear garden areas predominantly finished in concrete paving and grass.
LOCATION	The subject property is an end terrace house located at 107 Capsey Road, Ilfield, Crawley, RH11 0UF. The property sits on Capsey Road, Ilfield, Crawley, with driveway and additional parking in front of the building
FACILITIES	With driveways and additional parking in front of the building
LOCAL ENVIRONMENT	Quiet residential street with a driveway for 2 cars and on-street parking. The inspection identified no notable environmental concerns.
OTHER LOCAL FACTORS	N/A

Fig. 2

Fig. 3

Fig. 4

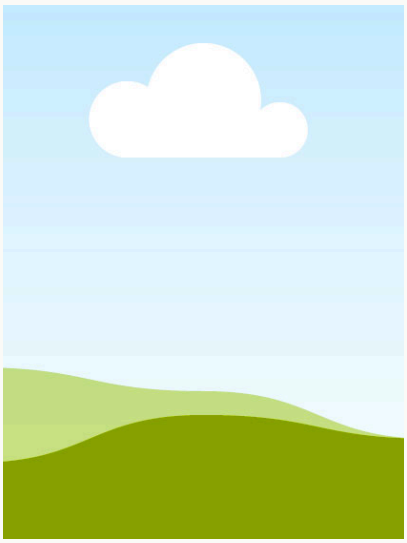

Fig. 5

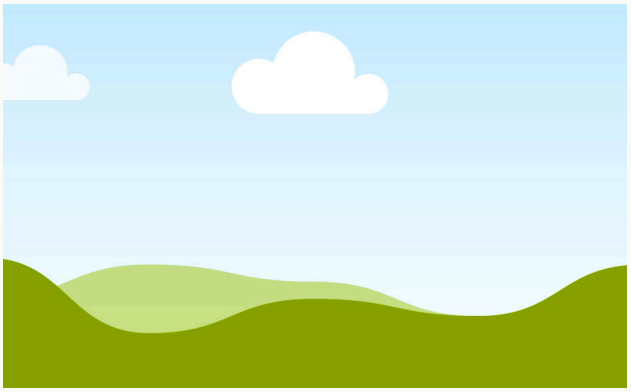

Fig. 6

D Outside the Property

Concrete roof tiles were installed on the main pitched roof, with UPVC guttering. The roof was visually inspected from ground level and from close-up photos only. No significant defects were identified during the visual inspection.

LIMITATIONS ON THE INSPECTION

There is loose/broken flash between the rear and front neighbour's side roof that needs to be fixed to the brick joint

D1 Chimney stacks

NI

REASON NOT INSPECTED No chimney stack present

D2 Roof coverings

2

DESCRIPTION Concrete roof tiles were installed on the main pitched roof, with UPVC guttering. The roof was visually inspected from ground level and from close-up photos only. No significant defects were identified during the visual inspection.

DEFECTS There is loose/broken flashing that needs to be fixed to the brick joint on the neighbour's side

PROBABLE CAUSE There is loose/broken flashing that needs to be fixed to the brick joint on the neighbour's side

Fig. 7

Fig. 8

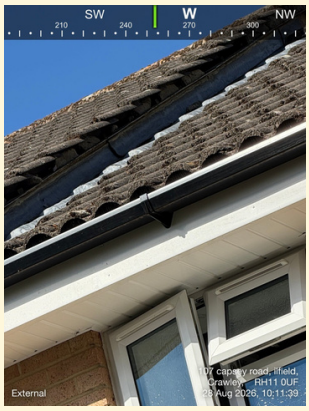

Fig. 9

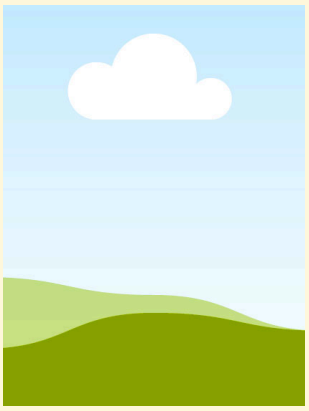

Fig. 10

D3 Rainwater pipes and gutters

2

DESCRIPTION

DEFECTS

PROBABLE CAUSE

RECOMMENDATIONS

Fig. 11

Fig. 12

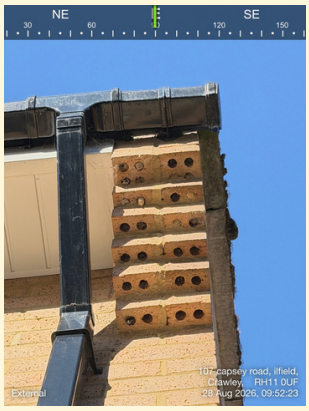

Fig. 13

D4 Main walls

2

DESCRIPTION

DEFECTS

PROBABLE CAUSE

Based on your readings, Elevated moisture meter readings were recorded in sections of the external wall, particularly around the kitchen elevation area. The readings may be associated with localised rainwater penetration, defective pointing/rainwater goods, or other sources of moisture ingress.

RECOMMENDATIONS

Further investigation is recommended, including monitoring moisture levels under dry weather conditions and inspecting the external wall and rainwater goods.

Fig. 14

Fig. 15

Fig. 16

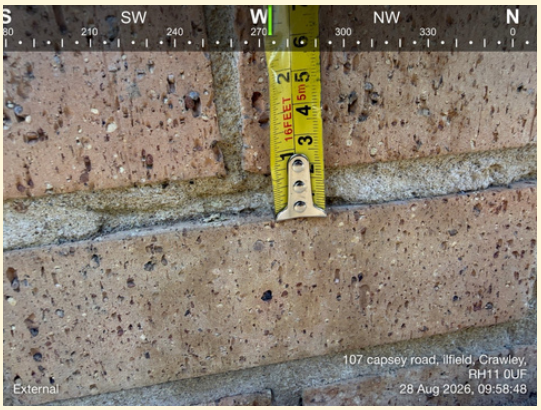

Fig. 17

Fig. 18

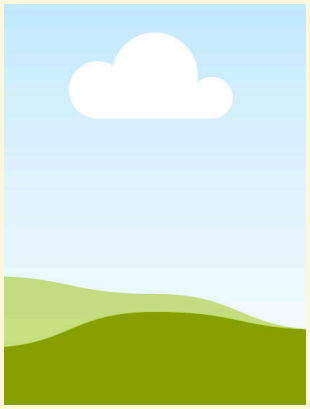

Fig. 19

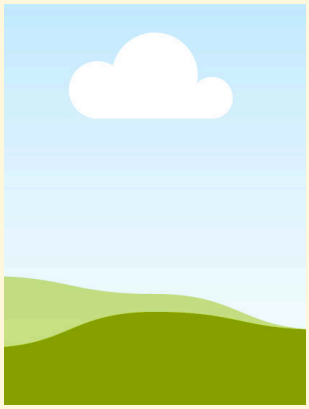

Fig. 20

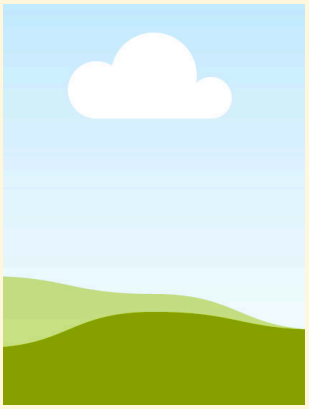

Fig. 21

D5 Windows

1

DESCRIPTION

Double-glazed uPVC windows with trickle vents are installed throughout the property. No significant defects or condensation were identified during the visual inspection. Windows: double-glazed, 2018, Saint-Gobain 2018. Remote-controlled steel shutter fitted on window opening.

Fig. 22

Fig. 23

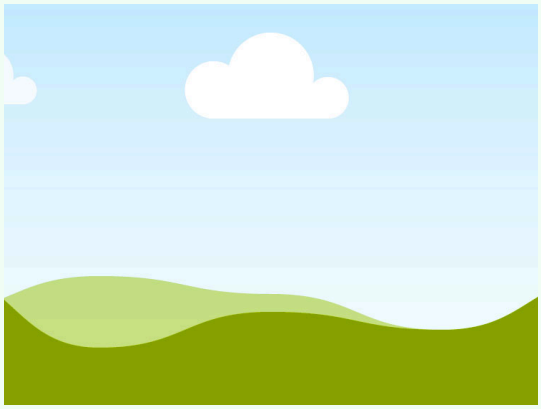

Fig. 24

D6 Outside doors (including patio doors)

1

DESCRIPTION

Remote-controlled steel shutter door fitted to the rear patio door opening. Patio door, 2018, double-glazed, with a trickle vent at the rear.

Fig. 25

Fig. 26

D7 Conservatory and porches

1

DESCRIPTION

The porch at the main front entrance is in good visual condition. No conservatory is present at the property

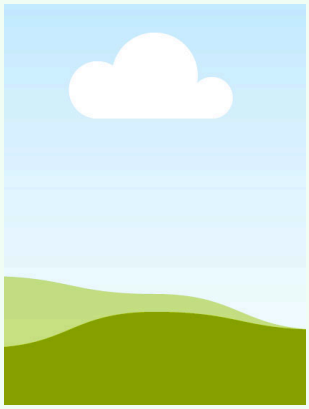

Fig. 27

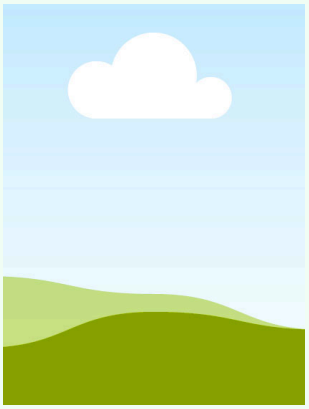

Fig. 28

D8 Other joinery and finishes

2

DESCRIPTION

The rear garden is enclosed by approximately 1.8m-high timber fencing, with the left-hand boundary also formed by timber fencing of similar height.
A timber-built shed, approximately 3.3m × 1.4m × 2.1m high, with a flat felt-covered roof, is located to the rear right-hand side of the garden.
The rear garden is predominantly finished with concrete paving and areas of grass. The paving was reportedly installed approximately 8 years ago and appeared generally serviceable at the time of inspection. A strip of slate chippings, approximately 600mm wide, extends along the right-hand side between the rear external wall and the trees. The landscaping is generally well maintained and in good condition.
A timber rear access gate/door, providing access from the front of the property, is located along the left-hand side wide 925mm.
Dish/Antenna fitted on the rear wall and connected.
The rear patio is set approximately 20–30mm above the surrounding ground level, with gaps of approximately 25mm between the paving tiles noted adjacent to the timber garden shed and boundary wall. No significant evidence of recent ground movement or subsidence was apparent during the inspection.

DEFECTS

The timber garden shed is in average overall condition, with some weakening/deterioration noted to the timber

elements and the roof covering. Routine maintenance and localised repairs or replacement should be considered as necessary.
The site search report indicates that the land/property is not identified as being at risk from relevant ground or environmental hazards. This is consistent with the absence of obvious signs of recent ground movement noted during the inspection.

PROBABLE CAUSE

Prolonged exposure to weather and moisture, together with general ageing and deterioration of the timber and roof covering, has resulted in localised weakening of the shed structure and roof materials.

The inspection identified no obvious signs of recent or significant ground movement, and the site search report does not identify the property as being at significant risk from relevant ground or environmental hazards.

RECOMMENDATIONS

The timber garden shed is in average overall condition, with some deterioration/weakening of the timber elements and deterioration of the roof covering. Consider repairing or replacing the affected timber and roof covering as part of routine maintenance.

No specific remedial action is currently considered necessary. The property should, however, be monitored as part of routine maintenance for any future signs of ground movement, such as new or progressive cracking, distortion or changes to doors and windows. Any significant changes should be investigated by a suitably qualified structural engineer.

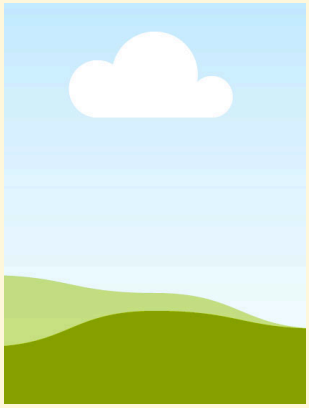

Fig. 29

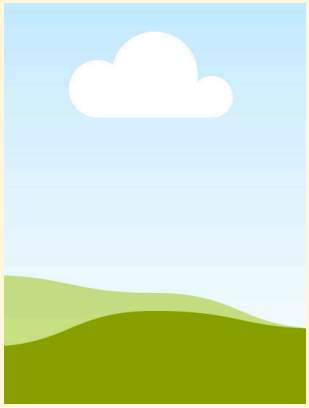

Fig. 30

Fig. 31

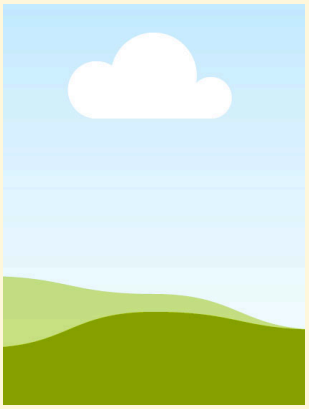

Fig. 32

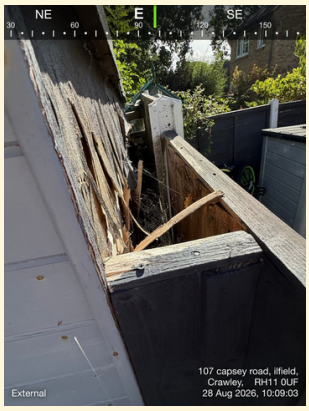

Fig. 33

Fig. 34

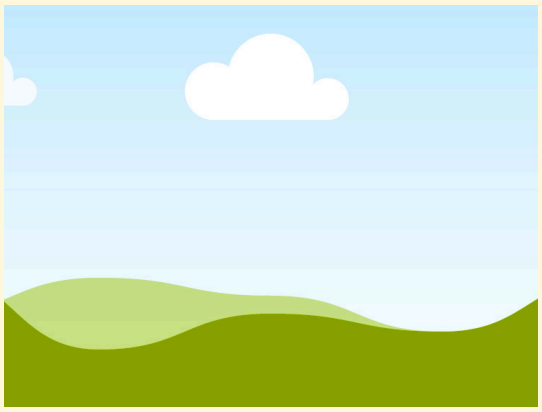

Fig. 35

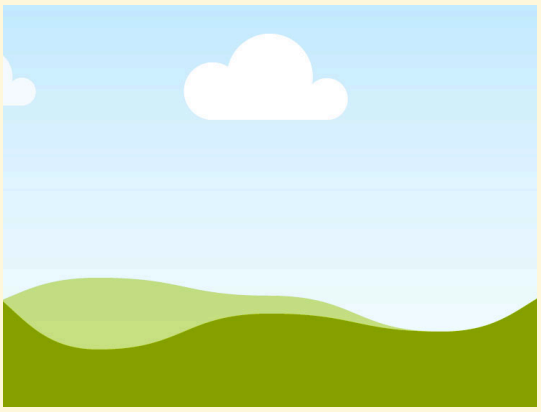

Fig. 36

D9 Other

2

DESCRIPTION

A bay leaf tree, approximately 150 mm trunk, 1.3 m spread x 2.2 m height and approx. 3.7m away from the rear external wall.

DEFECTS

PROBABLE CAUSE

RECOMMENDATIONS

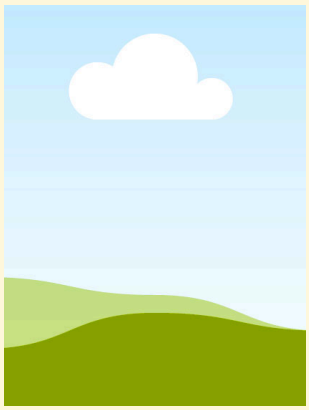

Fig. 37

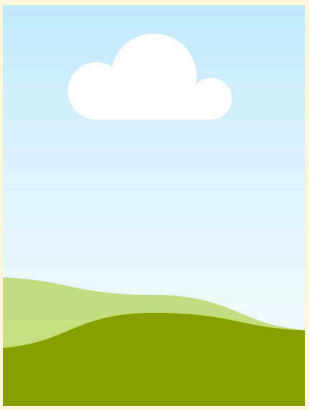

Fig. 38

E Inside the Property

E1 Roof structure

2

DESCRIPTION

Timber roof structure viewed through the loft area hatch located in the first-floor landing. Loft insulation present, 100 mm thick. No significant defects identified during the visual inspection; no signs of water penetration or timber decay noted. Hot water tank present at the loft.

DEFECTS

The loft insulation appears to be about 100 mm of mineral wool. So it is no longer considered sufficient to meet modern energy efficiency requirements for conserving fuel and power.

PROBABLE CAUSE

To reach the required thermal performance (U-value of 0.16 W/m²K), 270mm of mineral wool is the standard.

RECOMMENDATIONS

Top up" your loft by laying additional insulation (e.g., another 170mm) across the top, ideally perpendicular to the joists to cover them and eliminate thermal bridging.

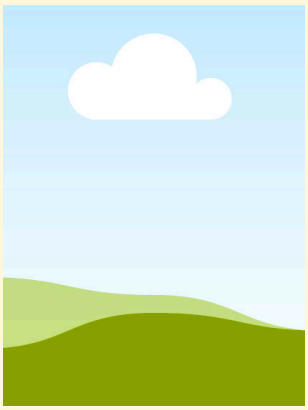

Fig. 39

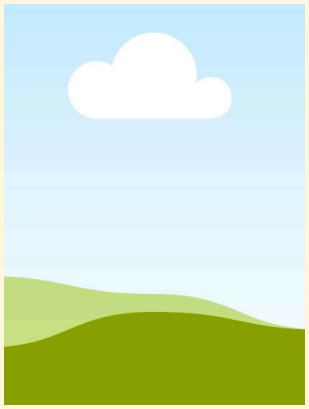

Fig. 40

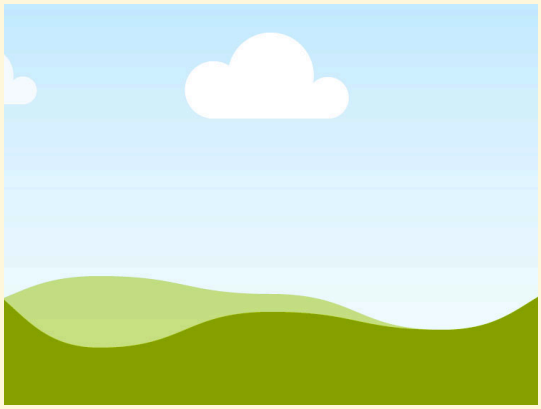

Fig. 41

Fig. 42

E2 Ceilings

1

DESCRIPTION

Plastered decorative ceilings throughout, generally in fair condition. Ground Floor Ceiling height in the entrance hall measured approximately 2360 mm, and first-floor ceiling height in the landing measured approximately 2350mm.

Fig. 43

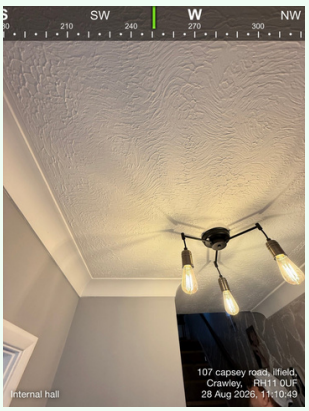

Fig. 44

E3 Walls and partitions

1

DESCRIPTION

Internally, the walls are generally finished with wall paper/painted and tiled surfaces, with skimmed plasterboard over masonry noted at ground- and first-

floor levels. First-floor internal partitions are 90mm. The first-floor bathroom walls are tiled.

Fig. 45

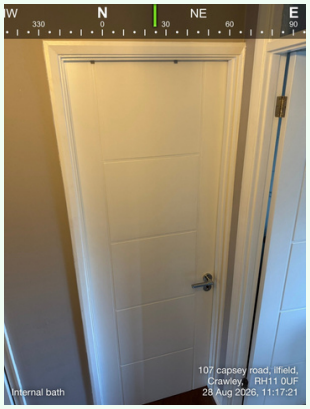

Fig. 46

E4 Floors

1

DESCRIPTION

Timber/Tile-finished floors at ground-floor level, and a timber-finished floor at first-floor level. Also, the floors are level

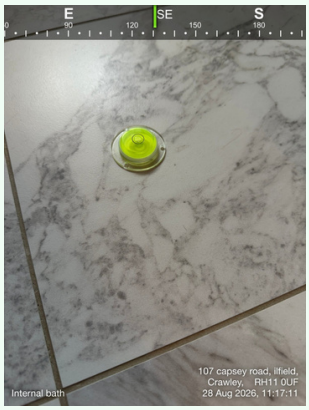

Fig. 47

Fig. 48

Fig. 49

Fig. 50

E5 Fireplaces, chimney breasts and flues

NI

REASON NOT INSPECTED

No chimney breast present - the property has no open fireplace and is served by a gas-fired boiler only.

Fig. 51

E6 Built-in fittings

1

DESCRIPTION

Modern fitted kitchen, cabinets, built-in fridge freezer and laminate worktops

Fig. 52

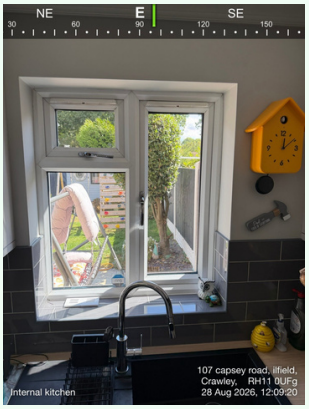

Fig. 53

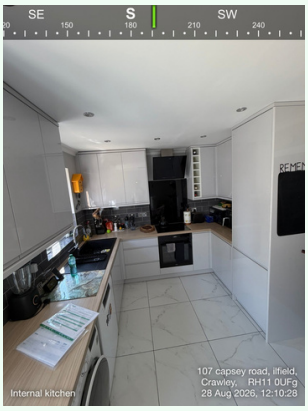

Fig. 54

E7 Woodwork (for example, staircase joinery)

1

DESCRIPTION

Fig. 55

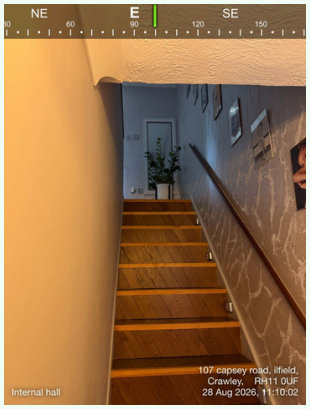

Fig. 56

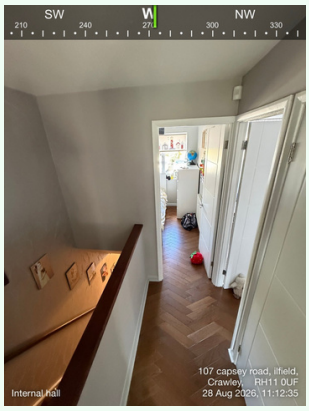

Fig. 57

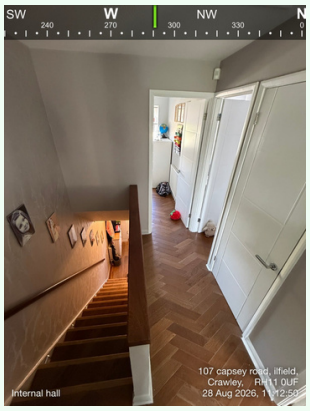

Fig. 58

E8 Bathroom fittings

2

DESCRIPTION

The property benefits from a first-floor family bathroom comprising a bath, wash hand basin and WC. The sanitary fittings were present and operational at the time of inspection, with no significant defects noted during the visual assessment. General wear and tear was noted and is considered consistent with the age and normal use of the property. Routine maintenance is recommended, including regular inspection and renewal of sealant around sanitary fittings and junctions where necessary, to help minimise the risk of water ingress and associated damage. Obscure glass double-glazed window with keys present.
The bathroom is fitted with extractor fans and a shower. The bathroom spotlight is not covered properly from the loft area

DEFECTS

The bathroom extractor fan is operational. The extractor vent goes to the bathroom ceiling, but it isn't connected to the outside vent.
Downlights, particularly older types, can generate significant heat. Where insulation is installed directly over or around the fittings, heat dissipation may be restricted, increasing the risk of overheating and, in some circumstances, creating a potential fire hazard.

PROBABLE CAUSE

Building Regulations require that extract ventilation from bathrooms, kitchens, and utility rooms must discharge directly to the external air. Venting into a roof space.
The electrical fitting appears to be an older-type metal recessed spotlight.

RECOMMENDATIONS

Extend the Ducting: Install a proper duct run from the back of the extractor fan to an external vent terminal.
A qualified electrician or other suitably competent person should inspect the lighting installation to confirm the fittings are suitable for their location and that adequate clearance from insulation is maintained.

Fig. 59

Fig. 60

Fig. 61

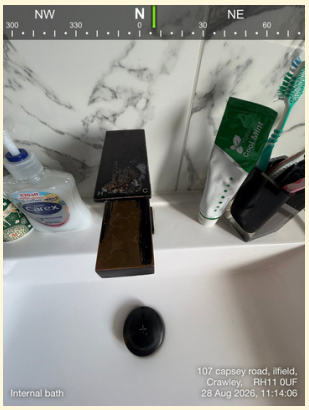

Fig. 62

N
NE
E
Internal bath
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:14:09

Fig. 63

NE
E
SE
Internal loft
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 11:55:46

Fig. 64

F Services

Services are generally hidden within the construction of the property. This means that we can only inspect the visible parts of the available services, and we do not carry out specialist tests.

F1 Electricity

2

> ⚠ Safety warning: Electrical Safety First recommends that you should get a registered electrician to check the property and its electrical fittings at least every ten years, or on change of occupancy.

DESCRIPTION

DEFECTS

PROBABLE CAUSE

RECOMMENDATIONS

Extend the Ducting: Install a proper duct run from the back of the extractor fan to an external vent terminal. A qualified electrician or other suitably competent person should inspect the lighting installation to confirm the fittings are suitable for their location and that adequate clearance from insulation is maintained.

Fig. 65

Fig. 66

Fig. 67

Fig. 68

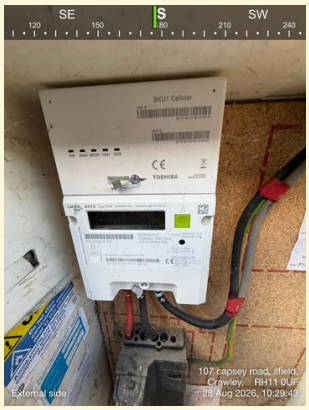

Fig. 69

F2 Gas/Oil

1

⚠ Safety warning: All gas and oil appliances and equipment should be regularly inspected, tested, maintained and serviced by a registered competent person.

DESCRIPTION

The gas meter is located externally within a cupboard off the left-side elevation. The visual inspection identified no significant defects

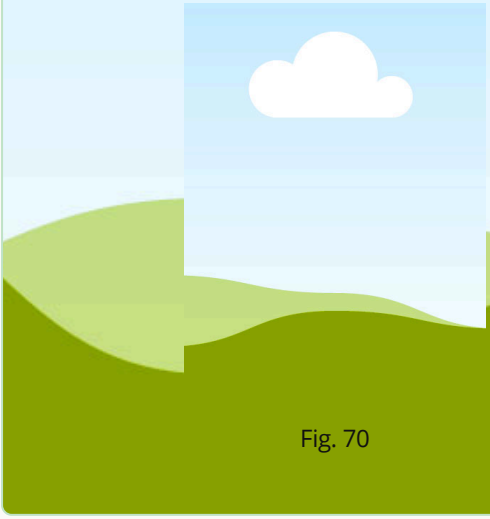

Fig. 70

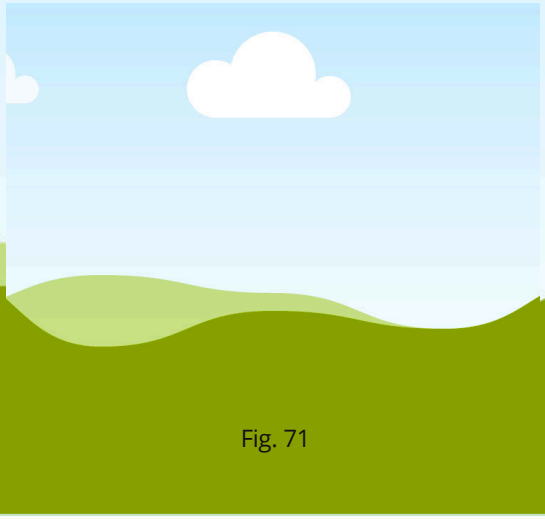

Fig. 71

F3 Water

1

DESCRIPTION

Water flow appeared satisfactory at the time of inspection. No significant defects were identified

F4 Heating

1

DESCRIPTION

A Vaillant Advance gas-fired boiler is located on the ground floor. The boiler provides central heating and domestic hot water and appears to be a relatively modern, high-efficiency condensing type. It is understood to have been installed in December 2024 and is reportedly covered by a 7-year warranty. No significant defects were identified during the visual inspection.
The hot-water cylinder and associated thermostat/

pump controls are located within the first-floor airing cupboard landing area. The hot-water storage tank is located within the loft space.

The boiler, hot-water cylinder, associated controls and pipework were visually inspected only and were not tested. Obtain the latest boiler service/inspection records, along with confirmation of the installation date and any remaining manufacturer's warranty documentation. The heating and hot-water systems should be maintained and serviced at the manufacturer's recommended intervals by an appropriately qualified Gas Safe registered engineer.

Fig. 72

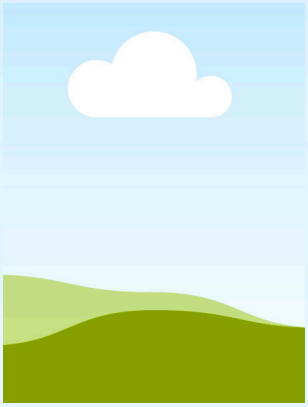

Fig. 73

Fig. 74

Fig. 75

Fig. 76

Fig. 77

F5 Water heating

1

DESCRIPTION

The property is served by a gas-fired boiler providing central heating and domestic hot water. Domestic hot water is stored in a separate hot-water cylinder and heated indirectly by the boiler via an internal heat-exchange coil. A programmer and cylinder thermostat control the system, with the hot-water cylinder and associated controls located separately from the boiler.

No significant defects were identified during the visual inspection. The system appeared to be in satisfactory condition at the time of inspection. The boiler, hot-water cylinder and associated controls should be maintained and serviced in accordance with the manufacturer's recommendations. Retain relevant installation, servicing, and maintenance records.

Fig. 78

Fig. 79

Fig. 80

Fig. 81

F6 Drainage

1

DESCRIPTION

No external foul water drainage inspection chambers or manholes were identified or exposed during the inspection. These are understood to serve the kitchen drainage and the first-floor family bathroom.
The Client/Vendor verbally identified a foul water manhole located to the rear right-hand side of the property, beneath approximately 100 mm of slate chippings, with a plastic membrane/layer below, near to the external kitchen wall.
Following the inspection, the Client/Vendor identified the location of the manhole and provided photographs via the estate agent on 02/09/2026. These photographs have been reviewed/are provided for reference and are included with this report. Refer to the attached photographs.
If confirmation of the drainage arrangement or condition is required, further investigation by a suitably qualified drainage contractor, including exposing and inspecting the manhole and carrying out a CCTV drainage survey where appropriate, is recommended.

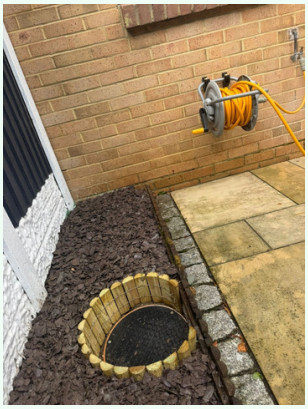

Fig. 82

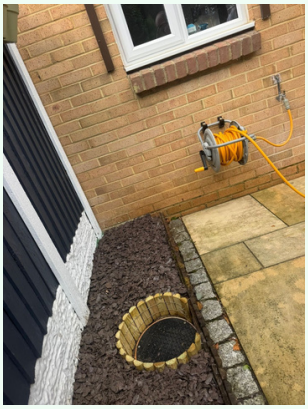

Fig. 83

Fig. 84

F7 Common services

1

DESCRIPTION

The property is an end-terrace house. The client verbally reported that a foul water manhole is located to the rear right-hand side of the property, beneath approximately 100 mm of slate chippings, with a plastic membrane/ layer below, close to the external kitchen wall. Some external foul water drainage infrastructure may be shared with the neighbouring property, including this manhole/inspection chamber adjacent to No. 109. The inspection could not confirm the exact ownership or responsibility for the shared manhole and associated drainage runs. Confirmation should be obtained from the relevant drainage authority and/or through the property documentation.

G Grounds (including shared areas for f lats)

G1 Garage

NI

REASON NOT INSPECTED No Garage Present

G2 Permanent outbuildings and other structures

2

DESCRIPTION

DEFECTS

PROBABLE CAUSE

RECOMMENDATIONS

Fig. 85

Fig. 86

Fig. 87

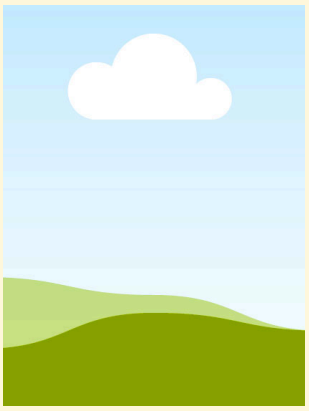

Fig. 88

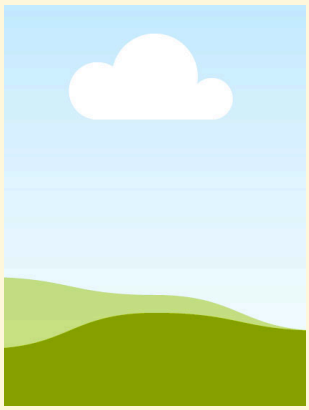

Fig. 89

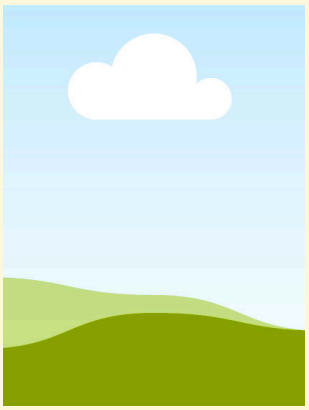

Fig. 90

G3 Other outdoor elements

NI

REASON NOT INSPECTED No other significant outdoor elements

G4 Trees

2

DESCRIPTION

A bay leaf tree, approximately 150 mm trunk, 1.3 m spread x 2.2 m height and approx. 3.7m away from the rear external wall.

DEFECTS

The tree's proximity may be contributing to the increased moisture levels and localised discolouration observed on the adjacent brickwork.

PROBABLE CAUSE

Tree roots may also affect foundations, drainage, and other building elements, depending on ground conditions, tree species, and root growth.

RECOMMENDATIONS

Removal of the tree is recommended, subject to confirmation from the local authority and/or a suitably qualified arborist, particularly if the tree is protected by a Tree Preservation Order or is located within a Conservation Area. After removal, monitor the affected brickwork and undertake any necessary remedial works.

Fig. 91

Fig. 92

Fig. 93

G5 Boundaries, retaining walls, and fences

1

DESCRIPTION

The garden is enclosed by approximately 1.8m-high painted closed-board timber fencing, comprising the left-hand, rear and right-hand boundaries.

G6 Driveways and paths

1

DESCRIPTION

Parking facilities include a block-paved driveway providing space for approximately two cars, together with off-street parking in front of the property. Bicycle parking is also provided on the driveway, with ground-fixed hooks. The driveway slopes towards the property, and a drainage channel/grille is provided adjacent to the external wall to assist with surface water drainage.

Fig. 94

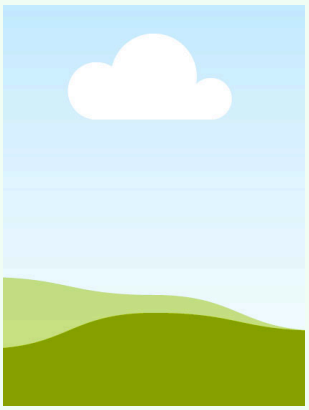

Fig. 95

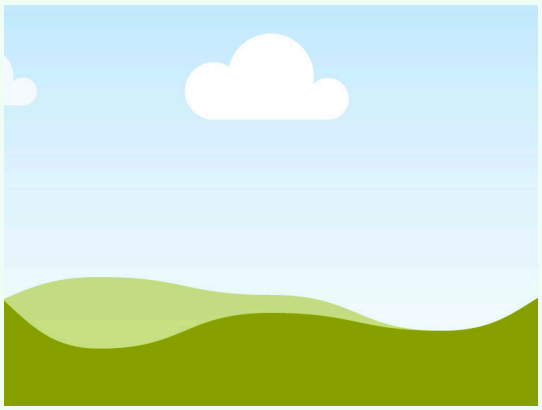

Fig. 96

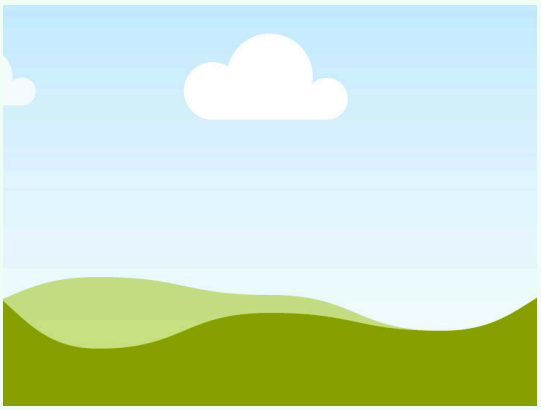

Fig. 97

Fig. 98

G7 Other grounds features

2

DESCRIPTION

The rear patio is set approximately 20–30mm above the surrounding ground level, with gaps of approximately 25mm between the paving tiles noted adjacent to the timber garden shed and boundary wall. No significant evidence of recent ground movement or subsidence was apparent during the inspection.

DEFECTS

The site search report indicates that the land/property is not identified as being at risk from relevant ground or environmental hazards. This is consistent with the absence of obvious signs of recent ground movement noted during the inspection.

PROBABLE CAUSE

The inspection found no obvious signs of recent or significant ground movement, and the site search report does not indicate that the property is at significant risk from relevant ground or environmental hazards.

RECOMMENDATIONS

No specific remedial action is currently considered necessary. The property should, however, be monitored as part of routine maintenance for any future signs of ground movement, such as new or progressive cracking, distortion or changes to doors and windows. Any significant changes should be investigated by a suitably qualified structural engineer.

Fig. 99

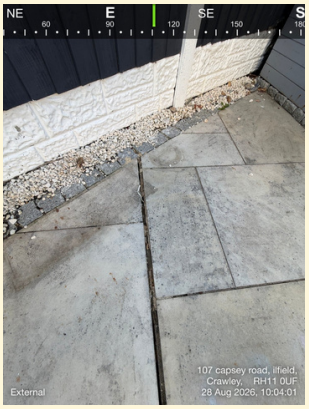

Fig. 100

Fig. 101

Fig. 102

Fig. 103

G8 Common / Shared areas

1

DESCRIPTION

The property is an end-terrace house. The client verbally reported that a foul water manhole is located to the rear right-hand side of the property, beneath approximately 100 mm of slate chippings, with a plastic membrane/ layer below, close to the external kitchen wall. Some external foul water drainage infrastructure may be shared with the neighbouring property, including this manhole/inspection chamber adjacent to No. 109. The inspection could not confirm the exact ownership or responsibility for the shared manhole and associated drainage runs. The relevant drainage authority and/or property documentation should confirm ownership and responsibility.

H Issues for Your Legal Advisers

REGULATION	We recommend your legal advisers request copies of any Building Regulation completion certificates, planning consents or FENSA certificates for the UPVC windows/replacement uPVC windows.
GUARANTEES	Please ask your legal advisers to confirm: (a) any boiler installation certificate and gas safety record, (b) any electrical installation guarantees,
OTHER MATTERS	No significant issues were found at the time of inspection

I Risks

RISKS TO THE BUILDING	No indicators of ongoing subsidence, heave, or significant structural movement were observed within the principal structure at the time of the inspection.
RISKS TO THE GROUNDS	No evidence of historic or significant ground movement was noted to the principal structure at the time of inspection. However, a tree is located close to the rear of the property and within the building's potential zone of influence. Depending on the tree species, soil conditions and foundation depth, the proximity of the tree may increase the risk of root-related ground movement. No invasive plant species, including Japanese knotweed or giant hogweed, were identified during the visual inspection.
RISKS TO PEOPLE	A suitably qualified electrician should inspect and test the electrical installation to confirm its condition, safety and compliance with current standards. An Electrical Installation Condition Report (EICR) is recommended. No obvious evidence of asbestos-containing materials (ACMs) was identified within the visible and readily accessible areas inspected. However, this inspection did not constitute an asbestos survey, and the presence of concealed or inaccessible ACMs

	cannot be ruled out. Appropriate precautions should therefore be taken before undertaking any intrusive works, alterations or demolition.
OTHER RISKS OR HAZARDS	No significant hazards were found at the time of inspection

K Surveyor’s Declaration

No information provided.

AI USE

No AI tools were used in the preparation of this report.

Surveyor & signature

SIGNATURE

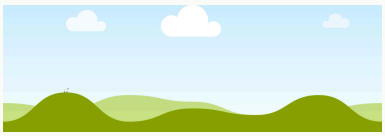

M – Description of the Home Survey – Level 3

The Service

The Home Survey – Level 3 (Building Survey) is produced by a qualified surveyor who has the skills, knowledge and experience to survey and report on residential properties. The service includes a thorough inspection and detailed report on a wider range of issues than the Level 2 report. It is suitable for all residential properties but is particularly appropriate for older properties, those of unusual construction, properties that have been altered or extended, or where major works are planned.

The Inspection

The surveyor carries out a more thorough inspection than the Level 2 service. This includes looking at areas that are accessible with the use of ladders (up to 3 metres), inspecting the roof space where accessible, and considering the construction methods used. The surveyor will inspect the inside and outside of the main building, all permanent outbuildings, and grounds within the boundary of the property.

The inspection is visual and non-invasive — the surveyor does not take up carpets or floor coverings, move heavy furniture, or remove secured panels. Services are inspected visually but not tested.

What the Report Tells You

The Level 3 report provides a comprehensive assessment of the property's condition with detailed descriptions of defects, the most probable cause(s) of those defects based on the inspection, and the likely consequences if not addressed. It includes advice on repairs and maintenance, as well as information about the construction and materials used.

Dangerous Materials, Contamination and Environmental Hazards

The surveyor will advise the client if they suspect, but cannot confirm, that asbestos or other potentially hazardous materials are present in the property. The Control of Asbestos Regulations 2012 place legal duties on the dutyholder of non-domestic premises and the common parts of multi-occupied residential buildings to manage asbestos. Suspected asbestos-containing materials should be inspected and tested by a qualified specialist before any work that might disturb them.

The surveyor does not make any enquiries about contamination or other environmental hazards. However, if the surveyor suspects a problem, a further investigation will be recommended. The property is not tested for radon; a radon test should be arranged if the property is located in a radon-affected area (information from UKradon.org).

Condition Ratings

The condition of the property is assessed using a rating system from 1 to 3, plus NI (Not Inspected). The ratings are described in full at the beginning of this report. The rating reflects the condition at the date of inspection.

Standard Terms of Engagement

1.The service. The Home Survey – Level 3 (Building Survey) service comprises a thorough physical inspection of the property and a detailed written report based on that inspection, prepared in accordance with the RICS Home Survey Standard (2021). The Surveyor will follow the Standard's mandatory inspection requirements and report on the matters set out in this report.

2.The surveyor. The Surveyor undertaking the inspection and producing the report is qualified to carry out a Home Survey – Level 3 and is a member of the Royal Institution of Chartered Surveyors (RICS). The Surveyor will provide an objective, independent and impartial report.

3.Before the inspection. The Client should advise the Surveyor before the inspection of any specific concerns about the property and any documents (planning consents, building regulations approvals, guarantees, leases, service charge details, etc.) that may be relevant. The Surveyor relies on access being available to the property and to the parts that the inspection is to cover.

4.Payment. The fee for the service is agreed in writing before the inspection takes place. Payment is due in accordance with the engagement letter. The report will not be issued until payment has been received in cleared funds, unless otherwise agreed in writing.

5.Cancellation. Where the Client is a consumer for the purposes of the Consumer Contracts (Information, Cancellation and Additional Charges) Regulations 2013, the Client has a 14-day cancellation period from the date of the engagement letter during which the contract may be cancelled. If the Client expressly requests the inspection to take place within that 14-day period, the right to cancel may be lost once the service is fully performed. Nothing in these terms affects the Client's statutory rights under the Consumer Rights Act 2015.

6.Liability. This report has been prepared by a surveyor ("the Surveyor") solely for the use of the person named as the client in this report ("the Client"). The Surveyor owes no duty of care to any third party and any such party relies on this report at their own risk. The report is confidential to the Client and the Client's professional advisers and should not be disclosed to any other party without the Surveyor's written consent. The Surveyor's liability is limited to the extent set out in the engagement letter.

Complaints Handling Procedure

The Surveyor operates a complaints handling procedure, a copy of which is available on request. If the Client is not satisfied with any aspect of the service, a complaint should be made in writing to the Surveyor in the first instance. If the complaint is not resolved to the Client's satisfaction, it may be referred to the RICS Dispute Resolution Service.

N – Typical House Diagram

This diagram shows the standard part labels used throughout this report. Your property may not have every element shown — the actual elements present are detailed in sections D–G.

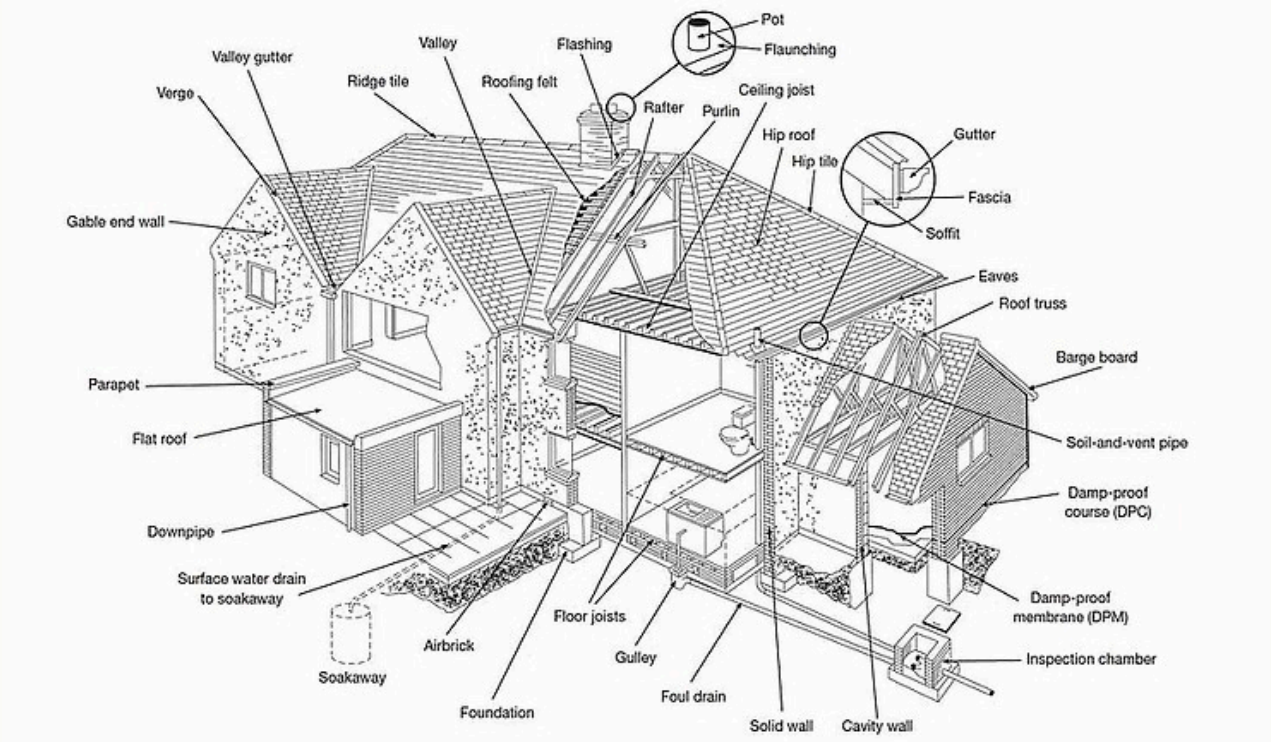

Illustration is schematic — it shows where labels apply in principle, not the specific construction of your property. Internal elements such as ceilings (E2), floors (E4), fireplaces (E5) and bathroom fittings (E8) are not shown.

Photographic Record

A – About the Inspection

Fig. 1

C – About the Property

Fig. 2

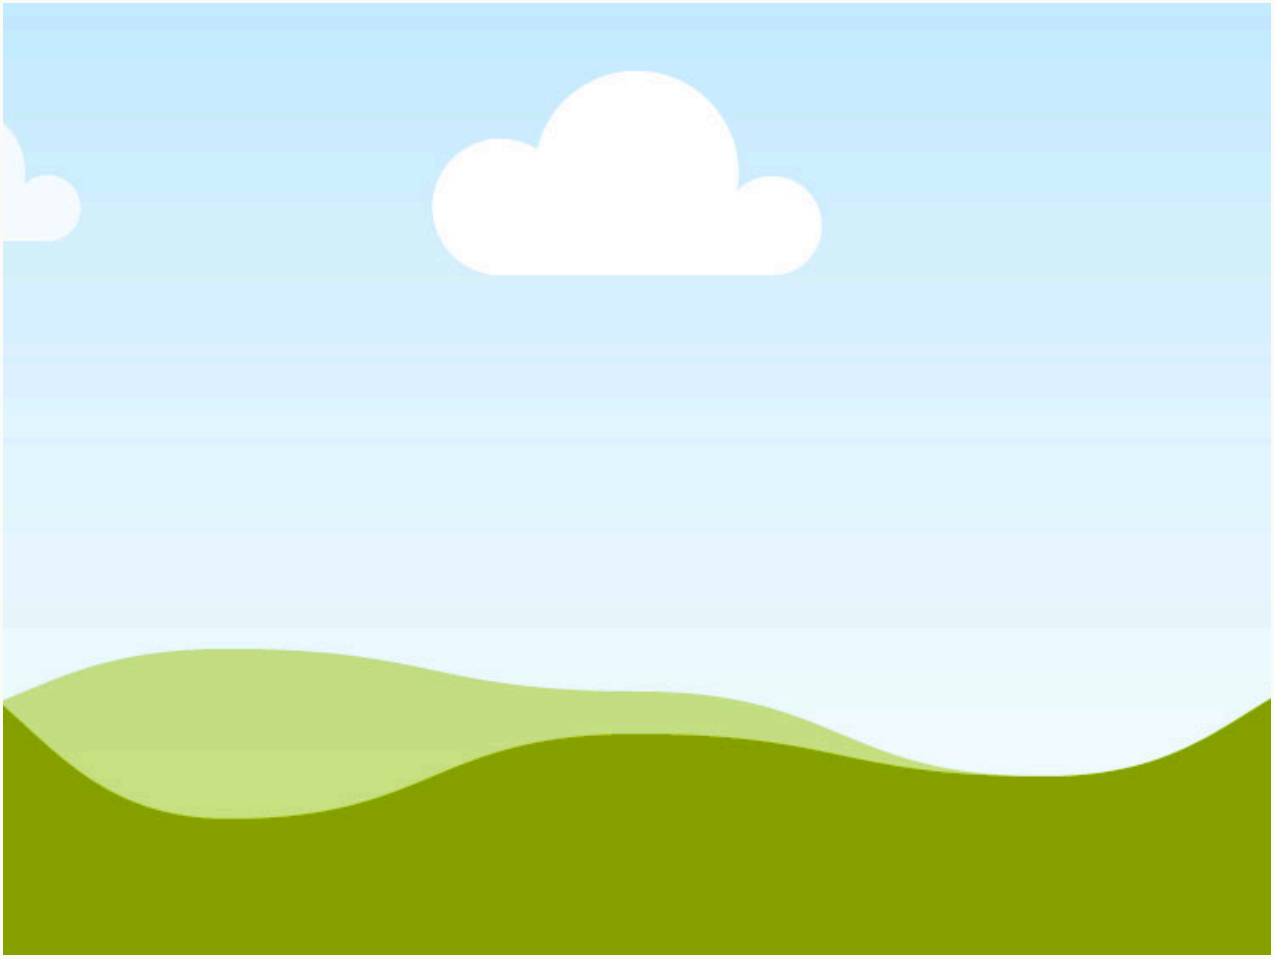

Fig. 3

SE
S
SW
120
150
180
210
240
HANDLE WITH CARE
BK-G4 M
G4 K9129074 17 01
Property of SGN
IF YOU THINK YOU CAN SMELL GAS
0800 111 999
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:27:55

Fig. 4

Fig. 5

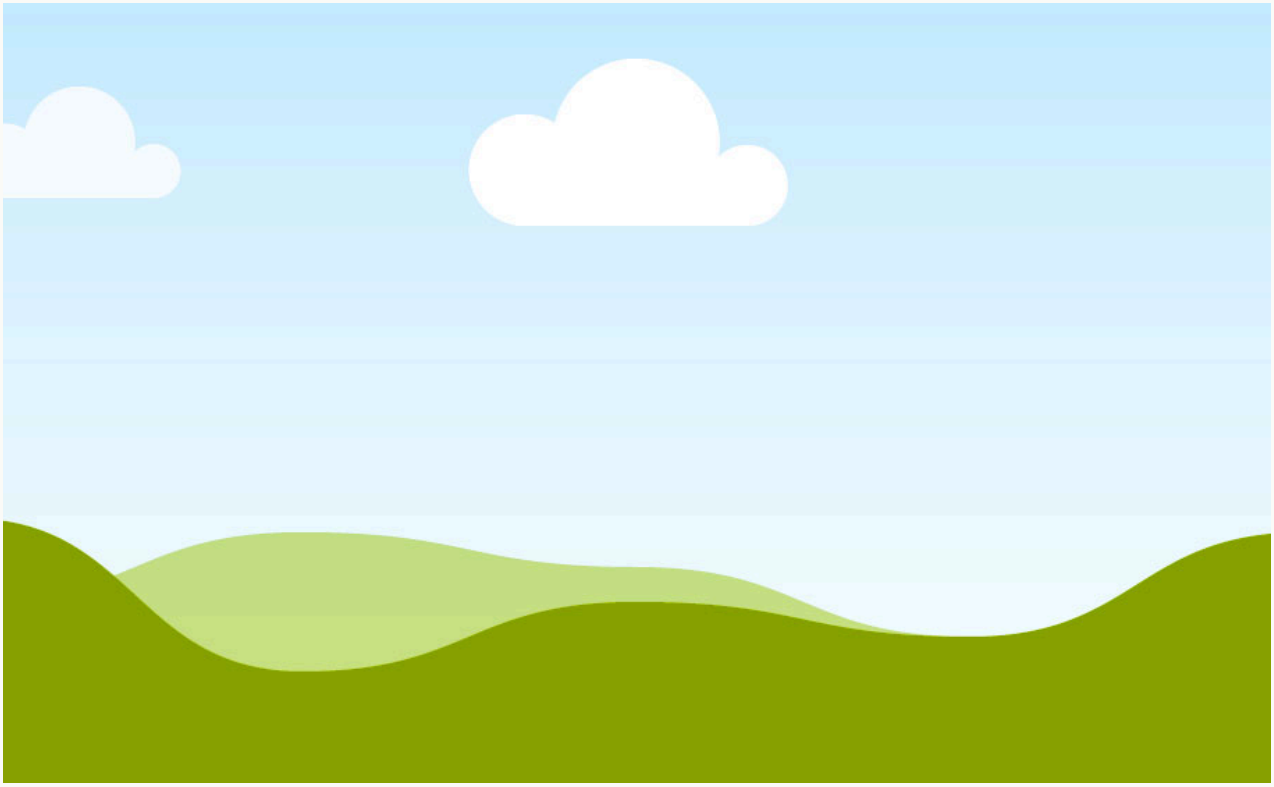

Fig. 6

D2 — Roof coverings

Fig. 7

Fig. 8

SW
W
NW
210
240
270
300
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:11:39

Fig. 9

SW
W
NW
210
240
270
300
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 09:46:26

Fig. 10

D3 — Rainwater pipes and gutters

Fig. 11

N
NE
E
0
30
60
90
120
External front
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:44:13

Fig. 12

Fig. 13

D4 — Main walls

Fig. 14

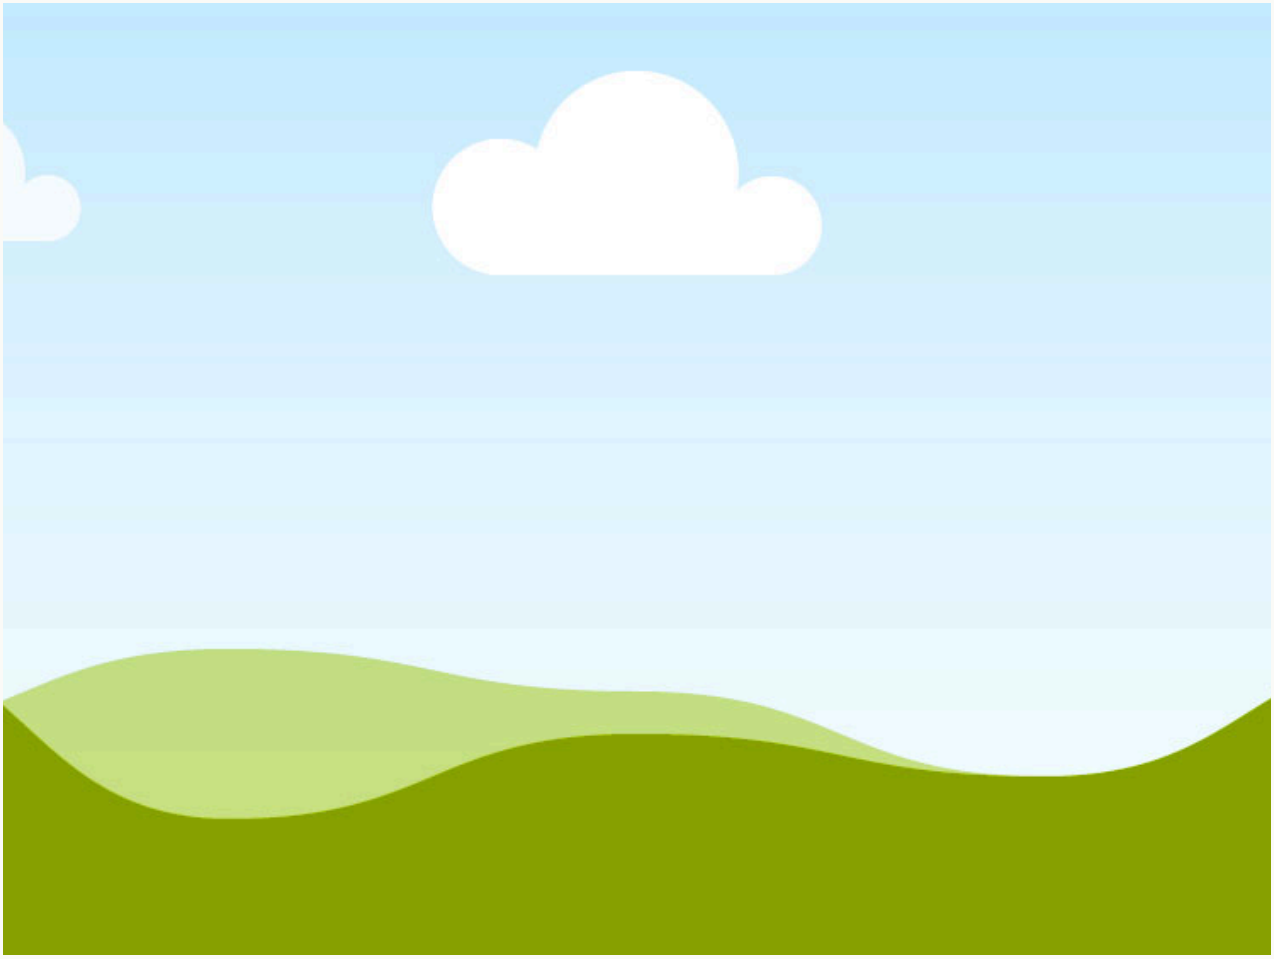

Fig. 15

SE
S
SW
W
0
150
180
210
240
270
300
External
107 capsey road, ilfield, Crawley,
RH11 0UF
28 Aug 2026, 09:54:07

Fig. 16

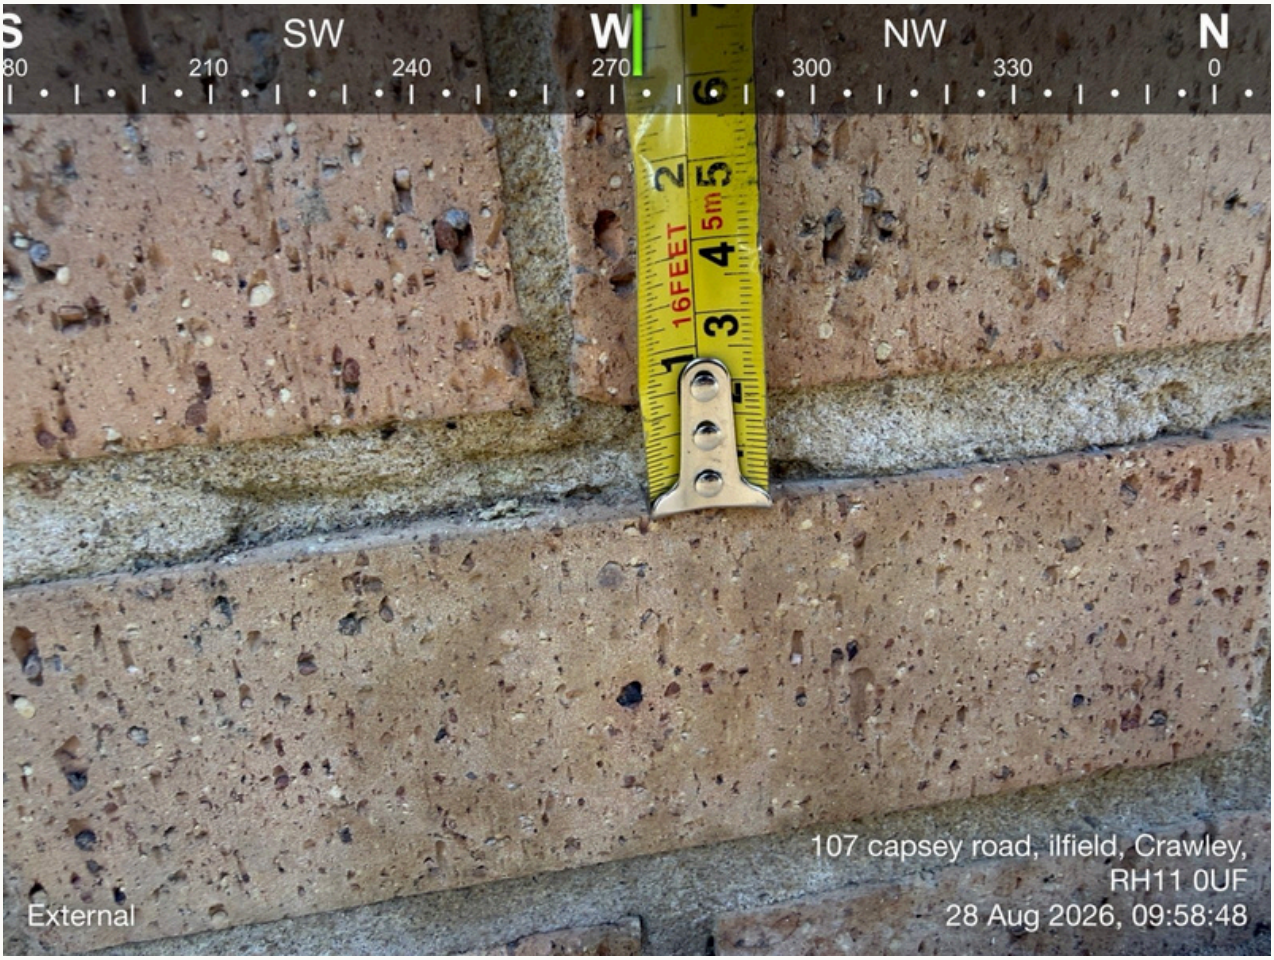
S
SW
W
NW
N
180
210
240
270
300
330
0
16FEET
5m
External
107 capsey road, ilfield, Crawley,
RH11 0UF
28 Aug 2026, 09:58:48

Fig. 17

SW
W
NW
N
210
240
270
300
330
0
16FEET
5m
107 capsey road, ilfield, Crawley,
RH11 0UF
28 Aug 2026, 09:59:05
External

Fig. 18

Fig. 19

Fig. 20

Fig. 21

D5 — Windows

Fig. 22

Fig. 23

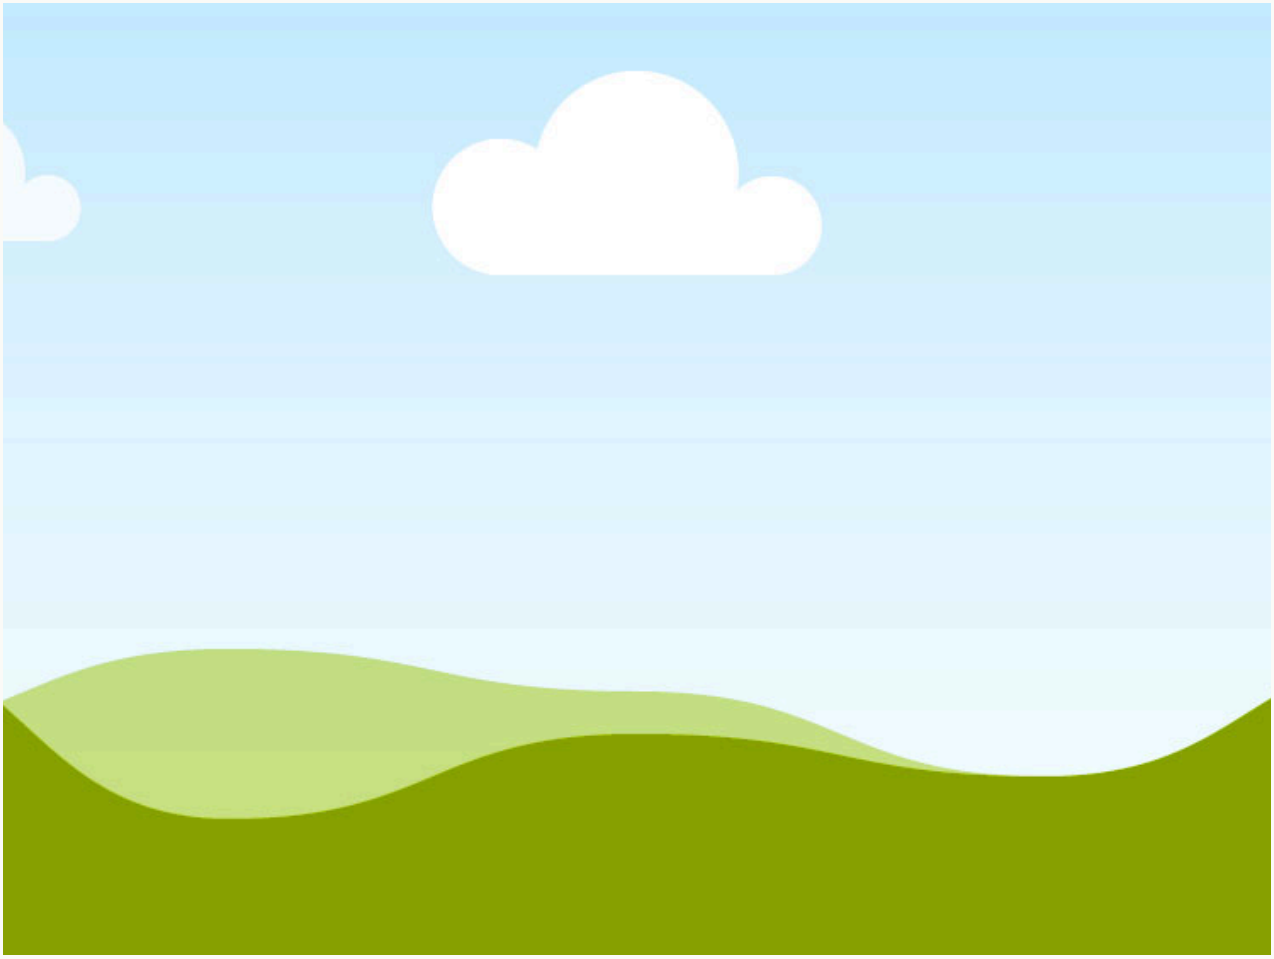

Fig. 24

D6 — Outside doors (including patio doors)

Fig. 25

SW
W
NW
210
240
270
300
330
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:10:41
External

Fig. 26

D7 — Conservatory and porches

Fig. 27

NE
E
SE
60
90
120
150
107
Capsey Road
External front
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:02:47

Fig. 28

D8 — Other joinery and finishes

Fig. 29

Fig. 30

Fig. 31

SE
S
SW
120
150
180
210
240
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:07:52

Fig. 32

NE
E
SE
30
60
90
120
150
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:09:03

Fig. 33

NE
E
SE
60
90
120
150
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:10:07

Fig. 34

Fig. 35

Fig. 36

D9 — Other

Fig. 37

Fig. 38

Fig. 39

Fig. 40

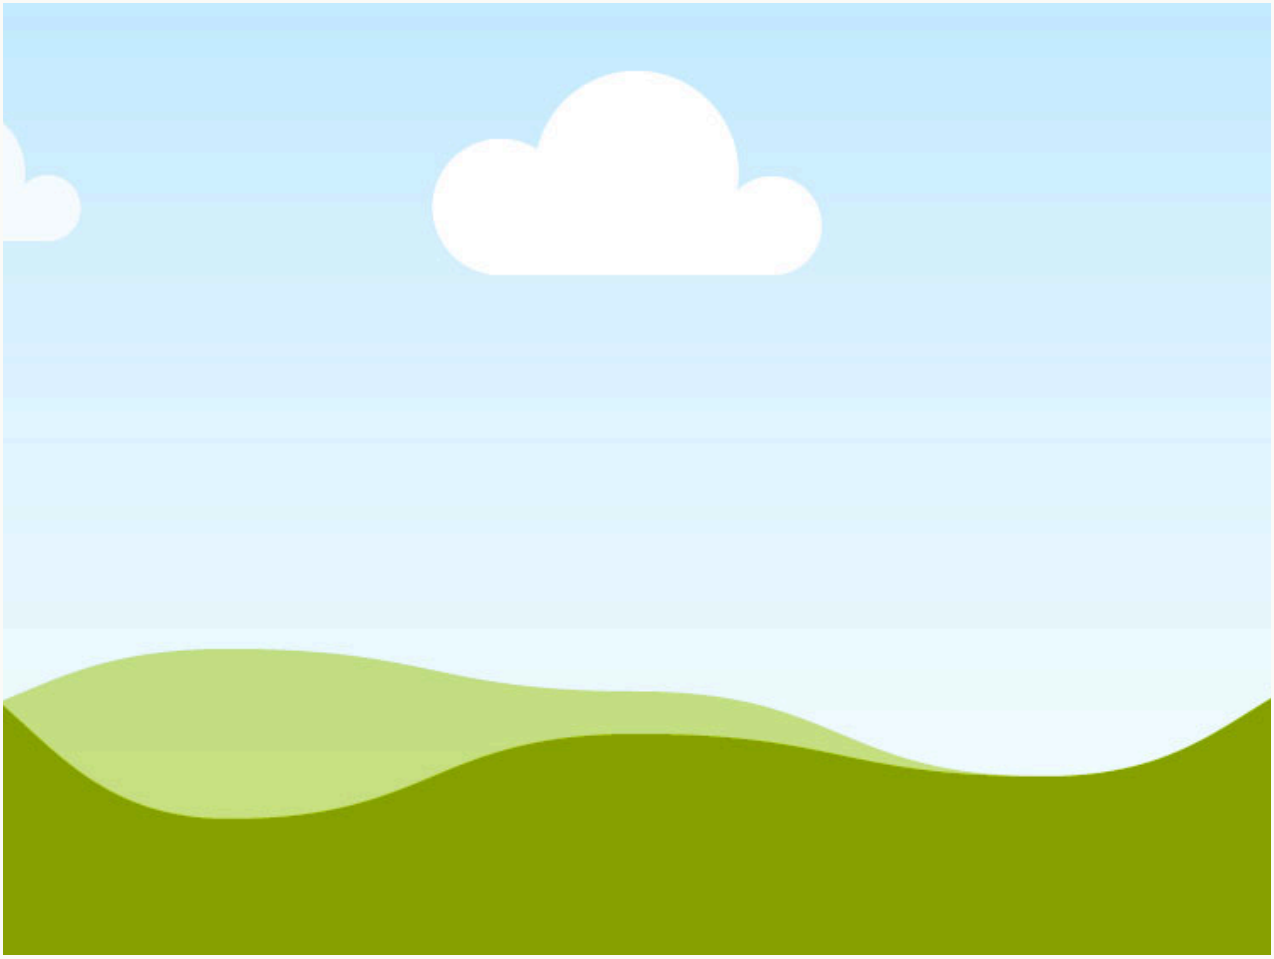

Fig. 41

NW
N
NE
330
0
30
60
Internal loft
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 11:51:35

Fig. 42

E2 — Ceilings

Fig. 43

S
SW
W
NW
30
210
240
270
300
Internal hall
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:10:49

Fig. 44

Fig. 45

W
N
NE
E
330
0
30
60
90
Internal bath
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:17:21

Fig. 46

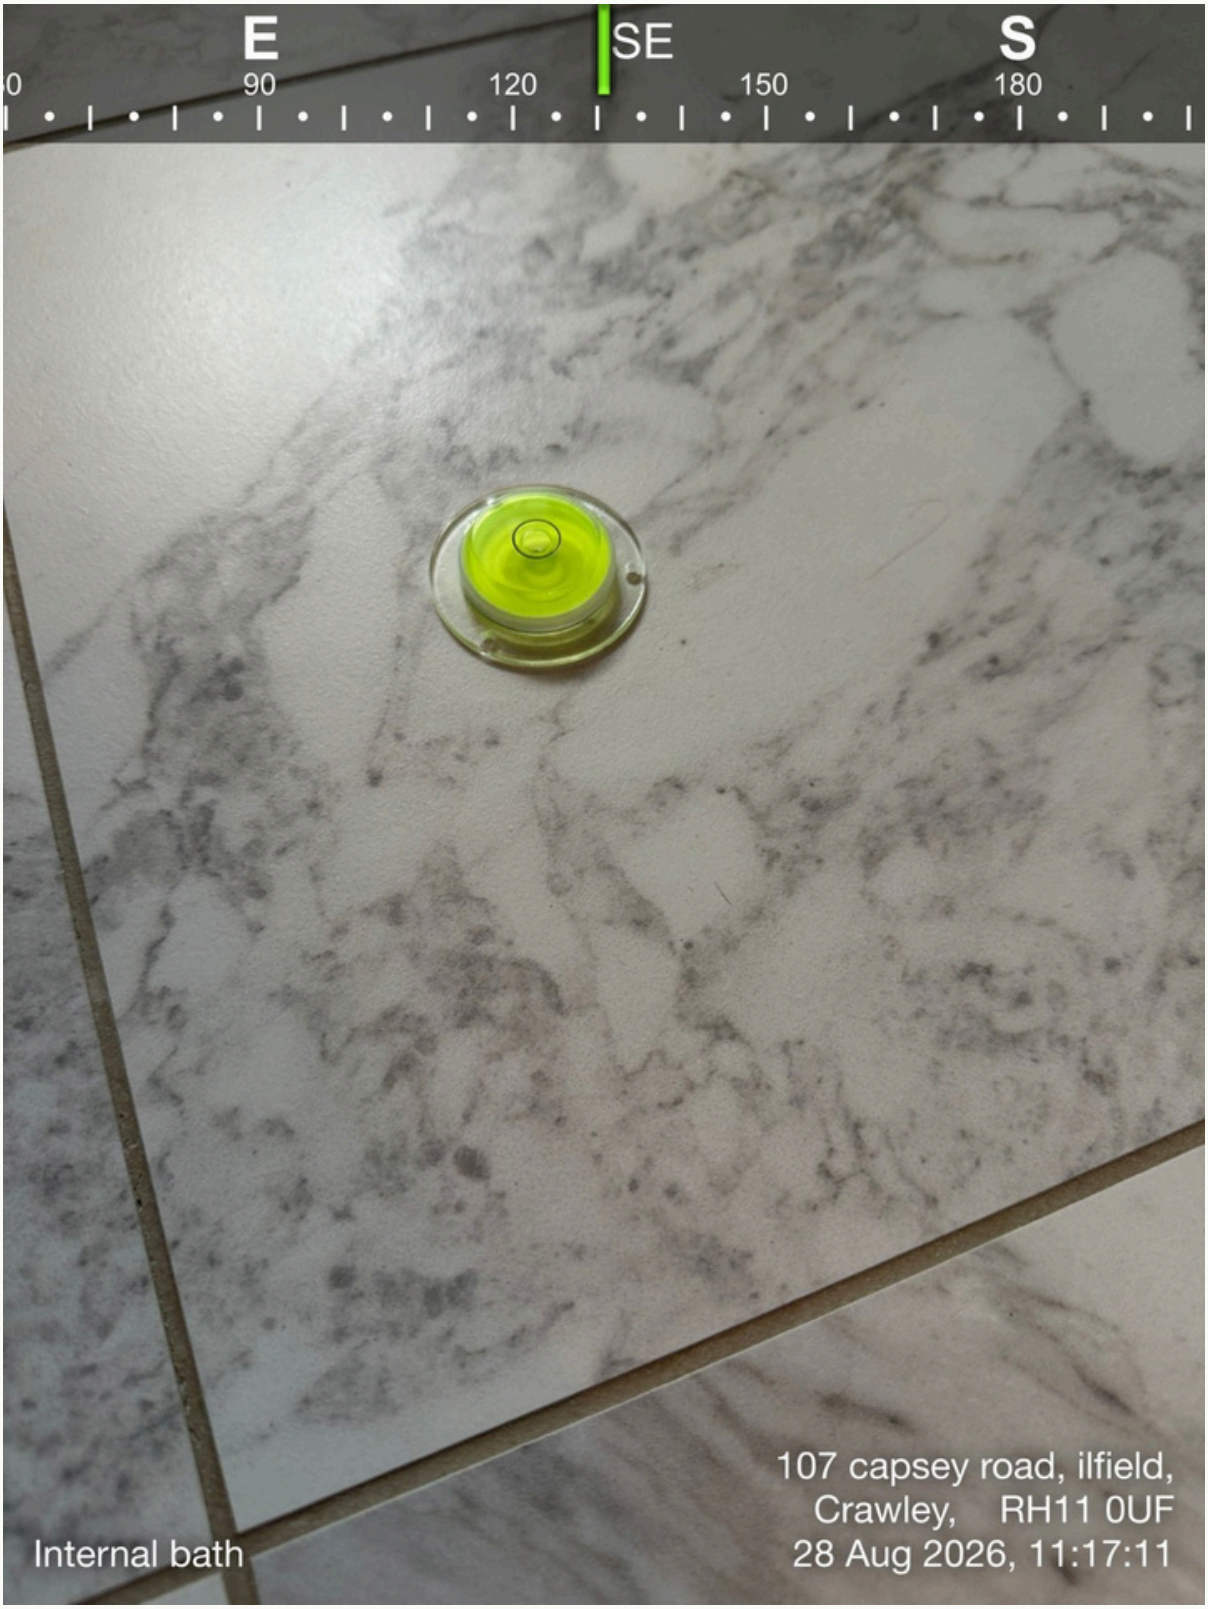
E
SE
S
90
120
150
180
Internal bath
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:17:11

Fig. 47

Fig. 48

Fig. 49

Fig. 50

E5 — Fireplaces, chimney breasts and flues

Fig. 51

E6 — Built-in fittings

Fig. 52

NE
E
SE
30
60
90
120
150
Internal kitchen
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 12:09:20

Fig. 53

SE
S
SW
20
150
180
210
240
Internal kitchen
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 12:10:28

Fig. 54

E7 — Woodwork (for example, staircase joinery)

Fig. 55

NE
E
SE
30
60
90
120
150
Internal hall
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:10:02

Fig. 56

SW
W
NW
210
240
270
300
330
Internal hall
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:12:35

Fig. 57

Fig. 58

Fig. 59

E
90
120
SE
150
S
180
Internal bath
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:14:50

Fig. 60

E
E
SE
S
60
90
120
150
180
Internal bath
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:13:32

Fig. 61

NW
N
NE
300
330
0
30
60
£70 off
Carex
Original
Cool Mint
H
C
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:14:06
Internal bath

Fig. 62

W
N
NE
E
330
0
30
60
90
Internal bath
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:14:09

Fig. 63

NE
E
SE
60
90
120
150
Internal loft
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 11:55:46

Fig. 64

E
90
120
SE
150
S
180
Internal bath
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:14:50

Fig. 65

NE
E
SE
30
60
90
120
Internal loft
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 11:54:29

Fig. 66

NE
E
SE
60
90
120
150
Internal loft
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 11:55:39

Fig. 67

E
SE
S
SW
W
90
120
150
180
210
240
270
External
107 capsey road, ilfield, Crawley,
RH11 0UF
28 Aug 2026, 10:29:03

Fig. 68

Fig. 69

F2 — Gas/Oil

Fig. 70

E
SE
S
SW
W
90
120
150
180
210
240
270
107 capsey road, ilfield, Crawley,
RH11 0UF
28 Aug 2026, 10:29:03
External

Fig. 71

W
NW
N
NE
270
300
330
0
30
50
40
60
70
80°C
min
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:27:05
Internal store

Fig. 72

NW
N
NE
300
330
0
30
Internal store
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:27:10

Fig. 73

NE
E
SE
30
60
90
120
Internal store
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:27:15

Fig. 74

NE
E
SE
30
60
120
150
IMPORTANT
INSTALLER CHECKLIST
To ensure validity of the boiler guarantee, please confirm that:
IMPORTANT
HOMEOWNER CHECKLIST
Vaillant
Comfort for your home
Vaillant
F.28
ecoFIT pure
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 12:14:09
Internal kitchen

Fig. 75

Fig. 76

NE
E
SE
60
90
120
150
Internal loft
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 11:47:32

Fig. 77

F5 — Water heating

Fig. 78

NW
N
NE
300
330
0
30
60
Internal store
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:26:29

Fig. 79

W
NW
N
NE
270
300
330
0
30
50
40
60
70
80°C
min
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 11:27:05
Internal store

Fig. 80

NE
E
SE
30
60
90
120
150
IMPORTANT
INSTALLER CHECKLIST
To ensure validity of the boiler guarantee, please confirm that:
SYSTEM - Have you thoroughly flushed the system, added a suitable inhibitor and confirmed the system water quality?
GAS - Have you tested the gas installation for tightness and purged the gas supply in accordance with the relevant standard?
FLUE - Is the flue adequately supported and correctly sited?
Did you carry out a flue gas analysis and have you replaced the flue sampling plug after use?
COMPLETION - Have you explained to the customer how to operate the boiler and use the controls and handed over all documentation?
IMPORTANT
HOMEOWNER CHECKLIST
You must register within 30 days of installation to validate your guarantee
You must ensure your installer has completed the technical requirements of the guarantee and signed the guarantee form
Call or for online registration go to www.vaillant.co.uk
Vaillant Comfort for your home
Vaillant
F.28
ecoFIT pure
107 capsey road, ilfield,
Crawley, RH11 0UFg
28 Aug 2026, 12:14:09
Internal kitchen

Fig. 81

F6 — Drainage

Fig. 82

Fig. 83

Fig. 84

G2 — Permanent outbuildings and other structures

Fig. 85

SE
S
SW
120
150
180
210
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:07:35

Fig. 86

SE
S
SW
150
180
210
240
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:08:33
External

Fig. 87

E
E
SE
S
60
90
120
150
180
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:08:52

Fig. 88

NE
E
SE
30
60
90
120
150
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:09:08

Fig. 89

NE
E
SE
60
90
120
150
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:10:07

Fig. 90

G4 — Trees

Fig. 91

E
SE
S
SV
90
120
150
180
210
External
107 capsey road, ilfield,
Crawley, , RH11 0UF
28 Aug 2026, 10:13:03

Fig. 92

E
SE
S
SW
90
120
150
180
210
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:13:08
External

Fig. 93

G6 — Driveways and paths

Fig. 94

SE
S
SW
120
150
180
210
240
External front
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:43:18

Fig. 95

NE
E
SE
S
30
60
90
120
150
180
107 capsey road, ilfield, Crawley,
RH11 0UF
28 Aug 2026, 10:45:41
External front

Fig. 96

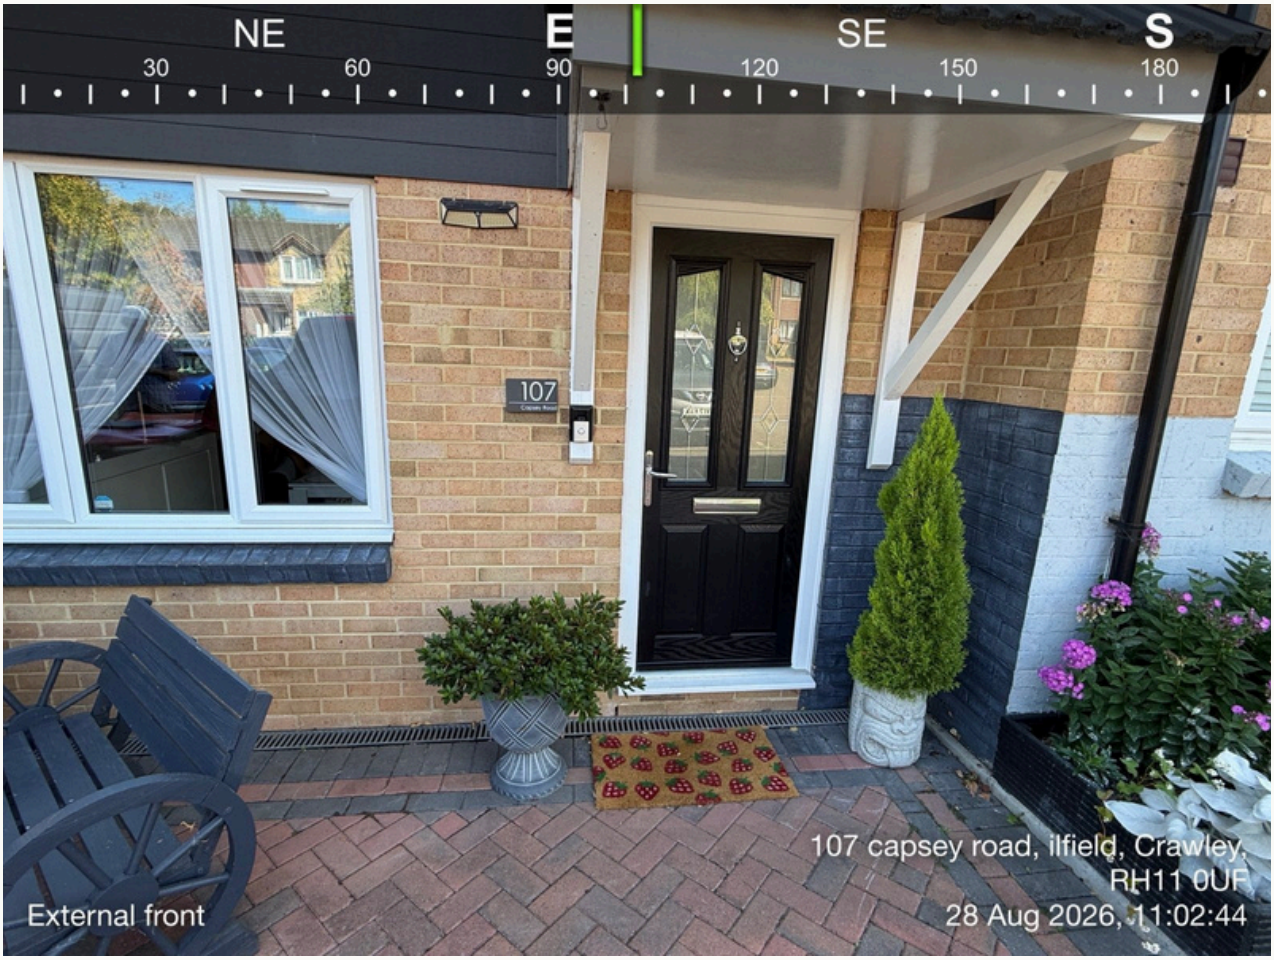
NE
E
SE
S
30
60
90
120
150
180
107
107 capsey road, ilfield, Crawley, RH11 0UF
28 Aug 2026, 11:02:44
External front

Fig. 97

N
NE
E
SE
0
30
60
90
120
150
107 capsey road, ilfield, Crawley,
RH11 0UFg
28 Aug 2026, 12:48:38
Internal kitchen

Fig. 98

G7 — Other grounds features

Fig. 99

NE
E
SE
S
60
90
120
150
180
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:04:01

Fig. 100

NE
E
SE
60
90
120
150
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:04:10

Fig. 101

NE
E
SE
60
90
120
150
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:04:39

Fig. 102

NE
E
SE
30
60
90
120
150
External
107 capsey road, ilfield,
Crawley, RH11 0UF
28 Aug 2026, 10:05:02

Fig. 103