


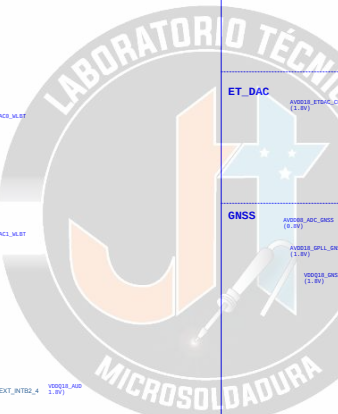
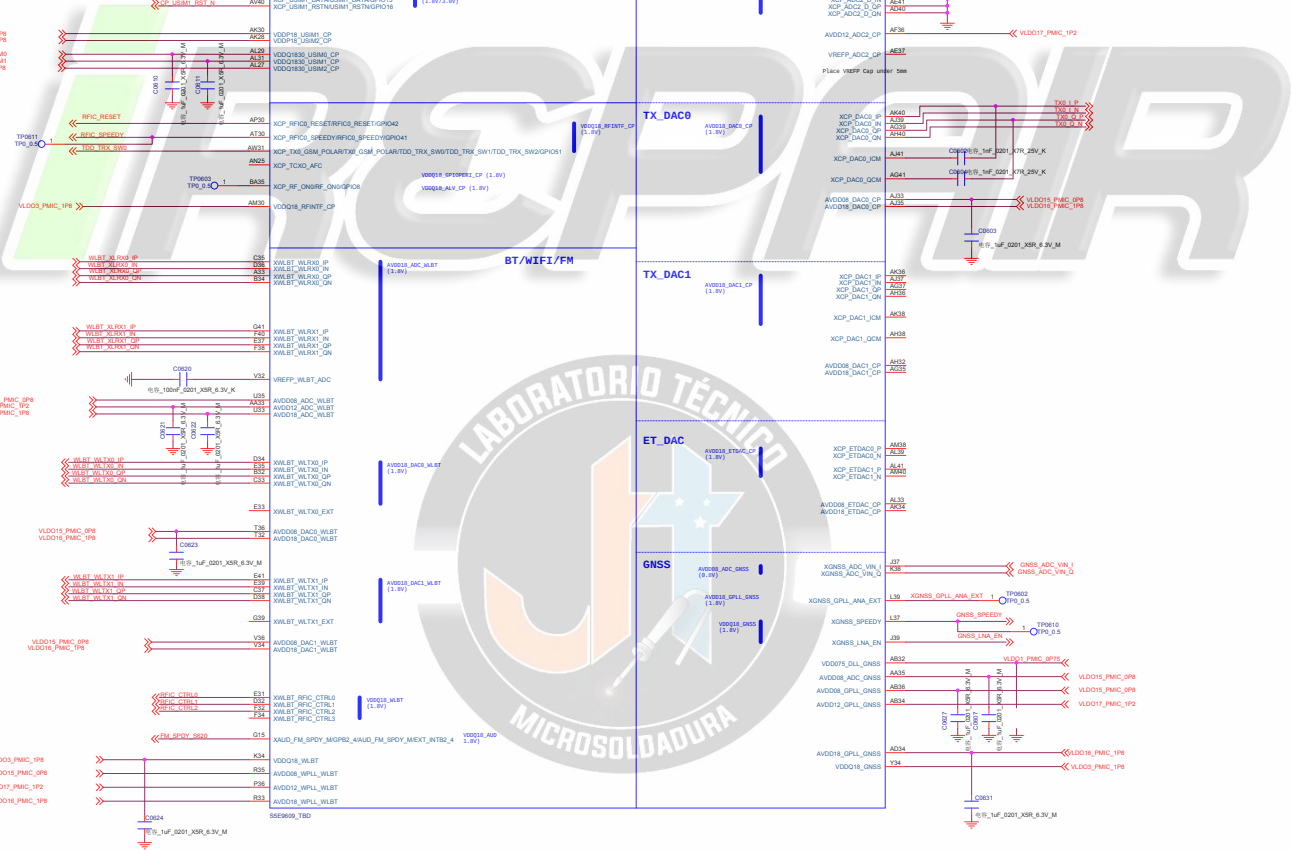

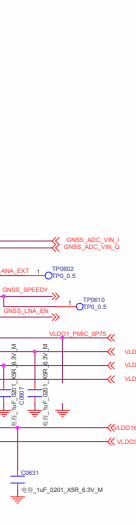
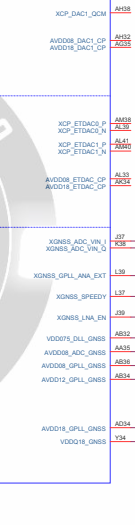
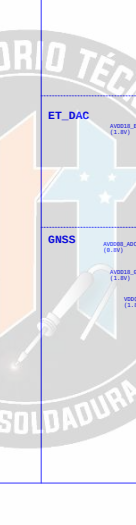
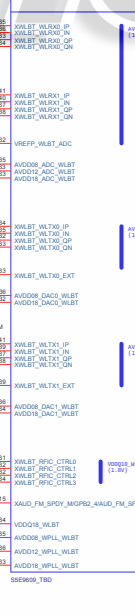
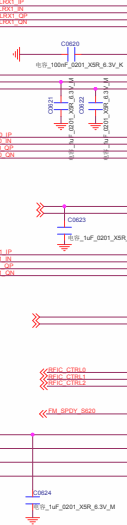


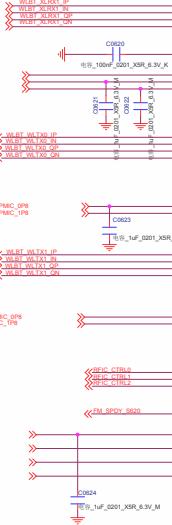

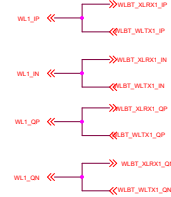

Rev	<Title>	Rev
Rev	Document Number	Rev
D	<Doc>	<Doc>
Doc	Microsoldadura 14.01.2018	Page 6 of 24

iREPAIR

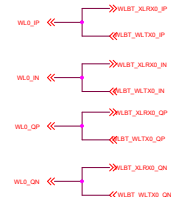

MSM8953
MIPI


File	
<Title>	
File	Document Number
ID	<Doc>
Date	Wednesday, November 14, 2018 12:08 PM




iREPAIR



MSM8953
RF

File	
<Title>	
File	Document Number
ID	<Doc>
Date	Wednesday, November 14, 2018 12:08 PM

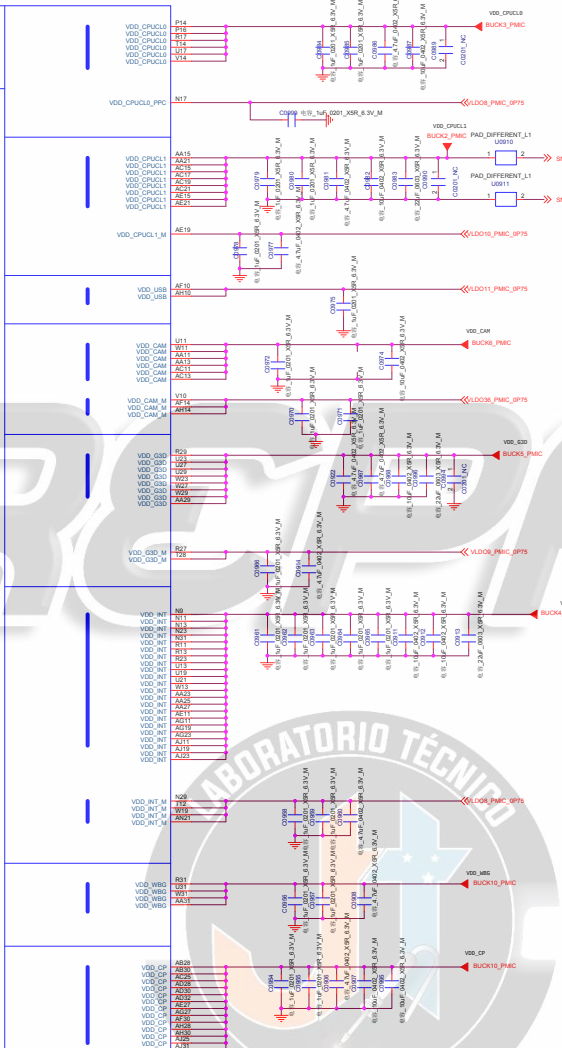[illegible]

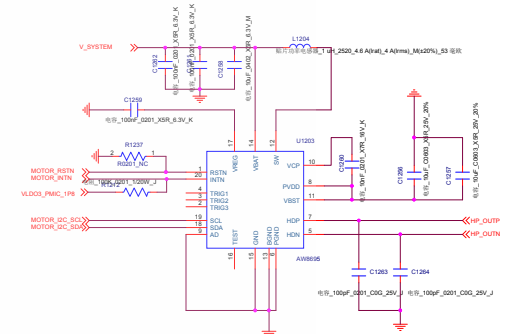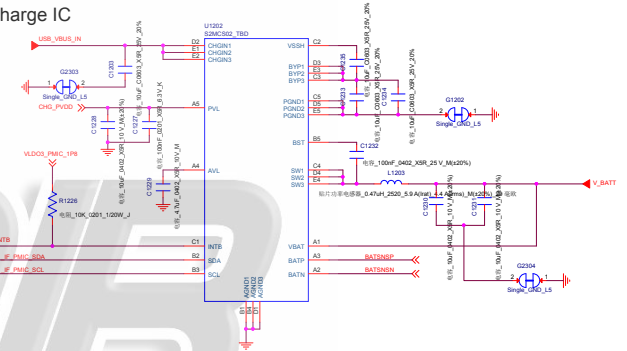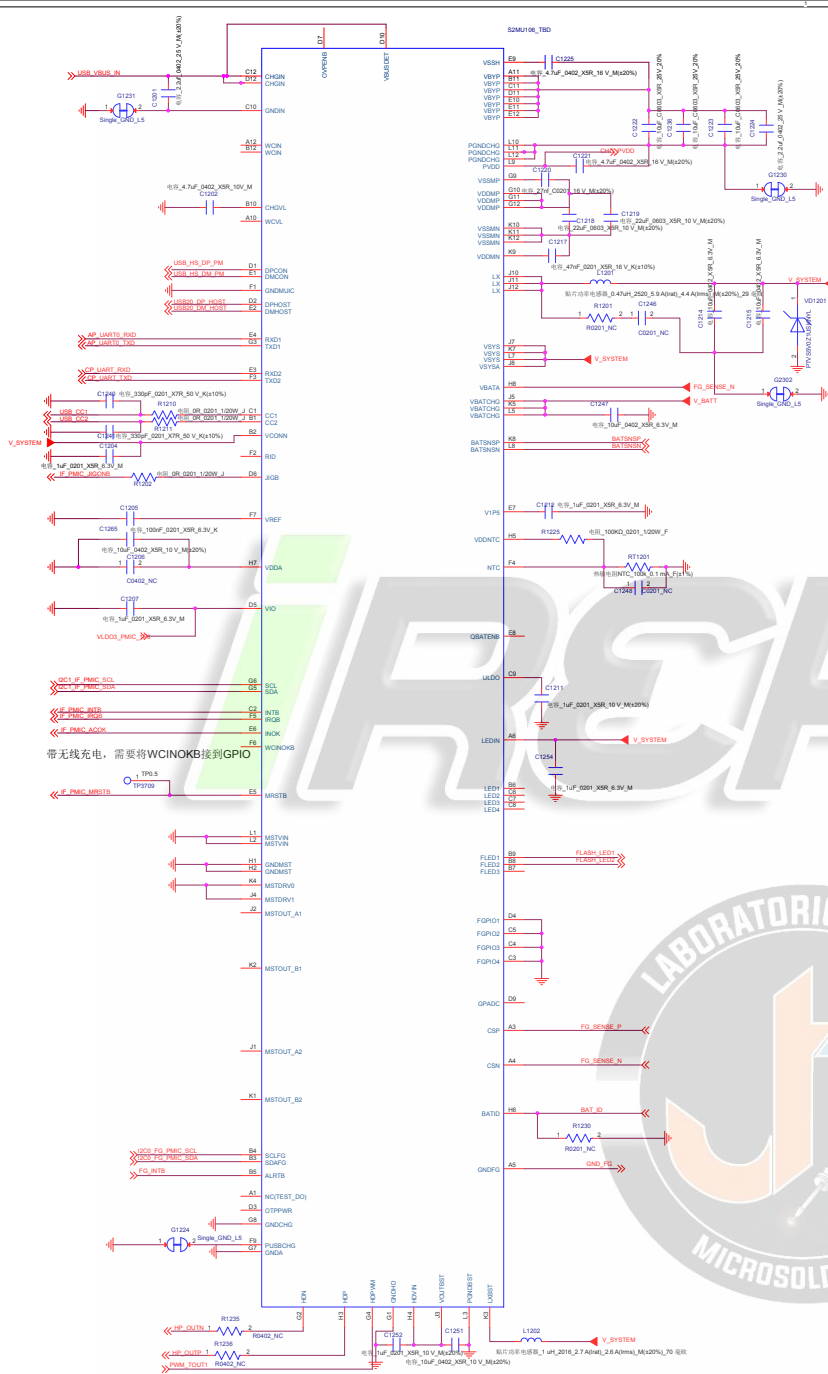


address of AW8695 is
AD:L 0X5A H 0X5B

iREPAIR



iREPAIR



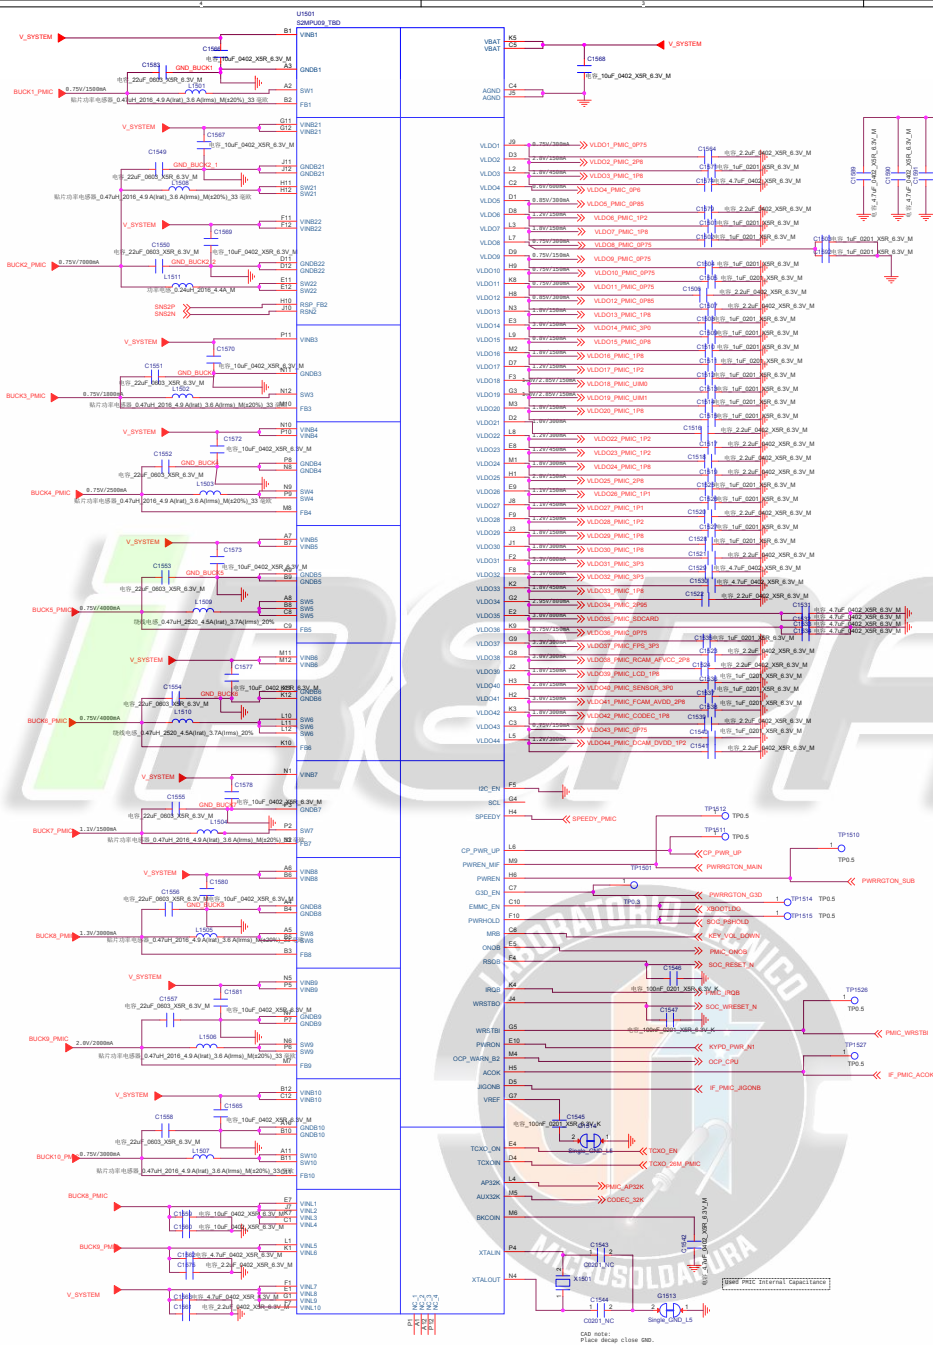



iREPAIR




Title <Title>			
Size A	Document Number <Doc>		Rev <RevCode>
Date:	Wednesday, November 14, 2018	Sheet 16 of 44	

iREPAIR



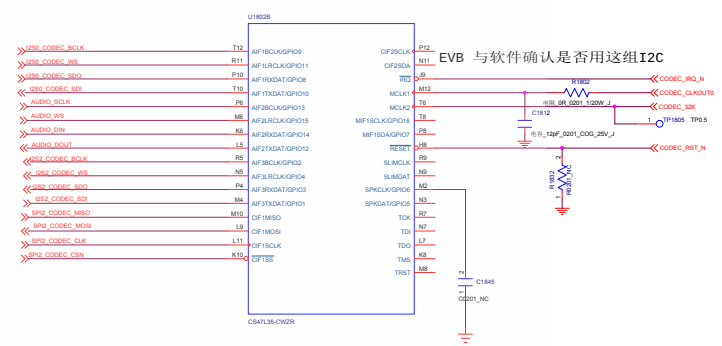

UFS2.0

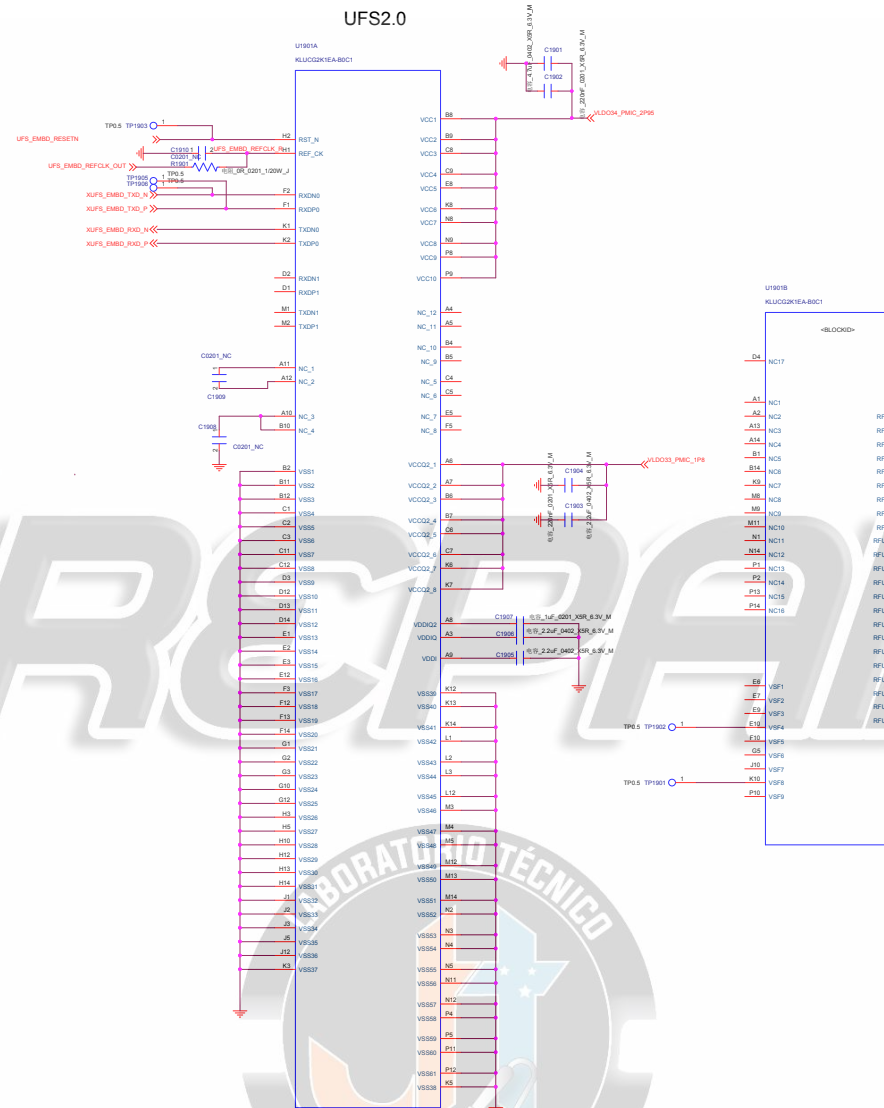

CAD Notes :
Place TP close to the via to minimize stub length.

CC Logic??

iREPAIR



iREPAIR



iREPAIR




Title <Title>			
Size A	Document Number <Doc>		Rev <RevCode>
Date:	Wednesday, November 14, 2018	Sheet 22 of 44	

iREPAIR




ACCELEROMETER+GYRO


I2C ADDRESS 0X68 0b1101000

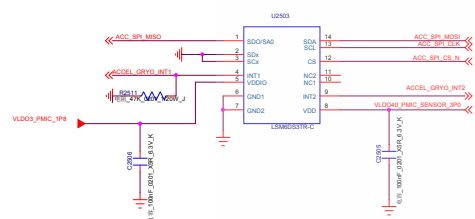

Magnetic Sensor

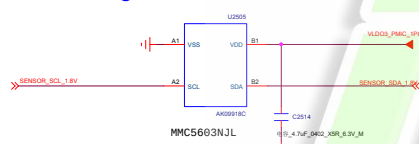


address of AK09918 is 0X0C
MMC5603NJL is 0X30

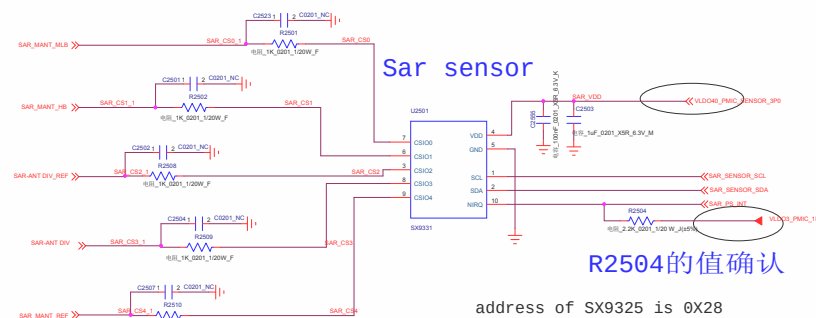

address of SX9325 is 0X28

ALS/P SENSOR CONN






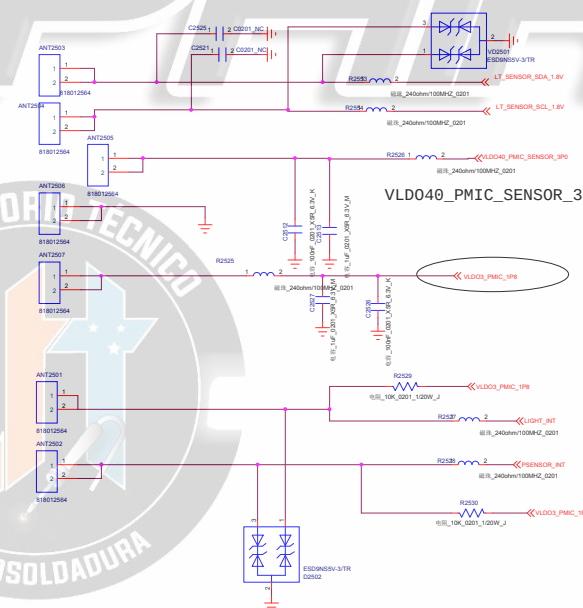


VLD040_PMIC_SENSOR_3P0 need Software change to 3.0V

LCD/TP-Connector




LDO

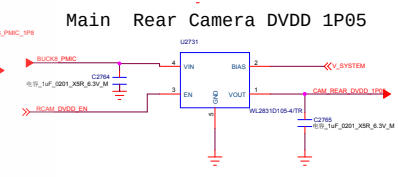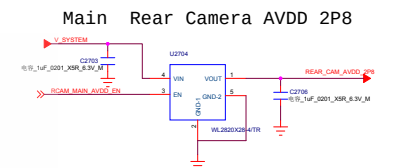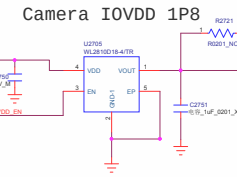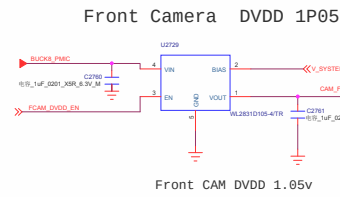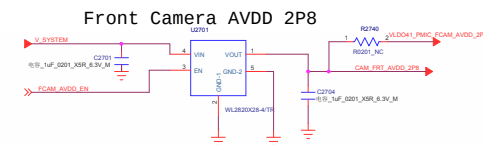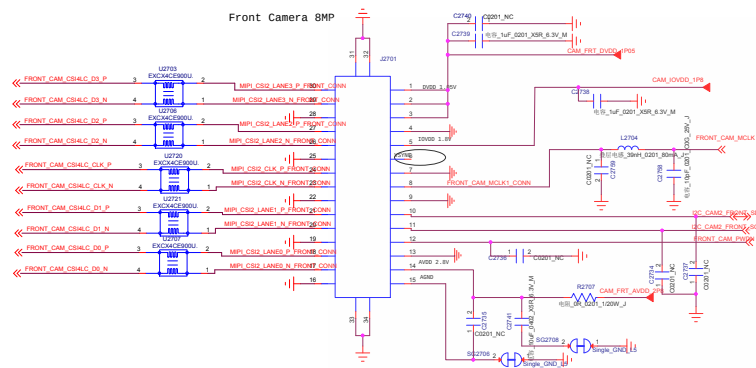


前闪


后闪

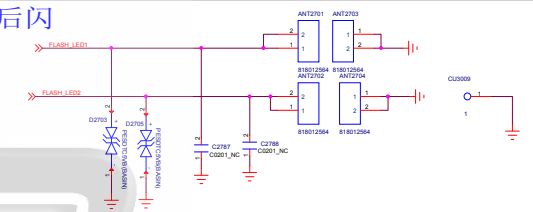

Slave Rear Camera

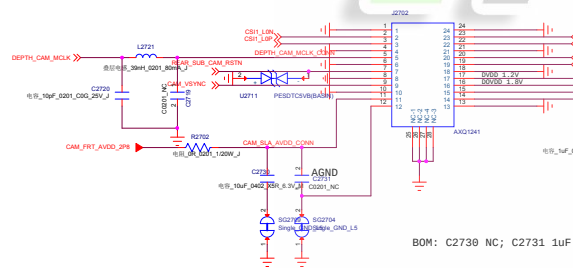


BOM: C2730 NC; C2731 1uF

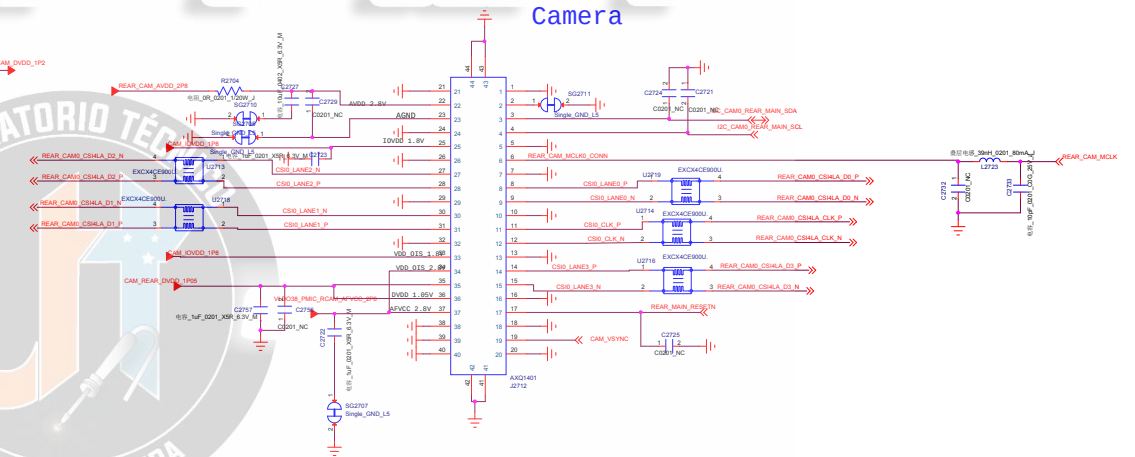

.Main/Slave Camera and Flash


Title			
<Title>			
Size	Document Number		Rev
D	<Doc>		<Rev>
Title: Wednesday, November 14, 2015			
Page		27 of 44	

音量键&开关机键

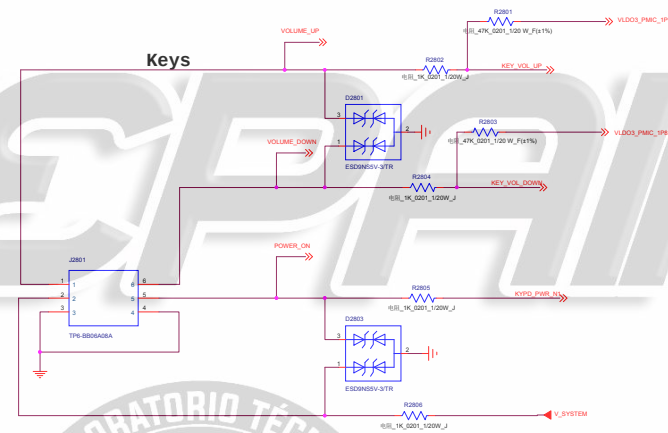

File	<Title>
Rev	Document Number
D	<Doc>
Date	Wednesday, November 14, 2018 11:28 AM

NFC

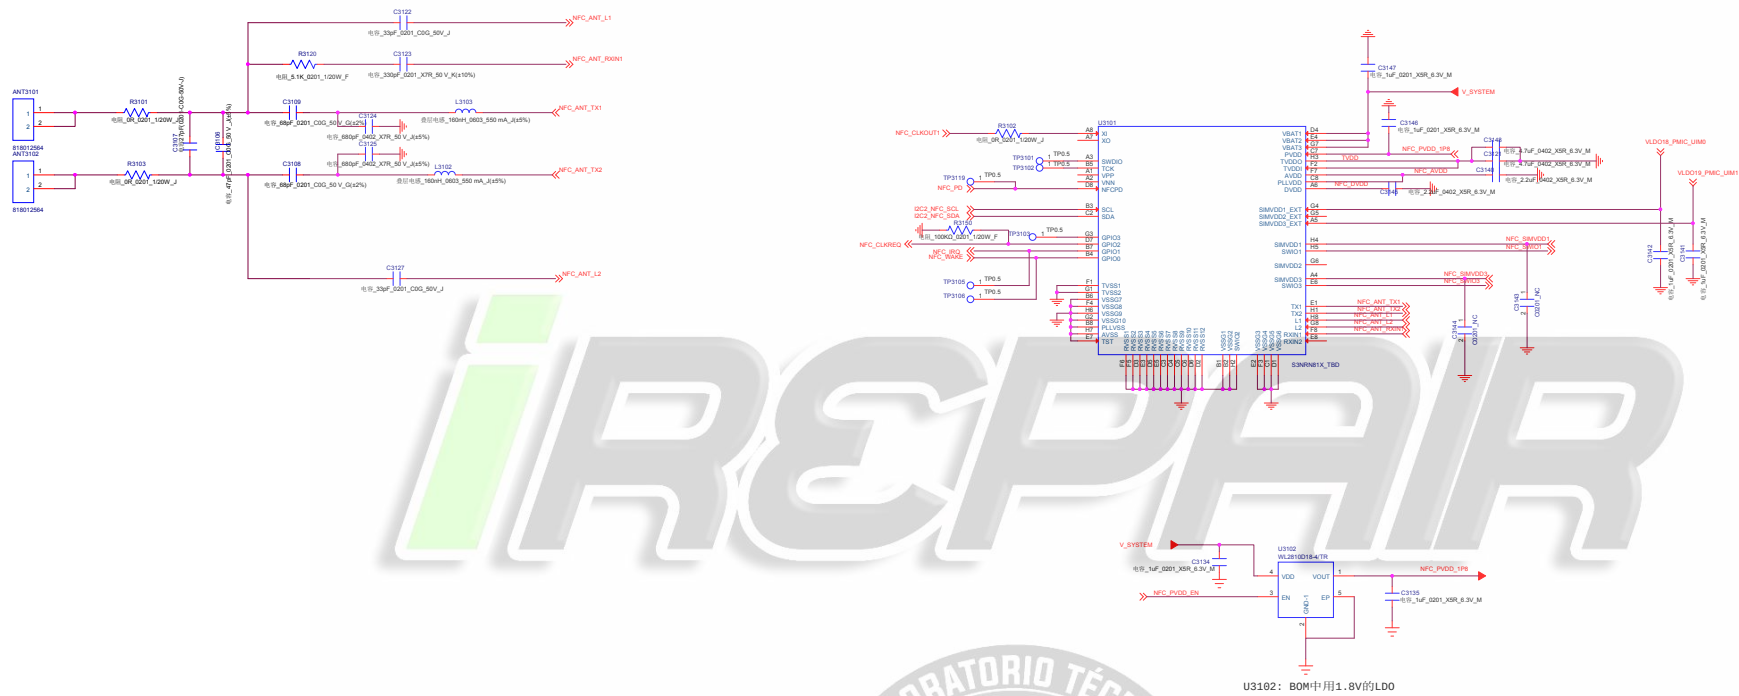


U3102: BOM中用1.8V的LDO




File	<Title>
Rev	Document Number
D	<Doc>
Date	Wednesday, November 14, 2018
Page	31 of 35


PRIMARY_ANTENNA

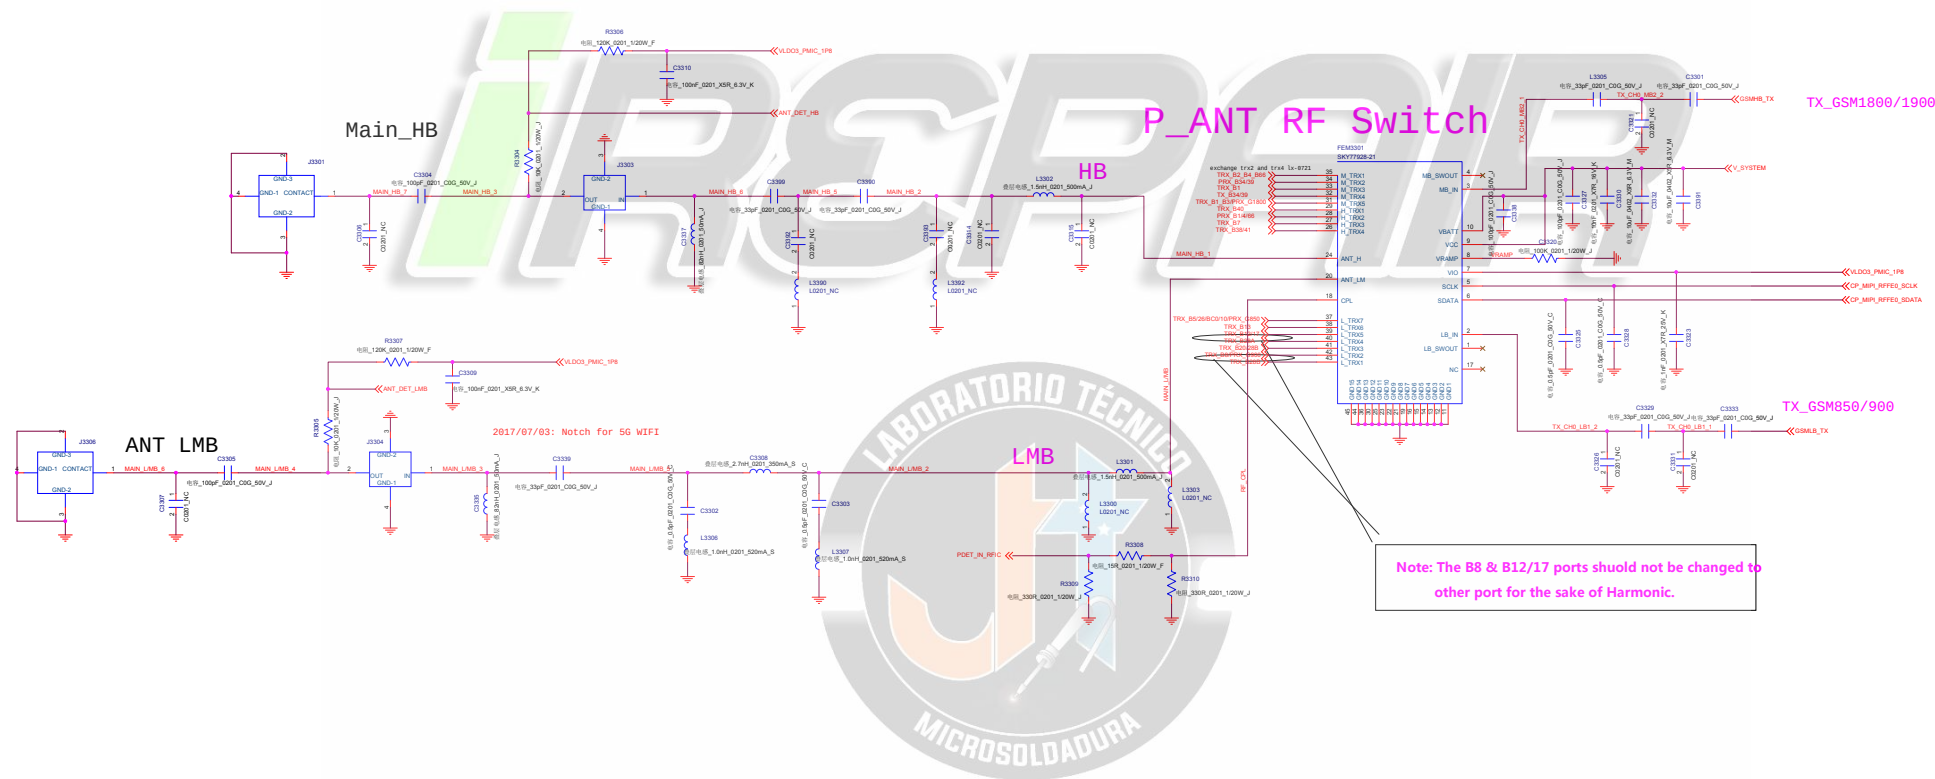

Company Hsuan		
Block Title PRIMARY_ANTENNA		
Project	Taller	Rev 1.0
Doc	Working Document 14	2018-03-07 27






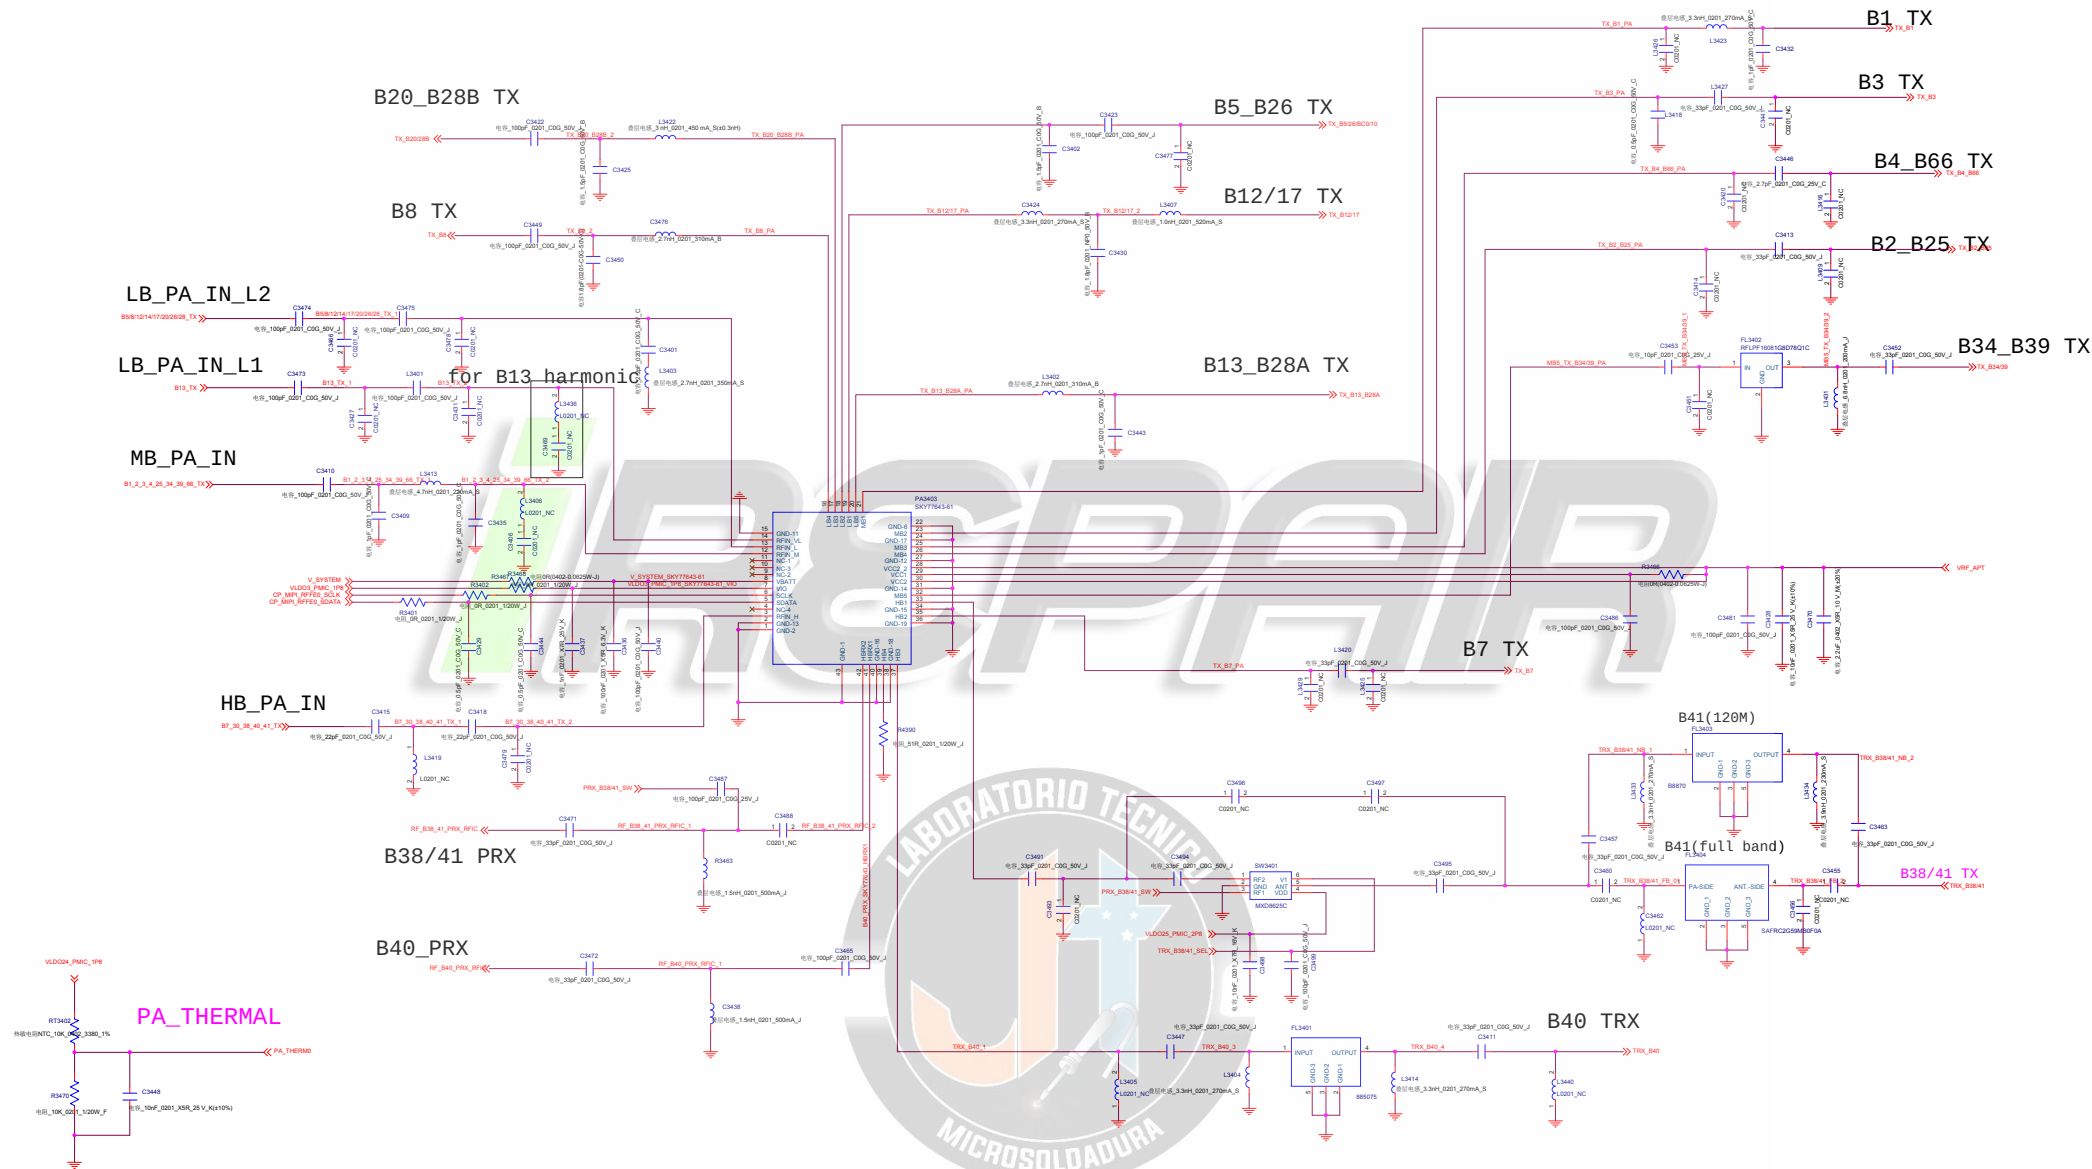


Company: Hsuan			
Block Title: PA & PA THERMAL			
Project:	Taller:	Rev:	1.0
Doc:	Working: November 14, 2020	25	07

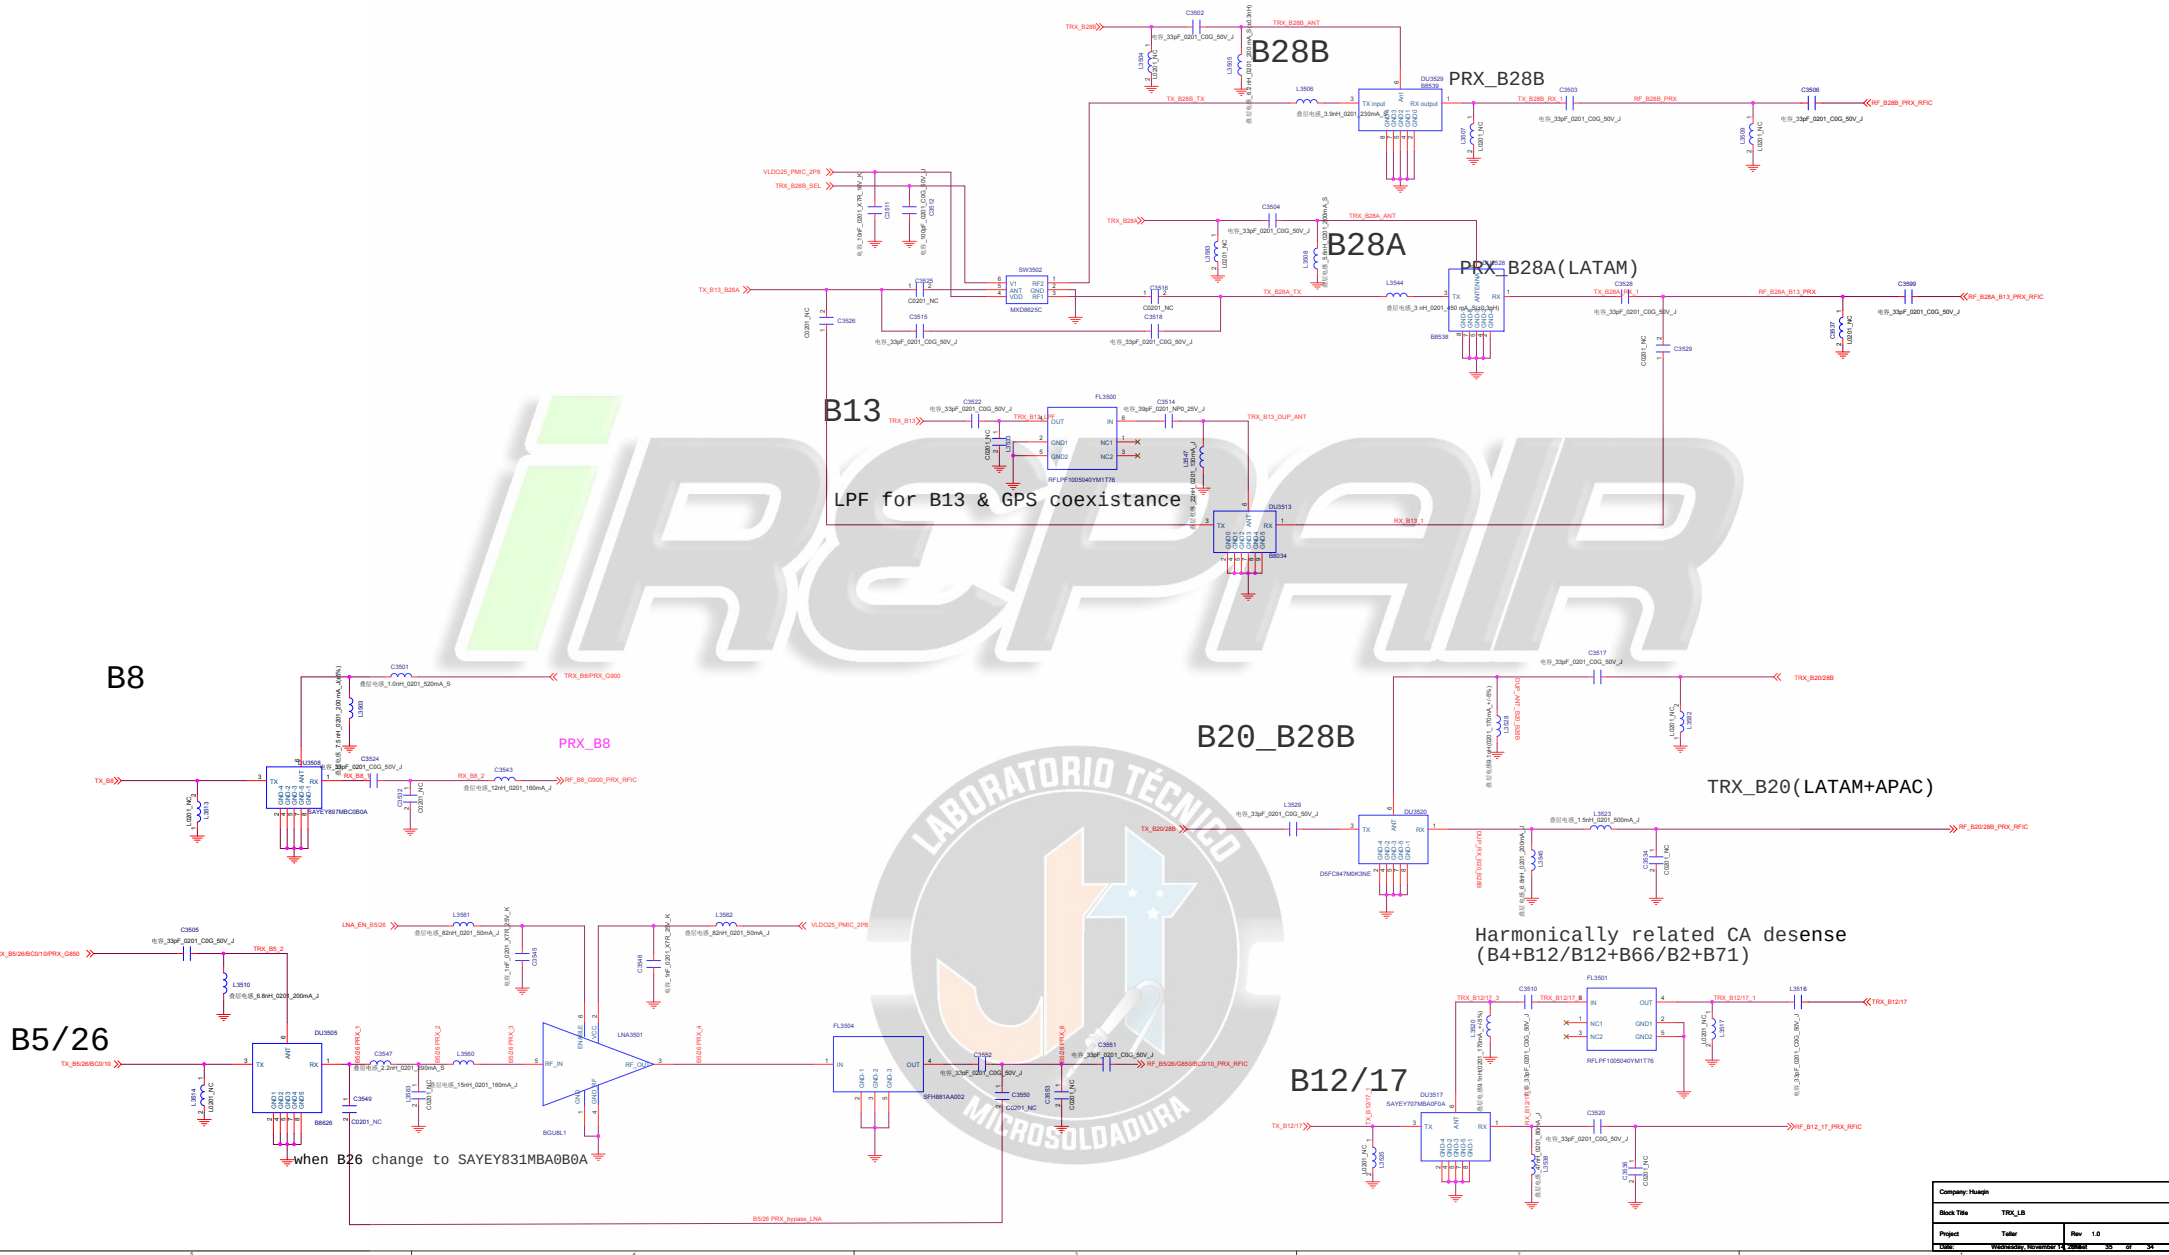

Company Huan			
Block Title	TRX_LB		
Project	Taller	Rev	1.0
Code	Workstation	Number	14


DRX_MB_HB

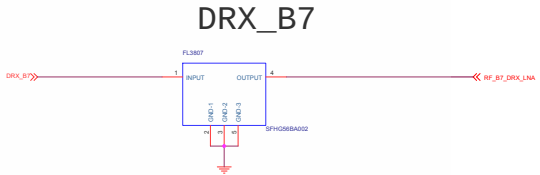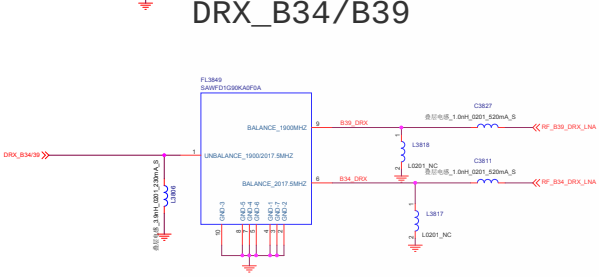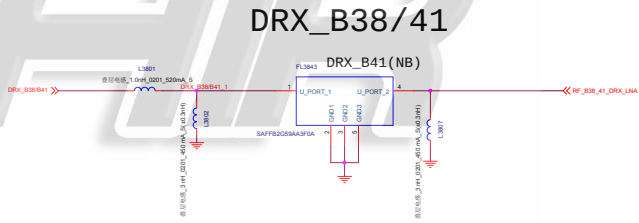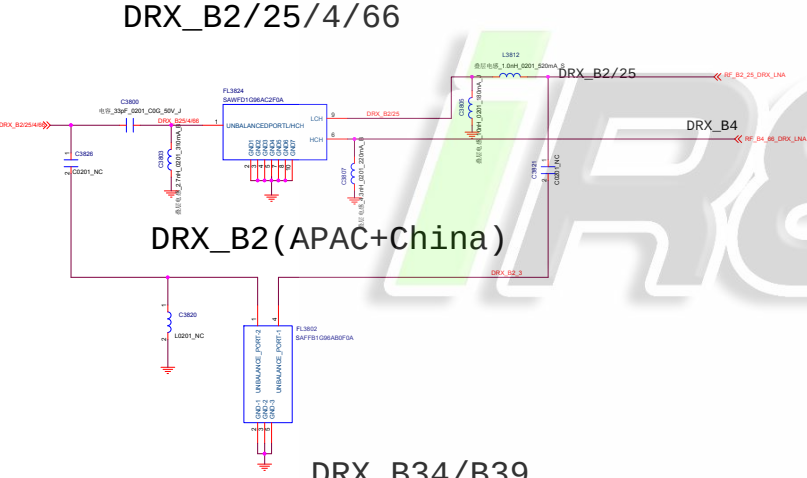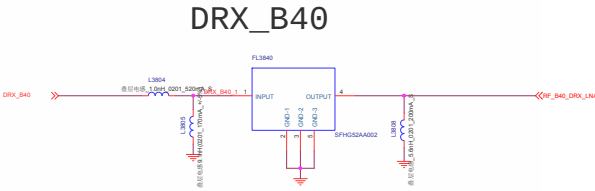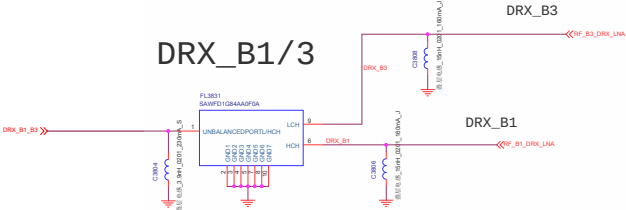


Company Hsiao			
Block Title DRX_MB_HB			
Project	Taller	Rev	1.0
Date: Wednesday, November 14, 2018 10:07 AM			

DRX_LB


DRX_B12/13/17

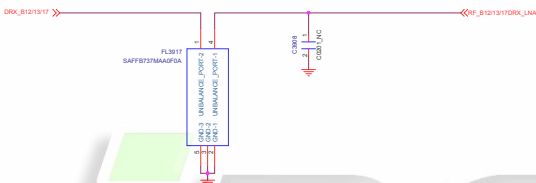


DRX_B8

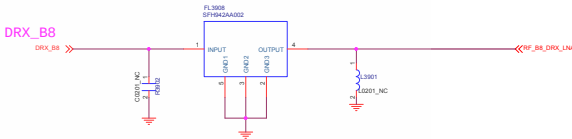


DRX_B28

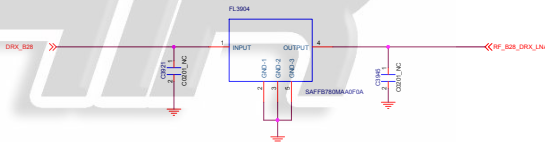




DRX_B5/26

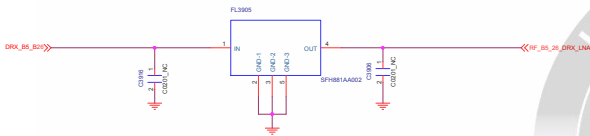


DRX_B20

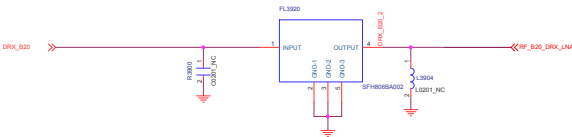

Company Name		
Block Title		
Project	Taller	Rev 1.0
Date		

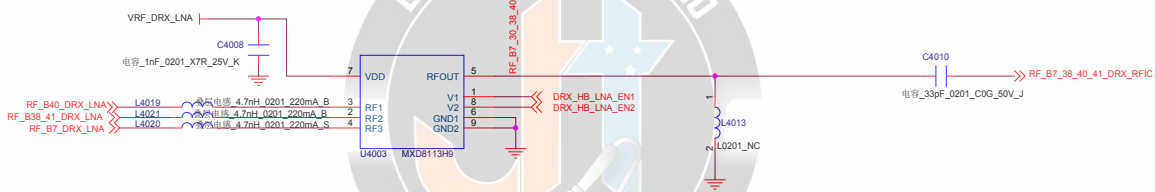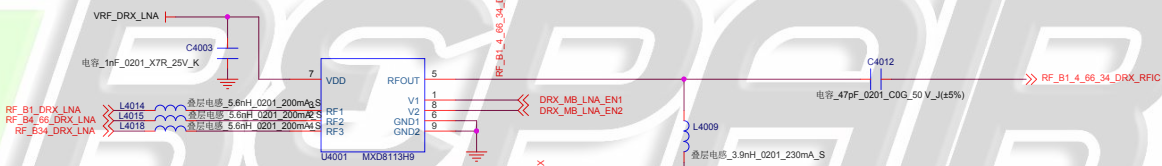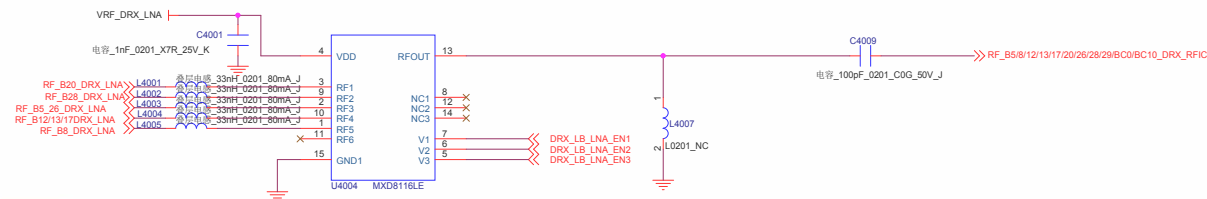


RFIC-S925

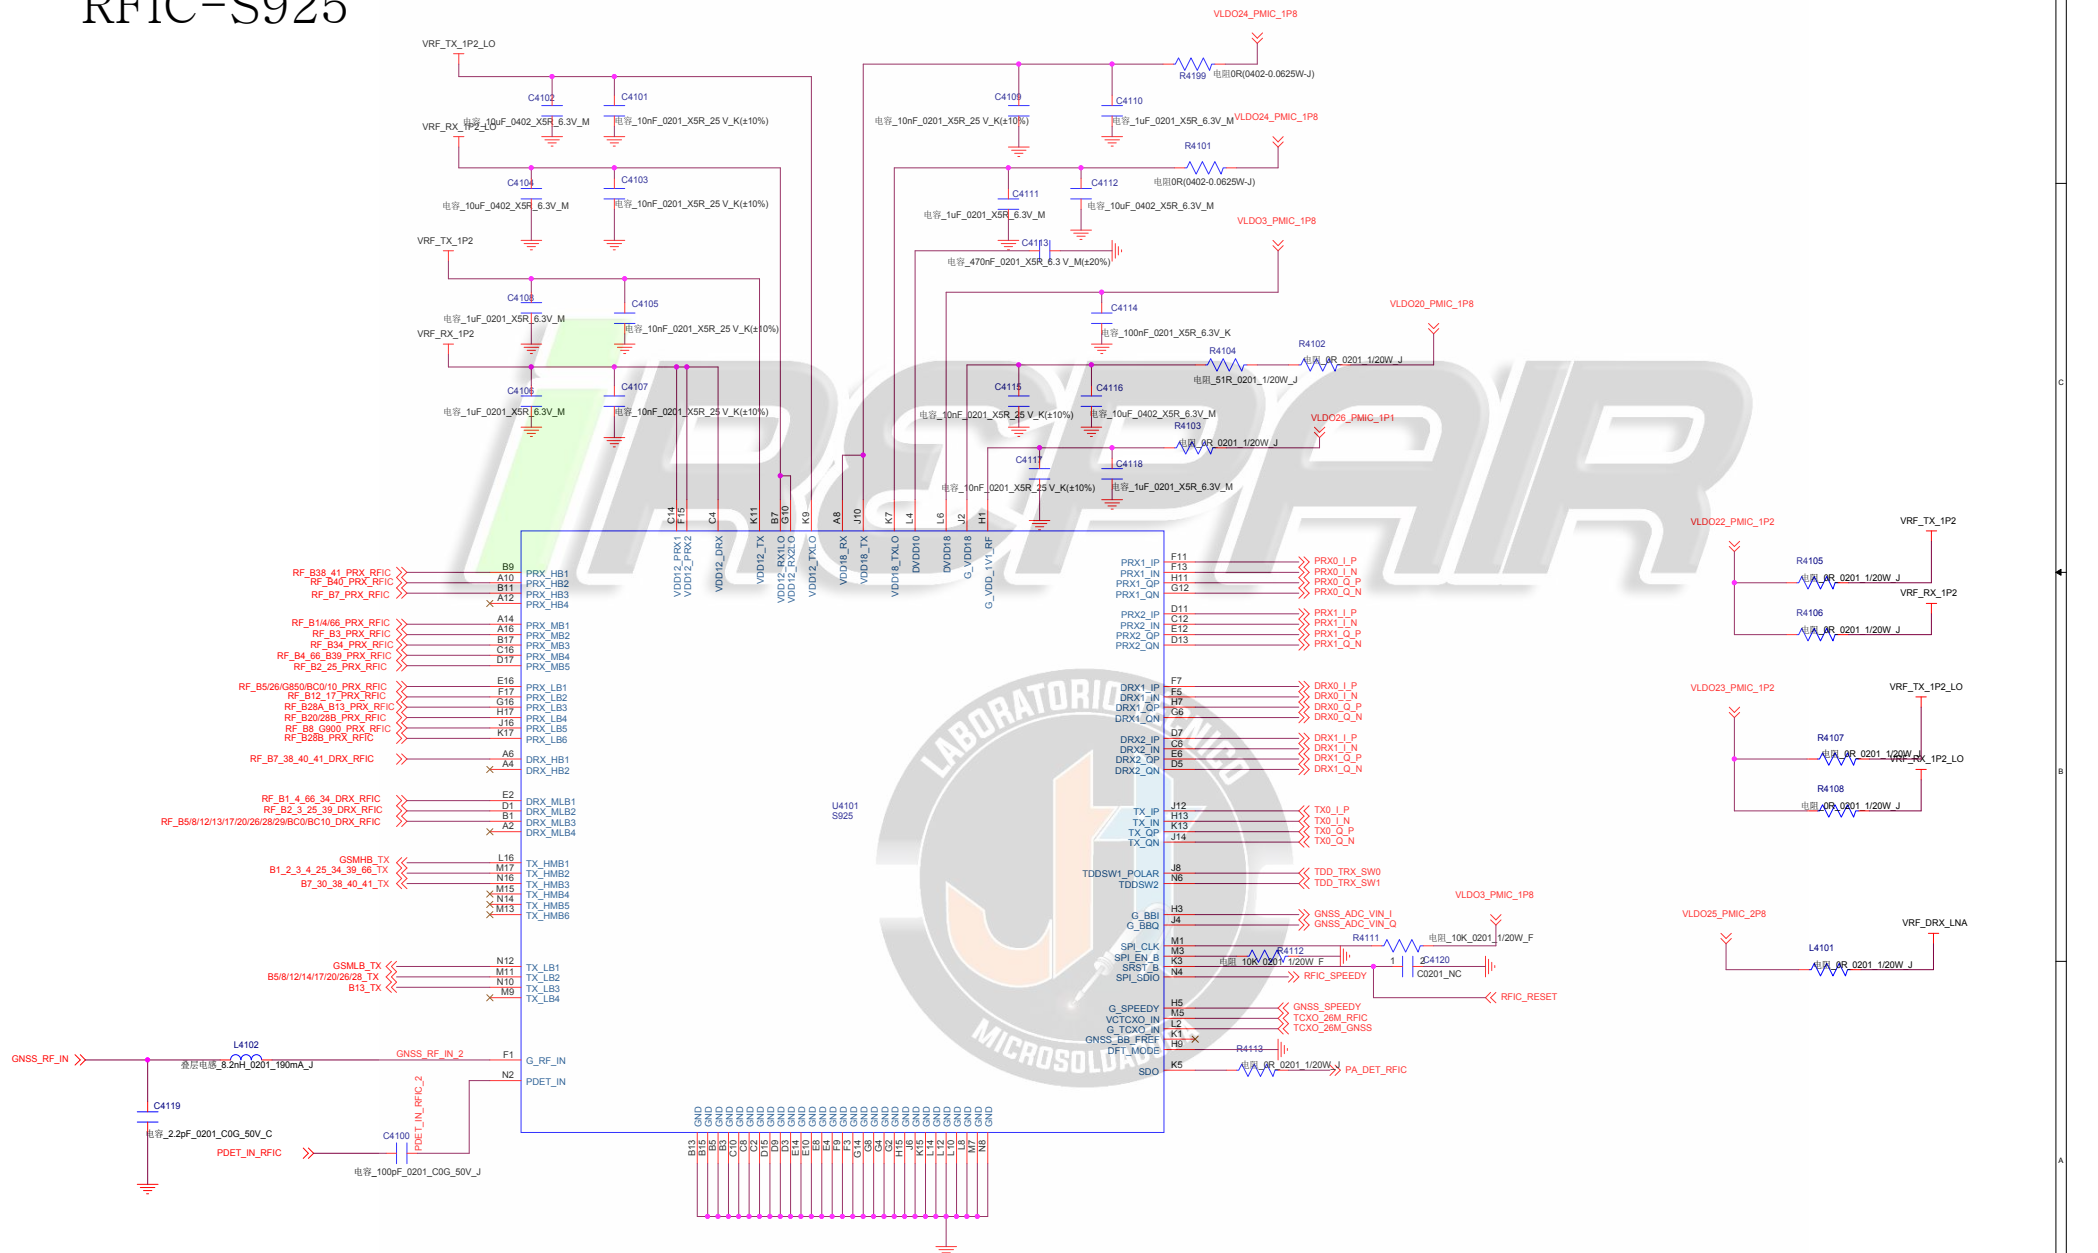

Title				<Title>			
Size	Document Number						Rev
C	<Doc>						<Rev Code>
Date:	Wednesday, November 14, 2018			Sheet	41	of	40

S2ABA01X01-6030 APT

APT
DC/DC

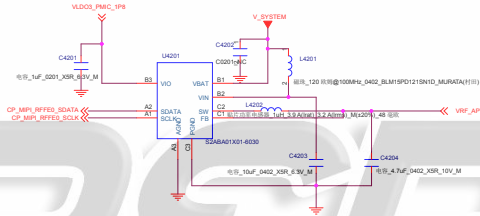


iREPAIR




Company Name			
Stock Title			
Project			
Title			
Rev			
1.0			
Date			
2023-07-01			
Page			
42 of 41			

WIFI_2.4G_5G & BT & GPS

WIFI0 2.4G/BT/GPS

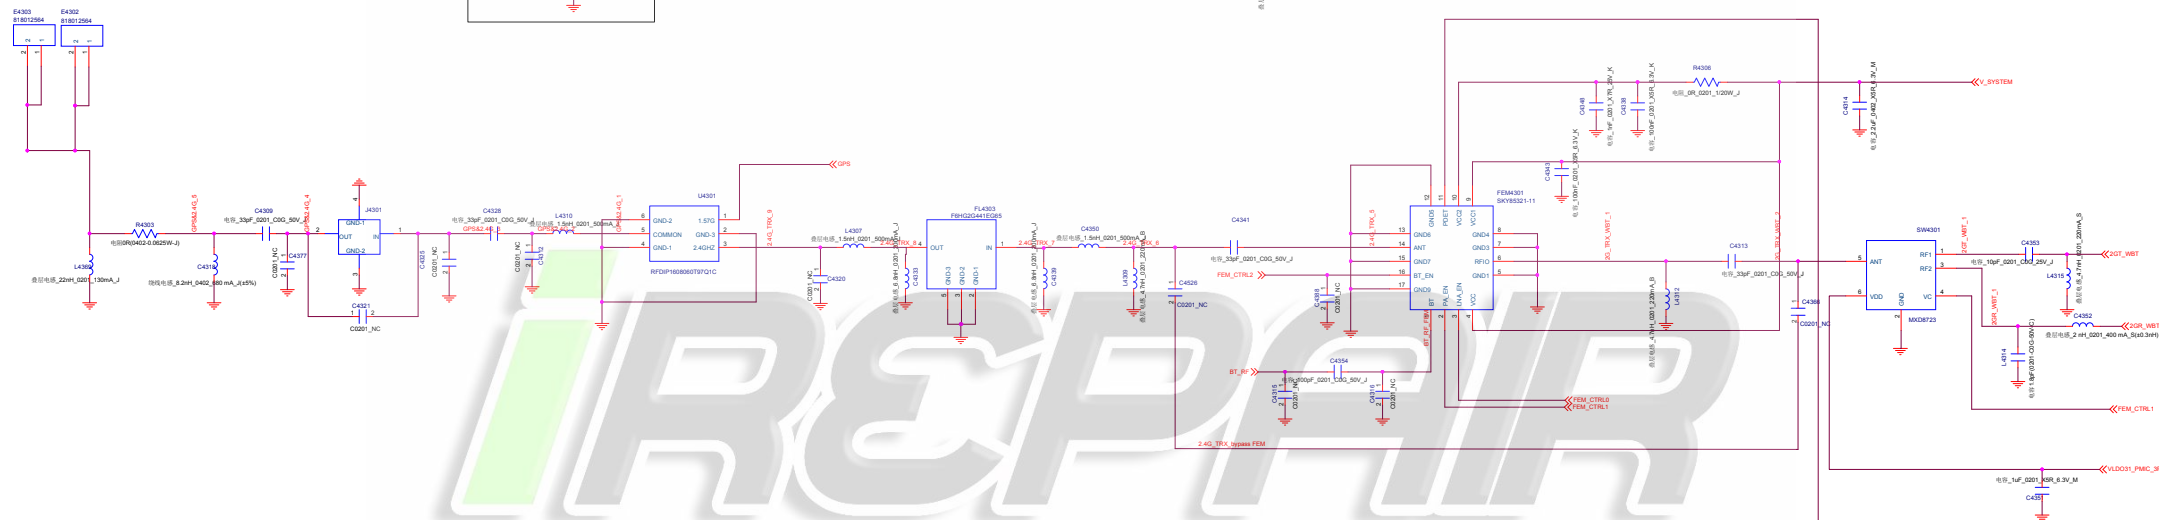

WIFI0 5G

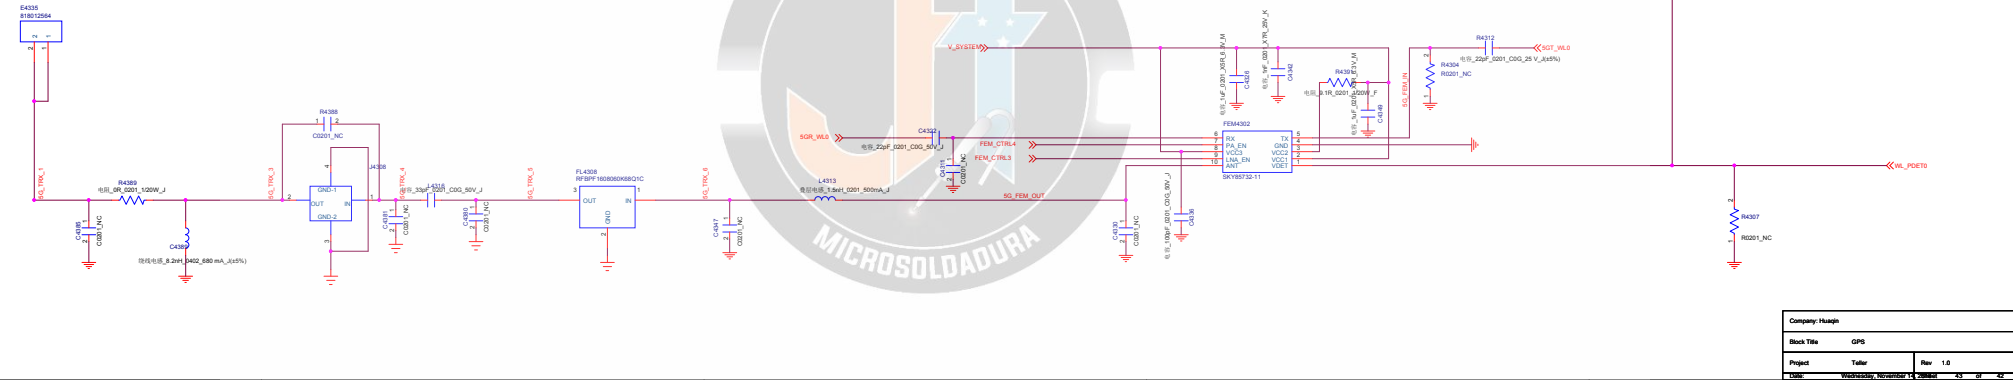

Company Hsuan			
Block Title GPS			
Project	Taller	Rev	1.0
Version: 1.0			

iREPAIR



Company: Huajin			
Block Title WIFI 2.4G/5G/BT			
Project Teller		Rev 1.0	
Date: Wednesday, November 14, 2018 12:44:01 43			

