



Prepared For: Francis Kurupa and Bini Mathew

Property Address: 2839 Pendleton Dr, San Jose, CA 95148

Inspector: Dennis Spencer

Company: WIN Home Inspection Santa Cruz
dba
(831) 214-8805
dspencer@wini.com

4/25/2017

4/25/2017

DocuSigned by:

Francis Kurupa

4F4E8CEB5360486...

DocuSigned by:

Bini Mathew

D3A7B6C4B6D5452...

Services Included in this Report:

Extended Full Home Inspection



NOT A WARRANTY

THE SERVICES PERFORMED, THE AGREEMENT, AND THE REPORT DO NOT CONSTITUTE A WARRANTY, AN INSURANCE POLICY, OR A GUARANTEE OF ANY KIND, NOR DO THEY SUBSTITUTE FOR ANY DISCLOSURE STATEMENT AS MAY BE REQUIRED BY LAW.

There are no warranties made against roof leaks, wet basements, or mechanical breakdowns. The report is NOT a listing of repairs that need to be made. Therefore, you agree NOT to hold us responsible for future failure and repair, or for the non-discovery of any patent or latent defects in material, workmanship, or other conditions of the property which may occur or become evident after the date the services were performed; nor for any alleged non-disclosure of condition that are the express responsibility of the seller of the property. You agree to assume all the risk for conditions which are concealed from view or inaccessible to us at the time that the services were performed.

THIS REPORT IS FOR THE EXCLUSIVE USE OF OUR CLIENT AS NAMED IN THE INSPECTION AGREEMENT. It may not be used or relied upon by any other person unless that person is specifically named by us in the Inspection Agreement as a recipient of this report. Distribution of this report to any third party without the written consent of the inspector and WIN Home Inspection is prohibited. As the client, you agree to maintain the confidentiality of this report and to reasonably protect the report from distribution to any third party. You agree to indemnify, defend and hold us harmless if any third party brings a claim against us relating to the inspection or to this report.

EXPLANATION OF TERMS

This report was prepared and written with the age of the structure and the comparable condition of neighborhood structures taken into consideration. Below is an explanation of the terms used in the report.

GOOD: Items marked Good appear to be new or nearly new. There are no visible indications of failure at the time the services were performed. The inspector recommends checking with the seller concerning any installation information that may pertain to this item.

FUNCTIONAL: Items marked Functional appear to be in serviceable condition using normal operating controls. There were no visible indication of failure at the time the services were performed.

SATISFACTORY: Items marked Satisfactory appear to be in serviceable condition using normal operating controls. There were no visible indications of failure at the time the services were performed. Items that need minor service that do not significantly affect an item's use may be classified as satisfactory.

ATTENTION: Items marked Attention appear to be in need of preventive maintenance or service. Attention may also indicate an item that the inspector would recommend gaining further information from a third party immediately in order to provide additional clarification and/or insight into the item's condition.

MAINTENANCE: Items marked Maintenance are in need of repair or replacement in order to make the item functional and/or prevent further deterioration.

ACTION REQUIRED: Items marked Action Required appear to be in need of immediate repair or replacement. Delay in repair or replacement may result in a dramatic shortening of the life expectancy of the item, have immediate effect on the item, system, structure, other related items, or present a potential health and/or safety hazard.

N/A: Items marked N/A are not included in the report. The item may not be present, not included, not accessible, not available, not addressed, not applicable, not appropriate, and/or not examined.



WIN Home Inspection

Extended Full Home Inspection

This report contains confidential information and is supplied solely for use by the client(s) of:

WIN Home Inspection Santa Cruz dba
7960 B Soquel Drive #202, Aptos, California 95003
(831) 214-8805

Work Order Number: 041917DS

Service Date: 4/19/2017

Time: 9:30 AM

Site Address:

2839 Pendleton Dr, San Jose, CA 95148

For the purpose of this inspection, the Main Entry Door faces:

Site Information:

Weather: °F - Sunny

Approximate Year Built: 1977

Structure: SF - Wood

Foundation: Raised Foundation

Bedrooms: 4

Bathrooms: 2.5

Floors: 2

Occupied: No

Client:

Name: Francis Kurupa and Bini Mathew

Address:

Work Phone:

Home Phone:

Mobile Phone:

Email Address: francis.kurupacheril@gmail.com,
binimathew@gmail.com,

Client Present at Inspection: No

Buyer's Agent:

Name: Surjit Kaur-Grewal

Company:

Address:

, CA

Phone: (650) 946-8100

Email: surjit@interorealestate.com

Buyer's Agent Present at Inspection: No

Seller's Agent:

Name:

Company:

Address:

,

Phone:

Email:

Seller's Agent Present at Inspection: No

Inspector: Dennis Spencer

WIN Home Inspection Santa Cruz
dba

License / Certification:

Email: dspencer@wini.com

Notes:

INSPECTION NOTICE

Your inspection was performed by Dennis Spencer dba WIN Home Inspection Santa Cruz. The inspector is a member of the American Society of Home Inspectors (ASHI), and has performed approximately 2,000+ inspections since 2010.

The inspection is to be considered preliminary in nature and the inspector may make recommendations for further evaluation by an individual who is an expert or specialist in one or more specific building components or systems. Testing, measuring, or preparing calculations for any system or component to determine adequacy, capacity, or compliance with any standard is outside the scope of this inspection. Not all improvements or deficiencies will be identified during this inspection. NO INSPECTION CAN WHOLLY ELIMINATE THE UNCERTAINTY REGARDING THE



PRESENCE OF PHYSICAL DEFICIENCIES AND THE PERFORMANCE OF THE BUILDING'S SYSTEMS. The inspection and report are intended to reduce, but not eliminate, the uncertainty regarding the potential for component or system failure and to reduce the potential that such component or system may not be initially observed. All repairs, further evaluation or suggestions from this report should be performed prior to the end of any inspection periods and before close of an escrow to minimize any unforeseen issues. **UNEXPECTED REPAIRS SHOULD BE ANTICIPATED.**

Acceptance of this report constitutes agreement to the terms of the Inspection Agreement, whether or not signatures or initials have been obtained. The findings in the report are solely intended for our direct client listed on this report. We are not liable for the findings to any other party relying on this report, except for the client listed. If this report is to be used in the sale/purchase of the property by someone not named as the client, a re-inspection, buyer consultation or new inspection of the property is required.

Excluded from this inspection is any system, structure or component of the building that is inaccessible, concealed from view, or cannot be inspected due to circumstances beyond the control of the inspector. Also excluded are: Engineering analysis of any kind including structural integrity, system/component design problems, functional adequacy, operational capacity, quality, or suitability for a particular use; building codes, clearances, etc.; operation of shut-offs, breakers, valves, etc.; water testing for roof, wall or window leaks; concealed roofing membrane integrity; concealed floor cracks and all underground components; product recalls or other such notices; detection of or identification of Chinese drywall, molds, asbestos, lead, or other hazardous materials; component/system cost estimates or remaining useful life (RUL) estimates; specific components noted in the inspection report as being beyond the scope of the inspection; effects of adjoining/adjacent properties; installation guidelines and manufacturer's specifications.

This inspection will be performed in accordance with the scope and standards of practice of ASHI, a nationally recognized home inspection association. A copy of these standards is available through your home inspector upon request or at www.ashi.org.

MOLD DISCLAIMER: The inspector is not a qualified mold inspector or expert in bio organic growth. We are not qualified to inspect, identify or give opinions regarding molds or airborne agents. Many times, the presence of mold is not readily visible and can appear in a short time span. If the residence is vacant, leaks have occurred, sub area moisture/dampness, and/or heat has been turned off to the home, molds may be present. This inspection is limited to visible and accessible areas at the time of the inspection. We recommend you hire a certified mold inspection company for further evaluations and/or to conduct a thorough inspection.



SUMMARY SECTION

Extended Full Home Inspection Summary Report

We have identified various items on the subject structure that either require maintenance now or require periodic maintenance in the normal course of ownership. This is only a summary report and is intended as a guide to be used in both short and long term scheduling of maintenance items. Please read the complete report carefully as additional information and details are contained therein. It is always advisable to use experienced tradespeople or a qualified handyperson when contracting for work that may not be within the scope of your capabilities.

1. Structure - Smoke Detector(s)

Missing BR

Smoke detectors are required to be in service in the hallways or rooms adjacent to the bedrooms in proximity to the entry doors of the bedrooms, in each bedroom or sleeping area, and one on each level of multi-level structures. At the time of the inspection there were no smoke detectors installed in the bedrooms. Contact a qualified handyperson for installation of detectors in each of the bedrooms.

2. Exterior Structure - Eave / Soffit Areas

Maint - Sheathing

The roof sheathing at the front porch and at the northwest corner of the structure is damaged. Damage in this area is typically caused by leaks in the roof cover or gutter systems. Recommend removal and replacement of the damaged portions. Contact a licensed contractor for further evaluation and repairs. Referring to the current pest report for additional findings is advised.



Damaged sheathing at the front porch.




Damaged sheathing at the northwest corner.

3. Exterior Structure - Fascia Boards / Trim

Maintenance

The varge rafters at the front porch and at the northwest corner of the structure are damaged from moisture intrusion or wood damaging organisms. Recommend removal and replacement of the damaged portions. Contact the appropriate trade for further evaluation and repairs. Referring to the current pest report for additional findings is advised.

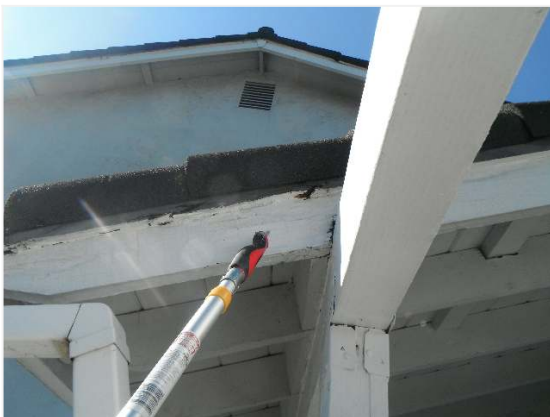

Damaged varge rafter at the front porch.



Damaged varge rafter and trim at the northeast corner of the structure.

The inspector noted some damage to the base of the trim at the garage exterior passage door, and in

Extended Full Home Inspection Summary Report

addition there is some damage to the base of door. Recommend repairing the damaged trim and door in order to prevent further deterioration and moisture intrusion. Contact a qualified handyperson for repairs.



4. Exterior Structure - Window Screens

Attention

The inspector noted that there were some damaged window screens at various windows. Installing or repairing the screens on those windows where the screens are missing or damaged is recommended to keep pests out of the structure

5. Structure Perimeter Exterior - Vent Screens

Attention

There is a missing foundation vent screen at the garage. The opening may allow vermin access into the garage space. Contact a qualified handyperson to install a foundation vent screen as a preventative maintenance measure.



6. Utility Services - Gas Service

Natural Gas

Flexible gas line passes through the rear garage wall. This is a substandard installation as gas lines that pass through walls are required to be rigid pipe. Recommend changing the flexible line with rigid pipe. Contact the appropriate trade for repairs.

Extended Full Home Inspection Summary Report



7. Patios/Decking/Porches - Railings

Maintenance

There is a damaged wood baluster at the front porch area. Recommend repair or replacement to prevent ongoing deterioration. Contact the appropriate trade for repairs.



8. Patios/Decking/Porches - Cover / Enclosure

Attention

There is some damage at the rear patio cover ledger board. Recommend monitoring and anticipating repairs in the future should the condition worsen.



9. Roof - Gutters / Down Spouts

Maintenance

There are rust stains and perforations in the gutter system at the upper north roof edge indicating advanced aging and probable leaks. Sealing the gutters from the interior may extend the gutters service life. Budgeting for replacement of the gutters in the near future is advised.

Extended Full Home Inspection Summary Report



There is no down spout at the southwest corner of the rear patio cover. Installation of a down spout is advised to prevent moisture from contacting the structure. Contact the appropriate trade for installation.

10. Electrical Service - Over Current Devices

Federal Pacific

The main electrical panel and the sub panel are Federal Pacific Electric (FPE) brand panels with Stab-Lock circuit breakers. Reports of failure with this equipment have been reported. Failure included breakers failing to trip at the stated ratings and breakers that still have power when turned to the "off" position. These panels also have poor breaker connections to bus bars, and some of these panels have insufficient wire bending space and insufficient gutter space. There are also incompatible metals between the bus bars and the breakers that may lead to deterioration over time. Consulting a licensed, qualified electrician for further evaluation is recommended.



11. Electrical Service - Panel to Structure

Copper/Aluminum

Some of the electrical circuit wiring is aluminum and the inspector does not invasively inspect the outlets, switches and connectors to determine if they are rated for aluminum wiring. The breakers are CU/AL (copper or aluminum) rated. Consideration should be given to having a licensed electrician remove and inspect the outlets, switches and connectors to determine if they are rated for aluminum wire for fire safety considerations.

Extended Full Home Inspection Summary Report



12. Electrical Service - Panel Cover

Attention

The inspector noted that there was an open slot on the sub panel cover. Installing a plastic blank in the open slot is recommended as a preventive safety consideration. Plastic breaker blanks can be purchased from a home improvement center and can be installed by a qualified handyperson or electrician.



13. Electrical Service - G.F.C.I. Protection

Attention

The ground fault circuit interrupters (G.F.C.I.)'s were spot tested and there appears to be a malfunction in the hall bathroom receptacle. The unit would not trip when tested. Recommend replacement of the receptacle so that it may function as intended. Contact a qualified person to make the repair.



14. Electrical Service - Outlets, Switches, Junction Boxes, Lighting

Functional

There is an open electrical junction box in the crawl space below the family room. Junction boxes are required to have a proper cover installed to prevent shock hazard and provide containment of sparks

Extended Full Home Inspection Summary Report

should arcing occur. Contact a qualified handyperson or electrician for installation of covers.



15. Heating System - Vents / Flues

Attention

The furnace exhaust flue is partially detached at a junction in the garage. This may allow spent gasses to exit the flue. Recommend sealing the open area. Contact the appropriate trade for repairs.



16. Plumbing - Encrustations Evident

Yes

There is an encrustation on the galvanized water supply pipe in the crawl space. Encrustations are an indication that the pipe is failing and leakage or blockage is imminent. Contact a licensed plumber to evaluate and make needed repairs.



17. Plumbing - Evidence of Leaks

Yes

There is a leak at the incoming water supply pipe at the front of the structure near the shut-off valve. Contact the appropriate trade for repairs.

Extended Full Home Inspection Summary Report



18. Water Heater - Safety Tie Down(s)

Attention

The tank is strapped with plumbers tape. This is allowed if the tape encircles the tank prior to being properly attached to the structure. In this instance the tape does not encircle the tank. Contact a qualified handyperson or plumber for proper strapping of the tank and compliance with state regulations. For further strapping information visit: http://www.seismic.ca.gov/HOG/waterheaterbracing_0...

19. Other Ext. Entry Doors - Door Fit

Maintenance

The living room sliding door is difficult to slide open. This may be due to worn rollers or tracks. Contact a qualified handyperson or appropriate trade for further evaluation and repairs.

20. Fire Place/Wood Stove - Rain Cap / Spark Arrestor

N/A

There is no spark arrester or rain cap on the chimney of this structure. Conditions may exist that may require a spark arrester for safe operation. Recommend checking with the local authority having jurisdiction to determine if spark arresters are required. Contact a qualified handyperson or chimney expert to install an approved spark arrester and rain cap if they are deemed to be required.



21. Kitchen(s) - Floor Cover Material

Attention

There is some warping present in the kitchen floor in front of the refrigerator which would indicate a water leak in the area at some time in the past. Recommend questioning the seller to determine if they are aware of any leaks in the area during their ownership and if they were repaired. The inspector did not note any moisture in the area at the time of the inspection.

Extended Full Home Inspection Summary Report



22. Kitchen(s) - Kitchen Fixtures

Attention

The aerator at the kitchen basin faucet is clogged, missing, or deteriorated and replacement/repair is recommend. Aerators can be purchased at most home improvement stores and simple thread into position.

23. Kitchen(s) - Stove / Cook Top

Gas: No Anti-tip

There is no anti-tip device installed on the stove to prevent it from tipping. Installation of an anti-tip bracket is advised to prevent accidents such as scalding of someone by spillage of hot liquids or contact with hot pans. Anti-tip hardware kits are available at appliance and home repair centers. Contact a qualified handyperson for installation.

24. Kitchen(s) - Cook top, Burners / Elements

Attention

The front right burner for the stove top did not appear to be functioning at the time of the inspection. Contact an appliance repair person to further evaluate and repair the burner.

25. Kitchen(s) - Stove Exhaust Fan

Maintenance-Inoperable

The exhaust fan is inoperable. Contact the appropriate trade for further evaluation and repairs.

26. Bedroom - Window(s)

Maintenance

There are damaged window sills in the master bedroom. Recommend repair or replacement to prevent ongoing deterioration. Contact a qualified handyperson or appropriate trade for repairs.



Example of damaged window sills.

27. Bathroom(s)/Washroom(s) - Mildew Noted

Yes

There is mildew staining in the tub/shower area of the hallway bathroom ceiling. Mildew in the bathroom area can be a health hazard, in addition to contributing to odor problems. Chemical cleaning is advised as well as keeping the area well ventilated.

Extended Full Home Inspection Summary Report

28. Bathroom(s)/Washroom(s) - Basin Drain

Attention

The master bathroom sink drain stopper does not function as intended. Contact a qualified handyperson for further evaluation and repairs.

29. Bathroom(s)/Washroom(s) - Shower Fixtures

Maintenance

The master bathroom shower mixing valve does not appear to function. Contact the appropriate trade for repairs, or have the seller demonstrate proper function.

30. Bathroom(s)/Washroom(s) - Toilet(s)

Attention

The master bathroom toilet hardware (flapper, handle, valve, etc) is not functioning as intended. Recommend repairs to restore proper function and/or reduce water usage. Contact a qualified handyperson for further evaluation and repairs.

31. 1/2 Bathroom - Toilet(s)

Attention-Not Low Flow

Water conservation ordinances require existing toilets to use less than 1.6 (or 1.28 in some instances) gallons of water per flush. This requirement is often enforced at the time of property transfer. The toilet is not labeled as a low flow unit and may not comply with the ordinance. Check with the appropriate water use agency for information in this regard.

32. Raised Foundation - Wood Members

Attention Stains

There are moisture stains on the rim joist beneath the kitchen that were dry at the time of the inspection. No damage was noted in these areas. Refer to the current pest report for additional information and any treatment recommendations that may be needed.





FULL REPORT



Home Inspection Details

(Italicized comments also appear in the summary report)

Structure

1. Description

Wood Framed Single Family

Two story single family residential home. We recommend two story homes have window locks in place to prevent a child from falling from an upper level window, and that portable emergency ladders be stored upstairs for exit out of windows in the event of a fire.

2. Approximate Year Built

Approximate Year Built 1977

This is an approximate age only provided to the inspector and should not be relied upon for exact accuracy. Checking with the local jurisdiction having authority to determine the exact age of the home would be required if an exact age is of importance. Some areas of the structure, and/or systems may not meet current construction standards, but may have complied with the standard of the time of construction. Some recommendations in this report may refer to current standards, however, they may not be required due to the age of the structure. This is a visual, non-invasive inspection, and does not include exhaustive calculations for the adequacy of the design of the building, or structural integrity. Due to inaccessibility of many structural components, it may not disclose all issues the home may have. For further exhaustive inspections or evaluations of the structure we recommend contacting the appropriate qualified and licensed professionals.

3. Bedroom(s)

Bedroom(s) 4

4. Bathroom(s)

Bathroom(s) 2.5

5. Other Room(s)

LR, FR

The other rooms consist of a kitchen, living room and family room.

6. Remodel / Modernization Evident

Yes

It appears that at some time during the life of the structure updates and modifications have been performed. The inspector recommends gathering public records, such as building permits, to determine whether/when updates were performed and whether any permits were needed and if so obtained. In addition, gathering builder and warranty information on materials or workmanship is recommended.

7. Repairs Evident

Yes

The inspector noted that there have been repairs to the structure or the structure's systems. We recommend determining whether any permits were needed and if so obtained, and whether there are any transferable warranties on materials or workmanship.

8. Insulation

Attic Only

9. Insulating Rating Evident

No

There was no documentation visible to indicate an insulation rating for the structure. Current recommendations for insulation include R-30 value in the attic space, R-19 value in the sub-structure, and R-13 value in the walls. These are minimum current recommendations to provide energy efficiency to a home. See insulation comments in the Structure, Attic, and Foundation sections of this report.



Home Inspection Details

(Italicized comments also appear in the summary report)

10. Smoke Detector(s)

Missing BR

Smoke detectors are required to be in service in the hallways or rooms adjacent to the bedrooms in proximity to the entry doors of the bedrooms, in each bedroom or sleeping area, and one on each level of multi-level structures. At the time of the inspection there were no smoke detectors installed in the bedrooms. Contact a qualified handyperson for installation of detectors in each of the bedrooms.

11. Carbon Monoxide Detector(s)

Present

The inspector noted the presence of multiple carbon monoxide (CO) detectors inside the structure. The detectors are battery operated, or have batteries as a back-up energy source. We recommend replacing the batteries in all of the units when the buyer takes possession of the property. Testing the units routinely and/or every month to identify functional operation is also recommended.

12. Alarm / Security System

Present

The structure is equipped with a security system. The system is not inspected under the scope of the inspection as the Inspector is not an expert in residential security systems. The inspector recommends questioning the current home owner on the condition and operation of the alarm system. Having the system inspected by a professional security company to ensure functional service is provided is recommended.

13. Asbestos Noted

Pre 1978

The scope of this inspection does not include an asbestos in materials sampling and/or identification inspection. Asbestos has been linked to certain health conditions and is considered by some to be a serious health concern. The only way to identify if any of the building materials contain asbestos is to have a qualified professional take a sample and have the sample tested by a qualified laboratory. Structures built prior to 1978 may contain this material in various substrates. If there is a concern, we recommend you contact an appropriate testing facility for further evaluation.

The structure has an acoustical (popcorn) ceiling material that could contain small amounts of asbestos if installed prior to the product being banned. The material was in satisfactory condition with no friable areas noted and appears to have been painted which encapsulates the material. Monitoring is advised and the product should not be disturbed (cut, sanded, demolished) without taking proper actions to assure that asbestos (if present) is not released into the home

14. Lead

Pre 1978

The scope of this inspection does not include a lead in materials sampling inspection. Due to the date of construction of this structure, there is a possibility that it could contain lead based paint and the paint could be under any top coats of paint that have been installed in the recent past. Recent legislation requires lead-based paint mitigation/containment measures be practiced during repair or remodeling of structures built prior to 1978. If there is a concern regarding the presence of lead we recommend contacting a lead inspection service for on-site testing.

15. Windows, Latches / Locks

Satisfactory

A representative number of window latches/locks were evaluated for proper function. Window coverings are not evaluated as part of this inspection. We recommend interested parties operate or evaluate the window coverings prior to the end of the inspection period.



Home Inspection Details

(Italicized comments also appear in the summary report)

16. Furniture / Storage

Average

The amount of furnishings and storage items in this structure are considered average for an occupied residence. There were furnishings and/or stored items inside the structure that limited the inspectors ability to visually inspect some areas of this home. Notation is made that the inspector does not move belongings in order to perform the inspection. Re-inspecting the structure is often recommended as issues may become visible once the structure is vacated.

17. Floor Structure

Girders

The floor structure consists of 4"x 6" beams (girders) spaced approximately 4' on center with concrete piers and wood support posts.

18. Ceiling Structure

Wood Trusses

The visible sections of the ceiling structure consists primarily of wood trusses. There may be different materials used that were not visible to the inspector. There did not appear to be any visual defects in the ceiling structure at the time of the inspection.

19. Roof Structure

Roof Trusses

The visible sections of the roof structure are made of wood trusses. There may be different materials used that were not visible to the inspector. There did not appear to be any visual defects in the roof structure at the time of the inspection. Note: Trusses are engineered and should never be cut, altered, or modified as this could compromise the structural integrity of the trusses.

20. Interior Walls

Textured Drywall

21. Interior Stairway Structure

Functional

The visible sections of the stairway structure appear to be without defects or damage. Not all areas of the stair structure were visible to the inspector.

22. Interior Ventilation Method

Kitchen

There is a ventilation fan in the kitchen over the cook top that appears to vent to the exterior of the home. Ventilation fan covers should be cleaned periodically to ensure proper function and provide maximum efficiency.

23. Fire Sprinkler System

Not Present

There was no fire sprinkler system installed in the structure at the time of the inspection. Fire sprinkler systems are a relatively recent requirement and the age of the structure likely predates this requirement.

24. Party or Lot Line Wall

No

Exterior Structure

1. Flat Surface Material(s)

Combination

The siding material consists of wood siding on the front of the structure with stucco siding on the remainder of the structure.



Home Inspection Details

(Italicized comments also appear in the summary report)

2. Painted Surfaces

Functional

In general the paint is in satisfactory condition. Repainting structures approximately every 7 to 10 years should be expected as part of a comprehensive maintenance program. Southern facing exposures tend to wear more rapidly and may require touch-up in between complete repaintings. Monitoring the condition of the paint is advised.

3. Caulking Structure

Satisfactory

In general the structure caulking is in satisfactory condition. Touching up the structure caulking around the tops and sides of the window and door trim is often needed in between paintings. The caulking keeps rain water from penetrating behind the siding material and causing premature deterioration of the material.

4. Siding Condition

Satisfactory

The siding material appears to be in functional condition. Periodically inspecting the siding for cracks, voids, staining, or damage is advised.

5. Weep Screed

Satisfactory

The weep screed could not be seen. The inspector felt the weep screed in a representative number of locations and did not note any blockage of the drain holes or deteriorated areas.

6. Eave / Soffit Areas

Maint - Sheathing

The roof sheathing at the front porch and at the northwest corner of the structure is damaged. Damage in this area is typically caused by leaks in the roof cover or gutter systems. Recommend removal and replacement of the damaged portions. Contact a licensed contractor for further evaluation and repairs. Referring to the current pest report for additional findings is advised.

7. Fascia Boards / Trim

Maintenance

The varge rafters at the front porch and at the northwest corner of the structure are damaged from moisture intrusion or wood damaging organisms. Recommend removal and replacement of the damaged portions. Contact the appropriate trade for further evaluation and repairs. Referring to the current pest report for additional findings is advised.

The inspector noted some damage to the base of the trim at the garage exterior passage door, and in addition there is some damage to the base of door. Recommend repairing the damaged trim and door in order to prevent further deterioration and moisture intrusion. Contact a qualified handyperson for repairs.

8. Exterior Columns / Support structures

Satisfactory

The visible sections of the columns appeared to be functional at the time of the inspection.

9. Window Glass

Satisfactory

The inspector did not note any broken or damaged glass panes at the time of the inspection.

10. Double Pane Seals / Insulating Windows

N/A Aluminum

Note: Most of the windows in this structure are single pane. Single pane windows are more susceptible to creating condensation which can stain and deteriorate the window sill areas. Due to the style and age of the windows upgrading to dual pane windows may be considered in the future to provide energy efficiency, noise reduction, and proper safety latches.



Home Inspection Details

(Italicized comments also appear in the summary report)

11. Window Screens

Attention

The inspector noted that there were some damaged window screens at various windows. Installing or repairing the screens on those windows where the screens are missing or damaged is recommended to keep pests out of the structure

12. Storm Windows

None

The structure is not equipped with storm windows. Due to the mild nature of the local weather conditions storm windows are not common in this area.

13. Security Lights

Present

This property is equipped with an exterior lighting system, adding to the safety and security of the residence. The lighting system was not tested as overriding the light sensor on the fixture(s) is beyond the scope of the inspection.

14. Water Feature / Fountain

Present

There is a water feature present at the front of the property. Inspection of this feature is outside the scope of the inspection. We recommend verifying proper operation prior to close of escrow.

Structure Perimeter Exterior

1. Address Identification

Satisfactory

The house numbers were visible from the street during daylight hours.

2. Mail Box

Present

There is a mail box or mail slot present for the delivery of mail.

3. Foundation Material(s)

Concrete

4. Vent Screens

Attention

There is a missing foundation vent screen at the garage. The opening may allow vermin access into the garage space. Contact a qualified handyperson to install a foundation vent screen as a preventative maintenance measure.

5. Visible Cracks

No

No cracks were noted in the visible areas of the foundation. Not all areas of the foundation may have been visible due to vegetation, paint, or other materials that prevent access. A condition may exist that was not readily apparent at the time of the inspection.

6. Evidence of Separation over 1/4"

No

The visual inspection of the exterior of the foundation did not reveal cracking in the foundation system with openings in excess of 1/4" in separation. Not all areas of the foundation were visible to inspection and a condition may exist that was not readily visible at the time of the inspection. Inspecting the foundation for cracks of 1/4" wide or greater is recommended once access is provided to the entire foundation area along the exterior.

7. Evidence of Movement

No

The structure does not show any significant amount of settlement on the exterior.



Home Inspection Details

(Italicized comments also appear in the summary report)

8. Evidence of Erosion

No

There were not any significant signs of erosion around the structure foundation at the time of the inspection. The inspector is not a licensed soils or geotechnical engineer, and pursuant to California Business and Professions Code section 7196.1 is prohibited from rendering an opinion on soil stability or potential soil movement during seismic events, after heavy rains or other acts of nature. If desired, qualified and licensed specialists in this area should be consulted in these matters.

9. Site Drainage

Satisfactory

The grading around the exterior of the structure is either level or sloping away from the foundation which helps to prevent rain water from draining toward the foundation. It is noted that standing water can occur on level ground due to soil conditions, water tables, and drainage patterns. We recommend determining whether any drainage systems are in place and whether there has been a history of drainage issues. Underground drainage lines are inaccessible and are therefore excluded from this inspection report.

10. Proper Earth-Wood Clearance

Yes

There should be no contact between the earth and the exterior surface material as it can cause damage or deterioration of the siding material. Sufficient clearance was noted. We recommend maintaining approximately 4-6 inches of clearance between the earth and siding material as a preventive maintenance measure.

11. Vegetation Clear from Structure

Yes

12. Watering System

Yes

The property is equipped with an automatic watering system. Testing the system was not performed as it is not within the scope of the inspection. The inspector recommends determining the functionality of the system, availability of operation manuals, and instructions on the operation of the system. We recommend the system be monitored, or if needed, adjusted so as not to spray water against the structure or produce excessive moisture around the foundation area.

Utility Services

1. Electrical Services

Underground

2. Water Source

City

The water source to the structure appears to be provided by a public/local utility water company. Recommend checking with the local water utility company to determine the source and fees for water service.

3. Water Meter Location

Sidewalk

4. Water Shutoff

Front of House

The water shutoff valve is a gate valve. The valve was not tested for proper function. Valves that are not used regularly, such as this, will on occasion begin to leak when tested. Because of this testing the main shutoff valve is beyond the scope of this inspection. Recommend testing the valve, or having the seller demonstrate proper function of the valve prior to close of escrow.

Home Inspection Details

(Italicized comments also appear in the summary report)

5. Sewer

City/Public

Information was provided to the inspector indicating the structure is serviced by a municipal sewer line. Recommend verifying with the appropriate agency that the property is connected to a sewer system.

6. Sewer Line Clean-out

Exterior

It is outside the scope of this inspection to determine how many clean-outs are required for the home and at what locations they are required. The inspection notes if there are clean-outs present and where they are located only.

7. Telephone

Underground

8. Cable TV Service

Satellite Dish

There is a satellite dish attached to the structure. Inspection or verification of proper function of the satellite dish is beyond the scope of this inspection. Contact the dish provider for additional information.

9. Gas Service

Natural Gas

Flexible gas line passes through the rear garage wall. This is a substandard installation as gas lines that pass through walls are required to be rigid pipe. Recommend changing the flexible line with rigid pipe. Contact the appropriate trade for repairs.

The shut off for the gas meter is located on the incoming gas line near the gas meter. When the shut-off valve is aligned with the pipe it is in the on position. When perpendicular it is in the off position. Storing a wrench near the meter needed to operate the valve is advised.



10. Gas Odors

None Noted

There were not any gas odors noted by the inspector at the time of the inspection. If gas odors are ever noted, it is recommended that the local utility company be contacted to investigate the odors and make any repairs should a gas leak be present. Check with your utility provider to see if they can provide a no-cost inspection of the gas appliances in the home.



Home Inspection Details

(Italicized comments also appear in the summary report)

11. Service Shut Off(s)

Meters and Appliances

The inspector noted a shut off valve at the gas meter and at the visible appliance connections. Not all appliance connections may have been visible and the visible valves were not operated for functionality as this is beyond the scope of the inspection. The inspector recommends keeping an emergency shut off tool for the gas meters main shut off valve stored near the meter. The inspector recommends attaching it with a piece of string to the meter for easy accessibility. In the event you still smell gas at the appliance after the appliance valve is shut off, go to the exterior, locate the meter and turn the main shut off valve 90 degrees to shut the gas off to the house. Once this has been done, call your local gas utility provider and notify them of the situation.

12. Vents / Exhaust

Satisfactory

The visible sections of the exhaust vent piping for the gas appliances was inspected and found to be free of defects that would require immediate action at this time. The vent piping should be inspected annually when the gas appliances are serviced.

13. Carbon Monoxide

Not Tested

This building has fossil fuel and/or solid fuel burning systems that have the potential to generate carbon monoxide. Carbon Monoxide is a colorless, odorless gas that can cause serious injury or death. Testing for Carbon Monoxide (CO) is NOT within the scope of a home inspection, according to the national standards of both the American Society of Home Inspectors and the National Association of Home Inspectors. We recommend that all fossil fuel-fired appliances be serviced and evaluated annually or per the manufacturer's instructions. For further information on the causes and measures to be taken to help prevent CO exposure, visit these helpful links: <http://www.epa.gov/air/urbanair/co/index.html>
<http://www.carbon-monoxide-poisoning.com>

Site Concrete and Paving

1. Driveway(s) / Parking

Satisfactory

2. Walkways

Attention

There are missing or damaged drain covers at the rear patio/walkway. The openings could be a trip hazard. Recommend installation of new covers as a preventative safety measure.

3. Steps

Satisfactory

Patios/Decking/Porches

1. Surface(s)

Satisfactory

The deck surface(s) is/are in satisfactory condition. Monitoring and maintaining the weather proof stain, ventilation between the deck boards, and proper securing of the nails or screws is recommended as part of ongoing homeowner maintenance.

2. Railings

Maintenance

There is a damaged wood baluster at the front porch area. Recommend repair or replacement to prevent ongoing deterioration. Contact the appropriate trade for repairs.



Home Inspection Details

(Italicized comments also appear in the summary report)

3. Steps / Handrails

Satisfactory

As the steps age, the nails securing the steps to the stringer supports loosen. As a preventive maintenance measure, consideration will need to be given to pounding the nails back in or removing the nails and installing screws in their place to keep the steps secure.

4. Concrete Slab

Satisfactory

5. Electrical Service

Yes/ No GFCI

The electrical receptacle(s) on the exterior of the home is not protected with a Ground Fault Circuit Interrupter (GFCI) for added safety. Consideration should be given to installing a GFCI receptacle for added safety considerations.

6. Weather Protected Outlet(s)

Yes

Weather protected outlets are present and should be periodically examined to assure functional operation as they prevent moisture from entering the electrical outlets.

7. Natural Gas Service / Equipment

No

8. Lights

Functional

9. Cover / Enclosure

Attention

There is some damage at the rear patio cover ledger board. Recommend monitoring and anticipating repairs in the future should the condition worsen.

Attached Garage

1. Size

Two Car

The size of the garage is a general statement. We recommend verifying that the size of the garage and garage door opening meet personal requirements.

2. Garage Door(s)

Satisfactory

The garage door(s) appear to be in satisfactory condition. Monitoring the condition of the door and hardware is advised to assure safe operation.

3. Automatic Opener(s)

Functional

The automatic garage door opener was operated and found to be in working order at the time of the inspection.

4. Springs/Mount

Functional

The garage springs were functional at the time of the inspection. Springs may require adjustment over time as they may lose some of their tension. Periodically lubricating the garage door hardware is advised to assure smooth/quiet operation and to prevent wear.



Home Inspection Details

(Italicized comments also appear in the summary report)

5. Safety Operation, Opener(s)

Functional

The garage door opener has a light sensor that reverses the garage door opener when an obstacle passes under the door and interrupts the light beam. The opener may have an auto-reverse function that reverses when it encounters an obstacle. If present, this feature is not tested as on occasion testing can damage the door or hardware. Should further evaluation of this feature be desired contact a qualified overhead door company.

6. Door Seal

Functional

The seal on the bottom of the garage door appears to be in functional condition and should provide intended service. Monitoring the seal for deterioration is advised.

7. Floor/Foundation

N/A-Car

The garage floor appears to be in satisfactory condition. However, the inspector was not able to completely evaluate the garage space and floor due to stored items and a parked car preventing access to all areas. Recommend visually evaluating the garage space and floor surface when the items and car have been removed.

8. Lighting

Functional

9. Insulation

Not Visible

The ceiling and walls are finished with sheet rock and therefore it is not possible to verify the presence of insulation.

10. Fire Wall/Ceiling Board

Functional

The walls between attached garages and the living space of the home are referred to as firewalls. They are designed to slow the spread of fire from the garage to the living area. Therefore, the sheetrock should not be opened or removed as this creates a breach in the firewall. All sheet rock seams and areas where wall penetrations occur should remain sealed with appropriate materials.

11. Door(s), Garage - Building

Functional

The door from the living area to the garage has a functioning automatic closing system and proper weather-stripping to provide an intended firewall protection. The fire rating of the door, or its ability to meet fire rating standards is beyond the scope of this inspection.

12. Evidence of Moisture Penetration

Yes: Past Event

Note: There are moisture stains and evidence of past repairs at the garage ceiling. Refer to the seller as to the history of the stains/repair. Monitoring is advised.

Note: There are moisture stains present on the roof underside. The roof cover material is a recent installation and the inspector assumes the stains are from past leaks in the roof cover material. Monitoring for evidence of moisture is advised.

Roof

1. Roof Evaluated From

Walk Surface

2. Roof Type

Pitched



Home Inspection Details

(Italicized comments also appear in the summary report)

3. Roof Cover Material(s)

Metal

The roof surface material consists of metal tiles coated with an aggregate material. Coated metal tiles can have a service life of forty years when installed and maintained properly. The manufacturer of the tiles was not determined. For a general overview of this type of product visit www.Decra.com.

4. Cover

Unknown

It was not possible to determine the number of layers of roofing material on this structure.

5. Debris on Roof

None

There was no debris build up on the roof at the time of the inspection. Debris build up should be cleaned off the roof surface on an annual basis as a proper care and maintenance recommendation.

6. Moss / Mildew

None

The inspector recommends inspecting the roof system for moss growth on an annual basis. Products that prevent growth can be purchased at a local hardware store or home improvement center and can be applied by a home owner.

7. Cover Material Condition

Functional

8. Ridges

Functional

9. Valleys

Functional

The visible portion of the valleys appear to be in satisfactory condition. Not all components of roof valleys are visible for inspection and conditions may exist that cannot be seen.

10. Vents / Chimneys / Covers

Functional

The inspector noted the junction of the plumbing vents and roof flashing openings are properly sealed. Periodic inspection of the vent cover storm collars or sealant is advised to prevent moisture intrusion.

11. Flashing / Caulking

Functional

12. Soft Spots

No

Soft spots can be indications of damaged roof sheathing or other roof structure issues. No soft spots were discovered at the time of the inspection.

13. Separate Certification Required

No

Certification of the roof surface is generally required or recommended when the roof surface is near the end of its service life. As that is not the case in this instance certification is not recommended.

14. Indications of Leaking

No

At the time of the inspection, the inspector found no evidence that the roof system is currently leaking. Monitoring attics or roof underside during periods of rain is advised.

Home Inspection Details

(Italicized comments also appear in the summary report)

15. Gutters / Down Spouts

Maintenance

There are rust stains and perforations in the gutter system at the upper north roof edge indicating advanced aging and probable leaks. Sealing the gutters from the interior may extend the gutters service life. Budgeting for replacement of the gutters in the near future is advised.

There is no down spout at the southwest corner of the rear patio cover. Installation of a down spout is advised to prevent moisture from contacting the structure. Contact the appropriate trade for installation.

16. Drains / Splash Blocks

Functional

The inspection of the down spout drains did not show visible evidence that they may be plugged with debris. It is important to keep the drains clear and functional so that they do not overflow next to the foundations perimeter. The inspector recommends inspecting the drains and/or splash blocks after a heavy rain to identify if they are providing their intended service. Periodic professional cleaning of drain piping is recommended.

Electrical Service

1. Panel / Sub-Panel Location(s)

Exterior

The main electrical panel and service disconnect is located at the southeast corner of the structure. The sub panel is located in the garage.



2. Service Size (Amps) / (Volts)

100 Amps - 240 Volts

3. Over Current Devices

Federal Pacific

The main electrical panel and the sub panel are Federal Pacific Electric (FPE) brand panels with Stab-Lock circuit breakers. Reports of failure with this equipment have been reported. Failure included breakers failing to trip at the stated ratings and breakers that still have power when turned to the "off" position. These panels also have poor breaker connections to bus bars, and some of these panels have insufficient wire bending space and insufficient gutter space. There are also incompatible metals between the bus bars and the breakers that may lead to deterioration over time. Consulting a licensed, qualified electrician for further evaluation is recommended.

4. Service to Panel

Manufactured Bus



Home Inspection Details

(Italicized comments also appear in the summary report)

5. Panel to Structure

Copper/Aluminum

Some of the electrical circuit wiring is aluminum and the inspector does not invasively inspect the outlets, switches and connectors to determine if they are rated for aluminum wiring. The breakers are CU/AL (copper or aluminum) rated. Consideration should be given to having a licensed electrician remove and inspect the outlets, switches and connectors to determine if they are rated for aluminum wire for fire safety considerations.

6. Panel Cover

Attention

The inspector noted that there was an open slot on the sub panel cover. Installing a plastic blank in the open slot is recommended as a preventive safety consideration. Plastic breaker blanks can be purchased from a home improvement center and can be installed by a qualified handyperson or electrician.

The breakers have been labeled in order to provide quick identification of service disconnects in the event of an emergency.

7. Panel Cover(s) Removed

Yes

8. Breaker Configuration

Functional

9. Wire-Over Current Compatibility

Satisfactory

The visible wires appeared to be properly sized to the breaker amperage.

10. Receptacle Ground Verify

Functional

The inspector has spot checked a representative number of three-prong 110 volt electrical outlets throughout the structure, and has not found any that were not correctly grounded. Some outlets may not have been checked due to accessibility and undiscovered conditions may exist.

11. G.F.C.I. Protection

Attention

The ground fault circuit interrupters (G.F.C.I.)'s were spot tested and there appears to be a malfunction in the hall bathroom receptacle. The unit would not trip when tested. Recommend replacement of the receptacle so that it may function as intended. Contact a qualified person to make the repair.

12. Service Ground Verified

No

The inspector was not able to visually verify the electrical system main ground. The inspector noted a ground wire in the panel, but could not locate its termination point away from the panel. Refer to comments under Electrical>Receptacle Ground Verify.

13. Outlets, Switches, Junction Boxes, Lighting

Functional

There is an open electrical junction box in the crawl space below the family room. Junction boxes are required to have a proper cover installed to prevent shock hazard and provide containment of sparks should arcing occur. Contact a qualified handyperson or electrician for installation of covers.

The inspector was able to identify and report on the condition of those outlets, switches and junction boxes that were visible and accessible at the time of the inspection. If the home was occupied at the time of the inspection furniture and stored items may prevent access to some electrical outlets, switches and junction boxes. Note: Some light bulbs throughout the structure may be missing or non-functional and replacement of light bulbs is considered an ongoing maintenance measure.



Home Inspection Details

(Italicized comments also appear in the summary report)

14. Wire Method

Non-Metallic Sheathed

Romex is the general term used for nonmetallic sheathed wiring. Nonmetallic sheathing refers to the plastic coating that encapsulates the metal wiring. Romex is considered a modern electrical conductor and is the predominate wire method used for residential construction.

15. Arc Fault Breakers (A.F.C.I.)

Not Present

Arc Fault Circuit Interrupters (AFCI) are a residential circuit breaker with an integrated processor which recognizes the unique current and/or voltage signatures associated with arcing faults, and acts to interrupt the circuit to reduce the likelihood of an electrical fire. Current building standards require AFCI's be in service for the bedroom circuits. This house predates the requirement for this device. Consideration may be given to installing AFCI circuit breakers as an upgrade to the electrical system.

Heating System

1. Location(s)

Garage

2. System Type(s) / Info

Gas Fired Forced Air

The furnace date of manufacture could not be determined due to lack of access to the front covers of the furnace. A conventional gas fired forced air furnace contains a heat exchanger that has an average life expectancy of 20-25 years from the date of installation. The heat exchanger is not visible without industry-specific tools and therefore was not evaluated. Refer to the seller as to the age of the furnace.

Consideration may be given to contacting a qualified HVAC contractor for further evaluation of the heat exchanger and associated components.

3. Energy Saving Unit

No

Energy saving units are defined as those being greater than 90% efficient. The inspector estimates this furnace to be approximately 80% efficient.

4. Thermostat Type

Set-Back

Installation of an electronic programmable thermostat may be considered as an upgrade to the system.

Some of the benefits of programmable thermostats are greater comfort, consistent temperature settings, and the ability to time the use of the system around the daily routine.

5. Thermostat Location(s)

Family Room

6. Thermostat Condition

Satisfactory

7. On/Off Check

Functional

The heating system was on/off tested and found to be functional at the time of the inspection.

8. Operation Noise

Satisfactory

9. Filter Condition

Satisfactory

The inspector recommends that the filter be changed or cleaned periodically to assure proper function.

10. Electronic Filter System

No



Home Inspection Details

(Italicized comments also appear in the summary report)

11. Vents / Flues

Attention

The furnace exhaust flue is partially detached at a junction in the garage. This may allow spent gasses to exit the flue. Recommend sealing the open area. Contact the appropriate trade for repairs.

12. Ducts / Returns / Radiators

Functional

The inspector took temperature readings at a representative number of accessible heating registers and noted consistent temperatures. The interior of the heating ducts and registers are not accessible for inspection. Consideration may be given to contacting a duct cleaning service to assure safe and efficient operation of the system.

13. Non-Heated Area(s)

None

14. Service Notes / Filter Size

None Visible

The inspector was unable to locate an apparent service record which would indicate the furnace has had a complete, technically exhaustive evaluation in the past year. Complete servicing by a professional is recommended annually prior to each heating season. If no service records are available within the last year showing a complete evaluation and service, the inspector would recommend that a qualified heating contractor provide a complete service on the system in order to ensure long term function is provided.

Plumbing

1. Size Service to Structure

3/4 Inch

2. Structure Pipe Material

Combination

The water supply pipes are primarily copper. There is one remaining portion of galvanized steel water supply piping. Galvanized steel piping has an average life expectancy of fifty to seventy years. When the pipes wear out, rust accumulates inside the pipe and restricts the diameter of the pipe, resulting in reduced water pressure and flow. Cleaning debris out of shower heads, faucet strainers and valves may improve flow for the short term. Replacing the supply piping in sections is a common practice for the readily accessible sections of piping in crawl spaces. Consideration will need to be given to upgrading the galvanized supply water pipe when the flow is reduced to a level that does not provide the intended service or when leaks develop.

3. Water Pipe Insulation

No

Insulating the water supply piping for this structure could be considered in order to add to the efficiency of the hot water system and prevent pipes from freezing and possibly bursting during hard freeze conditions.

4. Pipe Rumble Noise

No

5. Surge Bangs

No

6. Encrustations Evident

Yes

There is an encrustation on the galvanized water supply pipe in the crawl space. Encrustations are an indication that the pipe is failing and leakage or blockage is imminent. Contact a licensed plumber to evaluate and make needed repairs.

7. Mineral Deposits

No



Home Inspection Details

(Italicized comments also appear in the summary report)

8. Waste Pipe Material

Plastic

The exposed waste lines are plastic ABS (acrylonitrile butadiene styrene). ABS pipes have smooth inner walls ideal for waste flow and do not suffer from corrosion as do cast iron drain lines. The inspector was only able to visually examine the waste lines that were in view. The waste lines in the inaccessible areas may be of a different material. The interior of the waste lines is not visible and blockage or damage could be present that is not visible. Verification that the waste lines are connected to the sewage line or septic tank is beyond the scope of this inspection. Consideration may be given to having the interior of the waste lines evaluated by a plumbing service with video camera capability.

9. Evidence of Leaks

Yes

There is a leak at the incoming water supply pipe at the front of the structure near the shut-off valve. Contact the appropriate trade for repairs.

10. Interior Water Flow

Functional

The water flow at the interior faucets, spigots, and shower heads appeared satisfactory. Concurrent use of multiple fixtures may reduce the water flow at some fixtures.

11. Exterior Water Flow

Functional

A representative number of hose bibs were evaluated.

12. Pressure Readings Interior / Exterior

Exterior Only

The water pressure at the structure was noted to be 80 PSI at the exterior hose bib. Water pressure is recommended to be between 40-80 psi to provide sufficient service while preventing surging, banging and other conditions from occurring that can damage piping.

13. Soft Water System

None

14. Filter System

Active

There appears to be an active water filtering system in this structure located under the kitchen sink. However, this inspection does not cover the adequacy or extent of the system. Suggest checking with seller to determine the condition and operation of the filter system.

15. Drainage and Sump Pumps

None Visible

Water Heater

1. Location(s)

Garage

2. Type

Natural Gas

The age of the water heater could not be determined. The life expectancy of a water heater is typically 8-12 years from the date of installation, although there are exceptions on both sides. Gas water heaters must have a continuous source of air and fuel. Providing at least 2 feet of clearance around the water heater is recommended. Items should not be stored against the water heater and flammable gas or liquids should never be stored in the vicinity of the unit. Budgeting for replacement of water heaters that are over 8 years is recommended as failure could occur at any time due to their age. Refer to the seller as to the age of the unit, or remove the insulation blanket to access the water heater data plate which shows the date of manufacture.



Home Inspection Details

(Italicized comments also appear in the summary report)

3. Solar Auxiliary

None

It appears the solar auxiliary heating has been abandoned. Refer to the seller in this regard.

4. Size Main / Aux (Gal)

Approximately 50 US Gallons

5. Evidence of Leaks

No

There were no visible leaks in the water heater that would indicate the water heater is in need of replacing. Inspecting the bottom of the water heater, water line connections and all seams periodically for evidence of moisture is recommended.

6. Evidence of Encrustation

No

There are no encrustations forming at this time. Encrustations often occur at the fittings where the water lines enter and exit the water heater. It is evidenced by rust or scale developing at the fitting. This is generally an early indication of a small leak. Monitoring the hot and cold water connections at the top of the water heater for signs encrustations such as rusting or corrosion is recommended. If encrustations are discovered, these connections can be taken apart, cleaned to remove rust accumulations, and wrapped with plumbers tape to prolong the life of the water heater.

7. Safety Valve

Present

There is a temperature/pressure relief valve installed on the water heater that lets water escape if the temperature or pressure is too high. The temperature/pressure relief valve and all of the water shutoff valves are not tested as part of this inspection as per the ASHI standards of inspection. The valves are used infrequently and because of this may leak when tested or be inoperable. Interested parties may wish to test the valves prior to close of escrow.

8. Discharge Pipe

Functional

There is an appropriate discharge tube connected to the temperature/ pressure relief valve. The tube is installed to prevent someone from being sprayed with hot water in the event that the valve discharges. The termination point is recommended to be within 6" of the grade/ground. Discharging of the valves is uncommon and usually indicates that the water heater is in need of service or the relief valve is in need of replacing.

9. Safety Tie Down(s)

Attention

The tank is strapped with plumbers tape. This is allowed if the tape encircles the tank prior to being properly attached to the structure. In this instance the tape does not encircle the tank. Contact a qualified handyperson or plumber for proper strapping of the tank and compliance with state regulations. For further strapping information visit: http://www.seismic.ca.gov/HOG/waterheaterbracing_0...

10. Insulation Blanket

Satisfactory

The water heating system has an insulation blanket that will help to reduce the cost of heating water.

Note: The insulation blanket restricted the inspectors ability to inspect the tank for corrosion and leaks and there may be a condition that was not readily apparent.

11. Insulation Rating(s)

No Visible Rating

Insulating ratings are rarely published on newer or recently constructed water heaters as compliance standards at the time of manufacture have generally negated the need for additional insulation.



Home Inspection Details

(Italicized comments also appear in the summary report)

12. Installation

Functional

The water heater provided hot water at all locations tested. The water temperature was within the acceptable range and no threat of scalding from excessively hot water was noted.

Main Entry Door

1. Correct Application

Yes

2. Door Fit

Functional

The main entry door opened and closed in a normal fashion without any extra effort. The door appears to be properly installed in the frame without any large gaps present.

3. Weather Strip

Functional

There is weather stripping installed around the perimeter and threshold of the main entry door. Weather stripping is designed to help keep out drafts and to aid with the energy efficiency of the home. This is only a visual inspection of the weather stripping and not an evaluation for how well the weather stripping may perform. The weather stripping should be visually inspected on an annual basis and should be replaced when it becomes worn or damaged.

4. Finish

Functional

The finish on the main entry door appears to be satisfactory. The door finish should be evaluated on an annual basis and addressed as needed to assure that the main entry door is protected from the elements.

5. Dead Bolts

Yes

There is a functional dead bolt lock on the main entry door. The lock has been visually inspected and operated by the inspector, and was found to be operational. The lock was not inspected for how well it may perform against an intruder.

6. Security / Caller Visibility

Yes

It is possible to view a caller either from a peep hole in the door or from an adjoining window.

7. Storm / Screen / Doors

None

There is no screen or storm door present at the main entry door.

8. Door Chime

None

9. Intercom

No

10. Lighting

Satisfactory

The lighting at the main entry door is present and appeared to be satisfactory. Recommend checking for light coverage when it is dark to assure there is ample light for safety and functional reasons.

Other Ext. Entry Doors

1. Correct Application

Yes



Home Inspection Details

(Italicized comments also appear in the summary report)

2. Location(s)

Living Room

3. Finish

Satisfactory

4. Door Fit

Maintenance

The living room sliding door is difficult to slide open. This may be due to worn rollers or tracks. Contact a qualified handyperson or appropriate trade for further evaluation and repairs.

5. Storm / Screen Door(s)

N/A

6. Locks

N/A

Not evaluated. The door was difficult to close making evaluation not feasible. Further evaluation advised.

Living Room / Main Hall

1. Floor

Satisfactory

The visible area of the floor covering appeared satisfactory. In occupied homes not all of the floor can be viewed and conditions may exist that cannot be seen due to rugs, furniture, and personal items.

2. Ceiling / Walls / Doors

Satisfactory

3. Doors / Closet Doors

Satisfactory

Fire Place/Wood Stove

1. Location

Living Room

2. Solid Fuel / Gas Logs / Gas Appliance

Wood Burning

There is a wood burning fireplace in this home. Wood burning fireplaces require periodic cleaning and maintenance to assure safe operation.

3. Flue Condition

Not Visible

The scope of this inspection does not include the flues/liner of the chimney. The visible portion of the flue/liner appears clean, however, the flue/liner could not be seen in its entirety and therefore, should not be considered as fully inspected. Consideration may be given to having the flue cleaned and inspected by a qualified chimney sweep service if no records of cleaning and/or inspection are available.

4. Flue Dampers

Functional

5. Firebox

Functional

6. Exterior Chimney(s) Condition

Satisfactory

The exterior of the chimney or chase is in satisfactory condition. However, a program of regular inspections and periodic maintenance is necessary for the continued safe operation of the system.



Home Inspection Details

(Italicized comments also appear in the summary report)

7. Rain Cap / Spark Arrestor

N/A

There is no spark arrester or rain cap on the chimney of this structure. Conditions may exist that may require a spark arrester for safe operation. Recommend checking with the local authority having jurisdiction to determine if spark arresters are required. Contact a qualified handyperson or chimney expert to install an approved spark arrester and rain cap if they are deemed to be required.

Other Room(s)

1. Location / Type

Family Room

2. Floors

Satisfactory

The visible area of the floor appeared satisfactory. In occupied homes not all of the floor can be viewed and conditions in that instance may exist that could not be seen due to rugs, furniture, and personal items.

3. Ceiling / Walls / Doors

Satisfactory

4. Door(s) / Closet(s)

Satisfactory

Kitchen(s)

1. Floor Cover Material

Attention

There is some warping present in the kitchen floor in front of the refrigerator which would indicate a water leak in the area at some time in the past. Recommend questioning the seller to determine if they are aware of any leaks in the area during their ownership and if they were repaired. The inspector did not note any moisture in the area at the time of the inspection.

2. Ceiling / Walls / Doors

Satisfactory

3. Kitchen Fixtures

Attention

The aerator at the kitchen basin faucet is clogged, missing, or deteriorated and replacement/repair is recommend. Aerators can be purchased at most home improvement stores and simple thread into position.

4. Sink / Faucet Leak

No

5. Drains Appear Clear

Yes

A small amount of water was ran through the kitchen basin drain(s) and they appear to drain at an acceptable rate. Note: Blockage or issues with plumbing drain lines may come to light in homes when actual living conditions such as long showers and multiple fixtures are in use. Therefore, the inspection may not reveal conditions that are not localized to the drain being tested.

6. Under Sink Inspection

Satisfactory

7. Stove / Cook Top

Gas: No Anti-tip

There is no anti-tip device installed on the stove to prevent it from tipping. Installation of an anti-tip bracket is advised to prevent accidents such as scalding of someone by spillage of hot liquids or contact with hot pans. Anti-tip hardware kits are available at appliance and home repair centers. Contact a qualified handyperson for installation.



Home Inspection Details

(Italicized comments also appear in the summary report)

8. Cook top, Burners / Elements

Attention

The front right burner for the stove top did not appear to be functioning at the time of the inspection. Contact an appliance repair person to further evaluate and repair the burner.

9. Controls

Functional

10. Stove Exhaust Fan

Maintenance-Inoperable

The exhaust fan is inoperable. Contact the appropriate trade for further evaluation and repairs.

11. Oven

Gas

12. Oven Appearance / Condition

Satisfactory

13. Oven Operational

Yes

The bake and broil cycles were functional at the time of the inspection. This is an "on/off" test conducted on the oven. Note: Timer, clocks, convection fans, and self-cleaning systems are not tested.

14. Built-in Microwave Operational

Yes

The microwave was tested by heating a wet paper towel. Normal life expectancy of a microwave is 8-15 years.

15. Built-in Microwave Door Appearance

Satisfactory

The door appears to function as intended.

16. Garbage Disposal

Functional

The garbage disposal was operated and appears to be functional. The garbage disposal's ability to grind food scraps was not determined during the visual examination.

17. Water For Refrigerator

Yes

18. Counter Tops

Satisfactory

The kitchen counter tops are in satisfactory condition. Cosmetic items such as scratches or chips in the counter surfaces are not cited as issues unless they pose the risk of moisture intrusion or other subsequent damage.

19. Woodwork Finishes

Satisfactory

The woodwork finish appears satisfactory. Scratches, chips, or insignificant flaws are considered cosmetic in nature and are not cited in this report.

20. Drawers / Doors

Satisfactory

A representative number of drawers and doors were evaluated for proper function.

21. Lighting

Functional

The kitchen lighting fixtures appear to function as intended.



Home Inspection Details

(Italicized comments also appear in the summary report)

22. Kitchen Windows

Satisfactory

The kitchen window appeared to function as intended. No issues were noted.

Bedroom

1. Location(s)

Other

The bedrooms are located adjacent to the hallway. The bedrooms are labeled numerically as approached in a clockwise direction with the #1 bedroom being the first bedroom on the left.

2. Floor

Functional

The visible areas of the floors appeared to be in satisfactory condition. Note: In occupied homes stored items/furniture/rugs limit the inspectors ability to see all areas of the floor and conditions can exist in those areas that are not visible.

3. Ceiling/Walls/Doors

Satisfactory

4. Entry Door(s)/Closet Door(s)

Attention

The #3 bedroom entry door is physically damaged. Consideration may be given to replacement for aesthetic purposes.

5. Window(s)

Maintenance

There are damaged window sills in the master bedroom. Recommend repair or replacement to prevent ongoing deterioration. Contact a qualified handyperson or appropriate trade for repairs.

Bathroom(s)/Washroom(s)

1. Location(s)

Master and Hallway

2. Floor Cover

Functional

The floor covering is in satisfactory condition. Monitoring the floor coverings for wear, gaps, voids, or other conditions that may allow moisture intrusion to occur is advised.

3. Ceiling/Walls/Doors

Functional

4. Mildew Noted

Yes

There is mildew staining in the tub/shower area of the hallway bathroom ceiling. Mildew in the bathroom area can be a health hazard, in addition to contributing to odor problems. Chemical cleaning is advised as well as keeping the area well ventilated.

Note: There may be areas which are susceptible to molds at all properties. Molds may be in areas which cannot be seen through a visual examination of the structure. Some molds are known to produce toxins. Testing or identifying these organisms is NOT within the scope of a home inspection. Due to recent health issues associated with mold, we recommend that interested parties consider retaining a qualified professional for testing and/or sampling to determine if an adverse condition exists at this structure. For additional mold information visit the EPA website by entering EPA 402-K-02-003 in your web browser.

Bathroom(s)/Washroom(s)Mildew Noted



Home Inspection Details

(Italicized comments also appear in the summary report)

5. Basin(s)/Fixtures

Satisfactory

The basin fixtures functioned as intended and the basin(s) appeared to be free of any defects that would require repair at this time.

6. Basin Drain

Attention

The master bathroom sink drain stopper does not function as intended. Contact a qualified handyperson for further evaluation and repairs.

A small amount of water was ran through the basin drains and they appear to drain at an acceptable rate.

Note: Blockage or issues with plumbing drain lines may come to light in homes when actual living conditions such as long showers and multiple fixtures are in use. Therefore, the inspection may not reveal conditions that are not localized to the drain being tested.

7. Shower Fixtures

Maintenance

The master bathroom shower mixing valve does not appear to function. Contact the appropriate trade for repairs, or have the seller demonstrate proper function.

8. Shower Head(s)

Functional

Local water use regulations may require low-flow shower heads be in service. The shower heads are labeled as using 2.5 gallons per minute. Check with your Realtor or appropriate water use agency for compliance information.

9. Shower/Tub Enclosure(s)

Satisfactory

The lower corners of shower/tub enclosures are prone to leakage. Monitoring the area and keeping the area well-caulked is advised as part of home-owner routine maintenance.

10. Water Resist Cover Wall Cover

Functional

11. Caulking - Water Exposed Area

Satisfactory

The caulking along water exposed areas in the bathroom appears to provide adequate protection. Caulking around bathtub and shower fixtures, at corner and joints in the showers, along the tub and the floor, and around sinks/backsplashes should be maintained periodically to prevent moisture intrusion.

12. Tub(s)

Functional

13. Tub Fixtures

Functional

14. Tub/Shower Drain(s)

Functional

A small amount of water was ran through the bathtub/shower drains and they appear to drain at an acceptable rate. Note: Blockage or issues with plumbing drain lines may come to light in homes when actual living conditions such as long showers and multiple fixtures are in use. Therefore, the inspection may not reveal conditions that are not localized to the drain being tested.



Home Inspection Details

(Italicized comments also appear in the summary report)

15. Toilet(s)

Attention

The master bathroom toilet hardware (flapper, handle, valve, etc) is not functioning as intended. Recommend repairs to restore proper function and/or reduce water usage. Contact a qualified handyperson for further evaluation and repairs.

The toilet, (or toilets), are low-flow units using 1.6 gallons of water or less per flush. The toilets were inspected for cracks and serviceability. We recommend inspecting the toilets periodically for indications of cracking in the toilet box, tank or base as part of an ongoing homeowner maintenance program.

16. Ventilation

Functional

Ventilation is provided by an operable window. There is no assisted ventilation fan in the bathroom.

Consideration may be given to installing a fan as an upgrade to provide greater air exchange and reduce moisture levels.

17. Heat

Functional

There is a heat source present in the bathroom (s).

18. Medicine Cabinet/Vanity

Functional

19. Window(s)

Attention

The master bathroom window sill is damaged from moisture intrusion. Recommend repair or replacement to prevent ongoing deterioration. Contact a qualified handyperson or appropriate trade for repairs.

1/2 Bathroom

1. Floor Cover

Satisfactory

The floor covering is in satisfactory condition. Monitoring the floor coverings for wear, gaps, voids, or other conditions that may allow moisture intrusion to occur is advised.

2. Ceilings / Walls / Doors

Satisfactory

The ceilings, walls, and door appear to be in functional condition.

3. Water Resist Cover Wall Cover

Satisfactory

The water resistant wall covering in the shower/bathtub area is in functional condition and appears to be providing adequate protection to the wall surface.

Home Inspection Details

(Italicized comments also appear in the summary report)

4. Basin(s)/Fixture(s)

Maintenance

The hot water faucet handle in the half-bathroom is damaged and does not function. Contact the appropriate trade for repairs.



5. Basin Drain

Satisfactory

6. Toilet(s)

Attention-Not Low Flow

Water conservation ordinances require existing toilets to use less than 1.6 (or 1.28 in some instances) gallons of water per flush. This requirement is often enforced at the time of property transfer. The toilet is not labeled as a low flow unit and may not comply with the ordinance. Check with the appropriate water use agency for information in this regard.

7. Caulking - Water Exposed Area

Satisfactory

The caulking appears to provide adequate protection. The caulking should be maintained periodically in order to provide the desired protection to the adjoining wall surface.

8. Ventilation

Satisfactory

The ventilation fan was tested and found to be functional at the time of the inspection. Periodic cleaning of the ventilation cover is advised to assure maximum efficiency.

9. Mildew Noted

None Visible

No mildew was noted. There may be areas which are susceptible to molds at all properties. Molds may be in areas which cannot be seen through a visual examination of the structure. Some molds are known to produce toxins. Testing or identifying these organisms is NOT within the scope of a home inspection. Due to recent health issues associated with mold, we recommend that interested parties consider retaining a qualified professional for testing and/or sampling to determine if an adverse condition exists at this structure. For additional mold information visit the EPA website by entering EPA 402-K-02-003 in your web browser.

10. Window(s)

Satisfactory



Home Inspection Details

(Italicized comments also appear in the summary report)

Laundry Area

1. Floor Condition

Satisfactory

The visible floor area is in satisfactory condition. Areas beneath washers and dryers, (if present), are not accessible for inspection and the floor covering may have physical damage from vibration of the machines, as well as staining or lifting of the floor covering from moisture in the area.

2. Ceiling / Walls / Doors

Satisfactory

In general, bathroom ceilings, walls, and doors should be monitored for deterioration due to high moisture conditions that occur when in use. Keeping bathrooms well-ventilated, and maintaining painted surfaces is advised.

3. Washer Hookup(s)

Yes

The inspector noted hot and cold water supplies in the laundry area. The valves were not tested as this is beyond the scope of the inspection and on occasion the valves begin to leak when operated.

4. Drain(s)

Not Tested

The washing machine drain was not tested as it is beyond the scope of the inspection. Recommend verifying proper function of the drain prior to close of escrow.

5. Dryer Hookup(s)

Yes

There are sufficient electrical and/or gas connections present.

6. Dryer Electrical Service 240V

Unknown

7. Gas Service

Unknown

Refer to the seller as to whether gas and electric connections are present.

8. Dryer Ventilation System

Satisfactory

The dryer appears to be properly vented to the exterior of the structure. Portions of the dryer vent that are inaccessible for inspection may have issues that cannot be detected. We recommend that dryer vent ducts be cleaned on a regular basis to remove accumulations of lint which will shorten dryer run times and improve fire safety.

9. Lighting

Satisfactory

The light fixture and switch functioned properly when tested.

10. Shelving / Storage

Satisfactory

11. Area Ventilation

N/A

There is no mechanical ventilation system in the laundry. The inspector noted no adverse conditions due to the lack of ventilation. Monitoring the area for moisture or excessive heat buildup is advised. The addition of a vent exhaust fan in the laundry area would limit moisture buildup and help keep the area dry and free of adverse conditions.

12. Window(s)

None



Home Inspection Details

(Italicized comments also appear in the summary report)

Attic

1. Access Location / Type

Hallway

2. Access

Satisfactory

3. Attic Evaluated By

Head - Shoulder

4. Inaccessible Areas

Yes

There are inaccessible structure cavities evident from the attic and there are areas of the attic which are inaccessible due to reduced clearance, or obstruction by structural members, insulation, and/or mechanical apparatus. In all homes with pitched roofs the area around the perimeter of the structure is inaccessible due to limited clearance. Conditions may exist in the areas of the attic that the inspector could not access.

5. Ventilation

Satisfactory

6. Insulation

Blown-in Fiberglass

There is approximately 6" of fiberglass insulation installed in the attic area. Fiberglass insulation has an insulation value of 3.1 per inch, therefore, the insulation value in the attic area is approximately R-19.

7. Duct Work Piping

Functional

8. Exposed Rafters/Sheathing

Yes

9. Framing condition

Satisfactory

There were no signs of damaged framing members in the accessible areas of the attic space. Some attic areas may not have been inspected due to obstructions, insulation, or other conditions that limit the inspectors ability to view the area.

10. Roof Inspect from Underside

Satisfactory

The visible portions of the roof underside were inspected and no issues were noted. There are inaccessible structure cavities evident from the attic and there are areas of attic which are inaccessible due to reduced clearance, mechanical apparatus, or by structural design, that prevent complete inspection of the roof from the underside.

11. Light Thru

No

Raised Foundation

1. Method of Inspection

Entrance

The sub area was entered for inspection purposes.

2. Access Location

Other

Living room wall.



Home Inspection Details

(Italicized comments also appear in the summary report)

3. Access Size

Satisfactory

4. Clearance

Satisfactory

5. Inaccessible Areas

No

6. Debris / Trash

None

7. Moisture / Dampness

Satisfactory

The soil was dry at the time of the inspection and there was no evidence of past standing water, staining, or erosion in the visible areas. Conditions may change during the rainy periods and periodically monitoring the sub area for moisture is advised.

8. Vapor Barrier

None

Vapor barrier material does not appear to be needed as the sub area of the structure appears to be free from excessive moisture.

9. Ventilation

Satisfactory

The vent openings appear to provide ventilation of the crawl space area as intended. Calculations of ventilation requirements and placement is technically exhaustive and is beyond the scope of this inspection.

10. Proper Earth-Wood Clearance

Yes

The is no earth-wood contact in the visible area of the sub area crawl space.

11. Wood Members

Attention Stains

There are moisture stains on the rim joist beneath the kitchen that were dry at the time of the inspection. No damage was noted in these areas. Refer to the current pest report for additional information and any treatment recommendations that may be needed.

12. Pipe / Ducts

Satisfactory

The duct/pipes beneath the home appeared to be in satisfactory condition. Refer to Plumbing and Heating System sections of this report for additional information.

13. Evidence of Cracks - Stem Walls

No

No cracks of significance were noted at the foundation perimeter or interior stem walls. It should be noted that hairline or other cracks may exist and go undetected due to low-light conditions, staining, debris, or lack of visual access to areas that may be blocked by heating ducts, plumbing, or other apparatus.

14. Separation Over 1/4"

No

15. Insulation

None

There is no under floor insulation present. Consideration may be given to installing insulation in this area to improve energy efficiency, increase comfort within the structure, and aid in reducing moisture transfer from the sub area to the living space. If desired contact a licensed insulation contractor for further evaluation and cost estimates.



Home Inspection Details

(Italicized comments also appear in the summary report)

16. Pier Type and Condition

Concrete

There were not any significant issues visible to the concrete support piers or wood posts in the sub-structure. This inspection does not evaluate the integrity of the structure. If a detailed evaluation of the structure is desired we recommend you contact an appropriate structure/soils specialist.

17. Sill Plate Anchors

Verified

Anchor bolts are fasteners that connect wood framing to the concrete foundation. They limit the framings ability to move independently on the foundation in the event of an earthquake. Sill plate anchors were located and verified in various areas of the crawl space. There may be areas where sill plate anchors have not been installed, and the placement or arrangement of the anchors may not meet current building standards in some instances. Determining the size, method of attachment, and proper location of the anchor bolts is beyond the scope of this inspection.

18. Seismic Components Installed

Recommended Upgrade

Consideration could be given to contacting an appropriate trade to discuss additional upgrades to the structure such as strapping of the support posts beneath the home. This, and other upgrades, could help the structure resist movement and/or damage due to a seismic event.

Slab Foundation

1. Level / Gradation

Satisfactory

2. Off Sets (Heaving)

None Visible

The floor covering material limits the inspectors ability to inspect the concrete slab. The limited visible inspection does not indicate that off sets or heaving has occurred.

3. Moisture / Dampness

None Visible

4. Cracks / Separations

Not Visible

The concrete slab was covered with flooring material at the time of the inspection and the surface of the slab was not visible to the inspector. It is not uncommon for cracks to occur in the concrete slab during the curing process. Curing cracks are typically small and do not require repair in most instances. Should cracks larger than 1/8" ever be viewed contact the appropriate trade for further evaluation.

5. Footings / Sills

Satisfactory

The foundation footings are below grade and impossible to view. The visible sill portion of the foundation around the base of the structure showed no indications of cracks.