MA: Sandwich - 180 Cotuit Road Performance report

Q2 2025

System Overview

Name: Sandwich - 180 Cotuit Road
Location: Sandwich, MA
Size AC: 3111 kW
Size DC: 4357 kWp
Period: June 1, 2025 – June 30, 2025
Report Date: 07/09/25

Prepared by:
Ameresco
117 Flanders Road, Unit 100
Westborough, MA 01581

MA: Sandwich - 180 Cotuit Road Performance

	Q1	Q2	Q3	Q4	YTD
Actual Production MWH	796	1374			2170
Expected Energy MWH*	757	1971			2729
Estimated Production MWH**	1024	1732			2755
Actual vs Expected	105%	70%			80%
Actual vs Estimated	78%	79%			79%

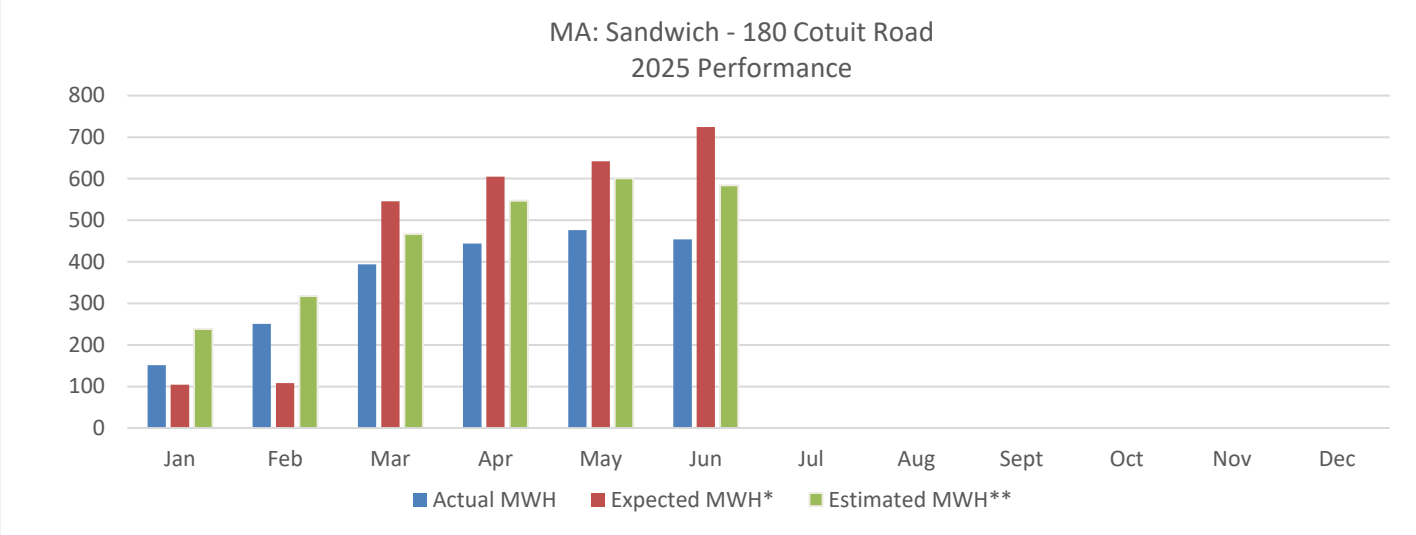

MA: Sandwich - 180 Cotuit Road Monthly Performance

	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sept	Oct	Nov	Dec
Actual MWH	151	251	394	444	476	454						
Exp MWH*	104	108	546	605	642	724						
Est MWH**	238	318	467	547	601	584						
Act vs Exp	146%	233%	72%	73%	74%	63%						
Act vs Est	63%	79%	84%	81%	79%	78%						

Actual Performance in May 2025 was 63% of the Expected, Weather Adjusted Model, and was short of the Estimated, PVsyst Model, by 78%.

MA: Sandwich - 180 Cotuit Road January Production

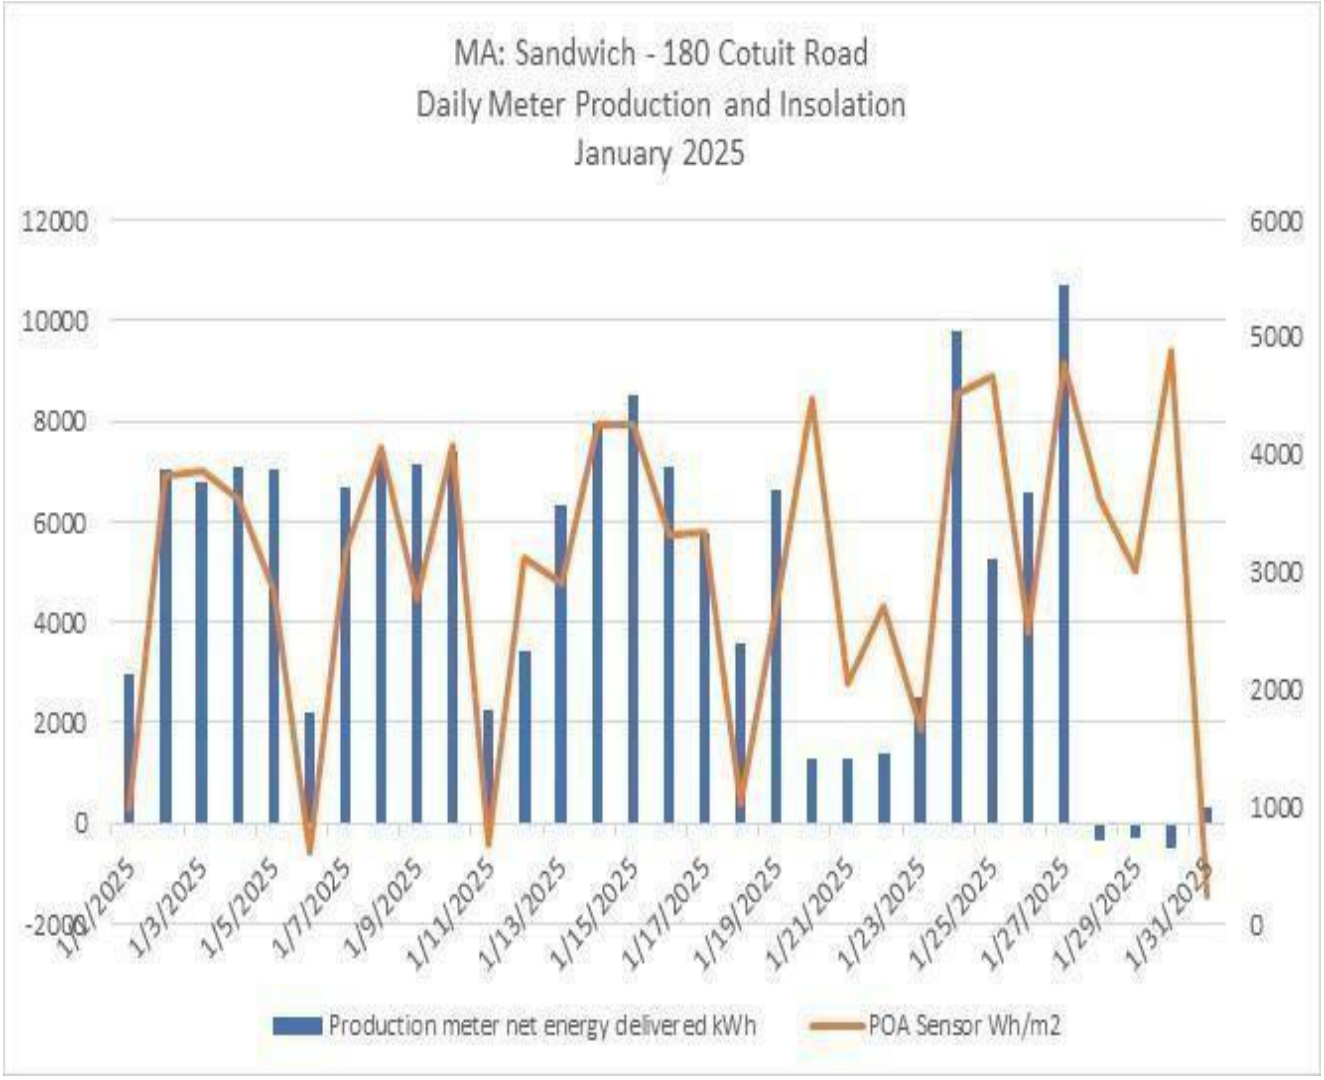

Events: -

1. The site was ofline from 01/28 due to an inverter fault. Later, Power Electronics brought the site back online on 01/31 by pulling the logs. SR096048

MA: Sandwich - 180 Cotuit Road February Production

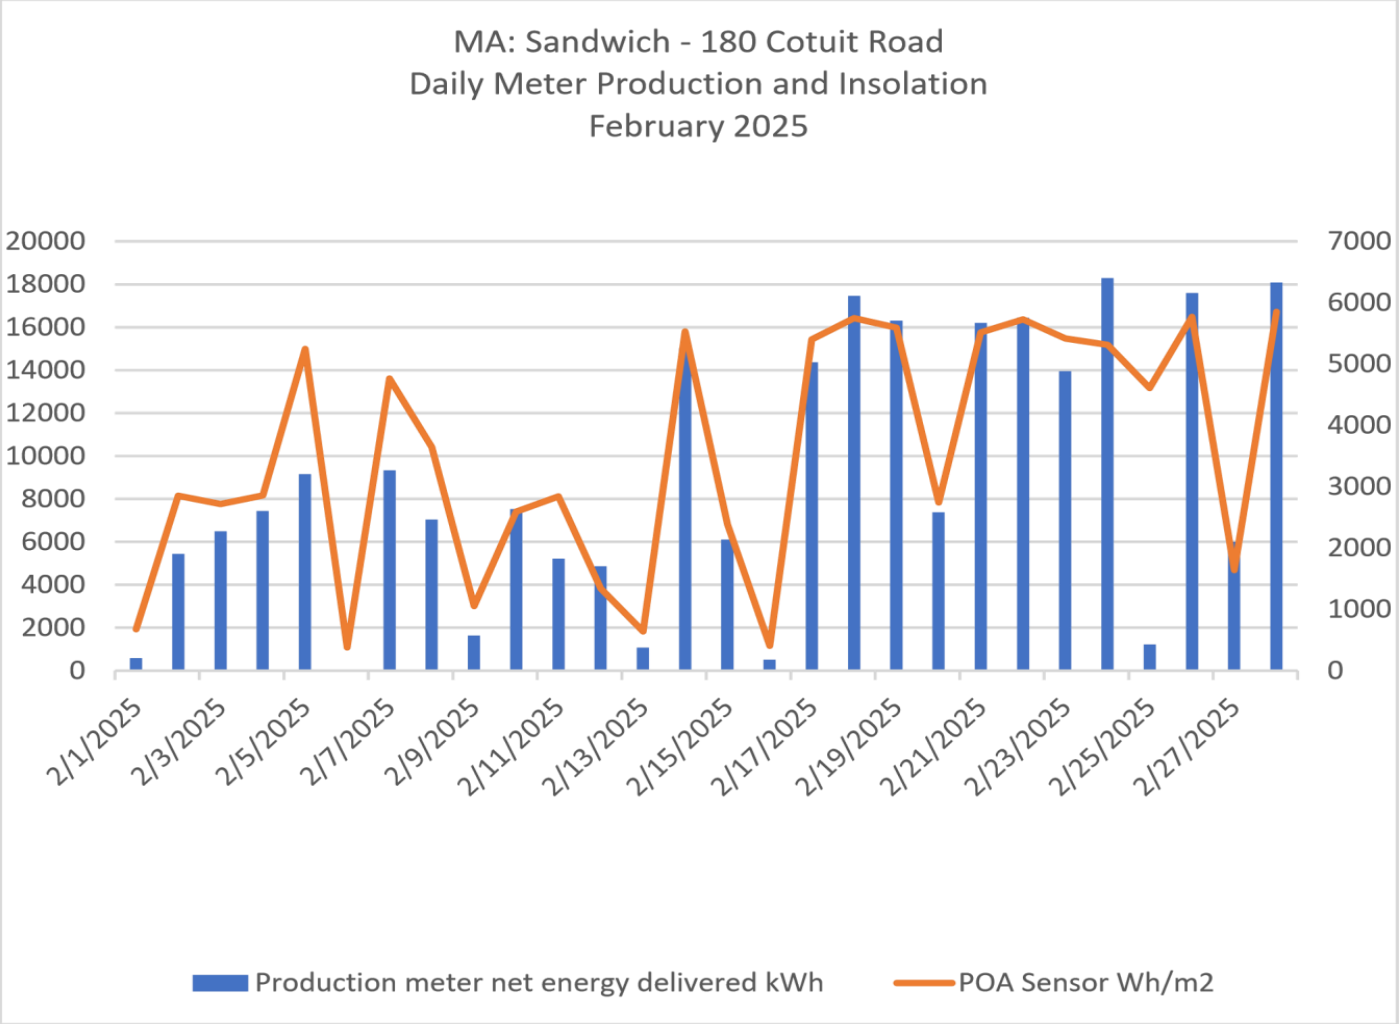

Events:

1. On 02/18/25, the technician found CB 15 strings 19 & 20 carrying 4 amps. Further investigation is needed to check for a ground fault or module issue. SR096077, SR097256.
2. The site was offline from 6:30 to 14:15 on 02/25/25 due to an inverter fault. The PE technician enabled all modules, put them in start mode, and brought the site back online. SR097746.

MA: Sandwich - 180 Cotuit Road March Production

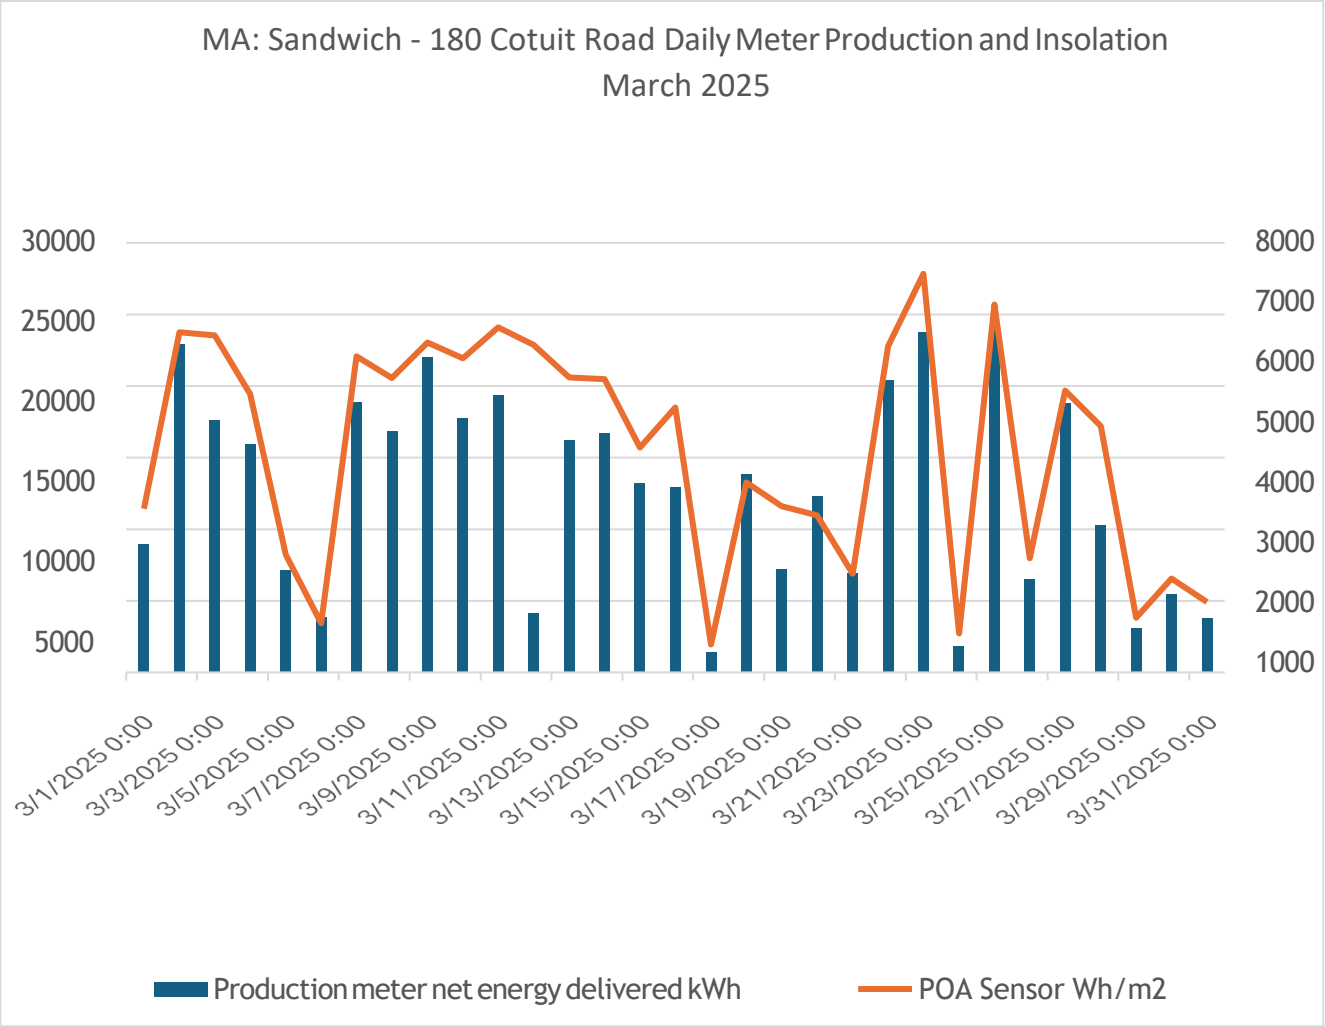

Events:

1. The site was taken offline from 08:30 to 14:45 on 03/12 due to an HVAC technician being on-site to check the site camera. SR098449
2. Power Electronics on site to perform retrospective ventilation. The Inverter will be taken offline from 11:30 to 13:15 on 03/28. SR099079
3. On 02/18/25, the technician found CB 15 strings 19 & 20 carrying 4 amps. Further investigation is needed to check for a ground fault or module issue. SR096077, SR097256, SR099474

MA: Sandwich - 180 Cotuit Road April Production

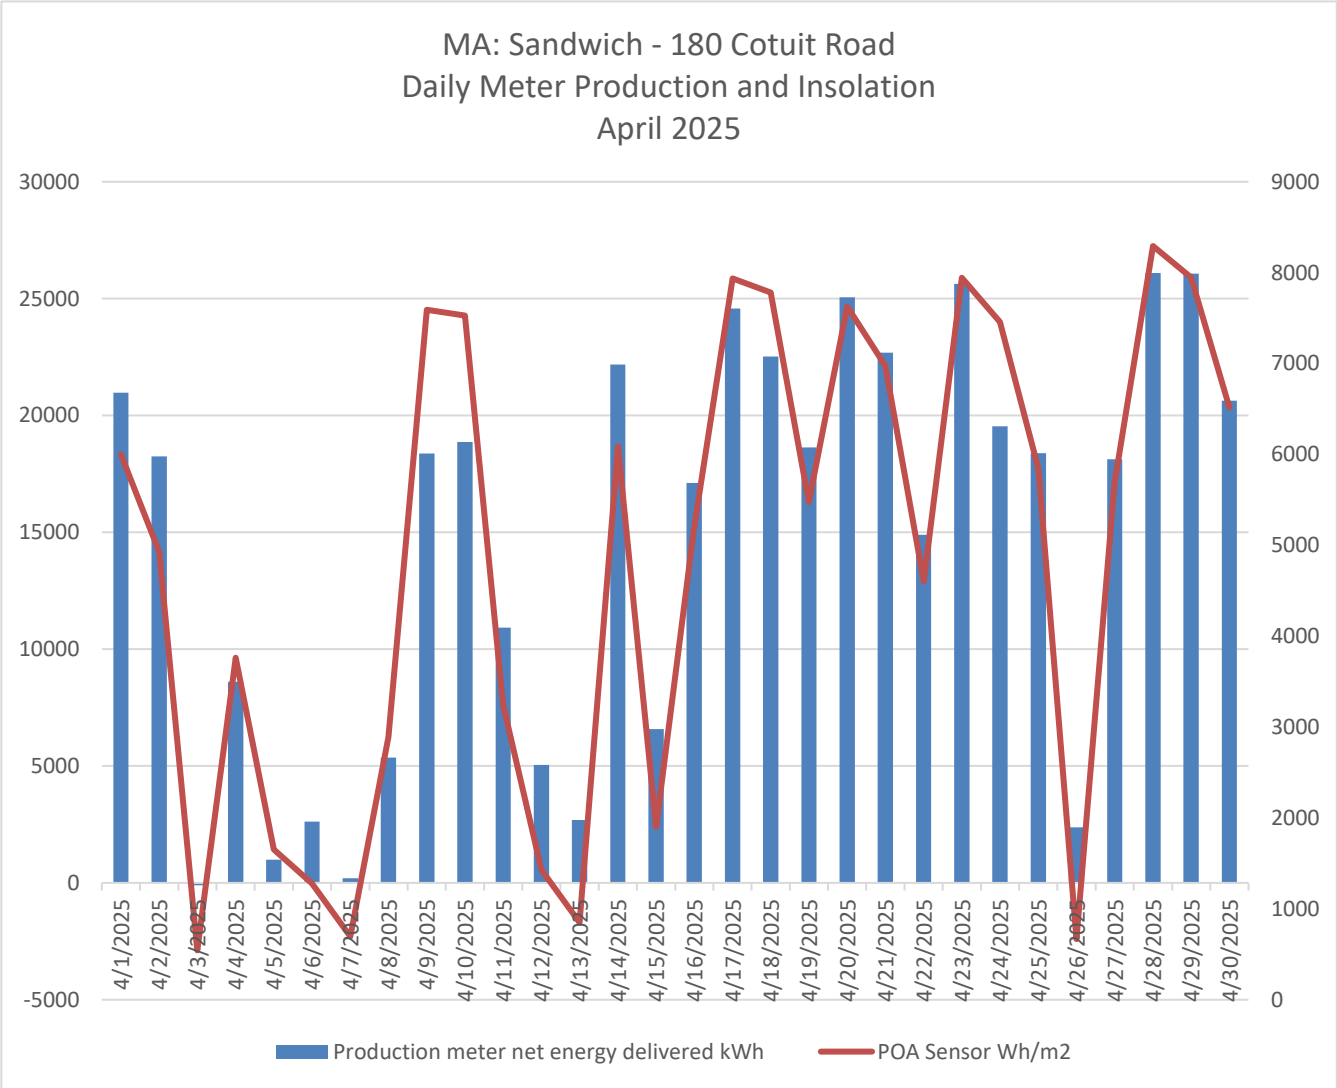

Events:-

1. The site was de-energized from 12:45 PM to 2:45 PM on 04/02 while PE was onsite to inspect inverter settings. **SR099316**
2. On 04/03 and 04/05, the inverter failed to start production but was brought back online after a technician performed a remote reset**. SR099371**

3. On 04/04, a technician checked in to investigate DC strings 19 and 20 in CB15 and discovered reverse polarity in jumper connections to a Northern Row. The jumpers were rewired with correct polarity, and final testing confirmed both strings were producing normally. **SR097256, SR099474 & SR099475.**

4. On 04/11/25, discrepancies were noted between meter and inverter readings, with the meter peaking at 3 MW while the inverter maxed at 2.2 MW. AE responded on 04/15/25, suggesting potential bin size logging or data latency issues and implemented logger setting changes. The issue now appears resolved, though the root cause remains unknown. PowerTrack still needs BESS data configured for accurate PV monitoring. **SR099700**

5. On 04/18, the inverter began production at 10:00 AM after experiencing a Softcharge DC5 fault. **SR099978**

6. Inverter tripped offline at 17:00 on 04/24 due to BW BF. PS. 151 fault and back online at 10Am on 04/25 after PE technician initiated the wake-up and soft charge process. **SR10036**

MA: Sandwich - 180 Cotuit Road May Production

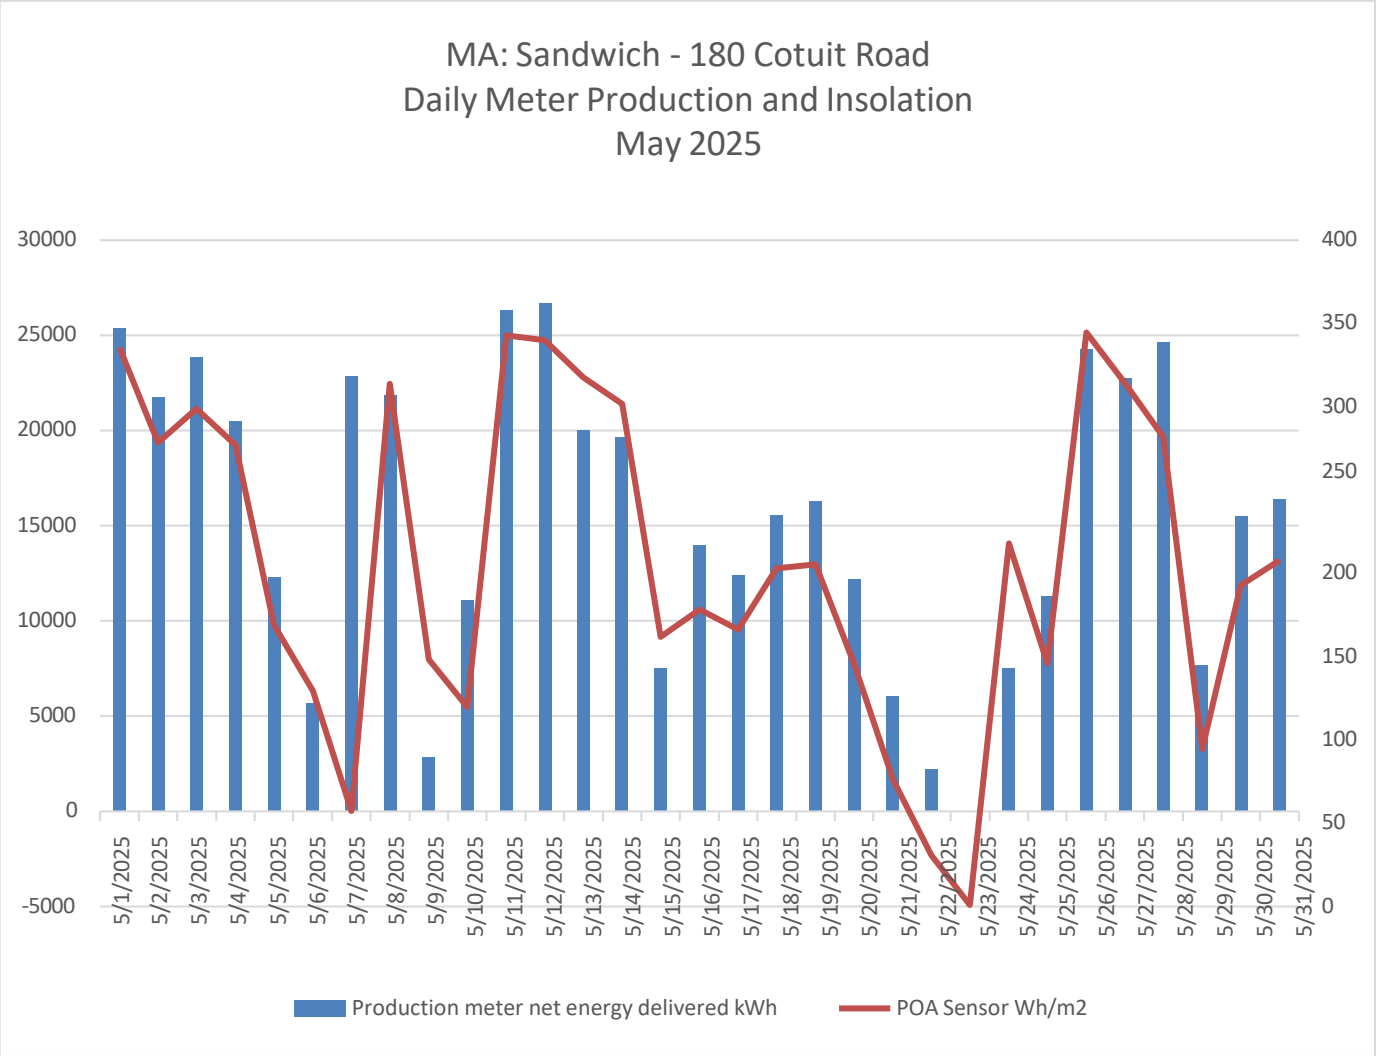

Events: -

1. The site was offline from 09:15 to 13:15 on 05/09. On 05/09, a technician reached out to Power Electronics and worked remotely with Pedro. Pedro was able to make changes to the parameters and get the inverter online. **SR101226**

2. Inverter 1 was offline from 18:15 on 05/13 to 09:45 on 05/14. Inverter was back online after technician with Remote support cleared fault and restarted inverter. **SR101418**

3. The site was offline from 10:30 to 11:45 on 05/15 as Power electronics technicians were on site to replace the main control board in an inverter 1 module. **SR101464**

4. Site was offline from 06:15 on 05/23 to 11:00 on 05/24. On 05/24, a technician was onsite and re-energized the site. The site was back online at 11:00 on 05/24. **SR101873**

MA: Sandwich - 180 Cotuit Road June Production

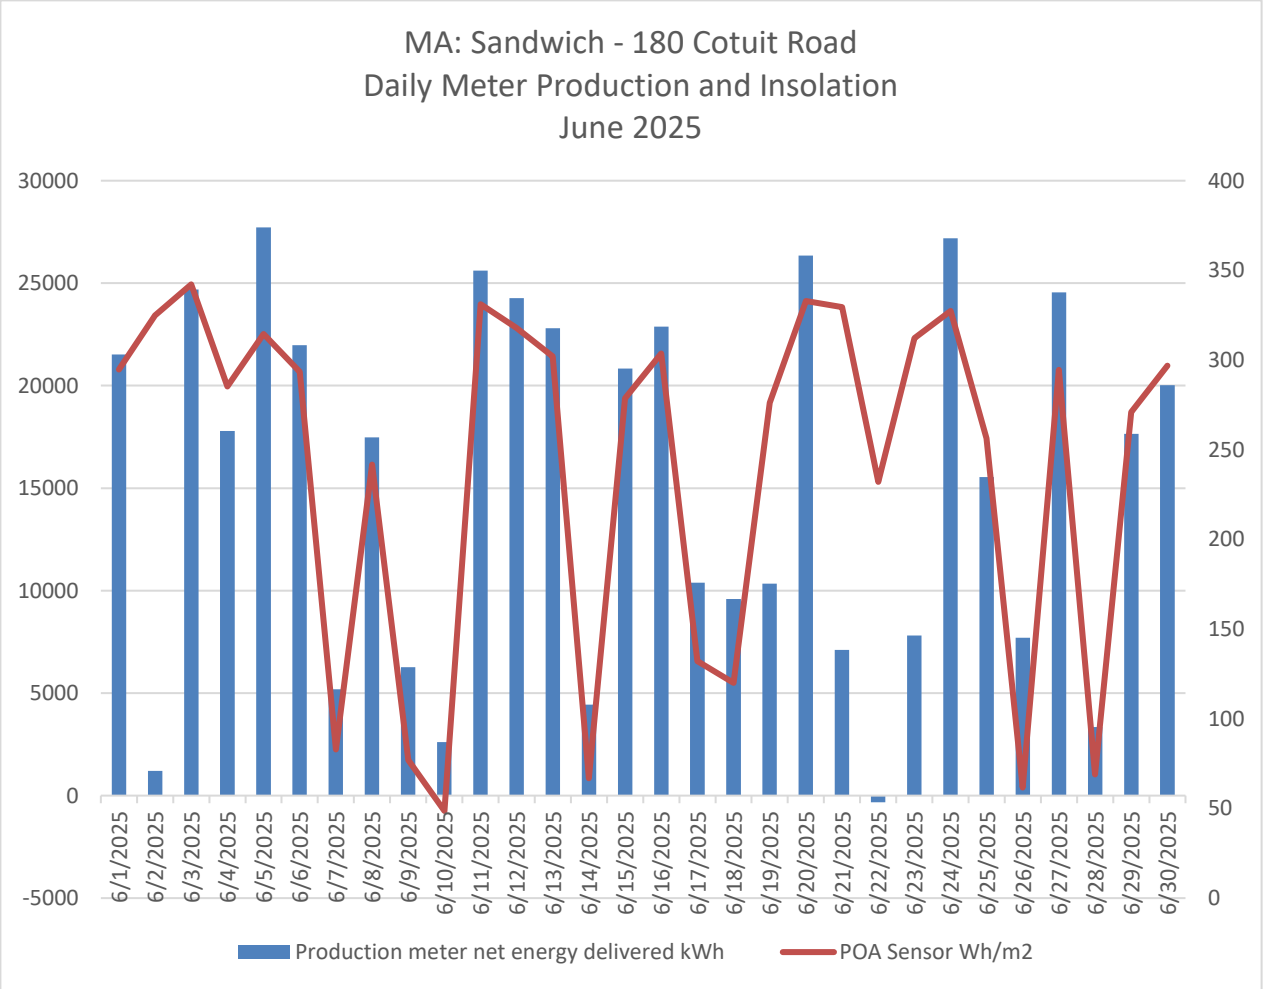

Events: -

1. Site tripped offline on 06/02 at 08:45 and back online on 06/03 at 08:00. **SR102295**
2. Inverter tripped offline at 18:00 on 06/03 and back online on 06/04 at 05:30. **SR102429**
3. The site was offline from 09:30 to 13:45 on 06/19. It was offline again from 08:45 to 11:45 on 06/21 and then went offline once more at 15:15 on the same day. It came back online on 06/23 at 09:00 but experienced another outage from 11:45 to 15:45 on the same day. **SR103172**

MA: Sandwich - 180 Cotuit Road Insolation

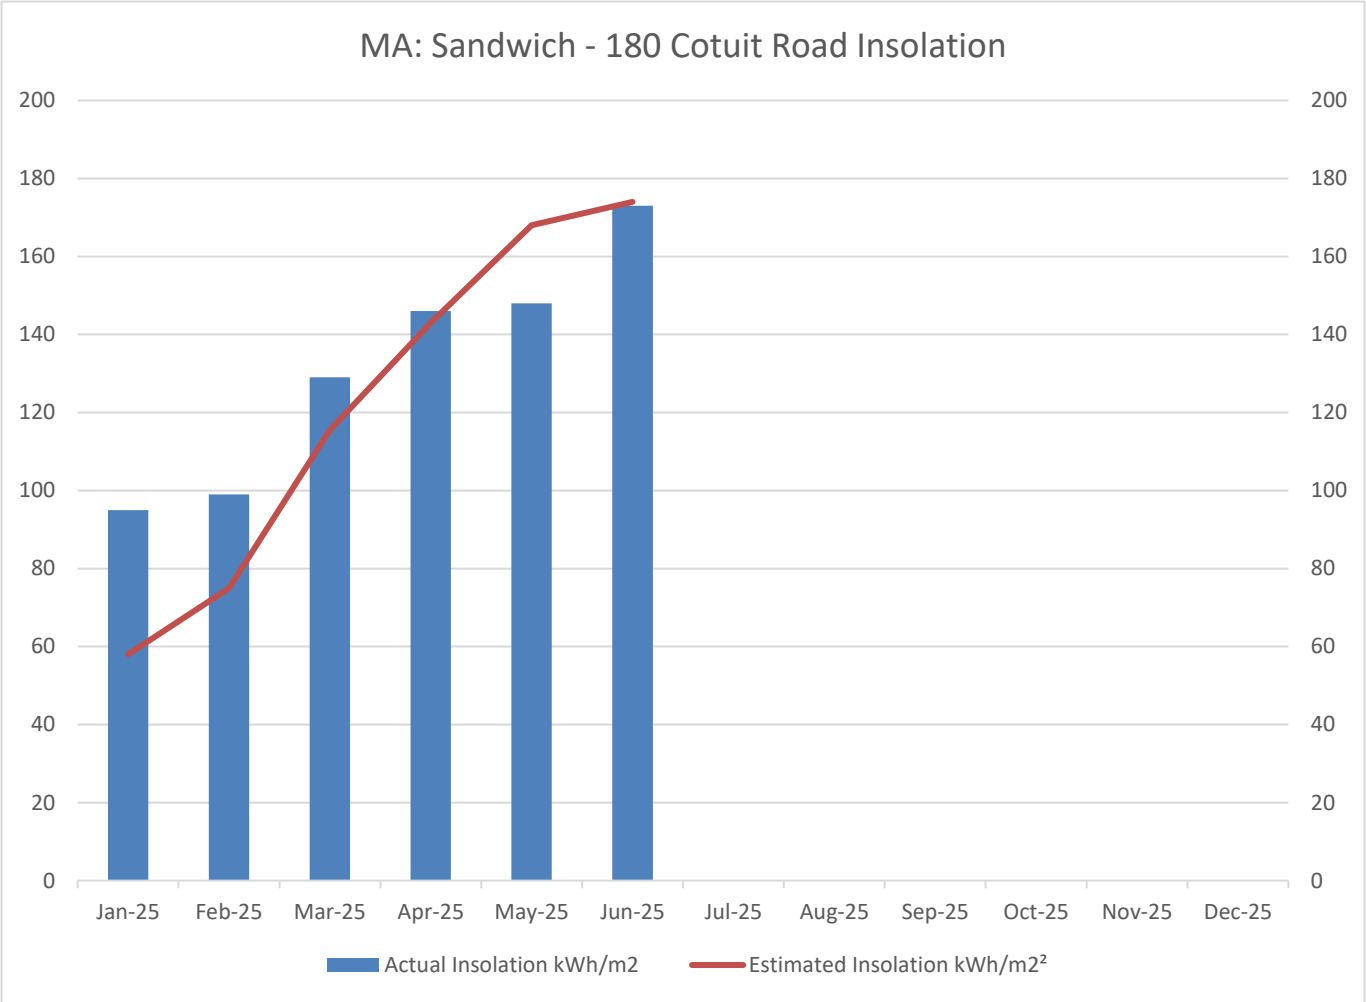

	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
Actual	95	99	129	146	148	173						
Est	58	75	115.5	143	168	174						
Act vs Est	162%	132%	112%	102%	88%	99%						

Estimated Insolation = Also Energy Estimated Insolation