Sample report. Illustrates the Report of Service Cleaning Pros Plus, LLC prepares; readings, findings and dates are illustrative.

Cleaning Pros Plus, LLC

Report of Service

Report No. RPT-K-SAMPLE · Job No. CPP-K-SAMPLE

CLEANED — 3 ITEMS NEED ATTENTION

The accessible areas of the exhaust system have been cleaned in accordance with NFPA 96 §12.6.1. Three installation items need correction — see Findings on page 7.

REPORT SUMMARY

Cleaning Pros Plus, LLC cleaned the full exhaust system, from the hood to the fan and rooftop area, and measured grease depth before and after with the depth gauge comb. The horizontal duct read at the cleaning-required depth before service. Every accessible location measured No Grease Build Up after service. The front and back of the fan blades were not accessible, so no grease depth was measured there. Three installation items need correction: the missing fan hinge, the missing rooftop grease containment, and the missing clean-out port on the fan bowl. All accessible areas were cleaned, and the inaccessible areas have been documented.

PREPARED FOR Sample Kitchen Fictional kitchen, California	**SERVICED BY** Cleaning Pros Plus, LLC IKECA Member #76716495
SYSTEM Charbroiler & Wok Line, One Hood, 1 Upblast Fan	**SERVICE DATE** 06/12/2026
JOB START 10:00 PM	**JOB END** 2:15 AM, 06/13/2026
LEAD TECHNICIAN Sample Technician	**COOKING CLASSIFICATION** Charbroiler / Wok / 24-7 Operation
INTERVAL BASIS NFPA 96 Table 12.4 — Quarterly	**NEXT SERVICE DUE** September 2026

SERVICE STATEMENT

The exhaust system at this premises was cleaned in accordance with NFPA 96 §12.6 (2024 edition). Ongoing maintenance responsibility rests with the building owner per §4.1. Determination of compliance with this standard is the responsibility of the Authority Having Jurisdiction (AHJ).

SERVICE AT A GLANCE

KEC **Kitchen Exhaust Cleaning** Service performed	34 / 35 items **Work Items Completed** Work Performed, page 8	0 µm **Post-Clean Depth, Accessible Locations** No Grease Build Up	3 findings **Needs Attention** High severity

SAMPLE

SCOPE OF SERVICE

Every location cleaned and observed on this service, with the result recorded at the time of service.

Areas Cleaned

Location	Status	Notes
Hood and Grease Capture Area	Cleaned	
Grease Filters and Baffles	Cleaned	Reinstalled after cleaning
Filter Track	Cleaned	
Hood Plenum	Cleaned	
Vertical Duct	Cleaned	Accessible sections
Horizontal Duct	Cleaned	Cleaning-required depth before service
Fan Bowl	Cleaned	
Fan Blades (Front)	Not Cleaned	Not accessible — no fan hinge — Finding 1
Fan Blades (Back)	Not Cleaned	Not accessible — no clean-out port on the fan bowl — Finding 3
Rooftop Fan Area	Cleaned	Roof grease present — see Finding 2

Areas Observed

Area	Result	Notes
Kitchen Work Area	No Issue	
Hood	No Issue	
Filter Track	No Issue	
Plenum	No Issue	
Fan Bowl	No Issue	
Fan Blades (Front)	Not Accessible	No fan hinge — Finding 1

SAMPLE

SCOPE OF SERVICE (CONTINUED)

Area	Result	Notes
Fan Blades (Back)	Not Accessible	No clean-out port — Finding 3
Ducts — Vertical	No Issue	
Ducts — Horizontal	No Issue	
Access Panels	No Issue	
Fan Hinge	Non-Operational	Missing — Finding 1
Rooftop Grease Containment	Non-Operational	Missing — Finding 2
Fan Bowl Clean-Out Port	Non-Operational	Missing — Finding 3
Roof Surface	Needs Attention	Grease present — Finding 2

INACCESSIBLE AREAS

The front and back of the fan blades could not be reached: the fan has no hinge (Finding 1) and the fan bowl has no clean-out port (Finding 3). Grease depth could not be measured on either side of the blades. No other area was inaccessible.

SAMPLE

GREASE DEPTH MEASUREMENTS

Readings against NFPA 96 §12.6.1.1, taken with the depth gauge comb at each location before and after cleaning. The fan bowl is measured against critical depth; every other location against the cleaning-required depth. Locations that could not be reached are marked Not Accessible and have no reading.

0	≤50	≥2,000	≥3,175
µm	µm	µm	µm
No Grease Build Up	**Acceptable**	**Cleaning Required**	**Critical Depth — Fan Bowl Only**
Depth Gauge Comb, ref. NFPA 96	NFPA 96 §12.6.1.1.1	NFPA 96 §12.6.1.1.3	NFPA 96 §12.6.1.1.4

PRE-CLEAN DEPTH BY LOCATION AGAINST THE TWO TRIGGER DEPTHS — EVERY ACCESSIBLE LOCATION READS ZERO AFTER CLEANING




Grease Depth by Location — Before and After Cleaning

Location	Pre-Clean	Post-Clean	Trigger	Result
Hood	Acceptable ≤ 50 µm / 0.002 in	No Grease Build Up 0 µm / 0.000 in	≥ 2,000 µm	Cleaned
Vertical Duct	Acceptable ≤ 50 µm / 0.002 in	No Grease Build Up 0 µm / 0.000 in	≥ 2,000 µm	Cleaned
Horizontal Duct	Cleaning Required ≥ 2,000 µm / 0.078 in	No Grease Build Up 0 µm / 0.000 in	≥ 2,000 µm	Cleaned
Fan Blade (Front)	Not Accessible Not measured	Not Accessible Not measured	≥ 2,000 µm	Not Cleaned
Fan Blade (Back)	Not Accessible Not measured	Not Accessible Not measured	≥ 2,000 µm	Not Cleaned
Fan Bowl	Acceptable ≤ 50 µm / 0.002 in	No Grease Build Up 0 µm / 0.000 in	≥ 3,175 µm	Cleaned

SAMPLE

GREASE DEPTH — BEFORE AND AFTER CLEANING

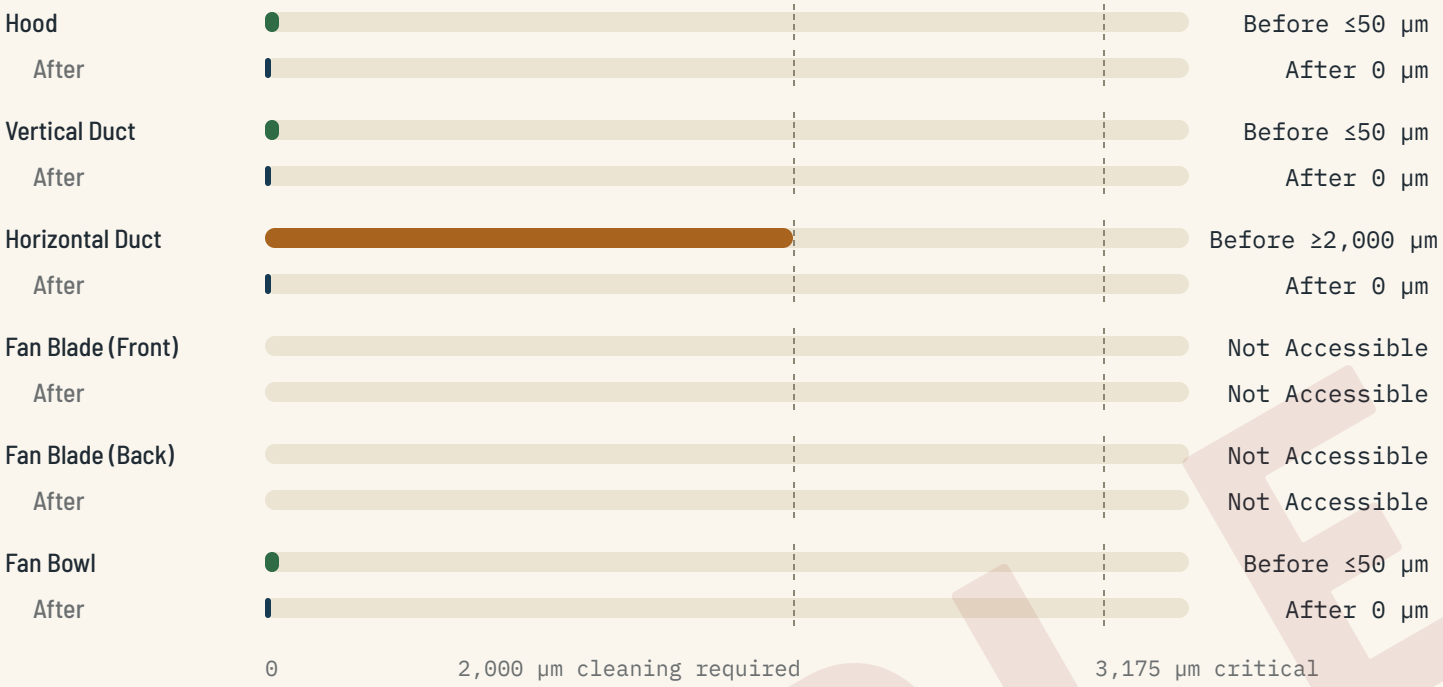

SYSTEM COMPONENTS

Condition of every component of the system. Operational: working as intended. Needs Attention: needs correction. Non-Operational: missing or not working. Not Accessible: could not be reached. Items that need attention are explained in Findings.

Component	Condition	Notes
Hood and Grease Capture Area	Operational	
Grease Filters and Baffles	Operational	
Hood Plenum	Operational	
Hood Lights	Operational	
Horizontal Ductwork	Operational	
Vertical Ductwork and Risers	Operational	
Exhaust Fan 1 of 1 (Upblast)	Needs Attention	See Findings 1 and 3
Fan Hinge	Non-Operational	See Finding 1
Fan Bowl Clean-Out Port	Non-Operational	See Finding 3
Fan Blades (Front)	Not Accessible	See Finding 1
Fan Blades (Back)	Not Accessible	See Finding 3

SAMPLE

SYSTEM COMPONENTS (CONTINUED)

Component	Condition	Notes
Rooftop Grease (Roof Surface)	Needs Attention	See Finding 2
Rooftop Grease Containment	Non-Operational	See Finding 2
Drip Trays and Grease Cups	Operational	
Fire-Suppression Service Tag	Current	Service tag only

SAMPLE

FINDINGS

Items observed during service, with the correction for each. Each finding is high severity.

Finding 1 — Fan hinge missing

HIGH

Without a hinge the fan can't be lifted safely, which blocks access for cleaning.

NFPA 96 REFERENCE

§8.1.2.1 — Upblast fan hinge. §8.1.6.3.1 and §8.1.6.3.2 — Upblast fan access opening.

REQUIRED CORRECTION

Install a hinge so the fan lifts safely for observation and cleaning.

Finding 2 — Rooftop grease containment missing

HIGH

Grease on the roof damages the roofing and is costly to repair.

NFPA 96 REFERENCE

§8.1.1.3 — Rooftop grease containment.

REQUIRED CORRECTION

Install rooftop grease containment at the fan and clean the grease from the roof.

Finding 3 — Fan bowl clean-out port missing

HIGH

Without a port, grease builds up on the back of the fan blades where it can't be reached, and it negatively impacts performance.

NFPA 96 REFERENCE

§8.1.6.3.1 and §8.1.6.3.2 — Upblast fan access opening.

REQUIRED CORRECTION

Install a clean-out port on the fan bowl so the back of the fan blades can be cleaned.

SERVICE INTERVAL — NFPA 96 TABLE 12.4

Set by NFPA 96 Table 12.4 on cooking volume and equipment type.

Solid Fuel	**MONTHLY**
Charbroiler / Wok / 24-7 Operation	**QUARTERLY**
Moderate-Volume	**SEMI-ANNUAL**
Low-Volume	**ANNUAL**

NEXT SERVICE DUE — THIS SYSTEM	September 2026 (Quarterly)

SAMPLE

WORK PERFORMED

34 of 35 items completed. 1 item not accessible (fan blades).

1	Containment tarps placed under hood and work area	Complete
2	Cooking equipment verified off and cool	Complete
3	PPE — gloves, goggles, respirator donned	Complete
4	Pressure washer filled, tested, and operational	Complete
5	Chemicals loaded — SDS reviewed	Complete
6	Grease receptacle positioned under drain points	Complete
7	Client or kitchen manager notified of start	Complete
8	Access panels located and opened	Complete
9	Filters removed and staged for cleaning	Complete
10	Before photos taken — all required angles	Complete
11	Pre-clean grease depth measurements recorded	Complete
12	Hood interior degreased	Complete
13	Filters cleaned or exchanged	Complete
14	Filter track cleaned	Complete
15	Plenum cleaned	Complete
16	Vertical duct cleaned — accessible sections	Complete
17	Horizontal duct cleaned — if applicable	Complete
18	Fan housing cleaned	Complete
19	Fan blades cleaned — if accessible	Not Accessible
20	Grease removal device cleaned	Complete
21	Rooftop fan area cleaned	Complete
22	Grease collection points cleared and cleaned	Complete
23	All grease collected — CWA compliant disposal	Complete
24	Deficiencies and findings documented	Complete
25	Kitchen work area kept clean during service	Complete
26	After photos taken — all required angles	Complete
27	Post-clean grease depth measured — all surfaces	Complete
28	Filters reinstalled correctly	Complete
29	Access panels closed and secured	Complete
30	Containment tarps removed and disposed	Complete
31	Kitchen work area cleaned and restored	Complete
32	Equipment tag and service sticker applied	Complete
33	CWA disposal log completed	Complete
34	Client walk-through completed	Complete
35	Technician signature captured	Complete

SAMPLE

PHOTO DOCUMENTATION

Before and after photos by photo type, taken by the technician at the time of service. Each pair is the same angle.

BEFORE · NOT CAPTURED

AFTER · NOT CAPTURED

Kitchen Work Area

Whole cook line, same angle

BEFORE · NOT CAPTURED

AFTER · NOT CAPTURED

Hood and Grease Capture Area

Interior, same angle

BEFORE · NOT CAPTURED

AFTER · NOT CAPTURED

Filter Track

Left to right run

BEFORE · NOT CAPTURED

AFTER · NOT CAPTURED

Hood Plenum

Through filter opening

BEFORE · NOT CAPTURED

AFTER · NOT CAPTURED

Vertical Duct

Accessible section

BEFORE · NOT CAPTURED

AFTER · NOT CAPTURED

Horizontal Duct

At access panel

BEFORE · NOT CAPTURED

AFTER · NOT CAPTURED

Fan Bowl

Housing interior

Not Accessible

Fan Blades (Front)

Not accessible — no fan hinge, see Finding 1

SAMPLE

PHOTO DOCUMENTATION (CONTINUED)

Not Accessible

Fan Blades (Back)

Not accessible — no clean-out port, see Finding 3

ON ARRIVAL · NOT CAPTURED

ON DEPARTURE · NOT CAPTURED

Rooftop Fan Area

Roof condition — roof grease, see Finding 2

SAMPLE

ADDITIONAL PHOTOS

Photos the technician added during service, each with its caption.

ADDED · NOT CAPTURED

Additional Photo 1
Technician’s caption

ADDED · NOT CAPTURED

Additional Photo 2
Technician’s caption

ADDED · NOT CAPTURED

Additional Photo 3
Technician’s caption

SAMPLE

ATTESTATION & SIGNATURES

ATTESTATION

This report documents the observations and cleaning of the kitchen exhaust system at the above-described premises. Per NFPA 96 §12.6 (2024 edition), exhaust systems serving commercial cooking operations shall be cleaned and maintained by trained, qualified, and certified personnel. All accessible surfaces were cleaned as documented in this report. The determination of compliance with NFPA 96 is the responsibility of the Authority Having Jurisdiction.

TECHNICIAN

Sample Technician

Sample Technician · Lead Technician

06/13/2026

"I certify that the readings, methods, and findings recorded are true and accurate, and that the cleaning and observations were performed per NFPA 96 §12.6."

AUTHORIZED BY

Arthur L. Haggerty, Jr

Arthur L Haggerty, Jr · Founder & CEO

CESI #200771 · CECS #200452

06/13/2026

"I attest that this report passed Cleaning Pros Plus, LLC's quality assurance review before release. The technician's readings, photos and findings were checked against the job record, and I approve this report for issue to the client."

RELATED DOCUMENTS

Certificate of Service: CERT-K-SAMPLE

SAMPLE