Production: MARGARINE

Objective: Spreadability/Softness of Margarine

Type of action:

Test setting:

| Speed | Test mode | Trigger | Target | Hold |
|--------|--------------|---------|--------|-------|
| 3 mm/s | Distance (c) | 0 gf | 23 mm | 0 sec |

Accessory:

Butter spreadability rig, Platform

Introduction:

Firmness (or hardness - the two are synonymous) as a discrete sensory property of a tablespread is implicit in the determination of its spreadability. The first impression of a tablespread texture will be that of its firmness, obtained as the consumer forces a spreading instrument into the product. Spreadability, in pragmatic terms, is the ease with which a spread can be applied in a thin, even layer to bread. Firmness or hardness may be measured by the force required to obtain a given deformation or by the amount of deformation under a given force. Although spreadability is also a deformation under an external load, it is a more dynamic property. Measurements of firmness and spreadability are usually highly correlated, however the relationship is rarely perfect, and this is partly a function of worksoftening. Margarine, for instance, worksoftens (when spread on bread) more easily than butter, which allows it to be more spreadable even when hardness values are initially equal.

The Butter spreadability rig is a set of precisely matched male and female perspex 90 cones. The material is allowed to set up in the lower cone or is filled into the lower cone with a spatula. The material is pressed down only so much as is needed to eliminate air pockets which are visible through the perspex cones, and then the surface is levelled with a flat knife. Excessive work is not introduced into the product. The fixture comes with five replaceable female cone sample holders which can be filled in advance of testing and then easily locked into the base holder precisely centred under the matching upper male cone probe. The sample holders can be stored in refrigerated or frozen environments, or they can be used at room temperature.

As long as the material has not been excessively worked or whipped, different styles of filling the material only affect the early part of the test.

The important action that the test is designed to measure, spreadability, occurs only in the later stages of the test. During these stages the product is squeezed out from between the male and female cones. The cone-shaped holder offers no locations into which the product can be packed or compressed, so the product flows outward between the male and female cone surfaces. The probe withdrawal may offer some insights into adhesive behaviours.

FAX: 03-3819338

TEL: 03-3819203

Sample Preparation:


Place sample into the female cone and press it down to eliminate air pockets. Before filling all of the sample holders, use an empty holder to perform the probe calibration procedure (see below). Scrape off any excess sample with a knife, to leave a flat test area. Excessive work should not be introduced into the product. Allow the samples to equilibrate to the specified temperature e.g. 5C before testing.

Test Set-Up:

Place the Heavy Duty Platform on the base of the machine but do not secure the position at this stage. Position the base holder on the Heavy Duty Platform and lock into place by tightening the screws. Insert an empty female cone sample holder into the base holder. Move the male cone probe down so that it fits almost all of the way into the female cone sample holder. When the male and female cones are practically touching, manoeuvre the Heavy Duty Platform so that the cones are precisely aligned. At this point tighten the screws of the Heavy Duty Platform so that it is secured into position. Before testing, the male cone probe must be calibrated against the female cone so that the starting point is at the same height for each test e.g 25.0mm above the female cone. To do this, raise the male cone up so that it is just above the female cone and select: Calibrate Probe.

When prompted, type in 25.0mm for the return distance, then click on OK. The probe will come down, just touch the female cone, and then return to a position precisely 25.0mm over the female cone. The Control Probe facility allows this test position to be reset rapidly and accurately after replacing the female cone with a new sample and cleaning the male cone. Each test must commence from the 25mm start position.

Typical plots:

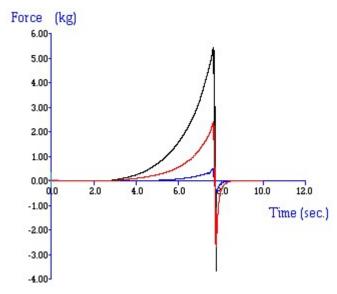

The above curves were produced from three different types of margarine, tested at 5C.

TEL: 03-3819203

FAX: 03-3819338

Observations:

Once the test is commenced the male cone probe proceeds to approach and then penetrate into the margarine sample and continues to a depth of 2mm above the sample holder surfaces, i.e. the probe moves a distance of 23mm from its start point. During penetration the force is seen to increase up until the point of maximum penetration depth. This force value can be taken as the "Firmness" at this specified depth. A firmer sample also shows a correspondingly larger area that represents the total amount of force required to perform the shearing process. Both of these values have been shown to rank samples in the same order of spreadability (and firmness), but for some samples one many prove to be more suitable than the other. The probe then proceeds to withdraw from the sample.

Data Analysis:

⊠Area (+)

Results

| Sample | Mean Max. +ve Force 'Firmness' (+/- S.D.) (kg) | Mean Area 'Work of Shear' (+/- S.D.) (kg s) |
|--------|--|--|
| А | 5.08 +/- 0.54 | 6.26 +/- 0.83 |
| В | 2.35 +/- 0.04 | 2.61 +/- 0.04 |
| С | 0.53 +/- 0.02 | 0.44 +/- 0.02 |

Notes:

- To avoid the Texture Analyser from overloading/underloading, the cones must be precisely aligned and the chosen penetration distance should always be at least two millimetres less than the calibrated probe height.
- In between tests, only remove the female cone from the base holder; do not remove the base holder from the Heavy Duty Platform otherwise the male and female cones will require realignment.
- During penetration, a large blip in the otherwise smooth curve may be observed. This is due to the compression of an air pocket within the product, so it is important to minimise the presence of air pockets when filling the female cone.
- When reporting results the test temperature and calibrated height (start point) should always be specified for the purpose of comparison.
- When attempting to optimise test settings it is suggested that the first tests are performed on the hardest samples to anticipate the maximum testing range required and ensure that the force capacity allows testing of all future samples.
- References:

Methods to Assess Quality and Stability of Oils and Fat-Containing Foods (Eds. K. Warner & N.A. M. Eskin), AOCS Press (1994).

FAX: 03-3819338

Food Texture - Instrumental and Sensory Measurement (Ed. H.R. Moskowitz), Marcel Dekker (1987).

TEL: 03-3819203