Asset Intelligence Copilot
Gemini 3.5 Flash Lite · 600 wells · Reference date: 15 January 2027

Approach and architecture

The copilot turns an operator’s question into scoped data queries, an evidence-backed explanation, and inline visual components. It combines structured inspections and work orders with maintenance reports, operator notes, manuals and SOPs. Numerical results are computed by tools; the model selects the investigation and explains what the records support. Missing measurements stay missing rather than being replaced with an unrelated proxy.

The active application uses React, CopilotKit and AG-UI, with Ant Design tables, ECharts charts and Leaflet maps. The backend is FastAPI with a bounded LangGraph workflow and Google AI Studio’s Gemini 3.5 Flash Lite through the official LangChain Google integration. A response can contain several coordinated panels, not just one component. Sessions, answers, source references and result sets are saved so the same response can be reopened in the UI.

Diagram 10 — Overall copilot architecture

The system separates the conversation interface, the reasoning workflow and the data provider. The planner resolves the requested assets, time window and analysis, then proposes typed operations. The application validates those operations, executes them against the effective records, and supplies a bounded context to the answer maker. The maker returns prose and a UI plan referencing server-owned results. Local checks validate source handles, numerical values and visual encodings before the trusted React component catalog renders the answer.

Diagram 12 — Source-to-context retrieval flow

Ingestion streams the dataset folders into an indexed SQLite representation while preserving source files, record IDs and report links. Typed fields support exact totals, rankings, time windows and joins; lexical source search locates relevant prose and SOP sections. Corrections overlay the originals rather than deleting them. Type and team histories are resolved at the relevant event date, late-entered records are ordered by their observation dates, and operator notes retain their timestamps. Dedicated assessments join the relevant records with the supplied gas-response, bypass, recall and regulatory rules. Full result arrays stay on the server; the model receives compact evidence and scope summaries.

Diagram 13 — Memory writes and conversation summaries

Gemini proposes remembered facts from the current user’s own statement. The application checks the quoted source, subject, scope, validity dates and conflicts before a transactional save. Shared asset observations, plans and corrections are available to other users; personal preferences and private conversation references stay user-scoped. A save is acknowledged only after a commit receipt exists. Firsthand reports, hearsay and contradictory claims remain distinguishable. Raw user and assistant messages are stored privately, and a rolling summary is scheduled after ten completed exchanges or earlier context overflow.

Diagram 14 — Bounded context without deleting the record

The admitted content budget is 2,000 long-term-memory tokens in total, 1,000 conversation tokens and 2,000 retrieved-evidence tokens. Long-term context includes a compact user/shared view and relevant facts; recent dialogue and a versioned summary provide short-term continuity. The canonical facts, original conversation and source evidence remain durable when items are omitted from the prompt. Google token counting measures admission, and compaction removes whole optional items rather than silently changing facts. Instructions, tool schemas, the current question and generated output are accounted for separately.

Implementation notes

The four figures above are the original requested diagrams. Earlier model labels or research-check counts inside those design images are historical; the active runtime is Gemini 3.5 Flash Lite and the active dataset contains 600 wells. Research comparisons are not claimed as final scenario accuracy.

Production status uses corrected wellhead-minus-ambient readings and the applicable type manual, including historical type changes. Recorded metadata can be stale. Source documents define the relevant regulatory windows and deadlines; the publication date of a letter is not automatically the period of the incidents it covers. A statement about absent reservoir pressure or produced-oil volumes does not

authorize using equipment ratings, temperature or spill barrels as substitutes.

Results — all 11 scenarios
Each question below will be followed by the actual saved response JSON. Multi-turn scenarios retain their separate users and sessions. Complete, partial and unavailable-data outcomes remain distinct; successful model delivery alone is not a claim of factual correctness.

Diagram 10

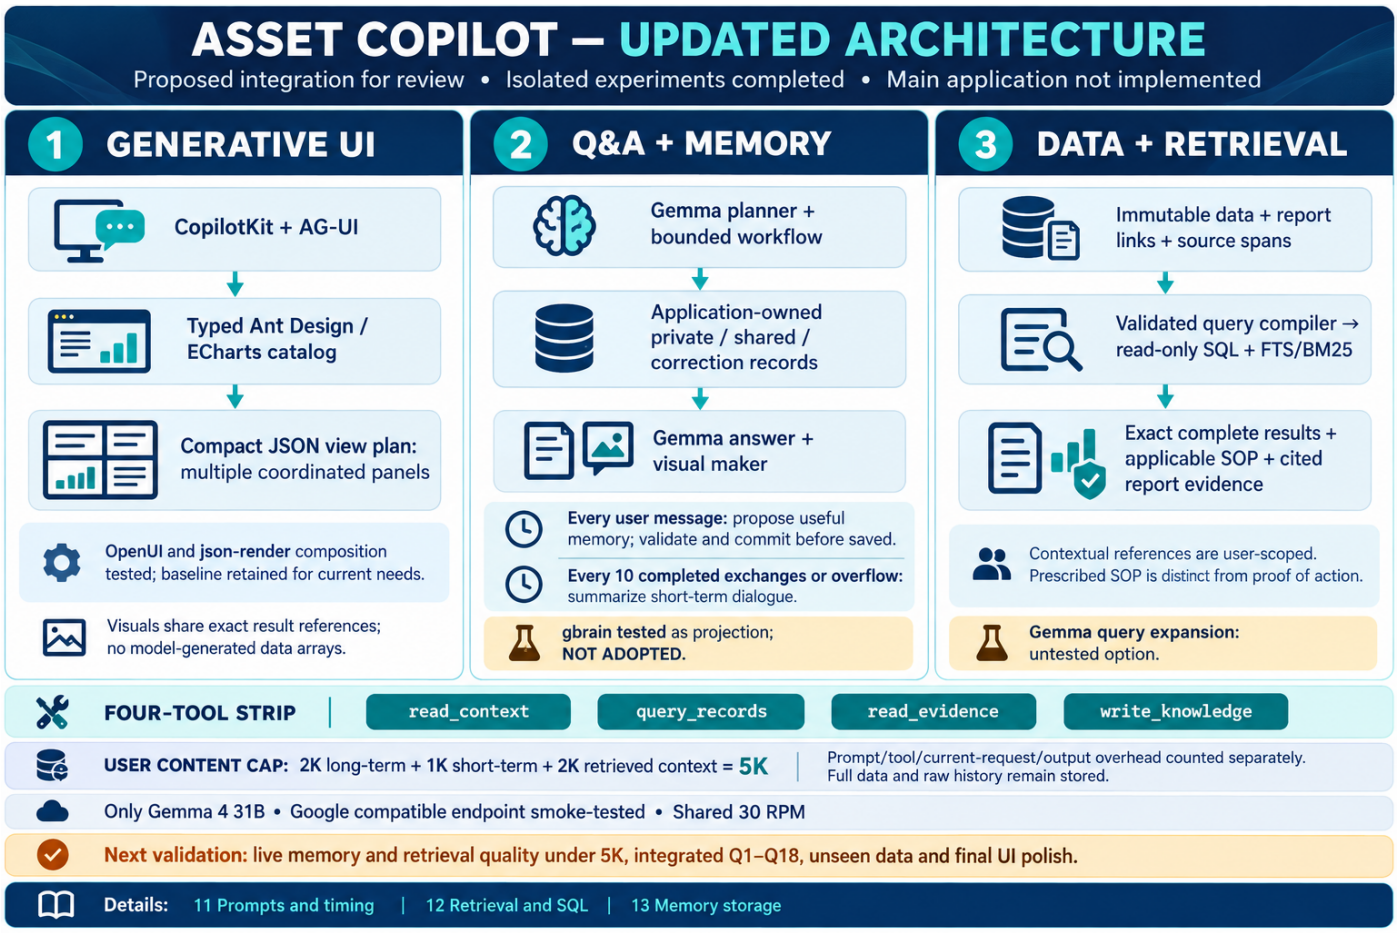

ASSET COPILOT — UPDATED ARCHITECTURE
Proposed integration for review • Isolated experiments completed • Main application not implemented
1 GENERATIVE UI
CopilotKit + AG-UI
Typed Ant Design / ECharts catalog
Compact JSON view plan: multiple coordinated panels
OpenUI and json-render composition tested; baseline retained for current needs.
Visuals share exact result references; no model-generated data arrays.
2 Q&A + MEMORY
Gemma planner + bounded workflow
Application-owned private / shared / correction records
Gemma answer + visual maker
Every user message: propose useful memory; validate and commit before saved.
Every 10 completed exchanges or overflow: summarize short-term dialogue.
gbrain tested as projection; NOT ADOPTED.
3 DATA + RETRIEVAL
Immutable data + report links + source spans
Validated query compiler → read-only SQL + FTS/BM25
Exact complete results + applicable SOP + cited report evidence
Contextual references are user-scoped. Prescribed SOP is distinct from proof of action.
Gemma query expansion: untested option.
FOUR-TOOL STRIP
read_context
query_records
read_evidence
write_knowledge
USER CONTENT CAP: 2K long-term + 1K short-term + 2K retrieved context = 5K
Prompt/tool/current-request/output overhead counted separately. Full data and raw history remain stored.
Only Gemma 4 31B • Google compatible endpoint smoke-tested • Shared 30 RPM
Next validation: live memory and retrieval quality under 5K, integrated Q1–Q18, unseen data and final UI polish.
Details: 11 Prompts and timing | 12 Retrieval and SQL | 13 Memory storage

Diagram 12

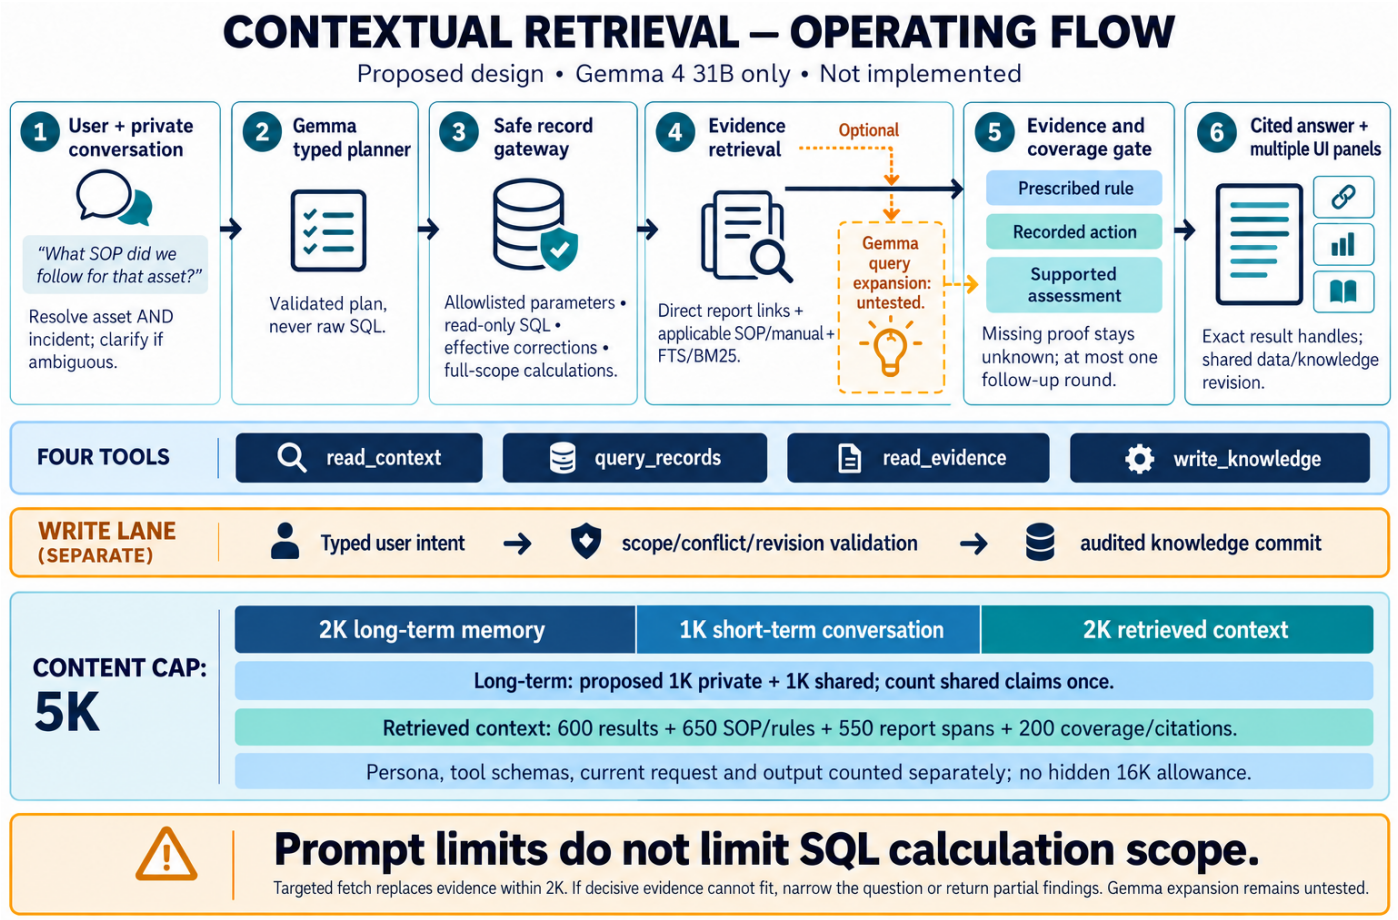

CONTEXTUAL RETRIEVAL – OPERATING FLOW
Proposed design • Gemma 4 31B only • Not implemented
1 User + private conversation
"What SOP did we follow for that asset?"
Resolve asset AND incident; clarify if ambiguous.
2 Gemma typed planner
Validated plan, never raw SQL.
3 Safe record gateway
Allowlisted parameters • read-only SQL • effective corrections • full-scope calculations.
4 Evidence retrieval
Optional
Direct report links + applicable SOP/manual + FTS/BM25.
Gemma query expansion: untested.
5 Evidence and coverage gate
Prescribed rule
Recorded action
Supported assessment
Missing proof stays unknown; at most one follow-up round.
6 Cited answer + multiple UI panels
Exact result handles; shared data/knowledge revision.
FOUR TOOLS
read_context
query_records
read_evidence
write_knowledge
WRITE LANE (SEPARATE)
Typed user intent
scope/conflict/revision validation
audited knowledge commit
CONTENT CAP: 5K
2K long-term memory
1K short-term conversation
2K retrieved context
Long-term: proposed 1K private + 1K shared; count shared claims once.
Retrieved context: 600 results + 650 SOP/rules + 550 report spans + 200 coverage/citations.
Persona, tool schemas, current request and output counted separately; no hidden 16K allowance.
Prompt limits do not limit SQL calculation scope.
Targeted fetch replaces evidence within 2K. If decisive evidence cannot fit, narrow the question or return partial findings. Gemma expansion remains untested.

Diagram 13

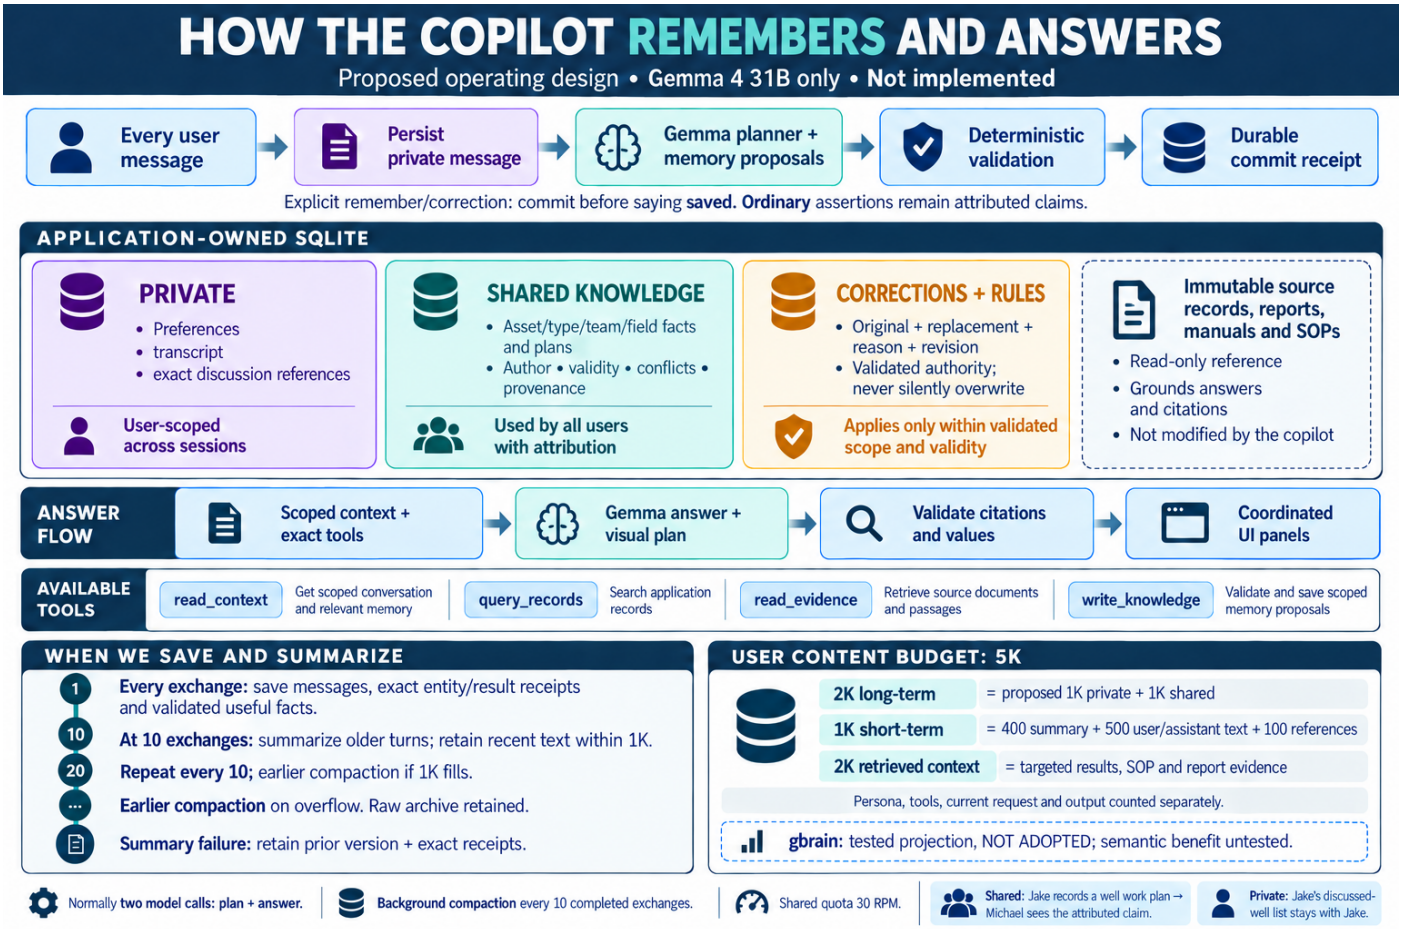
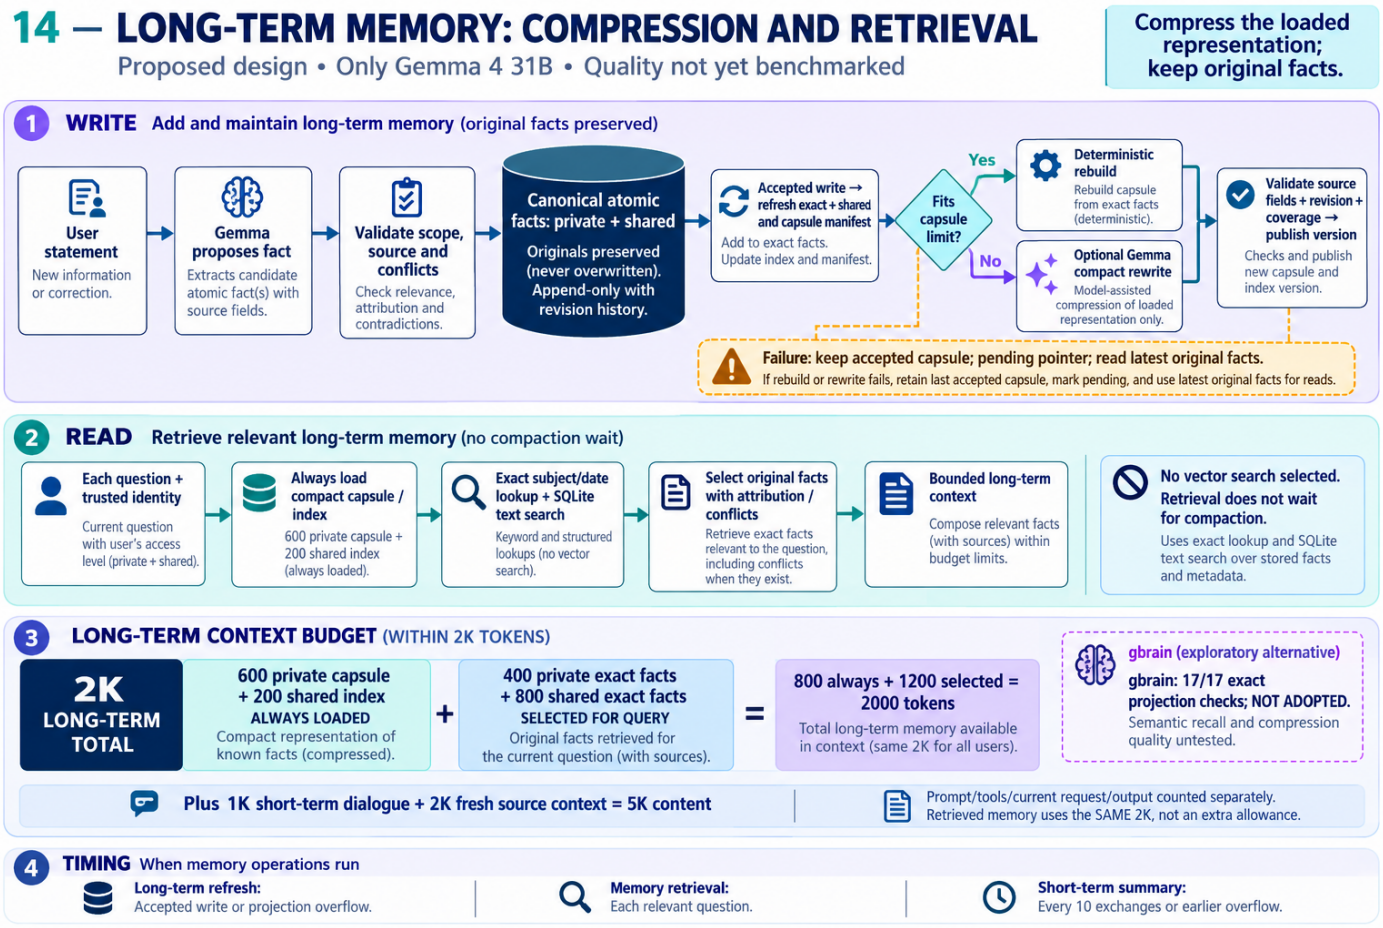

HOW THE COPILOT REMEMBERS AND ANSWERS
Proposed operating design • Gemma 4 31B only • Not implemented
Every user message
Persist private message
Gemma planner + memory proposals
Deterministic validation
Durable commit receipt
Explicit remember/correction: commit before saying saved. Ordinary assertions remain attributed claims.
APPLICATION-OWNED SQLITE
PRIVATE
• Preferences
• transcript
• exact discussion references
User-scoped across sessions
SHARED KNOWLEDGE
• Asset/type/team/field facts and plans
• Author • validity • conflicts • provenance
Used by all users with attribution
CORRECTIONS + RULES
• Original + replacement + reason + revision
• Validated authority; never silently overwrite
Applies only within validated scope and validity
Immutable source records, reports, manuals and SOPs
• Read-only reference
• Grounds answers and citations
• Not modified by the copilot
ANSWER FLOW
Scoped context + exact tools
Gemma answer + visual plan
Validate citations and values
Coordinated UI panels
AVAILABLE TOOLS
read_context
Get scoped conversation and relevant memory
query_records
Search application records
read_evidence
Retrieve source documents and passages
write_knowledge
Validate and save scoped memory proposals
WHEN WE SAVE AND SUMMARIZE
1
Every exchange: save messages, exact entity/result receipts and validated useful facts.
10
At 10 exchanges: summarize older turns; retain recent text within 1K.
20
Repeat every 10; earlier compaction if 1K fills.
...
Earlier compaction on overflow. Raw archive retained.
Summary failure: retain prior version + exact receipts.
USER CONTENT BUDGET: 5K
2K long-term = proposed 1K private + 1K shared
1K short-term = 400 summary + 500 user/assistant text + 100 references
2K retrieved context = targeted results, SOP and report evidence
Persona, tools, current request and output counted separately.
gbrain: tested projection, NOT ADOPTED; semantic benefit untested.
Normally two model calls: plan + answer.
Background compaction every 10 completed exchanges.
Shared quota 30 RPM.
Shared: Jake records a well work plan → Michael sees the attributed claim.
Private: Jake's discussed-well list stays with Jake.

Diagram 14


14 — LONG-TERM MEMORY: COMPRESSION AND RETRIEVAL
Proposed design • Only Gemma 4 31B • Quality not yet benchmarked
Compress the loaded representation; keep original facts.
1 WRITE Add and maintain long-term memory (original facts preserved)
User statement
New information or correction.
Gemma proposes fact
Extracts candidate atomic fact(s) with source fields.
Validate scope, source and conflicts
Check relevance, attribution and contradictions.
Canonical atomic facts: private + shared
Originals preserved (never overwritten). Append-only with revision history.
Accepted write → refresh exact + shared and capsule manifest
Add to exact facts. Update index and manifest.
Fits capsule limit?
Yes
No
Deterministic rebuild
Rebuild capsule from exact facts (deterministic).
Optional Gemma compact rewrite
Model-assisted compression of loaded representation only.
Validate source fields + revision + coverage → publish version
Checks and publish new capsule and index version.
Failure: keep accepted capsule; pending pointer; read latest original facts.
If rebuild or rewrite fails, retain last accepted capsule, mark pending, and use latest original facts for reads.
2 READ Retrieve relevant long-term memory (no compaction wait)
Each question + trusted identity
Current question with user's access level (private + shared).
Always load compact capsule / index
600 private capsule + 200 shared index (always loaded).
Exact subject/date lookup + SQLite text search
Keyword and structured lookups (no vector search).
Select original facts with attribution / conflicts
Retrieve exact facts relevant to the question, including conflicts when they exist.
Bounded long-term context
Compose relevant facts (with sources) within budget limits.
No vector search selected. Retrieval does not wait for compaction.
Uses exact lookup and SQLite text search over stored facts and metadata.
3 LONG-TERM CONTEXT BUDGET (WITHIN 2K TOKENS)
2K LONG-TERM TOTAL
600 private capsule + 200 shared index
ALWAYS LOADED
Compact representation of known facts (compressed).
+
400 private exact facts + 800 shared exact facts
SELECTED FOR QUERY
Original facts retrieved for the current question (with sources).
=
800 always + 1200 selected = 2000 tokens
Total long-term memory available in context (same 2K for all users).
gbrain (exploratory alternative)
gbrain: 17/17 exact projection checks; NOT ADOPTED.
Semantic recall and compression quality untested.
Plus 1K short-term dialogue + 2K fresh source context = 5K content
Prompt/tools/current request/output counted separately. Retrieved memory uses the SAME 2K, not an extra allowance.
4 TIMING When memory operations run
Long-term refresh:
Accepted write or projection overflow.
Memory retrieval:
Each relevant question.
Short-term summary:
Every 10 exchanges or earlier overflow.

Final run: all 11 scenarios / 21 saved replies / 14 sessions. 10 replies completed generation; 11 delivered partial records. These are delivery outcomes, not a claim that 10 answers passed semantic QA. No request ended with a fatal error. Missing reservoir-pressure and measured-production data are reported as unavailable rather than invented.

JSON below retains the saved narrative, component specifications, result columns and every returned row. Repeated source excerpts are omitted from this document; evidence handles remain. The accompanying ui-json-results.zip contains the complete, unchanged envelopes, including evidence and generation metadata.

Question 1

Michael Turner · Turn 1 · complete

All our wells feed one reservoir. Map the reservoir pressure across the field from the pressure data.


```json
{
  "schema_version": "1.0",
  "answer_id": "194ebce3-7dbb-4145-bb18-43535753599e",
  "thread_id": "726d99ea-61c0-4d23-87f4-1d8cc7860c42",
  "user_id": "U-201",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "The supplied records do not include reservoir pressure measurements. Equipment ratings and pressure tests cannot answer measured reservoir pressure, and the available evidence pack contains no pressure data or results to map.",
  "blocks": [],
  "results": {},
  "warnings": ["One or more requested visual kinds could not be validated; verified data remains available"],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":4337,"output_tokens":74,"total_tokens":4411,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":629,"live":true},{"stage":"maker","usage":{"input_tokens":2355,"output_tokens":46,"total_tokens":2401,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":632,"live":true}],"provider":"google","foreground_attempts":2,"live":true},
  "evidence": {"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"}}
}
```

Question 2

Robert Hayes · Turn 1 · complete

Which well produced the most oil in 2026?


```json
{
  "schema_version": "1.0",
  "answer_id": "e655809b-fafd-4b89-825f-fa89a60d1da4",
  "thread_id": "bf73c61b-6fc6-4c93-82bd-b008cb7d4122",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "The supplied records do not contain the oil production totals needed to determine which well produced the most oil in the specified year. Spills, thermal status, equipment ratings, and pressure tests cannot answer produced-oil volume. The necessary production measurement data is absent from the current data source.",
  "blocks": [],
  "results": {},
  "warnings": [],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":4744,"output_tokens":155,"total_tokens":4899,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":630,"live":true},{"stage":"maker","usage":{"input_tokens":2761,"output_tokens":71,"total_tokens":2832,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":634,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":2497,"output_tokens":72,"total_tokens":2569,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":641,"live":true}],"provider":"google","foreground_attempts":3,"live":true},
  "evidence": {"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"}}
}
```

Question 3

Laura Simmons · Turn 1 · partial

Since 1 Nov 2026, every time an operator note reports gas at a well, did we get someone out to that well in time under our operating procedures? List every report and whether the response met the deadline.


```json
{
  "schema_version": "1.0",
  "answer_id": "d8974b54-a210-45fa-9ef5-9b11c5760e2c",
  "thread_id": "d84b4f07-f29c-4426-9fbb-e81627990dc3",
  "user_id": "U-401",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Partial answer: verified data is shown below. The explanation could not be completed because the generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"d8974b54-a210-45fa-9ef5-9b11c5760e2c:verified:0","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_b51d2ae9bc464d97ada69872ee927892","evidence_ids":["ev_b063f774b875a9dc5dd96d88","ev_d41776cb6f58c7905b12aed1","src_148067724bdb724664aecc6e","ev_ea7256a530f2572ce63e1d8e","result_b51d2ae9bc464d97ada69872ee927892","ev_188fe84bb4fdc1aa89eb66a2","ev_629c0c0d72d24ca212aa3e2a","ev_33a8f3aa5e06d648d7da2670"],"encoding":{},"span":2}],
  "results": {"result_b51d2ae9bc464d97ada69872ee927892":{"result_set_id":"result_b51d2ae9bc464d97ada69872ee927892","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":4,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"note_id","label":"Note Id"},{"key":"reported_at","label":"Reported At"},{"key":"note","label":"Note"},{"key":"response_id","label":"Response Id"},{"key":"response_at","label":"Response At"},{"key":"response_kind","label":"Response Kind"},{"key":"hours_to_response","label":"Hours To Response","unit":"hour"},{"key":"deadline_hours","label":"Deadline Hours","unit":"hour"},{"key":"due_at","label":"Due At"},{"key":"assessment","label":"Assessment"},{"key":"h2s_ppm","label":"H2S Ppm"}],"rows":[{"area_name":"Northeast Block 8","asset_id":"WELL-0163","response_id":"MNT-0163-019","h2s_ppm":null,"reported_at":"2026-11-03T20:55:00Z","response_kind":"maintenance","response_at":"2026-11-14T08:00:00Z","hours_to_response":251.08333333333334,"due_at":"2026-11-04T20:55:00+00:00","assessment":"missed","deadline_hours":24,"note":"H2S monitor alarmed at WELL-0163, crew moved upwind and reported it.","note_id":"CTX-0163-002","area_id":"NE-08"},{"area_name":"Northeast Block 7","asset_id":"WELL-0149","response_id":"MNT-0149-029","h2s_ppm":null,"reported_at":"2026-11-06T18:20:00Z","response_kind":"maintenance","response_at":"2026-11-07T08:00:00Z","hours_to_response":13.666666666666666,"due_at":"2026-11-07T18:20:00+00:00","assessment":"met","deadline_hours":24,"note":"Strong gas odor around the WELL-0149 cellar, called it in to the supervisor.","note_id":"CTX-0149-004","area_id":"NE-07"},{"area_name":"Northeast Block 8","asset_id":"WELL-0165","response_id":"MNT-0165-031","h2s_ppm":null,"reported_at":"2026-11-13T20:35:00Z","response_kind":"maintenance","response_at":"2026-11-14T08:00:00Z","hours_to_response":11.416666666666666,"due_at":"2026-11-14T20:35:00+00:00","assessment":"met","deadline_hours":24,"note":"Rotten-egg smell at the WELL-0165 pad on arrival, called the HSE officer.","note_id":"CTX-0165-001","area_id":"NE-08"},{"area_name":"Northwest Block 12","asset_id":"WELL-0341","response_id":"INS-0341-0109","h2s_ppm":null,"reported_at":"2026-11-19T07:40:00Z","response_kind":"manual_inspection","response_at":"2026-12-17T13:30:00Z","hours_to_response":677.8333333333334,"due_at":"2026-11-20T07:40:00+00:00","assessment":"missed","deadline_hours":24,"note":"H2S monitor alarmed at WELL-0341, crew moved upwind and reported it.","note_id":"CTX-0341-002","area_id":"NW-12"},{"area_name":"Southwest Block 24","asset_id":"WELL-0091","response_id":"MNT-0091-019","h2s_ppm":null,"reported_at":"2026-11-27T22:25:00Z","response_kind":"maintenance","response_at":"2026-11-28T08:00:00Z","hours_to_response":9.583333333333334,"due_at":"2026-11-28T22:25:00+00:00","assessment":"met","deadline_hours":24,"note":"H2S monitor alarmed at WELL-0091, crew moved upwind and reported it.","note_id":"CTX-0091-001","area_id":"SW-24"},{"area_name":"Northwest Block 12","asset_id":"WELL-0423","response_id":"INS-0423-0213","h2s_ppm":null,"reported_at":"2026-12-03T05:25:00Z","response_kind":"manual_inspection","response_at":"2026-12-03T09:15:00Z","hours_to_response":3.8333333333333335,"due_at":"2026-12-04T05:25:00+00:00","assessment":"met","deadline_hours":24,"note":"Gas odor reported by the pumper near WELL-0423 wellhead, area flagged off.","note_id":"CTX-0423-002","area_id":"NW-12"},{"area_name":"Southwest Block 24","asset_id":"WELL-0059","response_id":"INS-0059-0213","h2s_ppm":null,"reported_at":"2026-12-03T06:10:00Z","response_kind":"manual_inspection","response_at":"2026-12-03T12:15:00Z","hours_to_response":6.083333333333333,"due_at":"2026-12-04T06:10:00+00:00","assessment":"met","deadline_hours":24,"note":"Gas odor reported by the pumper near WELL-0059 wellhead, area flagged off.","note_id":"CTX-0059-002","area_id":"SW-24"},{"area_name":"Northwest Block 12","asset_id":"WELL-0332","response_id":null,"h2s_ppm":null,"reported_at":"2026-12-03T12:10:00Z","response_kind":null,"response_at":null,"hours_to_response":null,"due_at":"2026-12-04T12:10:00+00:00","assessment":"missed","deadline_hours":24,"note":"Gas odor reported by the pumper near WELL-0332 wellhead, area flagged off.","note_id":"CTX-0332-004","area_id":"NW-12"},{"area_name":"Northwest Block 12","asset_id":"WELL-0401","response_id":"MNT-0401-033","h2s_ppm":null,"reported_at":"2026-12-05T13:50:00Z","response_kind":"maintenance","response_at":"2026-12-11T08:00:00Z","hours_to_response":138.16666666666666,"due_at":"2026-12-06T13:50:00+00:00","assessment":"missed","deadline_hours":24,"note":"H2S monitor alarmed at WELL-0401, crew moved upwind and reported it.","note_id":"CTX-0401-002","area_id":"NW-12"},{"area_name":"Northeast Block 8","asset_id":"WELL-0189","response_id":"MNT-0189-037","h2s_ppm":null,"reported_at":"2026-12-10T12:35:00Z","response_kind":"maintenance","response_at":"2026-12-11T08:00:00Z","hours_to_response":19.416666666666668,"due_at":"2026-12-11T12:35:00+00:00","assessment":"met","deadline_hours":24,"note":"H2S monitor alarmed at WELL-0189, crew moved upwind and reported it.","note_id":"CTX-0189-003","area_id":"NE-08"},{"area_name":"Northwest Block 12","asset_id":"WELL-0403","response_id":"MNT-0403-024","h2s_ppm":null,"reported_at":"2026-12-10T21:15:00Z","response_kind":"maintenance","response_at":"2026-12-11T08:00:00Z","hours_to_response":10.75,"due_at":"2026-12-11T21:15:00+00:00","assessment":"met","deadline_hours":24,"note":"Rotten-egg smell at the WELL-0403 pad on arrival, called the HSE officer.","note_id":"CTX-0403-004","area_id":"NW-12"},{"area_name":"Southeast Block 31","asset_id":"WELL-0244","response_id":"MNT-0244-026","h2s_ppm":null,"reported_at":"2026-12-11T05:25:00Z","response_kind":"maintenance","response_at":"2026-12-11T08:00:00Z","hours_to_response":2.5833333333333335,"due_at":"2026-12-12T05:25:00+00:00","assessment":"met","deadline_hours":24,"note":"Gas odor reported by the pumper near WELL-0244 wellhead, area flagged off.","note_id":"CTX-0244-002","area_id":"SE-31"},{"area_name":"Southwest Block 23","asset_id":"WELL-0040","response_id":"MNT-0040-029","h2s_ppm":null,"reported_at":"2026-12-12T01:55:00Z","response_kind":"maintenance","response_at":"2026-12-12T08:00:00Z","hours_to_response":6.083333333333333,"due_at":"2026-12-13T01:55:00+00:00","assessment":"met","deadline_hours":24,"note":"Rotten-egg smell at the WELL-0040 pad on arrival, called the HSE officer.","note_id":"CTX-0040-002","area_id":"SW-23"},{"area_name":"Southeast Block 31","asset_id":"WELL-0228","response_id":"INS-0228-0144","h2s_ppm":null,"reported_at":"2026-12-16T19:50:00Z","response_kind":"manual_inspection","response_at":"2026-12-17T12:45:00Z","hours_to_response":16.916666666666668,"due_at":"2026-12-17T19:50:00+00:00","assessment":"met","deadline_hours":24,"note":"Smelled gas downwind of WELL-0228 wellhead, backed off and called it in.","note_id":"CTX-0228-004","area_id":"SE-31"},{"area_name":"Southwest Block 24","asset_id":"WELL-0052","response_id":null,"h2s_ppm":null,"reported_at":"2026-12-18T06:45:00Z","response_kind":null,"response_at":null,"hours_to_response"
```

:null,"due_at":"2026-12-19T06:45:00+00:00","assessment":"missed","deadline_hours":24,"note":"Gas odor reported by the pumper near WELL-0052 wellhead, area flagged off.","note_id":"CTX-0052-003","area_id":"SW-24"},{"area_name":"Northwest Block 12","asset_id":"WELL-0370","response_id":"MNT-0370-028","h2s_ppm":null,"reported_at":"2026-12-21T12:45:00Z","response_kind":"maintenance","response_at":"2026-12-22T08:00:00Z","hours_to_response":19.25,"due_at":"2026-12-22T12:45:00+00:00","assessment":"met","deadline_hours":24,"note":"Strong gas odor around the WELL-0370 cellar, called it in to the supervisor.","note_id":"CTX-0370-005","area_id":"NW-12"},{"area_name":"Northwest Block 12","asset_id":"WELL-0362","response_id":"MNT-0362-030","h2s_ppm":null,"reported_at":"2026-12-24T00:15:00Z","response_kind":"maintenance","response_at":"2026-12-25T08:00:00Z","hours_to_response":31.75,"due_at":"2026-12-25T00:15:00+00:00","assessment":"missed","deadline_hours":24,"note":"Gas odor reported by the pumper near WELL-0362 wellhead, area flagged off.","note_id":"CTX-0362-002","area_id":"NW-12"},{"area_name":"Northeast Block 8","asset_id":"WELL-0161","response_id":"INS-0161-0168","h2s_ppm":null,"reported_at":"2026-12-25T15:45:00Z","response_kind":"manual_inspection","response_at":"2027-01-14T11:00:00Z","hours_to_response":475.25,"due_at":"2026-12-26T15:45:00+00:00","assessment":"missed","deadline_hours":24,"note":"Smelled gas downwind of WELL-0161 wellhead, backed off and called it in.","note_id":"CTX-0161-006","area_id":"NE-08"},{"area_name":"Northeast Block 7","asset_id":"WELL-0135","response_id":"MNT-0135-034","h2s_ppm":null,"reported_at":"2026-12-27T03:50:00Z","response_kind":"maintenance","response_at":"2026-12-27T08:00:00Z","hours_to_response":4.166666666666667,"due_at":"2026-12-28T03:50:00+00:00","assessment":"met","deadline_hours":24,"note":"Smelled gas downwind of WELL-0135 wellhead, backed off and called it in.","note_id":"CTX-0135-009","area_id":"NE-07"},{"area_name":"Northwest Block 12","asset_id":"WELL-0324","response_id":"MNT-0324-036","h2s_ppm":null,"reported_at":"2027-01-01T22:40:00Z","response_kind":"maintenance","response_at":"2027-01-02T08:00:00Z","hours_to_response":9.333333333333334,"due_at":"2027-01-02T10:40:00+00:00","assessment":"met","deadline_hours":12,"note":"Gas odor reported by the pumper near WELL-0324 wellhead, area flagged off.","note_id":"CTX-0324-001","area_id":"NW-12"},{"area_name":"Northwest Block 12","asset_id":"WELL-0330","response_id":"MNT-0330-030","h2s_ppm":null,"reported_at":"2027-01-02T21:40:00Z","response_kind":"maintenance","response_at":"2027-01-03T08:00:00Z","hours_to_response":10.333333333333334,"due_at":"2027-01-03T09:40:00+00:00","assessment":"met","deadline_hours":12,"note":"H2S monitor alarmed at WELL-0330, crew moved upwind and reported it.","note_id":"CTX-0330-003","area_id":"NW-12"},{"area_name":"Southeast Block 32","asset_id":"WELL-0599","response_id":"INS-0599-0196","h2s_ppm":null,"reported_at":"2027-01-06T17:20:00Z","response_kind":"manual_inspection","response_at":"2027-01-07T09:45:00Z","hours_to_response":16.416666666666668,"due_at":"2027-01-07T05:20:00+00:00","assessment":"missed","deadline_hours":12,"note":"Strong gas odor around the WELL-0599 cellar, called it in to the supervisor.","note_id":"CTX-0599-003","area_id":"SE-32"},{"area_name":"Southeast Block 32","asset_id":"WELL-0516","response_id":"INS-0516-0215","h2s_ppm":null,"reported_at":"2027-01-06T21:15:00Z","response_kind":"manual_inspection","response_at":"2027-01-07T12:15:00Z","hours_to_response":15.0,"due_at":"2027-01-07T09:15:00+00:00","assessment":"missed","deadline_hours":12,"note":"Rotten-egg smell at the WELL-0516 pad on arrival, called the HSE officer.","note_id":"CTX-0516-002","area_id":"SE-32"},{"area_name":"Northwest Block 12","asset_id":"WELL-0425","response_id":"INS-0425-0218","h2s_ppm":null,"reported_at":"2027-01-07T05:20:00Z","response_kind":"manual_inspection","response_at":"2027-01-07T09:00:00Z","hours_to_response":3.6666666666666665,"due_at":"2027-01-07T17:20:00+00:00","assessment":"met","deadline_hours":12,"note":"Gas odor reported by the pumper near WELL-0425 wellhead, area flagged off.","note_id":"CTX-0425-006","area_id":"NW-12"},{"area_name":"Southeast Block 32","asset_id":"WELL-0465","response_id":"MNT-0465-031","h2s_ppm":null,"reported_at":"2027-01-08T23:35:00Z","response_kind":"maintenance","response_at":"2027-01-09T08:00:00Z","hours_to_response":8.416666666666666,"due_at":"2027-01-09T11:35:00+00:00","assessment":"met","deadline_hours":12,"note":"Strong gas odor around the WELL-0465 cellar, called it in to the supervisor.","note_id":"CTX-0465-005","area_id":"SE-32"},{"area_name":"Northeast Block 7","asset_id":"WELL-0137","response_id":"MNT-0137-032","h2s_ppm":null,"reported_at":"2027-01-10T23:30:00Z","response_kind":"maintenance","response_at":"2027-01-11T08:00:00Z","hours_to_response":8.5,"due_at":"2027-01-11T11:30:00+00:00","assessment":"met","deadline_hours":12,"note":"Gas odor reported by the pumper near WELL-0137 wellhead, area flagged off.","note_id":"CTX-0137-004","area_id":"NE-07"}],"evidence_ids":["ev_b063f774b875a9dc5dd96d88","ev_d41776cb6f58c7905b12aed1","src_148067724bdb724664aecc6e","ev_ea7256a530f2572ce63e1d8e","result_b51d2ae9bc464d97ada69872ee927892","ev_188fe84bb4fdc1aa89eb66a2","ev_629c0c0d72d24ca212aa3e2a","ev_33a8f3aa5e06d648d7da2670","ev_a5ee7b5b0cb3db655bf2f946","ev_6c705b202a734d4dd5fb9d15","ev_f90cdbe0544438f645b30ccf","ev_4241fa42224323b46ab8e0a6","ev_589ad967d0dc47584b285d1a","ev_7f1f111806f2b4d367bff896","ev_77df7d031044175b918cf5af","ev_ce494ab553330d1fd03d2571","ev_7d02994b192d6e58cc92cda0","ev_ba98e86c19e4a703d6b51171","ev_91b9a6f13c94b6d098ef196a","ev_baa4639af1d70d430cb165a0","ev_692031576607da659b6959d4","ev_c360ec03e43c700c197dd2fa","ev_19aba37d265933b21ba09a43","ev_630cef1e4aa799df8e2fccad","ev_7fe351e3d9212748884010cb","ev_87eef4ff4d043a1249621637","ev_b9ec9a1ede0a25b0a14eec15","ev_3873c9c3bdf6ee344e3dd1b7","ev_217d5cc6694b6acb16f014d4","ev_1b64abf3a86f360825fb6f9b","ev_92fcf2eead504af306d11686","ev_690d72c0bb9074d6ff0018ee","ev_2754ffe56a791e9743933ed5","ev_690a40a939416836a62f9b97","ev_654c70702755fa6f73caa191","ev_8fb246c2600d466f804f2a63","ev_9b2408d4ddf6aeea35291b66","ev_f6a34059d18d9b3f9707c6f3","ev_203d55552eb0cb9fab71e048","ev_01faf91d53b36b62322579c5","ev_9e8ce6965e5c004ff12d4496","ev_5c2e0b326c3fc6b2da01dd0c","ev_2a3c0d8ef65b4e324fc0a804","ev_74a539c633ca9f78d3ace3ac","ev_878cc7fa95f68b7c7134075a","ev_24ab41ee1cfa53ba40fca34b","ev_7c2ae6dca58f4311329da01e","ev_f47954b66dd0f707302706ef","ev_868d9cbb077159b2e6d175fe","ev_07884db56674bb8e68f8e34f","ev_494a7258e93b3e822f7ed8e6","ev_af0a52b1ff5fc219b208de48","ev_659d50bd9bb2d12a64fa0a6b","ev_52da88eeec32448e499dd276","ev_4eab4c3384e403af4cba4511","ev_68870b4d7d9cee7e380e7f2d","ev_eac93e1d8b56faf9af9a5dc8","ev_c39c086366efd801781eddb8","ev_3617ce2f029ab65d04d1c6ee","ev_594ddbf32a0ce395f9bc7f59","ev_01242bd543f3dc7b548f9fa6","ev_52daaf0cf4425284590889ca","ev_aa3a7d43a8f326d9575d1980","ev_d0022fee764f58dd616f89d4","ev_4c274e9fa9761654b5eede2a","ev_e8986c487d651119f7f22fe8","ev_04ad3d4855e006a8c42f2031","ev_17b4d79da6ce169c232b0951","ev_bb7364e4df80dca44c023a86","ev_b00a21ee0e7127a4b65a9831","ev_93dffd946464fe3e2645946a","ev_f343a958de710219efd63798","ev_d218220c1542327ede82b603","ev_6aaf432b499ab40fbed8cec6","ev_25cb96d6d1e94466eaf971be","ev_9bbd8c4ce93bb03b77838dbd","ev_cbfb5efca906f6f8ba99f5ed","ev_a223146c4337ac9e81ecf479"],"provider_coverage":{"unit":"gas_response","matching":26,"evaluated":26,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":26,"output_rows":26,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_4ca6abd6348344f8a01d098689c45fb8","warnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day."],"bounds":{"start":"2026-11-01","end":null,"closure":"both"},"operation":{"collection":"context_notes","metric":"gas_response"},"summary":{"total_matching":26,"assessment_counts":{"missed":9,"met":17},"area_counts":{"Northeast Block 8":4,"Northeast Block 7":3,"Northwest Block 12":10,"Southwest Block 24":3,"Southeast Block 31":2,"Southwest Block 23":1,"Southeast Block 32":3}},"assessment_counts":{"missed":9,"met":17},"coverage":{"matching":26,"evaluated":26,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Ranked lexical retrieval cannot prove a fleet total or source absence","Report prose may predate corrections; a lexical hit does not confirm effective spill detection or current classification","The explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanation_error_code":"grounding_repair_budget","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":5166,"output_tokens":207,"total_tokens":5373,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":638,"live":true},{"stage":"maker","usage":{"input_tokens":5075,"output_tokens":151,"total_tokens":5226,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":651,"live":true}]},
  "evidence": {"ev_b063f774b875a9dc5dd96d88":{"id":"ev_b063f774b875a9dc5dd96d88","source_id":"src_214c564192312cd7b6b32b5e","source_kind":"metadata","title":"WELL-0163","path":"assets/WELL-0163/metadata.json"},"ev_d41776cb6f58c7905b12ae

```
d1":{"id":"ev_d41776cb6f58c7905b12aed1","source_id":"src_d143a30a5fe94b3e95f70393","source_kind":"context","title":"CT
X-0163-002","path":"assets/WELL-0163/context.jsonl"},"src_148067724bdb724664aecc6e":{"id":"src_148067724bdb724664aecc6
e","source_id":"src_148067724bdb724664aecc6e","source_kind":"sop","title":"fleet/sops/operations-sop-rev2.md","path":"
fleet/sops/operations-sop-rev2.md"},"ev_ea7256a530f2572ce63e1d8e":{"id":"ev_ea7256a530f2572ce63e1d8e","source_id":"src
_e920bd534fc5b2b89b8c05a4","source_kind":"maintenance","title":"MNT-0163-019","path":"assets/WELL-0163/maintenance.jso
nl"},"result_b51d2ae9bc464d97ada69872ee927892":{"id":"result_b51d2ae9bc464d97ada69872ee927892","source_id":"result_b51
d2ae9bc464d97ada69872ee927892","source_kind":"aggregate_lineage","title":"result_b51d2ae9bc464d97ada69872ee927892"},"e
v_188fe84bb4fdc1aa89eb66a2":{"id":"ev_188fe84bb4fdc1aa89eb66a2","source_id":"src_fe96b7b3e10ae435ea860ac9","source_kin
d":"metadata","title":"WELL-0149","path":"assets/WELL-0149/metadata.json"},"ev_629c0c0d72d24ca212aa3e2a":{"id":"ev_629
c0c0d72d24ca212aa3e2a","source_id":"src_6905d652ec9dace94746e529","source_kind":"context","title":"CTX-0149-004","path
":"assets/WELL-0149/context.jsonl"},"ev_33a8f3aa5e06d648d7da2670":{"id":"ev_33a8f3aa5e06d648d7da2670","source_id":"src
_1ab23fc41585331ae3e9cbdb","source_kind":"maintenance","title":"MNT-0149-029","path":"assets/WELL-0149/maintenance.jso
nl"},"ev_a5ee7b5b0cb3db655bf2f946":{"id":"ev_a5ee7b5b0cb3db655bf2f946","source_id":"src_69f98584aa5c911e535c6f65","sou
rce_kind":"metadata","title":"WELL-0165","path":"assets/WELL-0165/metadata.json"},"ev_6c705b202a734d4dd5fb9d15":{"id":
"ev_6c705b202a734d4dd5fb9d15","source_id":"src_f43d5fd537f83f6c4dfd832b","source_kind":"context","title":"CTX-0165-001
","path":"assets/WELL-0165/context.jsonl"},"ev_f90cdbe0544438f645b30ccf":{"id":"ev_f90cdbe0544438f645b30ccf","source_i
d":"src_4068b03d75b32cecbfcf87c7","source_kind":"maintenance","title":"MNT-0165-031","path":"assets/WELL-0165/maintena
nce.jsonl"},"ev_4241fa42224323b46ab8e0a6":{"id":"ev_4241fa42224323b46ab8e0a6","source_id":"src_e9324e85373f0c7e92ee1e6
f","source_kind":"metadata","title":"WELL-0341","path":"assets/WELL-0341/metadata.json"},"ev_589ad967d0dc47584b285d1a"
:{"id":"ev_589ad967d0dc47584b285d1a","source_id":"src_6e512fdd5b7edbff6fb258a0","source_kind":"context","title":"CTX-0
341-002","path":"assets/WELL-0341/context.jsonl"},"ev_7f1f111806f2b4d367bff896":{"id":"ev_7f1f111806f2b4d367bff896","s
ource_id":"src_298767296f70d987cef77c4d","source_kind":"inspections","title":"INS-0341-0109","path":"assets/WELL-0341/
inspections.jsonl"},"ev_77df7d031044175b918cf5af":{"id":"ev_77df7d031044175b918cf5af","source_id":"src_3dbf036979da7d0
8df7bc691","source_kind":"metadata","title":"WELL-0091","path":"assets/WELL-0091/metadata.json"},"ev_ce494ab553330d1fd
03d2571":{"id":"ev_ce494ab553330d1fd03d2571","source_id":"src_c96b4629397c626fb739278b","source_kind":"context","title
":"CTX-0091-001","path":"assets/WELL-0091/context.jsonl"},"ev_7d02994b192d6e58cc92cda0":{"id":"ev_7d02994b192d6e58cc92
cda0","source_id":"src_3621a87f5e294e9ceb4f4101","source_kind":"maintenance","title":"MNT-0091-019","path":"assets/WEL
L-0091/maintenance.jsonl"},"ev_ba98e86c19e4a703d6b51171":{"id":"ev_ba98e86c19e4a703d6b51171","source_id":"src_e3d20bf3
2e126ae845c85b68","source_kind":"metadata","title":"WELL-0423","path":"assets/WELL-0423/metadata.json"},"ev_91b9a6f13c
94b6d098ef196a":{"id":"ev_91b9a6f13c94b6d098ef196a","source_id":"src_f5c4a91a5e9b492be171b9e9","source_kind":"context"
,"title":"CTX-0423-002","path":"assets/WELL-0423/context.jsonl"},"ev_baa4639af1d70d430cb165a0":{"id":"ev_baa4639af1d70
d430cb165a0","source_id":"src_f4db1503f34c359f15b40d14","source_kind":"inspections","title":"INS-0423-0213","path":"as
sets/WELL-0423/inspections.jsonl"},"ev_692031576607da659b6959d4":{"id":"ev_692031576607da659b6959d4","source_id":"src_
aa22bbfbf33ba7c8306a8bf2","source_kind":"metadata","title":"WELL-0059","path":"assets/WELL-0059/metadata.json"},"ev_c3
60ec03e43c700c197dd2fa":{"id":"ev_c360ec03e43c700c197dd2fa","source_id":"src_502722ba06e1f7140e2f5a3b","source_kind":"
context","title":"CTX-0059-002","path":"assets/WELL-0059/context.jsonl"},"ev_19aba37d265933b21ba09a43":{"id":"ev_19aba
37d265933b21ba09a43","source_id":"src_12c2c61f2e8ecfaef9d5ba0d","source_kind":"inspections","title":"INS-0059-0213","p
ath":"assets/WELL-0059/inspections.jsonl"},"ev_630cef1e4aa799df8e2fccad":{"id":"ev_630cef1e4aa799df8e2fccad","source_i
d":"src_1dde2aac8f318474821aa0ca","source_kind":"metadata","title":"WELL-0332","path":"assets/WELL-0332/metadata.json"
},"ev_7fe351e3d9212748884010cb":{"id":"ev_7fe351e3d9212748884010cb","source_id":"src_e0e3eaab7de9d4dd04af1edb","source
_kind":"context","title":"CTX-0332-004","path":"assets/WELL-0332/context.jsonl"},"ev_87eef4ff4d043a1249621637":{"id":"
ev_87eef4ff4d043a1249621637","source_id":"src_f45b1e1e547a111ebefedaa2","source_kind":"metadata","title":"WELL-0401","
path":"assets/WELL-0401/metadata.json"},"ev_b9ec9a1ede0a25b0a14eec15":{"id":"ev_b9ec9a1ede0a25b0a14eec15","source_id":
"src_d8067bf062aa686a65029084","source_kind":"context","title":"CTX-0401-002","path":"assets/WELL-0401/context.jsonl"}
,"ev_3873c9c3bdf6ee344e3dd1b7":{"id":"ev_3873c9c3bdf6ee344e3dd1b7","source_id":"src_6d21d56f64c4fddf40952721","source_
kind":"maintenance","title":"MNT-0401-033","path":"assets/WELL-0401/maintenance.jsonl"},"ev_217d5cc6694b6acb16f014d4":
{"id":"ev_217d5cc6694b6acb16f014d4","source_id":"src_efd4108e48b8911de14ee4ff","source_kind":"metadata","title":"WELL-
0189","path":"assets/WELL-0189/metadata.json"},"ev_1b64abf3a86f360825fb6f9b":{"id":"ev_1b64abf3a86f360825fb6f9b","sour
ce_id":"src_b9722e06cad1a05a97255c2f","source_kind":"context","title":"CTX-0189-003","path":"assets/WELL-0189/context.
jsonl"},"ev_92fcf2eead504af306d11686":{"id":"ev_92fcf2eead504af306d11686","source_id":"src_baa0d3390bcb91cb1e035f39","
source_kind":"maintenance","title":"MNT-0189-037","path":"assets/WELL-0189/maintenance.jsonl"},"ev_690d72c0bb9074d6ff0
018ee":{"id":"ev_690d72c0bb9074d6ff0018ee","source_id":"src_1e9d887a1d73256ff58e5091","source_kind":"metadata","title"
:"WELL-0403","path":"assets/WELL-0403/metadata.json"},"ev_2754ffe56a791e9743933ed5":{"id":"ev_2754ffe56a791e9743933ed5
","source_id":"src_f6747653e174a4683cbc3703","source_kind":"context","title":"CTX-0403-004","path":"assets/WELL-0403/c
ontext.jsonl"},"ev_690a40a939416836a62f9b97":{"id":"ev_690a40a939416836a62f9b97","source_id":"src_c4d081a9e34659241f77
d8b8","source_kind":"maintenance","title":"MNT-0403-024","path":"assets/WELL-0403/maintenance.jsonl"},"ev_654c70702755
fa6f73caa191":{"id":"ev_654c70702755fa6f73caa191","source_id":"src_afbf0e055e6b3d6e1ceef81d","source_kind":"metadata",
"title":"WELL-0244","path":"assets/WELL-0244/metadata.json"},"ev_8fb246c2600d466f804f2a63":{"id":"ev_8fb246c2600d466f8
04f2a63","source_id":"src_069bd2e688d832aa6b9ccd29","source_kind":"context","title":"CTX-0244-002","path":"assets/WELL
-0244/context.jsonl"},"ev_9b2408d4ddf6aeea35291b66":{"id":"ev_9b2408d4ddf6aeea35291b66","source_id":"src_8b5fa97e74acc
682d0a9fe48","source_kind":"maintenance","title":"MNT-0244-026","path":"assets/WELL-0244/maintenance.jsonl"},"ev_f6a34
059d18d9b3f9707c6f3":{"id":"ev_f6a34059d18d9b3f9707c6f3","source_id":"src_278282e794a003974492cd9e","source_kind":"met
adata","title":"WELL-0040","path":"assets/WELL-0040/metadata.json"},"ev_203d55552eb0cb9fab71e048":{"id":"ev_203d55552e
b0cb9fab71e048","source_id":"src_a6ea1d884a11e5089d8cdb23","source_kind":"context","title":"CTX-0040-002","path":"asse
ts/WELL-0040/context.jsonl"},"ev_01faf91d53b36b62322579c5":{"id":"ev_01faf91d53b36b62322579c5","source_id":"src_816293
105cfd004565ca59c8","source_kind":"maintenance","title":"MNT-0040-029","path":"assets/WELL-0040/maintenance.jsonl"},"e
v_9e8ce6965e5c004ff12d4496":{"id":"ev_9e8ce6965e5c004ff12d4496","source_id":"src_37485038796885d2d674b213","source_kin
d":"metadata","title":"WELL-0228","path":"assets/WELL-0228/metadata.json"},"ev_5c2e0b326c3fc6b2da01dd0c":{"id":"ev_5c2
e0b326c3fc6b2da01dd0c","source_id":"src_9c8737c327832f14aa2d11fb","source_kind":"context","title":"CTX-0228-004","path
":"assets/WELL-0228/context.jsonl"},"ev_2a3c0d8ef65b4e324fc0a804":{"id":"ev_2a3c0d8ef65b4e324fc0a804","source_id":"src
_d1848421ae795c3156b8195f","source_kind":"inspections","title":"INS-0228-0144","path":"assets/WELL-0228/inspections.js
onl"},"ev_74a539c633ca9f78d3ace3ac":{"id":"ev_74a539c633ca9f78d3ace3ac","source_id":"src_4bd386e9cc21f7a99ae48869","so
urce_kind":"metadata","title":"WELL-0052","path":"assets/WELL-0052/metadata.json"},"ev_878cc7fa95f68b7c7134075a":{"id"
:"ev_878cc7fa95f68b7c7134075a","source_id":"src_9ba08d0d309073c55af9eb1e","source_kind":"context","title":"CTX-0052-00
3","path":"assets/WELL-0052/context.jsonl"},"ev_24ab41ee1cfa53ba40fca34b":{"id":"ev_24ab41ee1cfa53ba40fca34b","source_
id":"src_c73d989f3ada051e5cb84e76","source_kind":"metadata","title":"WELL-0370","path":"assets/WELL-0370/metadata.json
"},"ev_7c2ae6dca58f4311329da01e":{"id":"ev_7c2ae6dca58f4311329da01e","source_id":"src_aa0a66d8a1c34a8887f0d293","sourc
e_kind":"context","title":"CTX-0370-005","path":"assets/WELL-0370/context.jsonl"},"ev_f47954b66dd0f707302706ef":{"id":
"ev_f47954b66dd0f707302706ef","source_id":"src_f83d148e06751e7aad3c2b4c","source_kind":"maintenance","title":"MNT-0370
-028","path":"assets/WELL-0370/maintenance.jsonl"},"ev_868d9cbb077159b2e6d175fe":{"id":"ev_868d9cbb077159b2e6d175fe","
source_id":"src_d35efd93998a0c71dc9a5d40","source_kind":"metadata","title":"WELL-0362","path":"assets/WELL-0362/metada
ta.json"},"ev_07884db56674bb8e68f8e34f":{"id":"ev_07884db56674bb8e68f8e34f","source_id":"src_26a14c45bd7d759f117fc56a"
,"source_kind":"context","title":"CTX-0362-002","path":"assets/WELL-0362/context.jsonl"},"ev_494a7258e93b3e822f7ed8e6"
:{"id":"ev_494a7258e93b3e822f7ed8e6","source_id":"src_bb823076074e59e5fae74048","source_kind":"maintenance","title":"M
NT-0362-030","path":"assets/WELL-0362/maintenance.jsonl"},"ev_af0a52b1ff5fc219b208de48":{"id":"ev_af0a52b1ff5fc219b208
```

```
de48","source_id":"src_29a88784cbc53343ce4fac32","source_kind":"metadata","title":"WELL-0161","path":"assets/WELL-0161
/metadata.json"},"ev_659d50bd9bb2d12a64fa0a6b":{"id":"ev_659d50bd9bb2d12a64fa0a6b","source_id":"src_47f864d7a512c0cae2
bdf2cc","source_kind":"context","title":"CTX-0161-006","path":"assets/WELL-0161/context.jsonl"},"ev_52da88eeec32448e49
9dd276":{"id":"ev_52da88eeec32448e499dd276","source_id":"src_8db3d441980b55202d39910d","source_kind":"inspections","ti
tle":"INS-0161-0168","path":"assets/WELL-0161/inspections.jsonl"},"ev_4eab4c3384e403af4cba4511":{"id":"ev_4eab4c3384e4
03af4cba4511","source_id":"src_9cf10b93e80fc2fc758d0a7c","source_kind":"metadata","title":"WELL-0135","path":"assets/W
ELL-0135/metadata.json"},"ev_68870b4d7d9cee7e380e7f2d":{"id":"ev_68870b4d7d9cee7e380e7f2d","source_id":"src_4bece7e659
142aa85667f595","source_kind":"context","title":"CTX-0135-009","path":"assets/WELL-0135/context.jsonl"},"ev_eac93e1d8b
56faf9af9a5dc8":{"id":"ev_eac93e1d8b56faf9af9a5dc8","source_id":"src_7f736420cf0c75a017a54166","source_kind":"maintena
nce","title":"MNT-0135-034","path":"assets/WELL-0135/maintenance.jsonl"},"ev_c39c086366efd801781eddb8":{"id":"ev_c39c0
86366efd801781eddb8","source_id":"src_b9120f1c7a6ccb6e1aed8390","source_kind":"metadata","title":"WELL-0324","path":"a
ssets/WELL-0324/metadata.json"},"ev_3617ce2f029ab65d04d1c6ee":{"id":"ev_3617ce2f029ab65d04d1c6ee","source_id":"src_909
1cc4560c60586473ddae6","source_kind":"context","title":"CTX-0324-001","path":"assets/WELL-0324/context.jsonl"},"ev_594
ddbf32a0ce395f9bc7f59":{"id":"ev_594ddbf32a0ce395f9bc7f59","source_id":"src_3add80f8117eaa9b689de3ed","source_kind":"m
aintenance","title":"MNT-0324-036","path":"assets/WELL-0324/maintenance.jsonl"},"ev_01242bd543f3dc7b548f9fa6":{"id":"e
v_01242bd543f3dc7b548f9fa6","source_id":"src_db4f4ed7592394c712a1a1c7","source_kind":"metadata","title":"WELL-0330","p
ath":"assets/WELL-0330/metadata.json"},"ev_52daaf0cf4425284590889ca":{"id":"ev_52daaf0cf4425284590889ca","source_id":"
src_0183517b58937086c9cd5bda","source_kind":"context","title":"CTX-0330-003","path":"assets/WELL-0330/context.jsonl"},
"ev_aa3a7d43a8f326d9575d1980":{"id":"ev_aa3a7d43a8f326d9575d1980","source_id":"src_e973d29e048289261aaedc83","source_k
ind":"maintenance","title":"MNT-0330-030","path":"assets/WELL-0330/maintenance.jsonl"},"ev_d0022fee764f58dd616f89d4":{
"id":"ev_d0022fee764f58dd616f89d4","source_id":"src_621948e83f8b81f48a20e03c","source_kind":"metadata","title":"WELL-0
599","path":"assets/WELL-0599/metadata.json"},"ev_4c274e9fa9761654b5eede2a":{"id":"ev_4c274e9fa9761654b5eede2a","sourc
e_id":"src_47fded237b955a55b460ed7a","source_kind":"context","title":"CTX-0599-003","path":"assets/WELL-0599/context.j
sonl"},"ev_e8986c487d651119f7f22fe8":{"id":"ev_e8986c487d651119f7f22fe8","source_id":"src_6ee33a1c400496629529db6e","s
ource_kind":"inspections","title":"INS-0599-0196","path":"assets/WELL-0599/inspections.jsonl"},"ev_04ad3d4855e006a8c42
f2031":{"id":"ev_04ad3d4855e006a8c42f2031","source_id":"src_de455dcb9f2e96881aa4e872","source_kind":"metadata","title"
:"WELL-0516","path":"assets/WELL-0516/metadata.json"},"ev_17b4d79da6ce169c232b0951":{"id":"ev_17b4d79da6ce169c232b0951
","source_id":"src_d2ce3a338abcb408bb3b255d","source_kind":"context","title":"CTX-0516-002","path":"assets/WELL-0516/c
ontext.jsonl"},"ev_bb7364e4df80dca44c023a86":{"id":"ev_bb7364e4df80dca44c023a86","source_id":"src_e1cae51fe8f03db88ea5
bb5e","source_kind":"inspections","title":"INS-0516-0215","path":"assets/WELL-0516/inspections.jsonl"},"ev_b00a21ee0e7
127a4b65a9831":{"id":"ev_b00a21ee0e7127a4b65a9831","source_id":"src_a1bf8ca59d04ddf28bec9a9d","source_kind":"metadata"
,"title":"WELL-0425","path":"assets/WELL-0425/metadata.json"},"ev_93dffd946464fe3e2645946a":{"id":"ev_93dffd946464fe3e
2645946a","source_id":"src_04573802be4631ab215b161d","source_kind":"context","title":"CTX-0425-006","path":"assets/WEL
L-0425/context.jsonl"},"ev_f343a958de710219efd63798":{"id":"ev_f343a958de710219efd63798","source_id":"src_9ec8de541288
09ea20963a79","source_kind":"inspections","title":"INS-0425-0218","path":"assets/WELL-0425/inspections.jsonl"},"ev_d21
8220c1542327ede82b603":{"id":"ev_d218220c1542327ede82b603","source_id":"src_0ca06c2fcfff17be9ec17fc5","source_kind":"m
etadata","title":"WELL-0465","path":"assets/WELL-0465/metadata.json"},"ev_6aaf432b499ab40fbed8cec6":{"id":"ev_6aaf432b
499ab40fbed8cec6","source_id":"src_a573434abe0051e011832a6e","source_kind":"context","title":"CTX-0465-005","path":"as
sets/WELL-0465/context.jsonl"},"ev_25cb96d6d1e94466eaf971be":{"id":"ev_25cb96d6d1e94466eaf971be","source_id":"src_3570
72c9bebfa40953995e78","source_kind":"maintenance","title":"MNT-0465-031","path":"assets/WELL-0465/maintenance.jsonl"},
"ev_9bbd8c4ce93bb03b77838dbd":{"id":"ev_9bbd8c4ce93bb03b77838dbd","source_id":"src_2480657834eefa619379d868","source_k
ind":"metadata","title":"WELL-0137","path":"assets/WELL-0137/metadata.json"},"ev_cbfb5efca906f6f8ba99f5ed":{"id":"ev_c
bfb5efca906f6f8ba99f5ed","source_id":"src_f35d3b41491b38f348d4b4ae","source_kind":"context","title":"CTX-0137-004","pa
th":"assets/WELL-0137/context.jsonl"},"ev_a223146c4337ac9e81ecf479":{"id":"ev_a223146c4337ac9e81ecf479","source_id":"s
rc_99e15c5eb2d0731c2cb482c2","source_kind":"maintenance","title":"MNT-0137-032","path":"assets/WELL-0137/maintenance.j
sonl"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"
memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan
Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id"
:"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by
Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","sour
ce_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by
Nathan Pierce"},"chunk_6731424810ccb184c0b7c1e7":{"id":"chunk_6731424810ccb184c0b7c1e7","source_id":"src_148067724bdb7
24664aecc6e","source_kind":"sop","title":"OPS-1 Gas odor response","path":"fleet/sops/operations-sop-rev2.md"},"chunk_
5bc1907e61caac72be268a58":{"id":"chunk_5bc1907e61caac72be268a58","source_id":"src_148067724bdb724664aecc6e","source_ki
nd":"sop","title":"OPS-1 Gas odor response","path":"fleet/sops/operations-sop-rev2.md"},"chunk_68edd4b082353175b7a18b4
c":{"id":"chunk_68edd4b082353175b7a18b4c","source_id":"src_148067724bdb724664aecc6e","source_kind":"sop","title":"Revi
sion history","path":"fleet/sops/operations-sop-rev2.md"},"chunk_c55e53a4de1ad4b9f446e27d":{"id":"chunk_c55e53a4de1ad4
b9f446e27d","source_id":"src_85bc657d28115b6a502a6e44","source_kind":"sop","title":"Revision history","path":"fleet/so
ps/spill-response-sop.md"},"chunk_6b0c7b7b5c92a8d45ed826d9":{"id":"chunk_6b0c7b7b5c92a8d45ed826d9","source_id":"src_85
bc657d28115b6a502a6e44","source_kind":"sop","title":"2. Background (industry
references)","path":"fleet/sops/spill-response-sop.md"}}
}
```

Question 4

Chris Dalton · Turn 1 · complete

Across all areas, which temporary flowline bypasses are in place right now, and is each one allowed? Also list any bypass, past or present, that stayed in after its approval ran out or was never approved at all.


```json
{
  "schema_version": "1.0",
  "answer_id": "60164705-f5ba-408a-8290-78ca626ab644",
  "thread_id": "b8a82ddc-031b-4f94-9792-9534ceba5d24",
  "user_id": "U-402",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Across all areas, there are 3 temporary flowline bypasses currently in place (at WELL-0249, WELL-0405, and WELL-0248) [result_0a06f8913fc147b6a43bd0d300ea72ea]. Of these, the bypass at Southeast Block 31 (WELL-0248) is allowed under approval MOC-2026-031 with extension MOC-2026-044, valid until 2027-02-28 [result_0a06f8913fc147b6a43bd0d300ea72ea]. The bypass at Southeast Block 31 (WELL-0249) is expired (approval MOC-2026-036 expired on 2026-12-15), and the bypass at Northwest Block 12 (WELL-0405) is not approved [result_0a06f8913fc147b6a43bd0d300ea72ea]. In total, the full population of 12 matching flowline bypass records (past and present) includes 5 violations consisting of expired approvals or unapproved bypasses [result_0a06f8913fc147b6a43bd0d300ea72ea].",
  "blocks": [{"id":"60164705-f5ba-408a-8290-78ca626ab644:block:0","type":"table","title":"Temporary Flowline Bypasses","result_set_id":"result_0a06f8913fc147b6a43bd0d300ea72ea","evidence_ids":["src_b225e00c275a47ecd7c4ed16"],"encoding":{"asset_id":"asset_id","area_name":"area_name","current_in_place":"current_in_place","approval_id":"approval_id","assessment":"assessment","violation":"violation"},"span":2}],
  "results": {"result_0a06f8913fc147b6a43bd0d300ea72ea":{"result_set_id":"result_0a06f8913fc147b6a43bd0d300ea72ea","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":4,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"bypass_in","label":"Bypass In"},{"key":"bypass_out","label":"Bypass Out"},{"key":"current_in_place","label":"Current In Place"},{"key":"approval_id","label":"Approval Id"},{"key":"extension_id","label":"Extension Id"},{"key":"approval_valid_until","label":"Approval Valid Until"},{"key":"assessment","label":"Assessment"},{"key":"violation","label":"Violation"}],"rows":[{"area_name":"Southeast Block 31","asset_id":"WELL-0249","violation":true,"approval_id":"MOC-2026-036","bypass_in":"2026-11-25T10:25:00Z","current_in_place":true,"bypass_out":null,"assessment":"expired","approval_valid_until":"2026-12-15","area_id":"SE-31","extension_id":null},{"area_name":"Northwest Block 12","asset_id":"WELL-0405","violation":true,"approval_id":null,"bypass_in":"2026-12-20T10:15:00Z","current_in_place":true,"bypass_out":null,"assessment":"not_approved","approval_valid_until":null,"area_id":"NW-12","extension_id":null},{"area_name":"Southeast Block 31","asset_id":"WELL-0248","violation":false,"approval_id":"MOC-2026-031","bypass_in":"2026-11-05T13:30:00Z","current_in_place":true,"bypass_out":null,"assessment":"allowed","approval_valid_until":"2027-02-28","area_id":"SE-31","extension_id":"MOC-2026-044"},{"area_name":"Southwest Block 24","asset_id":"WELL-0087","violation":true,"approval_id":"MOC-2026-036","bypass_in":"2026-12-02T11:15:00Z","current_in_place":false,"bypass_out":"2027-01-06T13:20:00Z","assessment":"expired","approval_valid_until":"2026-12-15","area_id":"SW-24","extension_id":null},{"area_name":"Northeast Block 8","asset_id":"WELL-0158","violation":true,"approval_id":"MOC-2026-036","bypass_in":"2026-11-20T15:20:00Z","current_in_place":false,"bypass_out":"2026-12-28T10:35:00Z","assessment":"expired","approval_valid_until":"2026-12-15","area_id":"NE-08","extension_id":null},{"area_name":"Southeast Block 32","asset_id":"WELL-0561","violation":true,"approval_id":null,"bypass_in":"2026-12-08T08:25:00Z","current_in_place":false,"bypass_out":"2026-12-19T08:55:00Z","assessment":"not_approved","approval_valid_until":null,"area_id":"SE-32","extension_id":null},{"area_name":"Southwest Block 23","asset_id":"WELL-0013","violation":false,"approval_id":"MOC-2026-031","bypass_in":"2026-11-10T13:15:00Z","current_in_place":false,"bypass_out":"2027-01-08T14:45:00Z","assessment":"allowed","approval_valid_until":"2027-02-28","area_id":"SW-23","extension_id":"MOC-2026-044"},{"area_name":"Southwest Block 24","asset_id":"WELL-0062","violation":false,"approval_id":"MOC-2026-031","bypass_in":"2026-11-02T11:45:00Z","current_in_place":false,"bypass_out":"2026-11-27T09:20:00Z","assessment":"allowed","approval_valid_until":"2027-02-28","area_id":"SW-24","extension_id":"MOC-2026-044"},{"area_name":"Southwest Block 24","asset_id":"WELL-0284","violation":false,"approval_id":"MOC-2026-036","bypass_in":"2026-11-12T10:55:00Z","current_in_place":false,"bypass_out":"2026-12-10T15:20:00Z","assessment":"allowed","approval_valid_until":"2026-12-15","area_id":"SW-24","extension_id":null},{"area_name":"Northwest Block 12","asset_id":"WELL-0356","violation":false,"approval_id":"MOC-2026-036","bypass_in":"2026-11-18T09:20:00Z","current_in_place":false,"bypass_out":"2026-12-05T12:15:00Z","assessment":"allowed","approval_valid_until":"2026-12-15","area_id":"NW-12","extension_id":null},{"area_name":"Southeast Block 32","asset_id":"WELL-0461","violation":false,"approval_id":"MOC-2026-036","bypass_in":"2026-11-14T09:50:00Z","current_in_place":false,"bypass_out":"2026-12-12T15:40:00Z","assessment":"allowed","approval_valid_until":"2026-12-15","area_id":"SE-32","extension_id":null},{"area_name":"Southeast Block 32","asset_id":"WELL-0476","violation":false,"approval_id":"MOC-2026-031","bypass_in":"2026-10-22T15:50:00Z","current_in_place":false,"bypass_out":"2026-11-18T14:10:00Z","assessment":"allowed","approval_valid_until":"2027-02-28","area_id":"SE-32","extension_id":"MOC-2026-044"}],"evidence_ids":["ev_4ccfcc1b719f0f6b34641ddb","ev_68a418cbdd8d97073465ff08","src_b225e00c275a47ecd7c4ed16","result_0a06f8913fc147b6a43bd0d300ea72ea","ev_d0227f9e08a9cfd5acfbd8e6","ev_55e4119cbf5a590f1bb2d45e","ev_52be59807385555e3182dc48","ev_a31314778c5ef64320a2ddf4","src_40f453f8564eae41c6b0c88a","src_2935fd1cbef23fad63283ec4","ev_2657a5467d6f90a1e28a522f","ev_7b95ebda3a252d55a6afdbfa","ev_d9f2e20c021109353ac05c7b","ev_7cba5f3a951513c7ee14919f","ev_0965e97478a316d3051a0e2d","ev_b69f803f76e0caa7bc457820","ev_98cc2b82acb97097859bd1bf","ev_edf5f09f2338bd9a95ca028b","ev_d0b666e3c2905adc723811e1","ev_6712bb9260578093b99f22a6","ev_d9d5fabcf03a1b19f0f099d6","ev_909f0929e4b8fd758ce10f83","ev_a104fc9ec774855f0c5fb861","ev_99e9174448f58bf52d887375","ev_896c0fef598ce78a91db5318","ev_0ece1b8b536c90ae84433024","ev_8709a4df155cf1f53f062da3","ev_b2ab91f5468cba4c06748fa6","ev_778742186d923e1ed92ff905","ev_747afdcdf0b1351ac4391944","ev_d7796a4b48a98e70419df7da","ev_732974a48806c67af6f141b4","ev_3789d41eb6e0c7bb2ceb65cf","ev_3cd7eaa786efaf91150e216a","ev_1e36700897c1dfb2fac0ad15","ev_890e0e1d59851004c5220423","ev_99be5619071d226670ab5876","src_148067724bdb724664aecc6e"],"provider_coverage":{"unit":"bypass_intervals","matching":12,"evaluated":12,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":12,"output_rows":12,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_0139d0bb461447c1a2a8f2caf232898e","warnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day."],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"context_notes","metric":"bypass_intervals"},"summary":{"total_matching":12,"assessment_counts":{"expired":3,"not_approved":2,"allowed":7},"area_counts":{"Southeast Block 31":2,"Northwest Block 12":2,"Southwest Block 24":3,"Northeast Block 8":1,"Southeast Block 32":3,"Southwest Block 23":1},"current_in_place":3,"violations":5},"assessment_counts":{"expired":3,"not_approved":2,"allowed":7},"coverage":{"matching":12,"evaluated":12,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day."],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":4503,"output_tokens":202,"total_tokens":4705,"input_token_details":{"cache_read":0},"adapter":"langchain-google-gen
```

```
ai","finish_reason":"STOP"},"call_id":649,"live":true},{"stage":"maker","usage":{"input_tokens":4285,"output_tokens":1
038,"total_tokens":5323,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STO
P"},"call_id":655,"live":true}],"provider":"google","foreground_attempts":2,"live":true},
  "evidence": {"ev_4ccfcc1b719f0f6b34641ddb":{"id":"ev_4ccfcc1b719f0f6b34641ddb","source_id":"src_09848cfb8de66e525cd9
b704","source_kind":"metadata","title":"WELL-0249","path":"assets/WELL-0249/metadata.json"},"ev_68a418cbdd8d97073465ff
08":{"id":"ev_68a418cbdd8d97073465ff08","source_id":"src_5a7515ae361c22dfdb83358f","source_kind":"context","title":"CT
X-0249-002","path":"assets/WELL-0249/context.jsonl"},"src_b225e00c275a47ecd7c4ed16":{"id":"src_b225e00c275a47ecd7c4ed1
6","source_id":"src_b225e00c275a47ecd7c4ed16","source_kind":"sop","title":"fleet/sops/moc-2026-036.md","path":"fleet/s
ops/moc-2026-036.md"},"result_0a06f8913fc147b6a43bd0d300ea72ea":{"id":"result_0a06f8913fc147b6a43bd0d300ea72ea","sourc
e_id":"result_0a06f8913fc147b6a43bd0d300ea72ea","source_kind":"aggregate_lineage","title":"result_0a06f8913fc147b6a43b
d0d300ea72ea"},"ev_d0227f9e08a9cfd5acfbd8e6":{"id":"ev_d0227f9e08a9cfd5acfbd8e6","source_id":"src_2472ca703beebe656db5
e411","source_kind":"metadata","title":"WELL-0405","path":"assets/WELL-0405/metadata.json"},"ev_55e4119cbf5a590f1bb2d4
5e":{"id":"ev_55e4119cbf5a590f1bb2d45e","source_id":"src_6843304491e021704b5b3814","source_kind":"context","title":"CT
X-0405-003","path":"assets/WELL-0405/context.jsonl"},"ev_52be59807385555e3182dc48":{"id":"ev_52be59807385555e3182dc48"
,"source_id":"src_be90a5ce1fc6fc0030777f79","source_kind":"metadata","title":"WELL-0248","path":"assets/WELL-0248/meta
data.json"},"ev_a31314778c5ef64320a2ddf4":{"id":"ev_a31314778c5ef64320a2ddf4","source_id":"src_4274c7f2eda863e8a3f1f87
f","source_kind":"context","title":"CTX-0248-002","path":"assets/WELL-0248/context.jsonl"},"src_40f453f8564eae41c6b0c8
8a":{"id":"src_40f453f8564eae41c6b0c88a","source_id":"src_40f453f8564eae41c6b0c88a","source_kind":"sop","title":"fleet
/sops/moc-2026-031.md","path":"fleet/sops/moc-2026-031.md"},"src_2935fd1cbef23fad63283ec4":{"id":"src_2935fd1cbef23fad
63283ec4","source_id":"src_2935fd1cbef23fad63283ec4","source_kind":"sop","title":"fleet/sops/moc-2026-044.md","path":"
fleet/sops/moc-2026-044.md"},"ev_2657a5467d6f90a1e28a522f":{"id":"ev_2657a5467d6f90a1e28a522f","source_id":"src_bc2533
407868b17b40e76149","source_kind":"metadata","title":"WELL-0087","path":"assets/WELL-0087/metadata.json"},"ev_7b95ebda
3a252d55a6afdbfa":{"id":"ev_7b95ebda3a252d55a6afdbfa","source_id":"src_18cc32be7f209a603ef54847","source_kind":"contex
t","title":"CTX-0087-001","path":"assets/WELL-0087/context.jsonl"},"ev_d9f2e20c021109353ac05c7b":{"id":"ev_d9f2e20c021
109353ac05c7b","source_id":"src_18cc32be7f209a603ef54847","source_kind":"context","title":"CTX-0087-004","path":"asset
s/WELL-0087/context.jsonl"},"ev_7cba5f3a951513c7ee14919f":{"id":"ev_7cba5f3a951513c7ee14919f","source_id":"src_13017e7
f3179cda52e9689ff","source_kind":"metadata","title":"WELL-0158","path":"assets/WELL-0158/metadata.json"},"ev_0965e9747
8a316d3051a0e2d":{"id":"ev_0965e97478a316d3051a0e2d","source_id":"src_9467ed264e88278b15ad9cd8","source_kind":"context
","title":"CTX-0158-003","path":"assets/WELL-0158/context.jsonl"},"ev_b69f803f76e0caa7bc457820":{"id":"ev_b69f803f76e0
caa7bc457820","source_id":"src_9467ed264e88278b15ad9cd8","source_kind":"context","title":"CTX-0158-005","path":"assets
/WELL-0158/context.jsonl"},"ev_98cc2b82acb97097859bd1bf":{"id":"ev_98cc2b82acb97097859bd1bf","source_id":"src_7f230866
05b3e91aa15969c1","source_kind":"metadata","title":"WELL-0561","path":"assets/WELL-0561/metadata.json"},"ev_edf5f09f23
38bd9a95ca028b":{"id":"ev_edf5f09f2338bd9a95ca028b","source_id":"src_82c377e8a0093f0cc65fba2d","source_kind":"context"
,"title":"CTX-0561-004","path":"assets/WELL-0561/context.jsonl"},"ev_d0b666e3c2905adc723811e1":{"id":"ev_d0b666e3c2905
adc723811e1","source_id":"src_82c377e8a0093f0cc65fba2d","source_kind":"context","title":"CTX-0561-005","path":"assets/
WELL-0561/context.jsonl"},"ev_6712bb9260578093b99f22a6":{"id":"ev_6712bb9260578093b99f22a6","source_id":"src_8313aa8d6
895ee143c57f782","source_kind":"metadata","title":"WELL-0013","path":"assets/WELL-0013/metadata.json"},"ev_d9d5fabcf03
a1b19f0f099d6":{"id":"ev_d9d5fabcf03a1b19f0f099d6","source_id":"src_42816a15443631330be242ae","source_kind":"context",
"title":"CTX-0013-002","path":"assets/WELL-0013/context.jsonl"},"ev_909f0929e4b8fd758ce10f83":{"id":"ev_909f0929e4b8fd
758ce10f83","source_id":"src_42816a15443631330be242ae","source_kind":"context","title":"CTX-0013-005","path":"assets/W
ELL-0013/context.jsonl"},"ev_a104fc9ec774855f0c5fb861":{"id":"ev_a104fc9ec774855f0c5fb861","source_id":"src_cae3552c09
2ca6d38d44b2a5","source_kind":"metadata","title":"WELL-0062","path":"assets/WELL-0062/metadata.json"},"ev_99e9174448f5
8bf52d887375":{"id":"ev_99e9174448f58bf52d887375","source_id":"src_0b17f3a1c3360b1b8fdf6c49","source_kind":"context","
title":"CTX-0062-002","path":"assets/WELL-0062/context.jsonl"},"ev_896c0fef598ce78a91db5318":{"id":"ev_896c0fef598ce78
a91db5318","source_id":"src_0b17f3a1c3360b1b8fdf6c49","source_kind":"context","title":"CTX-0062-005","path":"assets/WE
LL-0062/context.jsonl"},"ev_0ece1b8b536c90ae84433024":{"id":"ev_0ece1b8b536c90ae84433024","source_id":"src_7c2593a6303
65f24fba946a3","source_kind":"metadata","title":"WELL-0284","path":"assets/WELL-0284/metadata.json"},"ev_8709a4df155cf
1f53f062da3":{"id":"ev_8709a4df155cf1f53f062da3","source_id":"src_484604a7bf9b0c49457a4ef1","source_kind":"context","t
itle":"CTX-0284-002","path":"assets/WELL-0284/context.jsonl"},"ev_b2ab91f5468cba4c06748fa6":{"id":"ev_b2ab91f5468cba4c
06748fa6","source_id":"src_484604a7bf9b0c49457a4ef1","source_kind":"context","title":"CTX-0284-003","path":"assets/WEL
L-0284/context.jsonl"},"ev_778742186d923e1ed92ff905":{"id":"ev_778742186d923e1ed92ff905","source_id":"src_7d3b34e8542e
6f7d525eab66","source_kind":"metadata","title":"WELL-0356","path":"assets/WELL-0356/metadata.json"},"ev_747afdcdf0b135
1ac4391944":{"id":"ev_747afdcdf0b1351ac4391944","source_id":"src_1a576011180070dc1730f791","source_kind":"context","ti
tle":"CTX-0356-002","path":"assets/WELL-0356/context.jsonl"},"ev_d7796a4b48a98e70419df7da":{"id":"ev_d7796a4b48a98e704
19df7da","source_id":"src_1a576011180070dc1730f791","source_kind":"context","title":"CTX-0356-003","path":"assets/WELL
-0356/context.jsonl"},"ev_732974a48806c67af6f141b4":{"id":"ev_732974a48806c67af6f141b4","source_id":"src_128fab1da2949
feac7abb64d","source_kind":"metadata","title":"WELL-0461","path":"assets/WELL-0461/metadata.json"},"ev_3789d41eb6e0c7b
b2ceb65cf":{"id":"ev_3789d41eb6e0c7bb2ceb65cf","source_id":"src_8c72d7f9f849bdfc8a98a32f","source_kind":"context","titl
e":"CTX-0461-002","path":"assets/WELL-0461/context.jsonl"},"ev_3cd7eaa786efaf91150e216a":{"id":"ev_3cd7eaa786efaf9115
0e216a","source_id":"src_8c72d7f9f849bdfc8a98a32f","source_kind":"context","title":"CTX-0461-003","path":"assets/WELL-
0461/context.jsonl"},"ev_1e36700897c1dfb2fac0ad15":{"id":"ev_1e36700897c1dfb2fac0ad15","source_id":"src_664eef2a4bb47c
c617f65a41","source_kind":"metadata","title":"WELL-0476","path":"assets/WELL-0476/metadata.json"},"ev_890e0e1d59851004
c5220423":{"id":"ev_890e0e1d59851004c5220423","source_id":"src_ac9a39957e5a5dba89f10afd","source_kind":"context","titl
e":"CTX-0476-002","path":"assets/WELL-0476/context.jsonl"},"ev_99be5619071d226670ab5876":{"id":"ev_99be5619071d226670a
b5876","source_id":"src_ac9a39957e5a5dba89f10afd","source_kind":"context","title":"CTX-0476-003","path":"assets/WELL-0
476/context.jsonl"},"src_148067724bdb724664aecc6e":{"id":"src_148067724bdb724664aecc6e","source_id":"src_148067724bdb7
24664aecc6e","source_kind":"sop","title":"fleet/sops/operations-sop-rev2.md","path":"fleet/sops/operations-sop-rev2.md
"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memo
ry:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pier
ce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"me
mory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Ha
yes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"m
emory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan
Pierce"}}
}
```

Question 5

Michael Turner · Turn 1 · complete

The State Oil & Gas Commission wrote to us in November 2026 about spills. Which of our spills does the letter cover, and on which ones are we not compliant? Show me a table.


```json
{
  "schema_version": "1.0",
  "answer_id": "71e0469c-b0b1-4752-8458-c3323bd3c79c",
  "thread_id": "87084f6c-8fa3-4f87-9959-d2f0a2ca5575",
  "user_id": "U-201",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "The State Oil & Gas Commission letter from November 2026 covers six spills across Northeast Block 7 and Northeast Block 8 [ev_c8678cad23d239cd6b6b21a5]. Based on the inspection and cleanup report checks, three of these spills are compliant and three are not compliant due to the absence of the required affirmative lab sentence in the specified report section [ev_c8678cad23d239cd6b6b21a5].",
  "blocks": [{"id":"71e0469c-b0b1-4752-8458-c3323bd3c79c:block:0","type":"table","title":"State Oil & Gas Commission Spill Compliance","result_set_id":"result_df49ef2365cb4c1098d44cd4d94a7229","evidence_ids":["ev_c8678cad23d239cd6b6b21a5","ev_5eee886bf708d89f810c9f16","src_71ddc6a00e486f4dff8c2f6c"],"encoding":{},"span":2}],
  "results": {"result_df49ef2365cb4c1098d44cd4d94a7229":{"result_set_id":"result_df49ef2365cb4c1098d44cd4d94a7229","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":4,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"inspection_id","label":"Inspection Id"},{"key":"inspected_at","label":"Inspected At"},{"key":"spill_volume_bbl","label":"Spill Volume Bbl","unit":"bbl"},{"key":"cleanup_jobs","label":"Cleanup Jobs"},{"key":"cleanup_job_ids","label":"Cleanup Job Ids"},{"key":"compliant","label":"Compliant"},{"key":"report_checks","label":"Report Checks"},{"key":"due_date","label":"Due Date"},{"key":"assessment","label":"Assessment"},{"key":"reason","label":"Reason"}],"rows":[{"area_name":"Northeast Block 7","asset_id":"WELL-0119","report_checks":"[{\"maintenance_id\": \"MNT-0119-029\", \"report_source_id\": \"src_20e751ecdf19d0416c5accb8\", \"lab_sentence_present\": true}]","due_date":"2027-01-15","reason":"Affirmative required lab sentence in specified report section","inspection_id":"INS-0119-0209","spill_volume_bbl":6.0,"inspected_at":"2026-11-05T14:15:00Z","assessment":"compliant","compliant":true,"cleanup_jobs":"[\"MNT-0119-029\"]","area_id":"NE-07","cleanup_job_ids":"MNT-0119-029"},{"area_name":"Northeast Block 7","asset_id":"WELL-0123","report_checks":"[{\"maintenance_id\": \"MNT-0123-014\", \"report_source_id\": \"src_9ff85b38c4bbb4cd0b3fee7c\", \"lab_sentence_present\": false}]","due_date":"2027-01-15","reason":"No linked cleanup report with the affirmative required lab sentence in specified section; on-site readings do not count","inspection_id":"INS-0123-0093","spill_volume_bbl":6.0,"inspected_at":"2026-09-24T13:30:00Z","assessment":"not_compliant","compliant":false,"cleanup_jobs":"[\"MNT-0123-014\"]","area_id":"NE-07","cleanup_job_ids":"MNT-0123-014"},{"area_name":"Northeast Block 8","asset_id":"WELL-0168","report_checks":"[{\"maintenance_id\": \"MNT-0168-024\", \"report_source_id\": \"src_a57a9d745e95e7e028ada0b2\", \"lab_sentence_present\": true}]","due_date":"2027-01-15","reason":"Affirmative required lab sentence in specified report section","inspection_id":"INS-0168-0190","spill_volume_bbl":5.6,"inspected_at":"2026-06-11T07:00:00Z","assessment":"compliant","compliant":true,"cleanup_jobs":"[\"MNT-0168-024\"]","area_id":"NE-08","cleanup_job_ids":"MNT-0168-024"},{"area_name":"Northeast Block 8","asset_id":"WELL-0182","report_checks":"[{\"maintenance_id\": \"MNT-0182-028\", \"report_source_id\": \"src_0a28517909e88064de70541e\", \"lab_sentence_present\": false}]","due_date":"2027-01-15","reason":"No linked cleanup report with the affirmative required lab sentence in specified section; on-site readings do not count","inspection_id":"INS-0182-0208","spill_volume_bbl":5.2,"inspected_at":"2026-12-03T11:45:00Z","assessment":"not_compliant","compliant":false,"cleanup_jobs":"[\"MNT-0182-028\"]","area_id":"NE-08","cleanup_job_ids":"MNT-0182-028"},{"area_name":"Northeast Block 8","asset_id":"WELL-0262","report_checks":"[{\"maintenance_id\": \"MNT-0262-029\", \"report_source_id\": \"src_e290d47460ff0352d5d67ed8\", \"lab_sentence_present\": false}]","due_date":"2027-01-15","reason":"No linked cleanup report with the affirmative required lab sentence in specified section; on-site readings do not count","inspection_id":"INS-0262-0218","spill_volume_bbl":6.1,"inspected_at":"2027-01-07T08:30:00Z","assessment":"not_compliant","compliant":false,"cleanup_jobs":"[\"MNT-0262-029\"]","area_id":"NE-08","cleanup_job_ids":"MNT-0262-029"},{"area_name":"Northeast Block 7","asset_id":"WELL-0277","report_checks":"[{\"maintenance_id\": \"MNT-0277-031\", \"report_source_id\": \"src_28c3ee57c11addb71b958873\", \"lab_sentence_present\": true}]","due_date":"2027-01-15","reason":"Affirmative required lab sentence in specified report section","inspection_id":"INS-0277-0205","spill_volume_bbl":6.2,"inspected_at":"2026-10-01T11:45:00Z","assessment":"compliant","compliant":true,"cleanup_jobs":"[\"MNT-0277-031\"]","area_id":"NE-07","cleanup_job_ids":"MNT-0277-031"}],"evidence_ids":["ev_c8678cad23d239cd6b6b21a5","ev_5eee886bf708d89f810c9f16","src_71ddc6a00e486f4dff8c2f6c","src_85bc657d28115b6a502a6e44","src_20e751ecdf19d0416c5accb8","ev_b1c5b71aec0a24b5c29b72f3","result_df49ef2365cb4c1098d44cd4d94a7229","ev_3f22b10c03b8b397da3e5224","ev_0bddf2714f939cff6ed849be","src_9ff85b38c4bbb4cd0b3fee7c","ev_42dd9003d04faea7c52cc6d2","ev_e6471362b1d5bf288a8de8c2","ev_f76ced5a9c2fa1e95a2bdd65","src_a57a9d745e95e7e028ada0b2","ev_ecf1093735b7175ae2414851","ev_f927e46a0474615370774296","ev_80d5062765bb4452ca679691","src_0a28517909e88064de70541e","ev_6a3ff4e33610ff45f3dfc293","ev_85ee6569eb8872f91bd21c20","ev_ac389bd34dbc5707674e7afe","src_e290d47460ff0352d5d67ed8","ev_ff6fd04c159c0d8f42338211","ev_56633c60d9c04584d5bea51c","ev_1cd1d715c47a9bb0fc52e1ac","src_28c3ee57c11addb71b958873","ev_ee1992aed1f3abd7eeb8c99a"],"provider_coverage":{"unit":"letter_compliance","matching":6,"evaluated":6,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":6,"output_rows":6,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_1de5a4b2a6974bc989f0c8814836833a","warnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Letter assessment uses its stated incident window through the reference date; publication date is not the spill window.","Compliant means the letter's explicit internal report-evidence criterion is met; report wording alone does not independently verify actual laboratory submission time."],"bounds":{"start":"2026-06-01","end":"2027-01-15","closure":"both"},"operation":{"collection":"regulatory_events","metric":"letter_compliance"},"summary":{"total_matching":6,"assessment_counts":{"compliant":3,"not_compliant":3},"area_counts":{"Northeast Block 7":3,"Northeast Block 8":3}},"assessment_counts":{"compliant":3,"not_compliant":3},"coverage":{"matching":6,"evaluated":6,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Letter assessment uses its stated incident window through the reference date; publication date is not the spill window.","Compliant means the letter's explicit internal report-evidence criterion is met; report wording alone does not independently verify actual laboratory submission time.","Ranked lexical retrieval cannot prove a fleet total or source absence","Report prose may predate corrections; a lexical hit does not confirm effective spill detection or current classification"],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":4363,"output_tokens":252,"total_tokens":4615,"input_token_details":{"cache_read":0},"adapter":"langchain-google-gen
```

```
ai","finish_reason":"STOP"},"call_id":659,"live":true},{"stage":"maker","usage":{"input_tokens":4242,"output_tokens":1
87,"total_tokens":4429,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP
"},"call_id":671,"live":true}],"provider":"google","foreground_attempts":3,"live":true},
  "evidence": {"ev_c8678cad23d239cd6b6b21a5":{"id":"ev_c8678cad23d239cd6b6b21a5","source_id":"src_f4f8260813bacacc8785
9e76","source_kind":"metadata","title":"WELL-0119","path":"assets/WELL-0119/metadata.json"},"ev_5eee886bf708d89f810c9f
16":{"id":"ev_5eee886bf708d89f810c9f16","source_id":"src_35da0b93d83407909227ce8f","source_kind":"inspections","title"
:"INS-0119-0209","path":"assets/WELL-0119/inspections.jsonl"},"src_71ddc6a00e486f4dff8c2f6c":{"id":"src_71ddc6a00e486f
4dff8c2f6c","source_id":"src_71ddc6a00e486f4dff8c2f6c","source_kind":"sop","title":"fleet/sops/regulator-letter-2026-1
1-20.md","path":"fleet/sops/regulator-letter-2026-11-20.md"},"src_85bc657d28115b6a502a6e44":{"id":"src_85bc657d28115b6
a502a6e44","source_id":"src_85bc657d28115b6a502a6e44","source_kind":"sop","title":"fleet/sops/spill-response-sop.md","
path":"fleet/sops/spill-response-sop.md"},"src_20e751ecdf19d0416c5accb8":{"id":"src_20e751ecdf19d0416c5accb8","source_
id":"src_20e751ecdf19d0416c5accb8","source_kind":"report","title":"assets/WELL-0119/maintenance-reports/MNT-0119-029.m
d","path":"assets/WELL-0119/maintenance-reports/MNT-0119-029.md"},"ev_b1c5b71aec0a24b5c29b72f3":{"id":"ev_b1c5b71aec0a
24b5c29b72f3","source_id":"src_7c29d436264cb0cfeb35e017","source_kind":"maintenance","title":"MNT-0119-029","path":"as
sets/WELL-0119/maintenance.jsonl"},"result_df49ef2365cb4c1098d44cd4d94a7229":{"id":"result_df49ef2365cb4c1098d44cd4d94
a7229","source_id":"result_df49ef2365cb4c1098d44cd4d94a7229","source_kind":"aggregate_lineage","title":"result_df49ef2
365cb4c1098d44cd4d94a7229"},"ev_3f22b10c03b8b397da3e5224":{"id":"ev_3f22b10c03b8b397da3e5224","source_id":"src_3ca43f2
5d21c6ea7596dd9df","source_kind":"metadata","title":"WELL-0123","path":"assets/WELL-0123/metadata.json"},"ev_0bddf2714
f939cff6ed849be":{"id":"ev_0bddf2714f939cff6ed849be","source_id":"src_5d2fd659ac07d33440a3e5ea","source_kind":"inspect
ions","title":"INS-0123-0093","path":"assets/WELL-0123/inspections.jsonl"},"src_9ff85b38c4bbb4cd0b3fee7c":{"id":"src_9
ff85b38c4bbb4cd0b3fee7c","source_id":"src_9ff85b38c4bbb4cd0b3fee7c","source_kind":"report","title":"assets/WELL-0123/m
aintenance-reports/MNT-0123-014.md","path":"assets/WELL-0123/maintenance-reports/MNT-0123-014.md"},"ev_42dd9003d04faea
7c52cc6d2":{"id":"ev_42dd9003d04faea7c52cc6d2","source_id":"src_dd763943495a7c07a2a7449f","source_kind":"maintenance",
"title":"MNT-0123-014","path":"assets/WELL-0123/maintenance.jsonl"},"ev_e6471362b1d5bf288a8de8c2":{"id":"ev_e6471362b1
d5bf288a8de8c2","source_id":"src_53c502e0ac1cb0c975bea517","source_kind":"metadata","title":"WELL-0168","path":"assets
/WELL-0168/metadata.json"},"ev_f76ced5a9c2fa1e95a2bdd65":{"id":"ev_f76ced5a9c2fa1e95a2bdd65","source_id":"src_2a597946
4298a1d01f6636ac","source_kind":"inspections","title":"INS-0168-0190","path":"assets/WELL-0168/inspections.jsonl"},"sr
c_a57a9d745e95e7e028ada0b2":{"id":"src_a57a9d745e95e7e028ada0b2","source_id":"src_a57a9d745e95e7e028ada0b2","source_ki
nd":"report","title":"assets/WELL-0168/maintenance-reports/MNT-0168-024.md","path":"assets/WELL-0168/maintenance-repor
ts/MNT-0168-024.md"},"ev_ecf1093735b7175ae2414851":{"id":"ev_ecf1093735b7175ae2414851","source_id":"src_1b671ba44451b5
05e468b5f1","source_kind":"maintenance","title":"MNT-0168-024","path":"assets/WELL-0168/maintenance.jsonl"},"ev_f927e4
6a04746153707742 96":{"id":"ev_f927e46a04746153707742 96","source_id":"src_c285a6ca99fff5c7f621c5c6","source_kind":"meta
data","title":"WELL-0182","path":"assets/WELL-0182/metadata.json"},"ev_80d5062765bb4452ca679691":{"id":"ev_80d5062765b
b4452ca679691","source_id":"src_0b9a897ffd4131c795d7e84c","source_kind":"inspections","title":"INS-0182-0208","path":"
assets/WELL-0182/inspections.jsonl"},"src_0a28517909e88064de70541e":{"id":"src_0a28517909e88064de70541e","source_id":"
src_0a28517909e88064de70541e","source_kind":"report","title":"assets/WELL-0182/maintenance-reports/MNT-0182-028.md","p
ath":"assets/WELL-0182/maintenance-reports/MNT-0182-028.md"},"ev_6a3ff4e33610ff45f3dfc293":{"id":"ev_6a3ff4e33610ff45f
3dfc293","source_id":"src_fef4282463791272bd034cf6","source_kind":"maintenance","title":"MNT-0182-028","path":"assets/
WELL-0182/maintenance.jsonl"},"ev_85ee6569eb8872f91bd21c20":{"id":"ev_85ee6569eb8872f91bd21c20","source_id":"src_b5f1a
1ebc90dd5254618f301","source_kind":"metadata","title":"WELL-0262","path":"assets/WELL-0262/metadata.json"},"ev_ac389bd
34dbc5707674e7afe":{"id":"ev_ac389bd34dbc5707674e7afe","source_id":"src_95a607e90b8fd09097484410","source_kind":"inspe
ctions","title":"INS-0262-0218","path":"assets/WELL-0262/inspections.jsonl"},"src_e290d47460ff0352d5d67ed8":{"id":"src
_e290d47460ff0352d5d67ed8","source_id":"src_e290d47460ff0352d5d67ed8","source_kind":"report","title":"assets/WELL-0262
/maintenance-reports/MNT-0262-029.md","path":"assets/WELL-0262/maintenance-reports/MNT-0262-029.md"},"ev_ff6fd04c159c0
d8f42338211":{"id":"ev_ff6fd04c159c0d8f42338211","source_id":"src_d92e72a5918217da86bd559c","source_kind":"maintenance
","title":"MNT-0262-029","path":"assets/WELL-0262/maintenance.jsonl"},"ev_56633c60d9c04584d5bea51c":{"id":"ev_56633c60
d9c04584d5bea51c","source_id":"src_540fe4171638cfb1ed7f59d5","source_kind":"metadata","title":"WELL-0277","path":"asse
ts/WELL-0277/metadata.json"},"ev_1cd1d715c47a9bb0fc52e1ac":{"id":"ev_1cd1d715c47a9bb0fc52e1ac","source_id":"src_2d0fb8
bc04d086d073ecfd79","source_kind":"inspections","title":"INS-0277-0205","path":"assets/WELL-0277/inspections.jsonl"},"
src_28c3ee57c11addb71b958873":{"id":"src_28c3ee57c11addb71b958873","source_id":"src_28c3ee57c11addb71b958873","source_
kind":"report","title":"assets/WELL-0277/maintenance-reports/MNT-0277-031.md","path":"assets/WELL-0277/maintenance-rep
orts/MNT-0277-031.md"},"ev_ee1992aed1f3abd7eeb8c99a":{"id":"ev_ee1992aed1f3abd7eeb8c99a","source_id":"src_72f6ee9134f4
192ad81ce646","source_kind":"maintenance","title":"MNT-0277-031","path":"assets/WELL-0277/maintenance.jsonl"},"memory:
6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e
-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memor
y:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d
28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memo
ry:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1
d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"ch
unk_0042df56db6acbd007d26eb8":{"id":"chunk_0042df56db6acbd007d26eb8","source_id":"src_77bc8d9c52cb2b2f829dc881","sourc
e_kind":"report","title":"Compliance check","path":"assets/WELL-0474/maintenance-reports/MNT-0474-028.md"},"chunk_00b0
04e1b16176fb07f482ce":{"id":"chunk_00b004e1b16176fb07f482ce","source_id":"src_90e04dff8745219b43aeca7d","source_kind":
"report","title":"Compliance check","path":"assets/WELL-0114/maintenance-reports/MNT-0114-004.md"},"chunk_02f7081ac6a9
c60ec4f2db71":{"id":"chunk_02f7081ac6a9c60ec4f2db71","source_id":"src_9ff85b38c4bbb4cd0b3fee7c","source_kind":"report"
,"title":"Compliance check","path":"assets/WELL-0123/maintenance-reports/MNT-0123-014.md"},"chunk_064c3f479f44fe7f893f
b805":{"id":"chunk_064c3f479f44fe7f893fb805","source_id":"src_3bf4ee8ff72d55bdf9aaad83","source_kind":"report","title"
:"Compliance check","path":"assets/WELL-0204/maintenance-reports/MNT-0204-019.md"},"chunk_0bf0af2383db5653aa4046b0":{"
id":"chunk_0bf0af2383db5653aa4046b0","source_id":"src_8576776a299e47c1705d5084","source_kind":"report","title":"Compli
ance check","path":"assets/WELL-0216/maintenance-reports/MNT-0216-014.md"},"chunk_1170ae988a51f8d13faa5649":{"id":"chu
nk_1170ae988a51f8d13faa5649","source_id":"src_990d5e71ac4cf7fd07ed4a3c","source_kind":"report","title":"Compliance
check","path":"assets/WELL-0303/maintenance-reports/MNT-0303-011.md"}}
}
```

Question 6

Nathan Pierce · Turn 1 · complete

Across the whole field, not just my area, for which wells do the latest inspection and the operator notes disagree about whether the well is producing oil? For each one, what is its real status right now, and why?


```json
{
  "schema_version": "1.0",
  "answer_id": "2c80a670-56fc-47e7-95fd-867ef4bfdeb1",
  "thread_id": "cead414a-dcd4-49ca-aca2-e5887e4fe559",
  "user_id": "U-601",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Across the whole field, the supplied records show 120 matching assets in total
[app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774]. The query asks for wells where the latest inspection and operator
notes disagree about whether the well is producing oil. The initial preview rows display wells WELL-0102, WELL-0103,
WELL-0106, WELL-0107, WELL-0111, and WELL-0122 in Northeast Block 7 [app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774].
Complete coverage of the disagreement status requires inspecting the full table results
[app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774].",
  "blocks": [{"id":"2c80a670-56fc-47e7-95fd-867ef4bfdeb1:block:0","type":"table","title":"Field Inspection and Status
Disagreements","result_set_id":"app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774","evidence_ids":["app:pages:29d0cf34-cf
7b-415a-8a42-ecac4e305774"],"encoding":{},"span":2}],
  "results": {"app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774":{"result_set_id":"app:pages:29d0cf34-cf7b-415a-8a42-eca
c4e305774","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":
4,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"well_type","label":"Well
Type"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area
Name"},{"key":"recorded_status","label":"Recorded
Status"},{"key":"lat","label":"Lat"},{"key":"lon","label":"Lon"},{"key":"inspection_id","label":"Inspection
Id"},{"key":"inspected_at","label":"Inspected At"},{"key":"inspector_name","label":"Inspector
Name"},{"key":"method","label":"Method"},{"key":"ambient_temp_c","label":"Ambient Temp
C","unit":"C"},{"key":"wellhead_temp_c","label":"Wellhead Temp C","unit":"C"},{"key":"delta_c","label":"Delta
C","unit":"C"},{"key":"threshold_c","label":"Threshold
C","unit":"C"},{"key":"inspection_producing","label":"Inspection
Producing"},{"key":"producing","label":"Producing"},{"key":"spill_detected","label":"Spill
Detected"},{"key":"spill_est_volume_bbl","label":"Spill Est Volume
Bbl","unit":"bbl"},{"key":"notes","label":"Notes"},{"key":"unknown_count","label":"Unknown
Count"},{"key":"inspection_well_type","label":"Inspection Well Type"},{"key":"recorded_at","label":"Recorded
At"},{"key":"team_id","label":"Team Id"},{"key":"team_name","label":"Team
Name"},{"key":"status_confirmed","label":"Status Confirmed"},{"key":"status_source","label":"Status
Source"},{"key":"latest_status_note_id","label":"Latest Status Note
Id"},{"key":"latest_status_note_at","label":"Latest Status Note At"},{"key":"latest_status_note_text","label":"Latest
Status Note Text"},{"key":"latest_status_note_author_user_id","label":"Latest Status Note Author User
Id"},{"key":"status_note_disagrees","label":"Status Note Disagrees"},{"key":"status_now","label":"Status
Now"},{"key":"decommissioned_on","label":"Decommissioned On"},{"key":"status_rule_source","label":"Status Rule
Source"}],"rows":[{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":
15.0,"lat":32.10673,"delta_c":32.7,"latest_status_note_id":"CTX-0102-001","decommissioned_on":null,"lon":-102.17303,"t
eam_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T13:00:00Z","area_name":"Northeast
Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.0,"producing":true,"latest_status_note_text":"Shut
in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-010
2","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-09-05T18:00:00Z","inspection_id":
"INS-0102-0219","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspe
ction_producing":true,"inspector_name":"Tyler Hughes","area_id":"NE-07","wellhead_temp_c":38.7,"status_source":"inspec
tion","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status
_now":"Producing oil","threshold_c":20.0,"lat":32.13904,"delta_c":31.4,"latest_status_note_id":"CTX-0103-001","decommi
ssioned_on":null,"lon":-102.19324,"team_id":"TEAM-NE","team_name":"Northeast
Production","inspected_at":"2027-01-14T07:30:00Z","area_name":"Northeast Block 7","recorded_status":"active","recorded
_at":null,"ambient_temp_c":9.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0103","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2025-08-07T18:00:00Z","inspection_id":"INS-0103-0220","spill_detected"
:false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Ashley Bennett","area_id":"NE-07","wellhead_temp_c":40.8,"status_source":"inspection","method":"drone","notes"
:"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshol
d_c":15.0,"lat":32.10646,"delta_c":22.8,"latest_status_note_id":"CTX-0106-001","decommissioned_on":null,"lon":-102.177
98,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T15:15:00Z","area_name":"Northeast
Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.6,"producing":true,"latest_status_note_text":"Shut
in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-010
6","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-02-22T18:00:00Z","inspection_id":
"INS-0106-0160","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspe
ction_producing":true,"inspector_name":"Tyler Hughes","area_id":"NE-07","wellhead_temp_c":32.4,"status_source":"inspec
tion","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_
now":"Producing oil","threshold_c":20.0,"lat":32.13859,"delta_c":27.1,"latest_status_note_id":"CTX-0107-001","decommis
sioned_on":null,"lon":-102.2179,"team_id":"TEAM-NE","team_name":"Northeast
Production","inspected_at":"2027-01-14T13:00:00Z","area_name":"Northeast Block 7","recorded_status":"active","recorded
_at":null,"ambient_temp_c":7.8,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0107","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2023-07-06T18:00:00Z","inspection_id":"INS-0107-0222","spill_detected"
:false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Jessica Reed","area_id":"NE-07","wellhead_temp_c":34.9,"status_source":"inspection","method":"drone","notes":"
","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_
c":20.0,"lat":32.14018,"delta_c":34.9,"latest_status_note_id":"CTX-0111-001","decommissioned_on":null,"lon":-102.187,"
```

team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T07:00:00Z","area_name":"Northeast Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.5,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0111","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-10-02T18:00:00Z","inspection_id":"INS-0111-0216","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Tyler Hughes","area_id":"NE-07","wellhead_temp_c":44.4,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":32.12581,"delta_c":27.1,"latest_status_note_id":"CTX-0122-001","decommissioned_on":null,"lon":-102.21471,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T14:45:00Z","area_name":"Northeast Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":4.6,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0122","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-02-26T18:00:00Z","inspection_id":"INS-0122-0219","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jessica Reed","area_id":"NE-07","wellhead_temp_c":31.7,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.08837,"delta_c":19.7,"latest_status_note_id":"CTX-0124-001","decommissioned_on":null,"lon":-102.20778,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T08:30:00Z","area_name":"Northeast Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.3,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0124","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-08-10T18:00:00Z","inspection_id":"INS-0124-0216","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jessica Reed","area_id":"NE-07","wellhead_temp_c":29.0,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.14241,"delta_c":28.3,"latest_status_note_id":"CTX-0126-001","decommissioned_on":null,"lon":-102.18061,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T11:45:00Z","area_name":"Northeast Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.3,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0126","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-03-02T18:00:00Z","inspection_id":"INS-0126-0204","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jessica Reed","area_id":"NE-07","wellhead_temp_c":33.6,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":32.10752,"delta_c":25.1,"latest_status_note_id":"CTX-0128-002","decommissioned_on":null,"lon":-102.17395,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T12:45:00Z","area_name":"Northeast Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.3,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0128","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-08-21T18:00:00Z","inspection_id":"INS-0128-0215","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jessica Reed","area_id":"NE-07","wellhead_temp_c":30.4,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":32.09385,"delta_c":32.3,"latest_status_note_id":"CTX-0132-001","decommissioned_on":null,"lon":-102.17676,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T11:00:00Z","area_name":"Northeast Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.2,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0132","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-10-26T18:00:00Z","inspection_id":"INS-0132-0220","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jessica Reed","area_id":"NE-07","wellhead_temp_c":41.5,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":32.09689,"delta_c":29.3,"latest_status_note_id":"CTX-0137-001","decommissioned_on":null,"lon":-102.21457,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T13:45:00Z","area_name":"Northeast Block 7","recorded_status":"active","recorded_at":null,"ambient_temp_c":11.8,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0137","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-04-11T18:00:00Z","inspection_id":"INS-0137-0217","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ashley Bennett","area_id":"NE-07","wellhead_temp_c":41.1,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.09151,"delta_c":31.5,"latest_status_note_id":"CTX-0253-001","decommissioned_on":null,"lon":-102.20233,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T12:45:00Z","area_name":"Northeast Block
7","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.1,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0253","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-09-21T18:00:00Z","inspection_id":"INS-0253-0218","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ashley Bennett","area_id":"NE-07","wellhead_temp_c":38.6,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.13168,"delta_c":20.5,"latest_status_note_id":"CTX-0257-001","decommissioned_on":null,"lon":-102.18991,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T07:45:00Z","area_name":"Northeast Block 7","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.7,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0257","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-05-23T18:00:00Z","inspection_id":"INS-0257-0219","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Tyler Hughes","area_id":"NE-07","wellhead_temp_c":30.2,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":32.09752,"delta_c":28.1,"latest_status_note_id":"CTX-0277-001","decommissioned_on":null,"lon":-102.21745,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T11:00:00Z","area_name":"Northeast Block 7","recorded_status":"active","recorded_at":null,"ambient_temp_c":10.1,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0277","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-02-16T18:00:00Z","inspect

ion_id":"INS-0277-0219","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":tru
e,"inspection_producing":true,"inspector_name":"Tyler Hughes","area_id":"NE-07","wellhead_temp_c":38.2,"status_source"
:"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350",
"status_now":"Producing oil","threshold_c":20.0,"lat":32.14721,"delta_c":30.9,"latest_status_note_id":"CTX-0171-001","
decommissioned_on":null,"lon":-102.18945,"team_id":"TEAM-NE","team_name":"Northeast
Production","inspected_at":"2027-01-14T07:15:00Z","area_name":"Northeast Block
8","recorded_status":"down","recorded_at":null,"ambient_temp_c":6.5,"producing":true,"latest_status_note_text":"Shut
in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-017
1","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-07-17T18:00:00Z","inspection_id":
"INS-0171-0203","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspe
ction_producing":true,"inspector_name":"Ashley Bennett","area_id":"NE-08","wellhead_temp_c":37.4,"status_source":"insp
ection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","statu
s_now":"Producing oil","threshold_c":15.0,"lat":32.13098,"delta_c":27.2,"latest_status_note_id":"CTX-0173-001","decomm
issioned_on":null,"lon":-102.1511,"team_id":"TEAM-NE","team_name":"Northeast
Production","inspected_at":"2027-01-14T08:30:00Z","area_name":"Northeast Block 8","recorded_status":"active","recorded
_at":null,"ambient_temp_c":10.7,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0173","status_confirmed":true,"spill_e
st_volume_bbl":null,"latest_status_note_at":"2024-01-04T18:00:00Z","inspection_id":"INS-0173-0215","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Jessica Reed","area_id":"NE-08","wellhead_temp_c":37.9,"status_source":"inspection","method":"drone","notes":"","
unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":
15.0,"lat":32.17812,"delta_c":28.8,"latest_status_note_id":"CTX-0188-001","decommissioned_on":null,"lon":-102.1722,"te
am_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T11:15:00Z","area_name":"Northeast Block
8","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.8,"producing":true,"latest_status_note_text":"Shut
in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-018
8","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-09-10T18:00:00Z","inspection_id":
"INS-0188-0218","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspe
ction_producing":true,"inspector_name":"Tyler Hughes","area_id":"NE-08","wellhead_temp_c":38.6,"status_source":"inspec
tion","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_
now":"Producing oil","threshold_c":20.0,"lat":32.17295,"delta_c":36.0,"latest_status_note_id":"CTX-0191-001","decommis
sioned_on":null,"lon":-102.1724,"team_id":"TEAM-NE","team_name":"Northeast
Production","inspected_at":"2027-01-14T12:00:00Z","area_name":"Northeast Block
8","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.9,"producing":true,"latest_status_note_text":"Shut
in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-019
1","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-05-16T18:00:00Z","inspection_id":
"INS-0191-0218","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspe
ction_producing":true,"inspector_name":"Tyler Hughes","area_id":"NE-08","wellhead_temp_c":42.9,"status_source":"inspec
tion","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_
now":"Producing oil","threshold_c":15.0,"lat":32.1674,"delta_c":24.9,"latest_status_note_id":"CTX-0262-001","decommiss
ioned_on":null,"lon":-102.13836,"team_id":"TEAM-NE","team_name":"Northeast
Production","inspected_at":"2027-01-14T10:00:00Z","area_name":"Northeast Block 8","recorded_status":"active","recorded
_at":null,"ambient_temp_c":11.1,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0262","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2024-10-10T18:00:00Z","inspection_id":"INS-0262-0219","spill_detected"
:false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Tyler Hughes","area_id":"NE-08","wellhead_temp_c":36.0,"status_source":"inspection","method":"drone","notes":"
","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_
c":20.0,"lat":32.13155,"delta_c":36.1,"latest_status_note_id":"CTX-0266-001","decommissioned_on":null,"lon":-102.13575
,"team_id":"TEAM-NE","team_name":"Northeast Production","inspected_at":"2027-01-14T13:30:00Z","area_name":"Northeast
Block
8","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.6,"producing":true,"latest_status_note_text":"Shut
in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-026
6","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-02-23T18:00:00Z","inspection_id":
"INS-0266-0220","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspe
ction_producing":true,"inspector_name":"Ashley Bennett","area_id":"NE-08","wellhead_temp_c":44.7,"status_source":"insp
ection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","statu
s_now":"Producing oil","threshold_c":15.0,"lat":32.13736,"delta_c":27.0,"latest_status_note_id":"CTX-0294-001","decomm
issioned_on":null,"lon":-102.16861,"team_id":"TEAM-NE","team_name":"Northeast
Production","inspected_at":"2027-01-14T08:15:00Z","area_name":"Northeast Block 8","recorded_status":"active","recorded
_at":null,"ambient_temp_c":9.8,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0294","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2024-07-04T18:00:00Z","inspection_id":"INS-0294-0217","spill_detected"
:false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Jessica Reed","area_id":"NE-08","wellhead_temp_c":36.8,"status_source":"inspection","method":"drone","notes":"
","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_
c":15.0,"lat":32.24355,"delta_c":26.7,"latest_status_note_id":"CTX-0305-001","decommissioned_on":null,"lon":-102.61501
,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T09:45:00Z","area_name":"Northwest
Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":10.1,"producing":true,"latest_status_note_tex
t":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id"
:"WELL-0305","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-01-23T18:00:00Z","inspe
ction_id":"INS-0305-0216","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":t
rue,"inspection_producing":true,"inspector_name":"Brandon Shaw","area_id":"NW-12","wellhead_temp_c":36.8,"status_sourc
e":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T20
0","status_now":"Producing oil","threshold_c":15.0,"lat":32.18552,"delta_c":27.7,"latest_status_note_id":"CTX-0317-001
","decommissioned_on":null,"lon":-102.58896,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T14:15:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":5.0,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0317","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2024-12-12T18:00:00Z","inspection_id":"INS-0317-0216","spill_detected"
:false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Caleb Whitaker","area_id":"NW-12","wellhead_temp_c":32.7,"status_source":"inspection","method":"drone","notes"
:"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshol
d_c":15.0,"lat":32.22919,"delta_c":20.8,"latest_status_note_id":"CTX-0320-001","decommissioned_on":null,"lon":-102.606
33,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T15:30:00Z","area_name":"Northwest
Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.2,"producing":true,"latest_status_note_text

```
":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"
WELL-0320","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2022-11-24T18:00:00Z","inspect
ion_id":"INS-0320-0215","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":tru
e,"inspection_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":27.0,"status_source":
"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","insp
ection_well_type":"T200","status_now":"Not producing oil","threshold_c":15.0,"lat":32.23658,"delta_c":24.5,"latest_sta
tus_note_id":"CTX-0323-002","decommissioned_on":null,"lon":-102.59432,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T14:45:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":10.4,"producing":false,"latest_status_note_text":"Shut-in WELL-0323 after the pumper
reported a stuffing box leak.","well_type":"T200","asset_id":"WELL-0323","status_confirmed":true,"spill_est_volume_bbl
":null,"latest_status_note_at":"2027-01-14T19:20:00Z","inspection_id":"INS-0323-0219","spill_detected":false,"latest_s
tatus_note_author_user_id":"U-606","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Caleb Wh
itaker","area_id":"NW-12","wellhead_temp_c":34.9,"status_source":"operator_note","method":"drone","notes":"","unknown_
count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"la
t":32.19013,"delta_c":20.2,"latest_status_note_id":"CTX-0328-001","decommissioned_on":null,"lon":-102.64222,"team_id":
"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T07:00:00Z","area_name":"Northwest Block 12","r
ecorded_status":"active","recorded_at":null,"ambient_temp_c":4.0,"producing":true,"latest_status_note_text":"Shut in
by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0328",
"status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-04-11T18:00:00Z","inspection_id":"IN
S-0328-0217","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspecti
on_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":24.2,"status_source":"inspection
","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now"
:"Not producing oil","threshold_c":15.0,"lat":32.19106,"delta_c":4.4,"latest_status_note_id":"CTX-0330-002","decommiss
ioned_on":null,"lon":-102.61551,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T07:15:00Z","area_name":"Northwest Block 12","recorded_status":"down","recorded_
at":null,"ambient_temp_c":8.6,"producing":false,"latest_status_note_text":"WELL-0330 put back on production after the
repair crew finished.","well_type":"T200","asset_id":"WELL-0330","status_confirmed":true,"spill_est_volume_bbl":null,"
latest_status_note_at":"2026-12-19T06:00:00Z","inspection_id":"INS-0330-0213","spill_detected":false,"latest_status_no
te_author_user_id":"U-602","status_note_disagrees":true,"inspection_producing":false,"inspector_name":"Brandon
Shaw","area_id":"NW-12","wellhead_temp_c":13.0,"status_source":"inspection","method":"drone","notes":"No stroke
observed during flight.","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Not
producing oil","threshold_c":15.0,"lat":32.2338,"delta_c":0.5,"latest_status_note_id":"CTX-0332-003","decommissioned_o
n":null,"lon":-102.61928,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T14:45:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":10.4,"producing":false,"latest_status_note_text":"Restarted WELL-0332 after the crew
cleared the lockout.","well_type":"T200","asset_id":"WELL-0332","status_confirmed":true,"spill_est_volume_bbl":null,"l
atest_status_note_at":"2026-11-20T20:00:00Z","inspection_id":"INS-0332-0217","spill_detected":false,"latest_status_not
e_author_user_id":"U-602","status_note_disagrees":true,"inspection_producing":false,"inspector_name":"Caleb Whitaker",
"area_id":"NW-12","wellhead_temp_c":10.9,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{
"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.20715
,"delta_c":25.8,"latest_status_note_id":"CTX-0333-001","decommissioned_on":null,"lon":-102.60263,"team_id":"TEAM-NW","
team_name":"Northwest Production","inspected_at":"2027-01-14T11:15:00Z","area_name":"Northwest Block 12","recorded_sta
tus":"active","recorded_at":null,"ambient_temp_c":6.2,"producing":true,"latest_status_note_text":"Waiting on
replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0333","s
tatus_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-06-08T18:00:00Z","inspection_id":"INS-
0333-0219","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection
_producing":true,"inspector_name":"Caleb Whitaker","area_id":"NW-12","wellhead_temp_c":32.0,"status_source":"inspectio
n","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now
":"Producing oil","threshold_c":25.0,"lat":32.18603,"delta_c":37.5,"latest_status_note_id":"CTX-0334-001","decommissio
ned_on":null,"lon":-102.60632,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T11:30:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":6.6,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T500","asset_id":"WELL-0334","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2025-09-25T18:00:00Z","inspection_id":"INS-0334-0218","spill_detected"
:false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Caleb Whitaker","area_id":"NW-12","wellhead_temp_c":44.1,"status_source":"inspection","method":"drone","notes"
:"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshol
d_c":20.0,"lat":32.22164,"delta_c":23.9,"latest_status_note_id":"CTX-0340-001","decommissioned_on":null,"lon":-102.639
49,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T10:30:00Z","area_name":"Northwest
Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.1,"producing":true,"latest_status_note_text
":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"
WELL-0340","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-05-07T18:00:00Z","inspect
ion_id":"INS-0340-0218","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":tru
e,"inspection_producing":true,"inspector_name":"Caleb Whitaker","area_id":"NW-12","wellhead_temp_c":32.0,"status_sourc
e":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T20
0","status_now":"Producing oil","threshold_c":15.0,"lat":32.20412,"delta_c":23.0,"latest_status_note_id":"CTX-0341-001
","decommissioned_on":null,"lon":-102.64458,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T13:30:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":10.4,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0341","status_confirmed":true,"spill_e
st_volume_bbl":null,"latest_status_note_at":"2025-06-19T18:00:00Z","inspection_id":"INS-0341-0113","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Caleb Whitaker","area_id":"NW-12","wellhead_temp_c":33.4,"status_source":"inspection","method":"drone","notes":""
,"unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c
":15.0,"lat":32.21907,"delta_c":24.5,"latest_status_note_id":"CTX-0354-001","decommissioned_on":null,"lon":-102.62068,
"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-07T09:45:00Z","area_name":"Northwest
Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.9,"producing":true,"latest_status_note_text
":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":
"WELL-0354","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-01-26T18:00:00Z","inspec
tion_id":"INS-0354-0217","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":tr
ue,"inspection_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":32.4,"status_source"
:"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","ins
pection_well_type":"T200","status_now":"Not producing oil","threshold_c":15.0,"lat":32.20716,"delta_c":31.1,"latest_st
atus_note_id":"CTX-0355-004","decommissioned_on":null,"lon":-102.62719,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T15:15:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
```

d_at":null,"ambient_temp_c":7.9,"producing":false,"latest_status_note_text":"Found WELL-0355 leaking at the stuffing box, shut the well in.","well_type":"T200","asset_id":"WELL-0355","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-14T19:05:00Z","inspection_id":"INS-0355-0213","spill_detected":false,"latest_status_note_author_user_id":"U-606","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Brandon Shaw","area_id":"NW-12","wellhead_temp_c":39.0,"status_source":"operator_note","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.19549,"delta_c":21.1,"latest_status_note_id":"CTX-0357-002","decommissioned_on":null,"lon":-102.58969,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T14:15:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":11.6,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0357","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-12-19T18:00:00Z","inspection_id":"INS-0357-0217","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":32.7,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.2415,"delta_c":31.6,"latest_status_note_id":"CTX-0359-001","decommissioned_on":null,"lon":-102.64207,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T15:45:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0359","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-09-19T18:00:00Z","inspection_id":"INS-0359-0216","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Brandon Shaw","area_id":"NW-12","wellhead_temp_c":40.0,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c":25.0,"lat":32.23757,"delta_c":37.5,"latest_status_note_id":"CTX-0360-002","decommissioned_on":null,"lon":-102.62741,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T11:00:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.6,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T500","asset_id":"WELL-0360","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-09-03T18:00:00Z","inspection_id":"INS-0360-0215","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":44.1,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c":25.0,"lat":32.23591,"delta_c":36.8,"latest_status_note_id":"CTX-0370-002","decommissioned_on":null,"lon":-102.59087,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T09:00:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":11.7,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T500","asset_id":"WELL-0370","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-05-07T18:00:00Z","inspection_id":"INS-0370-0215","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":48.5,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c":25.0,"lat":32.22659,"delta_c":35.9,"latest_status_note_id":"CTX-0382-002","decommissioned_on":null,"lon":-102.59896,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T11:45:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.3,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T500","asset_id":"WELL-0382","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-10-24T18:00:00Z","inspection_id":"INS-0382-0216","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":41.2,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.21839,"delta_c":25.2,"latest_status_note_id":"CTX-0394-001","decommissioned_on":null,"lon":-102.60404,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T07:00:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.7,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0394","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-02-01T18:00:00Z","inspection_id":"INS-0394-0221","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":33.9,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.22987,"delta_c":23.7,"latest_status_note_id":"CTX-0399-001","decommissioned_on":null,"lon":-102.63784,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T11:15:00Z","area_name":"Northwest Block 12","recorded_status":"down","recorded_at":null,"ambient_temp_c":7.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0399","status_confirmed":true,"spill_est_volume_bbl":0.9,"latest_status_note_at":"2025-10-16T18:00:00Z","inspection_id":"INS-0399-0217","spill_detected":true,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Brandon Shaw","area_id":"NW-12","wellhead_temp_c":31.1,"status_source":"inspection","method":"drone","notes":"Oil sheen around cellar.","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.2323,"delta_c":28.1,"latest_status_note_id":"CTX-0406-001","decommissioned_on":null,"lon":-102.61222,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T10:30:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.5,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0406","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-02-09T18:00:00Z","inspection_id":"INS-0406-0216","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Brandon Shaw","area_id":"NW-12","wellhead_temp_c":37.6,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.19563,"delta_c":20.1,"latest_status_note_id":"CTX-0416-001","decommissioned_on":null,"lon":-102.60521,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T09:45:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.0,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0416","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2022-10-27T18:00:00Z","inspection_id":"INS-0416-0214","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Caleb Whitaker","area_id":"NW-12","wellhead_temp_c":25.1,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":32.20636,"delta_c":28.2,"latest_status_note_id":"CTX-0419-001","decommissioned_on":null,"lon":-102.62502,"team_id":"TEAM-NW","team_name":"Northwest

```
Production","inspected_at":"2027-01-14T07:30:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":8.5,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0419","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2024-03-21T18:00:00Z","inspection_id":"INS-0419-0216","spill_detected"
:false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Brandon Shaw","area_id":"NW-12","wellhead_temp_c":36.7,"status_source":"inspection","method":"drone","notes":"
","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","inspection_well_type":"T350","status_now":"
Not producing oil","threshold_c":20.0,"lat":32.23071,"delta_c":27.7,"latest_status_note_id":"CTX-0422-003","decommissi
oned_on":null,"lon":-102.62814,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T15:15:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":7.4,"producing":false,"latest_status_note_text":"Shut in WELL-0422 for the night, high
pressure alarm on the separator.","well_type":"T350","asset_id":"WELL-0422","status_confirmed":true,"spill_est_volume_
bbl":null,"latest_status_note_at":"2027-01-14T21:35:00Z","inspection_id":"INS-0422-0215","spill_detected":false,"lates
t_status_note_author_user_id":"U-606","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Caleb
Whitaker","area_id":"NW-12","wellhead_temp_c":35.1,"status_source":"operator_note","method":"drone","notes":"","unknow
n_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Not producing oil","threshold_c":20
.0,"lat":32.20951,"delta_c":6.2,"latest_status_note_id":"CTX-0429-004","decommissioned_on":null,"lon":-102.64638,"team
_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T11:15:00Z","area_name":"Northwest Block 1
2","recorded_status":"active","recorded_at":null,"ambient_temp_c":11.8,"producing":false,"latest_status_note_text":"Re
started WELL-0429 after the crew cleared the lockout.","well_type":"T350","asset_id":"WELL-0429","status_confirmed":tr
ue,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-11-14T05:30:00Z","inspection_id":"INS-0429-0219","spill_d
etected":false,"latest_status_note_author_user_id":"U-605","status_note_disagrees":true,"inspection_producing":false,"
inspector_name":"Brandon
Shaw","area_id":"NW-12","wellhead_temp_c":18.0,"status_source":"inspection","method":"drone","notes":"No stroke
observed during
flight.","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","thr
eshold_c":15.0,"lat":32.22268,"delta_c":22.4,"latest_status_note_id":"CTX-0431-001","decommissioned_on":null,"lon":-10
2.61998,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T15:00:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":10.5,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0431","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2024-01-11T18:00:00Z","inspection_id":"INS-0431-0215","spill_detected"
:false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Brandon Shaw","area_id":"NW-12","wellhead_temp_c":32.9,"status_source":"inspection","method":"drone","notes":"
","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_
c":15.0,"lat":32.20253,"delta_c":27.8,"latest_status_note_id":"CTX-0433-002","decommissioned_on":null,"lon":-102.61805
,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T12:15:00Z","area_name":"Northwest
Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.5,"producing":true,"latest_status_note_text
":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":
"WELL-0433","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-10-09T18:00:00Z","inspec
tion_id":"INS-0433-0219","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":tr
ue,"inspection_producing":true,"inspector_name":"Rachel Dunn","area_id":"NW-12","wellhead_temp_c":35.3,"status_source"
:"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200",
"status_now":"Producing oil","threshold_c":15.0,"lat":32.23609,"delta_c":24.9,"latest_status_note_id":"CTX-0437-001","
decommissioned_on":null,"lon":-102.64226,"team_id":"TEAM-NW","team_name":"Northwest
Production","inspected_at":"2027-01-14T13:15:00Z","area_name":"Northwest Block 12","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":6.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0437","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2025-06-19T18:00:00Z","inspection_id":"INS-0437-0217","spill_detected"
:false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Caleb Whitaker","area_id":"NW-12","wellhead_temp_c":31.3,"status_source":"inspection","method":"drone","notes"
:"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshol
d_c":20.0,"lat":32.20859,"delta_c":35.7,"latest_status_note_id":"CTX-0447-002","decommissioned_on":null,"lon":-102.595
06,"team_id":"TEAM-NW","team_name":"Northwest Production","inspected_at":"2027-01-14T11:15:00Z","area_name":"Northwest
Block 12","recorded_status":"active","recorded_at":null,"ambient_temp_c":4.1,"producing":true,"latest_status_note_text
":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":
"WELL-0447","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-03-27T18:00:00Z","inspec
tion_id":"INS-0447-0218","spill_detected":false,"latest_status_note_author_user_id":"U-601","status_note_disagrees":tr
ue,"inspection_producing":true,"inspector_name":"Brandon Shaw","area_id":"NW-12","wellhead_temp_c":39.8,"status_source
":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200"
,"status_now":"Producing oil","threshold_c":15.0,"lat":31.69237,"delta_c":30.8,"latest_status_note_id":"CTX-0218-001",
"decommissioned_on":null,"lon":-102.34527,"team_id":"TEAM-SE","team_name":"Southeast
Production","inspected_at":"2027-01-14T07:15:00Z","area_name":"Southeast Block 31","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":11.8,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0218","status_confirmed":true,"spill_e
st_volume_bbl":null,"latest_status_note_at":"2026-01-22T18:00:00Z","inspection_id":"INS-0218-0218","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Diego Ramirez","area_id":"SE-31","wellhead_temp_c":42.6,"status_source":"inspection","method":"drone","notes":"",
"unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Not producing oil","threshol
d_c":25.0,"lat":31.71993,"delta_c":4.5,"latest_status_note_id":"CTX-0219-006","decommissioned_on":null,"lon":-102.3034
9,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T08:45:00Z","area_name":"Southeast
Block 31","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.6,"producing":false,"latest_status_note_tex
t":"WELL-0219 drive tripping on underload, restarted from the panel.","well_type":"T500","asset_id":"WELL-0219","statu
s_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-05T09:55:00Z","inspection_id":"INS-0219
-0171","spill_detected":false,"latest_status_note_author_user_id":"U-505","status_note_disagrees":true,"inspection_pro
ducing":false,"inspector_name":"Marcus
Lee","area_id":"SE-31","wellhead_temp_c":13.1,"status_source":"inspection","method":"manual","notes":"No flow noise at
the wellhead.","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil
","threshold_c":25.0,"lat":31.69017,"delta_c":36.2,"latest_status_note_id":"CTX-0226-001","decommissioned_on":null,"lo
n":-102.33106,"team_id":"TEAM-SE","team_name":"Southeast
Production","inspected_at":"2027-01-14T15:15:00Z","area_name":"Southeast Block 31","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":8.9,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T500","asset_id":"WELL-0226","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2026-03-05T18:00:00Z","inspection_id":"INS-0226-0216","spill_detected"
:false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector
```

_name":"Hannah Brooks","area_id":"SE-31","wellhead_temp_c":45.1,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.67734,"delta_c":36.4,"latest_status_note_id":"CTX-0240-001","decommissioned_on":null,"lon":-102.29284,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T08:00:00Z","area_name":"Southeast Block 31","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.4,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0240","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-10-02T18:00:00Z","inspection_id":"INS-0240-0218","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SE-31","wellhead_temp_c":44.8,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c":25.0,"lat":31.68064,"delta_c":36.8,"latest_status_note_id":"CTX-0241-001","decommissioned_on":null,"lon":-102.32985,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T12:30:00Z","area_name":"Southeast Block 31","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.6,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T500","asset_id":"WELL-0241","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-06-04T18:00:00Z","inspection_id":"INS-0241-0215","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SE-31","wellhead_temp_c":46.4,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Not producing oil","threshold_c":25.0,"lat":31.73474,"delta_c":5.9,"latest_status_note_id":"CTX-0249-004","decommissioned_on":null,"lon":-102.29981,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T12:00:00Z","area_name":"Southeast Block 31","recorded_status":"active","recorded_at":null,"ambient_temp_c":10.2,"producing":false,"latest_status_note_text":"WELL-0249 drive tripping on underload, restarted from the panel.","well_type":"T500","asset_id":"WELL-0249","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-13T09:40:00Z","inspection_id":"INS-0249-0120","spill_detected":false,"latest_status_note_author_user_id":"U-502","status_note_disagrees":true,"inspection_producing":false,"inspector_name":"Marcus Lee","area_id":"SE-31","wellhead_temp_c":16.1,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Not producing oil","threshold_c":20.0,"lat":31.6431,"delta_c":3.1,"latest_status_note_id":"CTX-0452-005","decommissioned_on":null,"lon":-102.27868,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T11:15:00Z","area_name":"Southeast Block 32","recorded_status":"down","recorded_at":null,"ambient_temp_c":7.8,"producing":false,"latest_status_note_text":"Restarted WELL-0452, unit running smooth.","well_type":"T350","asset_id":"WELL-0452","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-12-15T01:00:00Z","inspection_id":"INS-0452-0219","spill_detected":false,"latest_status_note_author_user_id":"U-506","status_note_disagrees":true,"inspection_producing":false,"inspector_name":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":10.9,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.64632,"delta_c":31.1,"latest_status_note_id":"CTX-0455-001","decommissioned_on":null,"lon":-102.27084,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T14:30:00Z","area_name":"Southeast Block 32","recorded_status":"down","recorded_at":null,"ambient_temp_c":9.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0455","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-04-17T18:00:00Z","inspection_id":"INS-0455-0110","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":40.5,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.66133,"delta_c":27.1,"latest_status_note_id":"CTX-0457-001","decommissioned_on":null,"lon":-102.29072,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T08:00:00Z","area_name":"Southeast Block 32","recorded_status":"down","recorded_at":null,"ambient_temp_c":10.2,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0457","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-07-17T18:00:00Z","inspection_id":"INS-0457-0218","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":37.3,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.65561,"delta_c":29.1,"latest_status_note_id":"CTX-0459-001","decommissioned_on":null,"lon":-102.29247,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T10:30:00Z","area_name":"Southeast Block 32","recorded_status":"down","recorded_at":null,"ambient_temp_c":7.9,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0459","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2022-12-29T18:00:00Z","inspection_id":"INS-0459-0219","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":37.0,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.65584,"delta_c":30.9,"latest_status_note_id":"CTX-0461-001","decommissioned_on":null,"lon":-102.24573,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T10:45:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.6,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0461","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-01-29T18:00:00Z","inspection_id":"INS-0461-0219","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":37.5,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c":25.0,"lat":31.65506,"delta_c":36.8,"latest_status_note_id":"CTX-0463-001","decommissioned_on":null,"lon":-102.28356,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T14:30:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.6,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T500","asset_id":"WELL-0463","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-07-16T18:00:00Z","inspection_id":"INS-0463-0184","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":44.4,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c":25.0,"lat":31.67933,"delta_c":36.4,"latest_status_note_id":"CTX-0464-001","decommissioned_on":null,"lon":-102.27462,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T15:00:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.8,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T500","asset_id":"WELL-0464","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-09-17T18:00:00Z","inspection_id":"INS-0464-0216","spill_detected":fa

lse,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":42.2,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.63631,"delta_c":30.6,"latest_status_note_id":"CTX-0466-001","decommissioned_on":null,"lon":-102.28352,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T13:00:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.7,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0466","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-05-14T18:00:00Z","inspection_id":"INS-0466-0218","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":37.3,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.68517,"delta_c":29.2,"latest_status_note_id":"CTX-0477-002","decommissioned_on":null,"lon":-102.30084,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T12:15:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.8,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0477","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-06-12T18:00:00Z","inspection_id":"INS-0477-0197","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":38.0,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","inspection_well_type":"T200","status_now":"Not producing oil","threshold_c":15.0,"lat":31.647,"delta_c":23.6,"latest_status_note_id":"CTX-0479-004","decommissioned_on":null,"lon":-102.2615,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T11:45:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.1,"producing":false,"latest_status_note_text":"Found WELL-0479 leaking at the stuffing box, shut the well in.","well_type":"T200","asset_id":"WELL-0479","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-14T15:35:00Z","inspection_id":"INS-0479-0213","spill_detected":false,"latest_status_note_author_user_id":"U-505","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":31.7,"status_source":"operator_note","method":"drone","notes":"","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","inspection_well_type":"T200","status_now":"Not producing oil","threshold_c":15.0,"lat":31.67271,"delta_c":22.4,"latest_status_note_id":"CTX-0481-006","decommissioned_on":null,"lon":-102.28807,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T14:30:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":4.8,"producing":false,"latest_status_note_text":"Shut in WELL-0481 for the night, high pressure alarm on the separator.","well_type":"T200","asset_id":"WELL-0481","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-14T18:50:00Z","inspection_id":"INS-0481-0220","spill_detected":false,"latest_status_note_author_user_id":"U-506","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":27.2,"status_source":"operator_note","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c":25.0,"lat":31.68285,"delta_c":36.3,"latest_status_note_id":"CTX-0495-001","decommissioned_on":null,"lon":-102.29225,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T14:00:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.5,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T500","asset_id":"WELL-0495","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-10-17T18:00:00Z","inspection_id":"INS-0495-0217","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":42.8,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.6479,"delta_c":32.2,"latest_status_note_id":"CTX-0502-002","decommissioned_on":null,"lon":-102.27855,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T11:45:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.5,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0502","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-10-03T18:00:00Z","inspection_id":"INS-0502-0219","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":39.7,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.6348,"delta_c":25.1,"latest_status_note_id":"CTX-0505-001","decommissioned_on":null,"lon":-102.25869,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T13:45:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":11.3,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0505","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-08-28T18:00:00Z","inspection_id":"INS-0505-0220","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":36.4,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.6644,"delta_c":36.4,"latest_status_note_id":"CTX-0510-002","decommissioned_on":null,"lon":-102.2921,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T13:30:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":4.6,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0510","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-05-07T18:00:00Z","inspection_id":"INS-0510-0221","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":41.0,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.6707,"delta_c":25.1,"latest_status_note_id":"CTX-0512-001","decommissioned_on":null,"lon":-102.24611,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T08:15:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.7,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0512","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2022-10-27T18:00:00Z","inspection_id":"INS-0512-0221","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":32.8,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.68076,"delta_c":19.3,"latest_status_note_id":"CTX-0523-001","decommissioned_on":null,"lon":-102.25921,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T14:30:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":4.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0523","status_confirmed":true,"spil

l_est_volume_bbl":null,"latest_status_note_at":"2025-02-06T18:00:00Z","inspection_id":"INS-0523-0101","spill_detected"
:false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":23.7,"status_source":"inspection","method":"drone","notes":"",
"unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c"
:20.0,"lat":31.65252,"delta_c":33.7,"latest_status_note_id":"CTX-0525-001","decommissioned_on":null,"lon":-102.29316,"
team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T07:45:00Z","area_name":"Southeast
Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.8,"producing":true,"latest_status_note_text
":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":
"WELL-0525","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-03-20T18:00:00Z","inspec
tion_id":"INS-0525-0217","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":tr
ue,"inspection_producing":true,"inspector_name":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":42.5,"status_sourc
e":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500
","status_now":"Producing oil","threshold_c":25.0,"lat":31.66185,"delta_c":35.9,"latest_status_note_id":"CTX-0531-001"
,"decommissioned_on":null,"lon":-102.29538,"team_id":"TEAM-SE","team_name":"Southeast
Production","inspected_at":"2027-01-14T11:30:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":4.8,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T500","asset_id":"WELL-0531","status_confirmed":true,"spill_e
st_volume_bbl":null,"latest_status_note_at":"2026-07-02T18:00:00Z","inspection_id":"INS-0531-0219","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":40.7,"status_source":"inspection","method":"drone","notes":"",
"unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c"
:15.0,"lat":31.64559,"delta_c":19.8,"latest_status_note_id":"CTX-0536-001","decommissioned_on":null,"lon":-102.28458,"
team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T09:15:00Z","area_name":"Southeast
Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.2,"producing":true,"latest_status_note_text
":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"
WELL-0536","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-08-29T18:00:00Z","inspect
ion_id":"INS-0536-0218","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":tru
e,"inspection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":28.0,"status_source
":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200"
,"status_now":"Producing oil","threshold_c":15.0,"lat":31.63249,"delta_c":28.6,"latest_status_note_id":"CTX-0541-001",
"decommissioned_on":null,"lon":-102.29851,"team_id":"TEAM-SE","team_name":"Southeast
Production","inspected_at":"2027-01-14T09:00:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":7.5,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0541","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2025-09-18T18:00:00Z","inspection_id":"INS-0541-0218","spill_detected"
:false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":36.1,"status_source":"inspection","method":"drone","notes":
"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold
_c":15.0,"lat":31.68163,"delta_c":32.8,"latest_status_note_id":"CTX-0551-001","decommissioned_on":null,"lon":-102.2715
,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T07:00:00Z","area_name":"Southeast
Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.4,"producing":true,"latest_status_note_text
":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"
WELL-0551","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-01-09T18:00:00Z","inspect
ion_id":"INS-0551-0221","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":tru
e,"inspection_producing":true,"inspector_name":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":39.2,"status_source
":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350
","status_now":"Producing oil","threshold_c":20.0,"lat":31.63443,"delta_c":29.8,"latest_status_note_id":"CTX-0554-001"
,"decommissioned_on":null,"lon":-102.26664,"team_id":"TEAM-SE","team_name":"Southeast
Production","inspected_at":"2027-01-14T09:45:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":7.4,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0554","status_confirmed":true,"spill_e
st_volume_bbl":null,"latest_status_note_at":"2023-04-27T18:00:00Z","inspection_id":"INS-0554-0218","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":37.2,"status_source":"inspection","method":"drone","notes":"",
"unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c"
:25.0,"lat":31.68053,"delta_c":36.6,"latest_status_note_id":"CTX-0556-001","decommissioned_on":null,"lon":-102.29431,"
team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T09:00:00Z","area_name":"Southeast
Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.5,"producing":true,"latest_status_note_text
":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T500","asset_id":
"WELL-0556","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-11-16T18:00:00Z","inspec
tion_id":"INS-0556-0218","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":tr
ue,"inspection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":43.1,"status_sourc
e":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T35
0","status_now":"Producing oil","threshold_c":20.0,"lat":31.68338,"delta_c":26.9,"latest_status_note_id":"CTX-0565-001
","decommissioned_on":null,"lon":-102.26507,"team_id":"TEAM-SE","team_name":"Southeast
Production","inspected_at":"2027-01-14T08:00:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":5.2,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0565","status_confirmed":true,"spill_e
st_volume_bbl":null,"latest_status_note_at":"2025-07-31T18:00:00Z","inspection_id":"INS-0565-0160","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Diego Ramirez","area_id":"SE-32","wellhead_temp_c":32.1,"status_source":"inspection","method":"drone","notes":"",
"unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c"
:20.0,"lat":31.64887,"delta_c":37.2,"latest_status_note_id":"CTX-0571-001","decommissioned_on":null,"lon":-102.26499,"
team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T13:00:00Z","area_name":"Southeast
Block 32","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.9,"producing":true,"latest_status_note_text
":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":
"WELL-0571","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-01-09T18:00:00Z","inspec
tion_id":"INS-0571-0218","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":tr
ue,"inspection_producing":true,"inspector_name":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":46.1,"status_source":
"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","
status_now":"Producing oil","threshold_c":20.0,"lat":31.65583,"delta_c":27.4,"latest_status_note_id":"CTX-0575-002","d
ecommissioned_on":null,"lon":-102.24404,"team_id":"TEAM-SE","team_name":"Southeast
Production","inspected_at":"2027-01-14T10:30:00Z","area_name":"Southeast Block 32","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":5.6,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0575","status_confirmed":true,"spill_e

st_volume_bbl":null,"latest_status_note_at":"2026-01-22T18:00:00Z","inspection_id":"INS-0575-0219","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Marcus Lee","area_id":"SE-32","wellhead_temp_c":33.0,"status_source":"inspection","method":"drone","notes":"","un
known_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20
.0,"lat":31.65518,"delta_c":26.4,"latest_status_note_id":"CTX-0600-001","decommissioned_on":null,"lon":-102.2683,"team
_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-07T07:00:00Z","area_name":"Southeast Block 3
2","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.0,"producing":true,"latest_status_note_text":"Wait
ing on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0
600","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-03-06T18:00:00Z","inspection_id
":"INS-0600-0184","spill_detected":false,"latest_status_note_author_user_id":"U-501","status_note_disagrees":true,"ins
pection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SE-32","wellhead_temp_c":31.4,"status_source":"ins
pection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","stat
us_now":"Producing oil","threshold_c":15.0,"lat":31.85919,"delta_c":27.4,"latest_status_note_id":"CTX-0008-002","decom
missioned_on":null,"lon":-102.53044,"team_id":"TEAM-SW","team_name":"Southwest
Production","inspected_at":"2027-01-14T14:00:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":8.2,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0008","status_confirmed":true,"spill_e
st_volume_bbl":null,"latest_status_note_at":"2024-07-04T18:00:00Z","inspection_id":"INS-0008-0218","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":35.6,"status_source":"inspection","method":"drone","notes":""
,"unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Not producing oil","thresho
ld_c":20.0,"lat":31.8572,"delta_c":17.5,"latest_status_note_id":"CTX-0010-004","decommissioned_on":null,"lon":-102.521
12,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T14:00:00Z","area_name":"Southwest
Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":10.2,"producing":false,"latest_status_note_te
xt":"Restarted WELL-0010 after the crew cleared the lockout.","well_type":"T350","asset_id":"WELL-0010","status_confir
med":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-09T04:00:00Z","inspection_id":"INS-0010-0219","
spill_detected":false,"latest_status_note_author_user_id":"U-103","status_note_disagrees":true,"inspection_producing":
false,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":27.7,"status_source":"inspection","method"
:"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producin
g oil","threshold_c":15.0,"lat":31.86234,"delta_c":26.7,"latest_status_note_id":"CTX-0015-001","decommissioned_on":nul
l,"lon":-102.50255,"team_id":"TEAM-SW","team_name":"Southwest
Production","inspected_at":"2027-01-14T10:30:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":5.9,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0015","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2023-12-14T18:00:00Z","inspection_id":"INS-0015-0219","spill_detected"
:false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Ryan Brooks","area_id":"SW-23","wellhead_temp_c":32.6,"status_source":"inspection","method":"drone","notes":""
,"unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c
":20.0,"lat":31.84718,"delta_c":30.3,"latest_status_note_id":"CTX-0017-001","decommissioned_on":null,"lon":-102.49253,
"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T12:30:00Z","area_name":"Southwest
Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.9,"producing":true,"latest_status_note_text
":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":
"WELL-0017","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-12-28T18:00:00Z","inspec
tion_id":"INS-0017-0219","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":tr
ue,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":39.2,"status_sour
ce":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T20
0","status_now":"Producing oil","threshold_c":15.0,"lat":31.8571,"delta_c":18.7,"latest_status_note_id":"CTX-0018-002"
,"decommissioned_on":null,"lon":-102.52826,"team_id":"TEAM-SW","team_name":"Southwest
Production","inspected_at":"2027-01-14T12:00:00Z","area_name":"Southwest Block 23","recorded_status":"down","recorded_
at":null,"ambient_temp_c":10.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the
vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0018","status_confirmed":true,"spil
l_est_volume_bbl":null,"latest_status_note_at":"2024-05-23T18:00:00Z","inspection_id":"INS-0018-0219","spill_detected"
:false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector
_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":29.1,"status_source":"inspection","method":"drone","notes"
:"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshol
d_c":15.0,"lat":31.86334,"delta_c":31.1,"latest_status_note_id":"CTX-0022-001","decommissioned_on":null,"lon":-102.533
77,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T15:15:00Z","area_name":"Southwest
Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":10.2,"producing":true,"latest_status_note_tex
t":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id"
:"WELL-0022","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-07-17T18:00:00Z","inspe
ction_id":"INS-0022-0210","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":t
rue,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":41.3,"status_sou
rce":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e",
"inspection_well_type":"T200","status_now":"Producing oil (unconfirmed)","threshold_c":15.0,"lat":31.85964,"delta_c":5
.4,"latest_status_note_id":"CTX-0026-001","decommissioned_on":null,"lon":-102.51631,"team_id":"TEAM-SW","team_name":"S
outhwest Production","inspected_at":"2027-01-14T12:15:00Z","area_name":"Southwest Block 23","recorded_status":"down","
recorded_at":null,"ambient_temp_c":5.2,"producing":true,"latest_status_note_text":"WELL-0026 put back on production
after the repair crew finished.","well_type":"T200","asset_id":"WELL-0026","status_confirmed":false,"spill_est_volume_
bbl":null,"latest_status_note_at":"2027-01-15T10:25:00Z","inspection_id":"INS-0026-0216","spill_detected":false,"lates
t_status_note_author_user_id":"U-102","status_note_disagrees":true,"inspection_producing":false,"inspector_name":"Sara
h Mitchell","area_id":"SW-23","wellhead_temp_c":10.6,"status_source":"operator_note","method":"drone","notes":"Pump
jack not moving.","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing
oil","threshold_c":20.0,"lat":31.83236,"delta_c":29.2,"latest_status_note_id":"CTX-0028-001","decommissioned_on":null,
"lon":-102.49654,"team_id":"TEAM-SW","team_name":"Southwest
Production","inspected_at":"2027-01-14T13:45:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorde
d_at":null,"ambient_temp_c":11.5,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby
pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0028","status_confirmed":true,"spill_e
st_volume_bbl":null,"latest_status_note_at":"2024-12-05T18:00:00Z","inspection_id":"INS-0028-0217","spill_detected":fa
lse,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_na
me":"Jake Morales","area_id":"SW-23","wellhead_temp_c":40.7,"status_source":"inspection","method":"drone","notes":"","
unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":
15.0,"lat":31.8705,"delta_c":19.5,"latest_status_note_id":"CTX-0031-001","decommissioned_on":null,"lon":-102.50768,"te
am_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T15:00:00Z","area_name":"Southwest Block
23","recorded_status":"down","recorded_at":null,"ambient_temp_c":11.0,"producing":true,"latest_status_note_text":"Shut
in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-003

1","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-02-01T18:00:00Z","inspection_id":"INS-0031-0215","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ryan Brooks","area_id":"SW-23","wellhead_temp_c":30.5,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","inspection_well_type":"T350","status_now":"Producing oil (unconfirmed)","threshold_c":20.0,"lat":31.84827,"delta_c":7.4,"latest_status_note_id":"CTX-0032-006","decommissioned_on":null,"lon":-102.488,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T08:30:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":12.0,"producing":true,"latest_status_note_text":"Brought WELL-0032 back online after the pump change.","well_type":"T350","asset_id":"WELL-0032","status_confirmed":false,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-15T10:25:00Z","inspection_id":"INS-0032-0219","spill_detected":false,"latest_status_note_author_user_id":"U-102","status_note_disagrees":true,"inspection_producing":false,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":19.4,"status_source":"operator_note","method":"drone","notes":"Wellhead cold to touch.","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","inspection_well_type":"T350","status_now":"Producing oil (unconfirmed)","threshold_c":20.0,"lat":31.86439,"delta_c":10.0,"latest_status_note_id":"CTX-0033-003","decommissioned_on":null,"lon":-102.52511,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T14:45:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.2,"producing":true,"latest_status_note_text":"Restarted WELL-0033, unit running smooth.","well_type":"T350","asset_id":"WELL-0033","status_confirmed":false,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-15T10:25:00Z","inspection_id":"INS-0033-0222","spill_detected":false,"latest_status_note_author_user_id":"U-102","status_note_disagrees":true,"inspection_producing":false,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":16.2,"status_source":"operator_note","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.86832,"delta_c":28.2,"latest_status_note_id":"CTX-0035-001","decommissioned_on":null,"lon":-102.51226,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T14:30:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.6,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0035","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-03-07T18:00:00Z","inspection_id":"INS-0035-0218","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jake Morales","area_id":"SW-23","wellhead_temp_c":37.8,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","inspection_well_type":"T200","status_now":"Not producing oil","threshold_c":15.0,"lat":31.8195,"delta_c":23.7,"latest_status_note_id":"CTX-0044-008","decommissioned_on":null,"lon":-102.50695,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T07:30:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.0,"producing":false,"latest_status_note_text":"Shut in WELL-0044 at the wellhead, flowline leak suspected.","well_type":"T200","asset_id":"WELL-0044","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-14T13:05:00Z","inspection_id":"INS-0044-0218","spill_detected":false,"latest_status_note_author_user_id":"U-104","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ryan Brooks","area_id":"SW-23","wellhead_temp_c":30.7,"status_source":"operator_note","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.85808,"delta_c":25.8,"latest_status_note_id":"CTX-0045-002","decommissioned_on":null,"lon":-102.52834,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T12:00:00Z","area_name":"Southwest Block 23","recorded_status":"down","recorded_at":null,"ambient_temp_c":4.3,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0045","status_confirmed":true,"spill_est_volume_bbl":0.3,"latest_status_note_at":"2026-02-12T18:00:00Z","inspection_id":"INS-0045-0214","spill_detected":true,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":30.1,"status_source":"inspection","method":"drone","notes":"Staining along flowline route.","unknown_count":0},{"status_rule_source":"src_148067724bdb724664aecc6e","inspection_well_type":"T200","status_now":"Producing oil (unconfirmed)","threshold_c":15.0,"lat":31.86347,"delta_c":2.1,"latest_status_note_id":"CTX-0046-004","decommissioned_on":null,"lon":-102.51244,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T13:00:00Z","area_name":"Southwest Block 23","recorded_status":"down","recorded_at":null,"ambient_temp_c":6.8,"producing":true,"latest_status_note_text":"WELL-0046 put back on production after the repair crew finished.","well_type":"T200","asset_id":"WELL-0046","status_confirmed":false,"spill_est_volume_bbl":null,"latest_status_note_at":"2027-01-15T10:25:00Z","inspection_id":"INS-0046-0220","spill_detected":false,"latest_status_note_author_user_id":"U-102","status_note_disagrees":true,"inspection_producing":false,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":8.9,"status_source":"operator_note","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.82304,"delta_c":30.3,"latest_status_note_id":"CTX-0047-001","decommissioned_on":null,"lon":-102.54018,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T13:00:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.2,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0047","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-06-20T18:00:00Z","inspection_id":"INS-0047-0215","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":37.5,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.83471,"delta_c":28.2,"latest_status_note_id":"CTX-0049-001","decommissioned_on":null,"lon":-102.5262,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T12:30:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0049","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-04-27T18:00:00Z","inspection_id":"INS-0049-0218","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":34.6,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.81422,"delta_c":29.9,"latest_status_note_id":"CTX-0267-001","decommissioned_on":null,"lon":-102.51756,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T15:45:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":10.8,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0267","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2022-12-08T18:00:00Z","inspection_id":"INS-0267-0218","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":40.7,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.83609,"delta_c":31.2,"latest_status_note_id":"CTX-0271-001","decommissioned_on":null,"lon":-102.49942,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T07:00:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorde

d_at":null,"ambient_temp_c":7.5,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0271","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-02-09T18:00:00Z","inspection_id":"INS-0271-0217","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-23","wellhead_temp_c":38.7,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T500","status_now":"Producing oil","threshold_c":25.0,"lat":31.8336,"delta_c":36.3,"latest_status_note_id":"CTX-0279-002","decommissioned_on":null,"lon":-102.53547,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T13:30:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.9,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T500","asset_id":"WELL-0279","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-04-16T18:00:00Z","inspection_id":"INS-0279-0217","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ryan Brooks","area_id":"SW-23","wellhead_temp_c":42.2,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.81464,"delta_c":24.3,"latest_status_note_id":"CTX-0295-002","decommissioned_on":null,"lon":-102.50267,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T13:45:00Z","area_name":"Southwest Block 23","recorded_status":"active","recorded_at":null,"ambient_temp_c":4.8,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0295","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-10-24T18:00:00Z","inspection_id":"INS-0295-0215","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ryan Brooks","area_id":"SW-23","wellhead_temp_c":29.1,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.82086,"delta_c":24.1,"latest_status_note_id":"CTX-0058-001","decommissioned_on":null,"lon":-102.48876,"team_id":"TEAM-SE","team_name":"Southeast Production","inspected_at":"2027-01-14T15:30:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.4,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0058","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-08-28T18:00:00Z","inspection_id":"INS-0058-0219","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Hannah Brooks","area_id":"SW-24","wellhead_temp_c":30.5,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.8011,"delta_c":29.3,"latest_status_note_id":"CTX-0061-001","decommissioned_on":null,"lon":-102.47371,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T10:45:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.7,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0061","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2023-07-20T18:00:00Z","inspection_id":"INS-0061-0221","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-24","wellhead_temp_c":36.0,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.80529,"delta_c":26.0,"latest_status_note_id":"CTX-0067-001","decommissioned_on":null,"lon":-102.44261,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T15:15:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.9,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0067","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-01-16T18:00:00Z","inspection_id":"INS-0067-0217","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jake Morales","area_id":"SW-24","wellhead_temp_c":35.9,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.80151,"delta_c":24.5,"latest_status_note_id":"CTX-0072-001","decommissioned_on":null,"lon":-102.49752,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T13:45:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":10.0,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0072","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-08-06T18:00:00Z","inspection_id":"INS-0072-0219","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ryan Brooks","area_id":"SW-24","wellhead_temp_c":34.5,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.80847,"delta_c":22.2,"latest_status_note_id":"CTX-0076-001","decommissioned_on":null,"lon":-102.48095,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T12:45:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":6.6,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0076","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-09-19T18:00:00Z","inspection_id":"INS-0076-0218","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-24","wellhead_temp_c":28.8,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.79852,"delta_c":20.3,"latest_status_note_id":"CTX-0078-002","decommissioned_on":null,"lon":-102.44833,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T10:15:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.2,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0078","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-02-05T18:00:00Z","inspection_id":"INS-0078-0218","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jake Morales","area_id":"SW-24","wellhead_temp_c":28.5,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.79665,"delta_c":31.5,"latest_status_note_id":"CTX-0079-001","decommissioned_on":null,"lon":-102.44517,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T15:00:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":4.2,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0079","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-05-29T18:00:00Z","inspection_id":"INS-0079-0213","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ryan Brooks","area_id":"SW-24","wellhead_temp_c":35.7,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.80271,"delta_c":19.6,"latest_status_note_id":"CTX-0080-001","decommissioned_on":null,"lon":-102.47819,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T15:30:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorde

d_at":null,"ambient_temp_c":11.6,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T200","asset_id":"WELL-0080","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-08-22T18:00:00Z","inspection_id":"INS-0080-0220","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jake Morales","area_id":"SW-24","wellhead_temp_c":31.2,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.8261,"delta_c":31.2,"latest_status_note_id":"CTX-0083-001","decommissioned_on":null,"lon":-102.49622,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T11:45:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.3,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0083","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-09-11T18:00:00Z","inspection_id":"INS-0083-0212","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-24","wellhead_temp_c":39.5,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.81164,"delta_c":28.7,"latest_status_note_id":"CTX-0086-001","decommissioned_on":null,"lon":-102.46669,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T13:30:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":8.6,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0086","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-10-09T18:00:00Z","inspection_id":"INS-0086-0218","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-24","wellhead_temp_c":37.3,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.78911,"delta_c":26.8,"latest_status_note_id":"CTX-0088-001","decommissioned_on":null,"lon":-102.48434,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T14:30:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.7,"producing":true,"latest_status_note_text":"Waiting on replacement parts from the vendor; well stays shut in until they arrive.","well_type":"T350","asset_id":"WELL-0088","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2024-02-22T18:00:00Z","inspection_id":"INS-0088-0220","spill_detected":false,"latest_status_note_author_user_id":"U-101","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ryan Brooks","area_id":"SW-24","wellhead_temp_c":32.5,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.82153,"delta_c":31.0,"latest_status_note_id":"CTX-0092-001","decommissioned_on":null,"lon":-102.4495,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T10:30:00Z","area_name":"Southwest Block 24","recorded_status":"down","recorded_at":null,"ambient_temp_c":7.3,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0092","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2026-04-02T18:00:00Z","inspection_id":"INS-0092-0212","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-24","wellhead_temp_c":38.3,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.80126,"delta_c":35.6,"latest_status_note_id":"CTX-0095-001","decommissioned_on":null,"lon":-102.47503,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T11:45:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":9.2,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0095","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-12-18T18:00:00Z","inspection_id":"INS-0095-0217","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Sarah Mitchell","area_id":"SW-24","wellhead_temp_c":44.8,"status_source":"inspection","method":"drone","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T350","status_now":"Producing oil","threshold_c":20.0,"lat":31.79813,"delta_c":31.8,"latest_status_note_id":"CTX-0098-001","decommissioned_on":null,"lon":-102.45511,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T09:30:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":7.3,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T350","asset_id":"WELL-0098","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-03-20T18:00:00Z","inspection_id":"INS-0098-0215","spill_detected":false,"latest_status_note_author_user_id":"U-301","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Jake Morales","area_id":"SW-24","wellhead_temp_c":39.1,"status_source":"inspection","method":"manual","notes":"","unknown_count":0},{"status_rule_source":null,"inspection_well_type":"T200","status_now":"Producing oil","threshold_c":15.0,"lat":31.80779,"delta_c":29.5,"latest_status_note_id":"CTX-0100-001","decommissioned_on":null,"lon":-102.45111,"team_id":"TEAM-SW","team_name":"Southwest Production","inspected_at":"2027-01-14T08:45:00Z","area_name":"Southwest Block 24","recorded_status":"active","recorded_at":null,"ambient_temp_c":5.9,"producing":true,"latest_status_note_text":"Shut in by the operator during a nearby pipeline tie-in; not an equipment failure.","well_type":"T200","asset_id":"WELL-0100","status_confirmed":true,"spill_est_volume_bbl":null,"latest_status_note_at":"2025-04-24T18:00:00Z","inspection_id":"INS-0100-0213","spill_detected":false,"latest_status_note_author_user_id":"U-201","status_note_disagrees":true,"inspection_producing":true,"inspector_name":"Ryan Brooks","area_id":"SW-24","wellhead_temp_c":35.4,"status_source":"inspection","method":"manual","notes":"","unknown_count":0}],"evidence_ids":["app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774","ev_4efa3b04d1d2f74d5971a78d","result_dd8bbbfbfdeb4be4a9343b66d8011aca","ev_6e5b97e9fa9f6cab081c507b","ev_de4e7f7c5f6e3dbb0326b143","ev_48e158d164259a5e9839e091","ev_99ce61fe5b653f23708a7034","ev_c4668f6ab7f8e9139df7cc80","ev_3efe99cc32993ee98784b60b","ev_b51461ca814e674ed7520761","ev_4899bd0b97cdc3bc1c67ab44","ev_812822d09ed03975e2daa6e0","ev_638f7d3c96fffa636b5ed6ae","ev_fe8c9561455e8b951aa618c2","ev_d4d1999b2bd11f97d561fa35","ev_ef4cba6521ffa146d6da90f0","ev_47670bcd6e752b25c271ef62","ev_b068079fbd9aa8f7500fc6c9","ev_f8401024e745613ecaf3a6d2","ev_384eac6660ea71285f8acf32","ev_8c589c9cf61f37ce6d47ceec","ev_ef71c6c22fa33deeef68aacb","ev_f99fcad7de8a5c663fa363ed","src_148067724bdb724664aecc6e","ev_32813221cd56f44fe860df07","ev_9a0adf468ceadba21669bfac","ev_f0d1c24783ba1eed4f7eea63","ev_b78f72b1bc6c00c0209a35f1","ev_ecd062eace8e3149af5efa98","ev_8a1a0d04ef69b47cbbd7e2a9","ev_bc5197bd530d6f7aae4757bb","ev_33f52ab19bc692095f2613cd","ev_676f34459d729fbc8b964ff9","ev_763bc9eba3a011c8defefb22","ev_54fdf72e6ba2bb3b2daefd3a","ev_f27c0821662c9c641fab2ad6","ev_8006c3f21507a1707b9ba0e5","ev_1ee6d4204933e28d74c96119","ev_029f72c6ffe26c92ef3deeba","ev_fbaca0a5bd535373a6607bbd","ev_32b1d5cea33bfde40b7be4f0","ev_2cbdbd1119055f0d32abb860","ev_27b5821c6bb6b6b706c7890b","ev_60ef15984854bb82a4b81082","ev_8197aeef59587fb62acdedd0","ev_d067855a9d3cc2e2f43f8484","ev_c7c54356b2c8c2d46967df8e","ev_3713a8efaf2f517f83069df7","ev_6defff21ff6945b11e011b2f","ev_7e480bffc490a5389baac69a","ev_9145e135884678dfedb63f18","ev_fef055fa0033af0dcf9c7532","ev_e53d02e1c563f593794fb94d","ev_fed3e43a947cd872d3408bd8","ev_bc334fd1ecff32d67e04ec4d","ev_d887fb89f3cb55901afa7836","ev_ada5a4d762e2915cf5228174","ev_5dc709cab1d1b6f0255f755b","ev_0d5c92b1848069c95cc1ea89","ev_6dc5aaef483bcd0814682fb7","ev_12434facbb6ed8f5dcf1ebe8","ev_934d497b4dd7573cb0526025","ev_fc511faa0cea82de29228fc1","ev_62a3abf0945b5967a062dba3","ev_0dc733940602bacc83828f1b","ev_cb32c016fb7f86d21cfb72e3","ev_24c4592380a47fe26f2f599e","ev_56fd058f01c79a5af4d1ed27","ev_6142f957ddaaf89f5eab0f2b","ev_af15281e64d797ac64105226","ev_c27aaf8cfabd527c6a455534","ev_d491249355076386c7c4c6b0","ev_f26a90754b2aeaf6a82eb0bc","ev_34f21f30b296db9f3efef010","ev_6341f9f7638fa6126e26e509","ev_7025b07d09335ba45821b656","ev_a522400cb

97d8795c0c55cf8","ev_53216160ba72ab0385517fd4","ev_c05a8d49d4d6c8df10a53c45","ev_ea997cca35bef87ddff9e622","ev_c618047edd493e186e0ab38b","ev_9f1e40b0a74614ccd820ee83","ev_4a821caf2e13e71497a32788","ev_2915bfebd6745194c65924ca","ev_377fbd57c19a0483af9f83aa","ev_df9a0fe1e3c53d623e48e939","ev_8f501ad1150c900472f6a010","ev_46852bd332b56eeece88b3a3","ev_d6ca1ebda1649d9600eae792","ev_670aa75d08ecb096839afd83","ev_02c4e8558bd85df285f5ff0e","ev_e0ed5244938bee7aefe51314","ev_44124b0ac1afdac84ff98435","ev_a71f6c85521fedd363808cc4","ev_d1f40f820f7532c100c605c5","ev_a2414aa446afc58ee7eb5fc2","ev_0ab9431eeb73c15dbb8e47ee","ev_85f479b4c0061c8450a8b18d","ev_6cb17d0270acb8e3ad6f276d","ev_7e362ff1ff342c3514e3c823","ev_ee2adac7565786b35105adb7","ev_7a3d09ac7ec70ce704f168fa","ev_a0d20c5ae8b736b2a96c4808","ev_08b859ba7f34ffca74494a3c","ev_d97ca3979093c765fbfeac70","ev_c309f3c0f1afe006bab5af0e","ev_1ab43b6195eb54c9ddf03376","ev_4b24873b67dbc78bf1a0e3a0","ev_4c68c6645a0286ada2c0d21e","ev_2650c6ee108ef31710aebcc8","ev_954278a8f38bb1d86eb1a0e5","ev_40f21185a803c30abc6f4dad","ev_423cce5779161a042d1d8900","ev_0758f615d97f3b09efca9db5","ev_4e7b6eece098b7a52ba4b703","ev_4870e5f96589e32a4b1e4676","ev_9d12e4bff327282025e59070","ev_73bef1ac23dc39648de77489","ev_c9b6b3162cfbc235bd2de98c","ev_356fa0d816d4b8fd8a5f7767","ev_01833da7d66df475c0ac81f0","ev_bbf43552fee695d625c9d8cd","ev_dc18db3b802b381011b8fb20","ev_2252c54e9ad0be205565be43","ev_7de428bae9189303955a3ad4","ev_3db9bfdc457dea515fed4d33","ev_dbc09d50bead1541c535f767","ev_d12f1a67bd060771ad167257","ev_0642db05e370c701e6fdc18f","ev_4e69e029fc2793c07457f9fa","ev_9bbd8c4ce93bb03b77838dbd","ev_9bf26c0011b9dcd7b67a4703","ev_ca443934473b5f95fd8b3304","ev_dcd97529f1acd812498a60e5","ev_fb8c82c053c64cad78fe2b0d","ev_6eb3a1ad958e69f08bc706e1","ev_a653f3dbe2c5f77a26718aef","ev_20edcb1efc83dad580e39e33","ev_719194ad94b291b38b60d699","ev_56b7275c9a703da76cf584df","ev_747a4251e5cf9c7ff4194aac","ev_cf31246f691f828e415f15d5","ev_1d72c73ed1e765f83a6cb706","ev_61aa0e9eeab41f472e229495","ev_ce3315aa984dfc9a13dc8ffa","ev_c5da926c6acefb02c9f0412f","ev_e0e064a2eb1d066f3b20cea6","ev_d7d56958bdf6831f8cc05828","ev_56d9007333833b3825223dc7","ev_6f49b85303e1263ae930643f","ev_69640446ef45090e0293a0cf","ev_f64a0b97d81afb9b6d1242aa","ev_97124e128ade7d3be2e888b6","ev_1638cc4892f2fdb789faf1ec","ev_c4c98e392879d30a0716fb89","ev_c338e2bff344ba6b624d782b","ev_d7e9776b9d5923406aee8c5d","ev_ee63dc70c80698d8607dbe27","ev_6116c30650afe4b652bce06e","ev_b67e8bb7d545804392aad608","ev_4ccfcc1b719f0f6b34641ddb","ev_7a995a511b7490944ef5b886","ev_b677423f9fee98df99fee661","ev_e8cbc122e181df1130338857","ev_e8506e04055c6869c08d2586","ev_4091436310d556a54d555461","ev_d683c9731bbfd99f0a314ffb","ev_a66c588160715b23b7725d00","ev_e0156c5dcea6668bcbb87ae0","ev_85ee6569eb8872f91bd21c20","ev_b05e7e27bac1ace3dd94836f","ev_c03071a1734128244737d8c1","ev_ec26e458805348ccaa27d597","ev_250177d11b8cc2401638bbd1","ev_bf154f910c95962265df5d68","ev_617b7fff681baa108f7efc2a","ev_07582aba3d2d5883f46b0d68","ev_2372dfc69ff5b4ca7b27ec30","ev_6803058b648794a10053bef2","ev_7a08c8dc18573a27fc2d21e0","ev_e0c0c6af54286c39c006ecc3","ev_56633c60d9c04584d5bea51c","ev_4ebcd852f65b98797bd30349","ev_f9d7892a68662c478d1f61fb","ev_27d2acafe1996951fe08adcc","ev_def89e6e73e242e50a477c59","ev_4ab76b0e43f8df8eaabc51fa","ev_413989af9205c0e5a569920a","ev_d9f6d611432f81406abb04b6","ev_1b55eb47a46fb6009f48d877","ev_206ddc6d3efaa0532163ad8a","ev_477cbf81dc1a4ae0eb443e78","ev_7cabe3fb75e0c725bfc05296","ev_a4f4cbab2ed8a1770afbcf5b","ev_3e7c914c90b36bb2db64fc62","ev_34225d7a92a3b52a315a0780","ev_c4274d22292ecd9249d248e2","ev_7099a19be8776aacd58e5200","ev_c1e4c29c668e1e584b9ba90c","ev_3ae13bae56610b363b0a3d0a","ev_3d87d7b928620e11bb316e86","ev_b2b14c0a3bd5d842781d0400","ev_9919a3b3c4adc79ea225718e","ev_5de9bcb8272f1b4bbfd66a28","ev_996d11d2b5b60808fabb06ea","ev_b375aed104e22e404d2c7ba5","ev_8ae06faf189c5987c2448e6c","ev_fab6c2aa291da606dbc0a77a","ev_01242bd543f3dc7b548f9fa6","ev_b112c7021ec0bfcf40977fce","ev_fab0de95336e9201c10980e6","ev_630cef1e4aa799df8e2fccad","ev_ba79b09a608a7421c875adcd","ev_6783450ed0e97a9354a9adcd","ev_a1612e0f1d7e31483dbfc633","ev_7abfc9900f22a11b1636e89d","ev_e7694c0c12e709e775b471a8","ev_7444f11cdd9391ba37aead76","ev_8c192fa7f7f20daee69cd635","ev_d36bbff4d8661c03029486df","ev_5ca751d4a55292dfa1928851","ev_c1cf48b2475bfd8000cfef47","ev_b70379b818b32e3187919a97","ev_4241fa42224323b46ab8e0a6","ev_c9c5ffc1562ae50f2dc16d8d","ev_aa086bef5ed11c1c0232faf4","ev_affecec645d1944951b4aaa5","ev_a90a73491db7410dd1de577f","ev_1dc7fb6cd04eb87d0e99a593","ev_7905ce64513d1436877cda69","ev_b87ed26c3812889490049edd","ev_2dee99a0262c10836c3e06a2","ev_115f736e6c6b467181e1b86b","ev_2b683eb22eb1a387b09490f6","ev_bffc5b9b6d6f908746a71d97","ev_2b67dd4a819e40cae54c8234","ev_8d1c3bf6af75967b296a4a3a","ev_4e6131c9e1ec06e1b252c63d","ev_6a467a03024d8491d33acfae","ev_a6e1f7ccfeedf2a7df78182a","ev_39b71d6ed91b3c31e8651725","ev_24ab41ee1cfa53ba40fca34b","ev_de5c36e909790c04e6d0b03d","ev_f4ae844315dee5f96433f3a5","ev_5d5c9c87e7df121468c9672a","ev_de0c9c65e505408cb26cb0ff","ev_3793afe65ab5702f7a20c4ca","ev_f74e9b506d81b9eef98497d2","ev_32e6573140fde0fbc56c0c74","ev_cef7bd534e3e7dc9737c83f4","ev_4950ab4281f80d79262c1ddb","ev_34727afe65e28d811ec13504","ev_89286af03a9043f8984b59ab","ev_19388da8ab0d3a38f4f05770","ev_13857967e9bdb390dc77bd1c","ev_d8a79b6a9785eaec62955978","ev_af61d24dcfd0a41f821e6e01","ev_3e31d0f4a109a5d62292f36e","ev_dfcb0ff67a0b01470f7a03c5","ev_d7e331540a04fb4fde449e14","ev_379c90c81807fd8a7c9bfa03","ev_c0a528f5fa65ac2550f347b8","ev_c20dc8d61ceec5634352d639","ev_b8b1f5c506f7fbd74aea1cea","ev_d4a63e97717febf90cdcdfa7","ev_1acbca9630ad9a6f342b5ccc","ev_a93f2738f46de6f28b0cbcf2","ev_2456c004d6afdc378da01207","ev_55fdef72094e230edc053791","ev_b2a8d633980a7c08e6f07724","ev_bbd38e94b48175900ceaa2e0","ev_c44211594068d6107454fb1f","ev_91d124f98f35668ddffb2cfc","ev_47948a6fd2b4b67699a1deb1","ev_2ea49388780f0dd512349a62","ev_99044e6744f7aab4c7236bef","ev_2eb5edc18b69074f5c26c089","ev_352ada5226a463f3e2419020","ev_a20cc06319139dfa6ec8196a","ev_f447d905605b36dbbba03b95","ev_0c2ddc9d5dd022c564ed4643","ev_677915dafc5a2213ea13dc4e","ev_f67a392f80f864250b1c4506","ev_9c0fc249c4aa4a41933e5989","ev_12b6796fd6750300b18a92f8","ev_0a98234236791eab41ce7c95","ev_676972ccf3c134176e46c7ec","ev_a69410a32237f0c3b1f4cb89","ev_7f7b092022848dc5694744d3","ev_2b424056ff5228ee37aac932","ev_c3a1c443194bdda3ef3c273b","ev_5496d0ac304c9480a46d32b0","ev_732974a48806c67af6f141b4","ev_4276011333de55b02e8a1ee1","ev_20b60eb6ae20593d630c5443","ev_669f77cfb1ee3f27159701db","ev_55b694c5178722e73fb65806","ev_d9a2d1edaef07a4bb359544a","ev_f449c7ecc8ecbb39a01d641a","ev_348ae8dd3e166901da8e01b6","ev_622d8bfda4ba5502af857f00","ev_dfb43c703711ce31f30af323","ev_eb4c218bd66981dda0479367","ev_2c29de23256c88dc9d51b300","result_27b669d49fcb4f0f9d09cf23b7b31d12","ev_cfdf9392cb984c6d752bc08b","ev_7a8a07eb8c892e968204d863","ev_307663f0e9ad53f8f34a2c61","ev_c5f120e395c6c2a3899d3916","ev_100227afdc3881c757df7146","ev_b8596665107f59e3de32a965","ev_030cc2f4485302a526dfdb4a","ev_de4ba74bb6965b2b6df70d85","ev_eda499ca853d0705de31b171","ev_a5cab3c006f685dab7c070a6","ev_bad315a7e6b9475e28156e04","ev_4719bf4bf5114f62de0fb524","ev_fb66432d89070a9b4a4318ad","ev_bacf3347395f55c1d76d3cf3","ev_22d7adf55371b43371513fa6","ev_3de7168d7ea6c869ce1cc119","ev_95af297a9ffb3d0ef737bacc","ev_874407f2d767fb7defa1cab1","ev_12aacd350f31284b7421d772","ev_bcac7268ab2dbe3395497cdd","ev_8986faaef066c8aefa7ae417","ev_26a25e51dff191be55a5ff23","ev_282434bb339c68e532ef4461","ev_8c1b440293b53f149a69c455","ev_0166249114d1ad8b4274c66e","ev_ee618a402ec2497e7e5c0d0a","ev_833a5fd01b2e14510d04babc","ev_ac2ad11c2e0a680f4809f581","ev_56ec34014329987f4d26ddb5","ev_5b8d1a4a0defbc33b347efb1","ev_c1db8f7a6aaf439eafd6c2de","ev_8a5ec7b226002c4eae90dd2a","ev_2f70ff67f6452884bb05ce34","ev_87b6bdba244827d6bf2b6d79","ev_7d524ac8910644c7049c7b78","ev_7144928b9b70faa8b63509ef","ev_404d125ab38bd02df38cd308","ev_c471024d49394115d5acd012","ev_f34955163a5208eeadac8c55","ev_3476d3f80b228110db6b763d","ev_dd9f449c356eb532e4cf9c3c","ev_40e053a05d5815f8702fbe5c","ev_2e1a3c331e6187c5cb2b2189","ev_581292c7bab4c66ab9f5fa46","ev_fbf469fbe3f8c455bfef122d","ev_4738ba30dd3d814f328fde88","ev_f145a8d6c54724463bfa6ffa","ev_52d1d1d119f7bd88e14df23f","ev_594092612a81b49240de6cc3","ev_23de532915eed6a5b26ef746","ev_7dfd6dffd49a6b2766d2ceae","ev_13bc3796520b9fa6588cd564","ev_0b66cb176ea031a4547d5a22","ev_d1c147186c837715e1baecdd","ev_d5b965ad4daba0f21f3adf02","ev_bfd0a2744e98b2c535e9a1fa","ev_04d5d8733b3fc82b4885f7d6","ev_b1e0a2548ba3357fa5e28fda","ev_79f3c79e2789bc9180b1b48d","src_215c78036f52b5303b330fe0","src_0b27ec48fd9b0f16a6cd84c6","src_330aa8bd8455ae32332cb94c"],"provider_coverage":{"unit":"matching_source_record","matching":120,"evaluated":120,"unknown":0,"import_issues":0,"status":"complete","output_rows":120,"displayed_rows":120,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_4f74291eb6f340d789f25b04aafaea8d","warnings":[],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"assets","metric":"status"},"summary":null,"coverage":{"matching":120,"evaluated":120,"unknown":0},"presentation":{"sort_keys":["area_name","asset_id"]}}},
  "warnings": ["Ranked lexical retrieval cannot prove a fleet total or source absence","Report prose may predate corrections; a lexical hit does not confirm effective spill detection or current classification"],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":5952,"output_tokens":201,"total_tokens":6153,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":669,"live":true},{"stage":"maker","usage":{"input_tokens":5216,"output_tokens":554,"total_tokens":5770,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP

```
"},"call_id":679,"live":true}],"provider":"google","foreground_attempts":3,"live":true},
  "evidence": {"app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774":{"id":"app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774"
,"source_id":"app:pages:29d0cf34-cf7b-415a-8a42-ecac4e305774","source_kind":"verified_paged_query","title":"Complete
effective status population"},"ev_4efa3b04d1d2f74d5971a78d":{"id":"ev_4efa3b04d1d2f74d5971a78d","source_id":"src_6b7e3
b9a01988e810e943b87","source_kind":"inspections","title":"INS-0008-0218","path":"assets/WELL-0008/inspections.jsonl"},
"result_dd8bbbfbfdeb4be4a9343b66d8011aca":{"id":"result_dd8bbbfbfdeb4be4a9343b66d8011aca","source_id":"result_dd8bbbfb
fdeb4be4a9343b66d8011aca","source_kind":"aggregate_lineage","title":"result_dd8bbbfbfdeb4be4a9343b66d8011aca"},"ev_6e5
b97e9fa9f6cab081c507b":{"id":"ev_6e5b97e9fa9f6cab081c507b","source_id":"src_6ecd5952b0afdf92df1d9860","source_kind":"m
etadata","title":"WELL-0008","path":"assets/WELL-0008/metadata.json"},"ev_de4e7f7c5f6e3dbb0326b143":{"id":"ev_de4e7f7c
5f6e3dbb0326b143","source_id":"src_6e13385145e82a507e533d10","source_kind":"context","title":"CTX-0008-002","path":"as
sets/WELL-0008/context.jsonl"},"ev_48e158d164259a5e9839e091":{"id":"ev_48e158d164259a5e9839e091","source_id":"src_01c7
3e126de581aa042d7bc5","source_kind":"inspections","title":"INS-0010-0219","path":"assets/WELL-0010/inspections.jsonl"}
,"ev_99ce61fe5b653f23708a7034":{"id":"ev_99ce61fe5b653f23708a7034","source_id":"src_a6ff20019ce0e76bf774f53c","source_
kind":"metadata","title":"WELL-0010","path":"assets/WELL-0010/metadata.json"},"ev_c4668f6ab7f8e9139df7cc80":{"id":"ev_
c4668f6ab7f8e9139df7cc80","source_id":"src_f4c925eade7030d1aedbb885","source_kind":"context","title":"CTX-0010-004","p
ath":"assets/WELL-0010/context.jsonl"},"ev_3efe99cc32993ee98784b60b":{"id":"ev_3efe99cc32993ee98784b60b","source_id":"
src_fb0fa9bd28ea3db96f619c82","source_kind":"inspections","title":"INS-0015-0219","path":"assets/WELL-0015/inspections
.jsonl"},"ev_b51461ca814e674ed7520761":{"id":"ev_b51461ca814e674ed7520761","source_id":"src_cc8c8077d6ac4e586ff72358",
"source_kind":"metadata","title":"WELL-0015","path":"assets/WELL-0015/metadata.json"},"ev_4899bd0b97cdc3bc1c67ab44":{"
id":"ev_4899bd0b97cdc3bc1c67ab44","source_id":"src_f4fa0d8a93432d403b9eec40","source_kind":"context","title":"CTX-0015
-001","path":"assets/WELL-0015/context.jsonl"},"ev_812822d09ed03975e2daa6e0":{"id":"ev_812822d09ed03975e2daa6e0","sour
ce_id":"src_030ea4c0456d8875e5e28f45","source_kind":"inspections","title":"INS-0017-0219","path":"assets/WELL-0017/ins
pections.jsonl"},"ev_638f7d3c96fffa636b5ed6ae":{"id":"ev_638f7d3c96fffa636b5ed6ae","source_id":"src_14809997f4b302c64f
512c2d","source_kind":"metadata","title":"WELL-0017","path":"assets/WELL-0017/metadata.json"},"ev_fe8c9561455e8b951aa6
18c2":{"id":"ev_fe8c9561455e8b951aa618c2","source_id":"src_e7ad6b9335e2e5d9b6c73425","source_kind":"context","title":"
CTX-0017-001","path":"assets/WELL-0017/context.jsonl"},"ev_d4d1999b2bd11f97d561fa35":{"id":"ev_d4d1999b2bd11f97d561fa3
5","source_id":"src_da9e70ae41fa452b5d7c1aeb","source_kind":"inspections","title":"INS-0018-0219","path":"assets/WELL-
0018/inspections.jsonl"},"ev_ef4cba6521ffa146d6da90f0":{"id":"ev_ef4cba6521ffa146d6da90f0","source_id":"src_0c37919c90
09204f46093f20","source_kind":"metadata","title":"WELL-0018","path":"assets/WELL-0018/metadata.json"},"ev_47670bcd6e75
2b25c271ef62":{"id":"ev_47670bcd6e752b25c271ef62","source_id":"src_e24738072b12696d54b0d5c3","source_kind":"context","
title":"CTX-0018-002","path":"assets/WELL-0018/context.jsonl"},"ev_b068079fbd9aa8f7500fc6c9":{"id":"ev_b068079fbd9aa8f
7500fc6c9","source_id":"src_ddddb54dd272384e4729737c","source_kind":"inspections","title":"INS-0022-0210","path":"asse
ts/WELL-0022/inspections.jsonl"},"ev_f8401024e745613ecaf3a6d2":{"id":"ev_f8401024e745613ecaf3a6d2","source_id":"src_59
11299bb60d4ff55a16d6a1","source_kind":"metadata","title":"WELL-0022","path":"assets/WELL-0022/metadata.json"},"ev_384e
ac6660ea71285f8acf32":{"id":"ev_384eac6660ea71285f8acf32","source_id":"src_d35f3e9e8106cfb871cdabae","source_kind":"co
ntext","title":"CTX-0022-001","path":"assets/WELL-0022/context.jsonl"},"ev_8c589c9cf61f37ce6d47ceec":{"id":"ev_8c589c9
cf61f37ce6d47ceec","source_id":"src_2e9aad969ad4aaf3432a7385","source_kind":"inspections","title":"INS-0026-0216","pat
h":"assets/WELL-0026/inspections.jsonl"},"ev_ef71c6c22fa33deeef68aacb":{"id":"ev_ef71c6c22fa33deeef68aacb","source_id"
:"src_8a4e14a2f90795593fb98512","source_kind":"metadata","title":"WELL-0026","path":"assets/WELL-0026/metadata.json"},
"ev_f99fcad7de8a5c663fa363ed":{"id":"ev_f99fcad7de8a5c663fa363ed","source_id":"src_fab45b5c7e66aa546b6654b9","source_k
ind":"context","title":"CTX-0026-001","path":"assets/WELL-0026/context.jsonl"},"src_148067724bdb724664aecc6e":{"id":"s
rc_148067724bdb724664aecc6e","source_id":"src_148067724bdb724664aecc6e","source_kind":"sop","title":"fleet/sops/operat
ions-sop-rev2.md","path":"fleet/sops/operations-sop-rev2.md"},"ev_32813221cd56f44fe860df07":{"id":"ev_32813221cd56f44f
e860df07","source_id":"src_b0880d117428fbcc7abf0c9b","source_kind":"inspections","title":"INS-0028-0217","path":"asset
s/WELL-0028/inspections.jsonl"},"ev_9a0adf468ceadba21669bfac":{"id":"ev_9a0adf468ceadba21669bfac","source_id":"src_b50
71380e135b82bd7e4274d","source_kind":"metadata","title":"WELL-0028","path":"assets/WELL-0028/metadata.json"},"ev_f0d1c
24783ba1eed4f7eea63":{"id":"ev_f0d1c24783ba1eed4f7eea63","source_id":"src_8cbef2f628ac1892efd4d5d4","source_kind":"con
text","title":"CTX-0028-001","path":"assets/WELL-0028/context.jsonl"},"ev_b78f72b1bc6c00c0209a35f1":{"id":"ev_b78f72b1
bc6c00c0209a35f1","source_id":"src_896837d9337b9fbf5c6babdc","source_kind":"inspections","title":"INS-0031-0215","path
":"assets/WELL-0031/inspections.jsonl"},"ev_ecd062eace8e3149af5efa98":{"id":"ev_ecd062eace8e3149af5efa98","source_id":
"src_9b91a550d3d412d193d7cde3","source_kind":"metadata","title":"WELL-0031","path":"assets/WELL-0031/metadata.json"},"
ev_8a1a0d04ef69b47cbbd7e2a9":{"id":"ev_8a1a0d04ef69b47cbbd7e2a9","source_id":"src_0b8799c783ddf67dced4b05a","source_kin
d":"context","title":"CTX-0031-001","path":"assets/WELL-0031/context.jsonl"},"ev_bc5197bd530d6f7aae4757bb":{"id":"ev_
bc5197bd530d6f7aae4757bb","source_id":"src_a07d3ae496e5acc2b2ead68c","source_kind":"inspections","title":"INS-0032-021
9","path":"assets/WELL-0032/inspections.jsonl"},"ev_33f52ab19bc692095f2613cd":{"id":"ev_33f52ab19bc692095f2613cd","sou
rce_id":"src_6cc66390898c085f779538b2","source_kind":"metadata","title":"WELL-0032","path":"assets/WELL-0032/metadata.
json"},"ev_676f34459d729fbc8b964ff9":{"id":"ev_676f34459d729fbc8b964ff9","source_id":"src_589874dfd619b7ca23c5dd54","s
ource_kind":"context","title":"CTX-0032-006","path":"assets/WELL-0032/context.jsonl"},"ev_763bc9eba3a011c8defefb22":{"
id":"ev_763bc9eba3a011c8defefb22","source_id":"src_e38fcefff02c839ceaf87a4a","source_kind":"inspections","title":"INS-
0033-0222","path":"assets/WELL-0033/inspections.jsonl"},"ev_54fdf72e6ba2bb3b2daefd3a":{"id":"ev_54fdf72e6ba2bb3b2daefd
3a","source_id":"src_3cde4e27f7417d4cf38aa42a","source_kind":"metadata","title":"WELL-0033","path":"assets/WELL-0033/m
etadata.json"},"ev_f27c0821662c9c641fab2ad6":{"id":"ev_f27c0821662c9c641fab2ad6","source_id":"src_43648f69b2df5ea157d4
583b","source_kind":"context","title":"CTX-0033-003","path":"assets/WELL-0033/context.jsonl"},"ev_8006c3f21507a1707b9b
a0e5":{"id":"ev_8006c3f21507a1707b9ba0e5","source_id":"src_ba1738e2645f2d623e60587f","source_kind":"inspections","titl
e":"INS-0035-0218","path":"assets/WELL-0035/inspections.jsonl"},"ev_1ee6d4204933e28d74c96119":{"id":"ev_1ee6d4204933e2
8d74c96119","source_id":"src_c1ef68a5af39b97ad6ecde50","source_kind":"metadata","title":"WELL-0035","path":"assets/WEL
L-0035/metadata.json"},"ev_029f72c6ffe26c92ef3deeba":{"id":"ev_029f72c6ffe26c92ef3deeba","source_id":"src_ae4bc53246c2
0e4c9d425d1e","source_kind":"context","title":"CTX-0035-001","path":"assets/WELL-0035/context.jsonl"},"ev_fbaca0a5bd53
5373a6607bbd":{"id":"ev_fbaca0a5bd535373a6607bbd","source_id":"src_cbf77323c80f3825f5136363","source_kind":"inspection
s","title":"INS-0044-0218","path":"assets/WELL-0044/inspections.jsonl"},"ev_32b1d5cea33bfde40b7be4f0":{"id":"ev_32b1d5
cea33bfde40b7be4f0","source_id":"src_9c01dbb95a8e7a2837fea5c8","source_kind":"metadata","title":"WELL-0044","path":"as
sets/WELL-0044/metadata.json"},"ev_2cbdbd1119055f0d32abb860":{"id":"ev_2cbdbd1119055f0d32abb860","source_id":"src_87ab
53403f3f970673b4439a","source_kind":"context","title":"CTX-0044-008","path":"assets/WELL-0044/context.jsonl"},"ev_27b5
821c6bb6b6b706c7890b":{"id":"ev_27b5821c6bb6b6b706c7890b","source_id":"src_f5ee6d1c357b8c32a152018e","source_kind":"in
spections","title":"INS-0045-0214","path":"assets/WELL-0045/inspections.jsonl"},"ev_60ef15984854bb82a4b81082":{"id":"e
v_60ef15984854bb82a4b81082","source_id":"src_b5a245d84808732e7be7be4b","source_kind":"metadata","title":"WELL-0045","p
ath":"assets/WELL-0045/metadata.json"},"ev_8197aeef59587fb62acdedd0":{"id":"ev_8197aeef59587fb62acdedd0","source_id":"
src_0801314b8718d833aac7342d","source_kind":"context","title":"CTX-0045-002","path":"assets/WELL-0045/context.jsonl"},
"ev_d067855a9d3cc2e2f43f8484":{"id":"ev_d067855a9d3cc2e2f43f8484","source_id":"src_51ca63d5e170f392b1a6d08b","source_k
ind":"inspections","title":"INS-0046-0220","path":"assets/WELL-0046/inspections.jsonl"},"ev_c7c54356b2c8c2d46967df8e":
{"id":"ev_c7c54356b2c8c2d46967df8e","source_id":"src_cacc8ab77e9284f4d112b6cd","source_kind":"metadata","title":"WELL-
0046","path":"assets/WELL-0046/metadata.json"},"ev_3713a8efaf2f517f83069df7":{"id":"ev_3713a8efaf2f517f83069df7","sour
ce_id":"src_eedecc258f1ba2dc066a625a","source_kind":"context","title":"CTX-0046-004","path":"assets/WELL-0046/context.
jsonl"},"ev_6defff21ff6945b11e011b2f":{"id":"ev_6defff21ff6945b11e011b2f","source_id":"src_702277ad79dfbf24776470f3","
source_kind":"inspections","title":"INS-0047-0215","path":"assets/WELL-0047/inspections.jsonl"},"ev_7e480bffc490a5389b
```

aac69a":{"id":"ev_7e480bffc490a5389baac69a","source_id":"src_a34cb727504007fe9d13d45c","source_kind":"metadata","title
":"WELL-0047","path":"assets/WELL-0047/metadata.json"},"ev_9145e135884678dfedb63f18":{"id":"ev_9145e135884678dfedb63f1
8","source_id":"src_1ec544b185c6dd65b1fab9f0","source_kind":"context","title":"CTX-0047-001","path":"assets/WELL-0047/
context.jsonl"},"ev_fef055fa0033af0dcf9c7532":{"id":"ev_fef055fa0033af0dcf9c7532","source_id":"src_6b00d7bc698bf56f086
a2218","source_kind":"inspections","title":"INS-0049-0218","path":"assets/WELL-0049/inspections.jsonl"},"ev_e53d02e1c5
63f593794fb94d":{"id":"ev_e53d02e1c563f593794fb94d","source_id":"src_14085eb99742fa59b1e933c8","source_kind":"metadata
","title":"WELL-0049","path":"assets/WELL-0049/metadata.json"},"ev_fed3e43a947cd872d3408bd8":{"id":"ev_fed3e43a947cd87
2d3408bd8","source_id":"src_a181aa73d983d6925717717e","source_kind":"context","title":"CTX-0049-001","path":"assets/WE
LL-0049/context.jsonl"},"ev_bc334fd1ecff32d67e04ec4d":{"id":"ev_bc334fd1ecff32d67e04ec4d","source_id":"src_66a3d652a67
847583107f8a0","source_kind":"inspections","title":"INS-0058-0219","path":"assets/WELL-0058/inspections.jsonl"},"ev_d8
87fb89f3cb55901afa7836":{"id":"ev_d887fb89f3cb55901afa7836","source_id":"src_2418247a0536d2b9f43685e8","source_kind":"
metadata","title":"WELL-0058","path":"assets/WELL-0058/metadata.json"},"ev_ada5a4d762e2915cf5228174":{"id":"ev_ada5a4d
762e2915cf5228174","source_id":"src_73cdf0e434936de97b71c69b","source_kind":"context","title":"CTX-0058-001","path":"a
ssets/WELL-0058/context.jsonl"},"ev_5dc709cab1d1b6f0255f755b":{"id":"ev_5dc709cab1d1b6f0255f755b","source_id":"src_4ed
c89dccfe5ef84d934c72a","source_kind":"inspections","title":"INS-0061-0221","path":"assets/WELL-0061/inspections.jsonl"
},"ev_0d5c92b1848069c95cc1ea89":{"id":"ev_0d5c92b1848069c95cc1ea89","source_id":"src_55183000123ff8ad82ca26b5","source
_kind":"metadata","title":"WELL-0061","path":"assets/WELL-0061/metadata.json"},"ev_6dc5aaef483bcd0814682fb7":{"id":"ev
_6dc5aaef483bcd0814682fb7","source_id":"src_a8c7750b7ee421f7e968cfe9","source_kind":"context","title":"CTX-0061-001","
path":"assets/WELL-0061/context.jsonl"},"ev_12434facbb6ed8f5dcf1ebe8":{"id":"ev_12434facbb6ed8f5dcf1ebe8","source_id":
"src_9ddace58e7dbfec2ede2097a","source_kind":"inspections","title":"INS-0067-0217","path":"assets/WELL-0067/inspection
s.jsonl"},"ev_934d497b4dd7573cb0526025":{"id":"ev_934d497b4dd7573cb0526025","source_id":"src_95474048b063db018bf8240a"
,"source_kind":"metadata","title":"WELL-0067","path":"assets/WELL-0067/metadata.json"},"ev_fc511faa0cea82de29228fc1":{
"id":"ev_fc511faa0cea82de29228fc1","source_id":"src_02139aac5e5f072c3622f7c5","source_kind":"context","title":"CTX-006
7-001","path":"assets/WELL-0067/context.jsonl"},"ev_62a3abf0945b5967a062dba3":{"id":"ev_62a3abf0945b5967a062dba3","sou
rce_id":"src_d51581d991e151146f83f7ff","source_kind":"inspections","title":"INS-0072-0219","path":"assets/WELL-0072/in
spections.jsonl"},"ev_0dc733940602bacc83828f1b":{"id":"ev_0dc733940602bacc83828f1b","source_id":"src_0b214721f7f520152
ec7687d","source_kind":"metadata","title":"WELL-0072","path":"assets/WELL-0072/metadata.json"},"ev_cb32c016fb7f86d21cf
b72e3":{"id":"ev_cb32c016fb7f86d21cfb72e3","source_id":"src_2a1342391fa773b8d543417d","source_kind":"context","title":
"CTX-0072-001","path":"assets/WELL-0072/context.jsonl"},"ev_24c4592380a47fe26f2f599e":{"id":"ev_24c4592380a47fe26f2f59
9e","source_id":"src_6613a0455e5d4af72f4b93b3","source_kind":"inspections","title":"INS-0076-0218","path":"assets/WELL
-0076/inspections.jsonl"},"ev_56fd058f01c79a5af4d1ed27":{"id":"ev_56fd058f01c79a5af4d1ed27","source_id":"src_4390df80e
92cc7b3908b97f4","source_kind":"metadata","title":"WELL-0076","path":"assets/WELL-0076/metadata.json"},"ev_6142f957dda
af89f5eab0f2b":{"id":"ev_6142f957ddaaf89f5eab0f2b","source_id":"src_af5bbe0ba46328d6520732e3","source_kind":"context",
"title":"CTX-0076-001","path":"assets/WELL-0076/context.jsonl"},"ev_af15281e64d797ac64105226":{"id":"ev_af15281e64d797
ac64105226","source_id":"src_2530847ffa876cb0811df304","source_kind":"inspections","title":"INS-0078-0218","path":"ass
ets/WELL-0078/inspections.jsonl"},"ev_c27aaf8cfabd527c6a455534":{"id":"ev_c27aaf8cfabd527c6a455534","source_id":"src_0
8442e73e005b89e218296f5","source_kind":"metadata","title":"WELL-0078","path":"assets/WELL-0078/metadata.json"},"ev_d49
1249355076386c7c4c6b0":{"id":"ev_d491249355076386c7c4c6b0","source_id":"src_136aa9083656cc5e4516d1c6","source_kind":"c
ontext","title":"CTX-0078-002","path":"assets/WELL-0078/context.jsonl"},"ev_f26a90754b2aeaf6a82eb0bc":{"id":"ev_f26a90
754b2aeaf6a82eb0bc","source_id":"src_63fddc2bc4ee4dd48a8dee50","source_kind":"inspections","title":"INS-0079-0213","pa
th":"assets/WELL-0079/inspections.jsonl"},"ev_34f21f30b296db9f3efef010":{"id":"ev_34f21f30b296db9f3efef010","source_id
":"src_d9276caf1602f6fd770b67f3","source_kind":"metadata","title":"WELL-0079","path":"assets/WELL-0079/metadata.json"}
,"ev_6341f9f7638fa6126e26e509":{"id":"ev_6341f9f7638fa6126e26e509","source_id":"src_b3878cea4029a26b254cd249","source_
kind":"context","title":"CTX-0079-001","path":"assets/WELL-0079/context.jsonl"},"ev_7025b07d09335ba45821b656":{"id":"e
v_7025b07d09335ba45821b656","source_id":"src_369300e19b85b751375f0a1c","source_kind":"inspections","title":"INS-0080-0
220","path":"assets/WELL-0080/inspections.jsonl"},"ev_a522400cb97d8795c0c55cf8":{"id":"ev_a522400cb97d8795c0c55cf8","s
ource_id":"src_329400c1cf634fe3c3ec68ee","source_kind":"metadata","title":"WELL-0080","path":"assets/WELL-0080/metadat
a.json"},"ev_53216160ba72ab0385517fd4":{"id":"ev_53216160ba72ab0385517fd4","source_id":"src_a3bfe3c806da49c81bd4f2b9",
"source_kind":"context","title":"CTX-0080-001","path":"assets/WELL-0080/context.jsonl"},"ev_c05a8d49d4d6c8df10a53c45":
{"id":"ev_c05a8d49d4d6c8df10a53c45","source_id":"src_8f73443077e49b39c268bc81","source_kind":"inspections","title":"IN
S-0083-0212","path":"assets/WELL-0083/inspections.jsonl"},"ev_ea997cca35bef87ddff9e622":{"id":"ev_ea997cca35bef87ddff9
e622","source_id":"src_889302ffb2491ee1c0c60b29","source_kind":"metadata","title":"WELL-0083","path":"assets/WELL-0083
/metadata.json"},"ev_c618047edd493e186e0ab38b":{"id":"ev_c618047edd493e186e0ab38b","source_id":"src_4fac6ee3488caa06c0
a864ae","source_kind":"context","title":"CTX-0083-001","path":"assets/WELL-0083/context.jsonl"},"ev_9f1e40b0a74614ccd8
20ee83":{"id":"ev_9f1e40b0a74614ccd820ee83","source_id":"src_f5c214725f20d7202a74c81d","source_kind":"inspections","ti
tle":"INS-0086-0218","path":"assets/WELL-0086/inspections.jsonl"},"ev_4a821caf2e13e71497a32788":{"id":"ev_4a821caf2e13
e71497a32788","source_id":"src_c119b5e441ef058f0726bbf7","source_kind":"metadata","title":"WELL-0086","path":"assets/W
ELL-0086/metadata.json"},"ev_2915bfebd6745194c65924ca":{"id":"ev_2915bfebd6745194c65924ca","source_id":"src_55e784f005
c537484544deb1","source_kind":"context","title":"CTX-0086-001","path":"assets/WELL-0086/context.jsonl"},"ev_377fbd57c1
9a0483af9f83aa":{"id":"ev_377fbd57c19a0483af9f83aa","source_id":"src_0df398af80bbc2c89db420df","source_kind":"inspecti
ons","title":"INS-0088-0220","path":"assets/WELL-0088/inspections.jsonl"},"ev_df9a0fe1e3c53d623e48e939":{"id":"ev_df9a
0fe1e3c53d623e48e939","source_id":"src_852bc182f8b62ed8b114bd1d","source_kind":"metadata","title":"WELL-0088","path":"
assets/WELL-0088/metadata.json"},"ev_8f501ad1150c900472f6a010":{"id":"ev_8f501ad1150c900472f6a010","source_id":"src_94
622e367c30a22ea00c6a22","source_kind":"context","title":"CTX-0088-001","path":"assets/WELL-0088/context.jsonl"},"ev_46
852bd332b56eeece88b3a3":{"id":"ev_46852bd332b56eeece88b3a3","source_id":"src_c182b61ffb4f5391e52a83d6","source_kind":"
inspections","title":"INS-0092-0212","path":"assets/WELL-0092/inspections.jsonl"},"ev_d6ca1ebda1649d9600eae792":{"id":
"ev_d6ca1ebda1649d9600eae792","source_id":"src_423208ceb9134d1e1c866004","source_kind":"metadata","title":"WELL-0092",
"path":"assets/WELL-0092/metadata.json"},"ev_670aa75d08ecb096839afd83":{"id":"ev_670aa75d08ecb096839afd83","source_id"
:"src_b5f20dd0ef702a027ba53689","source_kind":"context","title":"CTX-0092-001","path":"assets/WELL-0092/context.jsonl"
},"ev_02c4e8558bd85df285f5ff0e":{"id":"ev_02c4e8558bd85df285f5ff0e","source_id":"src_80e18f35bbbae3c7d3ffae12","source
_kind":"inspections","title":"INS-0095-0217","path":"assets/WELL-0095/inspections.jsonl"},"ev_e0ed5244938bee7aefe51314
":{"id":"ev_e0ed5244938bee7aefe51314","source_id":"src_1f306483f645df57331c0bce","source_kind":"metadata","title":"WEL
L-0095","path":"assets/WELL-0095/metadata.json"},"ev_44124b0ac1afdac84ff98435":{"id":"ev_44124b0ac1afdac84ff98435","so
urce_id":"src_2f554ef285051e85d0daa30a","source_kind":"context","title":"CTX-0095-001","path":"assets/WELL-0095/contex
t.jsonl"},"ev_a71f6c85521fedd363808cc4":{"id":"ev_a71f6c85521fedd363808cc4","source_id":"src_54e1f5f2c2d027b39032980b"
,"source_kind":"inspections","title":"INS-0098-0215","path":"assets/WELL-0098/inspections.jsonl"},"ev_d1f40f820f7532c1
00c605c5":{"id":"ev_d1f40f820f7532c100c605c5","source_id":"src_d7a9aca0dd1253257a8d18b7","source_kind":"metadata","tit
le":"WELL-0098","path":"assets/WELL-0098/metadata.json"},"ev_a2414aa446afc58ee7eb5fc2":{"id":"ev_a2414aa446afc58ee7eb5
fc2","source_id":"src_c6fc862d435c42d500cdd104","source_kind":"context","title":"CTX-0098-001","path":"assets/WELL-009
8/context.jsonl"},"ev_0ab9431eeb73c15dbb8e47ee":{"id":"ev_0ab9431eeb73c15dbb8e47ee","source_id":"src_4474697d536bfcc8e
6e9537a","source_kind":"inspections","title":"INS-0100-0213","path":"assets/WELL-0100/inspections.jsonl"},"ev_85f479b4
c0061c8450a8b18d":{"id":"ev_85f479b4c0061c8450a8b18d","source_id":"src_59765aea5b8ef99f54b293b9","source_kind":"metada
ta","title":"WELL-0100","path":"assets/WELL-0100/metadata.json"},"ev_6cb17d0270acb8e3ad6f276d":{"id":"ev_6cb17d0270acb
8e3ad6f276d","source_id":"src_d45cfc14aae0d6173e8f699d","source_kind":"context","title":"CTX-0100-001","path":"assets/
WELL-0100/context.jsonl"},"ev_7e362ff1ff342c3514e3c823":{"id":"ev_7e362ff1ff342c3514e3c823","source_id":"src_5893bad9f

924b5277bea3772","source_kind":"inspections","title":"INS-0102-0219","path":"assets/WELL-0102/inspections.jsonl"},"ev_
ee2adac7565786b35105adb7":{"id":"ev_ee2adac7565786b35105adb7","source_id":"src_2e1f971f7607c004149609a2","source_kind"
:"metadata","title":"WELL-0102","path":"assets/WELL-0102/metadata.json"},"ev_7a3d09ac7ec70ce704f168fa":{"id":"ev_7a3d0
9ac7ec70ce704f168fa","source_id":"src_53321dd8740754f5a88708ea","source_kind":"context","title":"CTX-0102-001","path":
"assets/WELL-0102/context.jsonl"},"ev_a0d20c5ae8b736b2a96c4808":{"id":"ev_a0d20c5ae8b736b2a96c4808","source_id":"src_6
58fc52aed980709317668b5","source_kind":"inspections","title":"INS-0103-0220","path":"assets/WELL-0103/inspections.json
l"},"ev_08b859ba7f34ffca74494a3c":{"id":"ev_08b859ba7f34ffca74494a3c","source_id":"src_1febc977e21f003d3faacfd9","sour
ce_kind":"metadata","title":"WELL-0103","path":"assets/WELL-0103/metadata.json"},"ev_d97ca3979093c765fbfeac70":{"id":"
ev_d97ca3979093c765fbfeac70","source_id":"src_bb51b25fff6d61853ca53483","source_kind":"context","title":"CTX-0103-001"
,"path":"assets/WELL-0103/context.jsonl"},"ev_c309f3c0f1afe006bab5af0e":{"id":"ev_c309f3c0f1afe006bab5af0e","source_id
":"src_cd975dabc24fc3b5c322fb01","source_kind":"inspections","title":"INS-0106-0160","path":"assets/WELL-0106/inspecti
ons.jsonl"},"ev_1ab43b6195eb54c9ddf03376":{"id":"ev_1ab43b6195eb54c9ddf03376","source_id":"src_b69266d7b32948f9a881706
c","source_kind":"metadata","title":"WELL-0106","path":"assets/WELL-0106/metadata.json"},"ev_4b24873b67dbc78bf1a0e3a0"
:{"id":"ev_4b24873b67dbc78bf1a0e3a0","source_id":"src_fa87d6f1e60f6767a0f1dfd3","source_kind":"context","title":"CTX-0
106-001","path":"assets/WELL-0106/context.jsonl"},"ev_4c68c6645a0286ada2c0d21e":{"id":"ev_4c68c6645a0286ada2c0d21e","s
ource_id":"src_1b463eaa69905762687cf8e5","source_kind":"inspections","title":"INS-0107-0222","path":"assets/WELL-0107/
inspections.jsonl"},"ev_2650c6ee108ef31710aebcc8":{"id":"ev_2650c6ee108ef31710aebcc8","source_id":"src_4cb1711930b3744
8e5c13d4d","source_kind":"metadata","title":"WELL-0107","path":"assets/WELL-0107/metadata.json"},"ev_954278a8f38bb1d86
eb1a0e5":{"id":"ev_954278a8f38bb1d86eb1a0e5","source_id":"src_55a1890989ac4158d58271d9","source_kind":"context","title
":"CTX-0107-001","path":"assets/WELL-0107/context.jsonl"},"ev_40f21185a803c30abc6f4dad":{"id":"ev_40f21185a803c30abc6f
4dad","source_id":"src_4187fcdf0352b7933d0b5449","source_kind":"inspections","title":"INS-0111-0216","path":"assets/WE
LL-0111/inspections.jsonl"},"ev_423cce5779161a042d1d8900":{"id":"ev_423cce5779161a042d1d8900","source_id":"src_02ad3a1
4e49819c2b629ae02","source_kind":"metadata","title":"WELL-0111","path":"assets/WELL-0111/metadata.json"},"ev_0758f615d
97f3b09efca9db5":{"id":"ev_0758f615d97f3b09efca9db5","source_id":"src_07ed811034d302cc38a64abf","source_kind":"context
","title":"CTX-0111-001","path":"assets/WELL-0111/context.jsonl"},"ev_4e7b6eece098b7a52ba4b703":{"id":"ev_4e7b6eece098
b7a52ba4b703","source_id":"src_545b78a850d3107637cf772d","source_kind":"inspections","title":"INS-0122-0219","path":"a
ssets/WELL-0122/inspections.jsonl"},"ev_4870e5f96589e32a4b1e4676":{"id":"ev_4870e5f96589e32a4b1e4676","source_id":"src
_13cb0840ddefc80161c420d9","source_kind":"metadata","title":"WELL-0122","path":"assets/WELL-0122/metadata.json"},"ev_9
d12e4bff327282025e59070":{"id":"ev_9d12e4bff327282025e59070","source_id":"src_cfbb2ba26d6e2bc628ea315d","source_kind":
"context","title":"CTX-0122-001","path":"assets/WELL-0122/context.jsonl"},"ev_73bef1ac23dc39648de77489":{"id":"ev_73be
f1ac23dc39648de77489","source_id":"src_37112cfdc630430dca55f95a","source_kind":"inspections","title":"INS-0124-0216","
path":"assets/WELL-0124/inspections.jsonl"},"ev_c9b6b3162cfbc235bd2de98c":{"id":"ev_c9b6b3162cfbc235bd2de98c","source_
id":"src_a967ad7d0d9f03396948953b","source_kind":"metadata","title":"WELL-0124","path":"assets/WELL-0124/metadata.json
"},"ev_356fa0d816d4b8fd8a5f7767":{"id":"ev_356fa0d816d4b8fd8a5f7767","source_id":"src_bf6afacb10e929f6706078b8","sourc
e_kind":"context","title":"CTX-0124-001","path":"assets/WELL-0124/context.jsonl"},"ev_01833da7d66df475c0ac81f0":{"id":
"ev_01833da7d66df475c0ac81f0","source_id":"src_11c5c4819ee5e8f3884a492e","source_kind":"inspections","title":"INS-0126
-0204","path":"assets/WELL-0126/inspections.jsonl"},"ev_bbf43552fee695d625c9d8cd":{"id":"ev_bbf43552fee695d625c9d8cd",
"source_id":"src_a0142b2c0f1e28cdfac55e12","source_kind":"metadata","title":"WELL-0126","path":"assets/WELL-0126/metad
ata.json"},"ev_dc18db3b802b381011b8fb20":{"id":"ev_dc18db3b802b381011b8fb20","source_id":"src_c9b1960118ec610b66a403b9
","source_kind":"context","title":"CTX-0126-001","path":"assets/WELL-0126/context.jsonl"},"ev_2252c54e9ad0be205565be43
":{"id":"ev_2252c54e9ad0be205565be43","source_id":"src_50601a960c6456579e230e51","source_kind":"inspections","title":"
INS-0128-0215","path":"assets/WELL-0128/inspections.jsonl"},"ev_7de428bae9189303955a3ad4":{"id":"ev_7de428bae918930395
5a3ad4","source_id":"src_4bec4c448dc2ec5827395e4a","source_kind":"metadata","title":"WELL-0128","path":"assets/WELL-01
28/metadata.json"},"ev_3db9bfdc457dea515fed4d33":{"id":"ev_3db9bfdc457dea515fed4d33","source_id":"src_8695cc5c0baf37c2
a065c117","source_kind":"context","title":"CTX-0128-002","path":"assets/WELL-0128/context.jsonl"},"ev_dbc09d50bead1541
c535f767":{"id":"ev_dbc09d50bead1541c535f767","source_id":"src_999d2907f17b5cef33b94d5b","source_kind":"inspections","
title":"INS-0132-0220","path":"assets/WELL-0132/inspections.jsonl"},"ev_d12f1a67bd060771ad167257":{"id":"ev_d12f1a67bd
060771ad167257","source_id":"src_1cbf2d95af33ae5188449cf8","source_kind":"metadata","title":"WELL-0132","path":"assets
/WELL-0132/metadata.json"},"ev_0642db05e370c701e6fdc18f":{"id":"ev_0642db05e370c701e6fdc18f","source_id":"src_448202ba
be9278e4a24dc6f7","source_kind":"context","title":"CTX-0132-001","path":"assets/WELL-0132/context.jsonl"},"ev_4e69e029
fc2793c07457f9fa":{"id":"ev_4e69e029fc2793c07457f9fa","source_id":"src_0bc878d5e3741080a833ee74","source_kind":"inspec
tions","title":"INS-0137-0217","path":"assets/WELL-0137/inspections.jsonl"},"ev_9bbd8c4ce93bb03b77838dbd":{"id":"ev_9b
bd8c4ce93bb03b77838dbd","source_id":"src_2480657834eefa619379d868","source_kind":"metadata","title":"WELL-0137","path"
:"assets/WELL-0137/metadata.json"},"ev_9bf26c0011b9dcd7b67a4703":{"id":"ev_9bf26c0011b9dcd7b67a4703","source_id":"src_
f35d3b41491b38f348d4b4ae","source_kind":"context","title":"CTX-0137-001","path":"assets/WELL-0137/context.jsonl"},"ev_
ca443934473b5f95fd8b3304":{"id":"ev_ca443934473b5f95fd8b3304","source_id":"src_87de9fe95f61b69e9ae96947","source_kind"
:"inspections","title":"INS-0171-0203","path":"assets/WELL-0171/inspections.jsonl"},"ev_dcd97529f1acd812498a60e5":{"id
":"ev_dcd97529f1acd812498a60e5","source_id":"src_7e43341605442abe15c90bbe","source_kind":"metadata","title":"WELL-0171
","path":"assets/WELL-0171/metadata.json"},"ev_fb8c82c053c64cad78fe2b0d":{"id":"ev_fb8c82c053c64cad78fe2b0d","source_i
d":"src_e264dbbcf17510cfdd867626","source_kind":"context","title":"CTX-0171-001","path":"assets/WELL-0171/context.json
l"},"ev_6eb3a1ad958e69f08bc706e1":{"id":"ev_6eb3a1ad958e69f08bc706e1","source_id":"src_2a2152d72f07f553a1a060f1","sour
ce_kind":"inspections","title":"INS-0173-0215","path":"assets/WELL-0173/inspections.jsonl"},"ev_a653f3dbe2c5f77a26718a
ef":{"id":"ev_a653f3dbe2c5f77a26718aef","source_id":"src_af71502aec06da970d12f293","source_kind":"metadata","title":"W
ELL-0173","path":"assets/WELL-0173/metadata.json"},"ev_20edcb1efc83dad580e39e33":{"id":"ev_20edcb1efc83dad580e39e33","
source_id":"src_3bf9d97908091d468b286d92","source_kind":"context","title":"CTX-0173-001","path":"assets/WELL-0173/cont
ext.jsonl"},"ev_719194ad94b291b38b60d699":{"id":"ev_719194ad94b291b38b60d699","source_id":"src_b1abe79306c831419bde3f5
c","source_kind":"inspections","title":"INS-0188-0218","path":"assets/WELL-0188/inspections.jsonl"},"ev_56b7275c9a703d
a76cf584df":{"id":"ev_56b7275c9a703da76cf584df","source_id":"src_a6dd204f7583d8c59dc87435","source_kind":"metadata","t
itle":"WELL-0188","path":"assets/WELL-0188/metadata.json"},"ev_747a4251e5cf9c7ff4194aac":{"id":"ev_747a4251e5cf9c7ff41
94aac","source_id":"src_597312938378a779bd507f3d","source_kind":"context","title":"CTX-0188-001","path":"assets/WELL-0
188/context.jsonl"},"ev_cf31246f691f828e415f15d5":{"id":"ev_cf31246f691f828e415f15d5","source_id":"src_da4a5f79e719c88
09cea23d1","source_kind":"inspections","title":"INS-0191-0218","path":"assets/WELL-0191/inspections.jsonl"},"ev_1d72c7
3ed1e765f83a6cb706":{"id":"ev_1d72c73ed1e765f83a6cb706","source_id":"src_8c2849a75e1fa1c4dfca4fb8","source_kind":"meta
data","title":"WELL-0191","path":"assets/WELL-0191/metadata.json"},"ev_61aa0e9eeab41f472e229495":{"id":"ev_61aa0e9eeab
41f472e229495","source_id":"src_63d68d93e12726837e6f0695","source_kind":"context","title":"CTX-0191-001","path":"asset
s/WELL-0191/context.jsonl"},"ev_ce3315aa984dfc9a13dc8ffa":{"id":"ev_ce3315aa984dfc9a13dc8ffa","source_id":"src_dbfb5c6
f10b29151b08da319","source_kind":"inspections","title":"INS-0218-0218","path":"assets/WELL-0218/inspections.jsonl"},"e
v_c5da926c6acefb02c9f0412f":{"id":"ev_c5da926c6acefb02c9f0412f","source_id":"src_82cf4402fae0a47d02a43b6b","source_kin
d":"metadata","title":"WELL-0218","path":"assets/WELL-0218/metadata.json"},"ev_e0e064a2eb1d066f3b20cea6":{"id":"ev_e0e
064a2eb1d066f3b20cea6","source_id":"src_dd29ecbd90e59e27ef1a3f78","source_kind":"context","title":"CTX-0218-001","path
":"assets/WELL-0218/context.jsonl"},"ev_d7d56958bdf6831f8cc05828":{"id":"ev_d7d56958bdf6831f8cc05828","source_id":"src
_aaba7871112b9888431430cf","source_kind":"inspections","title":"INS-0219-0171","path":"assets/WELL-0219/inspections.js
onl"},"ev_56d9007333833b3825223dc7":{"id":"ev_56d9007333833b3825223dc7","source_id":"src_c4f0febc8613212620c3c02d","so
urce_kind":"metadata","title":"WELL-0219","path":"assets/WELL-0219/metadata.json"},"ev_6f49b85303e1263ae930643f":{"id"
:"ev_6f49b85303e1263ae930643f","source_id":"src_e2dcf3b9a8a87d3df1926b07","source_kind":"context","title":"CTX-0219-00

6","path":"assets/WELL-0219/context.jsonl"},"ev_69640446ef45090e0293a0cf":{"id":"ev_69640446ef45090e0293a0cf","source_
id":"src_f76682a5e2c9076080a09eec","source_kind":"inspections","title":"INS-0226-0216","path":"assets/WELL-0226/inspec
tions.jsonl"},"ev_f64a0b97d81afb9b6d1242aa":{"id":"ev_f64a0b97d81afb9b6d1242aa","source_id":"src_9bf8c1f808530aeb42de5
95e","source_kind":"metadata","title":"WELL-0226","path":"assets/WELL-0226/metadata.json"},"ev_97124e128ade7d3be2e888b
6":{"id":"ev_97124e128ade7d3be2e888b6","source_id":"src_5108efb1e7a0d73b3e85ba39","source_kind":"context","title":"CTX
-0226-001","path":"assets/WELL-0226/context.jsonl"},"ev_1638cc4892f2fdb789faf1ec":{"id":"ev_1638cc4892f2fdb789faf1ec",
"source_id":"src_9fb2f87005781820906ad328","source_kind":"inspections","title":"INS-0240-0218","path":"assets/WELL-024
0/inspections.jsonl"},"ev_c4c98e392879d30a0716fb89":{"id":"ev_c4c98e392879d30a0716fb89","source_id":"src_a4dc1491dc9ea
a5a686f407c","source_kind":"metadata","title":"WELL-0240","path":"assets/WELL-0240/metadata.json"},"ev_c338e2bff344ba6
b624d782b":{"id":"ev_c338e2bff344ba6b624d782b","source_id":"src_dfe0c29d4c6cf1f05ecc77f8","source_kind":"context","tit
le":"CTX-0240-001","path":"assets/WELL-0240/context.jsonl"},"ev_d7e9776b9d5923406aee8c5d":{"id":"ev_d7e9776b9d5923406a
ee8c5d","source_id":"src_f84bb8b6711211b6ed3d3b64","source_kind":"inspections","title":"INS-0241-0215","path":"assets/
WELL-0241/inspections.jsonl"},"ev_ee63dc70c80698d8607dbe27":{"id":"ev_ee63dc70c80698d8607dbe27","source_id":"src_3f1e7
2ef7c9311d4c9d99416","source_kind":"metadata","title":"WELL-0241","path":"assets/WELL-0241/metadata.json"},"ev_6116c30
650afe4b652bce06e":{"id":"ev_6116c30650afe4b652bce06e","source_id":"src_b0414e8bcaa64958bab60d8a","source_kind":"conte
xt","title":"CTX-0241-001","path":"assets/WELL-0241/context.jsonl"},"ev_b67e8bb7d545804392aad608":{"id":"ev_b67e8bb7d5
45804392aad608","source_id":"src_fba526a45e378247595bd975","source_kind":"inspections","title":"INS-0249-0120","path":
"assets/WELL-0249/inspections.jsonl"},"ev_4ccfcc1b719f0f6b34641ddb":{"id":"ev_4ccfcc1b719f0f6b34641ddb","source_id":"s
rc_09848cfb8de66e525cd9b704","source_kind":"metadata","title":"WELL-0249","path":"assets/WELL-0249/metadata.json"},"ev
_7a995a511b7490944ef5b886":{"id":"ev_7a995a511b7490944ef5b886","source_id":"src_5a7515ae361c22dfdb83358f","source_kind
":"context","title":"CTX-0249-004","path":"assets/WELL-0249/context.jsonl"},"ev_b677423f9fee98df99fee661":{"id":"ev_b6
77423f9fee98df99fee661","source_id":"src_6e609611f13983ce2300ce52","source_kind":"inspections","title":"INS-0253-0218"
,"path":"assets/WELL-0253/inspections.jsonl"},"ev_e8cbc122e181df1130338857":{"id":"ev_e8cbc122e181df1130338857","sourc
e_id":"src_2bc054d61913479015074b02","source_kind":"metadata","title":"WELL-0253","path":"assets/WELL-0253/metadata.js
on"},"ev_e8506e04055c6869c08d2586":{"id":"ev_e8506e04055c6869c08d2586","source_id":"src_1e84f93bf846fe51fadcdcbe","sou
rce_kind":"context","title":"CTX-0253-001","path":"assets/WELL-0253/context.jsonl"},"ev_4091436310d556a54d555461":{"id
":"ev_4091436310d556a54d555461","source_id":"src_fdfddd9e2d0dae56266ff326","source_kind":"inspections","title":"INS-02
57-0219","path":"assets/WELL-0257/inspections.jsonl"},"ev_d683c9731bbfd99f0a314ffb":{"id":"ev_d683c9731bbfd99f0a314ffb
","source_id":"src_ac5128f4ed703f7d8bbd1439","source_kind":"metadata","title":"WELL-0257","path":"assets/WELL-0257/met
adata.json"},"ev_a66c588160715b23b7725d00":{"id":"ev_a66c588160715b23b7725d00","source_id":"src_031ecced336b52f036441c
d3","source_kind":"context","title":"CTX-0257-001","path":"assets/WELL-0257/context.jsonl"},"ev_e0156c5dcea6668bcbb87a
e0":{"id":"ev_e0156c5dcea6668bcbb87ae0","source_id":"src_95a607e90b8fd09097484410","source_kind":"inspections","title"
:"INS-0262-0219","path":"assets/WELL-0262/inspections.jsonl"},"ev_85ee6569eb8872f91bd21c20":{"id":"ev_85ee6569eb8872f9
1bd21c20","source_id":"src_b5f1a1ebc90dd5254618f301","source_kind":"metadata","title":"WELL-0262","path":"assets/WELL-
0262/metadata.json"},"ev_b05e7e27bac1ace3dd94836f":{"id":"ev_b05e7e27bac1ace3dd94836f","source_id":"src_9a098413e87862
775ea43345","source_kind":"context","title":"CTX-0262-001","path":"assets/WELL-0262/context.jsonl"},"ev_c03071a1734128
244737d8c1":{"id":"ev_c03071a1734128244737d8c1","source_id":"src_c28fc9f088108c87f838e923","source_kind":"inspections"
,"title":"INS-0266-0220","path":"assets/WELL-0266/inspections.jsonl"},"ev_ec26e458805348ccaa27d597":{"id":"ev_ec26e458
805348ccaa27d597","source_id":"src_8ec9aa216f1f9c9777a74ea2","source_kind":"metadata","title":"WELL-0266","path":"asse
ts/WELL-0266/metadata.json"},"ev_250177d11b8cc2401638bbd1":{"id":"ev_250177d11b8cc2401638bbd1","source_id":"src_df4816
d624eb0368bc6ff390","source_kind":"context","title":"CTX-0266-001","path":"assets/WELL-0266/context.jsonl"},"ev_bf154f
910c95962265df5d68":{"id":"ev_bf154f910c95962265df5d68","source_id":"src_b25f7b49f09a30b2403dfe3f","source_kind":"insp
ections","title":"INS-0267-0218","path":"assets/WELL-0267/inspections.jsonl"},"ev_617b7fff681baa108f7efc2a":{"id":"ev_
617b7fff681baa108f7efc2a","source_id":"src_a06a67a7aab15d5e3239080c","source_kind":"metadata","title":"WELL-0267","path
":"assets/WELL-0267/metadata.json"},"ev_07582aba3d2d5883f46b0d68":{"id":"ev_07582aba3d2d5883f46b0d68","source_id":"sr
c_f23de1f3a93b31beb0f6c9d5","source_kind":"context","title":"CTX-0267-001","path":"assets/WELL-0267/context.jsonl"},"e
v_2372dfc69ff5b4ca7b27ec30":{"id":"ev_2372dfc69ff5b4ca7b27ec30","source_id":"src_042ff8026f944ceb23b70837","source_kin
d":"inspections","title":"INS-0271-0217","path":"assets/WELL-0271/inspections.jsonl"},"ev_6803058b648794a10053bef2":{"
id":"ev_6803058b648794a10053bef2","source_id":"src_906515c621812bcaf56d228b","source_kind":"metadata","title":"WELL-02
71","path":"assets/WELL-0271/metadata.json"},"ev_7a08c8dc18573a27fc2d21e0":{"id":"ev_7a08c8dc18573a27fc2d21e0","source
_id":"src_04dbf16f54cfb257b9ff4572","source_kind":"context","title":"CTX-0271-001","path":"assets/WELL-0271/context.js
onl"},"ev_e0c0c6af54286c39c006ecc3":{"id":"ev_e0c0c6af54286c39c006ecc3","source_id":"src_2d0fb8bc04d086d073ecfd79","so
urce_kind":"inspections","title":"INS-0277-0219","path":"assets/WELL-0277/inspections.jsonl"},"ev_56633c60d9c04584d5be
a51c":{"id":"ev_56633c60d9c04584d5bea51c","source_id":"src_540fe4171638cfb1ed7f59d5","source_kind":"metadata","title":
"WELL-0277","path":"assets/WELL-0277/metadata.json"},"ev_4ebcd852f65b98797bd30349":{"id":"ev_4ebcd852f65b98797bd30349"
,"source_id":"src_433185fa68de35d3e555c2ad","source_kind":"context","title":"CTX-0277-001","path":"assets/WELL-0277/co
ntext.jsonl"},"ev_f9d7892a68662c478d1f61fb":{"id":"ev_f9d7892a68662c478d1f61fb","source_id":"src_b539a0d5c9e2ad589eb68
6f1","source_kind":"inspections","title":"INS-0279-0217","path":"assets/WELL-0279/inspections.jsonl"},"ev_27d2acafe199
6951fe08adcc":{"id":"ev_27d2acafe1996951fe08adcc","source_id":"src_1ca94746fc56a2c4de7d55bb","source_kind":"metadata",
"title":"WELL-0279","path":"assets/WELL-0279/metadata.json"},"ev_def89e6e73e242e50a477c59":{"id":"ev_def89e6e73e242e50
a477c59","source_id":"src_6cc7ca9f0b7caf865843098a","source_kind":"context","title":"CTX-0279-002","path":"assets/WELL
-0279/context.jsonl"},"ev_4ab76b0e43f8df8eaabc51fa":{"id":"ev_4ab76b0e43f8df8eaabc51fa","source_id":"src_6e8cb3e423569
ee0df934e84","source_kind":"inspections","title":"INS-0294-0217","path":"assets/WELL-0294/inspections.jsonl"},"ev_4139
89af9205c0e5a569920a":{"id":"ev_413989af9205c0e5a569920a","source_id":"src_f96e1babbe61732591305506","source_kind":"me
tadata","title":"WELL-0294","path":"assets/WELL-0294/metadata.json"},"ev_d9f6d611432f81406abb04b6":{"id":"ev_d9f6d6114
32f81406abb04b6","source_id":"src_a13cb5971ae926917ccb7ce5","source_kind":"context","title":"CTX-0294-001","path":"ass
ets/WELL-0294/context.jsonl"},"ev_1b55eb47a46fb6009f48d877":{"id":"ev_1b55eb47a46fb6009f48d877","source_id":"src_799f7
6b3b95b083f4dd11b3a","source_kind":"inspections","title":"INS-0295-0215","path":"assets/WELL-0295/inspections.jsonl"},
"ev_206ddc6d3efaa0532163ad8a":{"id":"ev_206ddc6d3efaa0532163ad8a","source_id":"src_042ed7e6871f8253313e1fbf","source_k
ind":"metadata","title":"WELL-0295","path":"assets/WELL-0295/metadata.json"},"ev_477cbf81dc1a4ae0eb443e78":{"id":"ev_4
77cbf81dc1a4ae0eb443e78","source_id":"src_962d1122bc7ae9070e4a7423","source_kind":"context","title":"CTX-0295-002","pa
th":"assets/WELL-0295/context.jsonl"},"ev_7cabe3fb75e0c725bfc05296":{"id":"ev_7cabe3fb75e0c725bfc05296","source_id":"s
rc_f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0216","path":"assets/WELL-0305/inspections.
jsonl"},"ev_a4f4cbab2ed8a1770afbcf5b":{"id":"ev_a4f4cbab2ed8a1770afbcf5b","source_id":"src_827164e72660ecb0547d8285","
source_kind":"metadata","title":"WELL-0305","path":"assets/WELL-0305/metadata.json"},"ev_3e7c914c90b36bb2db64fc62":{"id
":"ev_3e7c914c90b36bb2db64fc62","source_id":"src_f5a9fd97d067c429605d6b49","source_kind":"context","title":"CTX-0305-
001","path":"assets/WELL-0305/context.jsonl"},"ev_34225d7a92a3b52a315a0780":{"id":"ev_34225d7a92a3b52a315a0780","sourc
e_id":"src_1ec1e1c8f9bf7577d2cf397c","source_kind":"inspections","title":"INS-0317-0216","path":"assets/WELL-0317/insp
ections.jsonl"},"ev_c4274d22292ecd9249d248e2":{"id":"ev_c4274d22292ecd9249d248e2","source_id":"src_ba353549fed247a6741
7bead","source_kind":"metadata","title":"WELL-0317","path":"assets/WELL-0317/metadata.json"},"ev_7099a19be8776aacd58e5
200":{"id":"ev_7099a19be8776aacd58e5200","source_id":"src_c97f8d311da218b3e3648ba8","source_kind":"context","title":"C
TX-0317-001","path":"assets/WELL-0317/context.jsonl"},"ev_c1e4c29c668e1e584b9ba90c":{"id":"ev_c1e4c29c668e1e584b9ba90c
","source_id":"src_51c12f00c0fc146844a12f4a","source_kind":"inspections","title":"INS-0320-0215","path":"assets/WELL-0
320/inspections.jsonl"},"ev_3ae13bae56610b363b0a3d0a":{"id":"ev_3ae13bae56610b363b0a3d0a","source_id":"src_8fb37ab537b
91c6a374ea4a4","source_kind":"metadata","title":"WELL-0320","path":"assets/WELL-0320/metadata.json"},"ev_3d87d7b928620

```
e11bb316e86":{"id":"ev_3d87d7b928620e11bb316e86","source_id":"src_da7e6280dda1f3251688390d","source_kind":"context","t
itle":"CTX-0320-001","path":"assets/WELL-0320/context.jsonl"},"ev_b2b14c0a3bd5d842781d0400":{"id":"ev_b2b14c0a3bd5d842
781d0400","source_id":"src_1d5728353e199c868be02220","source_kind":"inspections","title":"INS-0323-0219","path":"asset
s/WELL-0323/inspections.jsonl"},"ev_9919a3b3c4adc79ea225718e":{"id":"ev_9919a3b3c4adc79ea225718e","source_id":"src_c87
02a4dd96025f3b199276e","source_kind":"metadata","title":"WELL-0323","path":"assets/WELL-0323/metadata.json"},"ev_5de9b
cb8272f1b4bbfd66a28":{"id":"ev_5de9bcb8272f1b4bbfd66a28","source_id":"src_8cc9d9c4f27a65615fa84342","source_kind":"con
text","title":"CTX-0323-002","path":"assets/WELL-0323/context.jsonl"},"ev_996d11d2b5b60808fabb06ea":{"id":"ev_996d11d2
b5b60808fabb06ea","source_id":"src_97afe029a2a2019bd7792f34","source_kind":"inspections","title":"INS-0328-0217","path
":"assets/WELL-0328/inspections.jsonl"},"ev_b375aed104e22e404d2c7ba5":{"id":"ev_b375aed104e22e404d2c7ba5","source_id":
"src_580d0adb217e75ad33bda6dc","source_kind":"metadata","title":"WELL-0328","path":"assets/WELL-0328/metadata.json"},"
ev_8ae06faf189c5987c2448e6c":{"id":"ev_8ae06faf189c5987c2448e6c","source_id":"src_6509018003bedd75d594b59a","source_ki
nd":"context","title":"CTX-0328-001","path":"assets/WELL-0328/context.jsonl"},"ev_fab6c2aa291da606dbc0a77a":{"id":"ev_
fab6c2aa291da606dbc0a77a","source_id":"src_9abb6d35cd02ee0a2b722c24","source_kind":"inspections","title":"INS-0330-021
3","path":"assets/WELL-0330/inspections.jsonl"},"ev_01242bd543f3dc7b548f9fa6":{"id":"ev_01242bd543f3dc7b548f9fa6","sou
rce_id":"src_db4f4ed7592394c712a1a1c7","source_kind":"metadata","title":"WELL-0330","path":"assets/WELL-0330/metadata.
json"},"ev_b112c7021ec0bfcf40977fce":{"id":"ev_b112c7021ec0bfcf40977fce","source_id":"src_0183517b58937086c9cd5bda","s
ource_kind":"context","title":"CTX-0330-002","path":"assets/WELL-0330/context.jsonl"},"ev_fab0de95336e9201c10980e6":{"
id":"ev_fab0de95336e9201c10980e6","source_id":"src_69cc9bd85277097f9cf6b326","source_kind":"inspections","title":"INS-
0332-0217","path":"assets/WELL-0332/inspections.jsonl"},"ev_630cef1e4aa799df8e2fccad":{"id":"ev_630cef1e4aa799df8e2fcc
ad","source_id":"src_1dde2aac8f318474821aa0ca","source_kind":"metadata","title":"WELL-0332","path":"assets/WELL-0332/m
etadata.json"},"ev_ba79b09a608a7421c875adcd":{"id":"ev_ba79b09a608a7421c875adcd","source_id":"src_e0e3eaab7de9d4dd04af
1edb","source_kind":"context","title":"CTX-0332-003","path":"assets/WELL-0332/context.jsonl"},"ev_6783450ed0e97a9354a9
adcd":{"id":"ev_6783450ed0e97a9354a9adcd","source_id":"src_bd104ad07d237e30887cbec6","source_kind":"inspections","titl
e":"INS-0333-0219","path":"assets/WELL-0333/inspections.jsonl"},"ev_a1612e0f1d7e31483dbfc633":{"id":"ev_a1612e0f1d7e31
483dbfc633","source_id":"src_451e620ec43b644f5d28061a","source_kind":"metadata","title":"WELL-0333","path":"assets/WEL
L-0333/metadata.json"},"ev_7abfc9900f22a11b1636e89d":{"id":"ev_7abfc9900f22a11b1636e89d","source_id":"src_4d5eff7bcf0c
bdf54b149950","source_kind":"context","title":"CTX-0333-001","path":"assets/WELL-0333/context.jsonl"},"ev_e7694c0c12e7
09e775b471a8":{"id":"ev_e7694c0c12e709e775b471a8","source_id":"src_8dbd73f66069c1f3ddde3704","source_kind":"inspection
s","title":"INS-0334-0218","path":"assets/WELL-0334/inspections.jsonl"},"ev_7444f11cdd9391ba37aead76":{"id":"ev_7444f1
1cdd9391ba37aead76","source_id":"src_264ac2dc46e6aaa1c38a8d29","source_kind":"metadata","title":"WELL-0334","path":"as
sets/WELL-0334/metadata.json"},"ev_8c192fa7f7f20daee69cd635":{"id":"ev_8c192fa7f7f20daee69cd635","source_id":"src_87bd
3d561d8638caad6984f0","source_kind":"context","title":"CTX-0334-001","path":"assets/WELL-0334/context.jsonl"},"ev_d36b
bff4d8661c03029486df":{"id":"ev_d36bbff4d8661c03029486df","source_id":"src_4b2136e33296426d557c9ebe","source_kind":"in
spections","title":"INS-0340-0218","path":"assets/WELL-0340/inspections.jsonl"},"ev_5ca751d4a55292dfa1928851":{"id":"e
v_5ca751d4a55292dfa1928851","source_id":"src_d5c667c3b0cbbec14ee8efc2","source_kind":"metadata","title":"WELL-0340","p
ath":"assets/WELL-0340/metadata.json"},"ev_c1cf48b2475bfd8000cfef47":{"id":"ev_c1cf48b2475bfd8000cfef47","source_id":"
src_718b75f7774caff2d7edb1fc","source_kind":"context","title":"CTX-0340-001","path":"assets/WELL-0340/context.jsonl"},
"ev_b70379b818b32e3187919a97":{"id":"ev_b70379b818b32e3187919a97","source_id":"src_298767296f70d987cef77c4d","source_k
ind":"inspections","title":"INS-0341-0113","path":"assets/WELL-0341/inspections.jsonl"},"ev_4241fa42224323b46ab8e0a6":
{"id":"ev_4241fa42224323b46ab8e0a6","source_id":"src_e9324e85373f0c7e92ee1e6f","source_kind":"metadata","title":"WELL-
0341","path":"assets/WELL-0341/metadata.json"},"ev_c9c5ffc1562ae50f2dc16d8d":{"id":"ev_c9c5ffc1562ae50f2dc16d8d","sour
ce_id":"src_6e512fdd5b7edbff6fb258a0","source_kind":"context","title":"CTX-0341-001","path":"assets/WELL-0341/context.
jsonl"},"ev_aa086bef5ed11c1c0232faf4":{"id":"ev_aa086bef5ed11c1c0232faf4","source_id":"src_14f008175846e9fc2a02b08c","
source_kind":"inspections","title":"INS-0354-0217","path":"assets/WELL-0354/inspections.jsonl"},"ev_affecec645d1944951
b4aaa5":{"id":"ev_affecec645d1944951b4aaa5","source_id":"src_4a216005b78c274afb0cef44","source_kind":"metadata","title
":"WELL-0354","path":"assets/WELL-0354/metadata.json"},"ev_a90a73491db7410dd1de577f":{"id":"ev_a90a73491db7410dd1de577
f","source_id":"src_f4c46ffc1823f19b0c97c7f6","source_kind":"context","title":"CTX-0354-001","path":"assets/WELL-0354/
context.jsonl"},"ev_1dc7fb6cd04eb87d0e99a593":{"id":"ev_1dc7fb6cd04eb87d0e99a593","source_id":"src_6f2fe09b13de5c6b0e1
e4c17","source_kind":"inspections","title":"INS-0355-0213","path":"assets/WELL-0355/inspections.jsonl"},"ev_7905ce6451
3d1436877cda69":{"id":"ev_7905ce64513d1436877cda69","source_id":"src_76945c3dbe5267b3e5ca3e1e","source_kind":"metadata
","title":"WELL-0355","path":"assets/WELL-0355/metadata.json"},"ev_b87ed26c3812889490049edd":{"id":"ev_b87ed26c3812889
490049edd","source_id":"src_bfa009343da6214a09a12172","source_kind":"context","title":"CTX-0355-004","path":"assets/WE
LL-0355/context.jsonl"},"ev_2dee99a0262c10836c3e06a2":{"id":"ev_2dee99a0262c10836c3e06a2","source_id":"src_10f1a667991
3fb6fd80626e0","source_kind":"inspections","title":"INS-0357-0217","path":"assets/WELL-0357/inspections.jsonl"},"ev_11
5f736e6c6b467181e1b86b":{"id":"ev_115f736e6c6b467181e1b86b","source_id":"src_424f244713566ae3c7033651","source_kind":"
metadata","title":"WELL-0357","path":"assets/WELL-0357/metadata.json"},"ev_2b683eb22eb1a387b09490f6":{"id":"ev_2b683eb
22eb1a387b09490f6","source_id":"src_802f23b0398f06c8281a512a","source_kind":"context","title":"CTX-0357-002","path":"a
ssets/WELL-0357/context.jsonl"},"ev_bffc5b9b6d6f908746a71d97":{"id":"ev_bffc5b9b6d6f908746a71d97","source_id":"src_72e
a8db26ff376191c08f52d","source_kind":"inspections","title":"INS-0359-0216","path":"assets/WELL-0359/inspections.jsonl"
},"ev_2b67dd4a819e40cae54c8234":{"id":"ev_2b67dd4a819e40cae54c8234","source_id":"src_43fcdf729dfd95e656db2d2d","source
_kind":"metadata","title":"WELL-0359","path":"assets/WELL-0359/metadata.json"},"ev_8d1c3bf6af75967b296a4a3a":{"id":"ev
_8d1c3bf6af75967b296a4a3a","source_id":"src_bbe6102637ab6590f8550f21","source_kind":"context","title":"CTX-0359-001","
path":"assets/WELL-0359/context.jsonl"},"ev_4e6131c9e1ec06e1b252c63d":{"id":"ev_4e6131c9e1ec06e1b252c63d","source_id":
"src_d743f7a71ca2a6a678f2995c","source_kind":"inspections","title":"INS-0360-0215","path":"assets/WELL-0360/inspection
s.jsonl"},"ev_6a467a03024d8491d33acfae":{"id":"ev_6a467a03024d8491d33acfae","source_id":"src_ad3600f039fd8fb062edd795"
,"source_kind":"metadata","title":"WELL-0360","path":"assets/WELL-0360/metadata.json"},"ev_a6e1f7ccfeedf2a7df78182a":{
"id":"ev_a6e1f7ccfeedf2a7df78182a","source_id":"src_2f9436eb05e2fa21b7b2d756","source_kind":"context","title":"CTX-036
0-002","path":"assets/WELL-0360/context.jsonl"},"ev_39b71d6ed91b3c31e8651725":{"id":"ev_39b71d6ed91b3c31e8651725","sou
rce_id":"src_3a2757a6341a9b51a2691357","source_kind":"inspections","title":"INS-0370-0215","path":"assets/WELL-0370/in
spections.jsonl"},"ev_24ab41ee1cfa53ba40fca34b":{"id":"ev_24ab41ee1cfa53ba40fca34b","source_id":"src_c73d989f3ada051e5
cb84e76","source_kind":"metadata","title":"WELL-0370","path":"assets/WELL-0370/metadata.json"},"ev_de5c36e909790c04e6d
0b03d":{"id":"ev_de5c36e909790c04e6d0b03d","source_id":"src_aa0a66d8a1c34a8887f0d293","source_kind":"context","title":
"CTX-0370-002","path":"assets/WELL-0370/context.jsonl"},"ev_f4ae844315dee5f96433f3a5":{"id":"ev_f4ae844315dee5f96433f3
a5","source_id":"src_0a9199de952e65609f33d205","source_kind":"inspections","title":"INS-0382-0216","path":"assets/WELL
-0382/inspections.jsonl"},"ev_5d5c9c87e7df121468c9672a":{"id":"ev_5d5c9c87e7df121468c9672a","source_id":"src_d0bd00e50
0fe24a9fad35185","source_kind":"metadata","title":"WELL-0382","path":"assets/WELL-0382/metadata.json"},"ev_de0c9c65e50
5408cb26cb0ff":{"id":"ev_de0c9c65e505408cb26cb0ff","source_id":"src_9edaae86b30b3b37761b600e","source_kind":"context",
"title":"CTX-0382-002","path":"assets/WELL-0382/context.jsonl"},"ev_3793afe65ab5702f7a20c4ca":{"id":"ev_3793afe65ab570
2f7a20c4ca","source_id":"src_46941d4545b3f04c3db17209","source_kind":"inspections","title":"INS-0394-0221","path":"ass
ets/WELL-0394/inspections.jsonl"},"ev_f74e9b506d81b9eef98497d2":{"id":"ev_f74e9b506d81b9eef98497d2","source_id":"src_2
33fa5c5ed08bb99d4ead350","source_kind":"metadata","title":"WELL-0394","path":"assets/WELL-0394/metadata.json"},"ev_32e
6573140fde0fbc56c0c74":{"id":"ev_32e6573140fde0fbc56c0c74","source_id":"src_b87235a78aa8aaa2f3a27179","source_kind":"c
ontext","title":"CTX-0394-001","path":"assets/WELL-0394/context.jsonl"},"ev_cef7bd534e3e7dc9737c83f4":{"id":"ev_cef7bd
534e3e7dc9737c83f4","source_id":"src_27d9c48c7dc98134be3a0bf5","source_kind":"inspections","title":"INS-0399-0217","pa
th":"assets/WELL-0399/inspections.jsonl"},"ev_4950ab4281f80d79262c1ddb":{"id":"ev_4950ab4281f80d79262c1ddb","source_id
```

```
":"src_7638159be2d34de1d87b8d19","source_kind":"metadata","title":"WELL-0399","path":"assets/WELL-0399/metadata.json"}
,"ev_34727afe65e28d811ec13504":{"id":"ev_34727afe65e28d811ec13504","source_id":"src_156620c27f91c4d4b796d256","source_
kind":"context","title":"CTX-0399-001","path":"assets/WELL-0399/context.jsonl"},"ev_89286af03a9043f8984b59ab":{"id":"e
v_89286af03a9043f8984b59ab","source_id":"src_ac5e641e726589fba2c36267","source_kind":"inspections","title":"INS-0406-0
216","path":"assets/WELL-0406/inspections.jsonl"},"ev_19388da8ab0d3a38f4f05770":{"id":"ev_19388da8ab0d3a38f4f05770","s
ource_id":"src_79075081bb2ab7c5d6a9b4ac","source_kind":"metadata","title":"WELL-0406","path":"assets/WELL-0406/metadat
a.json"},"ev_13857967e9bdb390dc77bd1c":{"id":"ev_13857967e9bdb390dc77bd1c","source_id":"src_bf2cbc0a6473eb5599e38d39",
"source_kind":"context","title":"CTX-0406-001","path":"assets/WELL-0406/context.jsonl"},"ev_d8a79b6a9785eaec62955978":
{"id":"ev_d8a79b6a9785eaec62955978","source_id":"src_ff6537529b16f80cf6ef49c0","source_kind":"inspections","title":"IN
S-0416-0214","path":"assets/WELL-0416/inspections.jsonl"},"ev_af61d24dcfd0a41f821e6e01":{"id":"ev_af61d24dcfd0a41f821e
6e01","source_id":"src_2f5b7a65fec8e7583b8033a1","source_kind":"metadata","title":"WELL-0416","path":"assets/WELL-0416
/metadata.json"},"ev_3e31d0f4a109a5d62292f36e":{"id":"ev_3e31d0f4a109a5d62292f36e","source_id":"src_eba5f684863cef711a
57b115","source_kind":"context","title":"CTX-0416-001","path":"assets/WELL-0416/context.jsonl"},"ev_dfcb0ff67a0b01470f
7a03c5":{"id":"ev_dfcb0ff67a0b01470f7a03c5","source_id":"src_844ad78f1a367a35a763b7cd","source_kind":"inspections","ti
tle":"INS-0419-0216","path":"assets/WELL-0419/inspections.jsonl"},"ev_d7e331540a04fb4fde449e14":{"id":"ev_d7e331540a04
fb4fde449e14","source_id":"src_aecc2df94371ecf2e18626d9","source_kind":"metadata","title":"WELL-0419","path":"assets/W
ELL-0419/metadata.json"},"ev_379c90c81807fd8a7c9bfa03":{"id":"ev_379c90c81807fd8a7c9bfa03","source_id":"src_886511450b
6a62c55e39e736","source_kind":"context","title":"CTX-0419-001","path":"assets/WELL-0419/context.jsonl"},"ev_c0a528f5fa
65ac2550f347b8":{"id":"ev_c0a528f5fa65ac2550f347b8","source_id":"src_94006826bed674bb2ed60ba0","source_kind":"inspecti
ons","title":"INS-0422-0215","path":"assets/WELL-0422/inspections.jsonl"},"ev_c20dc8d61ceec5634352d639":{"id":"ev_c20d
c8d61ceec5634352d639","source_id":"src_5caa525b62741649da07e298","source_kind":"metadata","title":"WELL-0422","path":"
assets/WELL-0422/metadata.json"},"ev_b8b1f5c506f7fbd74aea1cea":{"id":"ev_b8b1f5c506f7fbd74aea1cea","source_id":"src_bd
3168738fd9cb1797bd610c","source_kind":"context","title":"CTX-0422-003","path":"assets/WELL-0422/context.jsonl"},"ev_d4
a63e97717febf90cdcdfa7":{"id":"ev_d4a63e97717febf90cdcdfa7","source_id":"src_1a5cc8fb2e0f0263e0a835fd","source_kind":"
inspections","title":"INS-0429-0219","path":"assets/WELL-0429/inspections.jsonl"},"ev_1acbca9630ad9a6f342b5ccc":{"id":
"ev_1acbca9630ad9a6f342b5ccc","source_id":"src_67ae6086b515372d92dbf1b4","source_kind":"metadata","title":"WELL-0429",
"path":"assets/WELL-0429/metadata.json"},"ev_a93f2738f46de6f28b0cbcf2":{"id":"ev_a93f2738f46de6f28b0cbcf2","source_id"
:"src_a5970ab2bf9217cd963370d9","source_kind":"context","title":"CTX-0429-004","path":"assets/WELL-0429/context.jsonl"
},"ev_2456c004d6afdc378da01207":{"id":"ev_2456c004d6afdc378da01207","source_id":"src_5c5b44974a20b4eea4e3f6ae","source
_kind":"inspections","title":"INS-0431-0215","path":"assets/WELL-0431/inspections.jsonl"},"ev_55fdef72094e230edc053791
":{"id":"ev_55fdef72094e230edc053791","source_id":"src_8ddc33f3706db211de604615","source_kind":"metadata","title":"WEL
L-0431","path":"assets/WELL-0431/metadata.json"},"ev_b2a8d633980a7c08e6f07724":{"id":"ev_b2a8d633980a7c08e6f07724","so
urce_id":"src_dc4cc074b33f12288d0bc000","source_kind":"context","title":"CTX-0431-001","path":"assets/WELL-0431/contex
t.jsonl"},"ev_bbd38e94b48175900ceaa2e0":{"id":"ev_bbd38e94b48175900ceaa2e0","source_id":"src_d343563c59f706b62bbca5df"
,"source_kind":"inspections","title":"INS-0433-0219","path":"assets/WELL-0433/inspections.jsonl"},"ev_c44211594068d610
7454fb1f":{"id":"ev_c44211594068d6107454fb1f","source_id":"src_83854c2bf426598025ebabc8","source_kind":"metadata","tit
le":"WELL-0433","path":"assets/WELL-0433/metadata.json"},"ev_91d124f98f35668ddffb2cfc":{"id":"ev_91d124f98f35668ddffb2
cfc","source_id":"src_05917bfd1db46dfebe2f54d2","source_kind":"context","title":"CTX-0433-002","path":"assets/WELL-043
3/context.jsonl"},"ev_47948a6fd2b4b67699a1deb1":{"id":"ev_47948a6fd2b4b67699a1deb1","source_id":"src_e4b2cb844a012580e
00496d6","source_kind":"inspections","title":"INS-0437-0217","path":"assets/WELL-0437/inspections.jsonl"},"ev_2ea49388
780f0dd512349a62":{"id":"ev_2ea49388780f0dd512349a62","source_id":"src_5b3b92080095e596bc4ba168","source_kind":"metada
ta","title":"WELL-0437","path":"assets/WELL-0437/metadata.json"},"ev_99044e6744f7aab4c7236bef":{"id":"ev_99044e6744f7a
ab4c7236bef","source_id":"src_af86f47a5e77cc99b1db8a2d","source_kind":"context","title":"CTX-0437-001","path":"assets/
WELL-0437/context.jsonl"},"ev_2eb5edc18b69074f5c26c089":{"id":"ev_2eb5edc18b69074f5c26c089","source_id":"src_573753925
1f8fb7ec00dd822","source_kind":"inspections","title":"INS-0447-0218","path":"assets/WELL-0447/inspections.jsonl"},"ev_
352ada5226a463f3e2419020":{"id":"ev_352ada5226a463f3e2419020","source_id":"src_193414e764362aee3575e34d","source_kind"
:"metadata","title":"WELL-0447","path":"assets/WELL-0447/metadata.json"},"ev_a20cc06319139dfa6ec8196a":{"id":"ev_a20cc
06319139dfa6ec8196a","source_id":"src_03325d9fdd7c3b2851c0a04d","source_kind":"context","title":"CTX-0447-002","path":
"assets/WELL-0447/context.jsonl"},"ev_f447d905605b36dbbba03b95":{"id":"ev_f447d905605b36dbbba03b95","source_id":"src_2
ec5d12b62c067e4a1bcf337","source_kind":"inspections","title":"INS-0452-0219","path":"assets/WELL-0452/inspections.json
l"},"ev_0c2ddc9d5dd022c564ed4643":{"id":"ev_0c2ddc9d5dd022c564ed4643","source_id":"src_5b0f1048c741ff5507bfda05","sour
ce_kind":"metadata","title":"WELL-0452","path":"assets/WELL-0452/metadata.json"},"ev_677915dafc5a2213ea13dc4e":{"id":"
ev_677915dafc5a2213ea13dc4e","source_id":"src_4637d3b45c7c5bdf10b1367b","source_kind":"context","title":"CTX-0452-005"
,"path":"assets/WELL-0452/context.jsonl"},"ev_f67a392f80f864250b1c4506":{"id":"ev_f67a392f80f864250b1c4506","source_id
":"src_4732c8f2a1661ce950985601","source_kind":"inspections","title":"INS-0455-0110","path":"assets/WELL-0455/inspecti
ons.jsonl"},"ev_9c0fc249c4aa4a41933e5989":{"id":"ev_9c0fc249c4aa4a41933e5989","source_id":"src_578673b3664099564b01bcd
3","source_kind":"metadata","title":"WELL-0455","path":"assets/WELL-0455/metadata.json"},"ev_12b6796fd6750300b18a92f8"
:{"id":"ev_12b6796fd6750300b18a92f8","source_id":"src_a9d4ba2b41211d61177f99a5","source_kind":"context","title":"CTX-0
455-001","path":"assets/WELL-0455/context.jsonl"},"ev_0a98234236791eab41ce7c95":{"id":"ev_0a98234236791eab41ce7c95","s
ource_id":"src_c584b0358bcab2d20c24510c","source_kind":"inspections","title":"INS-0457-0218","path":"assets/WELL-0457/
inspections.jsonl"},"ev_676972ccf3c134176e46c7ec":{"id":"ev_676972ccf3c134176e46c7ec","source_id":"src_92fc9b7c84cc29d
c15507035","source_kind":"metadata","title":"WELL-0457","path":"assets/WELL-0457/metadata.json"},"ev_a69410a32237f0c3b
1f4cb89":{"id":"ev_a69410a32237f0c3b1f4cb89","source_id":"src_b2b6e48df224495fa1c6897b","source_kind":"context","title
":"CTX-0457-001","path":"assets/WELL-0457/context.jsonl"},"ev_7f7b092022848dc5694744d3":{"id":"ev_7f7b092022848dc56947
44d3","source_id":"src_36744fcb8d43f8ceb5778324","source_kind":"inspections","title":"INS-0459-0219","path":"assets/WE
LL-0459/inspections.jsonl"},"ev_2b424056ff5228ee37aac932":{"id":"ev_2b424056ff5228ee37aac932","source_id":"src_648791e
dab3dcdd1d7f48d18","source_kind":"metadata","title":"WELL-0459","path":"assets/WELL-0459/metadata.json"},"ev_c3a1c4431
94bdda3ef3c273b":{"id":"ev_c3a1c443194bdda3ef3c273b","source_id":"src_9826a9e43688842bc8a7d4dc","source_kind":"context
","title":"CTX-0459-001","path":"assets/WELL-0459/context.jsonl"},"ev_5496d0ac304c9480a46d32b0":{"id":"ev_5496d0ac304c
9480a46d32b0","source_id":"src_35749dd9a7048467f3bc8c90","source_kind":"inspections","title":"INS-0461-0219","path":"a
ssets/WELL-0461/inspections.jsonl"},"ev_732974a48806c67af6f141b4":{"id":"ev_732974a48806c67af6f141b4","source_id":"src
_128fab1da2949feac7abb64d","source_kind":"metadata","title":"WELL-0461","path":"assets/WELL-0461/metadata.json"},"ev_4
276011333de55b02e8a1ee1":{"id":"ev_4276011333de55b02e8a1ee1","source_id":"src_8c72d7f9f849bdfc8a98a32f","source_kind":
"context","title":"CTX-0461-001","path":"assets/WELL-0461/context.jsonl"},"ev_20b60eb6ae20593d630c5443":{"id":"ev_20b6
0eb6ae20593d630c5443","source_id":"src_11b90f1274fc6237b33a71c0","source_kind":"inspections","title":"INS-0463-0184","
path":"assets/WELL-0463/inspections.jsonl"},"ev_669f77cfb1ee3f27159701db":{"id":"ev_669f77cfb1ee3f27159701db","source_
id":"src_538fec289f186237431099a0","source_kind":"metadata","title":"WELL-0463","path":"assets/WELL-0463/metadata.json
"},"ev_55b694c5178722e73fb65806":{"id":"ev_55b694c5178722e73fb65806","source_id":"src_51ef31c8200c7c2789ec0fd5","sourc
e_kind":"context","title":"CTX-0463-001","path":"assets/WELL-0463/context.jsonl"},"ev_d9a2d1edaef07a4bb359544a":{"id":
"ev_d9a2d1edaef07a4bb359544a","source_id":"src_d7ffad86b1e75463d63114e5","source_kind":"inspections","title":"INS-0464
-0216","path":"assets/WELL-0464/inspections.jsonl"},"ev_f449c7ecc8ecbb39a01d641a":{"id":"ev_f449c7ecc8ecbb39a01d641a",
"source_id":"src_8de803f01e389edde0ba41da","source_kind":"metadata","title":"WELL-0464","path":"assets/WELL-0464/metad
ata.json"},"ev_348ae8dd3e166901da8e01b6":{"id":"ev_348ae8dd3e166901da8e01b6","source_id":"src_bdca9b07523af6a9ff4b0ee0
","source_kind":"context","title":"CTX-0464-001","path":"assets/WELL-0464/context.jsonl"},"ev_622d8bfda4ba5502af857f00
":{"id":"ev_622d8bfda4ba5502af857f00","source_id":"src_3a61fc78b24087b1871d9637","source_kind":"inspections","title":"
```

```
INS-0466-0218","path":"assets/WELL-0466/inspections.jsonl"},"ev_dfb43c703711ce31f30af323":{"id":"ev_dfb43c703711ce31f3
0af323","source_id":"src_b55c18922ed15dca0caf1e82","source_kind":"metadata","title":"WELL-0466","path":"assets/WELL-04
66/metadata.json"},"ev_eb4c218bd66981dda0479367":{"id":"ev_eb4c218bd66981dda0479367","source_id":"src_c74824cf03842f6b
25622914","source_kind":"context","title":"CTX-0466-001","path":"assets/WELL-0466/context.jsonl"},"ev_2c29de23256c88dc
9d51b300":{"id":"ev_2c29de23256c88dc9d51b300","source_id":"src_b7e89faa97785493b472c870","source_kind":"inspections","
title":"INS-0477-0197","path":"assets/WELL-0477/inspections.jsonl"},"result_27b669d49fcb4f0f9d09cf23b7b31d12":{"id":"r
esult_27b669d49fcb4f0f9d09cf23b7b31d12","source_id":"result_27b669d49fcb4f0f9d09cf23b7b31d12","source_kind":"aggregate
_lineage","title":"result_27b669d49fcb4f0f9d09cf23b7b31d12"},"ev_cfdf9392cb984c6d752bc08b":{"id":"ev_cfdf9392cb984c6d7
52bc08b","source_id":"src_1a94cdedb86a27ccd8618324","source_kind":"metadata","title":"WELL-0477","path":"assets/WELL-0
477/metadata.json"},"ev_7a8a07eb8c892e968204d863":{"id":"ev_7a8a07eb8c892e968204d863","source_id":"src_42625d8ffcd46fd
fe37e0427","source_kind":"context","title":"CTX-0477-002","path":"assets/WELL-0477/context.jsonl"},"ev_307663f0e9ad53f
8f34a2c61":{"id":"ev_307663f0e9ad53f8f34a2c61","source_id":"src_37c2134f247a6e0dfe08698e","source_kind":"inspections",
"title":"INS-0479-0213","path":"assets/WELL-0479/inspections.jsonl"},"ev_c5f120e395c6c2a3899d3916":{"id":"ev_c5f120e39
5c6c2a3899d3916","source_id":"src_457cbb59275c362ff5726910","source_kind":"metadata","title":"WELL-0479","path":"asset
s/WELL-0479/metadata.json"},"ev_100227afdc3881c757df7146":{"id":"ev_100227afdc3881c757df7146","source_id":"src_3efb028
213c95e79e236a620","source_kind":"context","title":"CTX-0479-004","path":"assets/WELL-0479/context.jsonl"},"ev_b859666
5107f59e3de32a965":{"id":"ev_b8596665107f59e3de32a965","source_id":"src_f11594d691fea014df984ffb","source_kind":"inspe
ctions","title":"INS-0481-0220","path":"assets/WELL-0481/inspections.jsonl"},"ev_030cc2f4485302a526dfdb4a":{"id":"ev_0
30cc2f4485302a526dfdb4a","source_id":"src_3dc4604d3ca3ab0bde9dcea7","source_kind":"metadata","title":"WELL-0481","path
":"assets/WELL-0481/metadata.json"},"ev_de4ba74bb6965b2b6df70d85":{"id":"ev_de4ba74bb6965b2b6df70d85","source_id":"src
_3d6e3669bdc485c4d995679b","source_kind":"context","title":"CTX-0481-006","path":"assets/WELL-0481/context.jsonl"},"ev
_eda499ca853d0705de31b171":{"id":"ev_eda499ca853d0705de31b171","source_id":"src_8b2c305e32f658a27709fd9a","source_kind
":"inspections","title":"INS-0495-0217","path":"assets/WELL-0495/inspections.jsonl"},"ev_a5cab3c006f685dab7c070a6":{"i
d":"ev_a5cab3c006f685dab7c070a6","source_id":"src_0f8e0c5fd9054f80d0cac6d7","source_kind":"metadata","title":"WELL-049
5","path":"assets/WELL-0495/metadata.json"},"ev_bad315a7e6b9475e28156e04":{"id":"ev_bad315a7e6b9475e28156e04","source_
id":"src_580b60d765366fa533fe0287","source_kind":"context","title":"CTX-0495-001","path":"assets/WELL-0495/context.jso
nl"},"ev_4719bf4bf5114f62de0fb524":{"id":"ev_4719bf4bf5114f62de0fb524","source_id":"src_2dbfa5204dbe55e07a79d8d7","sou
rce_kind":"inspections","title":"INS-0502-0219","path":"assets/WELL-0502/inspections.jsonl"},"ev_fb66432d89070a9b4a431
8ad":{"id":"ev_fb66432d89070a9b4a4318ad","source_id":"src_f5c5d55edd7084e5ec0efcbd","source_kind":"metadata","title":"
WELL-0502","path":"assets/WELL-0502/metadata.json"},"ev_bacf3347395f55c1d76d3cf3":{"id":"ev_bacf3347395f55c1d76d3cf3",
"source_id":"src_ffb78376b0569a5ada48d73c","source_kind":"context","title":"CTX-0502-002","path":"assets/WELL-0502/con
text.jsonl"},"ev_22d7adf55371b43371513fa6":{"id":"ev_22d7adf55371b43371513fa6","source_id":"src_ae2d9f2b3805beace20af6
fc","source_kind":"inspections","title":"INS-0505-0220","path":"assets/WELL-0505/inspections.jsonl"},"ev_3de7168d7ea6c
869ce1cc119":{"id":"ev_3de7168d7ea6c869ce1cc119","source_id":"src_f8d82f361b0e55db2243fb9e","source_kind":"metadata","
title":"WELL-0505","path":"assets/WELL-0505/metadata.json"},"ev_95af297a9ffb3d0ef737bacc":{"id":"ev_95af297a9ffb3d0ef7
37bacc","source_id":"src_f7253ba8f45091f0388e8db5","source_kind":"context","title":"CTX-0505-001","path":"assets/WELL-
0505/context.jsonl"},"ev_874407f2d767fb7defa1cab1":{"id":"ev_874407f2d767fb7defa1cab1","source_id":"src_2fa288fe79fc1f
6bf19becdf","source_kind":"inspections","title":"INS-0510-0221","path":"assets/WELL-0510/inspections.jsonl"},"ev_12aac
d350f31284b7421d772":{"id":"ev_12aacd350f31284b7421d772","source_id":"src_aad72f8218783d5bdf38c9b8","source_kind":"met
adata","title":"WELL-0510","path":"assets/WELL-0510/metadata.json"},"ev_bcac7268ab2dbe3395497cdd":{"id":"ev_bcac7268ab
2dbe3395497cdd","source_id":"src_f2d590e80fc55e2cbd02d0cc","source_kind":"context","title":"CTX-0510-002","path":"asse
ts/WELL-0510/context.jsonl"},"ev_8986faaef066c8aefa7ae417":{"id":"ev_8986faaef066c8aefa7ae417","source_id":"src_51055e
e83ce4e62d4ec11141","source_kind":"inspections","title":"INS-0512-0221","path":"assets/WELL-0512/inspections.jsonl"},"
ev_26a25e51dff191be55a5ff23":{"id":"ev_26a25e51dff191be55a5ff23","source_id":"src_01ef54280a23a620b2589984","source_ki
nd":"metadata","title":"WELL-0512","path":"assets/WELL-0512/metadata.json"},"ev_282434bb339c68e532ef4461":{"id":"ev_28
2434bb339c68e532ef4461","source_id":"src_3324f37570a2f99cda9075cd","source_kind":"context","title":"CTX-0512-001","pat
h":"assets/WELL-0512/context.jsonl"},"ev_8c1b440293b53f149a69c455":{"id":"ev_8c1b440293b53f149a69c455","source_id":"sr
c_6ace14a9d139fa9569a45d18","source_kind":"inspections","title":"INS-0523-0101","path":"assets/WELL-0523/inspections.j
sonl"},"ev_0166249114d1ad8b4274c66e":{"id":"ev_0166249114d1ad8b4274c66e","source_id":"src_807c3163cb05f5893d4bf2a2","s
ource_kind":"metadata","title":"WELL-0523","path":"assets/WELL-0523/metadata.json"},"ev_ee618a402ec2497e7e5c0d0a":{"id
":"ev_ee618a402ec2497e7e5c0d0a","source_id":"src_940fd5fa07540ed3429c580c","source_kind":"context","title":"CTX-0523-0
01","path":"assets/WELL-0523/context.jsonl"},"ev_833a5fd01b2e14510d04babc":{"id":"ev_833a5fd01b2e14510d04babc","source
_id":"src_0db773a18c08e2e1c31e209c","source_kind":"inspections","title":"INS-0525-0217","path":"assets/WELL-0525/inspe
ctions.jsonl"},"ev_ac2ad11c2e0a680f4809f581":{"id":"ev_ac2ad11c2e0a680f4809f581","source_id":"src_0f29503066468ed9734a
985a","source_kind":"metadata","title":"WELL-0525","path":"assets/WELL-0525/metadata.json"},"ev_56ec34014329987f4d26dd
b5":{"id":"ev_56ec34014329987f4d26ddb5","source_id":"src_6e00c4ac5b7eb88fac74fed6","source_kind":"context","title":"CT
X-0525-001","path":"assets/WELL-0525/context.jsonl"},"ev_5b8d1a4a0defbc33b347efb1":{"id":"ev_5b8d1a4a0defbc33b347efb1"
,"source_id":"src_09b7d62c5f6f4bf0fec01ad3","source_kind":"inspections","title":"INS-0531-0219","path":"assets/WELL-05
31/inspections.jsonl"},"ev_c1db8f7a6aaf439eafd6c2de":{"id":"ev_c1db8f7a6aaf439eafd6c2de","source_id":"src_3678ca42b7f8
2300bddc679a","source_kind":"metadata","title":"WELL-0531","path":"assets/WELL-0531/metadata.json"},"ev_8a5ec7b226002c
4eae90dd2a":{"id":"ev_8a5ec7b226002c4eae90dd2a","source_id":"src_ca9e09f0eb31630125c6f07f","source_kind":"context","ti
tle":"CTX-0531-001","path":"assets/WELL-0531/context.jsonl"},"ev_2f70ff67f6452884bb05ce34":{"id":"ev_2f70ff67f6452884b
b05ce34","source_id":"src_c5e7caeee6acee71ad24ef7c","source_kind":"inspections","title":"INS-0536-0218","path":"assets
/WELL-0536/inspections.jsonl"},"ev_87b6bdba244827d6bf2b6d79":{"id":"ev_87b6bdba244827d6bf2b6d79","source_id":"src_0b8c
f555917a1eca914ffa5f","source_kind":"metadata","title":"WELL-0536","path":"assets/WELL-0536/metadata.json"},"ev_7d524a
c8910644c7049c7b78":{"id":"ev_7d524ac8910644c7049c7b78","source_id":"src_ff6bd2b699a6f51c0c6d52ab","source_kind":"cont
ext","title":"CTX-0536-001","path":"assets/WELL-0536/context.jsonl"},"ev_7144928b9b70faa8b63509ef":{"id":"ev_7144928b9
b70faa8b63509ef","source_id":"src_1f15a2cf0d5bd958bca24703","source_kind":"inspections","title":"INS-0541-0218","path"
:"assets/WELL-0541/inspections.jsonl"},"ev_404d125ab38bd02df38cd308":{"id":"ev_404d125ab38bd02df38cd308","source_id":"
src_3e70e9b3c131ebe288d91016","source_kind":"metadata","title":"WELL-0541","path":"assets/WELL-0541/metadata.json"},"e
v_c471024d49394115d5acd012":{"id":"ev_c471024d49394115d5acd012","source_id":"src_cf2677f9cf275bb7cbcf2fe0","source_kin
d":"context","title":"CTX-0541-001","path":"assets/WELL-0541/context.jsonl"},"ev_f34955163a5208eeadac8c55":{"id":"ev_f
34955163a5208eeadac8c55","source_id":"src_a3ade33668ca35f6a8606f0c","source_kind":"inspections","title":"INS-0551-0221
","path":"assets/WELL-0551/inspections.jsonl"},"ev_3476d3f80b228110db6b763d":{"id":"ev_3476d3f80b228110db6b763d","sour
ce_id":"src_b1db1df51923180abb06337d","source_kind":"metadata","title":"WELL-0551","path":"assets/WELL-0551/metadata.j
son"},"ev_dd9f449c356eb532e4cf9c3c":{"id":"ev_dd9f449c356eb532e4cf9c3c","source_id":"src_b951a746f0f3967e9060ae05","so
urce_kind":"context","title":"CTX-0551-001","path":"assets/WELL-0551/context.jsonl"},"ev_40e053a05d5815f8702fbe5c":{"i
d":"ev_40e053a05d5815f8702fbe5c","source_id":"src_c0982a4f95954a719694c973","source_kind":"inspections","title":"INS-0
554-0218","path":"assets/WELL-0554/inspections.jsonl"},"ev_2e1a3c331e6187c5cb2b2189":{"id":"ev_2e1a3c331e6187c5cb2b218
9","source_id":"src_effecb7156747793cb387da8","source_kind":"metadata","title":"WELL-0554","path":"assets/WELL-0554/me
tadata.json"},"ev_581292c7bab4c66ab9f5fa46":{"id":"ev_581292c7bab4c66ab9f5fa46","source_id":"src_7ac6d5c26094fca74f983
68e","source_kind":"context","title":"CTX-0554-001","path":"assets/WELL-0554/context.jsonl"},"ev_fbf469fbe3f8c455bfef1
22d":{"id":"ev_fbf469fbe3f8c455bfef122d","source_id":"src_86d8c57e5ba1a0aa8657abff","source_kind":"inspections","title
":"INS-0556-0218","path":"assets/WELL-0556/inspections.jsonl"},"ev_4738ba30dd3d814f328fde88":{"id":"ev_4738ba30dd3d814
f328fde88","source_id":"src_f1209bdcb1fabfe0b3b47e84","source_kind":"metadata","title":"WELL-0556","path":"assets/WELL
```

```
-0556/metadata.json"},"ev_f145a8d6c54724463bfa6ffa":{"id":"ev_f145a8d6c54724463bfa6ffa","source_id":"src_6b733374ce4e0
9406b9517e3","source_kind":"context","title":"CTX-0556-001","path":"assets/WELL-0556/context.jsonl"},"ev_52d1d1d119f7b
d88e14df23f":{"id":"ev_52d1d1d119f7bd88e14df23f","source_id":"src_ffeda47c347b795387451e39","source_kind":"inspections
","title":"INS-0565-0160","path":"assets/WELL-0565/inspections.jsonl"},"ev_594092612a81b49240de6cc3":{"id":"ev_5940926
12a81b49240de6cc3","source_id":"src_2667ee3c58b6703643fe4006","source_kind":"metadata","title":"WELL-0565","path":"ass
ets/WELL-0565/metadata.json"},"ev_23de532915eed6a5b26ef746":{"id":"ev_23de532915eed6a5b26ef746","source_id":"src_e53d2
ec66319e0ae4a4a343c","source_kind":"context","title":"CTX-0565-001","path":"assets/WELL-0565/context.jsonl"},"ev_7dfd6
dffd49a6b2766d2ceae":{"id":"ev_7dfd6dffd49a6b2766d2ceae","source_id":"src_fa9979cc5bfc34d1005caccb","source_kind":"ins
pections","title":"INS-0571-0218","path":"assets/WELL-0571/inspections.jsonl"},"ev_13bc3796520b9fa6588cd564":{"id":"ev
_13bc3796520b9fa6588cd564","source_id":"src_3bbac28ed61ae93e1fb26129","source_kind":"metadata","title":"WELL-0571","pa
th":"assets/WELL-0571/metadata.json"},"ev_0b66cb176ea031a4547d5a22":{"id":"ev_0b66cb176ea031a4547d5a22","source_id":"s
rc_13a636de6b110385bf2af230","source_kind":"context","title":"CTX-0571-001","path":"assets/WELL-0571/context.jsonl"},"
ev_d1c147186c837715e1baecdd":{"id":"ev_d1c147186c837715e1baecdd","source_id":"src_5da1ac0e2a141decce4c05a7","source_ki
nd":"inspections","title":"INS-0575-0219","path":"assets/WELL-0575/inspections.jsonl"},"ev_d5b965ad4daba0f21f3adf02":{
"id":"ev_d5b965ad4daba0f21f3adf02","source_id":"src_443684fb92f3527275f53eec","source_kind":"metadata","title":"WELL-0
575","path":"assets/WELL-0575/metadata.json"},"ev_bfd0a2744e98b2c535e9a1fa":{"id":"ev_bfd0a2744e98b2c535e9a1fa","sourc
e_id":"src_3b485b7a0cff06316c6953e7","source_kind":"context","title":"CTX-0575-002","path":"assets/WELL-0575/context.j
sonl"},"ev_04d5d8733b3fc82b4885f7d6":{"id":"ev_04d5d8733b3fc82b4885f7d6","source_id":"src_b0d81a3102702b336fb2c832","s
ource_kind":"inspections","title":"INS-0600-0184","path":"assets/WELL-0600/inspections.jsonl"},"ev_b1e0a2548ba3357fa5e
28fda":{"id":"ev_b1e0a2548ba3357fa5e28fda","source_id":"src_f5c2245eed924f96fc048a33","source_kind":"metadata","title"
:"WELL-0600","path":"assets/WELL-0600/metadata.json"},"ev_79f3c79e2789bc9180b1b48d":{"id":"ev_79f3c79e2789bc9180b1b48d
","source_id":"src_ac26f73c6ecd344380ea1bf2","source_kind":"context","title":"CTX-0600-001","path":"assets/WELL-0600/c
ontext.jsonl"},"src_215c78036f52b5303b330fe0":{"id":"src_215c78036f52b5303b330fe0","source_id":"src_215c78036f52b5303b
330fe0","source_kind":"manual","title":"fleet/well-types/T200.md","path":"fleet/well-types/T200.md"},"src_0b27ec48fd9b
0f16a6cd84c6":{"id":"src_0b27ec48fd9b0f16a6cd84c6","source_id":"src_0b27ec48fd9b0f16a6cd84c6","source_kind":"manual","
title":"fleet/well-types/T350.md","path":"fleet/well-types/T350.md"},"src_330aa8bd8455ae32332cb94c":{"id":"src_330aa8b
d8455ae32332cb94c","source_id":"src_330aa8bd8455ae32332cb94c","source_kind":"manual","title":"fleet/well-types/T500.md
","path":"fleet/well-types/T500.md"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d
26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"O
bservation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-
8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":
"Observation reported by Robert Hayes"},"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d":{"id":"memory:0ce382ad-c21c-431d
-96bf-26d89c7d200d","source_id":"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d","source_kind":"private_memory","title":"
Preference reported by Nathan Pierce"},"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829":{"id":"memory:2868c56a-d0b7-408c-
a839-e5bbbd01c829","source_id":"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829","source_kind":"private_memory","title":"P
reference reported by Nathan Pierce"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-9
3c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"
Observation reported by Nathan Pierce"},"chunk_1f547c41485b0341feabe243":{"id":"chunk_1f547c41485b0341feabe243","sourc
e_id":"src_5f40723df2e1cfb76cd630ad","source_kind":"report","title":"What happened","path":"assets/WELL-0170/maintenan
ce-reports/MNT-0170-015.md"},"chunk_3947b0d04318999915a2559f":{"id":"chunk_3947b0d04318999915a2559f","source_id":"src_
788d118d5987d3d3d2915573","source_kind":"report","title":"What happened","path":"assets/WELL-0577/maintenance-reports/
MNT-0577-011.md"},"chunk_4ed61f5806c5a39db3f558d4":{"id":"chunk_4ed61f5806c5a39db3f558d4","source_id":"src_739a294e868
1a99a8b2790ed","source_kind":"report","title":"What happened","path":"assets/WELL-0019/maintenance-reports/MNT-0019-00
6.md"},"chunk_621c45a9b2aa357c35b45c25":{"id":"chunk_621c45a9b2aa357c35b45c25","source_id":"src_dee9e31e013bca941009c4
2c","source_kind":"report","title":"What happened","path":"assets/WELL-0169/maintenance-reports/MNT-0169-012.md"},"chu
nk_67142c6e9844a675497824e5":{"id":"chunk_67142c6e9844a675497824e5","source_id":"src_ab04bfac7b03f374781f1aca","source
_kind":"report","title":"What happened","path":"assets/WELL-0073/maintenance-reports/MNT-0073-017.md"}}
}
```

Question 7

Robert Hayes · Turn 1 · partial

Over the last month the operators have written notes about wells that sound or behave wrong. Which of those wells haven't had a repair since? Rank the 10 most likely to need a repair in the next 90 days, other than a spill clean-up, and quote the notes as evidence.


```json
{
  "schema_version": "1.0",
  "answer_id": "f1a1c8a8-2432-48ce-a4ad-314fd7ac284c",
  "thread_id": "bc7841cb-e9d3-4d05-bbcd-3db33212d6c5",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "I could not establish data for this selection. Please confirm the well and date range.",
  "blocks": [],
  "results": {},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Candidate ranking is an explicit heuristic, not a predicted probability. Absence of a later recorded corrective repair does not prove no field action occurred; targeted manual warning checks are not exhaustively implemented.","Ranked lexical retrieval cannot prove a fleet total or source absence","Report prose may predate corrections; a lexical hit does not confirm effective spill detection or current classification","The explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":false,"explanation_error_code":"invalid_narrative_citation","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":4793,"output_tokens":203,"total_tokens":4996,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":673,"live":true},{"stage":"maker","usage":{"input_tokens":3580,"output_tokens":351,"total_tokens":3931,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":680,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":3471,"output_tokens":380,"total_tokens":3851,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":687,"live":true}]},
  "evidence": {"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"chunk_5b4a0db26231c41d176d66ec":{"id":"chunk_5b4a0db26231c41d176d66ec","source_id":"src_c42cf9bf86260c3066da8dbd","source_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0001/maintenance-reports/MNT-0001-july-2025-prime-mover.md"},"chunk_04f4ee612a7785630a0b8157":{"id":"chunk_04f4ee612a7785630a0b8157","source_id":"src_8cf5d28f396db06c9fdc8901","source_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0578/maintenance-reports/MNT-0578-029.md"},"chunk_06354c4f1fb2627d00a04b17":{"id":"chunk_06354c4f1fb2627d00a04b17","source_id":"src_dd31ec6534dedd7c026ea63c","source_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0247/maintenance-reports/MNT-0247-030.md"},"chunk_06ce5714f2792fb454d1adab":{"id":"chunk_06ce5714f2792fb454d1adab","source_id":"src_10e3b04623306f993b30a945","source_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0020/maintenance-reports/MNT-0020-018.md"},"chunk_06e6d4ab865b265b166770a5":{"id":"chunk_06e6d4ab865b265b166770a5","source_id":"src_d7e9f4eb8391a9c752282387","source_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0546/maintenance-reports/MNT-0546-024.md"},"chunk_0711b9af3dab9dc1b3029d3f":{"id":"chunk_0711b9af3dab9dc1b3029d3f","source_id":"src_73e6cdba9c1192d08497a698","source_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0498/maintenance-reports/MNT-0498-022.md"}}
}
```


Robert Hayes · Turn 2 · complete

Which three would you send a crew to first this week, and why?


```json
{
  "schema_version": "1.0",
  "answer_id": "5999d57b-16d2-4222-b858-07aa15c6360e",
  "thread_id": "bc7841cb-e9d3-4d05-bbcd-3db33212d6c5",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Based on the priority screening results, the three wells to send a crew to first this week are WELL-0010 in Southwest Block 23, WELL-0175 in Northeast Block 8, and WELL-0197 in Northeast Block 8 [result_14b1278bec8b4cb9abf31fab5602b88a]. \n\n1. WELL-0010 has a priority score of 5, is currently not producing, and its latest note from 2027-01-14 stated: \"Heard fluid pound on WELL-0010, unit still running.\" [result_14b1278bec8b4cb9abf31fab5602b88a]. Its last repair was recorded on 2026-05-09 under ID MNT-0010-027 [result_14b1278bec8b4cb9abf31fab5602b88a].\n2. WELL-0175 has a priority score of 5, is currently not producing, and its latest note from 2026-12-26 stated: \"WELL-0175 tagging bottom on the downstroke, adjust spacing next visit.\" [result_14b1278bec8b4cb9abf31fab5602b88a]. Its last repair was recorded on 2026-05-30 under ID MNT-0175-031 [result_14b1278bec8b4cb9abf31fab5602b88a].\n3. WELL-0197 has a priority score of 5, is currently not producing, and its latest note from 2027-01-12 stated: \"Heard fluid pound on WELL-0197, unit still running.\" [result_14b1278bec8b4cb9abf31fab5602b88a]. Its last repair was recorded on 2027-01-01 under ID MNT-0197-029 [result_14b1278bec8b4cb9abf31fab5602b88a].\n\nThese selections reflect the top priorities from the evaluated candidate pool of 133 matching assets [result_14b1278bec8b4cb9abf31fab5602b88a]. A heuristic repair score is a screening judgement, not a calibrated failure probability or a guarantee of future failure [result_14b1278bec8b4cb9abf31fab5602b88a].",
  "blocks": [{"id":"5999d57b-16d2-4222-b858-07aa15c6360e:block:0","type":"table","title":"Top Priority Wells for Crew Dispatch","result_set_id":"result_14b1278bec8b4cb9abf31fab5602b88a","evidence_ids":["ev_99ce61fe5b653f23708a7034","ev_604416c15b73d057e4e5e4fa"],"encoding":{},"span":3}],
  "results": {"result_14b1278bec8b4cb9abf31fab5602b88a":{"result_set_id":"result_14b1278bec8b4cb9abf31fab5602b88a","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":4,"columns":[{
```

"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"latest_note_at","label":"Latest Note At"},{"key":"latest_note_quote","label":"Latest Note Quote"},{"key":"other_warning_signs","label":"Other Warning Signs"},{"key":"recent_readings","label":"Recent Readings"},{"key":"thermal_warning","label":"Thermal Warning"},{"key":"operator_notes","label":"Operator Notes"},{"key":"warning_note_count","label":"Warning Note Count"},{"key":"last_repair_id","label":"Last Repair Id"},{"key":"last_repair_at","label":"Last Repair At"},{"key":"producing","label":"Producing"},{"key":"assessment","label":"Assessment"},{"key":"priority_score","label":"Priority Score"},{"key":"ranking_basis","label":"Ranking Basis"},{"key":"rank","label":"Rank"}],"rows":[{"area_name":"Southwest Block 23","asset_id":"WELL-0010","priority_score":5,"latest_note_at":"2027-01-14T16:50:00Z","ranking_basis":"Unrepaired symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta warning in the note window; heuristic, not a calibrated 90-day forecast","warning_note_count":3,"thermal_warning":null,"latest_note_quote":"Heard fluid pound on WELL-0010, unit still running.","recent_readings":"[{\"inspection_id\": \"INS-0010-0216\", \"inspected_at\": \"2026-12-24T10:45:00Z\", \"well_type\": \"T350\", \"delta_c\": 32.5, \"delta_milli\": 32500, \"producing\": true}, {\"inspection_id\": \"INS-0010-0217\", \"inspected_at\": \"2026-12-31T14:00:00Z\", \"well_type\": \"T350\", \"delta_c\": 26.9, \"delta_milli\": 26900, \"producing\": true}, {\"inspection_id\": \"INS-0010-0218\", \"inspected_at\": \"2027-01-07T08:45:00Z\", \"well_type\": \"T350\", \"delta_c\": 29.1, \"delta_milli\": 29100, \"producing\": true}, {\"inspection_id\": \"INS-0010-0219\", \"inspected_at\": \"2027-01-14T14:00:00Z\", \"well_type\": \"T350\", \"delta_c\": 17.5, \"delta_milli\": 17500, \"producing\": false}]","producing":false,"last_repair_at":"2026-05-09T08:00:00Z","last_repair_id":"MNT-0010-027","assessment":"candidate","operator_notes":"[{\"note_id\": \"CTX-0010-005\", \"date\": \"2027-01-10T16:25:00Z\", \"quote\": \"Rod squeal at WELL-0010 stuffing box, greased the polished rod.\"}, {\"note_id\": \"CTX-0010-006\", \"date\": \"2027-01-13T12:25:00Z\", \"quote\": \"Rod squeal at WELL-0010 stuffing box, greased the polished rod.\"}, {\"note_id\": \"CTX-0010-007\", \"date\": \"2027-01-14T16:50:00Z\", \"quote\": \"Heard fluid pound on WELL-0010, unit still running.\"}]","rank":1,"other_warning_signs":"Currently not producing","area_id":"SW-23"},{"area_name":"Northeast Block 8","asset_id":"WELL-0175","priority_score":5,"latest_note_at":"2026-12-26T06:25:00Z","ranking_basis":"Unrepaired symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta warning in the note window; heuristic, not a calibrated 90-day forecast","warning_note_count":3,"thermal_warning":null,"latest_note_quote":"WELL-0175 tagging bottom on the downstroke, adjust spacing next visit.","recent_readings":"[{\"inspection_id\": \"INS-0175-0213\", \"inspected_at\": \"2026-12-24T09:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 30.1, \"delta_milli\": 30100, \"producing\": true}, {\"inspection_id\": \"INS-0175-0214\", \"inspected_at\": \"2026-12-31T09:00:00Z\", \"well_type\": \"T200\", \"delta_c\": 24.5, \"delta_milli\": 24500, \"producing\": true}, {\"inspection_id\": \"INS-0175-0215\", \"inspected_at\": \"2027-01-07T08:45:00Z\", \"well_type\": \"T200\", \"delta_c\": 26.9, \"delta_milli\": 26900, \"producing\": true}, {\"inspection_id\": \"INS-0175-0216\", \"inspected_at\": \"2027-01-14T10:00:00Z\", \"well_type\": \"T200\", \"delta_c\": 5.5, \"delta_milli\": 5500, \"producing\": false}]","producing":false,"last_repair_at":"2026-05-30T08:00:00Z","last_repair_id":"MNT-0175-031","assessment":"candidate","operator_notes":"[{\"note_id\": \"CTX-0175-003\", \"date\": \"2026-12-17T17:00:00Z\", \"quote\": \"Heard fluid pound on WELL-0175, unit still running.\"}, {\"note_id\": \"CTX-0175-006\", \"date\": \"2026-12-21T08:35:00Z\", \"quote\": \"Rod squeal at WELL-0175 stuffing box, greased the polished rod.\"}, {\"note_id\": \"CTX-0175-007\", \"date\": \"2026-12-26T06:25:00Z\", \"quote\": \"WELL-0175 tagging bottom on the downstroke, adjust spacing next visit.\"}]","rank":2,"other_warning_signs":"Currently not producing","area_id":"NE-08"},{"area_name":"Northeast Block 8","asset_id":"WELL-0197","priority_score":5,"latest_note_at":"2027-01-12T15:35:00Z","ranking_basis":"Unrepaired symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta warning in the note window; heuristic, not a calibrated 90-day forecast","warning_note_count":3,"thermal_warning":null,"latest_note_quote":"Heard fluid pound on WELL-0197, unit still running.","recent_readings":"[{\"inspection_id\": \"INS-0197-0211\", \"inspected_at\": \"2026-12-24T11:15:00Z\", \"well_type\": \"T200\", \"delta_c\": 19.0, \"delta_milli\": 19000, \"producing\": true}, {\"inspection_id\": \"INS-0197-0212\", \"inspected_at\": \"2026-12-31T11:00:00Z\", \"well_type\": \"T200\", \"delta_c\": 1.1, \"delta_milli\": 1100, \"producing\": false}, {\"inspection_id\": \"INS-0197-0213\", \"inspected_at\": \"2027-01-07T12:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 2.5, \"delta_milli\": 2500, \"producing\": false}, {\"inspection_id\": \"INS-0197-0214\", \"inspected_at\": \"2027-01-14T09:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 1.2, \"delta_milli\": 1200, \"producing\": false}]","producing":false,"last_repair_at":"2027-01-01T08:00:00Z","last_repair_id":"MNT-0197-029","assessment":"candidate","operator_notes":"[{\"note_id\": \"CTX-0197-002\", \"date\": \"2027-01-04T14:40:00Z\", \"quote\": \"Pumper reports rattling at WELL-0197 pump jack, keep an eye on it.\"}, {\"note_id\": \"CTX-0197-003\", \"date\": \"2027-01-08T14:15:00Z\", \"quote\": \"Heard fluid pound on WELL-0197, unit still running.\"}, {\"note_id\": \"CTX-0197-004\", \"date\": \"2027-01-12T15:35:00Z\", \"quote\": \"Heard fluid pound on WELL-0197, unit still running.\"}]","rank":3,"other_warning_signs":"Currently not producing","area_id":"NE-08"}],"evidence_ids":["ev_99ce61fe5b653f23708a7034","ev_665af8eaf61f85f490d8b20b","ev_fcb6b1391ea8f6ffb46563c1","ev_7addbd5958288789938c6acb","ev_6c948b50c556d28657254c4f","ev_0437521e35de62362c44d36e","ev_2549ee48ca81f9068c849b85","ev_1e978cf4c1a19269b984f5dc","ev_48e158d164259a5e9839e091","result_14b1278bec8b4cb9abf31fab5602b88a","ev_604416c15b73d057e4e5e4fa","ev_d90ea22b249a7fd40119a404","ev_bbcf6ef052f9a7428407b894","ev_0f6450308e92bf5c7ec8a307","ev_a25ea0c0468a862e2a29a5e7","ev_3f465073f16db27b35323276","ev_83e20c03a482b96d713bc3fb","ev_20cb34d51e425398a03a9d58","ev_c839bd3e6fc3ef002d85c207","ev_4a071e0a1234c051d19abfd8","ev_c5d24b601109069d6ea76092","ev_9db9578ee37d885be7ee18fd","ev_a15eaa6c56315f96326fcbf9","ev_5c4763c86d65d4af9dcb7b04","ev_93e620fc7a4a1e86db795d83","ev_112d05d5ccfb20e28870db09","ev_e395446335bd7e1ea36c93f5","ev_bc14f5be8c21e3efc9af16e8"],"provider_coverage":{"unit":"repair_candidates","matching":133,"evaluated":133,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":3,"output_rows":133,"display_truncated":true,"aggregation_input_truncated":false},"trace_id":"trace_33fc20b4c40a43fbb220b756b0239cca","warnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Candidate ranking is an explicit heuristic, not a predicted probability. Absence of a later recorded corrective repair does not prove no field action occurred; targeted manual warning checks are not exhaustively implemented."],"bounds":{"start":"2026-12-15","end":"2027-01-15","closure":"both"},"operation":{"collection":"maintenance","metric":"repair_candidates"},"summary":{"total_matching":133,"assessment_counts":{"candidate":133},"area_counts":{"Southwest Block 23":16,"Northeast Block 8":14,"Southwest Block 24":19,"Northwest Block 12":31,"Southeast Block 32":27,"Northeast Block 7":15,"Southeast Block 31":11}},"assessment_counts":{"candidate":133},"coverage":{"matching":133,"evaluated":133,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Candidate ranking is an explicit heuristic, not a predicted probability. Absence of a later recorded corrective repair does not prove no field action occurred; targeted manual warning checks are not exhaustively implemented."],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":4848,"output_tokens":178,"total_tokens":5026,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":690,"live":true},{"stage":"maker","usage":{"input_tokens":4885,"output_tokens":1629,"total_tokens":6514,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":694,"live":true}],"provider":"google","foreground_attempts":2,"live":true},

```
  "evidence": {"ev_99ce61fe5b653f23708a7034":{"id":"ev_99ce61fe5b653f23708a7034","source_id":"src_a6ff20019ce0e76bf774
f53c","source_kind":"metadata","title":"WELL-0010","path":"assets/WELL-0010/metadata.json"},"ev_665af8eaf61f85f490d8b2
0b":{"id":"ev_665af8eaf61f85f490d8b20b","source_id":"src_f4c925eade7030d1aedbb885","source_kind":"context","title":"CT
X-0010-005","path":"assets/WELL-0010/context.jsonl"},"ev_fcb6b1391ea8f6ffb46563c1":{"id":"ev_fcb6b1391ea8f6ffb46563c1"
,"source_id":"src_f4c925eade7030d1aedbb885","source_kind":"context","title":"CTX-0010-006","path":"assets/WELL-0010/co
ntext.jsonl"},"ev_7addbd5958288789938c6acb":{"id":"ev_7addbd5958288789938c6acb","source_id":"src_f4c925eade7030d1aedbb
885","source_kind":"context","title":"CTX-0010-007","path":"assets/WELL-0010/context.jsonl"},"ev_6c948b50c556d28657254
c4f":{"id":"ev_6c948b50c556d28657254c4f","source_id":"src_8c34118d7765947bcf5a5100","source_kind":"maintenance","title
":"MNT-0010-027","path":"assets/WELL-0010/maintenance.jsonl"},"ev_0437521e35de62362c44d36e":{"id":"ev_0437521e35de6236
2c44d36e","source_id":"src_01c73e126de581aa042d7bc5","source_kind":"inspections","title":"INS-0010-0216","path":"asset
s/WELL-0010/inspections.jsonl"},"ev_2549ee48ca81f9068c849b85":{"id":"ev_2549ee48ca81f9068c849b85","source_id":"src_01c
73e126de581aa042d7bc5","source_kind":"inspections","title":"INS-0010-0217","path":"assets/WELL-0010/inspections.jsonl"
},"ev_1e978cf4c1a19269b984f5dc":{"id":"ev_1e978cf4c1a19269b984f5dc","source_id":"src_01c73e126de581aa042d7bc5","source
_kind":"inspections","title":"INS-0010-0218","path":"assets/WELL-0010/inspections.jsonl"},"ev_48e158d164259a5e9839e091
":{"id":"ev_48e158d164259a5e9839e091","source_id":"src_01c73e126de581aa042d7bc5","source_kind":"inspections","title":"
INS-0010-0219","path":"assets/WELL-0010/inspections.jsonl"},"result_14b1278bec8b4cb9abf31fab5602b88a":{"id":"result_14
b1278bec8b4cb9abf31fab5602b88a","source_id":"result_14b1278bec8b4cb9abf31fab5602b88a","source_kind":"aggregate_lineage
","title":"result_14b1278bec8b4cb9abf31fab5602b88a"},"ev_604416c15b73d057e4e5e4fa":{"id":"ev_604416c15b73d057e4e5e4fa"
,"source_id":"src_7d2b9b6f3617814f44d17586","source_kind":"metadata","title":"WELL-0175","path":"assets/WELL-0175/meta
data.json"},"ev_d90ea22b249a7fd40119a404":{"id":"ev_d90ea22b249a7fd40119a404","source_id":"src_2162936d93d11ebf31d2164
1","source_kind":"context","title":"CTX-0175-003","path":"assets/WELL-0175/context.jsonl"},"ev_bbcf6ef052f9a7428407b89
4":{"id":"ev_bbcf6ef052f9a7428407b894","source_id":"src_2162936d93d11ebf31d21641","source_kind":"context","title":"CTX
-0175-006","path":"assets/WELL-0175/context.jsonl"},"ev_0f6450308e92bf5c7ec8a307":{"id":"ev_0f6450308e92bf5c7ec8a307",
"source_id":"src_2162936d93d11ebf31d21641","source_kind":"context","title":"CTX-0175-007","path":"assets/WELL-0175/con
text.jsonl"},"ev_a25ea0c0468a862e2a29a5e7":{"id":"ev_a25ea0c0468a862e2a29a5e7","source_id":"src_b34e41b0e785a9cba87a0d
02","source_kind":"maintenance","title":"MNT-0175-031","path":"assets/WELL-0175/maintenance.jsonl"},"ev_3f465073f16db2
7b35323276":{"id":"ev_3f465073f16db27b35323276","source_id":"src_ff100e3d8a816b3114d09909","source_kind":"inspections"
,"title":"INS-0175-0213","path":"assets/WELL-0175/inspections.jsonl"},"ev_83e20c03a482b96d713bc3fb":{"id":"ev_83e20c03
a482b96d713bc3fb","source_id":"src_ff100e3d8a816b3114d09909","source_kind":"inspections","title":"INS-0175-0214","path
":"assets/WELL-0175/inspections.jsonl"},"ev_20cb34d51e425398a03a9d58":{"id":"ev_20cb34d51e425398a03a9d58","source_id":
"src_ff100e3d8a816b3114d09909","source_kind":"inspections","title":"INS-0175-0215","path":"assets/WELL-0175/inspection
s.jsonl"},"ev_c839bd3e6fc3ef002d85c207":{"id":"ev_c839bd3e6fc3ef002d85c207","source_id":"src_ff100e3d8a816b3114d09909"
,"source_kind":"inspections","title":"INS-0175-0216","path":"assets/WELL-0175/inspections.jsonl"},"ev_4a071e0a1234c051
d19abfd8":{"id":"ev_4a071e0a1234c051d19abfd8","source_id":"src_e65a706300ec502983d61b80","source_kind":"metadata","tit
le":"WELL-0197","path":"assets/WELL-0197/metadata.json"},"ev_c5d24b601109069d6ea76092":{"id":"ev_c5d24b601109069d6ea76
092","source_id":"src_d145af4318757827f5eda9ab","source_kind":"context","title":"CTX-0197-002","path":"assets/WELL-019
7/context.jsonl"},"ev_9db9578ee37d885be7ee18fd":{"id":"ev_9db9578ee37d885be7ee18fd","source_id":"src_d145af4318757827f
5eda9ab","source_kind":"context","title":"CTX-0197-003","path":"assets/WELL-0197/context.jsonl"},"ev_a15eaa6c56315f963
26fcbf9":{"id":"ev_a15eaa6c56315f96326fcbf9","source_id":"src_d145af4318757827f5eda9ab","source_kind":"context","title
":"CTX-0197-004","path":"assets/WELL-0197/context.jsonl"},"ev_5c4763c86d65d4af9dcb7b04":{"id":"ev_5c4763c86d65d4af9dcb
7b04","source_id":"src_acd0d18641363bb3577c5f98","source_kind":"maintenance","title":"MNT-0197-029","path":"assets/WEL
L-0197/maintenance.jsonl"},"ev_93e620fc7a4a1e86db795d83":{"id":"ev_93e620fc7a4a1e86db795d83","source_id":"src_76ca86e6
2c6d5997df409781","source_kind":"inspections","title":"INS-0197-0211","path":"assets/WELL-0197/inspections.jsonl"},"ev
_112d05d5ccfb20e28870db09":{"id":"ev_112d05d5ccfb20e28870db09","source_id":"src_76ca86e62c6d5997df409781","source_kind
":"inspections","title":"INS-0197-0212","path":"assets/WELL-0197/inspections.jsonl"},"ev_e395446335bd7e1ea36c93f5":{"id":"ev_e395446335bd7e1ea36c93f5","source_id":"src_76ca86e62c6d5997df409781","source_kind":"inspections","title":"INS-0197-0213","path":"assets/WELL-0197/inspections.jsonl"},"ev_bc14f5be8c21e3efc9af16e8":{"id":"ev_bc14f5be8c21e3efc9af16e8","source_id":"src_76ca86e62c6d5997df409781","source_kind":"inspections","title":"INS-0197-0214","path":"assets/WELL-0197/inspections.jsonl"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"}}
}
```

Question 8

Nathan Pierce · Turn 1 · partial

WELL-0333's recalled pump was swapped out yesterday. The work order isn't in the system yet. Please count it as replaced from now on.


```json
{
  "schema_version": "1.0",
  "answer_id": "082cd538-69e9-4bb9-bc64-101ec66b48b8",
  "thread_id": "2572b5ee-546e-4514-bb49-f4a883f5a58e",
  "user_id": "U-601",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "I could not establish data for this selection. Please confirm the well and date range.",
  "blocks": [],
  "results": {},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Physical inventory and operational count are separate: explicit direct attributed replacement instruction changes operational count with unverified-work-order flag; hearsay does not. No claim becomes inspected physical evidence.","Installation cost is recorded total job cost, not pump-only price or paid expenditure.","The explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":false,"explanation_error_code":"invalid_model_json","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":5388,"output_tokens":326,"total_tokens":5714,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":706,"live":true},{"stage":"maker","usage":{"input_tokens":5743,"output_tokens":416,"total_tokens":6159,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":715,"live":true}]},
  "evidence": {"src_853c7f7623412e1b78b5e791":{"id":"src_853c7f7623412e1b78b5e791","source_id":"src_853c7f7623412e1b78b5e791","source_kind":"sop","title":"fleet/sops/supplier-recall-notice-2026-12-01.md","path":"fleet/sops/supplier-recall-notice-2026-12-01.md"},"memory:ea233e6c-8168-431d-99f3-840cdbc32f54":{"id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d":{"id":"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d","source_id":"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d","source_kind":"private_memory","title":"Preference reported by Nathan Pierce"},"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829":{"id":"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829","source_id":"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829","source_kind":"private_memory","title":"Preference reported by Nathan Pierce"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"}}
}
```


Nathan Pierce · Turn 2 · complete

Also, just for me: whenever you list wells, sort them by area and then by well ID, and show costs in thousands of dollars.


```json
{
  "schema_version": "1.0",
  "answer_id": "9917254f-343e-4eef-88af-baff5807feb2",
  "thread_id": "2572b5ee-546e-4514-bb49-f4a883f5a58e",
  "user_id": "U-601",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Saved private When listing wells, sort by area and then by well ID, and display costs in thousands of dollars. (author Nathan Pierce, attributed).",
  "blocks": [],
  "results": {},
  "warnings": [],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":5880,"output_tokens":189,"total_tokens":6069,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":722,"live":true}],"provider":"google","foreground_attempts":1,"live":true},
  "evidence": {"memory:1de31300-5ad0-4dfd-96ec-5224889d3906":{"id":"memory:1de31300-5ad0-4dfd-96ec-5224889d3906","source_id":"memory:1de31300-5ad0-4dfd-96ec-5224889d3906","source_kind":"private_memory","title":"Preference reported by Nathan Pierce"},"memory:ea233e6c-8168-431d-99f3-840cdbc32f54":{"id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d":{"id":"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d","source_id":"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d","source_kind":"private_memory","title":"Preference reported by Nathan Pierce"},"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829":{"id":"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829","source_id":"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829","source_kind":"private_memory","title":"Preference reported by Nathan Pierce"}}
}
```


Robert Hayes · Turn 3 · partial

Which recalled pumps are still in the ground right now?


```json
{
```

```
  "schema_version": "1.0",
  "answer_id": "6fa1a559-0b24-4894-a19b-315d7c4e4581",
  "thread_id": "621742ff-32f3-4b2d-ade5-035681b1e717",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Partial answer: verified data is shown below. The explanation could not be completed because the
generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"6fa1a559-0b24-4894-a19b-315d7c4e4581:verified:0","type":"table","title":"Verified data —
explanation incomplete","result_set_id":"result_0c84a872189a44ffa83f7c21477110f7","evidence_ids":["ev_aecf97d98f933acd
7a482eef","ev_0d5517c9853842c8024013e4","src_ef00a9b04ea8747af03b27fb","src_853c7f7623412e1b78b5e791","ev_08270ebc000d
f4f1f5db64f1","result_0c84a872189a44ffa83f7c21477110f7","ev_ecd062eace8e3149af5efa98","ev_de6c0ddf304742e362c227a5"],"
encoding":{},"span":2}],
  "results": {"result_0c84a872189a44ffa83f7c21477110f7":{"result_set_id":"result_0c84a872189a44ffa83f7c21477110f7","da
taset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":5,"columns":[{
"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area
Name"},{"key":"serial","label":"Serial"},{"key":"lot","label":"Lot"},{"key":"parts_installed","label":"Parts
Installed"},{"key":"installation_job","label":"Installation Job"},{"key":"installed_at","label":"Installed
At"},{"key":"installation_cost_usd","label":"Installation Cost
Usd","unit":"USD"},{"key":"assessment","label":"Assessment"},{"key":"documented_in_ground","label":"Documented In
Ground"},{"key":"included_in_operational_recall_list","label":"Included In Operational Recall
List"},{"key":"work_order_verified","label":"Work Order Verified"},{"key":"replacement_claims","label":"Replacement
Claims"},{"key":"producing","label":"Producing"},{"key":"status_now","label":"Status
Now"},{"key":"status_confirmed","label":"Status Confirmed"},{"key":"last_repair_id","label":"Last Repair
Id"},{"key":"last_repair_at","label":"Last Repair At"},{"key":"last_repair_equipment","label":"Last Repair
Equipment"}],"rows":[{"installation_job":"MNT-0428-022","status_now":"Producing oil","last_repair_equipment":"downhole
_pump","installation_cost_usd":27074,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"SN-708611"
,"area_name":"Northwest Block 12","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175
pump, serial SN-708611, lot LOT-2410-B","asset_id":"WELL-0428","status_confirmed":true,"installed_at":"2026-03-17T11:0
0:00Z","last_repair_at":"2026-03-07T08:00:00Z","area_id":"NW-12","lot":"LOT-2410-B","replacement_claims":"[]","last_re
pair_id":"MNT-0428-022","included_in_operational_recall_list":true},{"installation_job":"MNT-0031-027","status_now":"P
roducing oil","last_repair_equipment":"wellhead","installation_cost_usd":19625,"assessment":"recorded_in_ground","work
_order_verified":null,"serial":"SN-664877","area_name":"Southwest Block
23","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-664877, lot LOT-24
09-A","asset_id":"WELL-0031","status_confirmed":true,"installed_at":"2026-05-06T20:00:00Z","last_repair_at":"2027-01-0
2T08:00:00Z","area_id":"SW-23","lot":"LOT-2409-A","replacement_claims":"[]","last_repair_id":"MNT-0031-033","included_
in_operational_recall_list":true},{"installation_job":"MNT-0263-033","status_now":"Not producing oil","last_repair_equ
ipment":"flowline","installation_cost_usd":17254,"assessment":"recorded_in_ground","work_order_verified":null,"serial"
:"SN-187332","area_name":"Southwest Block
23","producing":false,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-187332, lot LOT-2
410-B","asset_id":"WELL-0263","status_confirmed":true,"installed_at":"2026-10-20T01:00:00Z","last_repair_at":"2027-01-
09T08:00:00Z","area_id":"SW-23","lot":"LOT-2410-B","replacement_claims":"[]","last_repair_id":"MNT-0263-035","included
_in_operational_recall_list":true},{"installation_job":"MNT-0426-030","status_now":"Producing oil","last_repair_equipm
ent":"pump_jack","installation_cost_usd":24044,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"
SN-880271","area_name":"Northwest Block 12","producing":true,"documented_in_ground":true,"parts_installed":"Highline
RP-175 pump, serial SN-880271, lot LOT-2409-C","asset_id":"WELL-0426","status_confirmed":true,"installed_at":"2026-06-
24T22:00:00Z","last_repair_at":"2026-08-09T08:00:00Z","area_id":"NW-12","lot":"LOT-2409-C","replacement_claims":"[]","
last_repair_id":"MNT-0426-033","included_in_operational_recall_list":true},{"installation_job":"MNT-0156-027","status_
now":"Producing oil","last_repair_equipment":"downhole_pump","installation_cost_usd":23398,"assessment":"recorded_in_g
round","work_order_verified":null,"serial":"SN-952958","area_name":"Northeast Block
8","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-952958, lot LOT-240
9-A","asset_id":"WELL-0156","status_confirmed":true,"installed_at":"2026-07-01T08:00:00Z","last_repair_at":"2026-06-27
T08:00:00Z","area_id":"NE-08","lot":"LOT-2409-A","replacement_claims":"[]","last_repair_id":"MNT-0156-027","included_i
n_operational_recall_list":true},{"installation_job":"MNT-0160-028","status_now":"Not producing oil","last_repair_equi
pment":"pump_jack","installation_cost_usd":33086,"assessment":"recorded_in_ground","work_order_verified":null,"serial"
:"SN-429965","area_name":"Northeast Block 8","producing":false,"documented_in_ground":true,"parts_installed":"Highline
RP-175 pump, serial SN-429965, lot LOT-2409-C","asset_id":"WELL-0160","status_confirmed":true,"installed_at":"2026-07-
28T19:00:00Z","last_repair_at":"2027-01-15T08:00:00Z","area_id":"NE-08","lot":"LOT-2409-C","replacement_claims":"[]","
last_repair_id":"MNT-0160-032","included_in_operational_recall_list":true},{"installation_job":"MNT-0577-028","status_
now":"Producing oil","last_repair_equipment":"pump_jack","installation_cost_usd":25500,"assessment":"recorded_in_groun
d","work_order_verified":null,"serial":"SN-757468","area_name":"Southeast Block
32","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-757468, lot LOT-24
09-A","asset_id":"WELL-0577","status_confirmed":true,"installed_at":"2026-08-11T12:00:00Z","last_repair_at":"2026-11-2
1T08:00:00Z","area_id":"SE-32","lot":"LOT-2409-A","replacement_claims":"[]","last_repair_id":"MNT-0577-032","included_
in_operational_recall_list":true},{"installation_job":"MNT-0305-032","status_now":"Producing oil","last_repair_equipme
nt":"downhole_pump","installation_cost_usd":24528,"assessment":"recorded_in_ground","work_order_verified":null,"serial
":"SN-978137","area_name":"Northwest Block
12","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-978137, lot LOT-24
09-A","asset_id":"WELL-0305","status_confirmed":true,"installed_at":"2026-10-21T14:00:00Z","last_repair_at":"2026-10-1
6T08:00:00Z","area_id":"NW-12","lot":"LOT-2409-A","replacement_claims":"[]","last_repair_id":"MNT-0305-032","included_
in_operational_recall_list":true}],"evidence_ids":["ev_aecf97d98f933acd7a482eef","ev_0d5517c9853842c8024013e4","src_ef
00a9b04ea8747af03b27fb","src_853c7f7623412e1b78b5e791","ev_08270ebc000df4f1f5db64f1","result_0c84a872189a44ffa83f7c214
77110f7","ev_ecd062eace8e3149af5efa98","ev_de6c0ddf304742e362c227a5","src_3c4e87f1039a258fecebce73","ev_b78f72b1bc6c00
c0209a35f1","ev_8a1a0d04ef69b47cbbd7e2a9","ev_64f37f5e03cf883914b5517b","ev_038c94ae2102a687f08dd299","ev_e1c9d34f62c3
afd8ddbf9e7d","src_d3d63c76890743ca90feaed2","ev_206d45edd557b98a1a58e3b7","ev_36f2b2dc10b914ab17e6f607","ev_935442f28
2cd866b735afd01","ev_1181c64586cc03d0aa986f9c","src_81583d1c4536722f5401c680","ev_34112aba2a657a223de798f9","ev_c0f401
df2b20db9071ca4338","ev_b0ea06187658ebe5d2567d0d","ev_fe3ce48741144d07651bdf11","src_9b54407ca5b9f1a256dbaf8a","ev_fa0
2979fc8349d0c7004e28f","ev_ee744e100e1f136b515c2947","ev_e2bf7a3b1283965196108c64","src_4ce65c1f3cac22a62f97f963","ev_
190217ada5c63174fef3e59d","ev_024ef47ffe4fe7f7de6fa26f","ev_fbd4b7b4e99379f1f849327c","ev_33881d2e0f89e2a1ae009719","s
rc_b94f3fb94d5d1496e2d01785","ev_69f2a8c39f8df63775ada596","ev_ce15a0af9f5bb4dd0d818f63","ev_a4f4cbab2ed8a1770afbcf5b"
,"ev_18b1580940f38e53e7490b80","src_dc1338cc1e13817cfb80817e","ev_7cabe3fb75e0c725bfc05296","ev_3e7c914c90b36bb2db64fc
62"],"provider_coverage":{"unit":"recall_inventory","matching":9,"evaluated":9,"unknown":0,"import_issues":0,"status":
"complete","displayed_rows":8,"output_rows":8,"display_truncated":false,"aggregation_input_truncated":false},"trace_id
":"trace_8d2262473f13467993645416a3dd6e51","warnings":["Missing records do not independently prove real-world
inaction; calendar reference date supplies no time of day.","Physical inventory and operational count are separate:
```

explicit direct attributed replacement instruction changes operational count with unverified-work-order flag; hearsay does not. No claim becomes inspected physical evidence.","Installation cost is recorded total job cost, not pump-only price or paid expenditure."],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"maintenance","metric":"recall_inventory"},"summary":{"total_matching":9,"assessment_counts":{"recorded_in_ground":8,"reported_replaced_unverified":1},"area_counts":{"Northwest Block 12":4,"Southwest Block 23":2,"Northeast Block 8":2,"Southeast Block 32":1},"documented_in_ground":9,"unconfirmed_replacement_claims":1,"operational_in_ground":8,"operational_area_counts":{"Northwest Block 12":3,"Southwest Block 23":2,"Northeast Block 8":2,"Southeast Block 32":1},"excluded_replacement_updates":[{"asset_id":"WELL-0333","area_name":"Northwest Block 12","assessment":"reported_replaced_unverified","serial":"SN-507591","lot":"LOT-2409-A","installation_job":"MNT-0333-024","documented_in_ground":true,"work_order_verified":false,"replacement_claims":[{"id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","author":"U-601","statement":"The recalled pump for WELL-0333 was swapped out on 2027-01-14, pending formal system documentation, and should be counted as replaced from now on.","valid_from":"2027-01-15","valid_to":null,"status":"attributed","conflicts":[],"qualifier":"attributed","firsthand":false,"attribution_basis":"attributed"},{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","author":"U-601","statement":"The recalled pump for WELL-0333 was swapped out on 2027-01-14, pending formal system documentation, and should be counted as replaced from now on.","valid_from":"2027-01-15","valid_to":null,"status":"unconfirmed","conflicts":[],"qualifier":"attributed","firsthand":false,"attribution_basis":"attributed"},{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","author":"U-601","statement":"A pump replacement was performed on 2027-01-14, pending system documentation.","valid_from":null,"valid_to":null,"status":"attributed","conflicts":[],"qualifier":"attributed","firsthand":false,"attribution_basis":"attributed"}]}]},"assessment_counts":{"recorded_in_ground":8,"reported_replaced_unverified":1},"coverage":{"matching":9,"evaluated":9,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Physical inventory and operational count are separate: explicit direct attributed replacement instruction changes operational count with unverified-work-order flag; hearsay does not. No claim becomes inspected physical evidence.","Installation cost is recorded total job cost, not pump-only price or paid expenditure.","Ranked lexical retrieval cannot prove a fleet total or source absence","Report prose may predate corrections; a lexical hit does not confirm effective spill detection or current classification","The explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanation_error_code":"unsupported_narrative_number","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":4986,"output_tokens":203,"total_tokens":5189,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":729,"live":true},{"stage":"maker","usage":{"input_tokens":3976,"output_tokens":640,"total_tokens":4616,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":733,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":4067,"output_tokens":475,"total_tokens":4542,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":736,"live":true}]},
  "evidence": {"ev_aecf97d98f933acd7a482eef":{"id":"ev_aecf97d98f933acd7a482eef","source_id":"src_0a4c0beadb992dd4a0ff3647","source_kind":"metadata","title":"WELL-0428","path":"assets/WELL-0428/metadata.json"},"ev_0d5517c9853842c8024013e4":{"id":"ev_0d5517c9853842c8024013e4","source_id":"src_fc86426bce84bc0b1d3106f7","source_kind":"maintenance","title":"MNT-0428-022","path":"assets/WELL-0428/maintenance.jsonl"},"src_ef00a9b04ea8747af03b27fb":{"id":"src_ef00a9b04ea8747af03b27fb","source_id":"src_ef00a9b04ea8747af03b27fb","source_kind":"report","title":"assets/WELL-0428/maintenance-reports/MNT-0428-022.md","path":"assets/WELL-0428/maintenance-reports/MNT-0428-022.md"},"src_853c7f7623412e1b78b5e791":{"id":"src_853c7f7623412e1b78b5e791","source_id":"src_853c7f7623412e1b78b5e791","source_kind":"sop","title":"fleet/sops/supplier-recall-notice-2026-12-01.md","path":"fleet/sops/supplier-recall-notice-2026-12-01.md"},"ev_08270ebc000df4f1f5db64f1":{"id":"ev_08270ebc000df4f1f5db64f1","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","title":"INS-0428-0218","path":"assets/WELL-0428/inspections.jsonl"},"result_0c84a872189a44ffa83f7c21477110f7":{"id":"result_0c84a872189a44ffa83f7c21477110f7","source_id":"result_0c84a872189a44ffa83f7c21477110f7","source_kind":"aggregate_lineage","title":"result_0c84a872189a44ffa83f7c21477110f7"},"ev_ecd062eace8e3149af5efa98":{"id":"ev_ecd062eace8e3149af5efa98","source_id":"src_9b91a550d3d412d193d7cde3","source_kind":"metadata","title":"WELL-0031","path":"assets/WELL-0031/metadata.json"},"ev_de6c0ddf304742e362c227a5":{"id":"ev_de6c0ddf304742e362c227a5","source_id":"src_d9142567942767d8f00359c3","source_kind":"maintenance","title":"MNT-0031-027","path":"assets/WELL-0031/maintenance.jsonl"},"src_3c4e87f1039a258fecebce73":{"id":"src_3c4e87f1039a258fecebce73","source_id":"src_3c4e87f1039a258fecebce73","source_kind":"report","title":"assets/WELL-0031/maintenance-reports/MNT-0031-027.md","path":"assets/WELL-0031/maintenance-reports/MNT-0031-027.md"},"ev_b78f72b1bc6c00c0209a35f1":{"id":"ev_b78f72b1bc6c00c0209a35f1","source_id":"src_896837d9337b9fbf5c6babdc","source_kind":"inspections","title":"INS-0031-0215","path":"assets/WELL-0031/inspections.jsonl"},"ev_8a1a0d04ef69b47cbbd7e2a9":{"id":"ev_8a1a0d04ef69b47cbbd7e2a9","source_id":"src_0b8799c783ddf67dced4b05a","source_kind":"context","title":"CTX-0031-001","path":"assets/WELL-0031/context.jsonl"},"ev_64f37f5e03cf883914b5517b":{"id":"ev_64f37f5e03cf883914b5517b","source_id":"src_d9142567942767d8f00359c3","source_kind":"maintenance","title":"MNT-0031-033","path":"assets/WELL-0031/maintenance.jsonl"},"ev_038c94ae2102a687f08dd299":{"id":"ev_038c94ae2102a687f08dd299","source_id":"src_1c75a10d9e027c44ad0cfe8c","source_kind":"metadata","title":"WELL-0263","path":"assets/WELL-0263/metadata.json"},"ev_e1c9d34f62c3afd8ddbf9e7d":{"id":"ev_e1c9d34f62c3afd8ddbf9e7d","source_id":"src_eb2bcbf0705db2f921b7a262","source_kind":"maintenance","title":"MNT-0263-033","path":"assets/WELL-0263/maintenance.jsonl"},"src_d3d63c76890743ca90feaed2":{"id":"src_d3d63c76890743ca90feaed2","source_id":"src_d3d63c76890743ca90feaed2","source_kind":"report","title":"assets/WELL-0263/maintenance-reports/MNT-0263-033.md","path":"assets/WELL-0263/maintenance-reports/MNT-0263-033.md"},"ev_206d45edd557b98a1a58e3b7":{"id":"ev_206d45edd557b98a1a58e3b7","source_id":"src_4905a07485ed996443163eac","source_kind":"inspections","title":"INS-0263-0219","path":"assets/WELL-0263/inspections.jsonl"},"ev_36f2b2dc10b914ab17e6f607":{"id":"ev_36f2b2dc10b914ab17e6f607","source_id":"src_eb2bcbf0705db2f921b7a262","source_kind":"maintenance","title":"MNT-0263-035","path":"assets/WELL-0263/maintenance.jsonl"},"ev_935442f282cd866b735afd01":{"id":"ev_935442f282cd866b735afd01","source_id":"src_b6abb20d6010fc8f9a5161c0","source_kind":"metadata","title":"WELL-0426","path":"assets/WELL-0426/metadata.json"},"ev_1181c64586cc03d0aa986f9c":{"id":"ev_1181c64586cc03d0aa986f9c","source_id":"src_c76378bdd2f19d65a93adc62","source_kind":"maintenance","title":"MNT-0426-030","path":"assets/WELL-0426/maintenance.jsonl"},"src_81583d1c4536722f5401c680":{"id":"src_81583d1c4536722f5401c680","source_id":"src_81583d1c4536722f5401c680","source_kind":"report","title":"assets/WELL-0426/maintenance-reports/MNT-0426-030.md","path":"assets/WELL-0426/maintenance-reports/MNT-0426-030.md"},"ev_34112aba2a657a223de798f9":{"id":"ev_34112aba2a657a223de798f9","source_id":"src_4dbd8195c2feb3123eca23b7","source_kind":"inspections","title":"INS-0426-0222","path":"assets/WELL-0426/inspections.jsonl"},"ev_c0f401df2b20db9071ca4338":{"id":"ev_c0f401df2b20db9071ca4338","source_id":"src_c76378bdd2f19d65a93adc62","source_kind":"maintenance","title":"MNT-0426-033","path":"assets/WELL-0426/maintenance.jsonl"},"ev_b0ea06187658ebe5d2567d0d":{"id":"ev_b0ea06187658ebe5d2567d0d","source_id":"src_67b3ad042ea971937347961f","source_kind":"metadata","title":"WELL-0156","path":"assets/WELL-0156/metadata.json"},"ev_fe3ce48741144d07651bdf11":{"id":"ev_fe3ce48741144d07651bdf11","source_id":"src_45814726fbc026cea45f8f67","source_kind":"maintenance","title":"MNT-0156-027","path":"assets/WELL-0156/maintenance.jsonl"},"src_9b54407ca5b9f1a256dbaf8a":{"id":"src_9b54407ca5b9f1a256dbaf8a","source_id":"src_9b54407ca5b9f1a256dbaf8a","source_kind":"report","title":"assets/WELL-0156/maintenance-reports/MNT-0156-027.md","path":"assets/WELL-0156/maintenance-reports/MNT-0156-027.md"},"ev_fa02979fc8349d0c7004e28f":{"id":"ev_fa02979fc8349d0c7004e28f","source_id":"src_ed1a309a3d743577acf65c37","source_kind":"inspections","title":"INS-0156-0217","path":"assets/WELL-0156/inspections.jsonl"},"ev_ee744e100e1f136b515c2947":{"id":"ev_ee744e100e1f136b515c2947","source_id":"src_b19afa2b76221e3878696fcf","source_kind":"metadata","title":"WELL-0160","path":"assets/WELL-0160/metadata.json"},"ev_e2bf7a3b1283965196108c64":{"id":"ev_e2bf7a3b1283965196108c64","sourc

e_id":"src_04719696ca2d338b02f0dc6e","source_kind":"maintenance","title":"MNT-0160-028","path":"assets/WELL-0160/maint
enance.jsonl"},"src_4ce65c1f3cac22a62f97f963":{"id":"src_4ce65c1f3cac22a62f97f963","source_id":"src_4ce65c1f3cac22a62f
97f963","source_kind":"report","title":"assets/WELL-0160/maintenance-reports/MNT-0160-028.md","path":"assets/WELL-0160
/maintenance-reports/MNT-0160-028.md"},"ev_190217ada5c63174fef3e59d":{"id":"ev_190217ada5c63174fef3e59d","source_id":"
src_423036549bd4facf67674e7a","source_kind":"inspections","title":"INS-0160-0217","path":"assets/WELL-0160/inspections
.jsonl"},"ev_024ef47ffe4fe7f7de6fa26f":{"id":"ev_024ef47ffe4fe7f7de6fa26f","source_id":"src_04719696ca2d338b02f0dc6e",
"source_kind":"maintenance","title":"MNT-0160-032","path":"assets/WELL-0160/maintenance.jsonl"},"ev_fbd4b7b4e99379f1f8
49327c":{"id":"ev_fbd4b7b4e99379f1f849327c","source_id":"src_639f855c0b5f55747c10f304","source_kind":"metadata","title
":"WELL-0577","path":"assets/WELL-0577/metadata.json"},"ev_33881d2e0f89e2a1ae009719":{"id":"ev_33881d2e0f89e2a1ae00971
9","source_id":"src_3e9bbe49277aa4f833e42f6c","source_kind":"maintenance","title":"MNT-0577-028","path":"assets/WELL-0
577/maintenance.jsonl"},"src_b94f3fb94d5d1496e2d01785":{"id":"src_b94f3fb94d5d1496e2d01785","source_id":"src_b94f3fb94
d5d1496e2d01785","source_kind":"report","title":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md","path":"assets/
WELL-0577/maintenance-reports/MNT-0577-028.md"},"ev_69f2a8c39f8df63775ada596":{"id":"ev_69f2a8c39f8df63775ada596","sou
rce_id":"src_da28b5372b2d5ce8d386d2f5","source_kind":"inspections","title":"INS-0577-0211","path":"assets/WELL-0577/in
spections.jsonl"},"ev_ce15a0af9f5bb4dd0d818f63":{"id":"ev_ce15a0af9f5bb4dd0d818f63","source_id":"src_3e9bbe49277aa4f83
3e42f6c","source_kind":"maintenance","title":"MNT-0577-032","path":"assets/WELL-0577/maintenance.jsonl"},"ev_a4f4cbab2
ed8a1770afbcf5b":{"id":"ev_a4f4cbab2ed8a1770afbcf5b","source_id":"src_827164e72660ecb0547d8285","source_kind":"metadat
a","title":"WELL-0305","path":"assets/WELL-0305/metadata.json"},"ev_18b1580940f38e53e7490b80":{"id":"ev_18b1580940f38e
53e7490b80","source_id":"src_7df4d484c15db67e4cf5e8e4","source_kind":"maintenance","title":"MNT-0305-032","path":"asse
ts/WELL-0305/maintenance.jsonl"},"src_dc1338cc1e13817cfb80817e":{"id":"src_dc1338cc1e13817cfb80817e","source_id":"src_
dc1338cc1e13817cfb80817e","source_kind":"report","title":"assets/WELL-0305/maintenance-reports/MNT-0305-032.md","path"
:"assets/WELL-0305/maintenance-reports/MNT-0305-032.md"},"ev_7cabe3fb75e0c725bfc05296":{"id":"ev_7cabe3fb75e0c725bfc05
296","source_id":"src_f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0216","path":"assets/WEL
L-0305/inspections.jsonl"},"ev_3e7c914c90b36bb2db64fc62":{"id":"ev_3e7c914c90b36bb2db64fc62","source_id":"src_f5a9fd97
d067c429605d6b49","source_kind":"context","title":"CTX-0305-001","path":"assets/WELL-0305/context.jsonl"},"memory:ea23
3e6c-8168-431d-99f3-840cdbc32f54":{"id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_id":"memory:ea233e6c-816
8-431d-99f3-840cdbc32f54","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:6f
72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f
14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:
c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28
-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory
:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d0
7-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"chun
k_0d223d7f93c5f28d2a12667d":{"id":"chunk_0d223d7f93c5f28d2a12667d","source_id":"src_a2fd40597bd711135e528f93","source_
kind":"report","title":"Notes and recommendations","path":"assets/WELL-0475/maintenance-reports/MNT-0475-034.md"},"chu
nk_1dc076c8782f0a541b07cc2b":{"id":"chunk_1dc076c8782f0a541b07cc2b","source_id":"src_cd50bf77e6379168e5f44aa9","source
_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0427/maintenance-reports/MNT-0427-025.md"},"ch
unk_3e18f33fc871af1629dfabf4":{"id":"chunk_3e18f33fc871af1629dfabf4","source_id":"src_387cbe906e5053697a2cc995","sourc
e_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0340/maintenance-reports/MNT-0340-038.md"},"c
hunk_52d6e69ebb632283957751c9":{"id":"chunk_52d6e69ebb632283957751c9","source_id":"src_5343b6f8f8a65c554d38cc85","sour
ce_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0302/maintenance-reports/MNT-0302-031.md"},"
chunk_7b96d4161bd74cf009f2d846":{"id":"chunk_7b96d4161bd74cf009f2d846","source_id":"src_12a5ade47cb97a1707e1336b","sou
rce_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0517/maintenance-reports/MNT-0517-030.md"},
"chunk_a7a4ff5cade072b606409212":{"id":"chunk_a7a4ff5cade072b606409212","source_id":"src_cce0face6a9ce58ef3694596","so
urce_kind":"report","title":"Notes and
recommendations","path":"assets/WELL-0460/maintenance-reports/MNT-0460-035.md"}}
}
```

Olivia Grant · Turn 4 · complete

Nathan told me the recalled pump on WELL-0577 was swapped as well. Take it off the recall list.

```json
{
  "schema_version": "1.0",
  "answer_id": "aa2709f7-d969-4cde-91a9-f40cf14fe2ea",
  "thread_id": "d47e1b14-4fea-489f-8e60-1bb219d76fb0",
  "user_id": "U-501",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "The unconfirmed replacement claim for WELL-0577, reported by Nathan and recorded by Olivia Grant
[memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3], remains on the operational recall list
[result_353345cfb8834f4f91325a0016d449ab]. Official replacement records and physical inventory closure rules have not
yet confirmed the swap, keeping the status unconfirmed with no commit receipt
[memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3].",
  "blocks": [{"id":"aa2709f7-d969-4cde-91a9-f40cf14fe2ea:block:0","type":"table","title":"WELL-0577 Recall and
Replacement Status","result_set_id":"result_353345cfb8834f4f91325a0016d449ab","evidence_ids":["ev_fbd4b7b4e99379f1f849
327c","ev_33881d2e0f89e2a1ae009719","src_b94f3fb94d5d1496e2d01785"],"encoding":{},"span":1}],
  "results": {"result_353345cfb8834f4f91325a0016d449ab":{"result_set_id":"result_353345cfb8834f4f91325a0016d449ab","da
taset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{
"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area
Name"},{"key":"serial","label":"Serial"},{"key":"lot","label":"Lot"},{"key":"parts_installed","label":"Parts
Installed"},{"key":"installation_job","label":"Installation Job"},{"key":"installed_at","label":"Installed
At"},{"key":"installation_cost_usd","label":"Installation Cost
Usd","unit":"USD"},{"key":"assessment","label":"Assessment"},{"key":"documented_in_ground","label":"Documented In
Ground"},{"key":"included_in_operational_recall_list","label":"Included In Operational Recall
List"},{"key":"work_order_verified","label":"Work Order Verified"},{"key":"replacement_claims","label":"Replacement
Claims"},{"key":"producing","label":"Producing"},{"key":"status_now","label":"Status
Now"},{"key":"status_confirmed","label":"Status Confirmed"},{"key":"last_repair_id","label":"Last Repair
Id"},{"key":"last_repair_at","label":"Last Repair At"},{"key":"last_repair_equipment","label":"Last Repair
Equipment"}],"rows":[{"installation_job":"MNT-0577-028","status_now":"Producing oil","last_repair_equipment":"pump_jac
k","installation_cost_usd":25500,"assessment":"replacement_claim_unconfirmed","work_order_verified":false,"serial":"SN
-757468","area_name":"Southeast Block 32","producing":true,"documented_in_ground":true,"parts_installed":"Highline
RP-175 pump, serial SN-757468, lot LOT-2409-A","asset_id":"WELL-0577","status_confirmed":true,"installed_at":"2026-08-
11T12:00:00Z","last_repair_at":"2026-11-21T08:00:00Z","area_id":"SE-32","lot":"LOT-2409-A","replacement_claims":"[{\"i

d\": \"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3\", \"author\": \"U-501\", \"statement\": \"The recalled pump on WELL-0577 was swapped as reported by Nathan, though physical inventory and official replacement records remain subject to documented maintenance closure rules.\", \"valid_from\": \"2027-01-15\", \"valid_to\": null, \"status\": \"unconfirmed\", \"conflicts\": [], \"qualifier\": \"hearsay\", \"firsthand\": false, \"attribution_basis\": \"hearsay\"}]","last_repair_id":"MNT-0577-032","included_in_operational_recall_list":true}],"evidence_ids":["ev_fbd4b7b4e99379f1f849327c","ev_33881d2e0f89e2a1ae009719","src_b94f3fb94d5d1496e2d01785","src_853c7f7623412e1b78b5e791","ev_69f2a8c39f8df63775ada596","ev_ce15a0af9f5bb4dd0d818f63","result_353345cfb8834f4f91325a0016d449ab"],"provider_coverage":{"unit":"recall_inventory","matching":1,"evaluated":1,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":1,"output_rows":1,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_788bb825c9e8449ab3687a91903620f4","warnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Physical inventory and operational count are separate: explicit direct attributed replacement instruction changes operational count with unverified-work-order flag; hearsay does not. No claim becomes inspected physical evidence.","Installation cost is recorded total job cost, not pump-only price or paid expenditure."],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"maintenance","metric":"recall_inventory"},"summary":{"total_matching":1,"assessment_counts":{"replacement_claim_unconfirmed":1},"area_counts":{"Southeast Block 32":1},"documented_in_ground":1,"unconfirmed_replacement_claims":1,"operational_in_ground":1,"operational_area_counts":{"Southeast Block 32":1},"excluded_replacement_updates":[]},"assessment_counts":{"replacement_claim_unconfirmed":1},"coverage":{"matching":1,"evaluated":1,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Physical inventory and operational count are separate: explicit direct attributed replacement instruction changes operational count with unverified-work-order flag; hearsay does not. No claim becomes inspected physical evidence.","Installation cost is recorded total job cost, not pump-only price or paid expenditure.","Ranked lexical retrieval cannot prove a fleet total or source absence","Report prose may predate corrections; a lexical hit does not confirm effective spill detection or current classification"],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":3738,"output_tokens":375,"total_tokens":4113,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":739,"live":true},{"stage":"maker","usage":{"input_tokens":3060,"output_tokens":547,"total_tokens":3607,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":744,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":3240,"output_tokens":687,"total_tokens":3927,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":747,"live":true}],"provider":"google","foreground_attempts":3,"live":true},
  "evidence": {"ev_fbd4b7b4e99379f1f849327c":{"id":"ev_fbd4b7b4e99379f1f849327c","source_id":"src_639f855c0b5f55747c10f304","source_kind":"metadata","title":"WELL-0577","path":"assets/WELL-0577/metadata.json"},"ev_33881d2e0f89e2a1ae009719":{"id":"ev_33881d2e0f89e2a1ae009719","source_id":"src_3e9bbe49277aa4f833e42f6c","source_kind":"maintenance","title":"MNT-0577-028","path":"assets/WELL-0577/maintenance.jsonl"},"src_b94f3fb94d5d1496e2d01785":{"id":"src_b94f3fb94d5d1496e2d01785","source_id":"src_b94f3fb94d5d1496e2d01785","source_kind":"report","title":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md","path":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md"},"src_853c7f7623412e1b78b5e791":{"id":"src_853c7f7623412e1b78b5e791","source_id":"src_853c7f7623412e1b78b5e791","source_kind":"sop","title":"fleet/sops/supplier-recall-notice-2026-12-01.md","path":"fleet/sops/supplier-recall-notice-2026-12-01.md"},"ev_69f2a8c39f8df63775ada596":{"id":"ev_69f2a8c39f8df63775ada596","source_id":"src_da28b5372b2d5ce8d386d2f5","source_kind":"inspections","title":"INS-0577-0211","path":"assets/WELL-0577/inspections.jsonl"},"ev_ce15a0af9f5bb4dd0d818f63":{"id":"ev_ce15a0af9f5bb4dd0d818f63","source_id":"src_3e9bbe49277aa4f833e42f6c","source_kind":"maintenance","title":"MNT-0577-032","path":"assets/WELL-0577/maintenance.jsonl"},"result_353345cfb8834f4f91325a0016d449ab":{"id":"result_353345cfb8834f4f91325a0016d449ab","source_id":"result_353345cfb8834f4f91325a0016d449ab","source_kind":"aggregate_lineage","title":"result_353345cfb8834f4f91325a0016d449ab"},"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3":{"id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_kind":"shared_knowledge","title":"Observation reported by Olivia Grant"},"memory:2388cd76-a257-47f0-bf54-32aa83cec09f":{"id":"memory:2388cd76-a257-47f0-bf54-32aa83cec09f","source_id":"memory:2388cd76-a257-47f0-bf54-32aa83cec09f","source_kind":"private_memory","title":"Work_Context reported by Olivia Grant"},"chunk_764bd90b88503c9c9b5873b4":{"id":"chunk_764bd90b88503c9c9b5873b4","source_id":"src_b94f3fb94d5d1496e2d01785","source_kind":"report","title":"Work done","path":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md"},"chunk_56462504939ec5aece154515":{"id":"chunk_56462504939ec5aece154515","source_id":"src_b94f3fb94d5d1496e2d01785","source_kind":"report","title":"Notes and recommendations","path":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md"},"chunk_2c03ddc389c5758c895db49c":{"id":"chunk_2c03ddc389c5758c895db49c","source_id":"src_b94f3fb94d5d1496e2d01785","source_kind":"report","title":"Root cause","path":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md"},"chunk_873071141f55d2d68736d9b7":{"id":"chunk_873071141f55d2d68736d9b7","source_id":"src_76cbed45f457c2582c9e07c3","source_kind":"report","title":"Root cause","path":"assets/WELL-0577/maintenance-reports/MNT-0577-031.md"},"chunk_a193a9fd094d3c0ef730df0c":{"id":"chunk_a193a9fd094d3c0ef730df0c","source_id":"src_b94f3fb94d5d1496e2d01785","source_kind":"report","title":"Testing and return to service","path":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md"},"chunk_fb73a7f2277732f9c4b6158d":{"id":"chunk_fb73a7f2277732f9c4b6158d","source_id":"src_b94f3fb94d5d1496e2d01785","source_kind":"report","title":"Parts and cost","path":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md"}}
}
```

Nathan Pierce · Turn 5 · partial

Show me the recalled pumps that are still in the ground in my area, and what it cost to install each one.

```json
{
  "schema_version": "1.0",
  "answer_id": "9b3fd814-d5d4-4d6f-aa63-120a0b8ac3f5",
  "thread_id": "26e31975-59dc-4e25-b41e-f3e87feae766",
  "user_id": "U-601",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Partial answer: verified data is shown below. The explanation could not be completed because the generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"9b3fd814-d5d4-4d6f-aa63-120a0b8ac3f5:verified:0","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_c716abab65324ab8a75f74d70a9d9ed8","evidence_ids":["ev_aecf97d98f933acd7a482eef","ev_0d5517c9853842c8024013e4","src_ef00a9b04ea8747af03b27fb","src_853c7f7623412e1b78b5e791","ev_08270ebc000df4f1f5db64f1","result_c716abab65324ab8a75f74d70a9d9ed8","ev_935442f282cd866b735afd01","ev_1181c64586cc03d0aa986f9c"],"encoding":{},"span":2}],
  "results": {"result_c716abab65324ab8a75f74d70a9d9ed8":{"result_set_id":"result_c716abab65324ab8a75f74d70a9d9ed8","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"serial","label":"Serial"},{"key":"lot","label":"Lot"},{"key":"parts_installed","label":"Parts

```
Installed"},{"key":"installation_job","label":"Installation Job"},{"key":"installed_at","label":"Installed
At"},{"key":"installation_cost_usd","label":"Installation Cost Usd","unit":"USD","raw_source_value":true},{"key":"asse
ssment","label":"Assessment"},{"key":"documented_in_ground","label":"Documented In
Ground"},{"key":"included_in_operational_recall_list","label":"Included In Operational Recall
List"},{"key":"work_order_verified","label":"Work Order Verified"},{"key":"replacement_claims","label":"Replacement
Claims"},{"key":"producing","label":"Producing"},{"key":"status_now","label":"Status
Now"},{"key":"status_confirmed","label":"Status Confirmed"},{"key":"last_repair_id","label":"Last Repair
Id"},{"key":"last_repair_at","label":"Last Repair At"},{"key":"last_repair_equipment","label":"Last Repair
Equipment"},{"key":"installation_cost_usd_thousands","label":"Installation Cost Usd (thousand USD)","unit":"thousand U
SD","derived_from":"installation_cost_usd","display_divisor":1000}],"rows":[{"installation_job":"MNT-0305-032","status
_now":"Producing oil","last_repair_equipment":"downhole_pump","installation_cost_usd":24528,"assessment":"recorded_in_
ground","work_order_verified":null,"serial":"SN-978137","area_name":"Northwest Block
12","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-978137, lot LOT-24
09-A","asset_id":"WELL-0305","status_confirmed":true,"installed_at":"2026-10-21T14:00:00Z","last_repair_at":"2026-10-1
6T08:00:00Z","area_id":"NW-12","lot":"LOT-2409-A","replacement_claims":"[]","last_repair_id":"MNT-0305-032","included_
in_operational_recall_list":true,"installation_cost_usd_thousands":24.528},{"installation_job":"MNT-0426-030","status_
now":"Producing oil","last_repair_equipment":"pump_jack","installation_cost_usd":24044,"assessment":"recorded_in_groun
d","work_order_verified":null,"serial":"SN-880271","area_name":"Northwest Block
12","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-880271, lot LOT-24
09-C","asset_id":"WELL-0426","status_confirmed":true,"installed_at":"2026-06-24T22:00:00Z","last_repair_at":"2026-08-0
9T08:00:00Z","area_id":"NW-12","lot":"LOT-2409-C","replacement_claims":"[]","last_repair_id":"MNT-0426-033","included_
in_operational_recall_list":true,"installation_cost_usd_thousands":24.044},{"installation_job":"MNT-0428-022","status_
now":"Producing oil","last_repair_equipment":"downhole_pump","installation_cost_usd":27074,"assessment":"recorded_in_g
round","work_order_verified":null,"serial":"SN-708611","area_name":"Northwest Block
12","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-708611, lot LOT-24
10-B","asset_id":"WELL-0428","status_confirmed":true,"installed_at":"2026-03-17T11:00:00Z","last_repair_at":"2026-03-0
7T08:00:00Z","area_id":"NW-12","lot":"LOT-2410-B","replacement_claims":"[]","last_repair_id":"MNT-0428-022","included_
in_operational_recall_list":true,"installation_cost_usd_thousands":27.074}],"evidence_ids":["ev_aecf97d98f933acd7a482e
ef","ev_0d5517c9853842c8024013e4","src_ef00a9b04ea8747af03b27fb","src_853c7f7623412e1b78b5e791","ev_08270ebc000df4f1f5
db64f1","result_c716abab65324ab8a75f74d70a9d9ed8","ev_935442f282cd866b735afd01","ev_1181c64586cc03d0aa986f9c","src_815
83d1c4536722f5401c680","ev_34112aba2a657a223de798f9","ev_c0f401df2b20db9071ca4338","ev_a4f4cbab2ed8a1770afbcf5b","ev_1
8b1580940f38e53e7490b80","src_dc1338cc1e13817cfb80817e","ev_7cabe3fb75e0c725bfc05296","ev_3e7c914c90b36bb2db64fc62"],"
provider_coverage":{"unit":"recall_inventory","matching":4,"evaluated":4,"unknown":0,"import_issues":0,"status":"compl
ete","displayed_rows":3,"output_rows":3,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"tra
ce_240ad347cadb4e42b2fbc2252ad82f75","warnings":["Missing records do not independently prove real-world inaction;
calendar reference date supplies no time of day.","Physical inventory and operational count are separate: explicit
direct attributed replacement instruction changes operational count with unverified-work-order flag; hearsay does not.
No claim becomes inspected physical evidence.","Installation cost is recorded total job cost, not pump-only price or
paid expenditure."],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"maintenance","metri
c":"recall_inventory"},"summary":{"total_matching":4,"assessment_counts":{"recorded_in_ground":3,"reported_replaced_un
verified":1},"area_counts":{"Northwest Block 12":4},"documented_in_ground":4,"unconfirmed_replacement_claims":1,"opera
tional_in_ground":3,"operational_area_counts":{"Northwest Block
12":3},"excluded_replacement_updates":[{"asset_id":"WELL-0333","area_name":"Northwest Block 12","assessment":"reported
_replaced_unverified","serial":"SN-507591","lot":"LOT-2409-A","installation_job":"MNT-0333-024","documented_in_ground"
:true,"work_order_verified":false,"replacement_claims":[{"id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","author":"
U-601","statement":"The recalled pump for WELL-0333 was swapped out on 2027-01-14, pending formal system
documentation, and should be counted as replaced from now on.","valid_from":"2027-01-15","valid_to":null,"status":"att
ributed","conflicts":[],"qualifier":"attributed","firsthand":false,"attribution_basis":"attributed"},{"id":"memory:6f7
2ff2e-f14e-4db1-9d26-6e5b1f30b765","author":"U-601","statement":"The recalled pump for WELL-0333 was swapped out on
2027-01-14, pending formal system documentation, and should be counted as replaced from now on.","valid_from":"2027-01
-15","valid_to":null,"status":"unconfirmed","conflicts":[],"qualifier":"attributed","firsthand":false,"attribution_bas
is":"attributed"},{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","author":"U-601","statement":"A pump replacement
was performed on 2027-01-14, pending system documentation.","valid_from":null,"valid_to":null,"status":"attributed","c
onflicts":[],"qualifier":"attributed","firsthand":false,"attribution_basis":"attributed"}]}]},"assessment_counts":{"re
corded_in_ground":3,"reported_replaced_unverified":1},"coverage":{"matching":4,"evaluated":4,"unknown":0},"presentatio
n":{"sort_keys":["area_name","asset_id"],"currency_unit":"thousand USD"}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no
time of day.","Physical inventory and operational count are separate: explicit direct attributed replacement
instruction changes operational count with unverified-work-order flag; hearsay does not. No claim becomes inspected
physical evidence.","Installation cost is recorded total job cost, not pump-only price or paid expenditure.","Ranked
lexical retrieval cannot prove a fleet total or source absence","Report prose may predate corrections; a lexical hit
does not confirm effective spill detection or current classification","The explanation is incomplete; the panels
contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanatio
n_error_code":"unsupported_claim","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":5525,"output_
tokens":191,"total_tokens":5716,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reas
on":"STOP"},"call_id":751,"live":true},{"stage":"maker","usage":{"input_tokens":5521,"output_tokens":613,"total_tokens
":6134,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":755
,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":5729,"output_tokens":665,"total_tokens":6394,"input_
token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":758,"live":true}]
},
  "evidence": {"ev_aecf97d98f933acd7a482eef":{"id":"ev_aecf97d98f933acd7a482eef","source_id":"src_0a4c0beadb992dd4a0ff
3647","source_kind":"metadata","title":"WELL-0428","path":"assets/WELL-0428/metadata.json"},"ev_0d5517c9853842c8024013
e4":{"id":"ev_0d5517c9853842c8024013e4","source_id":"src_fc86426bce84bc0b1d3106f7","source_kind":"maintenance","title"
:"MNT-0428-022","path":"assets/WELL-0428/maintenance.jsonl"},"src_ef00a9b04ea8747af03b27fb":{"id":"src_ef00a9b04ea8747
af03b27fb","source_id":"src_ef00a9b04ea8747af03b27fb","source_kind":"report","title":"assets/WELL-0428/maintenance-rep
orts/MNT-0428-022.md","path":"assets/WELL-0428/maintenance-reports/MNT-0428-022.md"},"src_853c7f7623412e1b78b5e791":{"
id":"src_853c7f7623412e1b78b5e791","source_id":"src_853c7f7623412e1b78b5e791","source_kind":"sop","title":"fleet/sops/
supplier-recall-notice-2026-12-01.md","path":"fleet/sops/supplier-recall-notice-2026-12-01.md"},"ev_08270ebc000df4f1f5
db64f1":{"id":"ev_08270ebc000df4f1f5db64f1","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","ti
tle":"INS-0428-0218","path":"assets/WELL-0428/inspections.jsonl"},"result_c716abab65324ab8a75f74d70a9d9ed8":{"id":"res
ult_c716abab65324ab8a75f74d70a9d9ed8","source_id":"result_c716abab65324ab8a75f74d70a9d9ed8","source_kind":"aggregate_l
ineage","title":"result_c716abab65324ab8a75f74d70a9d9ed8"},"ev_935442f282cd866b735afd01":{"id":"ev_935442f282cd866b735
afd01","source_id":"src_b6abb20d6010fc8f9a5161c0","source_kind":"metadata","title":"WELL-0426","path":"assets/WELL-042
6/metadata.json"},"ev_1181c64586cc03d0aa986f9c":{"id":"ev_1181c64586cc03d0aa986f9c","source_id":"src_c76378bdd2f19d65a
```

```
93adc62","source_kind":"maintenance","title":"MNT-0426-030","path":"assets/WELL-0426/maintenance.jsonl"},"src_81583d1c
4536722f5401c680":{"id":"src_81583d1c4536722f5401c680","source_id":"src_81583d1c4536722f5401c680","source_kind":"repor
t","title":"assets/WELL-0426/maintenance-reports/MNT-0426-030.md","path":"assets/WELL-0426/maintenance-reports/MNT-042
6-030.md"},"ev_34112aba2a657a223de798f9":{"id":"ev_34112aba2a657a223de798f9","source_id":"src_4dbd8195c2feb3123eca23b7
","source_kind":"inspections","title":"INS-0426-0222","path":"assets/WELL-0426/inspections.jsonl"},"ev_c0f401df2b20db9
071ca4338":{"id":"ev_c0f401df2b20db9071ca4338","source_id":"src_c76378bdd2f19d65a93adc62","source_kind":"maintenance",
"title":"MNT-0426-033","path":"assets/WELL-0426/maintenance.jsonl"},"ev_a4f4cbab2ed8a1770afbcf5b":{"id":"ev_a4f4cbab2e
d8a1770afbcf5b","source_id":"src_827164e72660ecb0547d8285","source_kind":"metadata","title":"WELL-0305","path":"assets
/WELL-0305/metadata.json"},"ev_18b1580940f38e53e7490b80":{"id":"ev_18b1580940f38e53e7490b80","source_id":"src_7df4d484
c15db67e4cf5e8e4","source_kind":"maintenance","title":"MNT-0305-032","path":"assets/WELL-0305/maintenance.jsonl"},"src
_dc1338cc1e13817cfb80817e":{"id":"src_dc1338cc1e13817cfb80817e","source_id":"src_dc1338cc1e13817cfb80817e","source_kin
d":"report","title":"assets/WELL-0305/maintenance-reports/MNT-0305-032.md","path":"assets/WELL-0305/maintenance-report
s/MNT-0305-032.md"},"ev_7cabe3fb75e0c725bfc05296":{"id":"ev_7cabe3fb75e0c725bfc05296","source_id":"src_f309ea7447e5255
e291364b7","source_kind":"inspections","title":"INS-0305-0216","path":"assets/WELL-0305/inspections.jsonl"},"ev_3e7c91
4c90b36bb2db64fc62":{"id":"ev_3e7c914c90b36bb2db64fc62","source_id":"src_f5a9fd97d067c429605d6b49","source_kind":"cont
ext","title":"CTX-0305-001","path":"assets/WELL-0305/context.jsonl"},"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3":{"i
d":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_kin
d":"shared_knowledge","title":"Observation reported by Olivia Grant"},"memory:ea233e6c-8168-431d-99f3-840cdbc32f54":{"
id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_ki
nd":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:1de31300-5ad0-4dfd-96ec-5224889d3906":
{"id":"memory:1de31300-5ad0-4dfd-96ec-5224889d3906","source_id":"memory:1de31300-5ad0-4dfd-96ec-5224889d3906","source_
kind":"private_memory","title":"Preference reported by Nathan Pierce"},"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d":{
"id":"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d","source_id":"memory:0ce382ad-c21c-431d-96bf-26d89c7d200d","source_k
ind":"private_memory","title":"Preference reported by Nathan Pierce"},"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829":{"
id":"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829","source_id":"memory:2868c56a-d0b7-408c-a839-e5bbbd01c829","source_ki
nd":"private_memory","title":"Preference reported by Nathan Pierce"},"chunk_a9a0270297a0dc92f2bf35e0":{"id":"chunk_a9a
0270297a0dc92f2bf35e0","source_id":"src_db16880a486fec53f9546f4a","source_kind":"report","title":"Safety and permits",
"path":"assets/WELL-0333/maintenance-reports/MNT-0333-024.md"},"chunk_dbd40e7f11bf9aed6c30ca7a":{"id":"chunk_dbd40e7f1
1bf9aed6c30ca7a","source_id":"src_db16880a486fec53f9546f4a","source_kind":"report","title":"Parts and cost","path":"as
sets/WELL-0333/maintenance-reports/MNT-0333-024.md"},"chunk_2c89ede7a9bb9443818022ba":{"id":"chunk_2c89ede7a9bb9443818
022ba","source_id":"src_db16880a486fec53f9546f4a","source_kind":"report","title":"Work done","path":"assets/WELL-0333/
maintenance-reports/MNT-0333-024.md"},"chunk_37c588e9bcaf707914a3f28f":{"id":"chunk_37c588e9bcaf707914a3f28f","source_
id":"src_7633bfa376043dda5131a9e2","source_kind":"report","title":"Root cause","path":"assets/WELL-0333/maintenance-re
ports/MNT-0333-020.md"},"chunk_06d29830305c7ccbf76a9a49":{"id":"chunk_06d29830305c7ccbf76a9a49","source_id":"src_0aad5
4a586a41d090f8ddc4a","source_kind":"report","title":"Parts and cost","path":"assets/WELL-0333/maintenance-reports/MNT-
0333-005.md"},"chunk_d741b215940fa7d65ab94abd":{"id":"chunk_d741b215940fa7d65ab94abd","source_id":"src_ae70e972a8a5a67
a5b7ad0c6","source_kind":"report","title":"Parts and
cost","path":"assets/WELL-0333/maintenance-reports/MNT-0333-009.md"}}
}
```

Question 9

Robert Hayes · Turn 1 · partial

How many recalled pumps are still in the ground, and in which areas?


```json
{
  "schema_version": "1.0",
  "answer_id": "71516edc-8417-4c50-b1b6-0351aa67e275",
  "thread_id": "3e4ffac7-1777-4011-b479-a004261ff08d",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Partial answer: verified data is shown below. The explanation could not be completed because the generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"71516edc-8417-4c50-b1b6-0351aa67e275:verified:0","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_436f51bf159c447b94c61031010e8e0d","evidence_ids":["ev_aecf97d98f933acd7a482eef","ev_0d5517c9853842c8024013e4","src_ef00a9b04ea8747af03b27fb","src_853c7f7623412e1b78b5e791","ev_08270ebc000df4f1f5db64f1","result_436f51bf159c447b94c61031010e8e0d","ev_ecd062eace8e3149af5efa98","ev_de6c0ddf304742e362c227a5"],"encoding":{},"span":2}],
  "results": {"result_436f51bf159c447b94c61031010e8e0d":{"result_set_id":"result_436f51bf159c447b94c61031010e8e0d","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"serial","label":"Serial"},{"key":"lot","label":"Lot"},{"key":"parts_installed","label":"Parts Installed"},{"key":"installation_job","label":"Installation Job"},{"key":"installed_at","label":"Installed At"},{"key":"installation_cost_usd","label":"Installation Cost Usd","unit":"USD"},{"key":"assessment","label":"Assessment"},{"key":"documented_in_ground","label":"Documented In Ground"},{"key":"included_in_operational_recall_list","label":"Included In Operational Recall List"},{"key":"work_order_verified","label":"Work Order Verified"},{"key":"replacement_claims","label":"Replacement Claims"},{"key":"producing","label":"Producing"},{"key":"status_now","label":"Status Now"},{"key":"status_confirmed","label":"Status Confirmed"},{"key":"last_repair_id","label":"Last Repair Id"},{"key":"last_repair_at","label":"Last Repair At"},{"key":"last_repair_equipment","label":"Last Repair Equipment"}],"rows":[{"installation_job":"MNT-0428-022","status_now":"Producing oil","last_repair_equipment":"downhole_pump","installation_cost_usd":27074,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"SN-708611","area_name":"Northwest Block 12","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-708611, lot LOT-2410-B","asset_id":"WELL-0428","status_confirmed":true,"installed_at":"2026-03-17T11:00:00Z","last_repair_at":"2026-03-07T08:00:00Z","area_id":"NW-12","lot":"LOT-2410-B","replacement_claims":"[]","last_repair_id":"MNT-0428-022","included_in_operational_recall_list":true},{"installation_job":"MNT-0031-027","status_now":"Producing oil","last_repair_equipment":"wellhead","installation_cost_usd":19625,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"SN-664877","area_name":"Southwest Block 23","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-664877, lot LOT-2409-A","asset_id":"WELL-0031","status_confirmed":true,"installed_at":"2026-05-06T20:00:00Z","last_repair_at":"2027-01-02T08:00:00Z","area_id":"SW-23","lot":"LOT-2409-A","replacement_claims":"[]","last_repair_id":"MNT-0031-033","included_in_operational_recall_list":true},{"installation_job":"MNT-0263-033","status_now":"Not producing oil","last_repair_equipment":"flowline","installation_cost_usd":17254,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"SN-187332","area_name":"Southwest Block 23","producing":false,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-187332, lot LOT-2410-B","asset_id":"WELL-0263","status_confirmed":true,"installed_at":"2026-10-20T01:00:00Z","last_repair_at":"2027-01-09T08:00:00Z","area_id":"SW-23","lot":"LOT-2410-B","replacement_claims":"[]","last_repair_id":"MNT-0263-035","included_in_operational_recall_list":true},{"installation_job":"MNT-0426-030","status_now":"Producing oil","last_repair_equipment":"pump_jack","installation_cost_usd":24044,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"SN-880271","area_name":"Northwest Block 12","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-880271, lot LOT-2409-C","asset_id":"WELL-0426","status_confirmed":true,"installed_at":"2026-06-24T22:00:00Z","last_repair_at":"2026-08-09T08:00:00Z","area_id":"NW-12","lot":"LOT-2409-C","replacement_claims":"[]","last_repair_id":"MNT-0426-033","included_in_operational_recall_list":true},{"installation_job":"MNT-0156-027","status_now":"Producing oil","last_repair_equipment":"downhole_pump","installation_cost_usd":23398,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"SN-952958","area_name":"Northeast Block 8","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-952958, lot LOT-2409-A","asset_id":"WELL-0156","status_confirmed":true,"installed_at":"2026-07-01T08:00:00Z","last_repair_at":"2026-06-27T08:00:00Z","area_id":"NE-08","lot":"LOT-2409-A","replacement_claims":"[]","last_repair_id":"MNT-0156-027","included_in_operational_recall_list":true},{"installation_job":"MNT-0160-028","status_now":"Not producing oil","last_repair_equipment":"pump_jack","installation_cost_usd":33086,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"SN-429965","area_name":"Northeast Block 8","producing":false,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-429965, lot LOT-2409-C","asset_id":"WELL-0160","status_confirmed":true,"installed_at":"2026-07-28T19:00:00Z","last_repair_at":"2027-01-15T08:00:00Z","area_id":"NE-08","lot":"LOT-2409-C","replacement_claims":"[]","last_repair_id":"MNT-0160-032","included_in_operational_recall_list":true},{"installation_job":"MNT-0577-028","status_now":"Producing oil","last_repair_equipment":"pump_jack","installation_cost_usd":25500,"assessment":"replacement_claim_unconfirmed","work_order_verified":false,"serial":"SN-757468","area_name":"Southeast Block 32","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-757468, lot LOT-2409-A","asset_id":"WELL-0577","status_confirmed":true,"installed_at":"2026-08-11T12:00:00Z","last_repair_at":"2026-11-21T08:00:00Z","area_id":"SE-32","lot":"LOT-2409-A","replacement_claims":"[{\"id\": \"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3\", \"author\": \"U-501\", \"statement\": \"The recalled pump on WELL-0577 was swapped as reported by Nathan, though physical inventory and official replacement records remain subject to documented maintenance closure rules.\", \"valid_from\": \"2027-01-15\", \"valid_to\": null, \"status\": \"unconfirmed\", \"conflicts\": [], \"qualifier\": \"hearsay\", \"firsthand\": false, \"attribution_basis\": \"hearsay\"}]","last_repair_id":"MNT-0577-032","included_in_operational_recall_list":true},{"installation_job":"MNT-0305-032","status_now":"Producing oil","last_repair_equipment":"downhole_pump","installation_cost_usd":24528,"assessment":"recorded_in_ground","work_order_verified":null,"serial":"SN-978137","area_name":"Northwest Block 12","producing":true,"documented_in_ground":true,"parts_installed":"Highline RP-175 pump, serial SN-978137, lot LOT-2409-A","asset_id":"WELL-0305","status_confirmed":true,"installed_at":"2026-10-21T14:00:00Z","last_repair_at":"2026-10-16T08:00:00Z","area_id":"NW-12","lot":"LOT-2409-A","replacement_claims":"[]","last_repair_id":"MNT-0305-032","included_in_operational_recall_list":true}],"evidence_ids":["ev_aecf97d98f933acd7a482eef","ev_0d5517c9853842c8024013e4","src_ef00a9b04ea8747af03b27fb","src_853c7f7623412e1b78b5e791","ev_08270ebc000df4f1f5db64f1","result_436f51bf159c447b94c61031010e8e0d","ev_ecd062eace8e3149af5efa98","ev_de6c0ddf304742e362c227a5","src_3c4e87f1039a258fecebce73","ev_b78f72b1bc6c00c0209a35f1","ev_8a1a0d04ef69b47cbbd7e2a9","ev_64f37f5e03cf883914b5517b","ev_038c94ae2102a687f08dd299","ev_e1c9d34f62c3
```

```
afd8ddbf9e7d","src_d3d63c76890743ca90feaed2","ev_206d45edd557b98a1a58e3b7","ev_36f2b2dc10b914ab17e6f607","ev_935442f28
2cd866b735afd01","ev_1181c64586cc03d0aa986f9c","src_81583d1c4536722f5401c680","ev_34112aba2a657a223de798f9","ev_c0f401
df2b20db9071ca4338","ev_b0ea06187658ebe5d2567d0d","ev_fe3ce48741144d07651bdf11","src_9b54407ca5b9f1a256dbaf8a","ev_fa0
2979fc8349d0c7004e28f","ev_ee744e100e1f136b515c2947","ev_e2bf7a3b1283965196108c64","src_4ce65c1f3cac22a62f97f963","ev_
190217ada5c63174fef3e59d","ev_024ef47ffe4fe7f7de6fa26f","ev_fbd4b7b4e99379f1f849327c","ev_33881d2e0f89e2a1ae009719","s
rc_b94f3fb94d5d1496e2d01785","ev_69f2a8c39f8df63775ada596","ev_ce15a0af9f5bb4dd0d818f63","ev_a4f4cbab2ed8a1770afbcf5b"
,"ev_18b1580940f38e53e7490b80","src_dc1338cc1e13817cfb80817e","ev_7cabe3fb75e0c725bfc05296","ev_3e7c914c90b36bb2db64fc
62"],"provider_coverage":{"unit":"recall_inventory","matching":9,"evaluated":9,"unknown":0,"import_issues":0,"status":
"complete","displayed_rows":8,"output_rows":8,"display_truncated":false,"aggregation_input_truncated":false},"trace_id
":"trace_b25c1f532af4447582fb8a39d4ce7ee3","warnings":["Missing records do not independently prove real-world
inaction; calendar reference date supplies no time of day.","Physical inventory and operational count are separate:
explicit direct attributed replacement instruction changes operational count with unverified-work-order flag; hearsay
does not. No claim becomes inspected physical evidence.","Installation cost is recorded total job cost, not pump-only
price or paid expenditure."],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"assets","m
etric":"recall_inventory"},"summary":{"total_matching":9,"assessment_counts":{"recorded_in_ground":7,"reported_replace
d_unverified":1,"replacement_claim_unconfirmed":1},"area_counts":{"Northwest Block 12":4,"Southwest Block
23":2,"Northeast Block 8":2,"Southeast Block 32":1},"documented_in_ground":9,"unconfirmed_replacement_claims":2,"opera
tional_in_ground":8,"operational_area_counts":{"Northwest Block 12":3,"Southwest Block 23":2,"Northeast Block
8":2,"Southeast Block 32":1},"excluded_replacement_updates":[{"asset_id":"WELL-0333","area_name":"Northwest Block 12",
"assessment":"reported_replaced_unverified","serial":"SN-507591","lot":"LOT-2409-A","installation_job":"MNT-0333-024",
"documented_in_ground":true,"work_order_verified":false,"replacement_claims":[{"id":"memory:ea233e6c-8168-431d-99f3-84
0cdbc32f54","author":"U-601","statement":"The recalled pump for WELL-0333 was swapped out on 2027-01-14, pending
formal system documentation, and should be counted as replaced from now on.","valid_from":"2027-01-15","valid_to":null
,"status":"attributed","conflicts":[],"qualifier":"attributed","firsthand":false,"attribution_basis":"attributed"},{"i
d":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","author":"U-601","statement":"The recalled pump for WELL-0333 was
swapped out on 2027-01-14, pending formal system documentation, and should be counted as replaced from now on.","valid
_from":"2027-01-15","valid_to":null,"status":"unconfirmed","conflicts":[],"qualifier":"attributed","firsthand":false,"
attribution_basis":"attributed"},{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","author":"U-601","statement":"A
pump replacement was performed on 2027-01-14, pending system documentation.","valid_from":null,"valid_to":null,"status
":"attributed","conflicts":[],"qualifier":"attributed","firsthand":false,"attribution_basis":"attributed"}]}]},"assess
ment_counts":{"recorded_in_ground":7,"reported_replaced_unverified":1,"replacement_claim_unconfirmed":1},"coverage":{"
matching":9,"evaluated":9,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no
time of day.","Physical inventory and operational count are separate: explicit direct attributed replacement
instruction changes operational count with unverified-work-order flag; hearsay does not. No claim becomes inspected
physical evidence.","Installation cost is recorded total job cost, not pump-only price or paid expenditure.","The
explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanatio
n_error_code":"unsupported_narrative_number","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":52
04,"output_tokens":160,"total_tokens":5364,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","
finish_reason":"STOP"},"call_id":762,"live":true},{"stage":"maker","usage":{"input_tokens":4207,"output_tokens":981,"t
otal_tokens":5188,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"c
all_id":766,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":4545,"output_tokens":672,"total_tokens":5
217,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":769,"l
ive":true}]},
  "evidence": {"ev_aecf97d98f933acd7a482eef":{"id":"ev_aecf97d98f933acd7a482eef","source_id":"src_0a4c0beadb992dd4a0ff
3647","source_kind":"metadata","title":"WELL-0428","path":"assets/WELL-0428/metadata.json"},"ev_0d5517c9853842c8024013
e4":{"id":"ev_0d5517c9853842c8024013e4","source_id":"src_fc86426bce84bc0b1d3106f7","source_kind":"maintenance","title"
:"MNT-0428-022","path":"assets/WELL-0428/maintenance.jsonl"},"src_ef00a9b04ea8747af03b27fb":{"id":"src_ef00a9b04ea8747
af03b27fb","source_id":"src_ef00a9b04ea8747af03b27fb","source_kind":"report","title":"assets/WELL-0428/maintenance-rep
orts/MNT-0428-022.md","path":"assets/WELL-0428/maintenance-reports/MNT-0428-022.md"},"src_853c7f7623412e1b78b5e791":{"
id":"src_853c7f7623412e1b78b5e791","source_id":"src_853c7f7623412e1b78b5e791","source_kind":"sop","title":"fleet/sops/
supplier-recall-notice-2026-12-01.md","path":"fleet/sops/supplier-recall-notice-2026-12-01.md"},"ev_08270ebc000df4f1f5
db64f1":{"id":"ev_08270ebc000df4f1f5db64f1","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","ti
tle":"INS-0428-0218","path":"assets/WELL-0428/inspections.jsonl"},"result_436f51bf159c447b94c61031010e8e0d":{"id":"res
ult_436f51bf159c447b94c61031010e8e0d","source_id":"result_436f51bf159c447b94c61031010e8e0d","source_kind":"aggregate_l
ineage","title":"result_436f51bf159c447b94c61031010e8e0d"},"ev_ecd062eace8e3149af5efa98":{"id":"ev_ecd062eace8e3149af5
efa98","source_id":"src_9b91a550d3d412d193d7cde3","source_kind":"metadata","title":"WELL-0031","path":"assets/WELL-003
1/metadata.json"},"ev_de6c0ddf304742e362c227a5":{"id":"ev_de6c0ddf304742e362c227a5","source_id":"src_d9142567942767d8f
00359c3","source_kind":"maintenance","title":"MNT-0031-027","path":"assets/WELL-0031/maintenance.jsonl"},"src_3c4e87f1
039a258fecebce73":{"id":"src_3c4e87f1039a258fecebce73","source_id":"src_3c4e87f1039a258fecebce73","source_kind":"repor
t","title":"assets/WELL-0031/maintenance-reports/MNT-0031-027.md","path":"assets/WELL-0031/maintenance-reports/MNT-003
1-027.md"},"ev_b78f72b1bc6c00c0209a35f1":{"id":"ev_b78f72b1bc6c00c0209a35f1","source_id":"src_896837d9337b9fbf5c6babdc
","source_kind":"inspections","title":"INS-0031-0215","path":"assets/WELL-0031/inspections.jsonl"},"ev_8a1a0d04ef69b47
cbbd7e2a9":{"id":"ev_8a1a0d04ef69b47cbbd7e2a9","source_id":"src_0b8799c783ddf67dced4b05a","source_kind":"context","tit
le":"CTX-0031-001","path":"assets/WELL-0031/context.jsonl"},"ev_64f37f5e03cf883914b5517b":{"id":"ev_64f37f5e03cf883914
b5517b","source_id":"src_d9142567942767d8f00359c3","source_kind":"maintenance","title":"MNT-0031-033","path":"assets/W
ELL-0031/maintenance.jsonl"},"ev_038c94ae2102a687f08dd299":{"id":"ev_038c94ae2102a687f08dd299","source_id":"src_1c75a1
0d9e027c44ad0cfe8c","source_kind":"metadata","title":"WELL-0263","path":"assets/WELL-0263/metadata.json"},"ev_e1c9d34f
62c3afd8ddbf9e7d":{"id":"ev_e1c9d34f62c3afd8ddbf9e7d","source_id":"src_eb2bcbf0705db2f921b7a262","source_kind":"mainte
nance","title":"MNT-0263-033","path":"assets/WELL-0263/maintenance.jsonl"},"src_d3d63c76890743ca90feaed2":{"id":"src_d
3d63c76890743ca90feaed2","source_id":"src_d3d63c76890743ca90feaed2","source_kind":"report","title":"assets/WELL-0263/m
aintenance-reports/MNT-0263-033.md","path":"assets/WELL-0263/maintenance-reports/MNT-0263-033.md"},"ev_206d45edd557b98
a1a58e3b7":{"id":"ev_206d45edd557b98a1a58e3b7","source_id":"src_4905a07485ed996443163eac","source_kind":"inspections",
"title":"INS-0263-0219","path":"assets/WELL-0263/inspections.jsonl"},"ev_36f2b2dc10b914ab17e6f607":{"id":"ev_36f2b2dc1
0b914ab17e6f607","source_id":"src_eb2bcbf0705db2f921b7a262","source_kind":"maintenance","title":"MNT-0263-035","path":
"assets/WELL-0263/maintenance.jsonl"},"ev_935442f282cd866b735afd01":{"id":"ev_935442f282cd866b735afd01","source_id":"s
rc_b6abb20d6010fc8f9a5161c0","source_kind":"metadata","title":"WELL-0426","path":"assets/WELL-0426/metadata.json"},"ev
_1181c64586cc03d0aa986f9c":{"id":"ev_1181c64586cc03d0aa986f9c","source_id":"src_c76378bdd2f19d65a93adc62","source_kind
":"maintenance","title":"MNT-0426-030","path":"assets/WELL-0426/maintenance.jsonl"},"src_81583d1c4536722f5401c680":{"i
d":"src_81583d1c4536722f5401c680","source_id":"src_81583d1c4536722f5401c680","source_kind":"report","title":"assets/WE
LL-0426/maintenance-reports/MNT-0426-030.md","path":"assets/WELL-0426/maintenance-reports/MNT-0426-030.md"},"ev_34112a
ba2a657a223de798f9":{"id":"ev_34112aba2a657a223de798f9","source_id":"src_4dbd8195c2feb3123eca23b7","source_kind":"insp
ections","title":"INS-0426-0222","path":"assets/WELL-0426/inspections.jsonl"},"ev_c0f401df2b20db9071ca4338":{"id":"ev_
c0f401df2b20db9071ca4338","source_id":"src_c76378bdd2f19d65a93adc62","source_kind":"maintenance","title":"MNT-0426-033
```

","path":"assets/WELL-0426/maintenance.jsonl"},"ev_b0ea06187658ebe5d2567d0d":{"id":"ev_b0ea06187658ebe5d2567d0d","source_id":"src_67b3ad042ea971937347961f","source_kind":"metadata","title":"WELL-0156","path":"assets/WELL-0156/metadata.json"},"ev_fe3ce48741144d07651bdf11":{"id":"ev_fe3ce48741144d07651bdf11","source_id":"src_45814726fbc026cea45f8f67","source_kind":"maintenance","title":"MNT-0156-027","path":"assets/WELL-0156/maintenance.jsonl"},"src_9b54407ca5b9f1a256dbaf8a":{"id":"src_9b54407ca5b9f1a256dbaf8a","source_id":"src_9b54407ca5b9f1a256dbaf8a","source_kind":"report","title":"assets/WELL-0156/maintenance-reports/MNT-0156-027.md","path":"assets/WELL-0156/maintenance-reports/MNT-0156-027.md"},"ev_fa02979fc8349d0c7004e28f":{"id":"ev_fa02979fc8349d0c7004e28f","source_id":"src_ed1a309a3d743577acf65c37","source_kind":"inspections","title":"INS-0156-0217","path":"assets/WELL-0156/inspections.jsonl"},"ev_ee744e100e1f136b515c2947":{"id":"ev_ee744e100e1f136b515c2947","source_id":"src_b19afa2b76221e3878696fcf","source_kind":"metadata","title":"WELL-0160","path":"assets/WELL-0160/metadata.json"},"ev_e2bf7a3b1283965196108c64":{"id":"ev_e2bf7a3b1283965196108c64","source_id":"src_04719696ca2d338b02f0dc6e","source_kind":"maintenance","title":"MNT-0160-028","path":"assets/WELL-0160/maintenance.jsonl"},"src_4ce65c1f3cac22a62f97f963":{"id":"src_4ce65c1f3cac22a62f97f963","source_id":"src_4ce65c1f3cac22a62f97f963","source_kind":"report","title":"assets/WELL-0160/maintenance-reports/MNT-0160-028.md","path":"assets/WELL-0160/maintenance-reports/MNT-0160-028.md"},"ev_190217ada5c63174fef3e59d":{"id":"ev_190217ada5c63174fef3e59d","source_id":"src_423036549bd4facf67674e7a","source_kind":"inspections","title":"INS-0160-0217","path":"assets/WELL-0160/inspections.jsonl"},"ev_024ef47ffe4fe7f7de6fa26f":{"id":"ev_024ef47ffe4fe7f7de6fa26f","source_id":"src_04719696ca2d338b02f0dc6e","source_kind":"maintenance","title":"MNT-0160-032","path":"assets/WELL-0160/maintenance.jsonl"},"ev_fbd4b7b4e99379f1f849327c":{"id":"ev_fbd4b7b4e99379f1f849327c","source_id":"src_639f855c0b5f55747c10f304","source_kind":"metadata","title":"WELL-0577","path":"assets/WELL-0577/metadata.json"},"ev_33881d2e0f89e2a1ae009719":{"id":"ev_33881d2e0f89e2a1ae009719","source_id":"src_3e9bbe49277aa4f833e42f6c","source_kind":"maintenance","title":"MNT-0577-028","path":"assets/WELL-0577/maintenance.jsonl"},"src_b94f3fb94d5d1496e2d01785":{"id":"src_b94f3fb94d5d1496e2d01785","source_id":"src_b94f3fb94d5d1496e2d01785","source_kind":"report","title":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md","path":"assets/WELL-0577/maintenance-reports/MNT-0577-028.md"},"ev_69f2a8c39f8df63775ada596":{"id":"ev_69f2a8c39f8df63775ada596","source_id":"src_da28b5372b2d5ce8d386d2f5","source_kind":"inspections","title":"INS-0577-0211","path":"assets/WELL-0577/inspections.jsonl"},"ev_ce15a0af9f5bb4dd0d818f63":{"id":"ev_ce15a0af9f5bb4dd0d818f63","source_id":"src_3e9bbe49277aa4f833e42f6c","source_kind":"maintenance","title":"MNT-0577-032","path":"assets/WELL-0577/maintenance.jsonl"},"ev_a4f4cbab2ed8a1770afbcf5b":{"id":"ev_a4f4cbab2ed8a1770afbcf5b","source_id":"src_827164e72660ecb0547d8285","source_kind":"metadata","title":"WELL-0305","path":"assets/WELL-0305/metadata.json"},"ev_18b1580940f38e53e7490b80":{"id":"ev_18b1580940f38e53e7490b80","source_id":"src_7df4d484c15db67e4cf5e8e4","source_kind":"maintenance","title":"MNT-0305-032","path":"assets/WELL-0305/maintenance.jsonl"},"src_dc1338cc1e13817cfb80817e":{"id":"src_dc1338cc1e13817cfb80817e","source_id":"src_dc1338cc1e13817cfb80817e","source_kind":"report","title":"assets/WELL-0305/maintenance-reports/MNT-0305-032.md","path":"assets/WELL-0305/maintenance-reports/MNT-0305-032.md"},"ev_7cabe3fb75e0c725bfc05296":{"id":"ev_7cabe3fb75e0c725bfc05296","source_id":"src_f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0216","path":"assets/WELL-0305/inspections.jsonl"},"ev_3e7c914c90b36bb2db64fc62":{"id":"ev_3e7c914c90b36bb2db64fc62","source_id":"src_f5a9fd97d067c429605d6b49","source_kind":"context","title":"CTX-0305-001","path":"assets/WELL-0305/context.jsonl"},"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3":{"id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_kind":"shared_knowledge","title":"Observation reported by Olivia Grant"},"memory:ea233e6c-8168-431d-99f3-840cdbc32f54":{"id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"}}
}
```

Robert Hayes · Turn 2 · partial

Different topic. Who leads Northwest Production, and how many wells does that team run?

```json
{
  "schema_version": "1.0",
  "answer_id": "1d1511f4-7175-4096-87da-31cefc674412",
  "thread_id": "3e4ffac7-1777-4011-b479-a004261ff08d",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Verified data: 150 matching assets [src_215c78036f52b5303b330fe0]. Partial answer: verified data is shown below. The explanation could not be completed because the generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"1d1511f4-7175-4096-87da-31cefc674412:verified:0","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_1f820a1d0ecb4c5b926ac0d80d50cd9c","evidence_ids":["result_1f820a1d0ecb4c5b926ac0d80d50cd9c","src_215c78036f52b5303b330fe0","src_0b27ec48fd9b0f16a6cd84c6","src_330aa8bd8455ae32332cb94c"],"encoding":{},"span":2},{"id":"1d1511f4-7175-4096-87da-31cefc674412:verified:1","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_b790c0e7d4584fcf802519caad509f48","evidence_ids":["src_215c78036f52b5303b330fe0","src_0b27ec48fd9b0f16a6cd84c6","src_330aa8bd8455ae32332cb94c"],"encoding":{},"span":2}],
  "results": {"result_1f820a1d0ecb4c5b926ac0d80d50cd9c":{"result_set_id":"result_1f820a1d0ecb4c5b926ac0d80d50cd9c","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{"key":"team_id","label":"Team Id"},{"key":"name","label":"Name"},{"key":"lead_user_id","label":"Lead User Id"},{"key":"team_name","label":"Team Name"}],"rows":[{"team_id":"TEAM-NW","name":"Northwest Production","lead_user_id":"U-601","team_name":"Northwest Production"}],"evidence_ids":["result_1f820a1d0ecb4c5b926ac0d80d50cd9c","src_215c78036f52b5303b330fe0","src_0b27ec48fd9b0f16a6cd84c6","src_330aa8bd8455ae32332cb94c"],"provider_coverage":{"unit":"matching_source_record","matching":1,"evaluated":1,"unknown":0,"import_issues":0,"status":"complete","output_rows":1,"displayed_rows":1,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_978de88026294907a9f3909e0d74a658","warnings":[],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"teams","metric":"records"},"summary":null,"coverage":{"matching":1,"evaluated":1,"unknown":0}},"result_b790c0e7d4584fcf802519caad509f48":{"result_set_id":"result_b790c0e7d4584fcf802519caad509f48","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{"key":"team_id","label":"Team Id"},{"key":"count","label":"Count","unit":"record"},{"key":"team_name","label":"Team Name"}],"rows":[{"team_id":"TEAM-NW","team_name":"Northwest Production","count":150}],"evidence_ids":["src_215c78036f52b5303b330fe0","src_0b27ec48fd9b0f16a6cd84c6","src_330aa8bd8455ae32332cb94c"],"provider_coverage":{"unit":"matching_source_record","matching":150,"evaluated":150,"unknown":0,"import_issues":0,"status":"complete","output_rows":1,"displayed_rows":1,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_9d405b89b3d24295a50d33c021

d80ad3","warnings":[],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"assets","metric":"count"},"summary":null,"coverage":{"matching":150,"evaluated":150,"unknown":0}}},
  "warnings": ["Some supporting documents could not be opened.","The explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanation_error_code":"invalid_claim_citation","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":5313,"output_tokens":260,"total_tokens":5573,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":773,"live":true},{"stage":"maker","usage":{"input_tokens":3918,"output_tokens":568,"total_tokens":4486,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":777,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":3896,"output_tokens":345,"total_tokens":4241,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":780,"live":true}]},
  "evidence": {"result_1f820a1d0ecb4c5b926ac0d80d50cd9c":{"id":"result_1f820a1d0ecb4c5b926ac0d80d50cd9c","source_id":"result_1f820a1d0ecb4c5b926ac0d80d50cd9c","source_kind":"aggregate_lineage","title":"result_1f820a1d0ecb4c5b926ac0d80d50cd9c"},"src_215c78036f52b5303b330fe0":{"id":"src_215c78036f52b5303b330fe0","source_id":"src_215c78036f52b5303b330fe0","source_kind":"manual","title":"fleet/well-types/T200.md","path":"fleet/well-types/T200.md"},"src_0b27ec48fd9b0f16a6cd84c6":{"id":"src_0b27ec48fd9b0f16a6cd84c6","source_id":"src_0b27ec48fd9b0f16a6cd84c6","source_kind":"manual","title":"fleet/well-types/T350.md","path":"fleet/well-types/T350.md"},"src_330aa8bd8455ae32332cb94c":{"id":"src_330aa8bd8455ae32332cb94c","source_id":"src_330aa8bd8455ae32332cb94c","source_kind":"manual","title":"fleet/well-types/T500.md","path":"fleet/well-types/T500.md"},"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3":{"id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_kind":"shared_knowledge","title":"Observation reported by Olivia Grant"},"memory:ea233e6c-8168-431d-99f3-840cdbc32f54":{"id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"}}
}
```

Robert Hayes · Turn 3 · partial

What does our operations SOP say about cold weather? Name one well that missed the check in December.

```json
{
  "schema_version": "1.0",
  "answer_id": "a7cd5422-0276-45f7-914e-98240e0139d4",
  "thread_id": "3e4ffac7-1777-4011-b479-a004261ff08d",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Partial answer: verified data is shown below. The explanation could not be completed because the generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"a7cd5422-0276-45f7-914e-98240e0139d4:verified:0","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_4c7cde2c08ca44a382797f0f78660ecc","evidence_ids":["ev_1853cc25d941bf09e252cf64","ev_599acd89b2df08519deb32ac","src_148067724bdb724664aecc6e","result_4c7cde2c08ca44a382797f0f78660ecc","ev_1501359937c92e6dbe60cd54","ev_b7195e8b648387e95d938994","ev_71a8a9a70cc12ffa705c28c9","ev_affecec645d1944951b4aaa5"],"encoding":{},"span":2}],
  "results": {"result_4c7cde2c08ca44a382797f0f78660ecc":{"result_set_id":"result_4c7cde2c08ca44a382797f0f78660ecc","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"inspection_id","label":"Inspection Id"},{"key":"inspected_at","label":"Inspected At"},{"key":"ambient_temp_c","label":"Ambient Temp C","unit":"C"},{"key":"producing","label":"Producing"},{"key":"response_id","label":"Response Id"},{"key":"response_at","label":"Response At"},{"key":"due_at","label":"Due At"},{"key":"assessment","label":"Assessment"}],"rows":[{"area_name":"Northwest Block 12","asset_id":"WELL-0310","response_id":null,"inspection_id":"INS-0310-0213","ambient_temp_c":-6.0,"inspected_at":"2026-12-17T07:15:00Z","producing":true,"response_at":null,"due_at":"2026-12-24T07:15:00+00:00","assessment":"missed","area_id":"NW-12"},{"area_name":"Northwest Block 12","asset_id":"WELL-0325","response_id":"MNT-0325-030","inspection_id":"INS-0325-0215","ambient_temp_c":-10.5,"inspected_at":"2026-12-17T07:15:00Z","producing":true,"response_at":"2026-12-22T09:00:00Z","due_at":"2026-12-24T07:15:00+00:00","assessment":"met","area_id":"NW-12"},{"area_name":"Northwest Block 12","asset_id":"WELL-0354","response_id":null,"inspection_id":"INS-0354-0215","ambient_temp_c":-11.4,"inspected_at":"2026-12-17T07:15:00Z","producing":true,"response_at":null,"due_at":"2026-12-24T07:15:00+00:00","assessment":"missed","area_id":"NW-12"},{"area_name":"Northwest Block 12","asset_id":"WELL-0421","response_id":"MNT-0421-032","inspection_id":"INS-0421-0216","ambient_temp_c":-8.0,"inspected_at":"2026-12-17T07:00:00Z","producing":true,"response_at":"2026-12-20T09:00:00Z","due_at":"2026-12-24T07:00:00+00:00","assessment":"met","area_id":"NW-12"},{"area_name":"Northwest Block 12","asset_id":"WELL-0445","response_id":"MNT-0445-026","inspection_id":"INS-0445-0213","ambient_temp_c":-9.1,"inspected_at":"2026-12-17T07:30:00Z","producing":true,"response_at":"2026-12-21T09:00:00Z","due_at":"2026-12-24T07:30:00+00:00","assessment":"met","area_id":"NW-12"},{"area_name":"Southeast Block 32","asset_id":"WELL-0468","response_id":"MNT-0468-020","inspection_id":"INS-0468-0154","ambient_temp_c":-9.6,"inspected_at":"2026-12-31T07:15:00Z","producing":true,"response_at":"2027-01-05T09:00:00Z","due_at":"2027-01-07T07:15:00+00:00","assessment":"met","area_id":"SE-32"},{"area_name":"Southeast Block 32","asset_id":"WELL-0486","response_id":null,"inspection_id":"INS-0486-0219","ambient_temp_c":-7.0,"inspected_at":"2026-12-31T07:15:00Z","producing":true,"response_at":null,"due_at":"2027-01-07T07:15:00+00:00","assessment":"missed","area_id":"SE-32"},{"area_name":"Southeast Block 32","asset_id":"WELL-0531","response_id":null,"inspection_id":"INS-0531-0217","ambient_temp_c":-5.3,"inspected_at":"2026-12-31T07:30:00Z","producing":true,"response_at":null,"due_at":"2027-01-07T07:30:00+00:00","assessment":"missed","area_id":"SE-32"},{"area_name":"Southeast Block 32","asset_id":"WELL-0547","response_id":"MNT-0547-028","inspection_id":"INS-0547-0214","ambient_temp_c":-10.8,"inspected_at":"2026-12-31T07:15:00Z","producing":true,"response_at":"2027-01-04T09:00:00Z","due_at":"2027-01-07T07:15:00+00:00","assessment":"met","area_id":"SE-32"}],"evidence_ids":["ev_1853cc25d941bf09e252cf64","ev_599acd89b2df08519deb32ac","src_148067724bdb724664aecc6e","result_4c7cde2c08ca44a382797f0f78660ecc","ev_1501359937c92e6dbe60cd54","ev_b7195e8b648387e95d938994","ev_71a8a9a70cc12ffa705c28c9","ev_affecec645d1944951b4aaa5","ev_59c4a355aaf14fc2b8ec26b8","ev_2a80b85d4caf250f5820e618","ev_428163ea3d15cfac27256dd9","ev_afa7f04195ee03aa59798873","ev_8d92f7ee4546cc0f7589a504","ev_78a85c946e2785864a10703e","ev_db5423c47f

```
e556938d9cde4e","ev_a1f11a17452a03aba0e45d8c","ev_c0929b3ebac0fc61d533ff80","ev_0336b547a7d4b1c52815536b","ev_9495d831
9a329b255f9c0b6b","ev_4f858ca53fdbcf36722c5341","ev_c1db8f7a6aaf439eafd6c2de","ev_f7a3e61feed0158f52f07006","ev_f2ee4b
21b09ddf017559fc06","ev_f9a228bd2964e10c363dd0af","ev_17bc166c7b6bfd717e7bbc9d"],"provider_coverage":{"unit":"freeze_c
hecks","matching":9,"evaluated":9,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":9,"output_rows":9
,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_143cf65295ca4774afc6d2684de5df55","w
arnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of
day."],"bounds":{"start":"2026-12-01","end":"2026-12-31","closure":"both"},"operation":{"collection":"inspections","me
tric":"freeze_checks"},"summary":{"total_matching":9,"assessment_counts":{"missed":4,"met":5},"area_counts":{"Northwes
t Block 12":5,"Southeast Block
32":4}},"assessment_counts":{"missed":4,"met":5},"coverage":{"matching":9,"evaluated":9,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no
time of day.","Ranked lexical retrieval cannot prove a fleet total or source absence","Report prose may predate
corrections; a lexical hit does not confirm effective spill detection or current classification","The explanation is
incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanatio
n_error_code":"unsupported_narrative_number","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":54
20,"output_tokens":205,"total_tokens":5625,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","
finish_reason":"STOP"},"call_id":783,"live":true},{"stage":"maker","usage":{"input_tokens":5418,"output_tokens":805,"t
otal_tokens":6223,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"c
all_id":787,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":5456,"output_tokens":472,"total_tokens":5
928,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":790,"l
ive":true}]},
  "evidence": {"ev_1853cc25d941bf09e252cf64":{"id":"ev_1853cc25d941bf09e252cf64","source_id":"src_5fa0524b7feec7558dac
ad0c","source_kind":"metadata","title":"WELL-0310","path":"assets/WELL-0310/metadata.json"},"ev_599acd89b2df08519deb32
ac":{"id":"ev_599acd89b2df08519deb32ac","source_id":"src_fe79bd8501b6025a5aaff656","source_kind":"inspections","title"
:"INS-0310-0213","path":"assets/WELL-0310/inspections.jsonl"},"src_148067724bdb724664aecc6e":{"id":"src_148067724bdb72
4664aecc6e","source_id":"src_148067724bdb724664aecc6e","source_kind":"sop","title":"fleet/sops/operations-sop-rev2.md"
,"path":"fleet/sops/operations-sop-rev2.md"},"result_4c7cde2c08ca44a382797f0f78660ecc":{"id":"result_4c7cde2c08ca44a38
2797f0f78660ecc","source_id":"result_4c7cde2c08ca44a382797f0f78660ecc","source_kind":"aggregate_lineage","title":"resu
lt_4c7cde2c08ca44a382797f0f78660ecc"},"ev_1501359937c92e6dbe60cd54":{"id":"ev_1501359937c92e6dbe60cd54","source_id":"s
rc_0ea79e5a22d7651b1b332272","source_kind":"metadata","title":"WELL-0325","path":"assets/WELL-0325/metadata.json"},"ev
_b7195e8b648387e95d938994":{"id":"ev_b7195e8b648387e95d938994","source_id":"src_2158677200c4c6dbf7eeab70","source_kind
":"inspections","title":"INS-0325-0215","path":"assets/WELL-0325/inspections.jsonl"},"ev_71a8a9a70cc12ffa705c28c9":{"i
d":"ev_71a8a9a70cc12ffa705c28c9","source_id":"src_71f86474899d866c4c387a4c","source_kind":"maintenance","title":"MNT-0
325-030","path":"assets/WELL-0325/maintenance.jsonl"},"ev_affecec645d1944951b4aaa5":{"id":"ev_affecec645d1944951b4aaa5
","source_id":"src_4a216005b78c274afb0cef44","source_kind":"metadata","title":"WELL-0354","path":"assets/WELL-0354/met
adata.json"},"ev_59c4a355aaf14fc2b8ec26b8":{"id":"ev_59c4a355aaf14fc2b8ec26b8","source_id":"src_14f008175846e9fc2a02b0
8c","source_kind":"inspections","title":"INS-0354-0215","path":"assets/WELL-0354/inspections.jsonl"},"ev_2a80b85d4caf2
50f5820e618":{"id":"ev_2a80b85d4caf250f5820e618","source_id":"src_30f961229cba44833ab72a28","source_kind":"metadata","
title":"WELL-0421","path":"assets/WELL-0421/metadata.json"},"ev_428163ea3d15cfac27256dd9":{"id":"ev_428163ea3d15cfac27
256dd9","source_id":"src_d43cc947a6860e3256fff694","source_kind":"inspections","title":"INS-0421-0216","path":"assets/
WELL-0421/inspections.jsonl"},"ev_afa7f04195ee03aa59798873":{"id":"ev_afa7f04195ee03aa59798873","source_id":"src_79472
219d9c331a124bab7f8","source_kind":"maintenance","title":"MNT-0421-032","path":"assets/WELL-0421/maintenance.jsonl"},"
ev_8d92f7ee4546cc0f7589a504":{"id":"ev_8d92f7ee4546cc0f7589a504","source_id":"src_9a5cf72bd12c966fd61812e3","source_ki
nd":"metadata","title":"WELL-0445","path":"assets/WELL-0445/metadata.json"},"ev_78a85c946e2785864a10703e":{"id":"ev_78
a85c946e2785864a10703e","source_id":"src_22aa56ac179ad301fecb91b4","source_kind":"inspections","title":"INS-0445-0213"
,"path":"assets/WELL-0445/inspections.jsonl"},"ev_db5423c47fe556938d9cde4e":{"id":"ev_db5423c47fe556938d9cde4e","sourc
e_id":"src_83d6372b9d975eeec9cdcaf6","source_kind":"maintenance","title":"MNT-0445-026","path":"assets/WELL-0445/maint
enance.jsonl"},"ev_a1f11a17452a03aba0e45d8c":{"id":"ev_a1f11a17452a03aba0e45d8c","source_id":"src_b4fb34ce2c58313d8bf7
7eb5","source_kind":"metadata","title":"WELL-0468","path":"assets/WELL-0468/metadata.json"},"ev_c0929b3ebac0fc61d533ff
80":{"id":"ev_c0929b3ebac0fc61d533ff80","source_id":"src_ac9b9dbe15c79d642e733b59","source_kind":"inspections","title"
:"INS-0468-0154","path":"assets/WELL-0468/inspections.jsonl"},"ev_0336b547a7d4b1c52815536b":{"id":"ev_0336b547a7d4b1c5
2815536b","source_id":"src_43ac5ec08da3ecc527244211","source_kind":"maintenance","title":"MNT-0468-020","path":"assets
/WELL-0468/maintenance.jsonl"},"ev_9495d8319a329b255f9c0b6b":{"id":"ev_9495d8319a329b255f9c0b6b","source_id":"src_7461
d9eedbdd67a841ee385b","source_kind":"metadata","title":"WELL-0486","path":"assets/WELL-0486/metadata.json"},"ev_4f858c
a53fdbcf36722c5341":{"id":"ev_4f858ca53fdbcf36722c5341","source_id":"src_489090c621452619d84a60a0","source_kind":"insp
ections","title":"INS-0486-0219","path":"assets/WELL-0486/inspections.jsonl"},"ev_c1db8f7a6aaf439eafd6c2de":{"id":"ev_
c1db8f7a6aaf439eafd6c2de","source_id":"src_3678ca42b7f82300bddc679a","source_kind":"metadata","title":"WELL-0531","pat
h":"assets/WELL-0531/metadata.json"},"ev_f7a3e61feed0158f52f07006":{"id":"ev_f7a3e61feed0158f52f07006","source_id":"sr
c_09b7d62c5f6f4bf0fec01ad3","source_kind":"inspections","title":"INS-0531-0217","path":"assets/WELL-0531/inspections.j
sonl"},"ev_f2ee4b21b09ddf017559fc06":{"id":"ev_f2ee4b21b09ddf017559fc06","source_id":"src_2902e172e495005eebe5345b","s
ource_kind":"metadata","title":"WELL-0547","path":"assets/WELL-0547/metadata.json"},"ev_f9a228bd2964e10c363dd0af":{"id
":"ev_f9a228bd2964e10c363dd0af","source_id":"src_cecd91fac269909e97e2909a","source_kind":"inspections","title":"INS-05
47-0214","path":"assets/WELL-0547/inspections.jsonl"},"ev_17bc166c7b6bfd717e7bbc9d":{"id":"ev_17bc166c7b6bfd717e7bbc9d
","source_id":"src_032160403ebc0ac91ff0c9bf","source_kind":"maintenance","title":"MNT-0547-028","path":"assets/WELL-05
47/maintenance.jsonl"},"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3":{"id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b
3","source_id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_kind":"shared_knowledge","title":"Observation
reported by Olivia Grant"},"memory:ea233e6c-8168-431d-99f3-840cdbc32f54":{"id":"memory:ea233e6c-8168-431d-99f3-840cdbc
32f54","source_id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_kind":"shared_knowledge","title":"Observation
reported by Nathan Pierce"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f
30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observatio
n reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381
d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observat
ion reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24d
e35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observa
tion reported by Nathan Pierce"},"chunk_cd2490600d1ca8e24e5809d1":{"id":"chunk_cd2490600d1ca8e24e5809d1","source_id":"
src_148067724bdb724664aecc6e","source_kind":"sop","title":"OPS-5 Freeze protection (1 Dec – 28 Feb)","path":"fleet/sop
s/operations-sop-rev2.md"},"chunk_b6d7b3e8f0645f2816910ce9":{"id":"chunk_b6d7b3e8f0645f2816910ce9","source_id":"src_d4
003588cbb9d4d2cb89c135","source_kind":"sop","title":"3. Protocols","path":"fleet/sops/field-work-sop.md"},"chunk_ab6b6
c89f5ca6e4f94906b14":{"id":"chunk_ab6b6c89f5ca6e4f94906b14","source_id":"src_d4003588cbb9d4d2cb89c135","source_kind":"
sop","title":"1. Purpose","path":"fleet/sops/field-work-sop.md"},"chunk_d485f7d66de5fbb931e37164":{"id":"chunk_d485f7d
66de5fbb931e37164","source_id":"src_40f453f8564eae41c6b0c88a","source_kind":"sop","title":"Management of Change — MOC-
2026-031","path":"fleet/sops/moc-2026-031.md"},"chunk_e5c3d5ba270fbf4e6d498b6b":{"id":"chunk_e5c3d5ba270fbf4e6d498b6b"
,"source_id":"src_40f453f8564eae41c6b0c88a","source_kind":"sop","title":"Change","path":"fleet/sops/moc-2026-031.md"},
"chunk_368c7cb4948dc2c9833cf097":{"id":"chunk_368c7cb4948dc2c9833cf097","source_id":"src_b225e00c275a47ecd7c4ed16","so
```

urce_kind":"sop","title":"Conditions","path":"fleet/sops/moc-2026-036.md"}}
}
```

Robert Hayes · Turn 4 · complete

An operator reported a gas smell at WELL-0332 on 3 Dec. What was the H2S reading?

```json
{
  "schema_version": "1.0",
  "answer_id": "a2311a4e-b0c5-4172-8bbd-67dd2f116d1e",
  "thread_id": "3e4ffac7-1777-4011-b479-a004261ff08d",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "The supplied records for WELL-0332 indicate that an operator reported a gas odor near the wellhead on 3 Dec 2026 [memory:c6e55d28-edbf-4149-8dc8-f381d41eadba, result_02b4ed976c1b43a19cef29b1b5aecb8c]. However, the H2S reading is recorded as null, meaning the supplied records do not include that measurement and the actual concentration remains unknown [result_02b4ed976c1b43a19cef29b1b5aecb8c].",
  "blocks": [{"id":"a2311a4e-b0c5-4172-8bbd-67dd2f116d1e:block:0","type":"status","title":"WELL-0332 H2S Status","result_set_id":"result_02b4ed976c1b43a19cef29b1b5aecb8c","evidence_ids":["result_02b4ed976c1b43a19cef29b1b5aecb8c"],"encoding":{"label":"asset_id","value":"h2s_ppm","status":"assessment"},"span":1}],
  "results": {"result_02b4ed976c1b43a19cef29b1b5aecb8c":{"result_set_id":"result_02b4ed976c1b43a19cef29b1b5aecb8c","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"note_id","label":"Note Id"},{"key":"reported_at","label":"Reported At"},{"key":"note","label":"Note"},{"key":"response_id","label":"Response Id"},{"key":"response_at","label":"Response At"},{"key":"response_kind","label":"Response Kind"},{"key":"hours_to_response","label":"Hours To Response","unit":"hour"},{"key":"deadline_hours","label":"Deadline Hours","unit":"hour"},{"key":"due_at","label":"Due At"},{"key":"assessment","label":"Assessment"},{"key":"h2s_ppm","label":"H2S Ppm"}],"rows":[{"area_name":"Northwest Block 12","asset_id":"WELL-0332","response_id":null,"h2s_ppm":null,"reported_at":"2026-12-03T12:10:00Z","response_kind":null,"response_at":null,"hours_to_response":null,"due_at":"2026-12-04T12:10:00+00:00","assessment":"missed","deadline_hours":24,"note":"Gas odor reported by the pumper near WELL-0332 wellhead, area flagged off.","note_id":"CTX-0332-004","area_id":"NW-12"}],"evidence_ids":["ev_630cef1e4aa799df8e2fccad","ev_7fe351e3d9212748884010cb","src_148067724bdb724664aecc6e","result_02b4ed976c1b43a19cef29b1b5aecb8c"],"provider_coverage":{"unit":"gas_response","matching":1,"evaluated":1,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":1,"output_rows":1,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_b49f58c9712f41e5953cfebdcfd03718","warnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day."],"bounds":{"start":"2026-12-03","end":"2026-12-04","closure":"both"},"operation":{"collection":"maintenance","metric":"gas_response"},"summary":{"total_matching":1,"assessment_counts":{"missed":1},"area_counts":{"Northwest Block 12":1}},"assessment_counts":{"missed":1},"coverage":{"matching":1,"evaluated":1,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Ranked lexical retrieval cannot prove a fleet total or source absence","Report prose may predate corrections; a lexical hit does not confirm effective spill detection or current classification"],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":4597,"output_tokens":233,"total_tokens":4830,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":794,"live":true},{"stage":"maker","usage":{"input_tokens":3233,"output_tokens":535,"total_tokens":3768,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":798,"live":true}],"provider":"google","foreground_attempts":2,"live":true},
  "evidence": {"ev_630cef1e4aa799df8e2fccad":{"id":"ev_630cef1e4aa799df8e2fccad","source_id":"src_1dde2aac8f318474821aa0ca","source_kind":"metadata","title":"WELL-0332","path":"assets/WELL-0332/metadata.json"},"ev_7fe351e3d9212748884010cb":{"id":"ev_7fe351e3d9212748884010cb","source_id":"src_e0e3eaab7de9d4dd04af1edb","source_kind":"context","title":"CTX-0332-004","path":"assets/WELL-0332/context.jsonl"},"src_148067724bdb724664aecc6e":{"id":"src_148067724bdb724664aecc6e","source_id":"src_148067724bdb724664aecc6e","source_kind":"sop","title":"fleet/sops/operations-sop-rev2.md","path":"fleet/sops/operations-sop-rev2.md"},"result_02b4ed976c1b43a19cef29b1b5aecb8c":{"id":"result_02b4ed976c1b43a19cef29b1b5aecb8c","source_id":"result_02b4ed976c1b43a19cef29b1b5aecb8c","source_kind":"aggregate_lineage","title":"result_02b4ed976c1b43a19cef29b1b5aecb8c"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"chunk_1960500011899dcc000af9d2":{"id":"chunk_1960500011899dcc000af9d2","source_id":"src_f6ccb487005134e6ef83ea02","source_kind":"report","title":"Maintenance Report — MNT-0332-033","path":"assets/WELL-0332/maintenance-reports/MNT-0332-033.md"},"chunk_92a71979342305129c768c76":{"id":"chunk_92a71979342305129c768c76","source_id":"src_262c00fab15c37897f086681","source_kind":"report","title":"Maintenance Report — MNT-0332-003","path":"assets/WELL-0332/maintenance-reports/MNT-0332-003.md"},"chunk_963d6444b3bf73cc165b3f68":{"id":"chunk_963d6444b3bf73cc165b3f68","source_id":"src_afbb4ec8bec79e71b1fe29d7","source_kind":"report","title":"Maintenance Report — MNT-0332-025","path":"assets/WELL-0332/maintenance-reports/MNT-0332-025.md"},"chunk_2c8575b809f89958dd7822e7":{"id":"chunk_2c8575b809f89958dd7822e7","source_id":"src_18196e251d897712c578ef6a","source_kind":"report","title":"Maintenance Report — MNT-0332-024","path":"assets/WELL-0332/maintenance-reports/MNT-0332-024.md"}}
}
```

Robert Hayes · Turn 5 · complete

Back to the pumps from my first question: which of those wells are not producing oil right now, and when was each one last repaired?

```json
{
  "schema_version": "1.0",
  "answer_id": "60f83514-bb51-491b-9c6b-1fa1b76ffe9a",
  "thread_id": "3e4ffac7-1777-4011-b479-a004261ff08d",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Among the wells from the previous question, WELL-0263 is currently not producing oil [result_7378c64a706f4680a68941ff0070f518]. It was last repaired on 2027-01-09T08:00:00Z under repair ID MNT-0263-035 [result_7378c64a706f4680a68941ff0070f518]. Meanwhile, WELL-0428 and WELL-0305 remain in production

[result_7378c64a706f4680a68941ff0070f518].",
  "blocks": [{"id":"60f83514-bb51-491b-9c6b-1fa1b76ffe9a:block:0","type":"table","title":"Well Production and Last Repair Status","result_set_id":"result_7378c64a706f4680a68941ff0070f518","evidence_ids":["ev_038c94ae2102a687f08dd299","ev_aecf97d98f933acd7a482eef","ev_a4f4cbab2ed8a1770afbcf5b"],"encoding":{},"span":2}],
  "results": {"result_7378c64a706f4680a68941ff0070f518":{"result_set_id":"result_7378c64a706f4680a68941ff0070f518","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"latest_note_at","label":"Latest Note At"},{"key":"latest_note_quote","label":"Latest Note Quote"},{"key":"other_warning_signs","label":"Other Warning Signs"},{"key":"recent_readings","label":"Recent Readings"},{"key":"thermal_warning","label":"Thermal Warning"},{"key":"operator_notes","label":"Operator Notes"},{"key":"warning_note_count","label":"Warning Note Count"},{"key":"last_repair_id","label":"Last Repair Id"},{"key":"last_repair_at","label":"Last Repair At"},{"key":"producing","label":"Producing"},{"key":"assessment","label":"Assessment"},{"key":"priority_score","label":"Priority Score"},{"key":"ranking_basis","label":"Ranking Basis"},{"key":"rank","label":"Rank"}],"rows":[{"area_name":"Southwest Block 23","asset_id":"WELL-0263","priority_score":4,"latest_note_at":"2027-01-14T10:45:00Z","ranking_basis":"Unrepaired symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta warning in the note window; heuristic, not a calibrated 90-day forecast","warning_note_count":2,"thermal_warning":null,"latest_note_quote":"Rod squeal at WELL-0263 stuffing box, greased the polished rod.","recent_readings":"[{\"inspection_id\": \"INS-0263-0216\", \"inspected_at\": \"2026-12-24T11:15:00Z\", \"well_type\": \"T350\", \"delta_c\": 36.5, \"delta_milli\": 36500, \"producing\": true}, {\"inspection_id\": \"INS-0263-0217\", \"inspected_at\": \"2026-12-31T13:00:00Z\", \"well_type\": \"T350\", \"delta_c\": 34.5, \"delta_milli\": 34500, \"producing\": true}, {\"inspection_id\": \"INS-0263-0218\", \"inspected_at\": \"2027-01-07T12:45:00Z\", \"well_type\": \"T350\", \"delta_c\": 8.2, \"delta_milli\": 8200, \"producing\": false}, {\"inspection_id\": \"INS-0263-0219\", \"inspected_at\": \"2027-01-14T10:45:00Z\", \"well_type\": \"T350\", \"delta_c\": 4.0, \"delta_milli\": 4000, \"producing\": false}]","producing":false,"last_repair_at":"2027-01-09T08:00:00Z","last_repair_id":"MNT-0263-035","assessment":"candidate","operator_notes":"[{\"note_id\": \"CTX-0263-004\", \"date\": \"2027-01-11T07:20:00Z\", \"quote\": \"Heard fluid pound on WELL-0263, unit still running.\"}, {\"note_id\": \"CTX-0263-005\", \"date\": \"2027-01-14T10:45:00Z\", \"quote\": \"Rod squeal at WELL-0263 stuffing box, greased the polished rod.\"}]","rank":1,"other_warning_signs":"Currently not producing","area_id":"SW-23"},{"area_name":"Northwest Block 12","asset_id":"WELL-0428","priority_score":2,"latest_note_at":"2027-01-06T11:10:00Z","ranking_basis":"Unrepaired symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta warning in the note window; heuristic, not a calibrated 90-day forecast","warning_note_count":2,"thermal_warning":null,"latest_note_quote":"Heard fluid pound on WELL-0428, unit still running.","recent_readings":"[{\"inspection_id\": \"INS-0428-0215\", \"inspected_at\": \"2026-12-24T10:00:00Z\", \"well_type\": \"T200\", \"delta_c\": 31.8, \"delta_milli\": 31800, \"producing\": true}, {\"inspection_id\": \"INS-0428-0216\", \"inspected_at\": \"2026-12-31T13:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 30.5, \"delta_milli\": 30500, \"producing\": true}, {\"inspection_id\": \"INS-0428-0217\", \"inspected_at\": \"2027-01-07T13:45:00Z\", \"well_type\": \"T200\", \"delta_c\": 32.2, \"delta_milli\": 32200, \"producing\": true}, {\"inspection_id\": \"INS-0428-0218\", \"inspected_at\": \"2027-01-14T15:15:00Z\", \"well_type\": \"T200\", \"delta_c\": 24.3, \"delta_milli\": 24300, \"producing\": true}]","producing":true,"last_repair_at":"2026-03-07T08:00:00Z","last_repair_id":"MNT-0428-022","assessment":"candidate","operator_notes":"[{\"note_id\": \"CTX-0428-002\", \"date\": \"2027-01-01T16:55:00Z\", \"quote\": \"Heard fluid pound on WELL-0428, unit still running.\"}, {\"note_id\": \"CTX-0428-003\", \"date\": \"2027-01-06T11:10:00Z\", \"quote\": \"Heard fluid pound on WELL-0428, unit still running.\"}]","rank":2,"other_warning_signs":"No additional deterministic warning established","area_id":"NW-12"},{"area_name":"Northwest Block 12","asset_id":"WELL-0305","priority_score":1,"latest_note_at":"2027-01-11T15:20:00Z","ranking_basis":"Unrepaired symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta warning in the note window; heuristic, not a calibrated 90-day forecast","warning_note_count":1,"thermal_warning":null,"latest_note_quote":"Pumper reports rattling at WELL-0305 pump jack, keep an eye on it.","recent_readings":"[{\"inspection_id\": \"INS-0305-0213\", \"inspected_at\": \"2026-12-17T07:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 32.4, \"delta_milli\": 32400, \"producing\": true}, {\"inspection_id\": \"INS-0305-0214\", \"inspected_at\": \"2026-12-24T07:45:00Z\", \"well_type\": \"T200\", \"delta_c\": 24.4, \"delta_milli\": 24400, \"producing\": true}, {\"inspection_id\": \"INS-0305-0215\", \"inspected_at\": \"2026-12-31T08:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 25.8, \"delta_milli\": 25800, \"producing\": true}, {\"inspection_id\": \"INS-0305-0216\", \"inspected_at\": \"2027-01-14T09:45:00Z\", \"well_type\": \"T200\", \"delta_c\": 26.7, \"delta_milli\": 26700, \"producing\": true}]","producing":true,"last_repair_at":"2026-10-16T08:00:00Z","last_repair_id":"MNT-0305-032","assessment":"candidate","operator_notes":"[{\"note_id\": \"CTX-0305-004\", \"date\": \"2027-01-11T15:20:00Z\", \"quote\": \"Pumper reports rattling at WELL-0305 pump jack, keep an eye on it.\"}]","rank":3,"other_warning_signs":"No additional deterministic warning established","area_id":"NW-12"}],"evidence_ids":["ev_038c94ae2102a687f08dd299","ev_9e6d0aae585dddeb66499ce0","ev_b81e2161baeb581a10f44d03","ev_36f2b2dc10b914ab17e6f607","ev_b883809bc32b7bf9199bab55","ev_42ce85f613d83110733422fd","ev_edfc23f92558a2ee31e5ae6e","ev_206d45edd557b98a1a58e3b7","result_7378c64a706f4680a68941ff0070f518","ev_aecf97d98f933acd7a482eef","ev_c9b8d1ebd59b5d3a69529e84","ev_cb3aed5c2ece074989dbcc6e","ev_0d5517c9853842c8024013e4","ev_0a1b8121548a64d88c0ea2b2","ev_6a859e63d109c3d0f0e03741","ev_799ceffd75291e63b7dc0b05","ev_08270ebc000df4f1f5db64f1","ev_a4f4cbab2ed8a1770afbcf5b","ev_01bee50ad442b51e6cf7ce16","ev_18b1580940f38e53e7490b80","ev_67e77baa0500a5c92027e0fd","ev_c19075f5e8c39360ddd0bbfc","ev_23995bcdffc8d7c1fcfbca3a","ev_7cabe3fb75e0c725bfc05296"],"provider_coverage":{"unit":"repair_candidates","matching":3,"evaluated":3,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":3,"output_rows":3,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_97164486b6254838adf0eeb93b36f5ad","warnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Candidate ranking is an explicit heuristic, not a predicted probability. Absence of a later recorded corrective repair does not prove no field action occurred; targeted manual warning checks are not exhaustively implemented."],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection":"assets","metric":"repair_candidates"},"summary":{"total_matching":3,"assessment_counts":{"candidate":3},"area_counts":{"Southwest Block 23":1,"Northwest Block 12":2}},"assessment_counts":{"candidate":3},"coverage":{"matching":3,"evaluated":3,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no time of day.","Candidate ranking is an explicit heuristic, not a predicted probability. Absence of a later recorded corrective repair does not prove no field action occurred; targeted manual warning checks are not exhaustively implemented."],
  "generation": {"status":"complete","model":"gemini-3.5-flash-lite","calls":[{"stage":"planner","usage":{"input_tokens":5790,"output_tokens":285,"total_tokens":6075,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":804,"live":true},{"stage":"maker","usage":{"input_tokens":5867,"output_tokens":998,"total_tokens":6865,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":808,"live":true}],"provider":"google","foreground_attempts":2,"live":true},
  "evidence": {"ev_038c94ae2102a687f08dd299":{"id":"ev_038c94ae2102a687f08dd299","source_id":"src_1c75a10d9e027c44ad0c

fe8c","source_kind":"metadata","title":"WELL-0263","path":"assets/WELL-0263/metadata.json"},"ev_9e6d0aae585dddeb66499ce0":{"id":"ev_9e6d0aae585dddeb66499ce0","source_id":"src_600ec0476f3bd90a4d20f3e7","source_kind":"context","title":"CTX-0263-004","path":"assets/WELL-0263/context.jsonl"},"ev_b81e2161baeb581a10f44d03":{"id":"ev_b81e2161baeb581a10f44d03","source_id":"src_600ec0476f3bd90a4d20f3e7","source_kind":"context","title":"CTX-0263-005","path":"assets/WELL-0263/context.jsonl"},"ev_36f2b2dc10b914ab17e6f607":{"id":"ev_36f2b2dc10b914ab17e6f607","source_id":"src_eb2bcbf0705db2f921b7a262","source_kind":"maintenance","title":"MNT-0263-035","path":"assets/WELL-0263/maintenance.jsonl"},"ev_b883809bc32b7bf9199bab55":{"id":"ev_b883809bc32b7bf9199bab55","source_id":"src_4905a07485ed996443163eac","source_kind":"inspections","title":"INS-0263-0216","path":"assets/WELL-0263/inspections.jsonl"},"ev_42ce85f613d83110733422fd":{"id":"ev_42ce85f613d83110733422fd","source_id":"src_4905a07485ed996443163eac","source_kind":"inspections","title":"INS-0263-0217","path":"assets/WELL-0263/inspections.jsonl"},"ev_edfc23f92558a2ee31e5ae6e":{"id":"ev_edfc23f92558a2ee31e5ae6e","source_id":"src_4905a07485ed996443163eac","source_kind":"inspections","title":"INS-0263-0218","path":"assets/WELL-0263/inspections.jsonl"},"ev_206d45edd557b98a1a58e3b7":{"id":"ev_206d45edd557b98a1a58e3b7","source_id":"src_4905a07485ed996443163eac","source_kind":"inspections","title":"INS-0263-0219","path":"assets/WELL-0263/inspections.jsonl"},"result_7378c64a706f4680a68941ff0070f518":{"id":"result_7378c64a706f4680a68941ff0070f518","source_id":"result_7378c64a706f4680a68941ff0070f518","source_kind":"aggregate_lineage","title":"result_7378c64a706f4680a68941ff0070f518"},"ev_aecf97d98f933acd7a482eef":{"id":"ev_aecf97d98f933acd7a482eef","source_id":"src_0a4c0beadb992dd4a0ff3647","source_kind":"metadata","title":"WELL-0428","path":"assets/WELL-0428/metadata.json"},"ev_c9b8d1ebd59b5d3a69529e84":{"id":"ev_c9b8d1ebd59b5d3a69529e84","source_id":"src_2ce67ed44a5d5993f93a9f3c","source_kind":"context","title":"CTX-0428-002","path":"assets/WELL-0428/context.jsonl"},"ev_cb3aed5c2ece074989dbcc6e":{"id":"ev_cb3aed5c2ece074989dbcc6e","source_id":"src_2ce67ed44a5d5993f93a9f3c","source_kind":"context","title":"CTX-0428-003","path":"assets/WELL-0428/context.jsonl"},"ev_0d5517c9853842c8024013e4":{"id":"ev_0d5517c9853842c8024013e4","source_id":"src_fc86426bce84bc0b1d3106f7","source_kind":"maintenance","title":"MNT-0428-022","path":"assets/WELL-0428/maintenance.jsonl"},"ev_0a1b8121548a64d88c0ea2b2":{"id":"ev_0a1b8121548a64d88c0ea2b2","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","title":"INS-0428-0215","path":"assets/WELL-0428/inspections.jsonl"},"ev_6a859e63d109c3d0f0e03741":{"id":"ev_6a859e63d109c3d0f0e03741","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","title":"INS-0428-0216","path":"assets/WELL-0428/inspections.jsonl"},"ev_799ceffd75291e63b7dc0b05":{"id":"ev_799ceffd75291e63b7dc0b05","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","title":"INS-0428-0217","path":"assets/WELL-0428/inspections.jsonl"},"ev_08270ebc000df4f1f5db64f1":{"id":"ev_08270ebc000df4f1f5db64f1","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","title":"INS-0428-0218","path":"assets/WELL-0428/inspections.jsonl"},"ev_a4f4cbab2ed8a1770afbcf5b":{"id":"ev_a4f4cbab2ed8a1770afbcf5b","source_id":"src_827164e72660ecb0547d8285","source_kind":"metadata","title":"WELL-0305","path":"assets/WELL-0305/metadata.json"},"ev_01bee50ad442b51e6cf7ce16":{"id":"ev_01bee50ad442b51e6cf7ce16","source_id":"src_f5a9fd97d067c429605d6b49","source_kind":"context","title":"CTX-0305-004","path":"assets/WELL-0305/context.jsonl"},"ev_18b1580940f38e53e7490b80":{"id":"ev_18b1580940f38e53e7490b80","source_id":"src_7df4d484c15db67e4cf5e8e4","source_kind":"maintenance","title":"MNT-0305-032","path":"assets/WELL-0305/maintenance.jsonl"},"ev_67e77baa0500a5c92027e0fd":{"id":"ev_67e77baa0500a5c92027e0fd","source_id":"src_f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0213","path":"assets/WELL-0305/inspections.jsonl"},"ev_c19075f5e8c39360ddd0bbfc":{"id":"ev_c19075f5e8c39360ddd0bbfc","source_id":"src_f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0214","path":"assets/WELL-0305/inspections.jsonl"},"ev_23995bcdffc8d7c1fcfbca3a":{"id":"ev_23995bcdffc8d7c1fcfbca3a","source_id":"src_f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0215","path":"assets/WELL-0305/inspections.jsonl"},"ev_7cabe3fb75e0c725bfc05296":{"id":"ev_7cabe3fb75e0c725bfc05296","source_id":"src_f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0216","path":"assets/WELL-0305/inspections.jsonl"},"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3":{"id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_kind":"shared_knowledge","title":"Observation reported by Olivia Grant"}}
}
```

Robert Hayes · Turn 6 · partial

Of all the wells we've talked about today, which one would you deal with first, and why?

```json
{
  "schema_version": "1.0",
  "answer_id": "c11bbe93-4548-42f8-8f8b-45feb7be5fdd",
  "thread_id": "3e4ffac7-1777-4011-b479-a004261ff08d",
  "user_id": "U-301",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Partial answer: verified data is shown below. The explanation could not be completed because the generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"c11bbe93-4548-42f8-8f8b-45feb7be5fdd:verified:0","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_50249fe45b2a4079805f37620e9d85ad","evidence_ids":["ev_038c94ae2102a687f08dd299","ev_9e6d0aae585dddeb66499ce0","ev_b81e2161baeb581a10f44d03","ev_36f2b2dc10b914ab17e6f607","ev_b883809bc32b7bf9199bab55","ev_42ce85f613d83110733422fd","ev_edfc23f92558a2ee31e5ae6e","ev_206d45edd557b98a1a58e3b7"],"encoding":{},"span":2}],
  "results": {"result_50249fe45b2a4079805f37620e9d85ad":{"result_set_id":"result_50249fe45b2a4079805f37620e9d85ad","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":6,"columns":[{"key":"asset_id","label":"Asset Id"},{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"latest_note_at","label":"Latest Note At"},{"key":"latest_note_quote","label":"Latest Note Quote"},{"key":"other_warning_signs","label":"Other Warning Signs"},{"key":"recent_readings","label":"Recent Readings"},{"key":"thermal_warning","label":"Thermal Warning"},{"key":"operator_notes","label":"Operator Notes"},{"key":"warning_note_count","label":"Warning Note Count"},{"key":"last_repair_id","label":"Last Repair Id"},{"key":"last_repair_at","label":"Last Repair At"},{"key":"producing","label":"Producing"},{"key":"assessment","label":"Assessment"},{"key":"priority_score","label":"Priority Score"},{"key":"ranking_basis","label":"Ranking Basis"},{"key":"rank","label":"Rank"}],"rows":[{"area_name":"Southwest Block 23","asset_id":"WELL-0263","priority_score":4,"latest_note_at":"2027-01-14T10:45:00Z","ranking_basis":"Unrepaired symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta warning in the note window; heuristic, not a calibrated 90-day forecast","warning_note_count":2,"thermal_warning":null,"latest_note_quote":"Rod squeal at WELL-0263 stuffing box, greased the polished rod.","recent_readings":"[{\"inspection_id\": \"INS-0263-0216\", \"inspected_at\": \"2026-12-24T11:15:00Z\", \"well_type\": \"T350\", \"delta_c\": 36.5, \"delta_milli\": 36500, \"producing\": true}, {\"inspection_id\": \"INS-0263-0217\", \"inspected_at\": \"2026-12-31T13:00:00Z\", \"well_type\": \"T350\", \"delta_c\": 34.5, \"delta_milli\": 34500, \"producing\": true}, {\"inspection_id\": \"INS-0263-0218\", \"inspected_at\": \"2027-01-07T12:45:00Z\", \"well_type\": \"T350\", \"delta_c\": 8.2, \"delta_milli\": 8200, \"producing\": false}, {\"inspection_id\": \"INS-0263-0219\", \"inspected_at\": \"2027-01-14T10:45:00Z\", \"well_type\": \"T350\", \"delta_c\": 4.0, \"delta_milli\": 4000, \"producing\": false}]","producing":false,"last_repa

ir_at":"2027-01-09T08:00:00Z","last_repair_id":"MNT-0263-035","assessment":"candidate","operator_notes":"[{\"note_id\"
: \"CTX-0263-004\", \"date\": \"2027-01-11T07:20:00Z\", \"quote\": \"Heard fluid pound on WELL-0263, unit still
running.\"}, {\"note_id\": \"CTX-0263-005\", \"date\": \"2027-01-14T10:45:00Z\", \"quote\": \"Rod squeal at WELL-0263
stuffing box, greased the polished rod.\"}]","rank":1,"other_warning_signs":"Currently not
producing","area_id":"SW-23"},{"area_name":"Northwest Block
12","asset_id":"WELL-0428","priority_score":2,"latest_note_at":"2027-01-06T11:10:00Z","ranking_basis":"Unrepaired
symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta
warning in the note window; heuristic, not a calibrated 90-day
forecast","warning_note_count":2,"thermal_warning":null,"latest_note_quote":"Heard fluid pound on WELL-0428, unit
still running.","recent_readings":"[{\"inspection_id\": \"INS-0428-0215\", \"inspected_at\": \"2026-12-24T10:00:00Z\",
\"well_type\": \"T200\", \"delta_c\": 31.8, \"delta_milli\": 31800, \"producing\": true}, {\"inspection_id\":
\"INS-0428-0216\", \"inspected_at\": \"2026-12-31T13:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 30.5,
\"delta_milli\": 30500, \"producing\": true}, {\"inspection_id\": \"INS-0428-0217\", \"inspected_at\":
\"2027-01-07T13:45:00Z\", \"well_type\": \"T200\", \"delta_c\": 32.2, \"delta_milli\": 32200, \"producing\": true},
{\"inspection_id\": \"INS-0428-0218\", \"inspected_at\": \"2027-01-14T15:15:00Z\", \"well_type\": \"T200\",
\"delta_c\": 24.3, \"delta_milli\": 24300, \"producing\": true}]","producing":true,"last_repair_at":"2026-03-07T08:00:
00Z","last_repair_id":"MNT-0428-022","assessment":"candidate","operator_notes":"[{\"note_id\": \"CTX-0428-002\",
\"date\": \"2027-01-01T16:55:00Z\", \"quote\": \"Heard fluid pound on WELL-0428, unit still running.\"}, {\"note_id\":
\"CTX-0428-003\", \"date\": \"2027-01-06T11:10:00Z\", \"quote\": \"Heard fluid pound on WELL-0428, unit still
running.\"}]","rank":2,"other_warning_signs":"No additional deterministic warning
established","area_id":"NW-12"},{"area_name":"Northwest Block
12","asset_id":"WELL-0305","priority_score":1,"latest_note_at":"2027-01-11T15:20:00Z","ranking_basis":"Unrepaired
symptom-note count +2 if currently not producing +3 for an unreconciled supplied ESP four-reading declining-delta
warning in the note window; heuristic, not a calibrated 90-day
forecast","warning_note_count":1,"thermal_warning":null,"latest_note_quote":"Pumper reports rattling at WELL-0305 pump
jack, keep an eye on it.","recent_readings":"[{\"inspection_id\": \"INS-0305-0213\", \"inspected_at\":
\"2026-12-17T07:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 32.4, \"delta_milli\": 32400, \"producing\": true},
{\"inspection_id\": \"INS-0305-0214\", \"inspected_at\": \"2026-12-24T07:45:00Z\", \"well_type\": \"T200\",
\"delta_c\": 24.4, \"delta_milli\": 24400, \"producing\": true}, {\"inspection_id\": \"INS-0305-0215\",
\"inspected_at\": \"2026-12-31T08:30:00Z\", \"well_type\": \"T200\", \"delta_c\": 25.8, \"delta_milli\": 25800,
\"producing\": true}, {\"inspection_id\": \"INS-0305-0216\", \"inspected_at\": \"2027-01-14T09:45:00Z\",
\"well_type\": \"T200\", \"delta_c\": 26.7, \"delta_milli\": 26700, \"producing\": true}]","producing":true,"last_repa
ir_at":"2026-10-16T08:00:00Z","last_repair_id":"MNT-0305-032","assessment":"candidate","operator_notes":"[{\"note_id\"
: \"CTX-0305-004\", \"date\": \"2027-01-11T15:20:00Z\", \"quote\": \"Pumper reports rattling at WELL-0305 pump jack,
keep an eye on it.\"}]","rank":3,"other_warning_signs":"No additional deterministic warning established","area_id":"NW
-12"}],"evidence_ids":["ev_038c94ae2102a687f08dd299","ev_9e6d0aae585dddeb66499ce0","ev_b81e2161baeb581a10f44d03","ev_3
6f2b2dc10b914ab17e6f607","ev_b883809bc32b7bf9199bab55","ev_42ce85f613d83110733422fd","ev_edfc23f92558a2ee31e5ae6e","ev
_206d45edd557b98a1a58e3b7","result_50249fe45b2a4079805f37620e9d85ad","ev_aecf97d98f933acd7a482eef","ev_c9b8d1ebd59b5d3
a69529e84","ev_cb3aed5c2ece074989dbcc6e","ev_0d5517c9853842c8024013e4","ev_0a1b8121548a64d88c0ea2b2","ev_6a859e63d109c
3d0f0e03741","ev_799ceffd75291e63b7dc0b05","ev_08270ebc000df4f1f5db64f1","ev_a4f4cbab2ed8a1770afbcf5b","ev_01bee50ad44
2b51e6cf7ce16","ev_18b1580940f38e53e7490b80","ev_67e77baa0500a5c92027e0fd","ev_c19075f5e8c39360ddd0bbfc","ev_23995bcdf
fc8d7c1fcfbca3a","ev_7cabe3fb75e0c725bfc05296"],"provider_coverage":{"unit":"repair_candidates","matching":3,"evaluate
d":3,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":3,"output_rows":3,"display_truncated":false,"a
ggregation_input_truncated":false},"trace_id":"trace_f2ebaf7c9e9f42648c67ed2bd85729a2","warnings":["Missing records do
not independently prove real-world inaction; calendar reference date supplies no time of day.","Candidate ranking is
an explicit heuristic, not a predicted probability. Absence of a later recorded corrective repair does not prove no
field action occurred; targeted manual warning checks are not exhaustively implemented."],"bounds":{"start":null,"end"
:null,"closure":"both"},"operation":{"collection":"maintenance","metric":"repair_candidates"},"summary":{"total_matchi
ng":3,"assessment_counts":{"candidate":3},"area_counts":{"Southwest Block 23":1,"Northwest Block
12":2}},"assessment_counts":{"candidate":3},"coverage":{"matching":3,"evaluated":3,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no
time of day.","Candidate ranking is an explicit heuristic, not a predicted probability. Absence of a later recorded
corrective repair does not prove no field action occurred; targeted manual warning checks are not exhaustively
implemented.","The explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanatio
n_error_code":"invalid_evidence_reference","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":5870
,"output_tokens":366,"total_tokens":6236,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","fi
nish_reason":"STOP"},"call_id":814,"live":true},{"stage":"maker","usage":{"input_tokens":5942,"output_tokens":1733,"to
tal_tokens":7675,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"ca
ll_id":818,"live":true},{"stage":"grounding_repair","usage":{"input_tokens":5098,"output_tokens":261,"total_tokens":53
59,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_id":821,"li
ve":true}]},
  "evidence": {"ev_038c94ae2102a687f08dd299":{"id":"ev_038c94ae2102a687f08dd299","source_id":"src_1c75a10d9e027c44ad0c
fe8c","source_kind":"metadata","title":"WELL-0263","path":"assets/WELL-0263/metadata.json"},"ev_9e6d0aae585dddeb66499c
e0":{"id":"ev_9e6d0aae585dddeb66499ce0","source_id":"src_600ec0476f3bd90a4d20f3e7","source_kind":"context","title":"CT
X-0263-004","path":"assets/WELL-0263/context.jsonl"},"ev_b81e2161baeb581a10f44d03":{"id":"ev_b81e2161baeb581a10f44d03"
,"source_id":"src_600ec0476f3bd90a4d20f3e7","source_kind":"context","title":"CTX-0263-005","path":"assets/WELL-0263/co
ntext.jsonl"},"ev_36f2b2dc10b914ab17e6f607":{"id":"ev_36f2b2dc10b914ab17e6f607","source_id":"src_eb2bcbf0705db2f921b7a
262","source_kind":"maintenance","title":"MNT-0263-035","path":"assets/WELL-0263/maintenance.jsonl"},"ev_b883809bc32b7
bf9199bab55":{"id":"ev_b883809bc32b7bf9199bab55","source_id":"src_4905a07485ed996443163eac","source_kind":"inspections
","title":"INS-0263-0216","path":"assets/WELL-0263/inspections.jsonl"},"ev_42ce85f613d83110733422fd":{"id":"ev_42ce85f
613d83110733422fd","source_id":"src_4905a07485ed996443163eac","source_kind":"inspections","title":"INS-0263-0217","pat
h":"assets/WELL-0263/inspections.jsonl"},"ev_edfc23f92558a2ee31e5ae6e":{"id":"ev_edfc23f92558a2ee31e5ae6e","source_id"
:"src_4905a07485ed996443163eac","source_kind":"inspections","title":"INS-0263-0218","path":"assets/WELL-0263/inspectio
ns.jsonl"},"ev_206d45edd557b98a1a58e3b7":{"id":"ev_206d45edd557b98a1a58e3b7","source_id":"src_4905a07485ed996443163eac
","source_kind":"inspections","title":"INS-0263-0219","path":"assets/WELL-0263/inspections.jsonl"},"result_50249fe45b2
a4079805f37620e9d85ad":{"id":"result_50249fe45b2a4079805f37620e9d85ad","source_id":"result_50249fe45b2a4079805f37620e9
d85ad","source_kind":"aggregate_lineage","title":"result_50249fe45b2a4079805f37620e9d85ad"},"ev_aecf97d98f933acd7a482e
ef":{"id":"ev_aecf97d98f933acd7a482eef","source_id":"src_0a4c0beadb992dd4a0ff3647","source_kind":"metadata","title":"W
ELL-0428","path":"assets/WELL-0428/metadata.json"},"ev_c9b8d1ebd59b5d3a69529e84":{"id":"ev_c9b8d1ebd59b5d3a69529e84","
source_id":"src_2ce67ed44a5d5993f93a9f3c","source_kind":"context","title":"CTX-0428-002","path":"assets/WELL-0428/cont
ext.jsonl"},"ev_cb3aed5c2ece074989dbcc6e":{"id":"ev_cb3aed5c2ece074989dbcc6e","source_id":"src_2ce67ed44a5d5993f93a9f3
c","source_kind":"context","title":"CTX-0428-003","path":"assets/WELL-0428/context.jsonl"},"ev_0d5517c9853842c8024013e
4":{"id":"ev_0d5517c9853842c8024013e4","source_id":"src_fc86426bce84bc0b1d3106f7","source_kind":"maintenance","title":
"MNT-0428-022","path":"assets/WELL-0428/maintenance.jsonl"},"ev_0a1b8121548a64d88c0ea2b2":{"id":"ev_0a1b8121548a64d88c

```
0ea2b2","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","title":"INS-0428-0215","path":"assets/
WELL-0428/inspections.jsonl"},"ev_6a859e63d109c3d0f0e03741":{"id":"ev_6a859e63d109c3d0f0e03741","source_id":"src_30292
896a9c5fb7a37cf99c8","source_kind":"inspections","title":"INS-0428-0216","path":"assets/WELL-0428/inspections.jsonl"},
"ev_799ceffd75291e63b7dc0b05":{"id":"ev_799ceffd75291e63b7dc0b05","source_id":"src_30292896a9c5fb7a37cf99c8","source_k
ind":"inspections","title":"INS-0428-0217","path":"assets/WELL-0428/inspections.jsonl"},"ev_08270ebc000df4f1f5db64f1":
{"id":"ev_08270ebc000df4f1f5db64f1","source_id":"src_30292896a9c5fb7a37cf99c8","source_kind":"inspections","title":"IN
S-0428-0218","path":"assets/WELL-0428/inspections.jsonl"},"ev_a4f4cbab2ed8a1770afbcf5b":{"id":"ev_a4f4cbab2ed8a1770afb
cf5b","source_id":"src_827164e72660ecb0547d8285","source_kind":"metadata","title":"WELL-0305","path":"assets/WELL-0305
/metadata.json"},"ev_01bee50ad442b51e6cf7ce16":{"id":"ev_01bee50ad442b51e6cf7ce16","source_id":"src_f5a9fd97d067c42960
5d6b49","source_kind":"context","title":"CTX-0305-004","path":"assets/WELL-0305/context.jsonl"},"ev_18b1580940f38e53e7
490b80":{"id":"ev_18b1580940f38e53e7490b80","source_id":"src_7df4d484c15db67e4cf5e8e4","source_kind":"maintenance","ti
tle":"MNT-0305-032","path":"assets/WELL-0305/maintenance.jsonl"},"ev_67e77baa0500a5c92027e0fd":{"id":"ev_67e77baa0500a
5c92027e0fd","source_id":"src_f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0213","path":"as
sets/WELL-0305/inspections.jsonl"},"ev_c19075f5e8c39360ddd0bbfc":{"id":"ev_c19075f5e8c39360ddd0bbfc","source_id":"src_
f309ea7447e5255e291364b7","source_kind":"inspections","title":"INS-0305-0214","path":"assets/WELL-0305/inspections.jso
nl"},"ev_23995bcdffc8d7c1fcfbca3a":{"id":"ev_23995bcdffc8d7c1fcfbca3a","source_id":"src_f309ea7447e5255e291364b7","sou
rce_kind":"inspections","title":"INS-0305-0215","path":"assets/WELL-0305/inspections.jsonl"},"ev_7cabe3fb75e0c725bfc05
296":{"id":"ev_7cabe3fb75e0c725bfc05296","source_id":"src_f309ea7447e5255e291364b7","source_kind":"inspections","title
":"INS-0305-0216","path":"assets/WELL-0305/inspections.jsonl"},"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3":{"id":"me
mory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_id":"memory:cd9ad363-6ee1-4e24-ab7c-a9d6012222b3","source_kind":"sh
ared_knowledge","title":"Observation reported by Olivia Grant"},"memory:ea233e6c-8168-431d-99f3-840cdbc32f54":{"id":"m
emory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_id":"memory:ea233e6c-8168-431d-99f3-840cdbc32f54","source_kind":"s
hared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":
"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":
"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id
":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind
":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"i
d":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kin
d":"shared_knowledge","title":"Observation reported by Nathan Pierce"}}
}
```

Question 10

Michael Turner · Turn 1 · partial

When a well stays shut in longer than the repair itself, what are we usually waiting on: parts, crews, contractors or weather? Break it down by area for jobs started in 2026, with the typical number of extra days, and tell me if any area stands out.


```json
{
  "schema_version": "1.0",
  "answer_id": "92d82d1f-2bd0-4fe8-90f7-736d05a0135c",
  "thread_id": "b2787153-3f70-48b6-9303-686e0fae5733",
  "user_id": "U-201",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Partial answer: verified data is shown below. The explanation could not be completed because the generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"92d82d1f-2bd0-4fe8-90f7-736d05a0135c:verified:0","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_0aabf661a35f489d8b49aadebf8af716","evidence_ids":["ev_09e848bea0d54a7f2afad16e","src_47bc08f542f65ec38fd9dba3","ev_9ac4ae88f71cca49bc7a9109","src_b5fe7b35737981beb8f75bd3","ev_24a0eb58ed9d5efc5dff7fba","src_70d65d03d9d68cd5822b93bf","ev_1070a42a48613df0051f5da1","src_903c06238862d881640af906"],"encoding":{},"span":2}],
  "results": {"result_0aabf661a35f489d8b49aadebf8af716":{"result_set_id":"result_0aabf661a35f489d8b49aadebf8af716","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":4,"columns":[{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"reason","label":"Reason"},{"key":"job_count","label":"Job Count"},{"key":"area_jobs_with_wait_evidence","label":"Area Jobs With Wait Evidence"},{"key":"share","label":"Share","unit":"fraction"},{"key":"median_extra_days","label":"Median Extra Days","unit":"day"},{"key":"extra_days_total","label":"Extra Days Total"},{"key":"estimated_job_count","label":"Estimated Job Count"},{"key":"estimated_median_extra_days","label":"Estimated Median Extra Days"},{"key":"conflicting_note_count","label":"Conflicting Note Count"},{"key":"conflicting_notes","label":"Conflicting Notes"},{"key":"assessment","label":"Assessment"}],"rows":[{"area_name":"Northeast Block 7","reason":"contractors","area_jobs_with_wait_evidence":54,"conflicting_notes":"[]","job_count":15,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2777777777777778,"estimated_job_count":0,"extra_days_total":140.0,"median_extra_days":8.0,"conflicting_note_count":0,"area_id":"NE-07"},{"area_name":"Northeast Block 7","reason":"crews","area_jobs_with_wait_evidence":54,"conflicting_notes":"[]","job_count":11,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2037037037037037,"estimated_job_count":0,"extra_days_total":192.0,"median_extra_days":16.0,"conflicting_note_count":0,"area_id":"NE-07"},{"area_name":"Northeast Block 7","reason":"parts","area_jobs_with_wait_evidence":54,"conflicting_notes":"[]","job_count":13,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.24074074074074073,"estimated_job_count":0,"extra_days_total":210.0,"median_extra_days":17.0,"conflicting_note_count":0,"area_id":"NE-07"},{"area_name":"Northeast Block 7","reason":"weather","area_jobs_with_wait_evidence":54,"conflicting_notes":"[]","job_count":15,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2777777777777778,"estimated_job_count":0,"extra_days_total":172.0,"median_extra_days":9.0,"conflicting_note_count":0,"area_id":"NE-07"},{"area_name":"Northeast Block 8","reason":"contractors","area_jobs_with_wait_evidence":66,"conflicting_notes":"[{\"maintenance_id\": \"MNT-0199-025\", \"note_id\": \"CTX-0199-001\", \"note_reason\": \"parts\", \"report_reason\": \"contractors\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}]","job_count":16,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.24242424242424243,"estimated_job_count":0,"extra_days_total":225.0,"median_extra_days":11.5,"conflicting_note_count":1,"area_id":"NE-08"},{"area_name":"Northeast Block 8","reason":"crews","area_jobs_with_wait_evidence":66,"conflicting_notes":"[]","job_count":19,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2878787878787879,"estimated_job_count":0,"extra_days_total":226.0,"median_extra_days":14.0,"conflicting_note_count":0,"area_id":"NE-08"},{"area_name":"Northeast Block 8","reason":"parts","area_jobs_with_wait_evidence":66,"conflicting_notes":"[]","job_count":13,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.19696969696969696,"estimated_job_count":0,"extra_days_total":178.0,"median_extra_days":10.0,"conflicting_note_count":0,"area_id":"NE-08"},{"area_name":"Northeast Block 8","reason":"weather","area_jobs_with_wait_evidence":66,"conflicting_notes":"[]","job_count":18,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2727272727272727,"estimated_job_count":0,"extra_days_total":156.0,"median_extra_days":8.0,"conflicting_note_count":0,"area_id":"NE-08"},{"area_name":"Northwest Block 12","reason":"contractors","area_jobs_with_wait_evidence":119,"conflicting_notes":"[]","job_count":24,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.20168067226890757,"estimated_job_count":0,"extra_days_total":333.0,"median_extra_days":10.5,"conflicting_note_count":0,"area_id":"NW-12"},{"area_name":"Northwest Block 12","reason":"crews","area_jobs_with_wait_evidence":119,"conflicting_notes":"[]","job_count":34,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2857142857142857,"estimated_job_count":0,"extra_days_total":406.0,"median_extra_days":9.5,"conflicting_note_count":0,"area_id":"NW-12"},{"area_name":"Northwest Block 12","reason":"parts","area_jobs_with_wait_evidence":119,"conflicting_notes":"[]","job_count":26,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2184873949579832,"estimated_job_count":0,"extra_days_total":291.0,"median_extra_days":9.0,"conflicting_note_count":0,"area_id":"NW-12"},{"area_name":"Northwest Block 12","reason":"weather","area_jobs_with_wait_evidence":119,"conflicting_notes":"[]","job_count":35,"estimated_median_extra_days":21.0,"assessment":"report_attributed","share":0.29411764705882354,"estimated_job_count":1,"extra_days_total":410.0,"median_extra_days":9.0,"conflicting_note_count":0,"area_id":"NW-12"},{"area_name":"Southeast Block 31","reason":"contractors","area_jobs_with_wait_evidence":26,"conflicting_notes":"[{\"maintenance_id\": \"MNT-0226-025\", \"note_id\": \"CTX-0226-001\", \"note_reason\": \"parts\", \"report_reason\": \"contractors\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}]","job_count":10,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.38461538461538464,"estimated_job_count":0,"extra_days_total":124.0,"median_extra_days":15.5,"conflicting_note_count":1,"area_id":"SE-31"},{"area_name":"Southeast Block 31","reason":"crews","area_jobs_with_wait_evidence":26,"conflicting_notes":"[]","job_count":2,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.07692307692307693,"estimated_job_count":0,"extra_days_total":11.0,"median_extra_days":5.5,"conflicting_note_count":0,"area_id":"SE-31"},{"area_name":"Southeast Block 31","reason":"parts","area_jobs_with_wait_evidence":26,"conflicting_notes":"[]","job_count":6,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.23076923076923078,"estimated_job_count":0,"extra_days_total":52.0,"median_extra_days":8.5,"conflicting_note_count":0,"area_id":"SE-31"},{"area_name":"Southeast Block 31","reason":"weather","area_jobs_with_wait_evidence":26,"conflicting_notes":"[]","job_count":8,"estimated_median_extra_days":null,"assessmen
```

t":"report_attributed","share":0.3076923076923077,"estimated_job_count":0,"extra_days_total":97.0,"median_extra_days":12.5,"conflicting_note_count":0,"area_id":"SE-31"},{"area_name":"Southeast Block 32","reason":"contractors","area_jobs_with_wait_evidence":103,"conflicting_notes":"[{\"maintenance_id\": \"MNT-0520-026\", \"note_id\": \"CTX-0520-001\", \"note_reason\": \"parts\", \"report_reason\": \"contractors\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}, {\"maintenance_id\": \"MNT-0498-024\", \"note_id\": \"CTX-0498-001\", \"note_reason\": \"parts\", \"report_reason\": \"contractors\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}, {\"maintenance_id\": \"MNT-0466-023\", \"note_id\": \"CTX-0466-001\", \"note_reason\": \"parts\", \"report_reason\": \"contractors\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}]","job_count":31,"estimated_median_extra_days":37.0,"assessment":"report_attributed","share":0.30097087378640774,"estimated_job_count":1,"extra_days_total":415.0,"median_extra_days":9.0,"conflicting_note_count":3,"area_id":"SE-32"},{"area_name":"Southeast Block 32","reason":"crews","area_jobs_with_wait_evidence":103,"conflicting_notes":"[{\"maintenance_id\": \"MNT-0510-031\", \"note_id\": \"CTX-0510-002\", \"note_reason\": \"parts\", \"report_reason\": \"crews\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}]","job_count":20,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.1941747572815534,"estimated_job_count":0,"extra_days_total":255.0,"median_extra_days":10.0,"conflicting_note_count":1,"area_id":"SE-32"},{"area_name":"Southeast Block 32","reason":"parts","area_jobs_with_wait_evidence":103,"conflicting_notes":"[]","job_count":25,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.24271844660194175,"estimated_job_count":0,"extra_days_total":300.0,"median_extra_days":10.0,"conflicting_note_count":0,"area_id":"SE-32"},{"area_name":"Southeast Block 32","reason":"weather","area_jobs_with_wait_evidence":103,"conflicting_notes":"[]","job_count":27,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2621359223300971,"estimated_job_count":0,"extra_days_total":420.0,"median_extra_days":9.0,"conflicting_note_count":0,"area_id":"SE-32"},{"area_name":"Southwest Block 23","reason":"contractors","area_jobs_with_wait_evidence":55,"conflicting_notes":"[]","job_count":12,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.21818181818181817,"estimated_job_count":0,"extra_days_total":166.0,"median_extra_days":12.5,"conflicting_note_count":0,"area_id":"SW-23"},{"area_name":"Southwest Block 23","reason":"crews","area_jobs_with_wait_evidence":55,"conflicting_notes":"[{\"maintenance_id\": \"MNT-0045-027\", \"note_id\": \"CTX-0045-002\", \"note_reason\": \"parts\", \"report_reason\": \"crews\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}]","job_count":13,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.23636363636363636,"estimated_job_count":0,"extra_days_total":127.0,"median_extra_days":7.0,"conflicting_note_count":1,"area_id":"SW-23"},{"area_name":"Southwest Block 23","reason":"parts","area_jobs_with_wait_evidence":55,"conflicting_notes":"[]","job_count":16,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2909090909090909,"estimated_job_count":0,"extra_days_total":253.0,"median_extra_days":12.5,"conflicting_note_count":0,"area_id":"SW-23"},{"area_name":"Southwest Block 23","reason":"weather","area_jobs_with_wait_evidence":55,"conflicting_notes":"[{\"maintenance_id\": \"MNT-0279-028\", \"note_id\": \"CTX-0279-002\", \"note_reason\": \"parts\", \"report_reason\": \"weather\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}]","job_count":14,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2545454545454545,"estimated_job_count":0,"extra_days_total":196.0,"median_extra_days":9.0,"conflicting_note_count":1,"area_id":"SW-23"},{"area_name":"Southwest Block 24","reason":"contractors","area_jobs_with_wait_evidence":49,"conflicting_notes":"[]","job_count":14,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.2857142857142857,"estimated_job_count":0,"extra_days_total":121.0,"median_extra_days":8.5,"conflicting_note_count":0,"area_id":"SW-24"},{"area_name":"Southwest Block 24","reason":"crews","area_jobs_with_wait_evidence":49,"conflicting_notes":"[]","job_count":8,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.16326530612244897,"estimated_job_count":0,"extra_days_total":85.0,"median_extra_days":12.0,"conflicting_note_count":0,"area_id":"SW-24"},{"area_name":"Southwest Block 24","reason":"parts","area_jobs_with_wait_evidence":49,"conflicting_notes":"[]","job_count":12,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.24489795918367346,"estimated_job_count":0,"extra_days_total":117.0,"median_extra_days":8.0,"conflicting_note_count":0,"area_id":"SW-24"},{"area_name":"Southwest Block 24","reason":"weather","area_jobs_with_wait_evidence":49,"conflicting_notes":"[{\"maintenance_id\": \"MNT-0078-022\", \"note_id\": \"CTX-0078-002\", \"note_reason\": \"parts\", \"report_reason\": \"weather\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}, {\"maintenance_id\": \"MNT-0072-029\", \"note_id\": \"CTX-0072-001\", \"note_reason\": \"parts\", \"report_reason\": \"weather\", \"quote\": \"Waiting on replacement parts from the vendor; well stays shut in until they arrive.\"}]","job_count":15,"estimated_median_extra_days":null,"assessment":"report_attributed","share":0.30612244897959184,"estimated_job_count":0,"extra_days_total":173.0,"median_extra_days":10.0,"conflicting_note_count":2,"area_id":"SW-24"}],"evidence_ids":["ev_09e848bea0d54a7f2afad16e","src_47bc08f542f65ec38fd9dba3","ev_9ac4ae88f71cca49bc7a9109","src_b5fe7b35737981beb8f75bd3","ev_24a0eb58ed9d5efc5dff7fba","src_70d65d03d9d68cd5822b93bf","ev_1070a42a48613df0051f5da1","src_903c06238862d881640af906","ev_e6c81c728aee94bb60bd22e4","src_6bf5adc4f19673c3ed0b80a9","ev_1c42aaca961db9a00dab93a6","src_dd5ed87a8533cbc636e7768e","ev_fef298e2ec2ba09a6e03cf87","src_6d438dcd4dc2a6d61b37b8b1","ev_cd4feadfc9c70d52e90760d0","src_16b635d0559480b662b0a15d","ev_5787b1f71415831645381469","src_7e569a9b8428eb9f0a98d263","ev_3c9f452b5e033bfd042fe77b","src_c44e1fe8dcbd993742405b38","ev_22ce1d1213b1589c61fe36f6","src_38f4f9ec2abae075ee9fef47","ev_d285e8eb9bac3c4d0adcaeea","src_5dbd3183538cc5bfbc4179a8","ev_faa01d789a496ba31dda91ea","src_ef59c634ba9e8af4a0124bde","ev_55cac16a6b70f8cf4ef5c7c2","src_a1b5396affe3160ce3d4d59b","ev_c263be7c32c0ed79e52141ad","src_5efdb6a9d2077d8bfff9af92","result_0aabf661a35f489d8b49aadebf8af716","ev_5d49e4b0bd365b4a43ab3b4c","src_5e713a8be83b7f6c4eb2e0f0","ev_4a4e3c272861a3e12b016fb8","src_acb59962e346d7140f499c57","ev_246f04d55e9d8d864c37a5de","src_3166a5c8ad974f47d2b89518","ev_f9dbfd86dc84cc15c82de82c","src_f2c4c81f93cbe3f1f03c447f","ev_38cf34fd822a011ee83b51cd","src_e566716b609bc7452f89422b","ev_597f6c7240b563e9f7ea5e08","src_35e9b0868f6b0b12357a7c18","ev_b989fe63d58ee048c5fa8fba","src_de75290fe3defb8b7481cb69","ev_8b12bcd41cd74d457c1fbf0a","src_be7e1f354f071be95bec0d52","ev_d0e8506e4d68236ffc8f0476","src_83f365a56e9c1fbb7a06ed8e","ev_32bd2fe493e981bef85e52aa","src_0a4b718b8b9254d9558828ee","ev_64e9a9f9066b651ba1d929a6","src_1ab2ee721f434e2623614bf4","ev_823b28c50a9e4dce3d93627c","src_d020101b9497ab9058c41e1b","ev_9bac58e3cf404fd34d51330a","src_6b6735870bf3c86edfbc7e8d","ev_5ab5d6d8be2ed2d4390f16ab","src_2b95b270c5f871c1751b8fda","ev_17bf65ede78cfe98248110f1","src_940a918d6c37c5faea466917","ev_4109ca41577a26070553acb0","src_0fecba4e1f4889072c15f432","ev_c1e0d846e48fae323187f6dc","src_22193c4a1ba5d3584470851d","ev_fb4d0809c0e0211d59612e97","src_d9ded8fae7cd45bfdbd5780","ev_bb4fe2a1eac6862791fe85d1","src_7cac915585122f3f9357c84b","ev_87367baf437a305661656b92","src_456ea44cc3a69a17defa7da4","ev_20be90ae4c2704b12a2abf83","src_a2772c87485e1332f87879ef","ev_bc0e3c0907a7f51c1382590f","src_30bb1a9c173d4aabe81a430e","ev_a67e7fbc2515365023957027","src_cefcd50daa4baabb05cd72c8","ev_b36459b71b6100fe2b8d2883","src_2cae69979ad70b4ea2a1a443","ev_5d6524235008577fab9107f9","src_5660588ec921ca95827ed5e5","ev_c364c25f27b15b6f06a8a738","src_bdd3394253c1debd5888ed51","ev_120d954899fb1e06770495ac","src_9a46ecedaef8cf22daa6db7a","ev_3201cda35abf43e8a6392b76","src_b90dfa2cd56f306a2a4d6e79","ev_13f1043e5ffb68a50ef639ed","src_77c466d4538a7ad5c8d91ec8","ev_d46104240d47e91c339889f5","src_87176551f29fa28f4c366407","ev_4781746ae3f349424f6c7483","src_32bcb3f9e21f71d53d0c057b","ev_c230bbef94dbe0f8a65c4419","src_7296601c4ee3dc2ee5059b40","ev_08e9ff0c339de85dfc23e3d3","src_52b1eb84ad41781aaab89455","ev_37bb6892cfd5f7b61304e929","src_9aa3f092818018ca2a62dea9","ev_c92e33eb8668840472cdabef","src_05e2fccb84eea8614919fd46","ev_c3d0cd6fbf7a3b8546fdc24d","src_70bdb2deea2a83dc945aa2c1","ev_3f2d1707159392b0b3a48279","src_b8664dd05f5560604511d8f2","ev_33a8f3aa5e06d648d7da2670","src_d53f0d2449e6d2af61ddb6aa","ev_5c0ecbd9eb01367767797947","src_918e0a278c42ad16edb795a7","ev_1e9e206ab1dbb18c5e0df650","src_e3d7723a6ce7a7197b033658","ev_d95e847db7ef4f65b077e549","ev_b41202478cea57b04e58c1d3","src_1fd4691bd6a427448d2e9d59","ev_a3c10ba06f5fcfbd83d5b435","src_6d3382c87d67797170d4be2a","ev_777a110f0a31f2c

b9f98c487","src_6f6dd7e395f55563d06fe9d9","ev_9ae3bf7594ca90cd73c18ddf","src_ceccf75d8d0ab2a591bfe0dc","ev_57b99899c77
afce397625765","src_0435576e00028d0181636f7a","ev_aa9cb0936e1fbfafa141b70a","src_d33fe414a44a04ae8c765b41","ev_49dcc42
5cda6c59321aaae81","src_c525c1f9b1918b8ee93d8db8","ev_b40ed25d60b3f69f4f44c38d","src_33d8a0ba09acc099833629a3","ev_88a
16e748ca89f656a0211dd","src_b4daf31bd0b5fdf7c7c9b0c6","ev_fc93cba46783eec69dffb6b3","src_7dfecef10cf0b55f3da60f2c","ev
_382a3e0a3720efa5dc4f6ac7","src_8273b2cb5b8f51273109904f","ev_5c24079e1b72c76fae392ea4","src_6ef14a4706c717bdb13465df"
,"ev_159c30882bada3f98ce2824a","src_bd484d6ee8f15f43223f8635","ev_fa0aaa2ec71c0c14e8f60dc0","src_87489bf70b7ed4ff72841
d19","ev_769a3293372426a31595bef6","src_a9a0143305e29a01695caf7d","ev_1abe812ef5baa0633cb00473","src_2191363b8faf2ba84
c445111","ev_0542aa88c296392a62e89829","src_60403b91b7eb3861e38ba03c","ev_48929b7c3a08b2d4c99229e0","src_6b57ec30d346f
3458f77cb4a","ev_a389ca454789604b93776d29","src_58dc08a78e2d3458a4c6ced4","ev_25db70c890f8436753b0b456","src_cbb5f2cd3
2f5026bd60a19ac","ev_c8516d92098f2ed3ff41a435","src_ebc87de2328b1ce5c1b3daf2","ev_249fc8e9095f7023247bd5f4","src_b6402
f846521e4094cf9ef55","ev_71a2a910d0f6dcb54d7fd250","src_1667013d137eb4f77019d15c","ev_c64bac651550cdd3bd04b094","src_a
36bbf80feee0b8312569992","ev_cf3ebe9a223e5c0560dcd16b","src_95648af512e2b3180d3cd7d0","ev_59f128df06f9a811fd7bdfd0","s
rc_f3b0eb03161dfb5b8733e723","ev_f2bdbfdca699fb0cd09345c6","src_c3db2137c9540b3783617b6c","ev_483f367bd263e447ad561641
","src_c4e63b4ac0524025ebfb2ab5","ev_d10f9df87b761b37675c915f","src_5d1d2e0dda25b0bf945cb110","ev_7678c59d3e0df41f9855
1fdb","src_e7cf712d6aec485c3a840054","ev_7d344c8d2f3c6742911431e4","src_8085e2431d9c68a74903ec39","ev_407ef5d92a50190a
a0336444","src_802512ae586926f766efbbae","ev_c297f159e5f975e5b7a067aa","src_c44bc236ed8aa962341d5607","ev_f3876d159dd3
b0f50406b0c5","src_b95269d23da299ec39100c9a","ev_c7d2298d1eff2a008305c1b0","src_d5287c91735cec40f379354a","ev_389c467c
4c40c4385c2ded1d","src_44da26e053f9e2386a6ccf4f","ev_7d8b0b1ab1d1dc23152d7aa3","src_b4af3fc20303e37877df0b98","ev_00ef
eeb27fbe5f6e267490c7","src_8e4eb4c18edb4cc8307fb01e","ev_39916011011b48bee1efe70e","src_b9a0d34447dabd386714c3b3","ev_
22860787175e0891de2a1ec9","src_d16ea3a9efd3aecabf17ddbb","ev_70ba39d21a8e37c92f3012cf","src_a403481375fa492189a34f65",
"ev_0321bae04ef6f4e8d13d5aad","src_ae657a6ba09bc8436c617339","ev_1a05014a7a4bf8536f18bbb9","src_810675ce37fd817525a7dc
73","ev_e021dada0241d60717c0f385","src_50038fb7b136ff9c16036936","ev_856eaa7d72b7b5053bb7bece","src_ecee23166ea54703aa
da6fd1","ev_8bd28782c6ca26ea375bbf35","src_6a532e3c96a142cc6a7c618b","ev_ef5b46174f938ae449551da2","src_fecf9a2e143b88
7e76ed656c","ev_7dfbcac47288c646a426122f","src_a9bc1e1c9a37aaaa002fffe8","ev_bf022a552e54ab5df67de5ba","src_bbf1133a7d
3cfb9c2b669efe","ev_b07bd3cd8058ecf5c3f64fa5","src_d32c9bbe5d928ce40386aae2","ev_4cd3e68268f03d89ca407b4b","src_cee69f
d3b50a6d5d3f53b9f9","ev_856fb8ce4a11ceca4ec9d283","src_a18042c67eaeda08211d0529","ev_c41a86b9596408eb28c3e68d","src_77
0e8df60427c1f112a5bc2f","ev_a25ea0c0468a862e2a29a5e7","src_2a62e7f1ddc6e621e23d7c48","ev_99d89bfd759e9a3a3c3ce19e","sr
c_6b28592a32b3e5828ce657a3","ev_a9a87d8747c66b0a16d021b3","src_e6a75ee490309408595743df","ev_e729375f7b9e7224307a9033"
,"src_3c76f2cc9d4455f1ff49f7f1","ev_9f86575de1395199f9d8d897","src_bbb1b153debd672cfad13e55","ev_5ac3494ef1e6cfe283782
72c","src_027366ecb348d48ec7169731","ev_2573e9da0e7ff3230a268439","src_9dbdaffe31a7c9b8c3785baf","ev_80a2d28b236e47158
59d75bf","src_4fb49e27f2bb6e16bae5613e","ev_5f1511e791ba14dbac3d9b68","src_dc79ce4e11961b2ccf0f9af8","ev_d26ce5e052644
fb09ee91c24","src_08ea6c1f863ab8d9a76948cb","ev_14fbd2ae4512933baa79c989","src_194aa71b79fbe8151889e211","ev_a2849b8a2
a7536990f381f51","src_ad49f3f2139b86e79b625b44","ev_3ecd7d35bcd5edd18fc5e820","src_6872f4738fc8c76d3b14f67b","ev_e78e6
e164abfaf12207dc6e0","src_20c36d3855cbaf14f59e354b","ev_54eca7607bf5df5b3a90ee04","src_685431350e94f989283ceb8c","ev_3
f63a5669344eb3803942c74","src_6c99778bcfc4a827ec271f75","ev_dbb36e877bc9e092c307ca30","src_3f6c50d9430acadaf1a6cb11","
ev_384d98b38edaa80ec677dbe3","src_d5ee17983ed0157b6c506f06","ev_c0e07757266c20ebe84708a4","src_9ad5f877dacbf9f83197370
4","ev_287012dcb5dfbf2aa411e362","src_3ee405a7b227a0c45fc80de8","ev_edc29a84c4df1a04e65e30b3","src_86c9218313dd7b04d1e
a13ac","ev_8307ed8f7a0b6f1c2f9f5a37","src_ac9e268412135637494eac84","ev_ca2250a9a624bfdca1e2a2a5","src_cd0998ad7d5782f
177ce35da","ev_4a7a3477e4bbcff719b89956","src_bb36e4bfb3cedf0dc4607638","ev_400ba54db6a1ee8bde9a6f55","src_11cf9833d9b
ff5f6aee980f0","ev_82ed73d750428b32bf7f943c","src_d2636e472e7095b34d2d49db","ev_283d62d29edc61393174e516","src_b7ea26f
3cb66ff4057d55f91","ev_6ca093411c2bd22fafc40ae2","src_41c710b0df5016f98f55adcc","ev_3774095cf2f7ffb1e8b02848","src_88c
ce5bbc130a2e033613355","ev_0a2ed15b4f808570e3c5988f","src_ab663bc6ee464e064b004cbc","ev_f3364ba01c7729c03f873a6e","src
_20068489d6a5599ecc512790","ev_72247fa3ca33d8709d7d7261","src_184ef3dd62aba925b2949680","ev_3ce778f7c1efe25c9b1dc8b0",
"src_00fa33aa7d80fc81cf8f8ff4","ev_8b51ffa587996d5c1d6291ad","src_80b888361313d61d60213ab8","ev_2e45db43cf2288d05014df
ec","src_596d0d39135a1e8c3c9cc21d","ev_d9d4e8d59b47272f651a7240","src_705aa91026db80dda0dbfafe","ev_70aa52e7571ce4262e
071a7c","src_03cb0ccf5f61d39465006d1d","ev_d0c0b7b781ebc5f5fd3045c6","src_f0daf10000bd543de86f996f","ev_bb23a798bd7840
83fff4feac","src_5cd384a7b3d635952713d773","ev_7e2e47032b215b51f8d79e99","src_ad45a233cacda307e49302ea","ev_2cd9cadcf0
52a7ba7230e95f","src_9a8fa7903aca8427172edf58","ev_27c0637a19b6714ade04c22b","src_08cab1dec8b7a65d5de35931","ev_5afc79
be427271c0f5342545","src_9dc004cfc7d4fae30f033add","ev_70d225cd2a815ff45a1f95ea","src_f9be1d68cebff1c1267bc426","ev_db
aaad84c858fd7c4493fda9","src_830376b6eec3438b4eb3e47f","ev_60dbb3fe61e132da1e5c906f","src_bfafcedc08b2f52b03413887","ev
_66828c9969665e1efa961c46","src_09d731f7ed01ebf79bb2e521","ev_a842e5ea57aa7a9063975fcf","src_031a224a490d4c1219d0234c
","ev_be86329f2491a0831094393d","src_0772691794f24a56fddcf638","ev_1a21e54f206009979b15a260","src_ab8209da3fcf5647db3b
f9bf","ev_38c1b487d37deea9c08b3ca5","src_71bc6da2ba20f4a59f961a36","ev_be203bf86004214fe41bd84b","src_4e56b2040455d459
74048c36","ev_72c76df5be7618b32b83dcbf","src_675c8a8b42e8ec7a4eab65a1","ev_5cc31c62421d07343ea8f727","src_1b08eaa3bb0d
bb99afc7e8cc","ev_6d80540f397292ddb5246d08","src_cc3872675004e79db0299e4e","ev_f8f554b964b55d73ccfc0673","src_f69f4f9b
00d9596ca02239f3","ev_49cb7d71b9b67f4cf034d15a","src_5265d0a87a982b4e702f716e","ev_a6db0bf51d70862c616e0378","src_3206
3c41175ee38af19c001b","ev_bf15221b95ee9ec35199e322","src_52ed2dd0da6548444c781d97","ev_f54a6c0f1b8f3dbea8687e03","src_
0c1b5f872d100086fdf1f02d","ev_73d7f7af27d19d5872a0bccb","src_d0dc6ade173f4fafd6a3e6f1","ev_7d566371da229d27dd0b87a0","
src_8d0aa4244437a9989a5f41d8","ev_4f3309969a97b08016ef0380","src_197df496c1e6fd576a5a76c2","ev_764960216b1eb9bc1f7be95
5","src_44780e3892b450a3011fee71","ev_7667e565709e6f5df31883a9","src_35f228f03b73b6a57ad3fd28","ev_d919c39867adf50d88f
5354d","src_7cc8b8a3ff8d0b7d701f6fea","ev_45b433e33324569109b6d705","src_d649c5181c80eeb27912bf9b","ev_8e4b3db50d93511
e5e1e3b67","src_3584afb15281805532700655","ev_aee70b8fbd0c76eeac47bd0d","src_00a0a082c14e59536527bff1","ev_111bf988803
deeecea8faf36","src_3c0212c37e608c41a7e882db","ev_841b258c9becab31a25feb4d","src_18326096e0d7261c8c6f3fe5","ev_d1519e5
89ca8148bc424c956","src_d07e7ff8941ccc533adc89f8","ev_3b028296bbd5a8908e861adc","src_c9820919b41c7fa5ca3898a5","ev_b6f
014001994c38683f06a6d","src_2f74011d4fb563f77f3a7b16","ev_4c69ff47e70b188fdd038d4b","src_0f99f49f9ee37509dacd850e","ev
_b9aada64fa9f8c06525782f2","src_afc7d7e96f5a27de3e886229","ev_2a97e718f8ceac71f19da770","src_e576bc7d1fb9c2a46f892091"
,"ev_0c38d1515a4ea48d43bcaeed","src_b8a3dc065fdc24053100aa5c","ev_2c1fa28cea0f3e95f749022d","src_f66b3bf65788b2235bc8e
aa7","ev_70f0d3989bdda4f2d1fd9e99","src_526d60d1dff584332a658d0d","ev_1d4c0debd6781ef922049f47","src_ed5098213551c0bee
f2f6616","ev_92debd7e83e89e7c85bf5628","src_d1cc5642f300bc30a94cd7b8","ev_3220afd7eedec00608ac5313","src_ef6e393f154b6
b247e275eb1","ev_356b3b677a5873825286ba11","src_27f9370b7ffb2cfba01518d1","ev_ad6f55cd8236e4d4ec1a877c","src_f8e56067d
aefb2e08c89e6b3","ev_437b67486e6ecf6e6773ac9f","src_47fd929d318a89e360875f1f","ev_a7422d3665cd5b1d4ab96dcb","src_c3ce1
abca994f4369a9123d1","ev_66ce42016739acdb85ea3046","src_4bbaaee5908db7826219cfca","ev_69c5e3d48d53db3316df4fbd","src_9
7fe54f06e714948f15e6aaf","ev_45e6fac2ea71938828cb47a1","src_561c3829028e2dca2ed11a1d","ev_3fbd416f69fdfdad0471a09c","s
rc_e341c61d637849e8ee6866d7","ev_d4aab08eb27abda8259fc5ea","src_af9d6b3a0e7f322da5d7fe8b","ev_61b422ab9984d76fd44e2111
","src_c7ed2c819dda00bb4e405a07","ev_c724a9d6c193bc011779612e","src_002eb9d299d42f0b67511af4","ev_86a2f4c169b95ec08336
b713","src_7a639c61313a9830ce919ac5","ev_dc6be84b8fd86918cd74a3a5","src_502b9276e551fb957cc96c0c","ev_f9a74c9ba9cbd11d
5938d8af","src_22fe96d0163065fc5fa02c9f","ev_612e68a97d101adf6a327a5c","src_56425f889d7c95860f114e0f","ev_28fc8d37c417
481415f88d8b","src_1d39924633856589ae3e05b2","ev_505772d59100fef73bc8e63a","src_762a8b46fe531c1fce133100","ev_4371b543
bf6ff84ae3f16af0","src_39e27954daa950bd8fb8d174","ev_b3b8a2f4c577a1278edbc361","src_7e9011ac9cbab88316c80127","ev_15ff
9e327b9de8af7d590d86","src_66a54fa44082233f36cff29c","ev_cc4f0c61f3d522b58d110ba2","src_2adc24b08c7ca8832afcbed7","ev_
8f25e7be899931e7e65b1f09","src_ea9362e84cbb73c55ab224ee","ev_df0e26143b09acbddfd0b7ff","src_6f9edb16dd2fe6ca1c3784c6",
"ev_044ff4451804e1d5d6f4b987","src_22d2b5df079d4c321c432f06","ev_1ee3ef10a12d1b2ee37475ac","src_b33049dddfe8c61e3d284e
6f","ev_4ae3155fab5b73723615c081","src_6de2b6ad865224603db67be6","ev_b3c51d283fbffb0514efa4fd","src_0431046d8f8683a143
12375e","ev_9c56b4342f4376792c8d8ae5","src_7bcf750665ce12dc9bd92fa7","ev_abc8e6b2375ed2520d13e1ff","src_dce7ed79b776c8
7e37eca95b","ev_2a18625fa72f3a79235247da","src_1883e5886d0576a126095a37","ev_fb22e1b81c0ec03147ecf3f7","src_dc4de9efbb

85ab7e6647b8ef","ev_243aef10ac4ad651eb5b0699","src_9a37e47dfdd575cc35561842","ev_5a5b9a571fa297923ec623da","src_323403
ad26f2445d709d580b","ev_54f6ee05b0dcd85ef57a42db","src_928ec16045e93b67ea6eb5e0","ev_a4f084bdb4673cae4519e7b8","src_56
55c4aa359e36499435 46bf","ev_eb0aec3aa473ea3f47fd1682","src_353d61f103b3398a06ded2ff","ev_f81fb20f27982d89ec56f2d5","sr
c_0a99f72757c0eb0d0a601115","ev_a4b0394574286937 50736ee8","src_651481483bdc14d6bc069416","ev_c3c922d03183791b64a66f4a"
,"src_c443828e9610589d038da845","ev_dc7b595c6c8de4d7d6691b87","src_ec34d9c6e90bbd6816a86ce9","ev_d547f52b3f5024755ab32
055","src_a2131ed7fd459e260438baf5","ev_93b12b6b6f12d37c9e288e87","src_6257c230b6163a119cbc6f01","ev_3681ce1e12020b684
d1cada5","src_a8708611471d869fc963053a","ev_2edace60c379929d206ae719","src_059a52b349f30fa106191927","ev_0ac294afc7f12
3159006ef3f","src_127a9816b2c42c30dcc810f9","ev_c65413cad5a398dd2764b556","src_cac8fa08652fea335b85475e","ev_e0dc17f33
bdea3e4b69d0517","src_5679f6738094fe3cf04ffbbb","ev_0578d57a16787c7343ef0644","src_ff09479385bc8400da695601","ev_aacf0
47e9c16335e2bb41f8e","src_58a196cf75c96355f5c92b01","ev_3c2d3367bbf525571dc7d801","src_98db61e37e5b3ac4d61cfd72","ev_7
48a18fb878e56c70bb74779","src_4b70a313ce7c8d35f6c52432","ev_d65bd4c74001da201a38cf85","src_c0bc7f99b24cecdf1e19e39f","
ev_4107bb2f078e5bbedbf27208","src_5c252c160d7ee804475d8470","ev_97124e128ade7d3be2e888b6","ev_8f7752f3ad8e43857fb6a649
","src_9007d0bbaf3751fbb844c954","ev_9b6392c9023c86ee485128a6","src_150730b0a046562f7afa32ae","ev_38ea04cfafac350b0c87
c85a","src_47a2e4e64a56b04a08d5e19b","ev_b25eb2597c53efb92d1b9883","src_e95c9459903783b0fbd04056","ev_dc43f4b5dd9bbb0c
dfaf83da","src_b0450242465faa6be8bd127f","ev_e7934996af45747240275ef2","src_814f061ab142460f91434f89","ev_5f71f7d7266a
3fef3a2e757b","src_0bdf16630651f3cbd28a6954","ev_261fb5db1bf40255e7e0c41f","src_873634e41045367317040423","ev_31ca18dd
36dff66ec1938743","src_bd5d468d10fdfb09ba05c657","ev_49e25915b46e370f5696a593","src_f9d9b868a1b1afeccd91d907","ev_2923
d140de4c4ce887860cea","src_4b3704bbd6d0c7b408cf625e","ev_0d39716dad954e1f36f6296f","src_e5315452594459831600d4bf","ev_
b256baf12a714820b5e2650c","src_c3474f2d8e1480b90af6293a","ev_3589466cdb2224d160cf3573","src_dd31ec6534dedd7c026ea63c",
"ev_ba580e6799060722db6cc430","src_e2bdf300804061ae0ab30145","ev_2c2c744e1595f1ba4a19c058","src_72ca961174409d83d567cb
23","ev_dd34374c41c4ef38b10eb335","src_53e55688feba4e4582ccd509","ev_db1da4c6ef9c5582d8449b79","src_8f8df3e6f80e62da39
3953bb","ev_714f9f8f71fa0ea99e0ad02c","src_ac53f00c84601d521cca7005","ev_7535b1c038468254e73553fd","src_f5398dd0139989
802472dfa7","ev_5f87189087c978a425fc648e","src_f7f37fbcbe6fe88e2829f487","ev_201b292d8ac97b75c14cff3d","src_37b382e910
fa1cf84881d149","ev_5eaabd2831a784e37e3797ca","src_ae640db045def4e3bf209356","ev_a50e1c93a4f1becca939cd2a","ev_f809642
6a0f0c051cf065231","src_3ff828440508457dc197598b","ev_7922e76b67500cd8cd8fb6de","ev_3d77c114878823fdde11d11d","src_d7e
9f4eb8391a9c752282387","ev_416b50b34adcf4e9c391de3e","src_3f43220a9519374014e8cc02","ev_7c8e622c02b7f519f35e4fba","src
_76f9bf2a729aece8df83d853","ev_a1cfca763d2a2c55c146237a","src_0d22e33492a8e23cd2780fd3","ev_cf36b88f757fa82317a681af",
"src_801702a428a9cf30533482d4","ev_d2880046217273f1955c22d8","src_5d8fc59f7ba7d9567776f565","ev_eb98dd01a31c24d348dcf7
ba","src_b2731be2bf7b3f8995accaf3","ev_85ce9d49f159213ec48b4b31","src_6e77ef92b17aaae45512a195","ev_eb4c218bd66981dda0
479367","ev_cbda0f34bc40ea28eb3fa818","src_5a42ba76ec221cb07b456b7f","ev_9228edd060d1ecd36a8d600d","src_94aa77b1a78d9d
158660f7a2","ev_e2e261b0ad8449f799520094","src_889b95419b8021703ab5277e","ev_74e3b7b47b94dbd93fb2357d","src_ddadcd30a5
5dd37b8b8a94c8","ev_66ec290ceae866f3ff1e44ac","src_a74054a9a58a3d8663b3a3d6","ev_5a28f1ad8b11a2071244c1ed","src_6a6127
45972fd47df8aab031","ev_340af70443233ba315df5f79","src_4c910367f21b52bcdfb94532","ev_b1582300d26f694033ffb479","src_4f
d20759f8706163541125bd","ev_203ca6e4de3568f8ef366deb","src_f2e24c6135cc59fa8ecbbc51","ev_bd54fba2cedcbbb26b78ba37","sr
c_5eadb7d04cfff005d199c8ba","ev_3ef0f4f06011f85c5786d740","src_9013963c44b5f5e3dde05eaf","ev_27e32a714afaf460643836b0"
,"src_f56fae386a9b4213288ed40a","ev_2ddc9e2d493c888a6d9bd3b0","src_d0463d2555cb086e4a16e4f0","ev_da2752151bbd39d68f997
5bc","src_1ef2521ac2416940cddd1662","ev_9ec7b2597d9070f329a65cdc","src_0215df9eb77c6a70b5bd5686","ev_ce15a0af9f5bb4dd0
d818f63","src_2c9f9d322c4670bd6fc1bfc1","ev_54729b21cdba38b5f44bf628","src_03497e7bc3ed0d2731a78c5f","ev_ace5c2b982d61
359c2d2be0f","src_bcbfe4d21f1c4b5dbddc8a4e","ev_5da32f65fdb508d1294e5beb","src_a356917a8984a7416f16a943","ev_e86291918
19e7a19553a982f","src_98e13ee5d252319be2897d31","ev_8bb2341e05f7cbb3067203f4","src_dd1192ead9cd00cf1c6733f1","ev_fcc7e
2a536f99f348cf18d35","src_486ce50170a6a83426651190","ev_b5629e338419d7cf8ddbf137","src_ba03f287985cabf498cbdc5e","ev_a
237f5e1c988c3918e4d3ef8","src_2acc13a645485c1de8026b41","ev_6179455330b1d37bfe9e361f","src_ba90a19a617b123bf731f492","
ev_a7588ea2637a7d42643e17a9","src_51535627e541bcaefdc020af","ev_92c8a65fca038f97f20cbc40","src_d763fc20a0a4b261a922acc
e","ev_b76022e3d7906cd9208a0df4","src_ef5631aba783fdaf80f266c8","ev_88effc934de94fbe50900667","src_be6490e8c321a2b7482
3059b","ev_e566511d3ab018a6d82f8852","src_8b271c1f79725359376197b1","ev_318691c20a0f2c63e9704efa","src_9c58b4a1a557c11
b7909af4f","ev_bcac7268ab2dbe3395497cdd","ev_96052710ec35e4a33f10c91a","src_cf1e54014692e8d961cdcfd8","ev_abb0fda4a0b3
e878af5ce311","src_a2ed98fcf874324e221f5302","ev_790e620af578f8a9bbdedd80","src_c785f19caf66d4b7774062a7","ev_6f5571c6
ba808d6fc96a5824","src_35c1a2a1ef046276aca91ddc","ev_39be74a0889dfb53e4852b1d","src_5c63f3fe6182d3a96dafae45","ev_cc0f
e49b3d609d0a004cef78","src_56e15b2690307dc1e3ad8d1b","ev_d2bdb1f6e92721e830e80b98","src_4d8ad66a8a66a95d2755e851","ev_
1905315e342d2fbf7f8da5f3","src_c031efd3835eb4db04803be5","ev_7736d1bc92d22944f8e40b67","src_b09d40111cbdea9e76ecd864",
"ev_74845b3f9a4f76435fbaefa2","src_04958fbd6ebbbc5a9260722d","ev_ce4f11845aa51b715fa1d1f7","src_1f8a96d6a59172178ef1ee
e5","ev_c76aa00438c2983f1ad3acc7","src_28dbe85da5565eb582d2611a","ev_984fa0c477128f7ca7653c73","src_86de129058e6359a8c
87cf1d","ev_cbf4a257d2b141f5c5249128","src_1a4165243368d9cce3936ef9","ev_832c3efce7aa90b90daaa08f","src_ccac87d7de3193
4cd48feca0","ev_c208d3243ec29c4669ebac75","src_7093e8e0e7759672797857b0","ev_d5bd4b994185bc3d2eb34649","src_7fcf9b2188
85a26ef7c3a632","ev_ac474ccae326dea5a41934e6","src_468c5db3236e8297f787dc73","ev_1a47b83c6766726b9b3de735","src_b263b8
7ecbe5edde4409a872","ev_714b317dab2a2fb69f95daea","src_e24959e7686c61e3d2e48a80","ev_1696949ecc9614526892cd42","src_04
5fcd55806dccde5839aec1","ev_36f7ed800b88d8e2d9477a04","src_36b0a54e07e7aeadc3e0e295","ev_6d51e8e080fa762fc824c434","sr
c_0fcc4f8de0e55be9eb762798","ev_868cd99e7fcaaa800476abc6","src_999b74e4b10764d723ddbd91","ev_92c9f3eb79da3d6048b79175"
,"src_4c780a5a27bf9e8af2877b5a","ev_ee4f5e29dd7ec1b699dfdfbd","src_d6933620c78a4b65fc2bd4a6","ev_402ef3d21803ef4478f10
e69","src_c4fdc631c5284f93f2645c6d","ev_e4a253e9a67491a28cde4584","src_3e8a6ec90f508eef0b5b7a47","ev_086bb27f4975c2042
5530ab0","src_d53df8b9500b52d6c4a4ed96","ev_243996f88dc202ac093423bd","src_238e6525fb53f158cee2d2d7","ev_189c2d6609dc0
7d53348040e","src_3296eaf5f02c5827166755fd","ev_d1eb8862f7b246274d2b73d2","src_6e9b7560a43e1eb5e96d3349","ev_73367a712
759877792934268","src_114869606dff10a7d88d28df","ev_f1eb1d7bb044a02cc922474b","src_b822210ee3102866aabf138f","ev_43b0b
de575fa5971e9ea2473","src_adc70748b4347c40938a135d","ev_f1972b172922fdf8358bbfa2","src_6e92817a443fad794db2420d","ev_a
83afacb8f38066ccd1c4ae3","src_c5585ef753f960d653ee58f9","ev_791b89af41a4fb3e323da800","src_d3df1ccbc231f325b87a1c50","
ev_99586c362b7c87a3561884aa","src_4597597d07a97975990f56a7","ev_044028cd8d6b2425a57f777a","src_9f01f28e4983e9777185643
9","ev_728e8f3a30bbda273b88596e","src_aa937aa5fba01e1cbd8c7193","ev_16118b86ab6641e7b14e06a0","src_503983a6b149f88948f
715cc","ev_ac9f49d0f297f864a9b578d1","src_a11e3039cf708cb67414fe64","ev_3a89a0dbdfc6a4a2fc5820b7","src_683355e9bc88185
85e432d53","ev_4b1f2c0efc655f12926dee70","src_48b8c83c9872328b04bc9db4","ev_a6d16fb452547a473f72b304","src_fd8c31cf076
a26daaf0fcbea","ev_d4a2a297a56c9b35b57d1eef","src_fa1d386fd96312dca85440a6","ev_90b264cfd7970883f79c3d44","src_02d6ec8
a0064b40a7e093d5b","ev_f688269e7ea82fede9fd5727","src_5915d99aa2c2399a67bb4b78","ev_e17488bf0f4f03682e7f1930","src_ee1
fc0a714d63149f11f79c4","ev_cda46c86b906011b6512dc2b","src_7bd7e34c5e715fc35c982636","ev_9a8cb156360fba90282345e9","src
_660b5fc4e949105ebfc63565","ev_b03f938b902410fb02fa73fb","src_65c4399694c682e39aed2428","ev_75cf62fb0f84f17b8f1a51c6",
"src_94ed01e961730457bdc27d83","ev_621b9a6072be9b63e5031822","src_8a36dbf065ef1c0751b5f3a0","ev_85f15a56ca71cc2166b302
d9","src_2ce28d707e15105efd5accb2","ev_b66ae239c8972099dbbd3ad7","src_8cf5d28f396db06c9fdc8901","ev_cb3943400ef83a2898
2c5724","src_203fca08a59ec871345f5bd9","ev_97d0e668add704b40fdca81f","src_47f6c0d8dc618aba5192e900","ev_6b98dc4ab9f890
f92500f6f3","src_f1ac05a6fe4735a5c9abe9a9","ev_d5d01d15720d2e9f0d9c7721","src_4fbc8ec9002ed99f416994a6","ev_0152a2e737
9a097aaf74cedb","src_e42236f3c2f150fcf12fd73e","ev_09b2a04923dde1e2b12e4665","src_421c2968c8ec12740a0488a8","ev_3b727e
195b57fc5beea26c5c","src_b30455091b0ca684963c48f4","ev_37828739916777dc77129eb3","src_5529fe10097f73723cd93439","ev_09
cf9bebfbe48e6bdc16d03a","src_3a097a0bed09264662b2d0f8","ev_6c948b50c556d28657254c4f","src_700d8ce0f570e3d659501ebb","e
v_6bf7ef9d78cb2fede9b0882f","src_b6b431c2d854f60bfc3baa96","ev_85b215bc978aaa511f85c596","src_1dd86975c349e93ddedc38d8
","ev_800139ffdf2d1855ff55f2dd","src_f32c49905a360fdd838d15dc","ev_31cdf7b3eddc60032fd43e27","src_78add4a30523a16c75e5
5bb0","ev_06f8cf370a32d4ac49043728","src_3ccf88206f8d84a96505e611","ev_fcd57bce0674172bd865ad38","src_20a83b05d63d4a0b
5d9231c1","ev_7835e4b276ee2fbb29640107","src_f89f6eec81b787243044bc65","ev_c0ed680764cedab70dcecd64","src_18ced4e0c9b4
bd5e097bb17b","ev_8b689dc6f3b8487d5df3f5ca","src_f85a9cb9d118d5a5674fb113","ev_8197aeef59587fb62acdedd0","ev_83293bcc6

13afe70df4e4fed","src_3056908f99dbe7964fd9e3da","ev_0b8ed776e5c6659018472f38","src_d945628f1964987678acab6a","ev_18a39
1095f5fae52e982e95e","src_2305a8fdffda0255983c808d","ev_682c621cc6666ed7375784ae","src_dcf49bb95910104a92594ab0","ev_9
ef34f6f955f49cc5a939dd2","src_46911a99eb05aafd74a3ba36","ev_aaeabaea8e8cc506817ad00c","src_fa4ea1bc0fb741a2507a04ce","
ev_bffd7db3983f87dafc92a287","src_4cd7b2734410e101538fd3dd","ev_47ee910ca43a9020377d3e78","src_2adcb0ba2c3c96c97e6a1cf
2","ev_e2ecc1bfefd1b8d39ac4dc77","src_b52a17e4373874a34dc37f94","ev_dcafa936d1a4cfb56e8950a7","src_7afebd1cdc921e8f1d9
519ea","ev_2ef792f654812e4429013ff5","src_37b5a1ff43ca730456263e29","ev_08dc8bda22dd62c13e508839","src_b8c96da984d3b54
a09aecb25","ev_ac94c05ac7d865c904d81c42","src_64476b9336ec5b8eaa4176bc","ev_0bf567a14e7ee2a62c60f8a0","src_fad4036c3e5
3011b4cd50bac","ev_d1f410a383ef8a228a0c2d14","src_aa5f7464d15283dba62d2cb6","ev_1d2dc3fd18f508236b63953a","src_8a685c7
da88ec2cf3f5eeea8","ev_d53e3975463e58161533ac4e","src_d9f568bf877213687abff8ca","ev_875b3776f3c762f4e0310480","src_692
fdf49ee47eb450e80ac77","ev_8b4d2e169b836e88fcd63aec","src_88eba9bb7bc67c7e891eb650","ev_13731e07eb415a122ec93fbd","src
_8c93bdca53b4a181ae09b337","ev_7a701089fbf1bf428d5e54f0","src_f3dd40845bb8527cd9ff4e45","ev_8589bccca310cc1428b19a70",
"src_20b7c1610e1531f9e70cf347","ev_a9c3e23e0ccf1d54fc2e9236","src_5a6efd7ec277c929c1548869","ev_7f20ae47122568a52cee7c
db","src_2453229f207bd253bd1d70a2","ev_62fa93e5fa96439c6d85e4e3","src_d31bcd1d8d3ed19516865b2c","ev_124bcee2edfd3daf55
240a1e","src_36861417bc074048f55c222c","ev_fe9e7ae3faadb2b1572a39a8","src_0a27549bb2a3330380ea5f19","ev_d720b35709c947
44fbce26f6","src_a4cc445e2cf87db16c35081e","ev_0c184aa48a3a10eb64c73f6b","src_baf385ebb64c66cc39365c68","ev_e8d45b4fb4
f81ec93ee508d5","src_0a87f9185e528b34c6596b40","ev_e489cfaf1ef8497e17d4f216","src_bf175ea96db967f925d1a9ea","ev_851bd5
5089bfe4d4e11f07c5","src_fed0a0be8d1b2b2ef660acb0","ev_af9304a8287e1c4ca1b6f693","src_853f552b37b7259f50709536","ev_de
6a6bd374c222311d909d20","src_05ebd6dc21b5bee4a63a039b","ev_413b657baa1a720dc0fc8221","src_05b33ce7c246fc953bb7c9fa","e
v_a93b2a7d0e278d3cad034eb3","src_554add9ed39d338a7f8e2efe","ev_2d291bf316a69cdce5ef679e","src_ffb1649b6044c7a6acb9df7f
","ev_4ea815961fe619ac38a83250","src_102c31d288fad986f2eac3aa","ev_def89e6e73e242e50a477c59","ev_01eac672d75187f18f0f6
7b5","src_18d6e8cfa38753eb5d690161","ev_e6247f6404f79323f62332af","src_ef59b5d70b778123d1fa48f3","ev_7962541db673c84b1
c33d440","src_25eeae438132839632c0cb46","ev_0a903cfe491dd668762d137b","src_f797ac07c70497dccfbef879","ev_7bf2da5b0c4d9
bd832025997","src_5383f97a7dfd459c51dfe054","ev_4f7aa9e69c51618770246d63","src_6884c517608acf5fa973f047","ev_71f34b088
63ca1398801177d","src_68324dca9e04e399749c959f","ev_3e090317104c161c377efc5e","src_38ce02b336e8ae45a713a47b","ev_8d574
95f961089b2ad6c8f6c","src_53991f1e41b3dc68ba855510","ev_826a473b3c433ebfe86f982c","src_3b45f1e731b9f683b84dfb99","ev_7
d603c183d1a89aabd417632","src_44b41e3dce157590816d1c9c","ev_22c5f8e7250f6cd563886071","src_0bf23aa1b00c94713b4dd128","
ev_fa65d1aa650da814063d887d","src_432a2a1763c016c81264eb25","ev_e81624e9576bf3244151e0b0","src_07fd7a661b45618dbb43f3f
f","ev_c3e1fc7c725f3f6ea6b2a26e","src_0b275954ccb4e56575566c2c","ev_b966b213ed933e42e251aaf1","src_5dc8271c636cb1a138e
f1177","ev_c3fb3f5faca88c118d5fa814","src_44c024c3e854918b76ab8921","ev_8dfe96c34e43559ab7f4d2e4","src_6b66b69167082ba
c4b395204","ev_3ace77d4e38e5ae3a59e7ae8","src_56fd89f29aa4c5d4544f8449","ev_2e84f0923f2b4a84e1750db4","src_c640e53bfa9
5bdcd071ac64c","ev_31194a5b8cb1d8c6ff43d190","src_43c4a5aa606602abe8821199","ev_3c3ffff544e7b4fa00a5ccda","src_9e42a81
2ea4bf956d836a9ec","ev_86246a6f84e810682201edf4","src_cbb0984132855770b4070700","ev_880d578a54cbdeff8b9f7832","src_41f
6904bb88f623cd2acb3b5","ev_5b09205c5adc40b9634508ee","src_d2ee8c15926168afe94ae069","ev_8b1d9af0a8f1646d40de2fa6","src
_8d406241f73f509a2016f299","ev_57842913e63577633a381f50","src_70c3f9c7b7d1cb1a87f97323","ev_796f963a7a2f25335f6e482d",
"src_c862c252111613e3d04f7613","ev_2ed71ec7539701935018419d","src_36542d200dca2ed6bf8ec427","ev_a31a4d122065cb257db8fc
a0","src_38c79f559c392593f863110f","ev_138a6b5fef0dd1f34f206e97","src_d7d26e3ff87d0f5e733ea092","ev_8085287e4f1dbbaabc
e0f737","src_24b119b09aedfed71cbcd30e","ev_2ca77a93aa95f9f367cf4670","src_3a414e02b31f0754a35b297a","ev_da69e1254a6529
ced76fc5ae","src_c4b17da7657e589c59027a27","ev_6f0b9c8341256a45c8e7ab00","src_6d6df147315ec26ce171e981","ev_1b1196ae36
fc627a93b3f520","src_5f8249f0134107dfe600963a","ev_e8603370f55551253dec7ea4","src_4bd705292c662260967ce798","ev_747cbb
853f87a42cdb7aec6e","src_246e2ad972d6c30a4ed826d9","ev_999461c820b0a99894f2197c","src_9152fc4dd4473b4354335c53","ev_e3
f7f4ad45e59e8bb4a3cca4","src_ebba510a592fc3144e4a4a97","ev_d491249355076386c7c4c6b0","ev_023e9811208cb685deb5424c","src
_a15c31273e0deb0d20be24cc","ev_6cc0d5b6f2d48fcbcc4d5556","src_9ee2d7bfb9a9f1e72b58e985","ev_a0b9d800fb49222f6c993c03"
,"src_ee8ca4ad5bd992558acfd8c7","ev_52101fb07895ad374eb47818","src_3be92ac562b1cc827facad83","ev_8ad0394eb6fecac67a7c1
7b5","src_7a47f14f7de5a7c7588b7339","ev_0705f054fd3f5418058a6be0","src_64b5f31c686c2e70ec688e21","ev_05cdc9bd9bf8609f1
9d2bf8a","src_e48fd5d5081229581617aa2e","ev_9d6e370ab75de2a730003998","src_8d233504b365ece3afc4d166","ev_cb32c016fb7f8
6d21cfb72e3","ev_d1df6269f93b6b5573feeb38","src_8ff4361f8474d50fa3fa6b57","ev_2cfbff4e6eb308951932d86c","src_3d8b813d1
e6e4ba31c379647","ev_e3dd5211177476f8ab84d32f","src_ba27038a2026a742584b72cf","ev_4ddb3605095362c534c6cbf2","src_e0932
f96d53a2e10c0853143","ev_d072ede702878ee68b9840ea","src_a37c42c1a87caa007a154849"],"provider_coverage":{"unit":"wait_r
easons","matching":28,"evaluated":28,"unknown":0,"import_issues":0,"status":"complete","displayed_rows":28,"output_row
s":28,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trace_7f49a94712424f41a1d2cd9034f66fe
d","warnings":["Missing records do not independently prove real-world inaction; calendar reference date supplies no
time of day.","Shares and median extra days use observed report-attributed waits only; future expected waits are
separate estimates. Denominator is jobs with explicit extra-wait-duration narrative, not all jobs. Differing nearby
note attributions remain visible; downtime_hours is never subtracted to invent waiting time.","Source coverage: 0
declared reports unavailable/truncated; 168 reports mention waiting without a recognized numeric extra-wait sentence."
],"bounds":{"start":"2026-01-01","end":"2026-12-31","closure":"both"},"operation":{"collection":"maintenance","metric"
:"wait_reasons"},"summary":{"total_matching":28,"assessment_counts":{"report_attributed":28},"area_counts":{"Northeast
Block 7":4,"Northeast Block 8":4,"Northwest Block 12":4,"Southeast Block 31":4,"Southeast Block 32":4,"Southwest Block
23":4,"Southwest Block 24":4},"observed_jobs":472,"estimated_jobs":2,"conflicting_note_attributions":10},"assessment_c
ounts":{"report_attributed":28},"coverage":{"matching":28,"evaluated":28,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no
time of day.","Shares and median extra days use observed report-attributed waits only; future expected waits are
separate estimates. Denominator is jobs with explicit extra-wait-duration narrative, not all jobs. Differing nearby
note attributions remain visible; downtime_hours is never subtracted to invent waiting time.","Source coverage: 0
declared reports unavailable/truncated; 168 reports mention waiting without a recognized numeric extra-wait
sentence.","The explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanatio
n_error_code":"grounding_repair_budget","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":4515,"o
utput_tokens":240,"total_tokens":4755,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finis
h_reason":"STOP"},"call_id":685,"live":true},{"stage":"maker","usage":{"input_tokens":4168,"output_tokens":1202,"total
_tokens":5370,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_
id":711,"live":true}]},
  "evidence": {"ev_09e848bea0d54a7f2afad16e":{"id":"ev_09e848bea0d54a7f2afad16e","source_id":"src_3434a1b512f530a5b904
0e19","source_kind":"maintenance","title":"MNT-0140-021","path":"assets/WELL-0140/maintenance.jsonl"},"src_47bc08f542f
65ec38fd9dba3":{"id":"src_47bc08f542f65ec38fd9dba3","source_id":"src_47bc08f542f65ec38fd9dba3","source_kind":"report",
"title":"assets/WELL-0140/maintenance-reports/MNT-0140-021.md","path":"assets/WELL-0140/maintenance-reports/MNT-0140-0
21.md"},"ev_9ac4ae88f71cca49bc7a9109":{"id":"ev_9ac4ae88f71cca49bc7a9109","source_id":"src_a6f964e811b84e4609e52a64","
source_kind":"maintenance","title":"MNT-0103-025","path":"assets/WELL-0103/maintenance.jsonl"},"src_b5fe7b35737981beb8
f75bd3":{"id":"src_b5fe7b35737981beb8f75bd3","source_id":"src_b5fe7b35737981beb8f75bd3","source_kind":"report","title"
:"assets/WELL-0103/maintenance-reports/MNT-0103-025.md","path":"assets/WELL-0103/maintenance-reports/MNT-0103-025.md"}
,"ev_24a0eb58ed9d5efc5dff7fba":{"id":"ev_24a0eb58ed9d5efc5dff7fba","source_id":"src_519bbfe83fa9b4b1dc12b799","source_
kind":"maintenance","title":"MNT-0108-024","path":"assets/WELL-0108/maintenance.jsonl"},"src_70d65d03d9d68cd5822b93bf"
:{"id":"src_70d65d03d9d68cd5822b93bf","source_id":"src_70d65d03d9d68cd5822b93bf","source_kind":"report","title":"asset
s/WELL-0108/maintenance-reports/MNT-0108-024.md","path":"assets/WELL-0108/maintenance-reports/MNT-0108-024.md"},"ev_10
70a42a48613df0051f5da1":{"id":"ev_1070a42a48613df0051f5da1","source_id":"src_f1e720767b8b7372f0d2a622","source_kind":"

maintenance","title":"MNT-0143-022","path":"assets/WELL-0143/maintenance.jsonl"},"src_903c06238862d881640af906":{"id":"src_903c06238862d881640af906","source_id":"src_903c06238862d881640af906","source_kind":"report","title":"assets/WELL-0143/maintenance-reports/MNT-0143-022.md","path":"assets/WELL-0143/maintenance-reports/MNT-0143-022.md"},"ev_e6c81c728aee94bb60bd22e4":{"id":"ev_e6c81c728aee94bb60bd22e4","source_id":"src_7345315f39d8cc20a7f031eb","source_kind":"maintenance","title":"MNT-0261-026","path":"assets/WELL-0261/maintenance.jsonl"},"src_6bf5adc4f19673c3ed0b80a9":{"id":"src_6bf5adc4f19673c3ed0b80a9","source_id":"src_6bf5adc4f19673c3ed0b80a9","source_kind":"report","title":"assets/WELL-0261/maintenance-reports/MNT-0261-026.md","path":"assets/WELL-0261/maintenance-reports/MNT-0261-026.md"},"ev_1c42aaca961db9a00dab93a6":{"id":"ev_1c42aaca961db9a00dab93a6","source_id":"src_519bbfe83fa9b4b1dc12b799","source_kind":"maintenance","title":"MNT-0108-028","path":"assets/WELL-0108/maintenance.jsonl"},"src_dd5ed87a8533cbc636e7768e":{"id":"src_dd5ed87a8533cbc636e7768e","source_id":"src_dd5ed87a8533cbc636e7768e","source_kind":"report","title":"assets/WELL-0108/maintenance-reports/MNT-0108-028.md","path":"assets/WELL-0108/maintenance-reports/MNT-0108-028.md"},"ev_fef298e2ec2ba09a6e03cf87":{"id":"ev_fef298e2ec2ba09a6e03cf87","source_id":"src_d1c022192100f23a32913193","source_kind":"maintenance","title":"MNT-0110-028","path":"assets/WELL-0110/maintenance.jsonl"},"src_6d438dcd4dc2a6d61b37b8b1":{"id":"src_6d438dcd4dc2a6d61b37b8b1","source_id":"src_6d438dcd4dc2a6d61b37b8b1","source_kind":"report","title":"assets/WELL-0110/maintenance-reports/MNT-0110-028.md","path":"assets/WELL-0110/maintenance-reports/MNT-0110-028.md"},"ev_cd4feadfc9c70d52e90760d0":{"id":"ev_cd4feadfc9c70d52e90760d0","source_id":"src_19d79aa697d546659c31bbcf","source_kind":"maintenance","title":"MNT-0138-031","path":"assets/WELL-0138/maintenance.jsonl"},"src_16b635d0559480b662b0a15d":{"id":"src_16b635d0559480b662b0a15d","source_id":"src_16b635d0559480b662b0a15d","source_kind":"report","title":"assets/WELL-0138/maintenance-reports/MNT-0138-031.md","path":"assets/WELL-0138/maintenance-reports/MNT-0138-031.md"},"ev_5787b1f71415831645381469":{"id":"ev_5787b1f71415831645381469","source_id":"src_874b0da0a6bd22e09917d773","source_kind":"maintenance","title":"MNT-0118-025","path":"assets/WELL-0118/maintenance.jsonl"},"src_7e569a9b8428eb9f0a98d263":{"id":"src_7e569a9b8428eb9f0a98d263","source_id":"src_7e569a9b8428eb9f0a98d263","source_kind":"report","title":"assets/WELL-0118/maintenance-reports/MNT-0118-025.md","path":"assets/WELL-0118/maintenance-reports/MNT-0118-025.md"},"ev_3c9f452b5e033bfd042fe77b":{"id":"ev_3c9f452b5e033bfd042fe77b","source_id":"src_19d79aa697d546659c31bbcf","source_kind":"maintenance","title":"MNT-0138-032","path":"assets/WELL-0138/maintenance.jsonl"},"src_c44e1fe8dcbd993742405b38":{"id":"src_c44e1fe8dcbd993742405b38","source_id":"src_c44e1fe8dcbd993742405b38","source_kind":"report","title":"assets/WELL-0138/maintenance-reports/MNT-0138-032.md","path":"assets/WELL-0138/maintenance-reports/MNT-0138-032.md"},"ev_22ce1d1213b1589c61fe36f6":{"id":"ev_22ce1d1213b1589c61fe36f6","source_id":"src_7345315f39d8cc20a7f031eb","source_kind":"maintenance","title":"MNT-0261-029","path":"assets/WELL-0261/maintenance.jsonl"},"src_38f4f9ec2abae075ee9fef47":{"id":"src_38f4f9ec2abae075ee9fef47","source_id":"src_38f4f9ec2abae075ee9fef47","source_kind":"report","title":"assets/WELL-0261/maintenance-reports/MNT-0261-029.md","path":"assets/WELL-0261/maintenance-reports/MNT-0261-029.md"},"ev_d285e8eb9bac3c4d0adcaeea":{"id":"ev_d285e8eb9bac3c4d0adcaeea","source_id":"src_ee8944e459eefc50bd1ed7fc","source_kind":"maintenance","title":"MNT-0297-032","path":"assets/WELL-0297/maintenance.jsonl"},"src_5dbd3183538cc5bfbc4179a8":{"id":"src_5dbd3183538cc5bfbc4179a8","source_id":"src_5dbd3183538cc5bfbc4179a8","source_kind":"report","title":"assets/WELL-0297/maintenance-reports/MNT-0297-032.md","path":"assets/WELL-0297/maintenance-reports/MNT-0297-032.md"},"ev_faa01d789a496ba31dda91ea":{"id":"ev_faa01d789a496ba31dda91ea","source_id":"src_ea8ba654289859ae2506417a","source_kind":"maintenance","title":"MNT-0136-032","path":"assets/WELL-0136/maintenance.jsonl"},"src_ef59c634ba9e8af4a0124bde":{"id":"src_ef59c634ba9e8af4a0124bde","source_id":"src_ef59c634ba9e8af4a0124bde","source_kind":"report","title":"assets/WELL-0136/maintenance-reports/MNT-0136-032.md","path":"assets/WELL-0136/maintenance-reports/MNT-0136-032.md"},"ev_55cac16a6b70f8cf4ef5c7c2":{"id":"ev_55cac16a6b70f8cf4ef5c7c2","source_id":"src_1f81150c6e2b66acd3d16614","source_kind":"maintenance","title":"MNT-0109-023","path":"assets/WELL-0109/maintenance.jsonl"},"src_a1b5396affe3160ce3d4d59b":{"id":"src_a1b5396affe3160ce3d4d59b","source_id":"src_a1b5396affe3160ce3d4d59b","source_kind":"report","title":"assets/WELL-0109/maintenance-reports/MNT-0109-023.md","path":"assets/WELL-0109/maintenance-reports/MNT-0109-023.md"},"ev_c263be7c32c0ed79e52141ad":{"id":"ev_c263be7c32c0ed79e52141ad","source_id":"src_10e5d4504be4f9fe45194593","source_kind":"maintenance","title":"MNT-0285-025","path":"assets/WELL-0285/maintenance.jsonl"},"src_5efdb6a9d2077d8bfff9af92":{"id":"src_5efdb6a9d2077d8bfff9af92","source_id":"src_5efdb6a9d2077d8bfff9af92","source_kind":"report","title":"assets/WELL-0285/maintenance-reports/MNT-0285-025.md","path":"assets/WELL-0285/maintenance-reports/MNT-0285-025.md"},"result_0aabf661a35f489d8b49aadebf8af716":{"id":"result_0aabf661a35f489d8b49aadebf8af716","source_id":"result_0aabf661a35f489d8b49aadebf8af716","source_kind":"aggregate_lineage","title":"result_0aabf661a35f489d8b49aadebf8af716"},"ev_5d49e4b0bd365b4a43ab3b4c":{"id":"ev_5d49e4b0bd365b4a43ab3b4c","source_id":"src_f1e720767b8b7372f0d2a622","source_kind":"maintenance","title":"MNT-0143-020","path":"assets/WELL-0143/maintenance.jsonl"},"src_5e713a8be83b7f6c4eb2e0f0":{"id":"src_5e713a8be83b7f6c4eb2e0f0","source_id":"src_5e713a8be83b7f6c4eb2e0f0","source_kind":"report","title":"assets/WELL-0143/maintenance-reports/MNT-0143-020.md","path":"assets/WELL-0143/maintenance-reports/MNT-0143-020.md"},"ev_4a4e3c272861a3e12b016fb8":{"id":"ev_4a4e3c272861a3e12b016fb8","source_id":"src_519bbfe83fa9b4b1dc12b799","source_kind":"maintenance","title":"MNT-0108-026","path":"assets/WELL-0108/maintenance.jsonl"},"src_acb59962e346d7140f499c57":{"id":"src_acb59962e346d7140f499c57","source_id":"src_acb59962e346d7140f499c57","source_kind":"report","title":"assets/WELL-0108/maintenance-reports/MNT-0108-026.md","path":"assets/WELL-0108/maintenance-reports/MNT-0108-026.md"},"ev_246f04d55e9d8d864c37a5de":{"id":"ev_246f04d55e9d8d864c37a5de","source_id":"src_e745c87568071ecf05ac8672","source_kind":"maintenance","title":"MNT-0273-015","path":"assets/WELL-0273/maintenance.jsonl"},"src_3166a5c8ad974f47d2b89518":{"id":"src_3166a5c8ad974f47d2b89518","source_id":"src_3166a5c8ad974f47d2b89518","source_kind":"report","title":"assets/WELL-0273/maintenance-reports/MNT-0273-015.md","path":"assets/WELL-0273/maintenance-reports/MNT-0273-015.md"},"ev_f9dbfd86dc84cc15c82de82c":{"id":"ev_f9dbfd86dc84cc15c82de82c","source_id":"src_642528becdb1155997588999","source_kind":"maintenance","title":"MNT-0115-034","path":"assets/WELL-0115/maintenance.jsonl"},"src_f2c4c81f93cbe3f1f03c447f":{"id":"src_f2c4c81f93cbe3f1f03c447f","source_id":"src_f2c4c81f93cbe3f1f03c447f","source_kind":"report","title":"assets/WELL-0115/maintenance-reports/MNT-0115-034.md","path":"assets/WELL-0115/maintenance-reports/MNT-0115-034.md"},"ev_38cf34fd822a011ee83b51cd":{"id":"ev_38cf34fd822a011ee83b51cd","source_id":"src_2afe1c7d037b7c60db02e37c","source_kind":"maintenance","title":"MNT-0107-028","path":"assets/WELL-0107/maintenance.jsonl"},"src_e566716b609bc7452f89422b":{"id":"src_e566716b609bc7452f89422b","source_id":"src_e566716b609bc7452f89422b","source_kind":"report","title":"assets/WELL-0107/maintenance-reports/MNT-0107-028.md","path":"assets/WELL-0107/maintenance-reports/MNT-0107-028.md"},"ev_597f6c7240b563e9f7ea5e08":{"id":"ev_597f6c7240b563e9f7ea5e08","source_id":"src_f0e500c67eb68c0551ff92a2","source_kind":"maintenance","title":"MNT-0112-028","path":"assets/WELL-0112/maintenance.jsonl"},"src_35e9b0868f6b0b12357a7c18":{"id":"src_35e9b0868f6b0b12357a7c18","source_id":"src_35e9b0868f6b0b12357a7c18","source_kind":"report","title":"assets/WELL-0112/maintenance-reports/MNT-0112-028.md","path":"assets/WELL-0112/maintenance-reports/MNT-0112-028.md"},"ev_b989fe63d58ee048c5fa8fba":{"id":"ev_b989fe63d58ee048c5fa8fba","source_id":"src_7f736420cf0c75a017a54166","source_kind":"maintenance","title":"MNT-0135-031","path":"assets/WELL-0135/maintenance.jsonl"},"src_de75290fe3defb8b7481cb69":{"id":"src_de75290fe3defb8b7481cb69","source_id":"src_de75290fe3defb8b7481cb69","source_kind":"report","title":"assets/WELL-0135/maintenance-reports/MNT-0135-031.md","path":"assets/WELL-0135/maintenance-reports/MNT-0135-031.md"},"ev_8b12bcd41cd74d457c1fbf0a":{"id":"ev_8b12bcd41cd74d457c1fbf0a","source_id":"src_6720fae76d8f93da0b0a5a02","source_kind":"maintenance","title":"MNT-0269-026","path":"assets/WELL-0269/maintenance.jsonl"},"src_be7e1f354f071be95bec0d52":{"id":"src_be7e1f354f071be95bec0d52","source_id":"src_be7e1f354f071be95bec0d52","source_kind":"report","title":"assets/WELL-0269/maintenance-reports/MNT-0269-026.md","path":"assets/WELL-0269/maintenance-reports/MNT-0269-026.md"},"ev_d0e8506e4d68236ffc8f0476":{"id":"ev_d0e8506e4d68236ffc8f0476","source_id":"src_5be046a40d2ba001684ddb0e","source_kind":"maintenance","title":"MNT-0114-025","path":"assets/WELL-0114/maintenance.jsonl"},"src_83f365a56e9c1fbb7a06ed8e":{"id":"src_83f365a56e9c1fbb7a06ed8e","source_id":"src_83f365a56e9c1fbb7a06ed8e","source_kind":"report","title":"assets/WELL-0114/maintenance-reports/MNT-0114-025.md","path":"assets/WELL-0114/maintenance-reports/MNT-0114-025.md"},"ev_32bd2fe493e981bef85e52aa":{"id":"ev_32bd2fe493e981bef85e52aa","source_id":"src_642528becdb1155997588999","source_kind":"maintenance","title":"MNT-0115-037",

```
"path":"assets/WELL-0115/maintenance.jsonl"},"src_0a4b718b8b9254d9558828ee":{"id":"src_0a4b718b8b9254d9558828ee","sour
ce_id":"src_0a4b718b8b9254d9558828ee","source_kind":"report","title":"assets/WELL-0115/maintenance-reports/MNT-0115-03
7.md","path":"assets/WELL-0115/maintenance-reports/MNT-0115-037.md"},"ev_64e9a9f9066b651ba1d929a6":{"id":"ev_64e9a9f90
66b651ba1d929a6","source_id":"src_c996f6635227bc6b441855b0","source_kind":"maintenance","title":"MNT-0265-026","path":
"assets/WELL-0265/maintenance.jsonl"},"src_1ab2ee721f434e2623614bf4":{"id":"src_1ab2ee721f434e2623614bf4","source_id":
"src_1ab2ee721f434e2623614bf4","source_kind":"report","title":"assets/WELL-0265/maintenance-reports/MNT-0265-026.md","
path":"assets/WELL-0265/maintenance-reports/MNT-0265-026.md"},"ev_823b28c50a9e4dce3d93627c":{"id":"ev_823b28c50a9e4dce
3d93627c","source_id":"src_efd4f663efcd5d358169febc","source_kind":"maintenance","title":"MNT-0281-022","path":"assets
/WELL-0281/maintenance.jsonl"},"src_d020101b9497ab9058c41e1b":{"id":"src_d020101b9497ab9058c41e1b","source_id":"src_d0
20101b9497ab9058c41e1b","source_kind":"report","title":"assets/WELL-0281/maintenance-reports/MNT-0281-022.md","path":"
assets/WELL-0281/maintenance-reports/MNT-0281-022.md"},"ev_9bac58e3cf404fd34d51330a":{"id":"ev_9bac58e3cf404fd34d51330
a","source_id":"src_171f1c80ce94550785ebdc5c","source_kind":"maintenance","title":"MNT-0102-027","path":"assets/WELL-0
102/maintenance.jsonl"},"src_6b6735870bf3c86edfbc7e8d":{"id":"src_6b6735870bf3c86edfbc7e8d","source_id":"src_6b6735870
bf3c86edfbc7e8d","source_kind":"report","title":"assets/WELL-0102/maintenance-reports/MNT-0102-027.md","path":"assets/
WELL-0102/maintenance-reports/MNT-0102-027.md"},"ev_5ab5d6d8be2ed2d4390f16ab":{"id":"ev_5ab5d6d8be2ed2d4390f16ab","sou
rce_id":"src_0de74508e2576db4c0f38c80","source_kind":"maintenance","title":"MNT-0122-026","path":"assets/WELL-0122/mai
ntenance.jsonl"},"src_2b95b270c5f871c1751b8fda":{"id":"src_2b95b270c5f871c1751b8fda","source_id":"src_2b95b270c5f871c1
751b8fda","source_kind":"report","title":"assets/WELL-0122/maintenance-reports/MNT-0122-026.md","path":"assets/WELL-01
22/maintenance-reports/MNT-0122-026.md"},"ev_17bf65ede78cfe98248110f1":{"id":"ev_17bf65ede78cfe98248110f1","source_id"
:"src_d7700423aeda4cb6bc1f6f06","source_kind":"maintenance","title":"MNT-0128-031","path":"assets/WELL-0128/maintenanc
e.jsonl"},"src_940a918d6c37c5faea466917":{"id":"src_940a918d6c37c5faea466917","source_id":"src_940a918d6c37c5faea46691
7","source_kind":"report","title":"assets/WELL-0128/maintenance-reports/MNT-0128-031.md","path":"assets/WELL-0128/main
tenance-reports/MNT-0128-031.md"},"ev_4109ca41577a26070553acb0":{"id":"ev_4109ca41577a26070553acb0","source_id":"src_e
a8ba654289859ae2506417a","source_kind":"maintenance","title":"MNT-0136-028","path":"assets/WELL-0136/maintenance.jsonl
"},"src_0fecba4e1f4889072c15f432":{"id":"src_0fecba4e1f4889072c15f432","source_id":"src_0fecba4e1f4889072c15f432","sou
rce_kind":"report","title":"assets/WELL-0136/maintenance-reports/MNT-0136-028.md","path":"assets/WELL-0136/maintenance
-reports/MNT-0136-028.md"},"ev_c1e0d846e48fae323187f6dc":{"id":"ev_c1e0d846e48fae323187f6dc","source_id":"src_6ce147e3
9f35c85d387ac930","source_kind":"maintenance","title":"MNT-0133-020","path":"assets/WELL-0133/maintenance.jsonl"},"src
_22193c4a1ba5d3584470851d":{"id":"src_22193c4a1ba5d3584470851d","source_id":"src_22193c4a1ba5d3584470851d","source_kin
d":"report","title":"assets/WELL-0133/maintenance-reports/MNT-0133-020.md","path":"assets/WELL-0133/maintenance-report
s/MNT-0133-020.md"},"ev_fb4d0809c0e0211d59612e97":{"id":"ev_fb4d0809c0e0211d59612e97","source_id":"src_ee8944e459eefc5
0bd1ed7fc","source_kind":"maintenance","title":"MNT-0297-028","path":"assets/WELL-0297/maintenance.jsonl"},"src_d9dedf
8fae7cd45bfdbd5780":{"id":"src_d9dedf8fae7cd45bfdbd5780","source_id":"src_d9dedf8fae7cd45bfdbd5780","source_kind":"rep
ort","title":"assets/WELL-0297/maintenance-reports/MNT-0297-028.md","path":"assets/WELL-0297/maintenance-reports/MNT-0
297-028.md"},"ev_bb4fe2a1eac6862791fe85d1":{"id":"ev_bb4fe2a1eac6862791fe85d1","source_id":"src_e5cb8746140f393f326342
22","source_kind":"maintenance","title":"MNT-0121-031","path":"assets/WELL-0121/maintenance.jsonl"},"src_7cac915585122
f3f9357c84b":{"id":"src_7cac915585122f3f9357c84b","source_id":"src_7cac915585122f3f9357c84b","source_kind":"report","t
itle":"assets/WELL-0121/maintenance-reports/MNT-0121-031.md","path":"assets/WELL-0121/maintenance-reports/MNT-0121-031
.md"},"ev_87367baf437a305661656b92":{"id":"ev_87367baf437a305661656b92","source_id":"src_3434a1b512f530a5b9040e19","so
urce_kind":"maintenance","title":"MNT-0140-025","path":"assets/WELL-0140/maintenance.jsonl"},"src_456ea44cc3a69a17defa
7da4":{"id":"src_456ea44cc3a69a17defa7da4","source_id":"src_456ea44cc3a69a17defa7da4","source_kind":"report","title":"
assets/WELL-0140/maintenance-reports/MNT-0140-025.md","path":"assets/WELL-0140/maintenance-reports/MNT-0140-025.md"},"
ev_20be90ae4c2704b12a2abf83":{"id":"ev_20be90ae4c2704b12a2abf83","source_id":"src_19d79aa697d546659c31bbcf","source_ki
nd":"maintenance","title":"MNT-0138-034","path":"assets/WELL-0138/maintenance.jsonl"},"src_a2772c87485e1332f87879ef":{
"id":"src_a2772c87485e1332f87879ef","source_id":"src_a2772c87485e1332f87879ef","source_kind":"report","title":"assets/
WELL-0138/maintenance-reports/MNT-0138-034.md","path":"assets/WELL-0138/maintenance-reports/MNT-0138-034.md"},"ev_bc0e
3c0907a7f51c1382590f":{"id":"ev_bc0e3c0907a7f51c1382590f","source_id":"src_e5cb8746140f393f32634222","source_kind":"ma
intenance","title":"MNT-0121-035","path":"assets/WELL-0121/maintenance.jsonl"},"src_30bb1a9c173d4aabe81a430e":{"id":"s
rc_30bb1a9c173d4aabe81a430e","source_id":"src_30bb1a9c173d4aabe81a430e","source_kind":"report","title":"assets/WELL-01
21/maintenance-reports/MNT-0121-035.md","path":"assets/WELL-0121/maintenance-reports/MNT-0121-035.md"},"ev_a67e7fbc251
5365023957027":{"id":"ev_a67e7fbc2515365023957027","source_id":"src_92b711d5b16befd247e10377","source_kind":"maintenan
ce","title":"MNT-0113-033","path":"assets/WELL-0113/maintenance.jsonl"},"src_cefcd50daa4baabb05cd72c8":{"id":"src_cefc
d50daa4baabb05cd72c8","source_id":"src_cefcd50daa4baabb05cd72c8","source_kind":"report","title":"assets/WELL-0113/main
tenance-reports/MNT-0113-033.md","path":"assets/WELL-0113/maintenance-reports/MNT-0113-033.md"},"ev_b36459b71b6100fe2b
8d2883":{"id":"ev_b36459b71b6100fe2b8d2883","source_id":"src_5be046a40d2ba001684ddb0e","source_kind":"maintenance","ti
tle":"MNT-0114-028","path":"assets/WELL-0114/maintenance.jsonl"},"src_2cae69979ad70b4ea2a1a443":{"id":"src_2cae69979ad
70b4ea2a1a443","source_id":"src_2cae69979ad70b4ea2a1a443","source_kind":"report","title":"assets/WELL-0114/maintenance
-reports/MNT-0114-028.md","path":"assets/WELL-0114/maintenance-reports/MNT-0114-028.md"},"ev_5d6524235008577fab9107f9"
:{"id":"ev_5d6524235008577fab9107f9","source_id":"src_acefc4a644064fba0222ff5e","source_kind":"maintenance","title":"M
NT-0289-027","path":"assets/WELL-0289/maintenance.jsonl"},"src_5660588ec921ca95827ed5e5":{"id":"src_5660588ec921ca9582
7ed5e5","source_id":"src_5660588ec921ca95827ed5e5","source_kind":"report","title":"assets/WELL-0289/maintenance-report
s/MNT-0289-027.md","path":"assets/WELL-0289/maintenance-reports/MNT-0289-027.md"},"ev_c364c25f27b15b6f06a8a738":{"id":
"ev_c364c25f27b15b6f06a8a738","source_id":"src_2ce6522dedcf571aeb591fd5","source_kind":"maintenance","title":"MNT-0116
-012","path":"assets/WELL-0116/maintenance.jsonl"},"src_bdd3394253c1debd5888ed51":{"id":"src_bdd3394253c1debd5888ed51"
,"source_id":"src_bdd3394253c1debd5888ed51","source_kind":"report","title":"assets/WELL-0116/maintenance-reports/MNT-0
116-012.md","path":"assets/WELL-0116/maintenance-reports/MNT-0116-012.md"},"ev_120d954899fb1e06770495ac":{"id":"ev_120
d954899fb1e06770495ac","source_id":"src_171f1c80ce94550785ebdc5c","source_kind":"maintenance","title":"MNT-0102-030","
path":"assets/WELL-0102/maintenance.jsonl"},"src_9a46ecedaef8cf22daa6db7a":{"id":"src_9a46ecedaef8cf22daa6db7a","sourc
e_id":"src_9a46ecedaef8cf22daa6db7a","source_kind":"report","title":"assets/WELL-0102/maintenance-reports/MNT-0102-030
.md","path":"assets/WELL-0102/maintenance-reports/MNT-0102-030.md"},"ev_3201cda35abf43e8a6392b76":{"id":"ev_3201cda35a
bf43e8a6392b76","source_id":"src_9f5c05bdb6a3c525cd139d46","source_kind":"maintenance","title":"MNT-0111-028","path":"
assets/WELL-0111/maintenance.jsonl"},"src_b90dfa2cd56f306a2a4d6e79":{"id":"src_b90dfa2cd56f306a2a4d6e79","source_id":"
src_b90dfa2cd56f306a2a4d6e79","source_kind":"report","title":"assets/WELL-0111/maintenance-reports/MNT-0111-028.md","p
ath":"assets/WELL-0111/maintenance-reports/MNT-0111-028.md"},"ev_13f1043e5ffb68a50ef639ed":{"id":"ev_13f1043e5ffb68a50
ef639ed","source_id":"src_5be046a40d2ba001684ddb0e","source_kind":"maintenance","title":"MNT-0114-023","path":"assets/
WELL-0114/maintenance.jsonl"},"src_77c466d4538a7ad5c8d91ec8":{"id":"src_77c466d4538a7ad5c8d91ec8","source_id":"src_77c
466d4538a7ad5c8d91ec8","source_kind":"report","title":"assets/WELL-0114/maintenance-reports/MNT-0114-023.md","path":"a
ssets/WELL-0114/maintenance-reports/MNT-0114-023.md"},"ev_d46104240d47e91c339889f5":{"id":"ev_d46104240d47e91c339889f5
","source_id":"src_0c5cfa878ee02402b38d7e12","source_kind":"maintenance","title":"MNT-0150-027","path":"assets/WELL-01
50/maintenance.jsonl"},"src_87176551f29fa28f4c366407":{"id":"src_87176551f29fa28f4c366407","source_id":"src_87176551f2
9fa28f4c366407","source_kind":"report","title":"assets/WELL-0150/maintenance-reports/MNT-0150-027.md","path":"assets/W
ELL-0150/maintenance-reports/MNT-0150-027.md"},"ev_4781746ae3f349424f6c7483":{"id":"ev_4781746ae3f349424f6c7483","sour
ce_id":"src_70bd6e67aadf804d12013812","source_kind":"maintenance","title":"MNT-0127-025","path":"assets/WELL-0127/main
tenance.jsonl"},"src_32bcb3f9e21f71d53d0c057b":{"id":"src_32bcb3f9e21f71d53d0c057b","source_id":"src_32bcb3f9e21f71d53
d0c057b","source_kind":"report","title":"assets/WELL-0127/maintenance-reports/MNT-0127-025.md","path":"assets/WELL-012
```

7/maintenance-reports/MNT-0127-025.md"},"ev_c230bbef94dbe0f8a65c4419":{"id":"ev_c230bbef94dbe0f8a65c4419","source_id":"src_1c586dad1268dee2ce1823be","source_kind":"maintenance","title":"MNT-0132-027","path":"assets/WELL-0132/maintenance.jsonl"},"src_7296601c4ee3dc2ee5059b40":{"id":"src_7296601c4ee3dc2ee5059b40","source_id":"src_7296601c4ee3dc2ee5059b40","source_kind":"report","title":"assets/WELL-0132/maintenance-reports/MNT-0132-027.md","path":"assets/WELL-0132/maintenance-reports/MNT-0132-027.md"},"ev_08e9ff0c339de85dfc23e3d3":{"id":"ev_08e9ff0c339de85dfc23e3d3","source_id":"src_0c5cfa878ee02402b38d7e12","source_kind":"maintenance","title":"MNT-0150-029","path":"assets/WELL-0150/maintenance.jsonl"},"src_52b1eb84ad41781aaab89455":{"id":"src_52b1eb84ad41781aaab89455","source_id":"src_52b1eb84ad41781aaab89455","source_kind":"report","title":"assets/WELL-0150/maintenance-reports/MNT-0150-029.md","path":"assets/WELL-0150/maintenance-reports/MNT-0150-029.md"},"ev_37bb6892cfd5f7b61304e929":{"id":"ev_37bb6892cfd5f7b61304e929","source_id":"src_e5cb8746140f393f32634222","source_kind":"maintenance","title":"MNT-0121-034","path":"assets/WELL-0121/maintenance.jsonl"},"src_9aa3f092818018ca2a62dea9":{"id":"src_9aa3f092818018ca2a62dea9","source_id":"src_9aa3f092818018ca2a62dea9","source_kind":"report","title":"assets/WELL-0121/maintenance-reports/MNT-0121-034.md","path":"assets/WELL-0121/maintenance-reports/MNT-0121-034.md"},"ev_c92e33eb8668840472cdabef":{"id":"ev_c92e33eb8668840472cdabef","source_id":"src_a6f964e811b84e4609e52a64","source_kind":"maintenance","title":"MNT-0103-031","path":"assets/WELL-0103/maintenance.jsonl"},"src_05e2fccb84eea8614919fd46":{"id":"src_05e2fccb84eea8614919fd46","source_id":"src_05e2fccb84eea8614919fd46","source_kind":"report","title":"assets/WELL-0103/maintenance-reports/MNT-0103-031.md","path":"assets/WELL-0103/maintenance-reports/MNT-0103-031.md"},"ev_c3d0cd6fbf7a3b8546fdc24d":{"id":"ev_c3d0cd6fbf7a3b8546fdc24d","source_id":"src_d1c022192100f23a32913193","source_kind":"maintenance","title":"MNT-0110-030","path":"assets/WELL-0110/maintenance.jsonl"},"src_70bdb2deea2a83dc945aa2c1":{"id":"src_70bdb2deea2a83dc945aa2c1","source_id":"src_70bdb2deea2a83dc945aa2c1","source_kind":"report","title":"assets/WELL-0110/maintenance-reports/MNT-0110-030.md","path":"assets/WELL-0110/maintenance-reports/MNT-0110-030.md"},"ev_3f2d1707159392b0b3a48279":{"id":"ev_3f2d1707159392b0b3a48279","source_id":"src_b1351843c4a46cd6eadf122e","source_kind":"maintenance","title":"MNT-0253-029","path":"assets/WELL-0253/maintenance.jsonl"},"src_b8664dd05f5560604511d8f2":{"id":"src_b8664dd05f5560604511d8f2","source_id":"src_b8664dd05f5560604511d8f2","source_kind":"report","title":"assets/WELL-0253/maintenance-reports/MNT-0253-029.md","path":"assets/WELL-0253/maintenance-reports/MNT-0253-029.md"},"ev_33a8f3aa5e06d648d7da2670":{"id":"ev_33a8f3aa5e06d648d7da2670","source_id":"src_1ab23fc41585331ae3e9cbdb","source_kind":"maintenance","title":"MNT-0149-029","path":"assets/WELL-0149/maintenance.jsonl"},"src_d53f0d2449e6d2af61ddb6aa":{"id":"src_d53f0d2449e6d2af61ddb6aa","source_id":"src_d53f0d2449e6d2af61ddb6aa","source_kind":"report","title":"assets/WELL-0149/maintenance-reports/MNT-0149-029.md","path":"assets/WELL-0149/maintenance-reports/MNT-0149-029.md"},"ev_5c0ecbd9eb01367767797947":{"id":"ev_5c0ecbd9eb01367767797947","source_id":"src_2ce6522dedcf571aeb591fd5","source_kind":"maintenance","title":"MNT-0116-016","path":"assets/WELL-0116/maintenance.jsonl"},"src_918e0a278c42ad16edb795a7":{"id":"src_918e0a278c42ad16edb795a7","source_id":"src_918e0a278c42ad16edb795a7","source_kind":"report","title":"assets/WELL-0116/maintenance-reports/MNT-0116-016.md","path":"assets/WELL-0116/maintenance-reports/MNT-0116-016.md"},"ev_1e9e206ab1dbb18c5e0df650":{"id":"ev_1e9e206ab1dbb18c5e0df650","source_id":"src_88a5ee8a2c89907169279778","source_kind":"maintenance","title":"MNT-0199-025","path":"assets/WELL-0199/maintenance.jsonl"},"src_e3d7723a6ce7a7197b033658":{"id":"src_e3d7723a6ce7a7197b033658","source_id":"src_e3d7723a6ce7a7197b033658","source_kind":"report","title":"assets/WELL-0199/maintenance-reports/MNT-0199-025.md","path":"assets/WELL-0199/maintenance-reports/MNT-0199-025.md"},"ev_d95e847db7ef4f65b077e549":{"id":"ev_d95e847db7ef4f65b077e549","source_id":"src_b96f142553663170a0e98507","source_kind":"context","title":"CTX-0199-001","path":"assets/WELL-0199/context.jsonl"},"ev_b41202478cea57b04e58c1d3":{"id":"ev_b41202478cea57b04e58c1d3","source_id":"src_4832e46db0b7d8e54b107b7a","source_kind":"maintenance","title":"MNT-0159-025","path":"assets/WELL-0159/maintenance.jsonl"},"src_1fd4691bd6a427448d2e9d59":{"id":"src_1fd4691bd6a427448d2e9d59","source_id":"src_1fd4691bd6a427448d2e9d59","source_kind":"report","title":"assets/WELL-0159/maintenance-reports/MNT-0159-025.md","path":"assets/WELL-0159/maintenance-reports/MNT-0159-025.md"},"ev_a3c10ba06f5fcfbd83d5b435":{"id":"ev_a3c10ba06f5fcfbd83d5b435","source_id":"src_d92e72a5918217da86bd559c","source_kind":"maintenance","title":"MNT-0262-025","path":"assets/WELL-0262/maintenance.jsonl"},"src_6d3382c87d67797170d4be2a":{"id":"src_6d3382c87d67797170d4be2a","source_id":"src_6d3382c87d67797170d4be2a","source_kind":"report","title":"assets/WELL-0262/maintenance-reports/MNT-0262-025.md","path":"assets/WELL-0262/maintenance-reports/MNT-0262-025.md"},"ev_777a110f0a31f2cb9f98c487":{"id":"ev_777a110f0a31f2cb9f98c487","source_id":"src_9c49b2722c2e45116a44e3c0","source_kind":"maintenance","title":"MNT-0183-028","path":"assets/WELL-0183/maintenance.jsonl"},"src_6f6dd7e395f55563d06fe9d9":{"id":"src_6f6dd7e395f55563d06fe9d9","source_id":"src_6f6dd7e395f55563d06fe9d9","source_kind":"report","title":"assets/WELL-0183/maintenance-reports/MNT-0183-028.md","path":"assets/WELL-0183/maintenance-reports/MNT-0183-028.md"},"ev_9ae3bf7594ca90cd73c18ddf":{"id":"ev_9ae3bf7594ca90cd73c18ddf","source_id":"src_04719696ca2d338b02f0dc6e","source_kind":"maintenance","title":"MNT-0160-029","path":"assets/WELL-0160/maintenance.jsonl"},"src_ceccf75d8d0ab2a591bfe0dc":{"id":"src_ceccf75d8d0ab2a591bfe0dc","source_id":"src_ceccf75d8d0ab2a591bfe0dc","source_kind":"report","title":"assets/WELL-0160/maintenance-reports/MNT-0160-029.md","path":"assets/WELL-0160/maintenance-reports/MNT-0160-029.md"},"ev_57b99899c77afce397625765":{"id":"ev_57b99899c77afce397625765","source_id":"src_8b3f5fee240277a1d3680c6a","source_kind":"maintenance","title":"MNT-0187-023","path":"assets/WELL-0187/maintenance.jsonl"},"src_0435576e00028d0181636f7a":{"id":"src_0435576e00028d0181636f7a","source_id":"src_0435576e00028d0181636f7a","source_kind":"report","title":"assets/WELL-0187/maintenance-reports/MNT-0187-023.md","path":"assets/WELL-0187/maintenance-reports/MNT-0187-023.md"},"ev_aa9cb0936e1fbfafa141b70a":{"id":"ev_aa9cb0936e1fbfafa141b70a","source_id":"src_4832e46db0b7d8e54b107b7a","source_kind":"maintenance","title":"MNT-0159-029","path":"assets/WELL-0159/maintenance.jsonl"},"src_d33fe414a44a04ae8c765b41":{"id":"src_d33fe414a44a04ae8c765b41","source_id":"src_d33fe414a44a04ae8c765b41","source_kind":"report","title":"assets/WELL-0159/maintenance-reports/MNT-0159-029.md","path":"assets/WELL-0159/maintenance-reports/MNT-0159-029.md"},"ev_49dcc425cda6c59321aaae81":{"id":"ev_49dcc425cda6c59321aaae81","source_id":"src_b83c94176db4308ed36a8e92","source_kind":"maintenance","title":"MNT-0193-023","path":"assets/WELL-0193/maintenance.jsonl"},"src_c525c1f9b1918b8ee93d8db8":{"id":"src_c525c1f9b1918b8ee93d8db8","source_id":"src_c525c1f9b1918b8ee93d8db8","source_kind":"report","title":"assets/WELL-0193/maintenance-reports/MNT-0193-023.md","path":"assets/WELL-0193/maintenance-reports/MNT-0193-023.md"},"ev_b40ed25d60b3f69f4f44c38d":{"id":"ev_b40ed25d60b3f69f4f44c38d","source_id":"src_1db6470eb602f785f0f4e6b3","source_kind":"maintenance","title":"MNT-0172-028","path":"assets/WELL-0172/maintenance.jsonl"},"src_33d8a0ba09acc099833629a3":{"id":"src_33d8a0ba09acc099833629a3","source_id":"src_33d8a0ba09acc099833629a3","source_kind":"report","title":"assets/WELL-0172/maintenance-reports/MNT-0172-028.md","path":"assets/WELL-0172/maintenance-reports/MNT-0172-028.md"},"ev_88a16e748ca89f656a0211dd":{"id":"ev_88a16e748ca89f656a0211dd","source_id":"src_3d6ba6c305d2866279e53a30","source_kind":"maintenance","title":"MNT-0166-029","path":"assets/WELL-0166/maintenance.jsonl"},"src_b4daf31bd0b5fdf7c7c9b0c6":{"id":"src_b4daf31bd0b5fdf7c7c9b0c6","source_id":"src_b4daf31bd0b5fdf7c7c9b0c6","source_kind":"report","title":"assets/WELL-0166/maintenance-reports/MNT-0166-029.md","path":"assets/WELL-0166/maintenance-reports/MNT-0166-029.md"},"ev_fc93cba46783eec69dffb6b3":{"id":"ev_fc93cba46783eec69dffb6b3","source_id":"src_09a9f5ccca0776e9ea11ccdb","source_kind":"maintenance","title":"MNT-0170-032","path":"assets/WELL-0170/maintenance.jsonl"},"src_7dfecef10cf0b55f3da60f2c":{"id":"src_7dfecef10cf0b55f3da60f2c","source_id":"src_7dfecef10cf0b55f3da60f2c","source_kind":"report","title":"assets/WELL-0170/maintenance-reports/MNT-0170-032.md","path":"assets/WELL-0170/maintenance-reports/MNT-0170-032.md"},"ev_382a3e0a3720efa5dc4f6ac7":{"id":"ev_382a3e0a3720efa5dc4f6ac7","source_id":"src_8901fcd304023786489d9b5c","source_kind":"maintenance","title":"MNT-0164-029","path":"assets/WELL-0164/maintenance.jsonl"},"src_8273b2cb5b8f51273109904f":{"id":"src_8273b2cb5b8f51273109904f","source_id":"src_8273b2cb5b8f51273109904f","source_kind":"report","title":"assets/WELL-0164/maintenance-reports/MNT-0164-029.md","path":"assets/WELL-0164/maintenance-reports/MNT-0164-029.md"},"ev_5c24079e1b72c76fae392ea4":{"id":"ev_5c24079e1b72c76fae392ea4","source_id":"src_91a7d3d6389ed7b93790a665","source_kind":"maintenance","title":"MNT-0169-025","path":"assets/WELL-0169/maintenance.jsonl"},"src_6ef14a4706c717bdb13465df":{"id":"src_6ef14a4706c717bdb13465df","source_id":"src_6ef14a4706c717bdb13465df","source_kind":"report","title":"assets/WELL-0169/maintenance-reports/MNT-0169-025.md","path":"assets/WELL-0169/maintenance-reports/MNT-0169-025.md"},"ev_159c30882bada3f98ce2824a

```
":{"id":"ev_159c30882bada3f98ce2824a","source_id":"src_b543f218210f372ccd9ca87b","source_kind":"maintenance","title":"
MNT-0180-031","path":"assets/WELL-0180/maintenance.jsonl"},"src_bd484d6ee8f15f43223f8635":{"id":"src_bd484d6ee8f15f432
23f8635","source_id":"src_bd484d6ee8f15f43223f8635","source_kind":"report","title":"assets/WELL-0180/maintenance-repor
ts/MNT-0180-031.md","path":"assets/WELL-0180/maintenance-reports/MNT-0180-031.md"},"ev_fa0aaa2ec71c0c14e8f60dc0":{"id"
:"ev_fa0aaa2ec71c0c14e8f60dc0","source_id":"src_4832e46db0b7d8e54b107b7a","source_kind":"maintenance","title":"MNT-015
9-031","path":"assets/WELL-0159/maintenance.jsonl"},"src_87489bf70b7ed4ff72841d19":{"id":"src_87489bf70b7ed4ff72841d19
","source_id":"src_87489bf70b7ed4ff72841d19","source_kind":"report","title":"assets/WELL-0159/maintenance-reports/MNT-
0159-031.md","path":"assets/WELL-0159/maintenance-reports/MNT-0159-031.md"},"ev_769a3293372426a31595bef6":{"id":"ev_76
9a3293372426a31595bef6","source_id":"src_88a5ee8a2c89907169279778","source_kind":"maintenance","title":"MNT-0199-033",
"path":"assets/WELL-0199/maintenance.jsonl"},"src_a9a0143305e29a01695caf7d":{"id":"src_a9a0143305e29a01695caf7d","sour
ce_id":"src_a9a0143305e29a01695caf7d","source_kind":"report","title":"assets/WELL-0199/maintenance-reports/MNT-0199-03
3.md","path":"assets/WELL-0199/maintenance-reports/MNT-0199-033.md"},"ev_1abe812ef5baa0633cb00473":{"id":"ev_1abe812ef
5baa0633cb00473","source_id":"src_0a311a795c629c1728f778d7","source_kind":"maintenance","title":"MNT-0181-022","path":
"assets/WELL-0181/maintenance.jsonl"},"src_2191363b8faf2ba84c445111":{"id":"src_2191363b8faf2ba84c445111","source_id":
"src_2191363b8faf2ba84c445111","source_kind":"report","title":"assets/WELL-0181/maintenance-reports/MNT-0181-022.md","
path":"assets/WELL-0181/maintenance-reports/MNT-0181-022.md"},"ev_0542aa88c296392a62e89829":{"id":"ev_0542aa88c296392a
62e89829","source_id":"src_d92e72a5918217da86bd559c","source_kind":"maintenance","title":"MNT-0262-022","path":"assets
/WELL-0262/maintenance.jsonl"},"src_60403b91b7eb3861e38ba03c":{"id":"src_60403b91b7eb3861e38ba03c","source_id":"src_60
403b91b7eb3861e38ba03c","source_kind":"report","title":"assets/WELL-0262/maintenance-reports/MNT-0262-022.md","path":"
assets/WELL-0262/maintenance-reports/MNT-0262-022.md"},"ev_48929b7c3a08b2d4c99229e0":{"id":"ev_48929b7c3a08b2d4c99229e
0","source_id":"src_129abc12bcdcc8560031f5e0","source_kind":"maintenance","title":"MNT-0294-027","path":"assets/WELL-0
294/maintenance.jsonl"},"src_6b57ec30d346f3458f77cb4a":{"id":"src_6b57ec30d346f3458f77cb4a","source_id":"src_6b57ec30d
346f3458f77cb4a","source_kind":"report","title":"assets/WELL-0294/maintenance-reports/MNT-0294-027.md","path":"assets/
WELL-0294/maintenance-reports/MNT-0294-027.md"},"ev_a389ca454789604b93776d29":{"id":"ev_a389ca454789604b93776d29","sou
rce_id":"src_44c96d7c85618191619355e8","source_kind":"maintenance","title":"MNT-0258-027","path":"assets/WELL-0258/mai
ntenance.jsonl"},"src_58dc08a78e2d3458a4c6ced4":{"id":"src_58dc08a78e2d3458a4c6ced4","source_id":"src_58dc08a78e2d3458
a4c6ced4","source_kind":"report","title":"assets/WELL-0258/maintenance-reports/MNT-0258-027.md","path":"assets/WELL-02
58/maintenance-reports/MNT-0258-027.md"},"ev_25db70c890f8436753b0b456":{"id":"ev_25db70c890f8436753b0b456","source_id"
:"src_895bd90fd88445ed1e145c6a","source_kind":"maintenance","title":"MNT-0298-027","path":"assets/WELL-0298/maintenanc
e.jsonl"},"src_cbb5f2cd32f5026bd60a19ac":{"id":"src_cbb5f2cd32f5026bd60a19ac","source_id":"src_cbb5f2cd32f5026bd60a19a
c","source_kind":"report","title":"assets/WELL-0298/maintenance-reports/MNT-0298-027.md","path":"assets/WELL-0298/main
tenance-reports/MNT-0298-027.md"},"ev_c8516d92098f2ed3ff41a435":{"id":"ev_c8516d92098f2ed3ff41a435","source_id":"src_f
ef4282463791272bd034cf6","source_kind":"maintenance","title":"MNT-0182-023","path":"assets/WELL-0182/maintenance.jsonl
"},"src_ebc87de2328b1ce5c1b3daf2":{"id":"src_ebc87de2328b1ce5c1b3daf2","source_id":"src_ebc87de2328b1ce5c1b3daf2","sou
rce_kind":"report","title":"assets/WELL-0182/maintenance-reports/MNT-0182-023.md","path":"assets/WELL-0182/maintenance
-reports/MNT-0182-023.md"},"ev_249fc8e9095f7023247bd5f4":{"id":"ev_249fc8e9095f7023247bd5f4","source_id":"src_45814726
fbc026cea45f8f67","source_kind":"maintenance","title":"MNT-0156-024","path":"assets/WELL-0156/maintenance.jsonl"},"src
_b6402f846521e4094cf9ef55":{"id":"src_b6402f846521e4094cf9ef55","source_id":"src_b6402f846521e4094cf9ef55","source_kin
d":"report","title":"assets/WELL-0156/maintenance-reports/MNT-0156-024.md","path":"assets/WELL-0156/maintenance-report
s/MNT-0156-024.md"},"ev_71a2a910d0f6dcb54d7fd250":{"id":"ev_71a2a910d0f6dcb54d7fd250","source_id":"src_8901fcd30402378
6489d9b5c","source_kind":"maintenance","title":"MNT-0164-024","path":"assets/WELL-0164/maintenance.jsonl"},"src_166701
3d137eb4f77019d15c":{"id":"src_1667013d137eb4f77019d15c","source_id":"src_1667013d137eb4f77019d15c","source_kind":"rep
ort","title":"assets/WELL-0164/maintenance-reports/MNT-0164-024.md","path":"assets/WELL-0164/maintenance-reports/MNT-0
164-024.md"},"ev_c64bac651550cdd3bd04b094":{"id":"ev_c64bac651550cdd3bd04b094","source_id":"src_baa0d3390bcb91cb1e035f
39","source_kind":"maintenance","title":"MNT-0189-030","path":"assets/WELL-0189/maintenance.jsonl"},"src_a36bbf80feee0
b8312569992":{"id":"src_a36bbf80feee0b8312569992","source_id":"src_a36bbf80feee0b8312569992","source_kind":"report","t
itle":"assets/WELL-0189/maintenance-reports/MNT-0189-030.md","path":"assets/WELL-0189/maintenance-reports/MNT-0189-030
.md"},"ev_cf3ebe9a223e5c0560dcd16b":{"id":"ev_cf3ebe9a223e5c0560dcd16b","source_id":"src_b097b12459d99f6a90b66cb4","so
urce_kind":"maintenance","title":"MNT-0270-025","path":"assets/WELL-0270/maintenance.jsonl"},"src_95648af512e2b3180d3c
d7d0":{"id":"src_95648af512e2b3180d3cd7d0","source_id":"src_95648af512e2b3180d3cd7d0","source_kind":"report","title":"
assets/WELL-0270/maintenance-reports/MNT-0270-025.md","path":"assets/WELL-0270/maintenance-reports/MNT-0270-025.md"},"
ev_59f128df06f9a811fd7bdfd0":{"id":"ev_59f128df06f9a811fd7bdfd0","source_id":"src_256653958ef690093a80d1d0","source_ki
nd":"maintenance","title":"MNT-0286-023","path":"assets/WELL-0286/maintenance.jsonl"},"src_f3b0eb03161dfb5b8733e723":{
"id":"src_f3b0eb03161dfb5b8733e723","source_id":"src_f3b0eb03161dfb5b8733e723","source_kind":"report","title":"assets/
WELL-0286/maintenance-reports/MNT-0286-023.md","path":"assets/WELL-0286/maintenance-reports/MNT-0286-023.md"},"ev_f2bd
bfdca699fb0cd09345c6":{"id":"ev_f2bdbfdca699fb0cd09345c6","source_id":"src_895bd90fd88445ed1e145c6a","source_kind":"ma
intenance","title":"MNT-0298-032","path":"assets/WELL-0298/maintenance.jsonl"},"src_c3db2137c9540b3783617b6c":{"id":"s
rc_c3db2137c9540b3783617b6c","source_id":"src_c3db2137c9540b3783617b6c","source_kind":"report","title":"assets/WELL-02
98/maintenance-reports/MNT-0298-032.md","path":"assets/WELL-0298/maintenance-reports/MNT-0298-032.md"},"ev_483f367bd26
3e447ad561641":{"id":"ev_483f367bd263e447ad561641","source_id":"src_09a9f5ccca0776e9ea11ccdb","source_kind":"maintenan
ce","title":"MNT-0170-029","path":"assets/WELL-0170/maintenance.jsonl"},"src_c4e63b4ac0524025ebfb2ab5":{"id":"src_c4e6
3b4ac0524025ebfb2ab5","source_id":"src_c4e63b4ac0524025ebfb2ab5","source_kind":"report","title":"assets/WELL-0170/main
tenance-reports/MNT-0170-029.md","path":"assets/WELL-0170/maintenance-reports/MNT-0170-029.md"},"ev_d10f9df87b761b3767
5c915f":{"id":"ev_d10f9df87b761b37675c915f","source_id":"src_94156b0c604427e2b99eaf6b","source_kind":"maintenance","ti
tle":"MNT-0179-029","path":"assets/WELL-0179/maintenance.jsonl"},"src_5d1d2e0dda25b0bf945cb110":{"id":"src_5d1d2e0dda2
5b0bf945cb110","source_id":"src_5d1d2e0dda25b0bf945cb110","source_kind":"report","title":"assets/WELL-0179/maintenance
-reports/MNT-0179-029.md","path":"assets/WELL-0179/maintenance-reports/MNT-0179-029.md"},"ev_7678c59d3e0df41f98551fdb"
:{"id":"ev_7678c59d3e0df41f98551fdb","source_id":"src_5f53346bab12206f4bb1ea77","source_kind":"maintenance","title":"M
NT-0188-031","path":"assets/WELL-0188/maintenance.jsonl"},"src_e7cf712d6aec485c3a840054":{"id":"src_e7cf712d6aec485c3a
840054","source_id":"src_e7cf712d6aec485c3a840054","source_kind":"report","title":"assets/WELL-0188/maintenance-report
s/MNT-0188-031.md","path":"assets/WELL-0188/maintenance-reports/MNT-0188-031.md"},"ev_7d344c8d2f3c6742911431e4":{"id":
"ev_7d344c8d2f3c6742911431e4","source_id":"src_dcbd59eaebcc7b7c0c19e2a1","source_kind":"maintenance","title":"MNT-0176
-029","path":"assets/WELL-0176/maintenance.jsonl"},"src_8085e2431d9c68a74903ec39":{"id":"src_8085e2431d9c68a74903ec39"
,"source_id":"src_8085e2431d9c68a74903ec39","source_kind":"report","title":"assets/WELL-0176/maintenance-reports/MNT-0
176-029.md","path":"assets/WELL-0176/maintenance-reports/MNT-0176-029.md"},"ev_407ef5d92a50190aa0336444":{"id":"ev_407
ef5d92a50190aa0336444","source_id":"src_88a5ee8a2c89907169279778","source_kind":"maintenance","title":"MNT-0199-032","
path":"assets/WELL-0199/maintenance.jsonl"},"src_802512ae586926f766efbbae":{"id":"src_802512ae586926f766efbbae","sourc
e_id":"src_802512ae586926f766efbbae","source_kind":"report","title":"assets/WELL-0199/maintenance-reports/MNT-0199-032
.md","path":"assets/WELL-0199/maintenance-reports/MNT-0199-032.md"},"ev_c297f159e5f975e5b7a067aa":{"id":"ev_c297f159e5
f975e5b7a067aa","source_id":"src_dfdac799f924852130250a82","source_kind":"maintenance","title":"MNT-0157-024","path":"
assets/WELL-0157/maintenance.jsonl"},"src_c44bc236ed8aa962341d5607":{"id":"src_c44bc236ed8aa962341d5607","source_id":"
src_c44bc236ed8aa962341d5607","source_kind":"report","title":"assets/WELL-0157/maintenance-reports/MNT-0157-024.md","p
ath":"assets/WELL-0157/maintenance-reports/MNT-0157-024.md"},"ev_f3876d159dd3b0f50406b0c5":{"id":"ev_f3876d159dd3b0f50
406b0c5","source_id":"src_fef4282463791272bd034cf6","source_kind":"maintenance","title":"MNT-0182-029","path":"assets/
WELL-0182/maintenance.jsonl"},"src_b95269d23da299ec39100c9a":{"id":"src_b95269d23da299ec39100c9a","source_id":"src_b95
```

```
269d23da299ec39100c9a","source_kind":"report","title":"assets/WELL-0182/maintenance-reports/MNT-0182-029.md","path":"a
ssets/WELL-0182/maintenance-reports/MNT-0182-029.md"},"ev_c7d2298d1eff2a008305c1b0":{"id":"ev_c7d2298d1eff2a008305c1b0
","source_id":"src_fef4282463791272bd034cf6","source_kind":"maintenance","title":"MNT-0182-021","path":"assets/WELL-01
82/maintenance.jsonl"},"src_d5287c91735cec40f379354a":{"id":"src_d5287c91735cec40f379354a","source_id":"src_d5287c9173
5cec40f379354a","source_kind":"report","title":"assets/WELL-0182/maintenance-reports/MNT-0182-021.md","path":"assets/W
ELL-0182/maintenance-reports/MNT-0182-021.md"},"ev_389c467c4c40c4385c2ded1d":{"id":"ev_389c467c4c40c4385c2ded1d","sour
ce_id":"src_14c1c104f30ada09ac061817","source_kind":"maintenance","title":"MNT-0194-031","path":"assets/WELL-0194/main
tenance.jsonl"},"src_44da26e053f9e2386a6ccf4f":{"id":"src_44da26e053f9e2386a6ccf4f","source_id":"src_44da26e053f9e2386
a6ccf4f","source_kind":"report","title":"assets/WELL-0194/maintenance-reports/MNT-0194-031.md","path":"assets/WELL-019
4/maintenance-reports/MNT-0194-031.md"},"ev_7d8b0b1ab1d1dc23152d7aa3":{"id":"ev_7d8b0b1ab1d1dc23152d7aa3","source_id":
"src_b34e41b0e785a9cba87a0d02","source_kind":"maintenance","title":"MNT-0175-028","path":"assets/WELL-0175/maintenance
.jsonl"},"src_b4af3fc20303e37877df0b98":{"id":"src_b4af3fc20303e37877df0b98","source_id":"src_b4af3fc20303e37877df0b98
","source_kind":"report","title":"assets/WELL-0175/maintenance-reports/MNT-0175-028.md","path":"assets/WELL-0175/maint
enance-reports/MNT-0175-028.md"},"ev_00efeeb27fbe5f6e267490c7":{"id":"ev_00efeeb27fbe5f6e267490c7","source_id":"src_1d
b6470eb602f785f0f4e6b3","source_kind":"maintenance","title":"MNT-0172-023","path":"assets/WELL-0172/maintenance.jsonl"
},"src_8e4eb4c18edb4cc8307fb01e":{"id":"src_8e4eb4c18edb4cc8307fb01e","source_id":"src_8e4eb4c18edb4cc8307fb01e","sour
ce_kind":"report","title":"assets/WELL-0172/maintenance-reports/MNT-0172-023.md","path":"assets/WELL-0172/maintenance-
reports/MNT-0172-023.md"},"ev_39916011011b48bee1efe70e":{"id":"ev_39916011011b48bee1efe70e","source_id":"src_895bd90fd
88445ed1e145c6a","source_kind":"maintenance","title":"MNT-0298-030","path":"assets/WELL-0298/maintenance.jsonl"},"src_
b9a0d34447dabd386714c3b3":{"id":"src_b9a0d34447dabd386714c3b3","source_id":"src_b9a0d34447dabd386714c3b3","source_kind
":"report","title":"assets/WELL-0298/maintenance-reports/MNT-0298-030.md","path":"assets/WELL-0298/maintenance-reports
/MNT-0298-030.md"},"ev_22860787175e0891de2a1ec9":{"id":"ev_22860787175e0891de2a1ec9","source_id":"src_f54b5af0fa1b838b
13f8f176","source_kind":"maintenance","title":"MNT-0278-024","path":"assets/WELL-0278/maintenance.jsonl"},"src_d16ea3a
9efd3aecabf17ddbb":{"id":"src_d16ea3a9efd3aecabf17ddbb","source_id":"src_d16ea3a9efd3aecabf17ddbb","source_kind":"repo
rt","title":"assets/WELL-0278/maintenance-reports/MNT-0278-024.md","path":"assets/WELL-0278/maintenance-reports/MNT-02
78-024.md"},"ev_70ba39d21a8e37c92f3012cf":{"id":"ev_70ba39d21a8e37c92f3012cf","source_id":"src_d589b7b0057187a7c1cf38e
f","source_kind":"maintenance","title":"MNT-0191-026","path":"assets/WELL-0191/maintenance.jsonl"},"src_a403481375fa49
2189a34f65":{"id":"src_a403481375fa492189a34f65","source_id":"src_a403481375fa492189a34f65","source_kind":"report","ti
tle":"assets/WELL-0191/maintenance-reports/MNT-0191-026.md","path":"assets/WELL-0191/maintenance-reports/MNT-0191-026.
md"},"ev_0321bae04ef6f4e8d13d5aad":{"id":"ev_0321bae04ef6f4e8d13d5aad","source_id":"src_2445897d2963a246c6df1024","sou
rce_kind":"maintenance","title":"MNT-0290-028","path":"assets/WELL-0290/maintenance.jsonl"},"src_ae657a6ba09bc8436c617
339":{"id":"src_ae657a6ba09bc8436c617339","source_id":"src_ae657a6ba09bc8436c617339","source_kind":"report","title":"a
ssets/WELL-0290/maintenance-reports/MNT-0290-028.md","path":"assets/WELL-0290/maintenance-reports/MNT-0290-028.md"},"e
v_1a05014a7a4bf8536f18bbb9":{"id":"ev_1a05014a7a4bf8536f18bbb9","source_id":"src_09a9f5ccca0776e9ea11ccdb","source_kin
d":"maintenance","title":"MNT-0170-031","path":"assets/WELL-0170/maintenance.jsonl"},"src_810675ce37fd817525a7dc73":{"
id":"src_810675ce37fd817525a7dc73","source_id":"src_810675ce37fd817525a7dc73","source_kind":"report","title":"assets/W
ELL-0170/maintenance-reports/MNT-0170-031.md","path":"assets/WELL-0170/maintenance-reports/MNT-0170-031.md"},"ev_e021d
ada0241d60717c0f385":{"id":"ev_e021dada0241d60717c0f385","source_id":"src_fef4282463791272bd034cf6","source_kind":"mai
ntenance","title":"MNT-0182-027","path":"assets/WELL-0182/maintenance.jsonl"},"src_50038fb7b136ff9c16036936":{"id":"sr
c_50038fb7b136ff9c16036936","source_id":"src_50038fb7b136ff9c16036936","source_kind":"report","title":"assets/WELL-018
2/maintenance-reports/MNT-0182-027.md","path":"assets/WELL-0182/maintenance-reports/MNT-0182-027.md"},"ev_856eaa7d72b7
b5053bb7bece":{"id":"ev_856eaa7d72b7b5053bb7bece","source_id":"src_48f765e371c2cab5084b94f1","source_kind":"maintenanc
e","title":"MNT-0200-028","path":"assets/WELL-0200/maintenance.jsonl"},"src_ecee23166ea54703aada6fd1":{"id":"src_ecee2
3166ea54703aada6fd1","source_id":"src_ecee23166ea54703aada6fd1","source_kind":"report","title":"assets/WELL-0200/maint
enance-reports/MNT-0200-028.md","path":"assets/WELL-0200/maintenance-reports/MNT-0200-028.md"},"ev_8bd28782c6ca26ea375
bbf35":{"id":"ev_8bd28782c6ca26ea375bbf35","source_id":"src_02381138712b379cda1e3eee","source_kind":"maintenance","tit
le":"MNT-0151-029","path":"assets/WELL-0151/maintenance.jsonl"},"src_6a532e3c96a142cc6a7c618b":{"id":"src_6a532e3c96a1
42cc6a7c618b","source_id":"src_6a532e3c96a142cc6a7c618b","source_kind":"report","title":"assets/WELL-0151/maintenance-
reports/MNT-0151-029.md","path":"assets/WELL-0151/maintenance-reports/MNT-0151-029.md"},"ev_ef5b46174f938ae449551da2":
{"id":"ev_ef5b46174f938ae449551da2","source_id":"src_5a567728b42340c5b6deddb6","source_kind":"maintenance","title":"MN
T-0171-024","path":"assets/WELL-0171/maintenance.jsonl"},"src_fecf9a2e143b887e76ed656c":{"id":"src_fecf9a2e143b887e76e
d656c","source_id":"src_fecf9a2e143b887e76ed656c","source_kind":"report","title":"assets/WELL-0171/maintenance-reports
/MNT-0171-024.md","path":"assets/WELL-0171/maintenance-reports/MNT-0171-024.md"},"ev_7dfbcac47288c646a426122f":{"id":"
ev_7dfbcac47288c646a426122f","source_id":"src_81ebeac3a44d7d8d2d79a87b","source_kind":"maintenance","title":"MNT-0177-
025","path":"assets/WELL-0177/maintenance.jsonl"},"src_a9bc1e1c9a37aaaa002fffe8":{"id":"src_a9bc1e1c9a37aaaa002fffe8",
"source_id":"src_a9bc1e1c9a37aaaa002fffe8","source_kind":"report","title":"assets/WELL-0177/maintenance-reports/MNT-01
77-025.md","path":"assets/WELL-0177/maintenance-reports/MNT-0177-025.md"},"ev_bf022a552e54ab5df67de5ba":{"id":"ev_bf02
2a552e54ab5df67de5ba","source_id":"src_c7e5cf83f31f3a23a2e72794","source_kind":"maintenance","title":"MNT-0178-029","p
ath":"assets/WELL-0178/maintenance.jsonl"},"src_bbf1133a7d3cfb9c2b669efe":{"id":"src_bbf1133a7d3cfb9c2b669efe","source
_id":"src_bbf1133a7d3cfb9c2b669efe","source_kind":"report","title":"assets/WELL-0178/maintenance-reports/MNT-0178-029.
md","path":"assets/WELL-0178/maintenance-reports/MNT-0178-029.md"},"ev_b07bd3cd8058ecf5c3f64fa5":{"id":"ev_b07bd3cd805
8ecf5c3f64fa5","source_id":"src_9c49b2722c2e45116a44e3c0","source_kind":"maintenance","title":"MNT-0183-026","path":"a
ssets/WELL-0183/maintenance.jsonl"},"src_d32c9bbe5d928ce40386aae2":{"id":"src_d32c9bbe5d928ce40386aae2","source_id":"s
rc_d32c9bbe5d928ce40386aae2","source_kind":"report","title":"assets/WELL-0183/maintenance-reports/MNT-0183-026.md","pa
th":"assets/WELL-0183/maintenance-reports/MNT-0183-026.md"},"ev_4cd3e68268f03d89ca407b4b":{"id":"ev_4cd3e68268f03d89ca
407b4b","source_id":"src_09a9f5ccca0776e9ea11ccdb","source_kind":"maintenance","title":"MNT-0170-026","path":"assets/W
ELL-0170/maintenance.jsonl"},"src_cee69fd3b50a6d5d3f53b9f9":{"id":"src_cee69fd3b50a6d5d3f53b9f9","source_id":"src_cee6
9fd3b50a6d5d3f53b9f9","source_kind":"report","title":"assets/WELL-0170/maintenance-reports/MNT-0170-026.md","path":"as
sets/WELL-0170/maintenance-reports/MNT-0170-026.md"},"ev_856fb8ce4a11ceca4ec9d283":{"id":"ev_856fb8ce4a11ceca4ec9d283"
,"source_id":"src_d1cc10d3bd01df656946372d","source_kind":"maintenance","title":"MNT-0196-029","path":"assets/WELL-019
6/maintenance.jsonl"},"src_a18042c67eaeda08211d0529":{"id":"src_a18042c67eaeda08211d0529","source_id":"src_a18042c67ea
eda08211d0529","source_kind":"report","title":"assets/WELL-0196/maintenance-reports/MNT-0196-029.md","path":"assets/WE
LL-0196/maintenance-reports/MNT-0196-029.md"},"ev_c41a86b9596408eb28c3e68d":{"id":"ev_c41a86b9596408eb28c3e68d","sourc
e_id":"src_5a567728b42340c5b6deddb6","source_kind":"maintenance","title":"MNT-0171-021","path":"assets/WELL-0171/maint
enance.jsonl"},"src_770e8df60427c1f112a5bc2f":{"id":"src_770e8df60427c1f112a5bc2f","source_id":"src_770e8df60427c1f112
a5bc2f","source_kind":"report","title":"assets/WELL-0171/maintenance-reports/MNT-0171-021.md","path":"assets/WELL-0171
/maintenance-reports/MNT-0171-021.md"},"ev_a25ea0c0468a862e2a29a5e7":{"id":"ev_a25ea0c0468a862e2a29a5e7","source_id":"
src_b34e41b0e785a9cba87a0d02","source_kind":"maintenance","title":"MNT-0175-031","path":"assets/WELL-0175/maintenance.
jsonl"},"src_2a62e7f1ddc6e621e23d7c48":{"id":"src_2a62e7f1ddc6e621e23d7c48","source_id":"src_2a62e7f1ddc6e621e23d7c48"
,"source_kind":"report","title":"assets/WELL-0175/maintenance-reports/MNT-0175-031.md","path":"assets/WELL-0175/mainte
nance-reports/MNT-0175-031.md"},"ev_99d89bfd759e9a3a3c3ce19e":{"id":"ev_99d89bfd759e9a3a3c3ce19e","source_id":"src_b6b
723041fb96e72dc740677","source_kind":"maintenance","title":"MNT-0173-026","path":"assets/WELL-0173/maintenance.jsonl"}
,"src_6b28592a32b3e5828ce657a3":{"id":"src_6b28592a32b3e5828ce657a3","source_id":"src_6b28592a32b3e5828ce657a3","sourc
e_kind":"report","title":"assets/WELL-0173/maintenance-reports/MNT-0173-026.md","path":"assets/WELL-0173/maintenance-r
eports/MNT-0173-026.md"},"ev_a9a87d8747c66b0a16d021b3":{"id":"ev_a9a87d8747c66b0a16d021b3","source_id":"src_dde5454e35
```

a84a114c99c90c","source_kind":"maintenance","title":"MNT-0174-028","path":"assets/WELL-0174/maintenance.jsonl"},"src_e6a75ee490309408595743df":{"id":"src_e6a75ee490309408595743df","source_id":"src_e6a75ee490309408595743df","source_kind":"report","title":"assets/WELL-0174/maintenance-reports/MNT-0174-028.md","path":"assets/WELL-0174/maintenance-reports/MNT-0174-028.md"},"ev_e729375f7b9e7224307a9033":{"id":"ev_e729375f7b9e7224307a9033","source_id":"src_a3133a3d337daf8f74957958","source_kind":"maintenance","title":"MNT-0154-029","path":"assets/WELL-0154/maintenance.jsonl"},"src_3c76f2cc9d4455f1ff49f7f1":{"id":"src_3c76f2cc9d4455f1ff49f7f1","source_id":"src_3c76f2cc9d4455f1ff49f7f1","source_kind":"report","title":"assets/WELL-0154/maintenance-reports/MNT-0154-029.md","path":"assets/WELL-0154/maintenance-reports/MNT-0154-029.md"},"ev_9f86575de1395199f9d8d897":{"id":"ev_9f86575de1395199f9d8d897","source_id":"src_baa0d3390bcb91cb1e035f39","source_kind":"maintenance","title":"MNT-0189-033","path":"assets/WELL-0189/maintenance.jsonl"},"src_bbb1b153debd672cfad13e55":{"id":"src_bbb1b153debd672cfad13e55","source_id":"src_bbb1b153debd672cfad13e55","source_kind":"report","title":"assets/WELL-0189/maintenance-reports/MNT-0189-033.md","path":"assets/WELL-0189/maintenance-reports/MNT-0189-033.md"},"ev_5ac3494ef1e6cfe28378272c":{"id":"ev_5ac3494ef1e6cfe28378272c","source_id":"src_9cdb99021268e74e3722930f","source_kind":"maintenance","title":"MNT-0195-029","path":"assets/WELL-0195/maintenance.jsonl"},"src_027366ecb348d48ec7169731":{"id":"src_027366ecb348d48ec7169731","source_id":"src_027366ecb348d48ec7169731","source_kind":"report","title":"assets/WELL-0195/maintenance-reports/MNT-0195-029.md","path":"assets/WELL-0195/maintenance-reports/MNT-0195-029.md"},"ev_2573e9da0e7ff3230a268439":{"id":"ev_2573e9da0e7ff3230a268439","source_id":"src_0b56e23ca62bc8b3c46b5642","source_kind":"maintenance","title":"MNT-0190-028","path":"assets/WELL-0190/maintenance.jsonl"},"src_9dbdaffe31a7c9b8c3785baf":{"id":"src_9dbdaffe31a7c9b8c3785baf","source_id":"src_9dbdaffe31a7c9b8c3785baf","source_kind":"report","title":"assets/WELL-0190/maintenance-reports/MNT-0190-028.md","path":"assets/WELL-0190/maintenance-reports/MNT-0190-028.md"},"ev_80a2d28b236e4715859d75bf":{"id":"ev_80a2d28b236e4715859d75bf","source_id":"src_256653958ef690093a80d1d0","source_kind":"maintenance","title":"MNT-0286-026","path":"assets/WELL-0286/maintenance.jsonl"},"src_4fb49e27f2bb6e16bae5613e":{"id":"src_4fb49e27f2bb6e16bae5613e","source_id":"src_4fb49e27f2bb6e16bae5613e","source_kind":"report","title":"assets/WELL-0286/maintenance-reports/MNT-0286-026.md","path":"assets/WELL-0286/maintenance-reports/MNT-0286-026.md"},"ev_5f1511e791ba14dbac3d9b68":{"id":"ev_5f1511e791ba14dbac3d9b68","source_id":"src_14c1c104f30ada09ac061817","source_kind":"maintenance","title":"MNT-0194-038","path":"assets/WELL-0194/maintenance.jsonl"},"src_dc79ce4e11961b2ccf0f9af8":{"id":"src_dc79ce4e11961b2ccf0f9af8","source_id":"src_dc79ce4e11961b2ccf0f9af8","source_kind":"report","title":"assets/WELL-0194/maintenance-reports/MNT-0194-038.md","path":"assets/WELL-0194/maintenance-reports/MNT-0194-038.md"},"ev_d26ce5e052644fb09ee91c24":{"id":"ev_d26ce5e052644fb09ee91c24","source_id":"src_0b56e23ca62bc8b3c46b5642","source_kind":"maintenance","title":"MNT-0190-030","path":"assets/WELL-0190/maintenance.jsonl"},"src_08ea6c1f863ab8d9a76948cb":{"id":"src_08ea6c1f863ab8d9a76948cb","source_id":"src_08ea6c1f863ab8d9a76948cb","source_kind":"report","title":"assets/WELL-0190/maintenance-reports/MNT-0190-030.md","path":"assets/WELL-0190/maintenance-reports/MNT-0190-030.md"},"ev_14fbd2ae4512933baa79c989":{"id":"ev_14fbd2ae4512933baa79c989","source_id":"src_d589b7b0057187a7c1cf38ef","source_kind":"maintenance","title":"MNT-0191-028","path":"assets/WELL-0191/maintenance.jsonl"},"src_194aa71b79fbe8151889e211":{"id":"src_194aa71b79fbe8151889e211","source_id":"src_194aa71b79fbe8151889e211","source_kind":"report","title":"assets/WELL-0191/maintenance-reports/MNT-0191-028.md","path":"assets/WELL-0191/maintenance-reports/MNT-0191-028.md"},"ev_a2849b8a2a7536990f381f51":{"id":"ev_a2849b8a2a7536990f381f51","source_id":"src_48f765e371c2cab5084b94f1","source_kind":"maintenance","title":"MNT-0200-029","path":"assets/WELL-0200/maintenance.jsonl"},"src_ad49f3f2139b86e79b625b44":{"id":"src_ad49f3f2139b86e79b625b44","source_id":"src_ad49f3f2139b86e79b625b44","source_kind":"report","title":"assets/WELL-0200/maintenance-reports/MNT-0200-029.md","path":"assets/WELL-0200/maintenance-reports/MNT-0200-029.md"},"ev_3ecd7d35bcd5edd18fc5e820":{"id":"ev_3ecd7d35bcd5edd18fc5e820","source_id":"src_8aa70bd204f0e279609dc6b4","source_kind":"maintenance","title":"MNT-0328-026","path":"assets/WELL-0328/maintenance.jsonl"},"src_6872f4738fc8c76d3b14f67b":{"id":"src_6872f4738fc8c76d3b14f67b","source_id":"src_6872f4738fc8c76d3b14f67b","source_kind":"report","title":"assets/WELL-0328/maintenance-reports/MNT-0328-026.md","path":"assets/WELL-0328/maintenance-reports/MNT-0328-026.md"},"ev_e78e6e164abfaf12207dc6e0":{"id":"ev_e78e6e164abfaf12207dc6e0","source_id":"src_f14e356314b809ff0ec70d3f","source_kind":"maintenance","title":"MNT-0432-021","path":"assets/WELL-0432/maintenance.jsonl"},"src_20c36d3855cbaf14f59e354b":{"id":"src_20c36d3855cbaf14f59e354b","source_id":"src_20c36d3855cbaf14f59e354b","source_kind":"report","title":"assets/WELL-0432/maintenance-reports/MNT-0432-021.md","path":"assets/WELL-0432/maintenance-reports/MNT-0432-021.md"},"ev_54eca7607bf5df5b3a90ee04":{"id":"ev_54eca7607bf5df5b3a90ee04","source_id":"src_e02e1ae3d32f9199758d69e7","source_kind":"maintenance","title":"MNT-0345-033","path":"assets/WELL-0345/maintenance.jsonl"},"src_685431350e94f989283ceb8c":{"id":"src_685431350e94f989283ceb8c","source_id":"src_685431350e94f989283ceb8c","source_kind":"report","title":"assets/WELL-0345/maintenance-reports/MNT-0345-033.md","path":"assets/WELL-0345/maintenance-reports/MNT-0345-033.md"},"ev_3f63a5669344eb3803942c74":{"id":"ev_3f63a5669344eb3803942c74","source_id":"src_33a02efbf3487e84e3b95e5f","source_kind":"maintenance","title":"MNT-0388-028","path":"assets/WELL-0388/maintenance.jsonl"},"src_6c99778bcfc4a827ec271f75":{"id":"src_6c99778bcfc4a827ec271f75","source_id":"src_6c99778bcfc4a827ec271f75","source_kind":"report","title":"assets/WELL-0388/maintenance-reports/MNT-0388-028.md","path":"assets/WELL-0388/maintenance-reports/MNT-0388-028.md"},"ev_dbb36e877bc9e092c307ca30":{"id":"ev_dbb36e877bc9e092c307ca30","source_id":"src_f14e356314b809ff0ec70d3f","source_kind":"maintenance","title":"MNT-0432-023","path":"assets/WELL-0432/maintenance.jsonl"},"src_3f6c50d9430acadaf1a6cb11":{"id":"src_3f6c50d9430acadaf1a6cb11","source_id":"src_3f6c50d9430acadaf1a6cb11","source_kind":"report","title":"assets/WELL-0432/maintenance-reports/MNT-0432-023.md","path":"assets/WELL-0432/maintenance-reports/MNT-0432-023.md"},"ev_384d98b38edaa80ec677dbe3":{"id":"ev_384d98b38edaa80ec677dbe3","source_id":"src_9bfed29edf2da1146e5c312d","source_kind":"maintenance","title":"MNT-0380-029","path":"assets/WELL-0380/maintenance.jsonl"},"src_d5ee17983ed0157b6c506f06":{"id":"src_d5ee17983ed0157b6c506f06","source_id":"src_d5ee17983ed0157b6c506f06","source_kind":"report","title":"assets/WELL-0380/maintenance-reports/MNT-0380-029.md","path":"assets/WELL-0380/maintenance-reports/MNT-0380-029.md"},"ev_c0e07757266c20ebe84708a4":{"id":"ev_c0e07757266c20ebe84708a4","source_id":"src_4edb7ae4c6462f6cff110743","source_kind":"maintenance","title":"MNT-0402-012","path":"assets/WELL-0402/maintenance.jsonl"},"src_9ad5f877dacbf9f831973704":{"id":"src_9ad5f877dacbf9f831973704","source_id":"src_9ad5f877dacbf9f831973704","source_kind":"report","title":"assets/WELL-0402/maintenance-reports/MNT-0402-012.md","path":"assets/WELL-0402/maintenance-reports/MNT-0402-012.md"},"ev_287012dcb5dfbf2aa411e362":{"id":"ev_287012dcb5dfbf2aa411e362","source_id":"src_f72bd5e7012e5d4197bb6976","source_kind":"maintenance","title":"MNT-0365-027","path":"assets/WELL-0365/maintenance.jsonl"},"src_3ee405a7b227a0c45fc80de8":{"id":"src_3ee405a7b227a0c45fc80de8","source_id":"src_3ee405a7b227a0c45fc80de8","source_kind":"report","title":"assets/WELL-0365/maintenance-reports/MNT-0365-027.md","path":"assets/WELL-0365/maintenance-reports/MNT-0365-027.md"},"ev_edc29a84c4df1a04e65e30b3":{"id":"ev_edc29a84c4df1a04e65e30b3","source_id":"src_3104c26ef649c879f0c9201f","source_kind":"maintenance","title":"MNT-0377-031","path":"assets/WELL-0377/maintenance.jsonl"},"src_86c9218313dd7b04d1ea13ac":{"id":"src_86c9218313dd7b04d1ea13ac","source_id":"src_86c9218313dd7b04d1ea13ac","source_kind":"report","title":"assets/WELL-0377/maintenance-reports/MNT-0377-031.md","path":"assets/WELL-0377/maintenance-reports/MNT-0377-031.md"},"ev_8307ed8f7a0b6f1c2f9f5a37":{"id":"ev_8307ed8f7a0b6f1c2f9f5a37","source_id":"src_f14e356314b809ff0ec70d3f","source_kind":"maintenance","title":"MNT-0432-024","path":"assets/WELL-0432/maintenance.jsonl"},"src_ac9e268412135637494eac84":{"id":"src_ac9e268412135637494eac84","source_id":"src_ac9e268412135637494eac84","source_kind":"report","title":"assets/WELL-0432/maintenance-reports/MNT-0432-024.md","path":"assets/WELL-0432/maintenance-reports/MNT-0432-024.md"},"ev_ca2250a9a624bfdca1e2a2a5":{"id":"ev_ca2250a9a624bfdca1e2a2a5","source_id":"src_99567c74d20c9e2e92d65689","source_kind":"maintenance","title":"MNT-0408-029","path":"assets/WELL-0408/maintenance.jsonl"},"src_cd0998ad7d5782f177ce35da":{"id":"src_cd0998ad7d5782f177ce35da","source_id":"src_cd0998ad7d5782f177ce35da","source_kind":"report","title":"assets/WELL-0408/maintenance-reports/MNT-0408-029.md","path":"assets/WELL-0408/maintenance-reports/MNT-0408-029.md"},"ev_4a7a3477e4bbcff719b89956":{"id":"ev_4a7a3477e4bbcff719b89956","source_id":"src_798493ffbf0819561ba24730","source_kind":"maintenance","title":"MNT-0366-026","path":"assets/WELL-0366/maintenance.jsonl"},"src_bb36e4bfb3cedf0dc4607638":{"id":"src_bb36e4bfb3cedf0dc4607638","source_id":"src_bb36e4bfb3cedf0dc4607638","source_kind":"report","title":"assets/WEL

L-0366/maintenance-reports/MNT-0366-026.md","path":"assets/WELL-0366/maintenance-reports/MNT-0366-026.md"},"ev_400ba54db6a1ee8bde9a6f55":{"id":"ev_400ba54db6a1ee8bde9a6f55","source_id":"src_bb823076074e59e5fae74048","source_kind":"maintenance","title":"MNT-0362-026","path":"assets/WELL-0362/maintenance.jsonl"},"src_11cf9833d9bff5f6aee980f0":{"id":"src_11cf9833d9bff5f6aee980f0","source_id":"src_11cf9833d9bff5f6aee980f0","source_kind":"report","title":"assets/WELL-0362/maintenance-reports/MNT-0362-026.md","path":"assets/WELL-0362/maintenance-reports/MNT-0362-026.md"},"ev_82ed73d750428b32bf7f943c":{"id":"ev_82ed73d750428b32bf7f943c","source_id":"src_9ee53afbf6d80ac363ea3fbb","source_kind":"maintenance","title":"MNT-0414-030","path":"assets/WELL-0414/maintenance.jsonl"},"src_d2636e472e7095b34d2d49db":{"id":"src_d2636e472e7095b34d2d49db","source_id":"src_d2636e472e7095b34d2d49db","source_kind":"report","title":"assets/WELL-0414/maintenance-reports/MNT-0414-030.md","path":"assets/WELL-0414/maintenance-reports/MNT-0414-030.md"},"ev_283d62d29edc61393174e516":{"id":"ev_283d62d29edc61393174e516","source_id":"src_9979f5e1ea62d92ffa9e6356","source_kind":"maintenance","title":"MNT-0448-024","path":"assets/WELL-0448/maintenance.jsonl"},"src_b7ea26f3cb66ff4057d55f91":{"id":"src_b7ea26f3cb66ff4057d55f91","source_id":"src_b7ea26f3cb66ff4057d55f91","source_kind":"report","title":"assets/WELL-0448/maintenance-reports/MNT-0448-024.md","path":"assets/WELL-0448/maintenance-reports/MNT-0448-024.md"},"ev_6ca093411c2bd22fafc40ae2":{"id":"ev_6ca093411c2bd22fafc40ae2","source_id":"src_121f331131b4e5337f368064","source_kind":"maintenance","title":"MNT-0439-030","path":"assets/WELL-0439/maintenance.jsonl"},"src_41c710b0df5016f98f55adcc":{"id":"src_41c710b0df5016f98f55adcc","source_id":"src_41c710b0df5016f98f55adcc","source_kind":"report","title":"assets/WELL-0439/maintenance-reports/MNT-0439-030.md","path":"assets/WELL-0439/maintenance-reports/MNT-0439-030.md"},"ev_3774095cf2f7ffb1e8b02848":{"id":"ev_3774095cf2f7ffb1e8b02848","source_id":"src_7df4d484c15db67e4cf5e8e4","source_kind":"maintenance","title":"MNT-0305-030","path":"assets/WELL-0305/maintenance.jsonl"},"src_88cce5bbc130a2e033613355":{"id":"src_88cce5bbc130a2e033613355","source_id":"src_88cce5bbc130a2e033613355","source_kind":"report","title":"assets/WELL-0305/maintenance-reports/MNT-0305-030.md","path":"assets/WELL-0305/maintenance-reports/MNT-0305-030.md"},"ev_0a2ed15b4f808570e3c5988f":{"id":"ev_0a2ed15b4f808570e3c5988f","source_id":"src_6ec4f23662604dd1fc1ed97e","source_kind":"maintenance","title":"MNT-0374-029","path":"assets/WELL-0374/maintenance.jsonl"},"src_ab663bc6ee464e064b004cbc":{"id":"src_ab663bc6ee464e064b004cbc","source_id":"src_ab663bc6ee464e064b004cbc","source_kind":"report","title":"assets/WELL-0374/maintenance-reports/MNT-0374-029.md","path":"assets/WELL-0374/maintenance-reports/MNT-0374-029.md"},"ev_f3364ba01c7729c03f873a6e":{"id":"ev_f3364ba01c7729c03f873a6e","source_id":"src_24f95d37d839326b70030d2c","source_kind":"maintenance","title":"MNT-0307-028","path":"assets/WELL-0307/maintenance.jsonl"},"src_20068489d6a5599ecc512790":{"id":"src_20068489d6a5599ecc512790","source_id":"src_20068489d6a5599ecc512790","source_kind":"report","title":"assets/WELL-0307/maintenance-reports/MNT-0307-028.md","path":"assets/WELL-0307/maintenance-reports/MNT-0307-028.md"},"ev_72247fa3ca33d8709d7d7261":{"id":"ev_72247fa3ca33d8709d7d7261","source_id":"src_c57790d464b13237e8d21c76","source_kind":"maintenance","title":"MNT-0395-026","path":"assets/WELL-0395/maintenance.jsonl"},"src_184ef3dd62aba925b2949680":{"id":"src_184ef3dd62aba925b2949680","source_id":"src_184ef3dd62aba925b2949680","source_kind":"report","title":"assets/WELL-0395/maintenance-reports/MNT-0395-026.md","path":"assets/WELL-0395/maintenance-reports/MNT-0395-026.md"},"ev_3ce778f7c1efe25c9b1dc8b0":{"id":"ev_3ce778f7c1efe25c9b1dc8b0","source_id":"src_4a7136301ebae79b0bf41f1b","source_kind":"maintenance","title":"MNT-0338-030","path":"assets/WELL-0338/maintenance.jsonl"},"src_00fa33aa7d80fc81cf8f8ff4":{"id":"src_00fa33aa7d80fc81cf8f8ff4","source_id":"src_00fa33aa7d80fc81cf8f8ff4","source_kind":"report","title":"assets/WELL-0338/maintenance-reports/MNT-0338-030.md","path":"assets/WELL-0338/maintenance-reports/MNT-0338-030.md"},"ev_8b51ffa587996d5c1d6291ad":{"id":"ev_8b51ffa587996d5c1d6291ad","source_id":"src_049acdfff9be477e699c2725","source_kind":"maintenance","title":"MNT-0411-023","path":"assets/WELL-0411/maintenance.jsonl"},"src_80b888361313d61d60213ab8":{"id":"src_80b888361313d61d60213ab8","source_id":"src_80b888361313d61d60213ab8","source_kind":"report","title":"assets/WELL-0411/maintenance-reports/MNT-0411-023.md","path":"assets/WELL-0411/maintenance-reports/MNT-0411-023.md"},"ev_2e45db43cf2288d05014dfec":{"id":"ev_2e45db43cf2288d05014dfec","source_id":"src_038459f36d8310b8efbfd5b6","source_kind":"maintenance","title":"MNT-0430-030","path":"assets/WELL-0430/maintenance.jsonl"},"src_596d0d39135a1e8c3c9cc21d":{"id":"src_596d0d39135a1e8c3c9cc21d","source_id":"src_596d0d39135a1e8c3c9cc21d","source_kind":"report","title":"assets/WELL-0430/maintenance-reports/MNT-0430-030.md","path":"assets/WELL-0430/maintenance-reports/MNT-0430-030.md"},"ev_d9d4e8d59b47272f651a7240":{"id":"ev_d9d4e8d59b47272f651a7240","source_id":"src_a8eeedde7b09e9ec27f7986c","source_kind":"maintenance","title":"MNT-0412-032","path":"assets/WELL-0412/maintenance.jsonl"},"src_705aa91026db80dda0dbfafe":{"id":"src_705aa91026db80dda0dbfafe","source_id":"src_705aa91026db80dda0dbfafe","source_kind":"report","title":"assets/WELL-0412/maintenance-reports/MNT-0412-032.md","path":"assets/WELL-0412/maintenance-reports/MNT-0412-032.md"},"ev_70aa52e7571ce4262e071a7c":{"id":"ev_70aa52e7571ce4262e071a7c","source_id":"src_a6dd4a0f7dfc4b633a41d0ec","source_kind":"maintenance","title":"MNT-0394-022","path":"assets/WELL-0394/maintenance.jsonl"},"src_03cb0ccf5f61d39465006d1d":{"id":"src_03cb0ccf5f61d39465006d1d","source_id":"src_03cb0ccf5f61d39465006d1d","source_kind":"report","title":"assets/WELL-0394/maintenance-reports/MNT-0394-022.md","path":"assets/WELL-0394/maintenance-reports/MNT-0394-022.md"},"ev_d0c0b7b781ebc5f5fd3045c6":{"id":"ev_d0c0b7b781ebc5f5fd3045c6","source_id":"src_50145e8863851d312afb220c","source_kind":"maintenance","title":"MNT-0399-019","path":"assets/WELL-0399/maintenance.jsonl"},"src_f0daf10000bd543de86f996f":{"id":"src_f0daf10000bd543de86f996f","source_id":"src_f0daf10000bd543de86f996f","source_kind":"report","title":"assets/WELL-0399/maintenance-reports/MNT-0399-019.md","path":"assets/WELL-0399/maintenance-reports/MNT-0399-019.md"},"ev_bb23a798bd784083fff4feac":{"id":"ev_bb23a798bd784083fff4feac","source_id":"src_e02e1ae3d32f9199758d69e7","source_kind":"maintenance","title":"MNT-0345-031","path":"assets/WELL-0345/maintenance.jsonl"},"src_5cd384a7b3d635952713d773":{"id":"src_5cd384a7b3d635952713d773","source_id":"src_5cd384a7b3d635952713d773","source_kind":"report","title":"assets/WELL-0345/maintenance-reports/MNT-0345-031.md","path":"assets/WELL-0345/maintenance-reports/MNT-0345-031.md"},"ev_7e2e47032b215b51f8d79e99":{"id":"ev_7e2e47032b215b51f8d79e99","source_id":"src_f72bd5e7012e5d4197bb6976","source_kind":"maintenance","title":"MNT-0365-024","path":"assets/WELL-0365/maintenance.jsonl"},"src_ad45a233cacda307e49302ea":{"id":"src_ad45a233cacda307e49302ea","source_id":"src_ad45a233cacda307e49302ea","source_kind":"report","title":"assets/WELL-0365/maintenance-reports/MNT-0365-024.md","path":"assets/WELL-0365/maintenance-reports/MNT-0365-024.md"},"ev_2cd9cadcf052a7ba7230e95f":{"id":"ev_2cd9cadcf052a7ba7230e95f","source_id":"src_9502cf69ae562435a03e10d9","source_kind":"maintenance","title":"MNT-0444-012","path":"assets/WELL-0444/maintenance.jsonl"},"src_9a8fa7903aca8427172edf58":{"id":"src_9a8fa7903aca8427172edf58","source_id":"src_9a8fa7903aca8427172edf58","source_kind":"report","title":"assets/WELL-0444/maintenance-reports/MNT-0444-012.md","path":"assets/WELL-0444/maintenance-reports/MNT-0444-012.md"},"ev_27c0637a19b6714ade04c22b":{"id":"ev_27c0637a19b6714ade04c22b","source_id":"src_4a7136301ebae79b0bf41f1b","source_kind":"maintenance","title":"MNT-0338-023","path":"assets/WELL-0338/maintenance.jsonl"},"src_08cab1dec8b7a65d5de35931":{"id":"src_08cab1dec8b7a65d5de35931","source_id":"src_08cab1dec8b7a65d5de35931","source_kind":"report","title":"assets/WELL-0338/maintenance-reports/MNT-0338-023.md","path":"assets/WELL-0338/maintenance-reports/MNT-0338-023.md"},"ev_5afc79be427271c0f5342545":{"id":"ev_5afc79be427271c0f5342545","source_id":"src_791f6e4f9cebfb849d8d8a4e","source_kind":"maintenance","title":"MNT-0447-028","path":"assets/WELL-0447/maintenance.jsonl"},"src_9dc004cfc7d4fae30f033add":{"id":"src_9dc004cfc7d4fae30f033add","source_id":"src_9dc004cfc7d4fae30f033add","source_kind":"report","title":"assets/WELL-0447/maintenance-reports/MNT-0447-028.md","path":"assets/WELL-0447/maintenance-reports/MNT-0447-028.md"},"ev_70d225cd2a815ff45a1f95ea":{"id":"ev_70d225cd2a815ff45a1f95ea","source_id":"src_71f86474899d866c4c387a4c","source_kind":"maintenance","title":"MNT-0325-024","path":"assets/WELL-0325/maintenance.jsonl"},"src_f9be1d68cebff1c1267bc426":{"id":"src_f9be1d68cebff1c1267bc426","source_id":"src_f9be1d68cebff1c1267bc426","source_kind":"report","title":"assets/WELL-0325/maintenance-reports/MNT-0325-024.md","path":"assets/WELL-0325/maintenance-reports/MNT-0325-024.md"},"ev_dbaaad84c858fd7c4493fda9":{"id":"ev_dbaaad84c858fd7c4493fda9","source_id":"src_6ec4f23662604dd1fc1ed97e","source_kind":"maintenance","title":"MNT-0374-024","path":"assets/WELL-0374/maintenance.jsonl"},"src_830376b6eec3438b4eb3e47f":{"id":"src_830376b6eec3438b4eb3e47f","source_id":"src_830376b6eec3438b4eb3e47f","source_kind":"report","title":"assets/WELL-0374/maintenance-reports/MNT-0374-024.md","path":"assets/WELL-0374/maintenance-reports/MNT-0374-024.md"},"ev_60dbb3fe61e132da1e5c906f":{"id":"ev_60dbb3fe61e132da1e5c906f","source_id":"src_fefd55648e9f1a44037c079f","source_kind":"maintenance","title":"MNT-0354-027

```
","path":"assets/WELL-0354/maintenance.jsonl"},"src_bfafcedc08b2f52b03413887":{"id":"src_bfafcedc08b2f52b03413887","so
urce_id":"src_bfafcedc08b2f52b03413887","source_kind":"report","title":"assets/WELL-0354/maintenance-reports/MNT-0354-
027.md","path":"assets/WELL-0354/maintenance-reports/MNT-0354-027.md"},"ev_66828c9969665e1efa961c46":{"id":"ev_66828c9
969665e1efa961c46","source_id":"src_049acdfff9be477e699c2725","source_kind":"maintenance","title":"MNT-0411-014","path
":"assets/WELL-0411/maintenance.jsonl"},"src_09d731f7ed01ebf79bb2e521":{"id":"src_09d731f7ed01ebf79bb2e521","source_id
":"src_09d731f7ed01ebf79bb2e521","source_kind":"report","title":"assets/WELL-0411/maintenance-reports/MNT-0411-014.md"
,"path":"assets/WELL-0411/maintenance-reports/MNT-0411-014.md"},"ev_a842e5ea57aa7a9063975fcf":{"id":"ev_a842e5ea57aa7a
9063975fcf","source_id":"src_a5ee40715859d1f89365b23c","source_kind":"maintenance","title":"MNT-0449-029","path":"asse
ts/WELL-0449/maintenance.jsonl"},"src_031a224a490d4c1219d0234c":{"id":"src_031a224a490d4c1219d0234c","source_id":"src_
031a224a490d4c1219d0234c","source_kind":"report","title":"assets/WELL-0449/maintenance-reports/MNT-0449-029.md","path"
:"assets/WELL-0449/maintenance-reports/MNT-0449-029.md"},"ev_be86329f2491a0831094393d":{"id":"ev_be86329f2491a08310943
93d","source_id":"src_b3de43fe200c186cd44f7a16","source_kind":"maintenance","title":"MNT-0335-024","path":"assets/WELL
-0335/maintenance.jsonl"},"src_0772691794f24a56fddcf638":{"id":"src_0772691794f24a56fddcf638","source_id":"src_0772691
794f24a56fddcf638","source_kind":"report","title":"assets/WELL-0335/maintenance-reports/MNT-0335-024.md","path":"asset
s/WELL-0335/maintenance-reports/MNT-0335-024.md"},"ev_1a21e54f206009979b15a260":{"id":"ev_1a21e54f206009979b15a260","s
ource_id":"src_f83d148e06751e7aad3c2b4c","source_kind":"maintenance","title":"MNT-0370-022","path":"assets/WELL-0370/m
aintenance.jsonl"},"src_ab8209da3fcf5647db3bf9bf":{"id":"src_ab8209da3fcf5647db3bf9bf","source_id":"src_ab8209da3fcf56
47db3bf9bf","source_kind":"report","title":"assets/WELL-0370/maintenance-reports/MNT-0370-022.md","path":"assets/WELL-
0370/maintenance-reports/MNT-0370-022.md"},"ev_38c1b487d37deea9c08b3ca5":{"id":"ev_38c1b487d37deea9c08b3ca5","source_i
d":"src_91c72b5fcaa703212eefb104","source_kind":"maintenance","title":"MNT-0348-032","path":"assets/WELL-0348/maintena
nce.jsonl"},"src_71bc6da2ba20f4a59f961a36":{"id":"src_71bc6da2ba20f4a59f961a36","source_id":"src_71bc6da2ba20f4a59f961
a36","source_kind":"report","title":"assets/WELL-0348/maintenance-reports/MNT-0348-032.md","path":"assets/WELL-0348/ma
intenance-reports/MNT-0348-032.md"},"ev_be203bf86004214fe41bd84b":{"id":"ev_be203bf86004214fe41bd84b","source_id":"src
_1c80aa81d77fc8c9a688a74f","source_kind":"maintenance","title":"MNT-0398-021","path":"assets/WELL-0398/maintenance.jso
nl"},"src_4e56b2040455d45974048c36":{"id":"src_4e56b2040455d45974048c36","source_id":"src_4e56b2040455d45974048c36","s
ource_kind":"report","title":"assets/WELL-0398/maintenance-reports/MNT-0398-021.md","path":"assets/WELL-0398/maintenan
ce-reports/MNT-0398-021.md"},"ev_72c76df5be7618b32b83dcbf":{"id":"ev_72c76df5be7618b32b83dcbf","source_id":"src_096efd
1681629b6a7b044a68","source_kind":"maintenance","title":"MNT-0384-020","path":"assets/WELL-0384/maintenance.jsonl"},"s
rc_675c8a8b42e8ec7a4eab65a1":{"id":"src_675c8a8b42e8ec7a4eab65a1","source_id":"src_675c8a8b42e8ec7a4eab65a1","source_k
ind":"report","title":"assets/WELL-0384/maintenance-reports/MNT-0384-020.md","path":"assets/WELL-0384/maintenance-repo
rts/MNT-0384-020.md"},"ev_5cc31c62421d07343ea8f727":{"id":"ev_5cc31c62421d07343ea8f727","source_id":"src_c7aec5561a9f9
3e1c8f0bc85","source_kind":"maintenance","title":"MNT-0310-024","path":"assets/WELL-0310/maintenance.jsonl"},"src_1b08
eaa3bb0dbb99afc7e8cc":{"id":"src_1b08eaa3bb0dbb99afc7e8cc","source_id":"src_1b08eaa3bb0dbb99afc7e8cc","source_kind":"r
eport","title":"assets/WELL-0310/maintenance-reports/MNT-0310-024.md","path":"assets/WELL-0310/maintenance-reports/MNT
-0310-024.md"},"ev_6d80540f397292ddb5246d08":{"id":"ev_6d80540f397292ddb5246d08","source_id":"src_121f331131b4e5337f36
8064","source_kind":"maintenance","title":"MNT-0439-027","path":"assets/WELL-0439/maintenance.jsonl"},"src_cc387267500
4e79db0299e4e":{"id":"src_cc3872675004e79db0299e4e","source_id":"src_cc3872675004e79db0299e4e","source_kind":"report",
"title":"assets/WELL-0439/maintenance-reports/MNT-0439-027.md","path":"assets/WELL-0439/maintenance-reports/MNT-0439-0
27.md"},"ev_f8f554b964b55d73ccfc0673":{"id":"ev_f8f554b964b55d73ccfc0673","source_id":"src_1f9a6f3ce1a724f7938b78ad","
source_kind":"maintenance","title":"MNT-0385-026","path":"assets/WELL-0385/maintenance.jsonl"},"src_f69f4f9b00d9596ca0
2239f3":{"id":"src_f69f4f9b00d9596ca02239f3","source_id":"src_f69f4f9b00d9596ca02239f3","source_kind":"report","title"
:"assets/WELL-0385/maintenance-reports/MNT-0385-026.md","path":"assets/WELL-0385/maintenance-reports/MNT-0385-026.md"}
,"ev_49cb7d71b9b67f4cf034d15a":{"id":"ev_49cb7d71b9b67f4cf034d15a","source_id":"src_be5c1e86d55f8f35d9177262","source_
kind":"maintenance","title":"MNT-0425-026","path":"assets/WELL-0425/maintenance.jsonl"},"src_5265d0a87a982b4e702f716e"
:{"id":"src_5265d0a87a982b4e702f716e","source_id":"src_5265d0a87a982b4e702f716e","source_kind":"report","title":"asset
s/WELL-0425/maintenance-reports/MNT-0425-026.md","path":"assets/WELL-0425/maintenance-reports/MNT-0425-026.md"},"ev_a6
db0bf51d70862c616e0378":{"id":"ev_a6db0bf51d70862c616e0378","source_id":"src_36c176d30b0c3d150be0bf9a","source_kind":"
maintenance","title":"MNT-0417-025","path":"assets/WELL-0417/maintenance.jsonl"},"src_32063c41175ee38af19c001b":{"id":
"src_32063c41175ee38af19c001b","source_id":"src_32063c41175ee38af19c001b","source_kind":"report","title":"assets/WELL-
0417/maintenance-reports/MNT-0417-025.md","path":"assets/WELL-0417/maintenance-reports/MNT-0417-025.md"},"ev_bf15221b9
5ee9ec35199e322":{"id":"ev_bf15221b95ee9ec35199e322","source_id":"src_94248cdcf052709dd574b652","source_kind":"mainten
ance","title":"MNT-0306-029","path":"assets/WELL-0306/maintenance.jsonl"},"src_52ed2dd0da6548444c781d97":{"id":"src_52
ed2dd0da6548444c781d97","source_id":"src_52ed2dd0da6548444c781d97","source_kind":"report","title":"assets/WELL-0306/ma
intenance-reports/MNT-0306-029.md","path":"assets/WELL-0306/maintenance-reports/MNT-0306-029.md"},"ev_f54a6c0f1b8f3dbe
a8687e03":{"id":"ev_f54a6c0f1b8f3dbea8687e03","source_id":"src_4edb7ae4c6462f6cff110743","source_kind":"maintenance","
title":"MNT-0402-014","path":"assets/WELL-0402/maintenance.jsonl"},"src_0c1b5f872d100086fdf1f02d":{"id":"src_0c1b5f872
d100086fdf1f02d","source_id":"src_0c1b5f872d100086fdf1f02d","source_kind":"report","title":"assets/WELL-0402/maintenan
ce-reports/MNT-0402-014.md","path":"assets/WELL-0402/maintenance-reports/MNT-0402-014.md"},"ev_73d7f7af27d19d5872a0bcc
b":{"id":"ev_73d7f7af27d19d5872a0bccb","source_id":"src_fff75e092e9773b28335b922","source_kind":"maintenance","title":
"MNT-0358-024","path":"assets/WELL-0358/maintenance.jsonl"},"src_d0dc6ade173f4fafd6a3e6f1":{"id":"src_d0dc6ade173f4faf
d6a3e6f1","source_id":"src_d0dc6ade173f4fafd6a3e6f1","source_kind":"report","title":"assets/WELL-0358/maintenance-repo
rts/MNT-0358-024.md","path":"assets/WELL-0358/maintenance-reports/MNT-0358-024.md"},"ev_7d566371da229d27dd0b87a0":{"id
":"ev_7d566371da229d27dd0b87a0","source_id":"src_134dba6b8bec0cd67f20d8b4","source_kind":"maintenance","title":"MNT-03
14-032","path":"assets/WELL-0314/maintenance.jsonl"},"src_8d0aa4244437a9989a5f41d8":{"id":"src_8d0aa4244437a9989a5f41d
8","source_id":"src_8d0aa4244437a9989a5f41d8","source_kind":"report","title":"assets/WELL-0314/maintenance-reports/MNT
-0314-032.md","path":"assets/WELL-0314/maintenance-reports/MNT-0314-032.md"},"ev_4f3309969a97b08016ef0380":{"id":"ev_4
f3309969a97b08016ef0380","source_id":"src_be0c6147093d627f38d3c08e","source_kind":"maintenance","title":"MNT-0309-022"
,"path":"assets/WELL-0309/maintenance.jsonl"},"src_197df496c1e6fd576a5a76c2":{"id":"src_197df496c1e6fd576a5a76c2","sou
rce_id":"src_197df496c1e6fd576a5a76c2","source_kind":"report","title":"assets/WELL-0309/maintenance-reports/MNT-0309-0
22.md","path":"assets/WELL-0309/maintenance-reports/MNT-0309-022.md"},"ev_764960216b1eb9bc1f7be955":{"id":"ev_76496021
6b1eb9bc1f7be955","source_id":"src_ea64cbc3df6f37ca6b4a03f7","source_kind":"maintenance","title":"MNT-0344-032","path"
:"assets/WELL-0344/maintenance.jsonl"},"src_44780e3892b450a3011fee71":{"id":"src_44780e3892b450a3011fee71","source_id"
:"src_44780e3892b450a3011fee71","source_kind":"report","title":"assets/WELL-0344/maintenance-reports/MNT-0344-032.md",
"path":"assets/WELL-0344/maintenance-reports/MNT-0344-032.md"},"ev_7667e565709e6f5df31883a9":{"id":"ev_7667e565709e6f5
df31883a9","source_id":"src_f14e356314b809ff0ec70d3f","source_kind":"maintenance","title":"MNT-0432-028","path":"asset
s/WELL-0432/maintenance.jsonl"},"src_35f228f03b73b6a57ad3fd28":{"id":"src_35f228f03b73b6a57ad3fd28","source_id":"src_3
5f228f03b73b6a57ad3fd28","source_kind":"report","title":"assets/WELL-0432/maintenance-reports/MNT-0432-028.md","path":
"assets/WELL-0432/maintenance-reports/MNT-0432-028.md"},"ev_d919c39867adf50d88f5354d":{"id":"ev_d919c39867adf50d88f535
4d","source_id":"src_e973d29e048289261aaedc83","source_kind":"maintenance","title":"MNT-0330-028","path":"assets/WELL-
0330/maintenance.jsonl"},"src_7cc8b8a3ff8d0b7d701f6fea":{"id":"src_7cc8b8a3ff8d0b7d701f6fea","source_id":"src_7cc8b8a3
ff8d0b7d701f6fea","source_kind":"report","title":"assets/WELL-0330/maintenance-reports/MNT-0330-028.md","path":"assets
/WELL-0330/maintenance-reports/MNT-0330-028.md"},"ev_45b433e33324569109b6d705":{"id":"ev_45b433e33324569109b6d705","so
urce_id":"src_a59717c056858ed909d5643a","source_kind":"maintenance","title":"MNT-0429-034","path":"assets/WELL-0429/ma
intenance.jsonl"},"src_d649c5181c80eeb27912bf9b":{"id":"src_d649c5181c80eeb27912bf9b","source_id":"src_d649c5181c80eeb
27912bf9b","source_kind":"report","title":"assets/WELL-0429/maintenance-reports/MNT-0429-034.md","path":"assets/WELL-0
```

429/maintenance-reports/MNT-0429-034.md"},"ev_8e4b3db50d93511e5e1e3b67":{"id":"ev_8e4b3db50d93511e5e1e3b67","source_id":"src_6ec4f23662604dd1fc1ed97e","source_kind":"maintenance","title":"MNT-0374-031","path":"assets/WELL-0374/maintenance.jsonl"},"src_3584afb15281805532700655":{"id":"src_3584afb15281805532700655","source_id":"src_3584afb152818055327006055","source_kind":"report","title":"assets/WELL-0374/maintenance-reports/MNT-0374-031.md","path":"assets/WELL-0374/maintenance-reports/MNT-0374-031.md"},"ev_aee70b8fbd0c76eeac47bd0d":{"id":"ev_aee70b8fbd0c76eeac47bd0d","source_id":"src_78a42f6bb9bf227a2367cc9f","source_kind":"maintenance","title":"MNT-0433-039","path":"assets/WELL-0433/maintenance.jsonl"},"src_00a0a082c14e59536527bff1":{"id":"src_00a0a082c14e59536527bff1","source_id":"src_00a0a082c14e59536527bff1","source_kind":"report","title":"assets/WELL-0433/maintenance-reports/MNT-0433-039.md","path":"assets/WELL-0433/maintenance-reports/MNT-0433-039.md"},"ev_111bf988803deeecea8faf36":{"id":"ev_111bf988803deeecea8faf36","source_id":"src_a5722e3d9f76dbe4324b6401","source_kind":"maintenance","title":"MNT-0400-030","path":"assets/WELL-0400/maintenance.jsonl"},"src_3c0212c37e608c41a7e882db":{"id":"src_3c0212c37e608c41a7e882db","source_id":"src_3c0212c37e608c41a7e882db","source_kind":"report","title":"assets/WELL-0400/maintenance-reports/MNT-0400-030.md","path":"assets/WELL-0400/maintenance-reports/MNT-0400-030.md"},"ev_841b258c9becab31a25feb4d":{"id":"ev_841b258c9becab31a25feb4d","source_id":"src_63afed48458d87446127e76f","source_kind":"maintenance","title":"MNT-0423-029","path":"assets/WELL-0423/maintenance.jsonl"},"src_18326096e0d7261c8c6f3fe5":{"id":"src_18326096e0d7261c8c6f3fe5","source_id":"src_18326096e0d7261c8c6f3fe5","source_kind":"report","title":"assets/WELL-0423/maintenance-reports/MNT-0423-029.md","path":"assets/WELL-0423/maintenance-reports/MNT-0423-029.md"},"ev_d1519e589ca8148bc424c956":{"id":"ev_d1519e589ca8148bc424c956","source_id":"src_b94dcd478c6a4265cae3bd07","source_kind":"maintenance","title":"MNT-0393-023","path":"assets/WELL-0393/maintenance.jsonl"},"src_d07e7ff8941ccc533adc89f8":{"id":"src_d07e7ff8941ccc533adc89f8","source_id":"src_d07e7ff8941ccc533adc89f8","source_kind":"report","title":"assets/WELL-0393/maintenance-reports/MNT-0393-023.md","path":"assets/WELL-0393/maintenance-reports/MNT-0393-023.md"},"ev_3b028296bbd5a8908e861adc":{"id":"ev_3b028296bbd5a8908e861adc","source_id":"src_ec59e111a5c376e4139ad1df","source_kind":"maintenance","title":"MNT-0376-024","path":"assets/WELL-0376/maintenance.jsonl"},"src_c9820919b41c7fa5ca3898a5":{"id":"src_c9820919b41c7fa5ca3898a5","source_id":"src_c9820919b41c7fa5ca3898a5","source_kind":"report","title":"assets/WELL-0376/maintenance-reports/MNT-0376-024.md","path":"assets/WELL-0376/maintenance-reports/MNT-0376-024.md"},"ev_b6f014001994c38683f06a6d":{"id":"ev_b6f014001994c38683f06a6d","source_id":"src_c6b8d1e260d39263a5f2090f","source_kind":"maintenance","title":"MNT-0351-026","path":"assets/WELL-0351/maintenance.jsonl"},"src_2f74011d4fb563f77f3a7b16":{"id":"src_2f74011d4fb563f77f3a7b16","source_id":"src_2f74011d4fb563f77f3a7b16","source_kind":"report","title":"assets/WELL-0351/maintenance-reports/MNT-0351-026.md","path":"assets/WELL-0351/maintenance-reports/MNT-0351-026.md"},"ev_4c69ff47e70b188fdd038d4b":{"id":"ev_4c69ff47e70b188fdd038d4b","source_id":"src_049acdfff9be477e699c2725","source_kind":"maintenance","title":"MNT-0411-013","path":"assets/WELL-0411/maintenance.jsonl"},"src_0f99f49f9ee37509dacd850e":{"id":"src_0f99f49f9ee37509dacd850e","source_id":"src_0f99f49f9ee37509dacd850e","source_kind":"report","title":"assets/WELL-0411/maintenance-reports/MNT-0411-013.md","path":"assets/WELL-0411/maintenance-reports/MNT-0411-013.md"},"ev_b9aada64fa9f8c06525782f2":{"id":"ev_b9aada64fa9f8c06525782f2","source_id":"src_280e6e7967e091122d8f5a38","source_kind":"maintenance","title":"MNT-0369-028","path":"assets/WELL-0369/maintenance.jsonl"},"src_afc7d7e96f5a27de3e886229":{"id":"src_afc7d7e96f5a27de3e886229","source_id":"src_afc7d7e96f5a27de3e886229","source_kind":"report","title":"assets/WELL-0369/maintenance-reports/MNT-0369-028.md","path":"assets/WELL-0369/maintenance-reports/MNT-0369-028.md"},"ev_2a97e718f8ceac71f19da770":{"id":"ev_2a97e718f8ceac71f19da770","source_id":"src_3a37054a301b0d8475b87be0","source_kind":"maintenance","title":"MNT-0322-025","path":"assets/WELL-0322/maintenance.jsonl"},"src_e576bc7d1fb9c2a46f892091":{"id":"src_e576bc7d1fb9c2a46f892091","source_id":"src_e576bc7d1fb9c2a46f892091","source_kind":"report","title":"assets/WELL-0322/maintenance-reports/MNT-0322-025.md","path":"assets/WELL-0322/maintenance-reports/MNT-0322-025.md"},"ev_0c38d1515a4ea48d43bcaeed":{"id":"ev_0c38d1515a4ea48d43bcaeed","source_id":"src_3104c26ef649c879f0c9201f","source_kind":"maintenance","title":"MNT-0377-029","path":"assets/WELL-0377/maintenance.jsonl"},"src_b8a3dc065fdc24053100aa5c":{"id":"src_b8a3dc065fdc24053100aa5c","source_id":"src_b8a3dc065fdc24053100aa5c","source_kind":"report","title":"assets/WELL-0377/maintenance-reports/MNT-0377-029.md","path":"assets/WELL-0377/maintenance-reports/MNT-0377-029.md"},"ev_2c1fa28cea0f3e95f749022d":{"id":"ev_2c1fa28cea0f3e95f749022d","source_id":"src_a5722e3d9f76dbe4324b6401","source_kind":"maintenance","title":"MNT-0400-025","path":"assets/WELL-0400/maintenance.jsonl"},"src_f66b3bf65788b2235bc8eaa7":{"id":"src_f66b3bf65788b2235bc8eaa7","source_id":"src_f66b3bf65788b2235bc8eaa7","source_kind":"report","title":"assets/WELL-0400/maintenance-reports/MNT-0400-025.md","path":"assets/WELL-0400/maintenance-reports/MNT-0400-025.md"},"ev_70f0d3989bdda4f2d1fd9e99":{"id":"ev_70f0d3989bdda4f2d1fd9e99","source_id":"src_497e360bf0ae020b7b15b269","source_kind":"maintenance","title":"MNT-0409-027","path":"assets/WELL-0409/maintenance.jsonl"},"src_526d60d1dff584332a658d0d":{"id":"src_526d60d1dff584332a658d0d","source_id":"src_526d60d1dff584332a658d0d","source_kind":"report","title":"assets/WELL-0409/maintenance-reports/MNT-0409-027.md","path":"assets/WELL-0409/maintenance-reports/MNT-0409-027.md"},"ev_1d4c0debd6781ef922049f47":{"id":"ev_1d4c0debd6781ef922049f47","source_id":"src_3104c26ef649c879f0c9201f","source_kind":"maintenance","title":"MNT-0377-030","path":"assets/WELL-0377/maintenance.jsonl"},"src_ed5098213551c0beef2f6616":{"id":"src_ed5098213551c0beef2f6616","source_id":"src_ed5098213551c0beef2f6616","source_kind":"report","title":"assets/WELL-0377/maintenance-reports/MNT-0377-030.md","path":"assets/WELL-0377/maintenance-reports/MNT-0377-030.md"},"ev_92debd7e83e89e7c85bf5628":{"id":"ev_92debd7e83e89e7c85bf5628","source_id":"src_106d27e2b9b8f64ab98f11dd","source_kind":"maintenance","title":"MNT-0301-028","path":"assets/WELL-0301/maintenance.jsonl"},"src_d1cc5642f300bc30a94cd7b8":{"id":"src_d1cc5642f300bc30a94cd7b8","source_id":"src_d1cc5642f300bc30a94cd7b8","source_kind":"report","title":"assets/WELL-0301/maintenance-reports/MNT-0301-028.md","path":"assets/WELL-0301/maintenance-reports/MNT-0301-028.md"},"ev_3220afd7eedec00608ac5313":{"id":"ev_3220afd7eedec00608ac5313","source_id":"src_36c9aaa58409661153ffff4f","source_kind":"maintenance","title":"MNT-0382-027","path":"assets/WELL-0382/maintenance.jsonl"},"src_ef6e393f154b6b247e275eb1":{"id":"src_ef6e393f154b6b247e275eb1","source_id":"src_ef6e393f154b6b247e275eb1","source_kind":"report","title":"assets/WELL-0382/maintenance-reports/MNT-0382-027.md","path":"assets/WELL-0382/maintenance-reports/MNT-0382-027.md"},"ev_356b3b677a5873825286ba11":{"id":"ev_356b3b677a5873825286ba11","source_id":"src_f5992cd915757081bcb72b6d","source_kind":"maintenance","title":"MNT-0333-026","path":"assets/WELL-0333/maintenance.jsonl"},"src_27f9370b7ffb2cfba01518d1":{"id":"src_27f9370b7ffb2cfba01518d1","source_id":"src_27f9370b7ffb2cfba01518d1","source_kind":"report","title":"assets/WELL-0333/maintenance-reports/MNT-0333-026.md","path":"assets/WELL-0333/maintenance-reports/MNT-0333-026.md"},"ev_ad6f55cd8236e4d4ec1a877c":{"id":"ev_ad6f55cd8236e4d4ec1a877c","source_id":"src_8f1798dce5b5b91681394423","source_kind":"maintenance","title":"MNT-0404-030","path":"assets/WELL-0404/maintenance.jsonl"},"src_f8e56067daefb2e08c89e6b3":{"id":"src_f8e56067daefb2e08c89e6b3","source_id":"src_f8e56067daefb2e08c89e6b3","source_kind":"report","title":"assets/WELL-0404/maintenance-reports/MNT-0404-030.md","path":"assets/WELL-0404/maintenance-reports/MNT-0404-030.md"},"ev_437b67486e6ecf6e6773ac9f":{"id":"ev_437b67486e6ecf6e6773ac9f","source_id":"src_5125ea9d3c8c47a657338a54","source_kind":"maintenance","title":"MNT-0406-027","path":"assets/WELL-0406/maintenance.jsonl"},"src_47fd929d318a89e360875f1f":{"id":"src_47fd929d318a89e360875f1f","source_id":"src_47fd929d318a89e360875f1f","source_kind":"report","title":"assets/WELL-0406/maintenance-reports/MNT-0406-027.md","path":"assets/WELL-0406/maintenance-reports/MNT-0406-027.md"},"ev_a7422d3665cd5b1d4ab96dcb":{"id":"ev_a7422d3665cd5b1d4ab96dcb","source_id":"src_95688f6dcb51b74773983bf1","source_kind":"maintenance","title":"MNT-0418-023","path":"assets/WELL-0418/maintenance.jsonl"},"src_c3ce1abca994f4369a9123d1":{"id":"src_c3ce1abca994f4369a9123d1","source_id":"src_c3ce1abca994f4369a9123d1","source_kind":"report","title":"assets/WELL-0418/maintenance-reports/MNT-0418-023.md","path":"assets/WELL-0418/maintenance-reports/MNT-0418-023.md"},"ev_66ce42016739acdb85ea3046":{"id":"ev_66ce42016739acdb85ea3046","source_id":"src_8aa70bd204f0e279609dc6b4","source_kind":"maintenance","title":"MNT-0328-031","path":"assets/WELL-0328/maintenance.jsonl"},"src_4bbaaee5908db7826219cfca":{"id":"src_4bbaaee5908db7826219cfca","source_id":"src_4bbaaee5908db7826219cfca","source_kind":"report","title":"assets/WELL-0328/maintenance-reports/MNT-0328-031.md","path":"assets/WELL-0328/maintenance-reports/MNT-0328-031.md"},"ev_69c5e3d48d53db3316df4fbd":{"id":"ev_69c5e3d48d53db3316df4fbd","source_id":"src_6ec4f23662604dd1fc1ed97e","source_kind":"maintenance","title":"MNT-0374-027","path":"assets/WELL-0374/maintenance.jsonl"},"src_97fe54f06e714

948f15e6aaf":{"id":"src_97fe54f06e714948f15e6aaf","source_id":"src_97fe54f06e714948f15e6aaf","source_kind":"report","t
itle":"assets/WELL-0374/maintenance-reports/MNT-0374-027.md","path":"assets/WELL-0374/maintenance-reports/MNT-0374-027
.md"},"ev_45e6fac2ea71938828cb47a1":{"id":"ev_45e6fac2ea71938828cb47a1","source_id":"src_79472219d9c331a124bab7f8","so
urce_kind":"maintenance","title":"MNT-0421-030","path":"assets/WELL-0421/maintenance.jsonl"},"src_561c3829028e2dca2ed1
1a1d":{"id":"src_561c3829028e2dca2ed11a1d","source_id":"src_561c3829028e2dca2ed11a1d","source_kind":"report","title":"
assets/WELL-0421/maintenance-reports/MNT-0421-030.md","path":"assets/WELL-0421/maintenance-reports/MNT-0421-030.md"},"
ev_3fbd416f69fdfdad0471a09c":{"id":"ev_3fbd416f69fdfdad0471a09c","source_id":"src_121f331131b4e5337f368064","source_ki
nd":"maintenance","title":"MNT-0439-032","path":"assets/WELL-0439/maintenance.jsonl"},"src_e341c61d637849e8ee6866d7":{
"id":"src_e341c61d637849e8ee6866d7","source_id":"src_e341c61d637849e8ee6866d7","source_kind":"report","title":"assets/
WELL-0439/maintenance-reports/MNT-0439-032.md","path":"assets/WELL-0439/maintenance-reports/MNT-0439-032.md"},"ev_d4aa
b08eb27abda8259fc5ea":{"id":"ev_d4aab08eb27abda8259fc5ea","source_id":"src_24f95d37d839326b70030d2c","source_kind":"ma
intenance","title":"MNT-0307-029","path":"assets/WELL-0307/maintenance.jsonl"},"src_af9d6b3a0e7f322da5d7fe8b":{"id":"s
rc_af9d6b3a0e7f322da5d7fe8b","source_id":"src_af9d6b3a0e7f322da5d7fe8b","source_kind":"report","title":"assets/WELL-03
07/maintenance-reports/MNT-0307-029.md","path":"assets/WELL-0307/maintenance-reports/MNT-0307-029.md"},"ev_61b422ab998
4d76fd44e2111":{"id":"ev_61b422ab9984d76fd44e2111","source_id":"src_70f5bbb2e3e2b231d093e363","source_kind":"maintenan
ce","title":"MNT-0342-028","path":"assets/WELL-0342/maintenance.jsonl"},"src_c7ed2c819dda00bb4e405a07":{"id":"src_c7ed
2c819dda00bb4e405a07","source_id":"src_c7ed2c819dda00bb4e405a07","source_kind":"report","title":"assets/WELL-0342/main
tenance-reports/MNT-0342-028.md","path":"assets/WELL-0342/maintenance-reports/MNT-0342-028.md"},"ev_c724a9d6c193bc0117
79612e":{"id":"ev_c724a9d6c193bc011779612e","source_id":"src_9bfed29edf2da1146e5c312d","source_kind":"maintenance","ti
tle":"MNT-0380-032","path":"assets/WELL-0380/maintenance.jsonl"},"src_002eb9d299d42f0b67511af4":{"id":"src_002eb9d299d
42f0b67511af4","source_id":"src_002eb9d299d42f0b67511af4","source_kind":"report","title":"assets/WELL-0380/maintenance
-reports/MNT-0380-032.md","path":"assets/WELL-0380/maintenance-reports/MNT-0380-032.md"},"ev_86a2f4c169b95ec08336b713"
:{"id":"ev_86a2f4c169b95ec08336b713","source_id":"src_c01b4d40346a648487385d44","source_kind":"maintenance","title":"M
NT-0346-029","path":"assets/WELL-0346/maintenance.jsonl"},"src_7a639c61313a9830ce919ac5":{"id":"src_7a639c61313a9830ce
919ac5","source_id":"src_7a639c61313a9830ce919ac5","source_kind":"report","title":"assets/WELL-0346/maintenance-report
s/MNT-0346-029.md","path":"assets/WELL-0346/maintenance-reports/MNT-0346-029.md"},"ev_dc6be84b8fd86918cd74a3a5":{"id":
"ev_dc6be84b8fd86918cd74a3a5","source_id":"src_c7f686ae3102ba649e95472f","source_kind":"maintenance","title":"MNT-0313
-027","path":"assets/WELL-0313/maintenance.jsonl"},"src_502b9276e551fb957cc96c0c":{"id":"src_502b9276e551fb957cc96c0c"
,"source_id":"src_502b9276e551fb957cc96c0c","source_kind":"report","title":"assets/WELL-0313/maintenance-reports/MNT-0
313-027.md","path":"assets/WELL-0313/maintenance-reports/MNT-0313-027.md"},"ev_f9a74c9ba9cbd11d5938d8af":{"id":"ev_f9a
74c9ba9cbd11d5938d8af","source_id":"src_ac5c9812770f3adba20437c3","source_kind":"maintenance","title":"MNT-0405-024","
path":"assets/WELL-0405/maintenance.jsonl"},"src_22fe96d0163065fc5fa02c9f":{"id":"src_22fe96d0163065fc5fa02c9f","sourc
e_id":"src_22fe96d0163065fc5fa02c9f","source_kind":"report","title":"assets/WELL-0405/maintenance-reports/MNT-0405-024
.md","path":"assets/WELL-0405/maintenance-reports/MNT-0405-024.md"},"ev_612e68a97d101adf6a327a5c":{"id":"ev_612e68a97d
101adf6a327a5c","source_id":"src_552e7f950da3d9067187793c","source_kind":"maintenance","title":"MNT-0340-030","path":"
assets/WELL-0340/maintenance.jsonl"},"src_56425f889d7c95860f114e0f":{"id":"src_56425f889d7c95860f114e0f","source_id":"
src_56425f889d7c95860f114e0f","source_kind":"report","title":"assets/WELL-0340/maintenance-reports/MNT-0340-030.md","p
ath":"assets/WELL-0340/maintenance-reports/MNT-0340-030.md"},"ev_28fc8d37c417481415f88d8b":{"id":"ev_28fc8d37c41748141
5f88d8b","source_id":"src_6ec4f23662604dd1fc1ed97e","source_kind":"maintenance","title":"MNT-0374-022","path":"assets/
WELL-0374/maintenance.jsonl"},"src_1d39924633856589ae3e05b2":{"id":"src_1d39924633856589ae3e05b2","source_id":"src_1d3
9924633856589ae3e05b2","source_kind":"report","title":"assets/WELL-0374/maintenance-reports/MNT-0374-022.md","path":"a
ssets/WELL-0374/maintenance-reports/MNT-0374-022.md"},"ev_505772d59100fef73bc8e63a":{"id":"ev_505772d59100fef73bc8e63a
","source_id":"src_744c6d6432f1b4509e7f783b","source_kind":"maintenance","title":"MNT-0321-027","path":"assets/WELL-03
21/maintenance.jsonl"},"src_762a8b46fe531c1fce133100":{"id":"src_762a8b46fe531c1fce133100","source_id":"src_762a8b46fe
531c1fce133100","source_kind":"report","title":"assets/WELL-0321/maintenance-reports/MNT-0321-027.md","path":"assets/W
ELL-0321/maintenance-reports/MNT-0321-027.md"},"ev_4371b543bf6ff84ae3f16af0":{"id":"ev_4371b543bf6ff84ae3f16af0","sour
ce_id":"src_3d9cec0051458ebc99f765f2","source_kind":"maintenance","title":"MNT-0332-027","path":"assets/WELL-0332/main
tenance.jsonl"},"src_39e27954daa950bd8fb8d174":{"id":"src_39e27954daa950bd8fb8d174","source_id":"src_39e27954daa950bd8
fb8d174","source_kind":"report","title":"assets/WELL-0332/maintenance-reports/MNT-0332-027.md","path":"assets/WELL-033
2/maintenance-reports/MNT-0332-027.md"},"ev_b3b8a2f4c577a1278edbc361":{"id":"ev_b3b8a2f4c577a1278edbc361","source_id":
"src_106d27e2b9b8f64ab98f11dd","source_kind":"maintenance","title":"MNT-0301-025","path":"assets/WELL-0301/maintenance
.jsonl"},"src_7e9011ac9cbab88316c80127":{"id":"src_7e9011ac9cbab88316c80127","source_id":"src_7e9011ac9cbab88316c80127
","source_kind":"report","title":"assets/WELL-0301/maintenance-reports/MNT-0301-025.md","path":"assets/WELL-0301/maint
enance-reports/MNT-0301-025.md"},"ev_15ff9e327b9de8af7d590d86":{"id":"ev_15ff9e327b9de8af7d590d86","source_id":"src_0f
986a2cdc8a8003f1422297","source_kind":"maintenance","title":"MNT-0320-025","path":"assets/WELL-0320/maintenance.jsonl"
},"src_66a54fa44082233f36cff29c":{"id":"src_66a54fa44082233f36cff29c","source_id":"src_66a54fa44082233f36cff29c","sour
ce_kind":"report","title":"assets/WELL-0320/maintenance-reports/MNT-0320-025.md","path":"assets/WELL-0320/maintenance-
reports/MNT-0320-025.md"},"ev_cc4f0c61f3d522b58d110ba2":{"id":"ev_cc4f0c61f3d522b58d110ba2","source_id":"src_4f5739b27
79c8772982ccb28","source_kind":"maintenance","title":"MNT-0357-023","path":"assets/WELL-0357/maintenance.jsonl"},"src_
2adc24b08c7ca8832afcbed7":{"id":"src_2adc24b08c7ca8832afcbed7","source_id":"src_2adc24b08c7ca8832afcbed7","source_kind
":"report","title":"assets/WELL-0357/maintenance-reports/MNT-0357-023.md","path":"assets/WELL-0357/maintenance-reports
/MNT-0357-023.md"},"ev_8f25e7be899931e7e65b1f09":{"id":"ev_8f25e7be899931e7e65b1f09","source_id":"src_121f331131b4e533
7f368064","source_kind":"maintenance","title":"MNT-0439-024","path":"assets/WELL-0439/maintenance.jsonl"},"src_ea9362e
84cbb73c55ab224ee":{"id":"src_ea9362e84cbb73c55ab224ee","source_id":"src_ea9362e84cbb73c55ab224ee","source_kind":"repo
rt","title":"assets/WELL-0439/maintenance-reports/MNT-0439-024.md","path":"assets/WELL-0439/maintenance-reports/MNT-04
39-024.md"},"ev_df0e26143b09acbddfd0b7ff":{"id":"ev_df0e26143b09acbddfd0b7ff","source_id":"src_152bde0ec8cb5ca8ea97dae
d","source_kind":"maintenance","title":"MNT-0368-028","path":"assets/WELL-0368/maintenance.jsonl"},"src_6f9edb16dd2fe6
ca1c3784c6":{"id":"src_6f9edb16dd2fe6ca1c3784c6","source_id":"src_6f9edb16dd2fe6ca1c3784c6","source_kind":"report","ti
tle":"assets/WELL-0368/maintenance-reports/MNT-0368-028.md","path":"assets/WELL-0368/maintenance-reports/MNT-0368-028.
md"},"ev_044ff4451804e1d5d6f4b987":{"id":"ev_044ff4451804e1d5d6f4b987","source_id":"src_e36e6241ca666926581e11cd","sou
rce_kind":"maintenance","title":"MNT-0443-025","path":"assets/WELL-0443/maintenance.jsonl"},"src_22d2b5df079d4c321c432
f06":{"id":"src_22d2b5df079d4c321c432f06","source_id":"src_22d2b5df079d4c321c432f06","source_kind":"report","title":"a
ssets/WELL-0443/maintenance-reports/MNT-0443-025.md","path":"assets/WELL-0443/maintenance-reports/MNT-0443-025.md"},"e
v_1ee3ef10a12d1b2ee37475ac":{"id":"ev_1ee3ef10a12d1b2ee37475ac","source_id":"src_2832a5293ce1d43273f8853c","source_kin
d":"maintenance","title":"MNT-0323-025","path":"assets/WELL-0323/maintenance.jsonl"},"src_b33049dddfe8c61e3d284e6f":{"
id":"src_b33049dddfe8c61e3d284e6f","source_id":"src_b33049dddfe8c61e3d284e6f","source_kind":"report","title":"assets/W
ELL-0323/maintenance-reports/MNT-0323-025.md","path":"assets/WELL-0323/maintenance-reports/MNT-0323-025.md"},"ev_4ae31
55fab5b73723615c081":{"id":"ev_4ae3155fab5b73723615c081","source_id":"src_417cd7870970f1cde0142669","source_kind":"mai
ntenance","title":"MNT-0316-022","path":"assets/WELL-0316/maintenance.jsonl"},"src_6de2b6ad865224603db67be6":{"id":"sr
c_6de2b6ad865224603db67be6","source_id":"src_6de2b6ad865224603db67be6","source_kind":"report","title":"assets/WELL-031
6/maintenance-reports/MNT-0316-022.md","path":"assets/WELL-0316/maintenance-reports/MNT-0316-022.md"},"ev_b3c51d283fbf
fb0514efa4fd":{"id":"ev_b3c51d283fbffb0514efa4fd","source_id":"src_c77df25bea0ab194ccb5d5f0","source_kind":"maintenanc
e","title":"MNT-0381-027","path":"assets/WELL-0381/maintenance.jsonl"},"src_0431046d8f8683a14312375e":{"id":"src_04310
46d8f8683a14312375e","source_id":"src_0431046d8f8683a14312375e","source_kind":"report","title":"assets/WELL-0381/maint
enance-reports/MNT-0381-027.md","path":"assets/WELL-0381/maintenance-reports/MNT-0381-027.md"},"ev_9c56b4342f4376792c8

d8ae5":{"id":"ev_9c56b4342f4376792c8d8ae5","source_id":"src_084a3746292c1fc5b4a45b4d","source_kind":"maintenance","title":"MNT-0302-027","path":"assets/WELL-0302/maintenance.jsonl"},"src_7bcf750665ce12dc9bd92fa7":{"id":"src_7bcf750665ce12dc9bd92fa7","source_id":"src_7bcf750665ce12dc9bd92fa7","source_kind":"report","title":"assets/WELL-0302/maintenance-reports/MNT-0302-027.md","path":"assets/WELL-0302/maintenance-reports/MNT-0302-027.md"},"ev_abc8e6b2375ed2520d13e1ff":{"id":"ev_abc8e6b2375ed2520d13e1ff","source_id":"src_552e7f950da3d9067187793c","source_kind":"maintenance","title":"MNT-0340-032","path":"assets/WELL-0340/maintenance.jsonl"},"src_dce7ed79b776c87e37eca95b":{"id":"src_dce7ed79b776c87e37eca95b","source_id":"src_dce7ed79b776c87e37eca95b","source_kind":"report","title":"assets/WELL-0340/maintenance-reports/MNT-0340-032.md","path":"assets/WELL-0340/maintenance-reports/MNT-0340-032.md"},"ev_2a18625fa72f3a79235247da":{"id":"ev_2a18625fa72f3a79235247da","source_id":"src_8c36500b65022d545dd82269","source_kind":"maintenance","title":"MNT-0326-021","path":"assets/WELL-0326/maintenance.jsonl"},"src_1883e5886d0576a126095a37":{"id":"src_1883e5886d0576a126095a37","source_id":"src_1883e5886d0576a126095a37","source_kind":"report","title":"assets/WELL-0326/maintenance-reports/MNT-0326-021.md","path":"assets/WELL-0326/maintenance-reports/MNT-0326-021.md"},"ev_fb22e1b81c0ec03147ecf3f7":{"id":"ev_fb22e1b81c0ec03147ecf3f7","source_id":"src_59e31278b36cf3600432f9db","source_kind":"maintenance","title":"MNT-0318-026","path":"assets/WELL-0318/maintenance.jsonl"},"src_dc4de9efbb85ab7e6647b8ef":{"id":"src_dc4de9efbb85ab7e6647b8ef","source_id":"src_dc4de9efbb85ab7e6647b8ef","source_kind":"report","title":"assets/WELL-0318/maintenance-reports/MNT-0318-026.md","path":"assets/WELL-0318/maintenance-reports/MNT-0318-026.md"},"ev_243aef10ac4ad651eb5b0699":{"id":"ev_243aef10ac4ad651eb5b0699","source_id":"src_6d21d56f64c4fddf40952721","source_kind":"maintenance","title":"MNT-0401-028","path":"assets/WELL-0401/maintenance.jsonl"},"src_9a37e47dfdd575cc35561842":{"id":"src_9a37e47dfdd575cc35561842","source_id":"src_9a37e47dfdd575cc35561842","source_kind":"report","title":"assets/WELL-0401/maintenance-reports/MNT-0401-028.md","path":"assets/WELL-0401/maintenance-reports/MNT-0401-028.md"},"ev_5a5b9a571fa297923ec623da":{"id":"ev_5a5b9a571fa297923ec623da","source_id":"src_9ee53afbf6d80ac363ea3fbb","source_kind":"maintenance","title":"MNT-0414-028","path":"assets/WELL-0414/maintenance.jsonl"},"src_323403ad26f2445d709d580b":{"id":"src_323403ad26f2445d709d580b","source_id":"src_323403ad26f2445d709d580b","source_kind":"report","title":"assets/WELL-0414/maintenance-reports/MNT-0414-028.md","path":"assets/WELL-0414/maintenance-reports/MNT-0414-028.md"},"ev_54f6ee05b0dcd85ef57a42db":{"id":"ev_54f6ee05b0dcd85ef57a42db","source_id":"src_e973d29e048289261aaedc83","source_kind":"maintenance","title":"MNT-0330-024","path":"assets/WELL-0330/maintenance.jsonl"},"src_928ec16045e93b67ea6eb5e0":{"id":"src_928ec16045e93b67ea6eb5e0","source_id":"src_928ec16045e93b67ea6eb5e0","source_kind":"report","title":"assets/WELL-0330/maintenance-reports/MNT-0330-024.md","path":"assets/WELL-0330/maintenance-reports/MNT-0330-024.md"},"ev_a4f084bdb4673cae4519e7b8":{"id":"ev_a4f084bdb4673cae4519e7b8","source_id":"src_e973d29e048289261aaedc83","source_kind":"maintenance","title":"MNT-0330-025","path":"assets/WELL-0330/maintenance.jsonl"},"src_5655c4aa359e3649943546bf":{"id":"src_5655c4aa359e3649943546bf","source_id":"src_5655c4aa359e3649943546bf","source_kind":"report","title":"assets/WELL-0330/maintenance-reports/MNT-0330-025.md","path":"assets/WELL-0330/maintenance-reports/MNT-0330-025.md"},"ev_eb0aec3aa473ea3f47fd1682":{"id":"ev_eb0aec3aa473ea3f47fd1682","source_id":"src_744c6d6432f1b4509e7f783b","source_kind":"maintenance","title":"MNT-0321-030","path":"assets/WELL-0321/maintenance.jsonl"},"src_353d61f103b3398a06ded2ff":{"id":"src_353d61f103b3398a06ded2ff","source_id":"src_353d61f103b3398a06ded2ff","source_kind":"report","title":"assets/WELL-0321/maintenance-reports/MNT-0321-030.md","path":"assets/WELL-0321/maintenance-reports/MNT-0321-030.md"},"ev_f81fb20f27982d89ec56f2d5":{"id":"ev_f81fb20f27982d89ec56f2d5","source_id":"src_ec59e111a5c376e4139ad1df","source_kind":"maintenance","title":"MNT-0376-028","path":"assets/WELL-0376/maintenance.jsonl"},"src_0a99f72757c0eb0d0a601115":{"id":"src_0a99f72757c0eb0d0a601115","source_id":"src_0a99f72757c0eb0d0a601115","source_kind":"report","title":"assets/WELL-0376/maintenance-reports/MNT-0376-028.md","path":"assets/WELL-0376/maintenance-reports/MNT-0376-028.md"},"ev_a4b039457428693750736ee8":{"id":"ev_a4b039457428693750736ee8","source_id":"src_95255d152d5cfec96c727380","source_kind":"maintenance","title":"MNT-0363-030","path":"assets/WELL-0363/maintenance.jsonl"},"src_651481483bdc14d6bc069416":{"id":"src_651481483bdc14d6bc069416","source_id":"src_651481483bdc14d6bc069416","source_kind":"report","title":"assets/WELL-0363/maintenance-reports/MNT-0363-030.md","path":"assets/WELL-0363/maintenance-reports/MNT-0363-030.md"},"ev_c3c922d03183791b64a66f4a":{"id":"ev_c3c922d03183791b64a66f4a","source_id":"src_c77df25bea0ab194ccb5d5f0","source_kind":"maintenance","title":"MNT-0381-030","path":"assets/WELL-0381/maintenance.jsonl"},"src_c443828e9610589d038da845":{"id":"src_c443828e9610589d038da845","source_id":"src_c443828e9610589d038da845","source_kind":"report","title":"assets/WELL-0381/maintenance-reports/MNT-0381-030.md","path":"assets/WELL-0381/maintenance-reports/MNT-0381-030.md"},"ev_dc7b595c6c8de4d7d6691b87":{"id":"ev_dc7b595c6c8de4d7d6691b87","source_id":"src_9ee53afbf6d80ac363ea3fbb","source_kind":"maintenance","title":"MNT-0414-031","path":"assets/WELL-0414/maintenance.jsonl"},"src_ec34d9c6e90bbd6816a86ce9":{"id":"src_ec34d9c6e90bbd6816a86ce9","source_id":"src_ec34d9c6e90bbd6816a86ce9","source_kind":"report","title":"assets/WELL-0414/maintenance-reports/MNT-0414-031.md","path":"assets/WELL-0414/maintenance-reports/MNT-0414-031.md"},"ev_d547f52b3f5024755ab32055":{"id":"ev_d547f52b3f5024755ab32055","source_id":"src_2b0ad0f4ba05fd7a79f8a75e","source_kind":"maintenance","title":"MNT-0341-016","path":"assets/WELL-0341/maintenance.jsonl"},"src_a2131ed7fd459e260438baf5":{"id":"src_a2131ed7fd459e260438baf5","source_id":"src_a2131ed7fd459e260438baf5","source_kind":"report","title":"assets/WELL-0341/maintenance-reports/MNT-0341-016.md","path":"assets/WELL-0341/maintenance-reports/MNT-0341-016.md"},"ev_93b12b6b6f12d37c9e288e87":{"id":"ev_93b12b6b6f12d37c9e288e87","source_id":"src_59e31278b36cf3600432f9db","source_kind":"maintenance","title":"MNT-0318-029","path":"assets/WELL-0318/maintenance.jsonl"},"src_6257c230b6163a119cbc6f01":{"id":"src_6257c230b6163a119cbc6f01","source_id":"src_6257c230b6163a119cbc6f01","source_kind":"report","title":"assets/WELL-0318/maintenance-reports/MNT-0318-029.md","path":"assets/WELL-0318/maintenance-reports/MNT-0318-029.md"},"ev_3681ce1e12020b684d1cada5":{"id":"ev_3681ce1e12020b684d1cada5","source_id":"src_8c36500b65022d545dd82269","source_kind":"maintenance","title":"MNT-0326-025","path":"assets/WELL-0326/maintenance.jsonl"},"src_a8708611471d869fc963053a":{"id":"src_a8708611471d869fc963053a","source_id":"src_a8708611471d869fc963053a","source_kind":"report","title":"assets/WELL-0326/maintenance-reports/MNT-0326-025.md","path":"assets/WELL-0326/maintenance-reports/MNT-0326-025.md"},"ev_2edace60c379929d206ae719":{"id":"ev_2edace60c379929d206ae719","source_id":"src_4a7136301ebae79b0bf41f1b","source_kind":"maintenance","title":"MNT-0338-028","path":"assets/WELL-0338/maintenance.jsonl"},"src_059a52b349f30fa106191927":{"id":"src_059a52b349f30fa106191927","source_id":"src_059a52b349f30fa106191927","source_kind":"report","title":"assets/WELL-0338/maintenance-reports/MNT-0338-028.md","path":"assets/WELL-0338/maintenance-reports/MNT-0338-028.md"},"ev_0ac294afc7f123159006ef3f":{"id":"ev_0ac294afc7f123159006ef3f","source_id":"src_0bffb6476be8c02ed12b7535","source_kind":"maintenance","title":"MNT-0407-029","path":"assets/WELL-0407/maintenance.jsonl"},"src_127a9816b2c42c30dcc810f9":{"id":"src_127a9816b2c42c30dcc810f9","source_id":"src_127a9816b2c42c30dcc810f9","source_kind":"report","title":"assets/WELL-0407/maintenance-reports/MNT-0407-029.md","path":"assets/WELL-0407/maintenance-reports/MNT-0407-029.md"},"ev_c65413cad5a398dd2764b556":{"id":"ev_c65413cad5a398dd2764b556","source_id":"src_d308ed6bd837039ed325b736","source_kind":"maintenance","title":"MNT-0438-030","path":"assets/WELL-0438/maintenance.jsonl"},"src_cac8fa08652fea335b85475e":{"id":"src_cac8fa08652fea335b85475e","source_id":"src_cac8fa08652fea335b85475e","source_kind":"report","title":"assets/WELL-0438/maintenance-reports/MNT-0438-030.md","path":"assets/WELL-0438/maintenance-reports/MNT-0438-030.md"},"ev_e0dc17f33bdea3e4b69d0517":{"id":"ev_e0dc17f33bdea3e4b69d0517","source_id":"src_be5c1e86d55f8f35d9177262","source_kind":"maintenance","title":"MNT-0425-031","path":"assets/WELL-0425/maintenance.jsonl"},"src_5679f6738094fe3cf04ffbbb":{"id":"src_5679f6738094fe3cf04ffbbb","source_id":"src_5679f6738094fe3cf04ffbbb","source_kind":"report","title":"assets/WELL-0425/maintenance-reports/MNT-0425-031.md","path":"assets/WELL-0425/maintenance-reports/MNT-0425-031.md"},"ev_0578d57a16787c7343ef0644":{"id":"ev_0578d57a16787c7343ef0644","source_id":"src_ac5c9812770f3adba20437c3","source_kind":"maintenance","title":"MNT-0405-030","path":"assets/WELL-0405/maintenance.jsonl"},"src_ff09479385bc8400da695601":{"id":"src_ff09479385bc8400da695601","source_id":"src_ff09479385bc8400da695601","source_kind":"report","title":"assets/WELL-0405/maintenance-reports/MNT-0405-030.md","path":"assets/WELL-0405/maintenance-reports/MNT-0405-030.md"},"ev_aacf047e9c16335e2bb41f8e":{"id":"ev_aacf047e9c16335e2bb41f8e","source_id":"src_8f1798dce5b5b91681394423","source_kind":"maintenance","title":"MNT-0404-034","path":"assets/WELL-0404/maintenance.jsonl"},"src_58a196cf75c96355f5c92b01":{"id":"src_58a196cf75c96355f5c92b01","source_id":"sr

c_58a196cf75c96355f5c92b01","source_kind":"report","title":"assets/WELL-0404/maintenance-reports/MNT-0404-034.md","path":"assets/WELL-0404/maintenance-reports/MNT-0404-034.md"},"ev_3c2d3367bbf525571dc7d801":{"id":"ev_3c2d3367bbf525571dc7d801","source_id":"src_0bce7f439efb92f6932c24ca","source_kind":"maintenance","title":"MNT-0218-023","path":"assets/WELL-0218/maintenance.jsonl"},"src_98db61e37e5b3ac4d61cfd72":{"id":"src_98db61e37e5b3ac4d61cfd72","source_id":"src_98db61e37e5b3ac4d61cfd72","source_kind":"report","title":"assets/WELL-0218/maintenance-reports/MNT-0218-023.md","path":"assets/WELL-0218/maintenance-reports/MNT-0218-023.md"},"ev_748a18fb878e56c70bb74779":{"id":"ev_748a18fb878e56c70bb74779","source_id":"src_9321f604899a1f866bd8150d","source_kind":"maintenance","title":"MNT-0217-020","path":"assets/WELL-0217/maintenance.jsonl"},"src_4b70a313ce7c8d35f6c52432":{"id":"src_4b70a313ce7c8d35f6c52432","source_id":"src_4b70a313ce7c8d35f6c52432","source_kind":"report","title":"assets/WELL-0217/maintenance-reports/MNT-0217-020.md","path":"assets/WELL-0217/maintenance-reports/MNT-0217-020.md"},"ev_d65bd4c74001da201a38cf85":{"id":"ev_d65bd4c74001da201a38cf85","source_id":"src_3efe5cabf90052b570945ff5","source_kind":"maintenance","title":"MNT-0225-027","path":"assets/WELL-0225/maintenance.jsonl"},"src_c0bc7f99b24cecdf1e19e39f":{"id":"src_c0bc7f99b24cecdf1e19e39f","source_id":"src_c0bc7f99b24cecdf1e19e39f","source_kind":"report","title":"assets/WELL-0225/maintenance-reports/MNT-0225-027.md","path":"assets/WELL-0225/maintenance-reports/MNT-0225-027.md"},"ev_4107bb2f078e5bbedbf27208":{"id":"ev_4107bb2f078e5bbedbf27208","source_id":"src_83209d1f63f46c55d8c09077","source_kind":"maintenance","title":"MNT-0226-025","path":"assets/WELL-0226/maintenance.jsonl"},"src_5c252c160d7ee804475d8470":{"id":"src_5c252c160d7ee804475d8470","source_id":"src_5c252c160d7ee804475d8470","source_kind":"report","title":"assets/WELL-0226/maintenance-reports/MNT-0226-025.md","path":"assets/WELL-0226/maintenance-reports/MNT-0226-025.md"},"ev_97124e128ade7d3be2e888b6":{"id":"ev_97124e128ade7d3be2e888b6","source_id":"src_5108efb1e7a0d73b3e85ba39","source_kind":"context","title":"CTX-0226-001","path":"assets/WELL-0226/context.jsonl"},"ev_8f7752f3ad8e43857fb6a649":{"id":"ev_8f7752f3ad8e43857fb6a649","source_id":"src_ff9e1632cfba0bf6c6405437","source_kind":"maintenance","title":"MNT-0232-023","path":"assets/WELL-0232/maintenance.jsonl"},"src_9007d0bbaf3751fbb844c954":{"id":"src_9007d0bbaf3751fbb844c954","source_id":"src_9007d0bbaf3751fbb844c954","source_kind":"report","title":"assets/WELL-0232/maintenance-reports/MNT-0232-023.md","path":"assets/WELL-0232/maintenance-reports/MNT-0232-023.md"},"ev_9b6392c9023c86ee485128a6":{"id":"ev_9b6392c9023c86ee485128a6","source_id":"src_333850f8b538c221f3e2887c","source_kind":"maintenance","title":"MNT-0209-022","path":"assets/WELL-0209/maintenance.jsonl"},"src_150730b0a046562f7afa32ae":{"id":"src_150730b0a046562f7afa32ae","source_id":"src_150730b0a046562f7afa32ae","source_kind":"report","title":"assets/WELL-0209/maintenance-reports/MNT-0209-022.md","path":"assets/WELL-0209/maintenance-reports/MNT-0209-022.md"},"ev_38ea04cfafac350b0c87c85a":{"id":"ev_38ea04cfafac350b0c87c85a","source_id":"src_4e10ed5a44063da976581f7f","source_kind":"maintenance","title":"MNT-0219-020","path":"assets/WELL-0219/maintenance.jsonl"},"src_47a2e4e64a56b04a08d5e19b":{"id":"src_47a2e4e64a56b04a08d5e19b","source_id":"src_47a2e4e64a56b04a08d5e19b","source_kind":"report","title":"assets/WELL-0219/maintenance-reports/MNT-0219-020.md","path":"assets/WELL-0219/maintenance-reports/MNT-0219-020.md"},"ev_b25eb2597c53efb92d1b9883":{"id":"ev_b25eb2597c53efb92d1b9883","source_id":"src_0332fb07f86cf7ba85d6f815","source_kind":"maintenance","title":"MNT-0213-026","path":"assets/WELL-0213/maintenance.jsonl"},"src_e95c9459903783b0fbd04056":{"id":"src_e95c9459903783b0fbd04056","source_id":"src_e95c9459903783b0fbd04056","source_kind":"report","title":"assets/WELL-0213/maintenance-reports/MNT-0213-026.md","path":"assets/WELL-0213/maintenance-reports/MNT-0213-026.md"},"ev_dc43f4b5dd9bbb0cdfaf83da":{"id":"ev_dc43f4b5dd9bbb0cdfaf83da","source_id":"src_9e05667ef4f878f78a557ac8","source_kind":"maintenance","title":"MNT-0234-022","path":"assets/WELL-0234/maintenance.jsonl"},"src_b0450242465faa6be8bd127f":{"id":"src_b0450242465faa6be8bd127f","source_id":"src_b0450242465faa6be8bd127f","source_kind":"report","title":"assets/WELL-0234/maintenance-reports/MNT-0234-022.md","path":"assets/WELL-0234/maintenance-reports/MNT-0234-022.md"},"ev_e7934996af45747240275ef2":{"id":"ev_e7934996af45747240275ef2","source_id":"src_a4f42a00d116387157518b39","source_kind":"maintenance","title":"MNT-0216-037","path":"assets/WELL-0216/maintenance.jsonl"},"src_814f061ab142460f91434f89":{"id":"src_814f061ab142460f91434f89","source_id":"src_814f061ab142460f91434f89","source_kind":"report","title":"assets/WELL-0216/maintenance-reports/MNT-0216-037.md","path":"assets/WELL-0216/maintenance-reports/MNT-0216-037.md"},"ev_5f71f7d7266a3fef3a2e757b":{"id":"ev_5f71f7d7266a3fef3a2e757b","source_id":"src_671fc5213ccc6cb2c201562d","source_kind":"maintenance","title":"MNT-0247-024","path":"assets/WELL-0247/maintenance.jsonl"},"src_0bdf16630651f3cbd28a6954":{"id":"src_0bdf16630651f3cbd28a6954","source_id":"src_0bdf16630651f3cbd28a6954","source_kind":"report","title":"assets/WELL-0247/maintenance-reports/MNT-0247-024.md","path":"assets/WELL-0247/maintenance-reports/MNT-0247-024.md"},"ev_261fb5db1bf40255e7e0c41f":{"id":"ev_261fb5db1bf40255e7e0c41f","source_id":"src_725fab078b4c389d061bbd9c","source_kind":"maintenance","title":"MNT-0205-028","path":"assets/WELL-0205/maintenance.jsonl"},"src_873634e41045367317040423":{"id":"src_873634e41045367317040423","source_id":"src_873634e41045367317040423","source_kind":"report","title":"assets/WELL-0205/maintenance-reports/MNT-0205-028.md","path":"assets/WELL-0205/maintenance-reports/MNT-0205-028.md"},"ev_31ca18dd36dff66ec1938743":{"id":"ev_31ca18dd36dff66ec1938743","source_id":"src_725fab078b4c389d061bbd9c","source_kind":"maintenance","title":"MNT-0205-023","path":"assets/WELL-0205/maintenance.jsonl"},"src_bd5d468d10fdfb09ba05c657":{"id":"src_bd5d468d10fdfb09ba05c657","source_id":"src_bd5d468d10fdfb09ba05c657","source_kind":"report","title":"assets/WELL-0205/maintenance-reports/MNT-0205-023.md","path":"assets/WELL-0205/maintenance-reports/MNT-0205-023.md"},"ev_49e25915b46e370f5696a593":{"id":"ev_49e25915b46e370f5696a593","source_id":"src_4d171dcbebf77dc1a1d28cba","source_kind":"maintenance","title":"MNT-0224-024","path":"assets/WELL-0224/maintenance.jsonl"},"src_f9d9b868a1b1afeccd91d907":{"id":"src_f9d9b868a1b1afeccd91d907","source_id":"src_f9d9b868a1b1afeccd91d907","source_kind":"report","title":"assets/WELL-0224/maintenance-reports/MNT-0224-024.md","path":"assets/WELL-0224/maintenance-reports/MNT-0224-024.md"},"ev_2923d140de4c4ce887860cea":{"id":"ev_2923d140de4c4ce887860cea","source_id":"src_4e10ed5a44063da976581f7f","source_kind":"maintenance","title":"MNT-0219-016","path":"assets/WELL-0219/maintenance.jsonl"},"src_4b3704bbd6d0c7b408cf625e":{"id":"src_4b3704bbd6d0c7b408cf625e","source_id":"src_4b3704bbd6d0c7b408cf625e","source_kind":"report","title":"assets/WELL-0219/maintenance-reports/MNT-0219-016.md","path":"assets/WELL-0219/maintenance-reports/MNT-0219-016.md"},"ev_0d39716dad954e1f36f6296f":{"id":"ev_0d39716dad954e1f36f6296f","source_id":"src_9321f604899a1f866bd8150d","source_kind":"maintenance","title":"MNT-0217-022","path":"assets/WELL-0217/maintenance.jsonl"},"src_e5315452594459831600d4bf":{"id":"src_e5315452594459831600d4bf","source_id":"src_e5315452594459831600d4bf","source_kind":"report","title":"assets/WELL-0217/maintenance-reports/MNT-0217-022.md","path":"assets/WELL-0217/maintenance-reports/MNT-0217-022.md"},"ev_b256baf12a714820b5e2650c":{"id":"ev_b256baf12a714820b5e2650c","source_id":"src_842acf3f3f0867e99b5aa34b","source_kind":"maintenance","title":"MNT-0204-024","path":"assets/WELL-0204/maintenance.jsonl"},"src_c3474f2d8e1480b90af6293a":{"id":"src_c3474f2d8e1480b90af6293a","source_id":"src_c3474f2d8e1480b90af6293a","source_kind":"report","title":"assets/WELL-0204/maintenance-reports/MNT-0204-024.md","path":"assets/WELL-0204/maintenance-reports/MNT-0204-024.md"},"ev_3589466cdb2224d160cf3573":{"id":"ev_3589466cdb2224d160cf3573","source_id":"src_671fc5213ccc6cb2c201562d","source_kind":"maintenance","title":"MNT-0247-030","path":"assets/WELL-0247/maintenance.jsonl"},"src_dd31ec6534dedd7c026ea63c":{"id":"src_dd31ec6534dedd7c026ea63c","source_id":"src_dd31ec6534dedd7c026ea63c","source_kind":"report","title":"assets/WELL-0247/maintenance-reports/MNT-0247-030.md","path":"assets/WELL-0247/maintenance-reports/MNT-0247-030.md"},"ev_ba580e6799060722db6cc430":{"id":"ev_ba580e6799060722db6cc430","source_id":"src_7e8e713994b87641481fb9b8","source_kind":"maintenance","title":"MNT-0229-014","path":"assets/WELL-0229/maintenance.jsonl"},"src_e2bdf300804061ae0ab30145":{"id":"src_e2bdf300804061ae0ab30145","source_id":"src_e2bdf300804061ae0ab30145","source_kind":"report","title":"assets/WELL-0229/maintenance-reports/MNT-0229-014.md","path":"assets/WELL-0229/maintenance-reports/MNT-0229-014.md"},"ev_2c2c744e1595f1ba4a19c058":{"id":"ev_2c2c744e1595f1ba4a19c058","source_id":"src_abe3e4acb956d025e75710b3","source_kind":"maintenance","title":"MNT-0236-032","path":"assets/WELL-0236/maintenance.jsonl"},"src_72ca961174409d83d567cb23":{"id":"src_72ca961174409d83d567cb23","source_id":"src_72ca961174409d83d567cb23","source_kind":"report","title":"assets/WELL-0236/maintenance-reports/MNT-0236-032.md","path":"assets/WELL-0236/maintenance-reports/MNT-0236-032.md"},"ev_dd34374c41c4ef38b10eb335":{"id":"ev_dd34374c41c4ef38b10eb335","source_id":"src_28c9b94dce8be712a0aa8f9d","source_kind":"maintenance","title":"MNT-0238-027","path":"assets/WELL-0238/maintenance.jsonl"},"src_53e55688feba4e4582ccd509":{"id":"src_53e55688feba4e4582ccd509","source_id":"src_53e55688feba4e4582ccd509","source_kind":"report","title":"assets/W

ELL-0238/maintenance-reports/MNT-0238-027.md","path":"assets/WELL-0238/maintenance-reports/MNT-0238-027.md"},"ev_db1da4c6ef9c5582d8449b79":{"id":"ev_db1da4c6ef9c5582d8449b79","source_id":"src_8e89f51e77b6a12e8bc1e27c","source_kind":"maintenance","title":"MNT-0240-034","path":"assets/WELL-0240/maintenance.jsonl"},"src_8f8df3e6f80e62da393953bb":{"id":"src_8f8df3e6f80e62da393953bb","source_id":"src_8f8df3e6f80e62da393953bb","source_kind":"report","title":"assets/WELL-0240/maintenance-reports/MNT-0240-034.md","path":"assets/WELL-0240/maintenance-reports/MNT-0240-034.md"},"ev_714f9f8f71fa0ea99e0ad02c":{"id":"ev_714f9f8f71fa0ea99e0ad02c","source_id":"src_a4f42a00d116387157518b39","source_kind":"maintenance","title":"MNT-0216-034","path":"assets/WELL-0216/maintenance.jsonl"},"src_ac53f00c84601d521cca7005":{"id":"src_ac53f00c84601d521cca7005","source_id":"src_ac53f00c84601d521cca7005","source_kind":"report","title":"assets/WELL-0216/maintenance-reports/MNT-0216-034.md","path":"assets/WELL-0216/maintenance-reports/MNT-0216-034.md"},"ev_7535b1c038468254e73553fd":{"id":"ev_7535b1c038468254e73553fd","source_id":"src_be59d53175903cf45f3cdce4","source_kind":"maintenance","title":"MNT-0248-025","path":"assets/WELL-0248/maintenance.jsonl"},"src_f5398dd0139989802472dfa7":{"id":"src_f5398dd0139989802472dfa7","source_id":"src_f5398dd0139989802472dfa7","source_kind":"report","title":"assets/WELL-0248/maintenance-reports/MNT-0248-025.md","path":"assets/WELL-0248/maintenance-reports/MNT-0248-025.md"},"ev_5f87189087c978a425fc648e":{"id":"ev_5f87189087c978a425fc648e","source_id":"src_0332fb07f86cf7ba85d6f815","source_kind":"maintenance","title":"MNT-0213-028","path":"assets/WELL-0213/maintenance.jsonl"},"src_f7f37fbcbe6fe88e2829f487":{"id":"src_f7f37fbcbe6fe88e2829f487","source_id":"src_f7f37fbcbe6fe88e2829f487","source_kind":"report","title":"assets/WELL-0213/maintenance-reports/MNT-0213-028.md","path":"assets/WELL-0213/maintenance-reports/MNT-0213-028.md"},"ev_201b292d8ac97b75c14cff3d":{"id":"ev_201b292d8ac97b75c14cff3d","source_id":"src_b5bb5376e5e45285f3747f73","source_kind":"maintenance","title":"MNT-0210-025","path":"assets/WELL-0210/maintenance.jsonl"},"src_37b382e910fa1cf84881d149":{"id":"src_37b382e910fa1cf84881d149","source_id":"src_37b382e910fa1cf84881d149","source_kind":"report","title":"assets/WELL-0210/maintenance-reports/MNT-0210-025.md","path":"assets/WELL-0210/maintenance-reports/MNT-0210-025.md"},"ev_5eaabd2831a784e37e3797ca":{"id":"ev_5eaabd2831a784e37e3797ca","source_id":"src_583b8f34eb4b3b335c4bd6bc","source_kind":"maintenance","title":"MNT-0520-026","path":"assets/WELL-0520/maintenance.jsonl"},"src_ae640db045def4e3bf209356":{"id":"src_ae640db045def4e3bf209356","source_id":"src_ae640db045def4e3bf209356","source_kind":"report","title":"assets/WELL-0520/maintenance-reports/MNT-0520-026.md","path":"assets/WELL-0520/maintenance-reports/MNT-0520-026.md"},"ev_a50e1c93a4f1becca939cd2a":{"id":"ev_a50e1c93a4f1becca939cd2a","source_id":"src_b81ddfbbaa00111644dc9843","source_kind":"context","title":"CTX-0520-001","path":"assets/WELL-0520/context.jsonl"},"ev_f8096426a0f0c051cf065231":{"id":"ev_f8096426a0f0c051cf065231","source_id":"src_5fe209075963711c4ec622f2","source_kind":"maintenance","title":"MNT-0498-024","path":"assets/WELL-0498/maintenance.jsonl"},"src_3ff828440508457dc197598b":{"id":"src_3ff828440508457dc197598b","source_id":"src_3ff828440508457dc197598b","source_kind":"report","title":"assets/WELL-0498/maintenance-reports/MNT-0498-024.md","path":"assets/WELL-0498/maintenance-reports/MNT-0498-024.md"},"ev_7922e76b67500cd8cd8fb6de":{"id":"ev_7922e76b67500cd8cd8fb6de","source_id":"src_6bb4fde97fdc590a1ed8ef71","source_kind":"context","title":"CTX-0498-001","path":"assets/WELL-0498/context.jsonl"},"ev_3d77c114878823fdde11d11d":{"id":"ev_3d77c114878823fdde11d11d","source_id":"src_9c1a8e77cc2b82bed6b56df3","source_kind":"maintenance","title":"MNT-0546-024","path":"assets/WELL-0546/maintenance.jsonl"},"src_d7e9f4eb8391a9c752282387":{"id":"src_d7e9f4eb8391a9c752282387","source_id":"src_d7e9f4eb8391a9c752282387","source_kind":"report","title":"assets/WELL-0546/maintenance-reports/MNT-0546-024.md","path":"assets/WELL-0546/maintenance-reports/MNT-0546-024.md"},"ev_416b50b34adcf4e9c391de3e":{"id":"ev_416b50b34adcf4e9c391de3e","source_id":"src_3e9bbe49277aa4f833e42f6c","source_kind":"maintenance","title":"MNT-0577-023","path":"assets/WELL-0577/maintenance.jsonl"},"src_3f43220a9519374014e8cc02":{"id":"src_3f43220a9519374014e8cc02","source_id":"src_3f43220a9519374014e8cc02","source_kind":"report","title":"assets/WELL-0577/maintenance-reports/MNT-0577-023.md","path":"assets/WELL-0577/maintenance-reports/MNT-0577-023.md"},"ev_7c8e622c02b7f519f35e4fba":{"id":"ev_7c8e622c02b7f519f35e4fba","source_id":"src_9812e8be6aea9d6c29757f23","source_kind":"maintenance","title":"MNT-0472-019","path":"assets/WELL-0472/maintenance.jsonl"},"src_76f9bf2a729aece8df83d853":{"id":"src_76f9bf2a729aece8df83d853","source_id":"src_76f9bf2a729aece8df83d853","source_kind":"report","title":"assets/WELL-0472/maintenance-reports/MNT-0472-019.md","path":"assets/WELL-0472/maintenance-reports/MNT-0472-019.md"},"ev_a1cfca763d2a2c55c146237a":{"id":"ev_a1cfca763d2a2c55c146237a","source_id":"src_e92cd1856878d472e4731220","source_kind":"maintenance","title":"MNT-0561-027","path":"assets/WELL-0561/maintenance.jsonl"},"src_0d22e33492a8e23cd2780fd3":{"id":"src_0d22e33492a8e23cd2780fd3","source_id":"src_0d22e33492a8e23cd2780fd3","source_kind":"report","title":"assets/WELL-0561/maintenance-reports/MNT-0561-027.md","path":"assets/WELL-0561/maintenance-reports/MNT-0561-027.md"},"ev_cf36b88f757fa82317a681af":{"id":"ev_cf36b88f757fa82317a681af","source_id":"src_bd568a9255716f1e2e81a545","source_kind":"maintenance","title":"MNT-0599-024","path":"assets/WELL-0599/maintenance.jsonl"},"src_801702a428a9cf30533482d4":{"id":"src_801702a428a9cf30533482d4","source_id":"src_801702a428a9cf30533482d4","source_kind":"report","title":"assets/WELL-0599/maintenance-reports/MNT-0599-024.md","path":"assets/WELL-0599/maintenance-reports/MNT-0599-024.md"},"ev_d2880046217273f1955c22d8":{"id":"ev_d2880046217273f1955c22d8","source_id":"src_3d645a913cee059128629f1f","source_kind":"maintenance","title":"MNT-0597-024","path":"assets/WELL-0597/maintenance.jsonl"},"src_5d8fc59f7ba7d9567776f565":{"id":"src_5d8fc59f7ba7d9567776f565","source_id":"src_5d8fc59f7ba7d9567776f565","source_kind":"report","title":"assets/WELL-0597/maintenance-reports/MNT-0597-024.md","path":"assets/WELL-0597/maintenance-reports/MNT-0597-024.md"},"ev_eb98dd01a31c24d348dcf7ba":{"id":"ev_eb98dd01a31c24d348dcf7ba","source_id":"src_514d3287e5117e303534f2ae","source_kind":"maintenance","title":"MNT-0592-023","path":"assets/WELL-0592/maintenance.jsonl"},"src_b2731be2bf7b3f8995accaf3":{"id":"src_b2731be2bf7b3f8995accaf3","source_id":"src_b2731be2bf7b3f8995accaf3","source_kind":"report","title":"assets/WELL-0592/maintenance-reports/MNT-0592-023.md","path":"assets/WELL-0592/maintenance-reports/MNT-0592-023.md"},"ev_85ce9d49f159213ec48b4b31":{"id":"ev_85ce9d49f159213ec48b4b31","source_id":"src_de9dda352620a54626693dac","source_kind":"maintenance","title":"MNT-0466-023","path":"assets/WELL-0466/maintenance.jsonl"},"src_6e77ef92b17aaae45512a195":{"id":"src_6e77ef92b17aaae45512a195","source_id":"src_6e77ef92b17aaae45512a195","source_kind":"report","title":"assets/WELL-0466/maintenance-reports/MNT-0466-023.md","path":"assets/WELL-0466/maintenance-reports/MNT-0466-023.md"},"ev_eb4c218bd66981dda0479367":{"id":"ev_eb4c218bd66981dda0479367","source_id":"src_c74824cf03842f6b25622914","source_kind":"context","title":"CTX-0466-001","path":"assets/WELL-0466/context.jsonl"},"ev_cbda0f34bc40ea28eb3fa818":{"id":"ev_cbda0f34bc40ea28eb3fa818","source_id":"src_3371595e06dfe10d78768ce0","source_kind":"maintenance","title":"MNT-0568-027","path":"assets/WELL-0568/maintenance.jsonl"},"src_5a42ba76ec221cb07b456b7f":{"id":"src_5a42ba76ec221cb07b456b7f","source_id":"src_5a42ba76ec221cb07b456b7f","source_kind":"report","title":"assets/WELL-0568/maintenance-reports/MNT-0568-027.md","path":"assets/WELL-0568/maintenance-reports/MNT-0568-027.md"},"ev_9228edd060d1ecd36a8d600d":{"id":"ev_9228edd060d1ecd36a8d600d","source_id":"src_6ce9ead1ea030fd9a93c7d60","source_kind":"maintenance","title":"MNT-0499-025","path":"assets/WELL-0499/maintenance.jsonl"},"src_94aa77b1a78d9d158660f7a2":{"id":"src_94aa77b1a78d9d158660f7a2","source_id":"src_94aa77b1a78d9d158660f7a2","source_kind":"report","title":"assets/WELL-0499/maintenance-reports/MNT-0499-025.md","path":"assets/WELL-0499/maintenance-reports/MNT-0499-025.md"},"ev_e2e261b0ad8449f799520094":{"id":"ev_e2e261b0ad8449f799520094","source_id":"src_7e353e2e0f0ff08efdde09d0","source_kind":"maintenance","title":"MNT-0477-025","path":"assets/WELL-0477/maintenance.jsonl"},"src_889b95419b8021703ab5277e":{"id":"src_889b95419b8021703ab5277e","source_id":"src_889b95419b8021703ab5277e","source_kind":"report","title":"assets/WELL-0477/maintenance-reports/MNT-0477-025.md","path":"assets/WELL-0477/maintenance-reports/MNT-0477-025.md"},"ev_74e3b7b47b94dbd93fb2357d":{"id":"ev_74e3b7b47b94dbd93fb2357d","source_id":"src_fc01c45ba8358933f4bcabea","source_kind":"maintenance","title":"MNT-0517-026","path":"assets/WELL-0517/maintenance.jsonl"},"src_ddadcd30a55dd37b8b8a94c8":{"id":"src_ddadcd30a55dd37b8b8a94c8","source_id":"src_ddadcd30a55dd37b8b8a94c8","source_kind":"report","title":"assets/WELL-0517/maintenance-reports/MNT-0517-026.md","path":"assets/WELL-0517/maintenance-reports/MNT-0517-026.md"},"ev_66ec290ceae866f3ff1e44ac":{"id":"ev_66ec290ceae866f3ff1e44ac","source_id":"src_bcefcc68c3bbee62ba068da5","source_kind":"maintenance","title":"MNT-0531-025","path":"assets/WELL-0531/maintenance.jsonl"},"src_a74054a9a58a3d8663b3a3d6":{"id":"src_a74054a9a58a3d8663b3a3d6","source_id":"src_a74054a9a58a3d8663b3a3d6","source_kind":"report","title":"assets/WELL-0531/maintenance-reports/MNT-0531-025.md","path":"assets/WELL-0531/maintenance-reports/MNT-0531-025.md"},"ev_5a28f1ad8b11a2071244c1ed":

{"id":"ev_5a28f1ad8b11a2071244c1ed","source_id":"src_f2bd04c605b8da4fe080618c","source_kind":"maintenance","title":"MNT-0514-024","path":"assets/WELL-0514/maintenance.jsonl"},"src_6a612745972fd47df8aab031":{"id":"src_6a612745972fd47df8aab031","source_id":"src_6a612745972fd47df8aab031","source_kind":"report","title":"assets/WELL-0514/maintenance-reports/MNT-0514-024.md","path":"assets/WELL-0514/maintenance-reports/MNT-0514-024.md"},"ev_340af70443233ba315df5f79":{"id":"ev_340af70443233ba315df5f79","source_id":"src_156830cca44ef61712f104fd","source_kind":"maintenance","title":"MNT-0544-027","path":"assets/WELL-0544/maintenance.jsonl"},"src_4c910367f21b52bcdfb94532":{"id":"src_4c910367f21b52bcdfb94532","source_id":"src_4c910367f21b52bcdfb94532","source_kind":"report","title":"assets/WELL-0544/maintenance-reports/MNT-0544-027.md","path":"assets/WELL-0544/maintenance-reports/MNT-0544-027.md"},"ev_b1582300d26f694033ffb479":{"id":"ev_b1582300d26f694033ffb479","source_id":"src_e83143155f9f9f864c865bc7","source_kind":"maintenance","title":"MNT-0548-024","path":"assets/WELL-0548/maintenance.jsonl"},"src_4fd20759f8706163541125bd":{"id":"src_4fd20759f8706163541125bd","source_id":"src_4fd20759f8706163541125bd","source_kind":"report","title":"assets/WELL-0548/maintenance-reports/MNT-0548-024.md","path":"assets/WELL-0548/maintenance-reports/MNT-0548-024.md"},"ev_203ca6e4de3568f8ef366deb":{"id":"ev_203ca6e4de3568f8ef366deb","source_id":"src_7d0b50e5ba6c113814f07cc2","source_kind":"maintenance","title":"MNT-0543-029","path":"assets/WELL-0543/maintenance.jsonl"},"src_f2e24c6135cc59fa8ecbbc51":{"id":"src_f2e24c6135cc59fa8ecbbc51","source_id":"src_f2e24c6135cc59fa8ecbbc51","source_kind":"report","title":"assets/WELL-0543/maintenance-reports/MNT-0543-029.md","path":"assets/WELL-0543/maintenance-reports/MNT-0543-029.md"},"ev_bd54fba2cedcbbb26b78ba37":{"id":"ev_bd54fba2cedcbbb26b78ba37","source_id":"src_26462423cfebc38a53da6259","source_kind":"maintenance","title":"MNT-0456-029","path":"assets/WELL-0456/maintenance.jsonl"},"src_5eadb7d04cfff005d199c8ba":{"id":"src_5eadb7d04cfff005d199c8ba","source_id":"src_5eadb7d04cfff005d199c8ba","source_kind":"report","title":"assets/WELL-0456/maintenance-reports/MNT-0456-029.md","path":"assets/WELL-0456/maintenance-reports/MNT-0456-029.md"},"ev_3ef0f4f06011f85c5786d740":{"id":"ev_3ef0f4f06011f85c5786d740","source_id":"src_282aaa85bfc9630d6d07c074","source_kind":"maintenance","title":"MNT-0483-031","path":"assets/WELL-0483/maintenance.jsonl"},"src_9013963c44b5f5e3dde05eaf":{"id":"src_9013963c44b5f5e3dde05eaf","source_id":"src_9013963c44b5f5e3dde05eaf","source_kind":"report","title":"assets/WELL-0483/maintenance-reports/MNT-0483-031.md","path":"assets/WELL-0483/maintenance-reports/MNT-0483-031.md"},"ev_27e32a714afaf460643836b0":{"id":"ev_27e32a714afaf460643836b0","source_id":"src_fa86f2029afce2298c8328c0","source_kind":"maintenance","title":"MNT-0509-034","path":"assets/WELL-0509/maintenance.jsonl"},"src_f56fae386a9b4213288ed40a":{"id":"src_f56fae386a9b4213288ed40a","source_id":"src_f56fae386a9b4213288ed40a","source_kind":"report","title":"assets/WELL-0509/maintenance-reports/MNT-0509-034.md","path":"assets/WELL-0509/maintenance-reports/MNT-0509-034.md"},"ev_2ddc9e2d493c888a6d9bd3b0":{"id":"ev_2ddc9e2d493c888a6d9bd3b0","source_id":"src_c28b39f3609b132cb901c086","source_kind":"maintenance","title":"MNT-0488-029","path":"assets/WELL-0488/maintenance.jsonl"},"src_d0463d2555cb086e4a16e4f0":{"id":"src_d0463d2555cb086e4a16e4f0","source_id":"src_d0463d2555cb086e4a16e4f0","source_kind":"report","title":"assets/WELL-0488/maintenance-reports/MNT-0488-029.md","path":"assets/WELL-0488/maintenance-reports/MNT-0488-029.md"},"ev_da2752151bbd39d68f9975bc":{"id":"ev_da2752151bbd39d68f9975bc","source_id":"src_d31cee0a983b5a030dbda794","source_kind":"maintenance","title":"MNT-0464-024","path":"assets/WELL-0464/maintenance.jsonl"},"src_1ef2521ac2416940cddd1662":{"id":"src_1ef2521ac2416940cddd1662","source_id":"src_1ef2521ac2416940cddd1662","source_kind":"report","title":"assets/WELL-0464/maintenance-reports/MNT-0464-024.md","path":"assets/WELL-0464/maintenance-reports/MNT-0464-024.md"},"ev_9ec7b2597d9070f329a65cdc":{"id":"ev_9ec7b2597d9070f329a65cdc","source_id":"src_6a20b323eaaee8f396ebb3c4","source_kind":"maintenance","title":"MNT-0579-027","path":"assets/WELL-0579/maintenance.jsonl"},"src_0215df9eb77c6a70b5bd5686":{"id":"src_0215df9eb77c6a70b5bd5686","source_id":"src_0215df9eb77c6a70b5bd5686","source_kind":"report","title":"assets/WELL-0579/maintenance-reports/MNT-0579-027.md","path":"assets/WELL-0579/maintenance-reports/MNT-0579-027.md"},"ev_ce15a0af9f5bb4dd0d818f63":{"id":"ev_ce15a0af9f5bb4dd0d818f63","source_id":"src_3e9bbe49277aa4f833e42f6c","source_kind":"maintenance","title":"MNT-0577-032","path":"assets/WELL-0577/maintenance.jsonl"},"src_2c9f9d322c4670bd6fc1bfc1":{"id":"src_2c9f9d322c4670bd6fc1bfc1","source_id":"src_2c9f9d322c4670bd6fc1bfc1","source_kind":"report","title":"assets/WELL-0577/maintenance-reports/MNT-0577-032.md","path":"assets/WELL-0577/maintenance-reports/MNT-0577-032.md"},"ev_54729b21cdba38b5f44bf628":{"id":"ev_54729b21cdba38b5f44bf628","source_id":"src_4e92c62d95d3399d363697c2","source_kind":"maintenance","title":"MNT-0487-024","path":"assets/WELL-0487/maintenance.jsonl"},"src_03497e7bc3ed0d2731a78c5f":{"id":"src_03497e7bc3ed0d2731a78c5f","source_id":"src_03497e7bc3ed0d2731a78c5f","source_kind":"report","title":"assets/WELL-0487/maintenance-reports/MNT-0487-024.md","path":"assets/WELL-0487/maintenance-reports/MNT-0487-024.md"},"ev_ace5c2b982d61359c2d2be0f":{"id":"ev_ace5c2b982d61359c2d2be0f","source_id":"src_e83143155f9f9f864c865bc7","source_kind":"maintenance","title":"MNT-0548-028","path":"assets/WELL-0548/maintenance.jsonl"},"src_bcbfe4d21f1c4b5dbddc8a4e":{"id":"src_bcbfe4d21f1c4b5dbddc8a4e","source_id":"src_bcbfe4d21f1c4b5dbddc8a4e","source_kind":"report","title":"assets/WELL-0548/maintenance-reports/MNT-0548-028.md","path":"assets/WELL-0548/maintenance-reports/MNT-0548-028.md"},"ev_5da32f65fdb508d1294e5beb":{"id":"ev_5da32f65fdb508d1294e5beb","source_id":"src_11e774d2fe4b21e667c23375","source_kind":"maintenance","title":"MNT-0589-032","path":"assets/WELL-0589/maintenance.jsonl"},"src_a356917a8984a7416f16a943":{"id":"src_a356917a8984a7416f16a943","source_id":"src_a356917a8984a7416f16a943","source_kind":"report","title":"assets/WELL-0589/maintenance-reports/MNT-0589-032.md","path":"assets/WELL-0589/maintenance-reports/MNT-0589-032.md"},"ev_e862919191819e7a19553a982f":{"id":"ev_e8629191819e7a19553a982f","source_id":"src_79024d186ca279893c0fd9fd","source_kind":"maintenance","title":"MNT-0496-033","path":"assets/WELL-0496/maintenance.jsonl"},"src_98e13ee5d252319be2897d31":{"id":"src_98e13ee5d252319be2897d31","source_id":"src_98e13ee5d252319be2897d31","source_kind":"report","title":"assets/WELL-0496/maintenance-reports/MNT-0496-033.md","path":"assets/WELL-0496/maintenance-reports/MNT-0496-033.md"},"ev_8bb2341e05f7cbb3067203f4":{"id":"ev_8bb2341e05f7cbb3067203f4","source_id":"src_16480dbb6e025ad53b724cbb","source_kind":"maintenance","title":"MNT-0504-026","path":"assets/WELL-0504/maintenance.jsonl"},"src_dd1192ead9cd00cf1c6733f1":{"id":"src_dd1192ead9cd00cf1c6733f1","source_id":"src_dd1192ead9cd00cf1c6733f1","source_kind":"report","title":"assets/WELL-0504/maintenance-reports/MNT-0504-026.md","path":"assets/WELL-0504/maintenance-reports/MNT-0504-026.md"},"ev_fcc7e2a536f99f348cf18d35":{"id":"ev_fcc7e2a536f99f348cf18d35","source_id":"src_448ef96f241e54d5ff831776","source_kind":"maintenance","title":"MNT-0484-033","path":"assets/WELL-0484/maintenance.jsonl"},"src_486ce50170a6a83426651190":{"id":"src_486ce50170a6a83426651190","source_id":"src_486ce50170a6a83426651190","source_kind":"report","title":"assets/WELL-0484/maintenance-reports/MNT-0484-033.md","path":"assets/WELL-0484/maintenance-reports/MNT-0484-033.md"},"ev_b5629e338419d7cf8ddbf137":{"id":"ev_b5629e338419d7cf8ddbf137","source_id":"src_412cd7696ee89129ee86e89c","source_kind":"maintenance","title":"MNT-0590-029","path":"assets/WELL-0590/maintenance.jsonl"},"src_ba03f287985cabf498cbdc5e":{"id":"src_ba03f287985cabf498cbdc5e","source_id":"src_ba03f287985cabf498cbdc5e","source_kind":"report","title":"assets/WELL-0590/maintenance-reports/MNT-0590-029.md","path":"assets/WELL-0590/maintenance-reports/MNT-0590-029.md"},"ev_a237f5e1c988c3918e4d3ef8":{"id":"ev_a237f5e1c988c3918e4d3ef8","source_id":"src_f03bfb7ef83ce01d9e7b48e4","source_kind":"maintenance","title":"MNT-0458-020","path":"assets/WELL-0458/maintenance.jsonl"},"src_2acc13a645485c1de8026b41":{"id":"src_2acc13a645485c1de8026b41","source_id":"src_2acc13a645485c1de8026b41","source_kind":"report","title":"assets/WELL-0458/maintenance-reports/MNT-0458-020.md","path":"assets/WELL-0458/maintenance-reports/MNT-0458-020.md"},"ev_6179455330b1d37bfe9e361f":{"id":"ev_6179455330b1d37bfe9e361f","source_id":"src_bc364bfb214e83da466ecb2c","source_kind":"maintenance","title":"MNT-0489-025","path":"assets/WELL-0489/maintenance.jsonl"},"src_ba90a19a617b123bf731f492":{"id":"src_ba90a19a617b123bf731f492","source_id":"src_ba90a19a617b123bf731f492","source_kind":"report","title":"assets/WELL-0489/maintenance-reports/MNT-0489-025.md","path":"assets/WELL-0489/maintenance-reports/MNT-0489-025.md"},"ev_a7588ea2637a7d42643e17a9":{"id":"ev_a7588ea2637a7d42643e17a9","source_id":"src_451c93459babb03ddc3466b0","source_kind":"maintenance","title":"MNT-0569-025","path":"assets/WELL-0569/maintenance.jsonl"},"src_51535627e541bcaefdc020af":{"id":"src_51535627e541bcaefdc020af","source_id":"src_51535627e541bcaefdc020af","source_kind":"report","title":"assets/WELL-0569/maintenance-reports/MNT-0569-025.md","path":"assets/WELL-0569/maintenance-reports/MNT-0569-025.md"},"ev_92c8a65fca038f97f20cbc40":{"id":"ev_92c8a65fca038f97f20cbc40","source_id":"src_2fe2b7f769356e8547da20c7","source_kind":"maintenance","title":"MNT-0515-019","path":"assets/WELL-0515/maintenance.jsonl"},"src_d763fc20a0a4b261a922acce":{"id":"src_d763fc20a0a4b261a922acce","source_id":"src_d763f

c20a0a4b261a922acce","source_kind":"report","title":"assets/WELL-0515/maintenance-reports/MNT-0515-019.md","path":"ass
ets/WELL-0515/maintenance-reports/MNT-0515-019.md"},"ev_b76022e3d7906cd9208a0df4":{"id":"ev_b76022e3d7906cd9208a0df4",
"source_id":"src_c03ead5da6428ea884b65bb7","source_kind":"maintenance","title":"MNT-0454-024","path":"assets/WELL-0454
/maintenance.jsonl"},"src_ef5631aba783fdaf80f266c8":{"id":"src_ef5631aba783fdaf80f266c8","source_id":"src_ef5631aba783
fdaf80f266c8","source_kind":"report","title":"assets/WELL-0454/maintenance-reports/MNT-0454-024.md","path":"assets/WEL
L-0454/maintenance-reports/MNT-0454-024.md"},"ev_88effc934de94fbe50900667":{"id":"ev_88effc934de94fbe50900667","source
_id":"src_ad42cc28b0789ed56e4e97b3","source_kind":"maintenance","title":"MNT-0595-025","path":"assets/WELL-0595/mainte
nance.jsonl"},"src_be6490e8c321a2b74823059b":{"id":"src_be6490e8c321a2b74823059b","source_id":"src_be6490e8c321a2b7482
3059b","source_kind":"report","title":"assets/WELL-0595/maintenance-reports/MNT-0595-025.md","path":"assets/WELL-0595/
maintenance-reports/MNT-0595-025.md"},"ev_e566511d3ab018a6d82f8852":{"id":"ev_e566511d3ab018a6d82f8852","source_id":"s
rc_dba4968d9e723faef79412ce","source_kind":"maintenance","title":"MNT-0486-026","path":"assets/WELL-0486/maintenance.j
sonl"},"src_8b271c1f79725359376197b1":{"id":"src_8b271c1f79725359376197b1","source_id":"src_8b271c1f79725359376197b1",
"source_kind":"report","title":"assets/WELL-0486/maintenance-reports/MNT-0486-026.md","path":"assets/WELL-0486/mainten
ance-reports/MNT-0486-026.md"},"ev_318691c20a0f2c63e9704efa":{"id":"ev_318691c20a0f2c63e9704efa","source_id":"src_5e61
f1548463a0d6ca1e5db2","source_kind":"maintenance","title":"MNT-0510-031","path":"assets/WELL-0510/maintenance.jsonl"},
"src_9c58b4a1a557c11b7909af4f":{"id":"src_9c58b4a1a557c11b7909af4f","source_id":"src_9c58b4a1a557c11b7909af4f","source
_kind":"report","title":"assets/WELL-0510/maintenance-reports/MNT-0510-031.md","path":"assets/WELL-0510/maintenance-re
ports/MNT-0510-031.md"},"ev_bcac7268ab2dbe3395497cdd":{"id":"ev_bcac7268ab2dbe3395497cdd","source_id":"src_f2d590e80fc
55e2cbd02d0cc","source_kind":"context","title":"CTX-0510-002","path":"assets/WELL-0510/context.jsonl"},"ev_96052710ec3
5e4a33f10c91a":{"id":"ev_96052710ec35e4a33f10c91a","source_id":"src_ca44b86fbd7340a5775612fa","source_kind":"maintenan
ce","title":"MNT-0500-025","path":"assets/WELL-0500/maintenance.jsonl"},"src_cf1e54014692e8d961cdcfd8":{"id":"src_cf1e
54014692e8d961cdcfd8","source_id":"src_cf1e54014692e8d961cdcfd8","source_kind":"report","title":"assets/WELL-0500/main
tenance-reports/MNT-0500-025.md","path":"assets/WELL-0500/maintenance-reports/MNT-0500-025.md"},"ev_abb0fda4a0b3e878af
5ce311":{"id":"ev_abb0fda4a0b3e878af5ce311","source_id":"src_a50f4ac37d8f55bd49e06933","source_kind":"maintenance","ti
tle":"MNT-0534-027","path":"assets/WELL-0534/maintenance.jsonl"},"src_a2ed98fcf874324e221f5302":{"id":"src_a2ed98fcf87
4324e221f5302","source_id":"src_a2ed98fcf874324e221f5302","source_kind":"report","title":"assets/WELL-0534/maintenance
-reports/MNT-0534-027.md","path":"assets/WELL-0534/maintenance-reports/MNT-0534-027.md"},"ev_790e620af578f8a9bbdedd80"
:{"id":"ev_790e620af578f8a9bbdedd80","source_id":"src_296e35c5fa894be53c11d7ff","source_kind":"maintenance","title":"M
NT-0559-025","path":"assets/WELL-0559/maintenance.jsonl"},"src_c785f19caf66d4b7774062a7":{"id":"src_c785f19caf66d4b777
4062a7","source_id":"src_c785f19caf66d4b7774062a7","source_kind":"report","title":"assets/WELL-0559/maintenance-report
s/MNT-0559-025.md","path":"assets/WELL-0559/maintenance-reports/MNT-0559-025.md"},"ev_6f5571c6ba808d6fc96a5824":{"id":
"ev_6f5571c6ba808d6fc96a5824","source_id":"src_4eca27395fe267daaff709cc","source_kind":"maintenance","title":"MNT-0575
-022","path":"assets/WELL-0575/maintenance.jsonl"},"src_35c1a2a1ef046276aca91ddc":{"id":"src_35c1a2a1ef046276aca91ddc"
,"source_id":"src_35c1a2a1ef046276aca91ddc","source_kind":"report","title":"assets/WELL-0575/maintenance-reports/MNT-0
575-022.md","path":"assets/WELL-0575/maintenance-reports/MNT-0575-022.md"},"ev_39be74a0889dfb53e4852b1d":{"id":"ev_39b
e74a0889dfb53e4852b1d","source_id":"src_26462423cfebc38a53da6259","source_kind":"maintenance","title":"MNT-0456-027","
path":"assets/WELL-0456/maintenance.jsonl"},"src_5c63f3fe6182d3a96dafae45":{"id":"src_5c63f3fe6182d3a96dafae45","sourc
e_id":"src_5c63f3fe6182d3a96dafae45","source_kind":"report","title":"assets/WELL-0456/maintenance-reports/MNT-0456-027
.md","path":"assets/WELL-0456/maintenance-reports/MNT-0456-027.md"},"ev_cc0fe49b3d609d0a004cef78":{"id":"ev_cc0fe49b3d
609d0a004cef78","source_id":"src_f26db529169214bafd9301d6","source_kind":"maintenance","title":"MNT-0491-024","path":"
assets/WELL-0491/maintenance.jsonl"},"src_56e15b2690307dc1e3ad8d1b":{"id":"src_56e15b2690307dc1e3ad8d1b","source_id":"
src_56e15b2690307dc1e3ad8d1b","source_kind":"report","title":"assets/WELL-0491/maintenance-reports/MNT-0491-024.md","p
ath":"assets/WELL-0491/maintenance-reports/MNT-0491-024.md"},"ev_d2bdb1f6e92721e830e80b98":{"id":"ev_d2bdb1f6e92721e83
0e80b98","source_id":"src_79024d186ca279893c0fd9fd","source_kind":"maintenance","title":"MNT-0496-027","path":"assets/
WELL-0496/maintenance.jsonl"},"src_4d8ad66a8a66a95d2755e851":{"id":"src_4d8ad66a8a66a95d2755e851","source_id":"src_4d8
ad66a8a66a95d2755e851","source_kind":"report","title":"assets/WELL-0496/maintenance-reports/MNT-0496-027.md","path":"a
ssets/WELL-0496/maintenance-reports/MNT-0496-027.md"},"ev_1905315e342d2fbf7f8da5f3":{"id":"ev_1905315e342d2fbf7f8da5f3
","source_id":"src_05ccd3db3994c9428489bb62","source_kind":"maintenance","title":"MNT-0502-027","path":"assets/WELL-05
02/maintenance.jsonl"},"src_c031efd3835eb4db04803be5":{"id":"src_c031efd3835eb4db04803be5","source_id":"src_c031efd383
5eb4db04803be5","source_kind":"report","title":"assets/WELL-0502/maintenance-reports/MNT-0502-027.md","path":"assets/W
ELL-0502/maintenance-reports/MNT-0502-027.md"},"ev_7736d1bc92d22944f8e40b67":{"id":"ev_7736d1bc92d22944f8e40b67","sour
ce_id":"src_de9dda352620a54626693dac","source_kind":"maintenance","title":"MNT-0466-027","path":"assets/WELL-0466/main
tenance.jsonl"},"src_b09d40111cbdea9e76ecd864":{"id":"src_b09d40111cbdea9e76ecd864","source_id":"src_b09d40111cbdea9e7
6ecd864","source_kind":"report","title":"assets/WELL-0466/maintenance-reports/MNT-0466-027.md","path":"assets/WELL-046
6/maintenance-reports/MNT-0466-027.md"},"ev_74845b3f9a4f76435fbaefa2":{"id":"ev_74845b3f9a4f76435fbaefa2","source_id":
"src_7c8c435a1276cf5abeb2d27c","source_kind":"maintenance","title":"MNT-0519-029","path":"assets/WELL-0519/maintenance
.jsonl"},"src_04958fbd6ebbbc5a9260722d":{"id":"src_04958fbd6ebbbc5a9260722d","source_id":"src_04958fbd6ebbbc5a9260722d
","source_kind":"report","title":"assets/WELL-0519/maintenance-reports/MNT-0519-029.md","path":"assets/WELL-0519/maint
enance-reports/MNT-0519-029.md"},"ev_ce4f11845aa51b715fa1d1f7":{"id":"ev_ce4f11845aa51b715fa1d1f7","source_id":"src_6a
20b323eaaee8f396ebb3c4","source_kind":"maintenance","title":"MNT-0579-028","path":"assets/WELL-0579/maintenance.jsonl"
},"src_1f8a96d6a59172178ef1eee5":{"id":"src_1f8a96d6a59172178ef1eee5","source_id":"src_1f8a96d6a59172178ef1eee5","sour
ce_kind":"report","title":"assets/WELL-0579/maintenance-reports/MNT-0579-028.md","path":"assets/WELL-0579/maintenance-
reports/MNT-0579-028.md"},"ev_c76aa00438c2983f1ad3acc7":{"id":"ev_c76aa00438c2983f1ad3acc7","source_id":"src_67caf9a1b
4a656276be9e6d5","source_kind":"maintenance","title":"MNT-0471-025","path":"assets/WELL-0471/maintenance.jsonl"},"src_
28dbe85da5565eb582d2611a":{"id":"src_28dbe85da5565eb582d2611a","source_id":"src_28dbe85da5565eb582d2611a","source_kind
":"report","title":"assets/WELL-0471/maintenance-reports/MNT-0471-025.md","path":"assets/WELL-0471/maintenance-reports
/MNT-0471-025.md"},"ev_984fa0c477128f7ca7653c73":{"id":"ev_984fa0c477128f7ca7653c73","source_id":"src_d2c994df536d7c21
3d575dbe","source_kind":"maintenance","title":"MNT-0461-022","path":"assets/WELL-0461/maintenance.jsonl"},"src_86de129
058e6359a8c87cf1d":{"id":"src_86de129058e6359a8c87cf1d","source_id":"src_86de129058e6359a8c87cf1d","source_kind":"repo
rt","title":"assets/WELL-0461/maintenance-reports/MNT-0461-022.md","path":"assets/WELL-0461/maintenance-reports/MNT-04
61-022.md"},"ev_cbf4a257d2b141f5c5249128":{"id":"ev_cbf4a257d2b141f5c5249128","source_id":"src_569caec98abc360ff8078a8
2","source_kind":"maintenance","title":"MNT-0567-023","path":"assets/WELL-0567/maintenance.jsonl"},"src_1a4165243368d9
cce3936ef9":{"id":"src_1a4165243368d9cce3936ef9","source_id":"src_1a4165243368d9cce3936ef9","source_kind":"report","ti
tle":"assets/WELL-0567/maintenance-reports/MNT-0567-023.md","path":"assets/WELL-0567/maintenance-reports/MNT-0567-023.
md"},"ev_832c3efce7aa90b90daaa08f":{"id":"ev_832c3efce7aa90b90daaa08f","source_id":"src_c66c7bf816cc95c97b18522a","sou
rce_kind":"maintenance","title":"MNT-0492-014","path":"assets/WELL-0492/maintenance.jsonl"},"src_ccac87d7de31934cd48fe
ca0":{"id":"src_ccac87d7de31934cd48feca0","source_id":"src_ccac87d7de31934cd48feca0","source_kind":"report","title":"a
ssets/WELL-0492/maintenance-reports/MNT-0492-014.md","path":"assets/WELL-0492/maintenance-reports/MNT-0492-014.md"},"e
v_c208d3243ec29c4669ebac75":{"id":"ev_c208d3243ec29c4669ebac75","source_id":"src_412cd7696ee89129ee86e89c","source_kin
d":"maintenance","title":"MNT-0590-031","path":"assets/WELL-0590/maintenance.jsonl"},"src_7093e8e0e7759672797857b0":{"
id":"src_7093e8e0e7759672797857b0","source_id":"src_7093e8e0e7759672797857b0","source_kind":"report","title":"assets/W
ELL-0590/maintenance-reports/MNT-0590-031.md","path":"assets/WELL-0590/maintenance-reports/MNT-0590-031.md"},"ev_d5bd4
b994185bc3d2eb34649":{"id":"ev_d5bd4b994185bc3d2eb34649","source_id":"src_d31cee0a983b5a030dbda794","source_kind":"mai
ntenance","title":"MNT-0464-021","path":"assets/WELL-0464/maintenance.jsonl"},"src_7fcf9b218885a26ef7c3a632":{"id":"sr
c_7fcf9b218885a26ef7c3a632","source_id":"src_7fcf9b218885a26ef7c3a632","source_kind":"report","title":"assets/WELL-046

4/maintenance-reports/MNT-0464-021.md","path":"assets/WELL-0464/maintenance-reports/MNT-0464-021.md"},"ev_ac474ccae326dea5a41934e6":{"id":"ev_ac474ccae326dea5a41934e6","source_id":"src_5e61f1548463a0d6ca1e5db2","source_kind":"maintenance","title":"MNT-0510-030","path":"assets/WELL-0510/maintenance.jsonl"},"src_468c5db3236e8297f787dc73":{"id":"src_468c5db3236e8297f787dc73","source_id":"src_468c5db3236e8297f787dc73","source_kind":"report","title":"assets/WELL-0510/maintenance-reports/MNT-0510-030.md","path":"assets/WELL-0510/maintenance-reports/MNT-0510-030.md"},"ev_1a47b83c6766726b9b3de735":{"id":"ev_1a47b83c6766726b9b3de735","source_id":"src_81f99732eca799e3a1216337","source_kind":"maintenance","title":"MNT-0469-024","path":"assets/WELL-0469/maintenance.jsonl"},"src_b263b87ecbe5edde4409a872":{"id":"src_b263b87ecbe5edde4409a872","source_id":"src_b263b87ecbe5edde4409a872","source_kind":"report","title":"assets/WELL-0469/maintenance-reports/MNT-0469-024.md","path":"assets/WELL-0469/maintenance-reports/MNT-0469-024.md"},"ev_714b317dab2a2fb69f95daea":{"id":"ev_714b317dab2a2fb69f95daea","source_id":"src_4e92c62d95d3399d363697c2","source_kind":"maintenance","title":"MNT-0487-019","path":"assets/WELL-0487/maintenance.jsonl"},"src_e24959e7686c61e3d2e48a80":{"id":"src_e24959e7686c61e3d2e48a80","source_id":"src_e24959e7686c61e3d2e48a80","source_kind":"report","title":"assets/WELL-0487/maintenance-reports/MNT-0487-019.md","path":"assets/WELL-0487/maintenance-reports/MNT-0487-019.md"},"ev_1696949ecc9614526892cd42":{"id":"ev_1696949ecc9614526892cd42","source_id":"src_4784a423450ae79851638606","source_kind":"maintenance","title":"MNT-0545-023","path":"assets/WELL-0545/maintenance.jsonl"},"src_045fcd55806dccde5839aec1":{"id":"src_045fcd55806dccde5839aec1","source_id":"src_045fcd55806dccde5839aec1","source_kind":"report","title":"assets/WELL-0545/maintenance-reports/MNT-0545-023.md","path":"assets/WELL-0545/maintenance-reports/MNT-0545-023.md"},"ev_36f7ed800b88d8e2d9477a04":{"id":"ev_36f7ed800b88d8e2d9477a04","source_id":"src_eedea96941cac9b62b531f36","source_kind":"maintenance","title":"MNT-0511-027","path":"assets/WELL-0511/maintenance.jsonl"},"src_36b0a54e07e7aeadc3e0e295":{"id":"src_36b0a54e07e7aeadc3e0e295","source_id":"src_36b0a54e07e7aeadc3e0e295","source_kind":"report","title":"assets/WELL-0511/maintenance-reports/MNT-0511-027.md","path":"assets/WELL-0511/maintenance-reports/MNT-0511-027.md"},"ev_6d51e8e080fa762fc824c434":{"id":"ev_6d51e8e080fa762fc824c434","source_id":"src_3d645a913cee059128629f1f","source_kind":"maintenance","title":"MNT-0597-026","path":"assets/WELL-0597/maintenance.jsonl"},"src_0fcc4f8de0e55be9eb762798":{"id":"src_0fcc4f8de0e55be9eb762798","source_id":"src_0fcc4f8de0e55be9eb762798","source_kind":"report","title":"assets/WELL-0597/maintenance-reports/MNT-0597-026.md","path":"assets/WELL-0597/maintenance-reports/MNT-0597-026.md"},"ev_868cd99e7fcaaa800476abc6":{"id":"ev_868cd99e7fcaaa800476abc6","source_id":"src_79024d186ca279893c0fd9fd","source_kind":"maintenance","title":"MNT-0496-026","path":"assets/WELL-0496/maintenance.jsonl"},"src_999b74e4b10764d723ddbd91":{"id":"src_999b74e4b10764d723ddbd91","source_id":"src_999b74e4b10764d723ddbd91","source_kind":"report","title":"assets/WELL-0496/maintenance-reports/MNT-0496-026.md","path":"assets/WELL-0496/maintenance-reports/MNT-0496-026.md"},"ev_92c9f3eb79da3d6048b79175":{"id":"ev_92c9f3eb79da3d6048b79175","source_id":"src_bd568a9255716f1e2e81a545","source_kind":"maintenance","title":"MNT-0599-026","path":"assets/WELL-0599/maintenance.jsonl"},"src_4c780a5a27bf9e8af2877b5a":{"id":"src_4c780a5a27bf9e8af2877b5a","source_id":"src_4c780a5a27bf9e8af2877b5a","source_kind":"report","title":"assets/WELL-0599/maintenance-reports/MNT-0599-026.md","path":"assets/WELL-0599/maintenance-reports/MNT-0599-026.md"},"ev_ee4f5e29dd7ec1b699dfdfbd":{"id":"ev_ee4f5e29dd7ec1b699dfdfbd","source_id":"src_a3cfea1d59ee276582cfc3a7","source_kind":"maintenance","title":"MNT-0463-020","path":"assets/WELL-0463/maintenance.jsonl"},"src_d6933620c78a4b65fc2bd4a6":{"id":"src_d6933620c78a4b65fc2bd4a6","source_id":"src_d6933620c78a4b65fc2bd4a6","source_kind":"report","title":"assets/WELL-0463/maintenance-reports/MNT-0463-020.md","path":"assets/WELL-0463/maintenance-reports/MNT-0463-020.md"},"ev_402ef3d21803ef4478f10e69":{"id":"ev_402ef3d21803ef4478f10e69","source_id":"src_1ac88b7b02114f60a2039db0","source_kind":"maintenance","title":"MNT-0588-025","path":"assets/WELL-0588/maintenance.jsonl"},"src_c4fdc631c5284f93f2645c6d":{"id":"src_c4fdc631c5284f93f2645c6d","source_id":"src_c4fdc631c5284f93f2645c6d","source_kind":"report","title":"assets/WELL-0588/maintenance-reports/MNT-0588-025.md","path":"assets/WELL-0588/maintenance-reports/MNT-0588-025.md"},"ev_e4a253e9a67491a28cde4584":{"id":"ev_e4a253e9a67491a28cde4584","source_id":"src_9a7a5ced34b7eb515b7b2e1e","source_kind":"maintenance","title":"MNT-0593-023","path":"assets/WELL-0593/maintenance.jsonl"},"src_3e8a6ec90f508eef0b5b7a47":{"id":"src_3e8a6ec90f508eef0b5b7a47","source_id":"src_3e8a6ec90f508eef0b5b7a47","source_kind":"report","title":"assets/WELL-0593/maintenance-reports/MNT-0593-023.md","path":"assets/WELL-0593/maintenance-reports/MNT-0593-023.md"},"ev_086bb27f4975c20425530ab0":{"id":"ev_086bb27f4975c20425530ab0","source_id":"src_38094eb336d32c0307503736","source_kind":"maintenance","title":"MNT-0478-022","path":"assets/WELL-0478/maintenance.jsonl"},"src_d53df8b9500b52d6c4a4ed96":{"id":"src_d53df8b9500b52d6c4a4ed96","source_id":"src_d53df8b9500b52d6c4a4ed96","source_kind":"report","title":"assets/WELL-0478/maintenance-reports/MNT-0478-022.md","path":"assets/WELL-0478/maintenance-reports/MNT-0478-022.md"},"ev_243996f88dc202ac093423bd":{"id":"ev_243996f88dc202ac093423bd","source_id":"src_6952d325d984073af7a14a34","source_kind":"maintenance","title":"MNT-0532-029","path":"assets/WELL-0532/maintenance.jsonl"},"src_238e6525fb53f158cee2d2d7":{"id":"src_238e6525fb53f158cee2d2d7","source_id":"src_238e6525fb53f158cee2d2d7","source_kind":"report","title":"assets/WELL-0532/maintenance-reports/MNT-0532-029.md","path":"assets/WELL-0532/maintenance-reports/MNT-0532-029.md"},"ev_189c2d6609dc07d53348040e":{"id":"ev_189c2d6609dc07d53348040e","source_id":"src_390c6e721c58605797cc1f27","source_kind":"maintenance","title":"MNT-0451-029","path":"assets/WELL-0451/maintenance.jsonl"},"src_3296eaf5f02c5827166755fd":{"id":"src_3296eaf5f02c5827166755fd","source_id":"src_3296eaf5f02c5827166755fd","source_kind":"report","title":"assets/WELL-0451/maintenance-reports/MNT-0451-029.md","path":"assets/WELL-0451/maintenance-reports/MNT-0451-029.md"},"ev_d1eb8862f7b246274d2b73d2":{"id":"ev_d1eb8862f7b246274d2b73d2","source_id":"src_514d3287e5117e303534f2ae","source_kind":"maintenance","title":"MNT-0592-025","path":"assets/WELL-0592/maintenance.jsonl"},"src_6e9b7560a43e1eb5e96d3349":{"id":"src_6e9b7560a43e1eb5e96d3349","source_id":"src_6e9b7560a43e1eb5e96d3349","source_kind":"report","title":"assets/WELL-0592/maintenance-reports/MNT-0592-025.md","path":"assets/WELL-0592/maintenance-reports/MNT-0592-025.md"},"ev_73367a712759877792934268":{"id":"ev_73367a712759877792934268","source_id":"src_14c1c696476e28b46258f699","source_kind":"maintenance","title":"MNT-0529-016","path":"assets/WELL-0529/maintenance.jsonl"},"src_114869606dff10a7d88d28df":{"id":"src_114869606dff10a7d88d28df","source_id":"src_114869606dff10a7d88d28df","source_kind":"report","title":"assets/WELL-0529/maintenance-reports/MNT-0529-016.md","path":"assets/WELL-0529/maintenance-reports/MNT-0529-016.md"},"ev_f1eb1d7bb044a02cc922474b":{"id":"ev_f1eb1d7bb044a02cc922474b","source_id":"src_499acf05db7ba36c846d678b","source_kind":"maintenance","title":"MNT-0600-028","path":"assets/WELL-0600/maintenance.jsonl"},"src_b822210ee3102866aabf138f":{"id":"src_b822210ee3102866aabf138f","source_id":"src_b822210ee3102866aabf138f","source_kind":"report","title":"assets/WELL-0600/maintenance-reports/MNT-0600-028.md","path":"assets/WELL-0600/maintenance-reports/MNT-0600-028.md"},"ev_43b0bde575fa5971e9ea2473":{"id":"ev_43b0bde575fa5971e9ea2473","source_id":"src_29f1c34534f9443d6fb2d0f7","source_kind":"maintenance","title":"MNT-0576-022","path":"assets/WELL-0576/maintenance.jsonl"},"src_adc70748b4347c40938a135d":{"id":"src_adc70748b4347c40938a135d","source_id":"src_adc70748b4347c40938a135d","source_kind":"report","title":"assets/WELL-0576/maintenance-reports/MNT-0576-022.md","path":"assets/WELL-0576/maintenance-reports/MNT-0576-022.md"},"ev_f1972b172922fdf8358bbfa2":{"id":"ev_f1972b172922fdf8358bbfa2","source_id":"src_250ba454186f1ed3a0e8c222","source_kind":"maintenance","title":"MNT-0474-034","path":"assets/WELL-0474/maintenance.jsonl"},"src_6e92817a443fad794db2420d":{"id":"src_6e92817a443fad794db2420d","source_id":"src_6e92817a443fad794db2420d","source_kind":"report","title":"assets/WELL-0474/maintenance-reports/MNT-0474-034.md","path":"assets/WELL-0474/maintenance-reports/MNT-0474-034.md"},"ev_a83afacb8f38066ccd1c4ae3":{"id":"ev_a83afacb8f38066ccd1c4ae3","source_id":"src_97a045c9f036fa82d98786a1","source_kind":"maintenance","title":"MNT-0505-022","path":"assets/WELL-0505/maintenance.jsonl"},"src_c5585ef753f960d653ee58f9":{"id":"src_c5585ef753f960d653ee58f9","source_id":"src_c5585ef753f960d653ee58f9","source_kind":"report","title":"assets/WELL-0505/maintenance-reports/MNT-0505-022.md","path":"assets/WELL-0505/maintenance-reports/MNT-0505-022.md"},"ev_791b89af41a4fb3e323da800":{"id":"ev_791b89af41a4fb3e323da800","source_id":"src_4eca27395fe267daaff709cc","source_kind":"maintenance","title":"MNT-0575-018","path":"assets/WELL-0575/maintenance.jsonl"},"src_d3df1ccbc231f325b87a1c50":{"id":"src_d3df1ccbc231f325b87a1c50","source_id":"src_d3df1ccbc231f325b87a1c50","source_kind":"report","title":"assets/WELL-0575/maintenance-reports/MNT-0575-018.md","path":"assets/WELL-0575/maintenance-reports/MNT-0575-018.md"},"ev_99586c362b7c87a3561884aa":{"id":"ev_99586c362b7c87a3561884aa","source_id":"src_a188081af2f65b38809d0e34","source_kind":"maintenance","title":"MNT-0459-021","pa

th":"assets/WELL-0459/maintenance.jsonl"},"src_4597597d07a97975990f56a7":{"id":"src_4597597d07a97975990f56a7","source_
id":"src_4597597d07a97975990f56a7","source_kind":"report","title":"assets/WELL-0459/maintenance-reports/MNT-0459-021.m
d","path":"assets/WELL-0459/maintenance-reports/MNT-0459-021.md"},"ev_044028cd8d6b2425a57f777a":{"id":"ev_044028cd8d6b
2425a57f777a","source_id":"src_bd568a9255716f1e2e81a545","source_kind":"maintenance","title":"MNT-0599-021","path":"as
sets/WELL-0599/maintenance.jsonl"},"src_9f01f28e4983e97771856439":{"id":"src_9f01f28e4983e97771856439","source_id":"sr
c_9f01f28e4983e97771856439","source_kind":"report","title":"assets/WELL-0599/maintenance-reports/MNT-0599-021.md","pat
h":"assets/WELL-0599/maintenance-reports/MNT-0599-021.md"},"ev_728e8f3a30bbda273b88596e":{"id":"ev_728e8f3a30bbda273b8
8596e","source_id":"src_448ef96f241e54d5ff831776","source_kind":"maintenance","title":"MNT-0484-024","path":"assets/WE
LL-0484/maintenance.jsonl"},"src_aa937aa5fba01e1cbd8c7193":{"id":"src_aa937aa5fba01e1cbd8c7193","source_id":"src_aa937
aa5fba01e1cbd8c7193","source_kind":"report","title":"assets/WELL-0484/maintenance-reports/MNT-0484-024.md","path":"ass
ets/WELL-0484/maintenance-reports/MNT-0484-024.md"},"ev_16118b86ab6641e7b14e06a0":{"id":"ev_16118b86ab6641e7b14e06a0",
"source_id":"src_6fb314bd1c793a34ed2c95a8","source_kind":"maintenance","title":"MNT-0556-028","path":"assets/WELL-0556
/maintenance.jsonl"},"src_503983a6b149f88948f715cc":{"id":"src_503983a6b149f88948f715cc","source_id":"src_503983a6b149
f88948f715cc","source_kind":"report","title":"assets/WELL-0556/maintenance-reports/MNT-0556-028.md","path":"assets/WEL
L-0556/maintenance-reports/MNT-0556-028.md"},"ev_ac9f49d0f297f864a9b578d1":{"id":"ev_ac9f49d0f297f864a9b578d1","source
_id":"src_14c1c696476e28b46258f699","source_kind":"maintenance","title":"MNT-0529-012","path":"assets/WELL-0529/mainte
nance.jsonl"},"src_a11e3039cf708cb67414fe64":{"id":"src_a11e3039cf708cb67414fe64","source_id":"src_a11e3039cf708cb6741
4fe64","source_kind":"report","title":"assets/WELL-0529/maintenance-reports/MNT-0529-012.md","path":"assets/WELL-0529/
maintenance-reports/MNT-0529-012.md"},"ev_3a89a0dbdfc6a4a2fc5820b7":{"id":"ev_3a89a0dbdfc6a4a2fc5820b7","source_id":"s
rc_aeb8121e0eda260133223e22","source_kind":"maintenance","title":"MNT-0524-021","path":"assets/WELL-0524/maintenance.j
sonl"},"src_683355e9bc8818585e432d53":{"id":"src_683355e9bc8818585e432d53","source_id":"src_683355e9bc8818585e432d53",
"source_kind":"report","title":"assets/WELL-0524/maintenance-reports/MNT-0524-021.md","path":"assets/WELL-0524/mainten
ance-reports/MNT-0524-021.md"},"ev_4b1f2c0efc655f12926dee70":{"id":"ev_4b1f2c0efc655f12926dee70","source_id":"src_032d
f6c11c1d8d5e39136649","source_kind":"maintenance","title":"MNT-0566-027","path":"assets/WELL-0566/maintenance.jsonl"},
"src_48b8c83c9872328b04bc9db4":{"id":"src_48b8c83c9872328b04bc9db4","source_id":"src_48b8c83c9872328b04bc9db4","source
_kind":"report","title":"assets/WELL-0566/maintenance-reports/MNT-0566-027.md","path":"assets/WELL-0566/maintenance-re
ports/MNT-0566-027.md"},"ev_a6d16fb452547a473f72b304":{"id":"ev_a6d16fb452547a473f72b304","source_id":"src_c90ede5410e
d683a84c13c15","source_kind":"maintenance","title":"MNT-0587-026","path":"assets/WELL-0587/maintenance.jsonl"},"src_fd
8c31cf076a26daaf0fcbea":{"id":"src_fd8c31cf076a26daaf0fcbea","source_id":"src_fd8c31cf076a26daaf0fcbea","source_kind":
"report","title":"assets/WELL-0587/maintenance-reports/MNT-0587-026.md","path":"assets/WELL-0587/maintenance-reports/M
NT-0587-026.md"},"ev_d4a2a297a56c9b35b57d1eef":{"id":"ev_d4a2a297a56c9b35b57d1eef","source_id":"src_ba73abaf17c288e2d4
da8e78","source_kind":"maintenance","title":"MNT-0538-022","path":"assets/WELL-0538/maintenance.jsonl"},"src_fa1d386fd
96312dca85440a6":{"id":"src_fa1d386fd96312dca85440a6","source_id":"src_fa1d386fd96312dca85440a6","source_kind":"report
","title":"assets/WELL-0538/maintenance-reports/MNT-0538-022.md","path":"assets/WELL-0538/maintenance-reports/MNT-0538
-022.md"},"ev_90b264cfd7970883f79c3d44":{"id":"ev_90b264cfd7970883f79c3d44","source_id":"src_dba4968d9e723faef79412ce"
,"source_kind":"maintenance","title":"MNT-0486-027","path":"assets/WELL-0486/maintenance.jsonl"},"src_02d6ec8a0064b40a
7e093d5b":{"id":"src_02d6ec8a0064b40a7e093d5b","source_id":"src_02d6ec8a0064b40a7e093d5b","source_kind":"report","titl
e":"assets/WELL-0486/maintenance-reports/MNT-0486-027.md","path":"assets/WELL-0486/maintenance-reports/MNT-0486-027.md
"},"ev_f688269e7ea82fede9fd5727":{"id":"ev_f688269e7ea82fede9fd5727","source_id":"src_bc364bfb214e83da466ecb2c","sourc
e_kind":"maintenance","title":"MNT-0489-028","path":"assets/WELL-0489/maintenance.jsonl"},"src_5915d99aa2c2399a67bb4b7
8":{"id":"src_5915d99aa2c2399a67bb4b78","source_id":"src_5915d99aa2c2399a67bb4b78","source_kind":"report","title":"ass
ets/WELL-0489/maintenance-reports/MNT-0489-028.md","path":"assets/WELL-0489/maintenance-reports/MNT-0489-028.md"},"ev_
e17488bf0f4f03682e7f1930":{"id":"ev_e17488bf0f4f03682e7f1930","source_id":"src_81f99732eca799e3a1216337","source_kind"
:"maintenance","title":"MNT-0469-026","path":"assets/WELL-0469/maintenance.jsonl"},"src_ee1fc0a714d63149f11f79c4":{"id
":"src_ee1fc0a714d63149f11f79c4","source_id":"src_ee1fc0a714d63149f11f79c4","source_kind":"report","title":"assets/WEL
L-0469/maintenance-reports/MNT-0469-026.md","path":"assets/WELL-0469/maintenance-reports/MNT-0469-026.md"},"ev_cda46c8
6b906011b6512dc2b":{"id":"ev_cda46c86b906011b6512dc2b","source_id":"src_448ef96f241e54d5ff831776","source_kind":"maint
enance","title":"MNT-0484-029","path":"assets/WELL-0484/maintenance.jsonl"},"src_7bd7e34c5e715fc35c982636":{"id":"src_
7bd7e34c5e715fc35c982636","source_id":"src_7bd7e34c5e715fc35c982636","source_kind":"report","title":"assets/WELL-0484/
maintenance-reports/MNT-0484-029.md","path":"assets/WELL-0484/maintenance-reports/MNT-0484-029.md"},"ev_9a8cb156360fba
90282345e9":{"id":"ev_9a8cb156360fba90282345e9","source_id":"src_a3bfcdd02583d5bfd2ed445b","source_kind":"maintenance"
,"title":"MNT-0521-023","path":"assets/WELL-0521/maintenance.jsonl"},"src_660b5fc4e949105ebfc63565":{"id":"src_660b5fc
4e949105ebfc63565","source_id":"src_660b5fc4e949105ebfc63565","source_kind":"report","title":"assets/WELL-0521/mainten
ance-reports/MNT-0521-023.md","path":"assets/WELL-0521/maintenance-reports/MNT-0521-023.md"},"ev_b03f938b902410fb02fa7
3fb":{"id":"ev_b03f938b902410fb02fa73fb","source_id":"src_97a045c9f036fa82d98786a1","source_kind":"maintenance","title
":"MNT-0505-029","path":"assets/WELL-0505/maintenance.jsonl"},"src_65c4399694c682e39aed2428":{"id":"src_65c4399694c682
e39aed2428","source_id":"src_65c4399694c682e39aed2428","source_kind":"report","title":"assets/WELL-0505/maintenance-re
ports/MNT-0505-029.md","path":"assets/WELL-0505/maintenance-reports/MNT-0505-029.md"},"ev_75cf62fb0f84f17b8f1a51c6":{"
id":"ev_75cf62fb0f84f17b8f1a51c6","source_id":"src_c988ce0f14d5ade682924ceb","source_kind":"maintenance","title":"MNT-
0598-019","path":"assets/WELL-0598/maintenance.jsonl"},"src_94ed01e961730457bdc27d83":{"id":"src_94ed01e961730457bdc27
d83","source_id":"src_94ed01e961730457bdc27d83","source_kind":"report","title":"assets/WELL-0598/maintenance-reports/M
NT-0598-019.md","path":"assets/WELL-0598/maintenance-reports/MNT-0598-019.md"},"ev_621b9a6072be9b63e5031822":{"id":"ev
_621b9a6072be9b63e5031822","source_id":"src_412cd7696ee89129ee86e89c","source_kind":"maintenance","title":"MNT-0590-03
5","path":"assets/WELL-0590/maintenance.jsonl"},"src_8a36dbf065ef1c0751b5f3a0":{"id":"src_8a36dbf065ef1c0751b5f3a0","s
ource_id":"src_8a36dbf065ef1c0751b5f3a0","source_kind":"report","title":"assets/WELL-0590/maintenance-reports/MNT-0590
-035.md","path":"assets/WELL-0590/maintenance-reports/MNT-0590-035.md"},"ev_85f15a56ca71cc2166b302d9":{"id":"ev_85f15a
56ca71cc2166b302d9","source_id":"src_a188081af2f65b38809d0e34","source_kind":"maintenance","title":"MNT-0459-025","pat
h":"assets/WELL-0459/maintenance.jsonl"},"src_2ce28d707e15105efd5accb2":{"id":"src_2ce28d707e15105efd5accb2","source_i
d":"src_2ce28d707e15105efd5accb2","source_kind":"report","title":"assets/WELL-0459/maintenance-reports/MNT-0459-025.md
","path":"assets/WELL-0459/maintenance-reports/MNT-0459-025.md"},"ev_b66ae239c8972099dbbd3ad7":{"id":"ev_b66ae239c8972
099dbbd3ad7","source_id":"src_12d9c05a572784cf9e454d9d","source_kind":"maintenance","title":"MNT-0578-029","path":"ass
ets/WELL-0578/maintenance.jsonl"},"src_8cf5d28f396db06c9fdc8901":{"id":"src_8cf5d28f396db06c9fdc8901","source_id":"src
_8cf5d28f396db06c9fdc8901","source_kind":"report","title":"assets/WELL-0578/maintenance-reports/MNT-0578-029.md","path
":"assets/WELL-0578/maintenance-reports/MNT-0578-029.md"},"ev_cb3943400ef83a28982c5724":{"id":"ev_cb3943400ef83a28982c
5724","source_id":"src_f26db529169214bafd9301d6","source_kind":"maintenance","title":"MNT-0491-027","path":"assets/WEL
L-0491/maintenance.jsonl"},"src_203fca08a59ec871345f5bd9":{"id":"src_203fca08a59ec871345f5bd9","source_id":"src_203fca
08a59ec871345f5bd9","source_kind":"report","title":"assets/WELL-0491/maintenance-reports/MNT-0491-027.md","path":"asse
ts/WELL-0491/maintenance-reports/MNT-0491-027.md"},"ev_97d0e668add704b40fdca81f":{"id":"ev_97d0e668add704b40fdca81f","
source_id":"src_077c8c42e5df8c038be45d80","source_kind":"maintenance","title":"MNT-0506-032","path":"assets/WELL-0506/
maintenance.jsonl"},"src_47f6c0d8dc618aba5192e900":{"id":"src_47f6c0d8dc618aba5192e900","source_id":"src_47f6c0d8dc618
aba5192e900","source_kind":"report","title":"assets/WELL-0506/maintenance-reports/MNT-0506-032.md","path":"assets/WELL
-0506/maintenance-reports/MNT-0506-032.md"},"ev_6b98dc4ab9f890f92500f6f3":{"id":"ev_6b98dc4ab9f890f92500f6f3","source_
id":"src_7cbb7d91ffa3297d54096bdb","source_kind":"maintenance","title":"MNT-0583-029","path":"assets/WELL-0583/mainten
ance.jsonl"},"src_f1ac05a6fe4735a5c9abe9a9":{"id":"src_f1ac05a6fe4735a5c9abe9a9","source_id":"src_f1ac05a6fe4735a5c9ab
e9a9","source_kind":"report","title":"assets/WELL-0583/maintenance-reports/MNT-0583-029.md","path":"assets/WELL-0583/m

aintenance-reports/MNT-0583-029.md"},"ev_d5d01d15720d2e9f0d9c7721":{"id":"ev_d5d01d15720d2e9f0d9c7721","source_id":"src_a188081af2f65b38809d0e34","source_kind":"maintenance","title":"MNT-0459-031","path":"assets/WELL-0459/maintenance.jsonl"},"src_4fbc8ec9002ed99f416994a6":{"id":"src_4fbc8ec9002ed99f416994a6","source_id":"src_4fbc8ec9002ed99f416994a6","source_kind":"report","title":"assets/WELL-0459/maintenance-reports/MNT-0459-031.md","path":"assets/WELL-0459/maintenance-reports/MNT-0459-031.md"},"ev_0152a2e7379a097aaf74cedb":{"id":"ev_0152a2e7379a097aaf74cedb","source_id":"src_9f6be5d38eaddda849268c9b","source_kind":"maintenance","title":"MNT-0501-028","path":"assets/WELL-0501/maintenance.jsonl"},"src_e42236f3c2f150fcf12fd73e":{"id":"src_e42236f3c2f150fcf12fd73e","source_id":"src_e42236f3c2f150fcf12fd73e","source_kind":"report","title":"assets/WELL-0501/maintenance-reports/MNT-0501-028.md","path":"assets/WELL-0501/maintenance-reports/MNT-0501-028.md"},"ev_09b2a04923dde1e2b12e4665":{"id":"ev_09b2a04923dde1e2b12e4665","source_id":"src_415a0ff3d488ae000a52115f","source_kind":"maintenance","title":"MNT-0581-029","path":"assets/WELL-0581/maintenance.jsonl"},"src_421c2968c8ec12740a0488a8":{"id":"src_421c2968c8ec12740a0488a8","source_id":"src_421c2968c8ec12740a0488a8","source_kind":"report","title":"assets/WELL-0581/maintenance-reports/MNT-0581-029.md","path":"assets/WELL-0581/maintenance-reports/MNT-0581-029.md"},"ev_3b727e195b57fc5beea26c5c":{"id":"ev_3b727e195b57fc5beea26c5c","source_id":"src_c9ee90619c8d29ec627b3a2b","source_kind":"maintenance","title":"MNT-0032-021","path":"assets/WELL-0032/maintenance.jsonl"},"src_b30455091b0ca684963c48f4":{"id":"src_b30455091b0ca684963c48f4","source_id":"src_b30455091b0ca684963c48f4","source_kind":"report","title":"assets/WELL-0032/maintenance-reports/MNT-0032-021.md","path":"assets/WELL-0032/maintenance-reports/MNT-0032-021.md"},"ev_37828739916777dc77129eb3":{"id":"ev_37828739916777dc77129eb3","source_id":"src_baf9ccceee42d9687b36d9e6","source_kind":"maintenance","title":"MNT-0036-022","path":"assets/WELL-0036/maintenance.jsonl"},"src_5529fe10097f73723cd93439":{"id":"src_5529fe10097f73723cd93439","source_id":"src_5529fe10097f73723cd93439","source_kind":"report","title":"assets/WELL-0036/maintenance-reports/MNT-0036-022.md","path":"assets/WELL-0036/maintenance-reports/MNT-0036-022.md"},"ev_09cf9bebfbe48e6bdc16d03a":{"id":"ev_09cf9bebfbe48e6bdc16d03a","source_id":"src_98df1860ccb988b3e8f938c1","source_kind":"maintenance","title":"MNT-0006-026","path":"assets/WELL-0006/maintenance.jsonl"},"src_3a097a0bed09264662b2d0f8":{"id":"src_3a097a0bed09264662b2d0f8","source_id":"src_3a097a0bed09264662b2d0f8","source_kind":"report","title":"assets/WELL-0006/maintenance-reports/MNT-0006-026.md","path":"assets/WELL-0006/maintenance-reports/MNT-0006-026.md"},"ev_6c948b50c556d28657254c4f":{"id":"ev_6c948b50c556d28657254c4f","source_id":"src_8c34118d7765947bcf5a5100","source_kind":"maintenance","title":"MNT-0010-027","path":"assets/WELL-0010/maintenance.jsonl"},"src_700d8ce0f570e3d659501ebb":{"id":"src_700d8ce0f570e3d659501ebb","source_id":"src_700d8ce0f570e3d659501ebb","source_kind":"report","title":"assets/WELL-0010/maintenance-reports/MNT-0010-027.md","path":"assets/WELL-0010/maintenance-reports/MNT-0010-027.md"},"ev_6bf7ef9d78cb2fede9b0882f":{"id":"ev_6bf7ef9d78cb2fede9b0882f","source_id":"src_db6eeb3e9730f695bdf96667","source_kind":"maintenance","title":"MNT-0271-027","path":"assets/WELL-0271/maintenance.jsonl"},"src_b6b431c2d854f60bfc3baa96":{"id":"src_b6b431c2d854f60bfc3baa96","source_id":"src_b6b431c2d854f60bfc3baa96","source_kind":"report","title":"assets/WELL-0271/maintenance-reports/MNT-0271-027.md","path":"assets/WELL-0271/maintenance-reports/MNT-0271-027.md"},"ev_85b215bc978aaa511f85c596":{"id":"ev_85b215bc978aaa511f85c596","source_id":"src_db6eeb3e9730f695bdf96667","source_kind":"maintenance","title":"MNT-0271-028","path":"assets/WELL-0271/maintenance.jsonl"},"src_1dd86975c349e93ddedc38d8":{"id":"src_1dd86975c349e93ddedc38d8","source_id":"src_1dd86975c349e93ddedc38d8","source_kind":"report","title":"assets/WELL-0271/maintenance-reports/MNT-0271-028.md","path":"assets/WELL-0271/maintenance-reports/MNT-0271-028.md"},"ev_800139ffdf2d1855ff55f2dd":{"id":"ev_800139ffdf2d1855ff55f2dd","source_id":"src_bf803d2db753981db80e010a","source_kind":"maintenance","title":"MNT-0025-032","path":"assets/WELL-0025/maintenance.jsonl"},"src_f32c49905a360fdd838d15dc":{"id":"src_f32c49905a360fdd838d15dc","source_id":"src_f32c49905a360fdd838d15dc","source_kind":"report","title":"assets/WELL-0025/maintenance-reports/MNT-0025-032.md","path":"assets/WELL-0025/maintenance-reports/MNT-0025-032.md"},"ev_31cdf7b3eddc60032fd43e27":{"id":"ev_31cdf7b3eddc60032fd43e27","source_id":"src_43b1a97293a30d2e0a02531d","source_kind":"maintenance","title":"MNT-0259-027","path":"assets/WELL-0259/maintenance.jsonl"},"src_78add4a30523a16c75e55bb0":{"id":"src_78add4a30523a16c75e55bb0","source_id":"src_78add4a30523a16c75e55bb0","source_kind":"report","title":"assets/WELL-0259/maintenance-reports/MNT-0259-027.md","path":"assets/WELL-0259/maintenance-reports/MNT-0259-027.md"},"ev_06f8cf370a32d4ac49043728":{"id":"ev_06f8cf370a32d4ac49043728","source_id":"src_bf803d2db753981db80e010a","source_kind":"maintenance","title":"MNT-0025-035","path":"assets/WELL-0025/maintenance.jsonl"},"src_3ccf88206f8d84a96505e611":{"id":"src_3ccf88206f8d84a96505e611","source_id":"src_3ccf88206f8d84a96505e611","source_kind":"report","title":"assets/WELL-0025/maintenance-reports/MNT-0025-035.md","path":"assets/WELL-0025/maintenance-reports/MNT-0025-035.md"},"ev_fcd57bce0674172bd865ad38":{"id":"ev_fcd57bce0674172bd865ad38","source_id":"src_b340b0ae12bd77619e26f2f1","source_kind":"maintenance","title":"MNT-0033-031","path":"assets/WELL-0033/maintenance.jsonl"},"src_20a83b05d63d4a0b5d9231c1":{"id":"src_20a83b05d63d4a0b5d9231c1","source_id":"src_20a83b05d63d4a0b5d9231c1","source_kind":"report","title":"assets/WELL-0033/maintenance-reports/MNT-0033-031.md","path":"assets/WELL-0033/maintenance-reports/MNT-0033-031.md"},"ev_7835e4b276ee2fbb29640107":{"id":"ev_7835e4b276ee2fbb29640107","source_id":"src_6582a1d3490955eec341fa7c","source_kind":"maintenance","title":"MNT-0018-028","path":"assets/WELL-0018/maintenance.jsonl"},"src_f89f6eec81b787243044bc65":{"id":"src_f89f6eec81b787243044bc65","source_id":"src_f89f6eec81b787243044bc65","source_kind":"report","title":"assets/WELL-0018/maintenance-reports/MNT-0018-028.md","path":"assets/WELL-0018/maintenance-reports/MNT-0018-028.md"},"ev_c0ed680764cedab70dcecd64":{"id":"ev_c0ed680764cedab70dcecd64","source_id":"src_eca15ee92416fae32244ab6a","source_kind":"maintenance","title":"MNT-0013-038","path":"assets/WELL-0013/maintenance.jsonl"},"src_18ced4e0c9b4bd5e097bb17b":{"id":"src_18ced4e0c9b4bd5e097bb17b","source_id":"src_18ced4e0c9b4bd5e097bb17b","source_kind":"report","title":"assets/WELL-0013/maintenance-reports/MNT-0013-038.md","path":"assets/WELL-0013/maintenance-reports/MNT-0013-038.md"},"ev_8b689dc6f3b8487d5df3f5ca":{"id":"ev_8b689dc6f3b8487d5df3f5ca","source_id":"src_53acb6d021f7d26a6ac303d8","source_kind":"maintenance","title":"MNT-0045-027","path":"assets/WELL-0045/maintenance.jsonl"},"src_f85a9cb9d118d5a5674fb113":{"id":"src_f85a9cb9d118d5a5674fb113","source_id":"src_f85a9cb9d118d5a5674fb113","source_kind":"report","title":"assets/WELL-0045/maintenance-reports/MNT-0045-027.md","path":"assets/WELL-0045/maintenance-reports/MNT-0045-027.md"},"ev_8197aeef59587fb62acdedd0":{"id":"ev_8197aeef59587fb62acdedd0","source_id":"src_0801314b8718d833aac7342d","source_kind":"context","title":"CTX-0045-002","path":"assets/WELL-0045/context.jsonl"},"ev_83293bcc613afe70df4e4fed":{"id":"ev_83293bcc613afe70df4e4fed","source_id":"src_98df1860ccb988b3e8f938c1","source_kind":"maintenance","title":"MNT-0006-023","path":"assets/WELL-0006/maintenance.jsonl"},"src_3056908f99dbe7964fd9e3da":{"id":"src_3056908f99dbe7964fd9e3da","source_id":"src_3056908f99dbe7964fd9e3da","source_kind":"report","title":"assets/WELL-0006/maintenance-reports/MNT-0006-023.md","path":"assets/WELL-0006/maintenance-reports/MNT-0006-023.md"},"ev_0b8ed776e5c6659018472f38":{"id":"ev_0b8ed776e5c6659018472f38","source_id":"src_c0df526acd26e7a0ca9c2901","source_kind":"maintenance","title":"MNT-0004-021","path":"assets/WELL-0004/maintenance.jsonl"},"src_d945628f1964987678acab6a":{"id":"src_d945628f1964987678acab6a","source_id":"src_d945628f1964987678acab6a","source_kind":"report","title":"assets/WELL-0004/maintenance-reports/MNT-0004-021.md","path":"assets/WELL-0004/maintenance-reports/MNT-0004-021.md"},"ev_18a391095f5fae52e982e95e":{"id":"ev_18a391095f5fae52e982e95e","source_id":"src_79f72b6258e1ecc016887a69","source_kind":"maintenance","title":"MNT-0020-030","path":"assets/WELL-0020/maintenance.jsonl"},"src_2305a8fdffda0255983c808d":{"id":"src_2305a8fdffda0255983c808d","source_id":"src_2305a8fdffda0255983c808d","source_kind":"report","title":"assets/WELL-0020/maintenance-reports/MNT-0020-030.md","path":"assets/WELL-0020/maintenance-reports/MNT-0020-030.md"},"ev_682c621cc6666ed7375784ae":{"id":"ev_682c621cc6666ed7375784ae","source_id":"src_30ddc41d65e5fc039bdd45e6","source_kind":"maintenance","title":"MNT-0043-029","path":"assets/WELL-0043/maintenance.jsonl"},"src_dcf49bb95910104a92594ab0":{"id":"src_dcf49bb95910104a92594ab0","source_id":"src_dcf49bb95910104a92594ab0","source_kind":"report","title":"assets/WELL-0043/maintenance-reports/MNT-0043-029.md","path":"assets/WELL-0043/maintenance-reports/MNT-0043-029.md"},"ev_9ef34f6f955f49cc5a939dd2":{"id":"ev_9ef34f6f955f49cc5a939dd2","source_id":"src_18aafc56af49cda94847fdea","source_kind":"maintenance","title":"MNT-0009-026","path":"assets/WELL-0009/maintenance.jsonl"},"src_46911a99eb05aafd74a3ba36":{"id":"src_46911a99eb05aafd74a3ba36","source_id":"src_46911a99eb05aafd74a3ba36","source_kind":"report","title":"assets/WELL-0009/maintenance-reports/MNT-0009-026.md","path":"assets/WELL-0009/maintenance-reports/MNT-0009-026.md"},"ev_aaeabaea8e8cc506817ad00c":{

"id":"ev_aaeabaea8e8cc506817ad00c","source_id":"src_b340b0ae12bd77619e26f2f1","source_kind":"maintenance","title":"MNT
-0033-026","path":"assets/WELL-0033/maintenance.jsonl"},"src_fa4ea1bc0fb741a2507a04ce":{"id":"src_fa4ea1bc0fb741a2507a
04ce","source_id":"src_fa4ea1bc0fb741a2507a04ce","source_kind":"report","title":"assets/WELL-0033/maintenance-reports/
MNT-0033-026.md","path":"assets/WELL-0033/maintenance-reports/MNT-0033-026.md"},"ev_bffd7db3983f87dafc92a287":{"id":"e
v_bffd7db3983f87dafc92a287","source_id":"src_c5cf445b26b4de4cfe175f48","source_kind":"maintenance","title":"MNT-0035-0
27","path":"assets/WELL-0035/maintenance.jsonl"},"src_4cd7b2734410e101538fd3dd":{"id":"src_4cd7b2734410e101538fd3dd","
source_id":"src_4cd7b2734410e101538fd3dd","source_kind":"report","title":"assets/WELL-0035/maintenance-reports/MNT-003
5-027.md","path":"assets/WELL-0035/maintenance-reports/MNT-0035-027.md"},"ev_47ee910ca43a9020377d3e78":{"id":"ev_47ee9
10ca43a9020377d3e78","source_id":"src_62f751d02bd290beeb44dccf","source_kind":"maintenance","title":"MNT-0039-024","pa
th":"assets/WELL-0039/maintenance.jsonl"},"src_2adcb0ba2c3c96c97e6a1cf2":{"id":"src_2adcb0ba2c3c96c97e6a1cf2","source_
id":"src_2adcb0ba2c3c96c97e6a1cf2","source_kind":"report","title":"assets/WELL-0039/maintenance-reports/MNT-0039-024.m
d","path":"assets/WELL-0039/maintenance-reports/MNT-0039-024.md"},"ev_e2ecc1bfefd1b8d39ac4dc77":{"id":"ev_e2ecc1bfefd1
b8d39ac4dc77","source_id":"src_c0df526acd26e7a0ca9c2901","source_kind":"maintenance","title":"MNT-0004-026","path":"as
sets/WELL-0004/maintenance.jsonl"},"src_b52a17e4373874a34dc37f94":{"id":"src_b52a17e4373874a34dc37f94","source_id":"sr
c_b52a17e4373874a34dc37f94","source_kind":"report","title":"assets/WELL-0004/maintenance-reports/MNT-0004-026.md","pat
h":"assets/WELL-0004/maintenance-reports/MNT-0004-026.md"},"ev_dcafa936d1a4cfb56e8950a7":{"id":"ev_dcafa936d1a4cfb56e8
950a7","source_id":"src_79f72b6258e1ecc016887a69","source_kind":"maintenance","title":"MNT-0020-034","path":"assets/WE
LL-0020/maintenance.jsonl"},"src_7afebd1cdc921e8f1d9519ea":{"id":"src_7afebd1cdc921e8f1d9519ea","source_id":"src_7afeb
d1cdc921e8f1d9519ea","source_kind":"report","title":"assets/WELL-0020/maintenance-reports/MNT-0020-034.md","path":"ass
ets/WELL-0020/maintenance-reports/MNT-0020-034.md"},"ev_2ef792f654812e4429013ff5":{"id":"ev_2ef792f654812e4429013ff5",
"source_id":"src_e55f6c9437df1d839066a69c","source_kind":"maintenance","title":"MNT-0026-031","path":"assets/WELL-0026
/maintenance.jsonl"},"src_37b5a1ff43ca730456263e29":{"id":"src_37b5a1ff43ca730456263e29","source_id":"src_37b5a1ff43ca
730456263e29","source_kind":"report","title":"assets/WELL-0026/maintenance-reports/MNT-0026-031.md","path":"assets/WEL
L-0026/maintenance-reports/MNT-0026-031.md"},"ev_08dc8bda22dd62c13e508839":{"id":"ev_08dc8bda22dd62c13e508839","source
_id":"src_b340b0ae12bd77619e26f2f1","source_kind":"maintenance","title":"MNT-0033-030","path":"assets/WELL-0033/mainte
nance.jsonl"},"src_b8c96da984d3b54a09aecb25":{"id":"src_b8c96da984d3b54a09aecb25","source_id":"src_b8c96da984d3b54a09a
ecb25","source_kind":"report","title":"assets/WELL-0033/maintenance-reports/MNT-0033-030.md","path":"assets/WELL-0033/
maintenance-reports/MNT-0033-030.md"},"ev_ac94c05ac7d865c904d81c42":{"id":"ev_ac94c05ac7d865c904d81c42","source_id":"s
rc_8c34118d7765947bcf5a5100","source_kind":"maintenance","title":"MNT-0010-024","path":"assets/WELL-0010/maintenance.j
sonl"},"src_64476b9336ec5b8eaa4176bc":{"id":"src_64476b9336ec5b8eaa4176bc","source_id":"src_64476b9336ec5b8eaa4176bc",
"source_kind":"report","title":"assets/WELL-0010/maintenance-reports/MNT-0010-024.md","path":"assets/WELL-0010/mainten
ance-reports/MNT-0010-024.md"},"ev_0bf567a14e7ee2a62c60f8a0":{"id":"ev_0bf567a14e7ee2a62c60f8a0","source_id":"src_b340
b0ae12bd77619e26f2f1","source_kind":"maintenance","title":"MNT-0033-024","path":"assets/WELL-0033/maintenance.jsonl"},
"src_fad4036c3e53011b4cd50bac":{"id":"src_fad4036c3e53011b4cd50bac","source_id":"src_fad4036c3e53011b4cd50bac","source
_kind":"report","title":"assets/WELL-0033/maintenance-reports/MNT-0033-024.md","path":"assets/WELL-0033/maintenance-re
ports/MNT-0033-024.md"},"ev_d1f410a383ef8a228a0c2d14":{"id":"ev_d1f410a383ef8a228a0c2d14","source_id":"src_db6eeb3e973
0f695bdf96667","source_kind":"maintenance","title":"MNT-0271-025","path":"assets/WELL-0271/maintenance.jsonl"},"src_aa
5f7464d15283dba62d2cb6":{"id":"src_aa5f7464d15283dba62d2cb6","source_id":"src_aa5f7464d15283dba62d2cb6","source_kind":
"report","title":"assets/WELL-0271/maintenance-reports/MNT-0271-025.md","path":"assets/WELL-0271/maintenance-reports/M
NT-0271-025.md"},"ev_1d2dc3fd18f508236b63953a":{"id":"ev_1d2dc3fd18f508236b63953a","source_id":"src_8cd79b361ffc31f513
048b9d","source_kind":"maintenance","title":"MNT-0028-028","path":"assets/WELL-0028/maintenance.jsonl"},"src_8a685c7da
88ec2cf3f5eeea8":{"id":"src_8a685c7da88ec2cf3f5eeea8","source_id":"src_8a685c7da88ec2cf3f5eeea8","source_kind":"report
","title":"assets/WELL-0028/maintenance-reports/MNT-0028-028.md","path":"assets/WELL-0028/maintenance-reports/MNT-0028
-028.md"},"ev_d53e3975463e58161533ac4e":{"id":"ev_d53e3975463e58161533ac4e","source_id":"src_d9142567942767d8f00359c3"
,"source_kind":"maintenance","title":"MNT-0031-026","path":"assets/WELL-0031/maintenance.jsonl"},"src_d9f568bf87721368
7abff8ca":{"id":"src_d9f568bf877213687abff8ca","source_id":"src_d9f568bf877213687abff8ca","source_kind":"report","titl
e":"assets/WELL-0031/maintenance-reports/MNT-0031-026.md","path":"assets/WELL-0031/maintenance-reports/MNT-0031-026.md
"},"ev_875b3776f3c762f4e0310480":{"id":"ev_875b3776f3c762f4e0310480","source_id":"src_bf803d2db753981db80e010a","sourc
e_kind":"maintenance","title":"MNT-0025-030","path":"assets/WELL-0025/maintenance.jsonl"},"src_692fdf49ee47eb450e80ac7
7":{"id":"src_692fdf49ee47eb450e80ac77","source_id":"src_692fdf49ee47eb450e80ac77","source_kind":"report","title":"ass
ets/WELL-0025/maintenance-reports/MNT-0025-030.md","path":"assets/WELL-0025/maintenance-reports/MNT-0025-030.md"},"ev_
8b4d2e169b836e88fcd63aec":{"id":"ev_8b4d2e169b836e88fcd63aec","source_id":"src_133d589fa9cd3f7414e6ea6b","source_kind"
:"maintenance","title":"MNT-0299-027","path":"assets/WELL-0299/maintenance.jsonl"},"src_88eba9bb7bc67c7e891eb650":{"id
":"src_88eba9bb7bc67c7e891eb650","source_id":"src_88eba9bb7bc67c7e891eb650","source_kind":"report","title":"assets/WEL
L-0299/maintenance-reports/MNT-0299-027.md","path":"assets/WELL-0299/maintenance-reports/MNT-0299-027.md"},"ev_13731e0
7eb415a122ec93fbd":{"id":"ev_13731e07eb415a122ec93fbd","source_id":"src_136edd10ba68506251046e23","source_kind":"maint
enance","title":"MNT-0015-032","path":"assets/WELL-0015/maintenance.jsonl"},"src_8c93bdca53b4a181ae09b337":{"id":"src_
8c93bdca53b4a181ae09b337","source_id":"src_8c93bdca53b4a181ae09b337","source_kind":"report","title":"assets/WELL-0015/
maintenance-reports/MNT-0015-032.md","path":"assets/WELL-0015/maintenance-reports/MNT-0015-032.md"},"ev_7a701089fbf1bf
428d5e54f0":{"id":"ev_7a701089fbf1bf428d5e54f0","source_id":"src_b0f47835ea60ac4f7f94d96e","source_kind":"maintenance"
,"title":"MNT-0041-031","path":"assets/WELL-0041/maintenance.jsonl"},"src_f3dd40845bb8527cd9ff4e45":{"id":"src_f3dd408
45bb8527cd9ff4e45","source_id":"src_f3dd40845bb8527cd9ff4e45","source_kind":"report","title":"assets/WELL-0041/mainten
ance-reports/MNT-0041-031.md","path":"assets/WELL-0041/maintenance-reports/MNT-0041-031.md"},"ev_8589bccca310cc1428b19
a70":{"id":"ev_8589bccca310cc1428b19a70","source_id":"src_d9142567942767d8f00359c3","source_kind":"maintenance","title
":"MNT-0031-028","path":"assets/WELL-0031/maintenance.jsonl"},"src_20b7c1610e1531f9e70cf347":{"id":"src_20b7c1610e1531
f9e70cf347","source_id":"src_20b7c1610e1531f9e70cf347","source_kind":"report","title":"assets/WELL-0031/maintenance-re
ports/MNT-0031-028.md","path":"assets/WELL-0031/maintenance-reports/MNT-0031-028.md"},"ev_a9c3e23e0ccf1d54fc2e9236":{"
id":"ev_a9c3e23e0ccf1d54fc2e9236","source_id":"src_b5ab1f7c53c22c63141d7da7","source_kind":"maintenance","title":"MNT-
0001-028","path":"assets/WELL-0001/maintenance.jsonl"},"src_5a6efd7ec277c929c1548869":{"id":"src_5a6efd7ec277c929c1548
869","source_id":"src_5a6efd7ec277c929c1548869","source_kind":"report","title":"assets/WELL-0001/maintenance-reports/M
NT-0001-028.md","path":"assets/WELL-0001/maintenance-reports/MNT-0001-028.md"},"ev_7f20ae47122568a52cee7cdb":{"id":"ev
_7f20ae47122568a52cee7cdb","source_id":"src_f0cc664b69f9e33045f5d681","source_kind":"maintenance","title":"MNT-0005-03
1","path":"assets/WELL-0005/maintenance.jsonl"},"src_2453229f207bd253bd1d70a2":{"id":"src_2453229f207bd253bd1d70a2","s
ource_id":"src_2453229f207bd253bd1d70a2","source_kind":"report","title":"assets/WELL-0005/maintenance-reports/MNT-0005
-031.md","path":"assets/WELL-0005/maintenance-reports/MNT-0005-031.md"},"ev_62fa93e5fa96439c6d85e4e3":{"id":"ev_62fa93
e5fa96439c6d85e4e3","source_id":"src_5343fe4dd2873d1f6a393b71","source_kind":"maintenance","title":"MNT-0021-032","pat
h":"assets/WELL-0021/maintenance.jsonl"},"src_d31bcd1d8d3ed19516865b2c":{"id":"src_d31bcd1d8d3ed19516865b2c","source_i
d":"src_d31bcd1d8d3ed19516865b2c","source_kind":"report","title":"assets/WELL-0021/maintenance-reports/MNT-0021-032.md
","path":"assets/WELL-0021/maintenance-reports/MNT-0021-032.md"},"ev_124bcee2edfd3daf55240a1e":{"id":"ev_124bcee2edfd3
daf55240a1e","source_id":"src_1096eed947d7dac4c9a70e2b","source_kind":"maintenance","title":"MNT-0002-018","path":"ass
ets/WELL-0002/maintenance.jsonl"},"src_36861417bc074048f55c222c":{"id":"src_36861417bc074048f55c222c","source_id":"src
_36861417bc074048f55c222c","source_kind":"report","title":"assets/WELL-0002/maintenance-reports/MNT-0002-018.md","path
":"assets/WELL-0002/maintenance-reports/MNT-0002-018.md"},"ev_fe9e7ae3faadb2b1572a39a8":{"id":"ev_fe9e7ae3faadb2b1572a
39a8","source_id":"src_6e94941c2a9361ce192c69b3","source_kind":"maintenance","title":"MNT-0046-027","path":"assets/WEL
L-0046/maintenance.jsonl"},"src_0a27549bb2a3330380ea5f19":{"id":"src_0a27549bb2a3330380ea5f19","source_id":"src_0a2754

9bb2a3330380ea5f19","source_kind":"report","title":"assets/WELL-0046/maintenance-reports/MNT-0046-027.md","path":"asse
ts/WELL-0046/maintenance-reports/MNT-0046-027.md"},"ev_d720b35709c94744fbce26f6":{"id":"ev_d720b35709c94744fbce26f6","
source_id":"src_4d487b6f6983f260f8ad1df3","source_kind":"maintenance","title":"MNT-0007-031","path":"assets/WELL-0007/
maintenance.jsonl"},"src_a4cc445e2cf87db16c35081e":{"id":"src_a4cc445e2cf87db16c35081e","source_id":"src_a4cc445e2cf87
db16c35081e","source_kind":"report","title":"assets/WELL-0007/maintenance-reports/MNT-0007-031.md","path":"assets/WELL
-0007/maintenance-reports/MNT-0007-031.md"},"ev_0c184aa48a3a10eb64c73f6b":{"id":"ev_0c184aa48a3a10eb64c73f6b","source_
id":"src_694058035d65d04cc4c6e16e","source_kind":"maintenance","title":"MNT-0019-026","path":"assets/WELL-0019/mainten
ance.jsonl"},"src_baf385ebb64c66cc39365c68":{"id":"src_baf385ebb64c66cc39365c68","source_id":"src_baf385ebb64c66cc3936
5c68","source_kind":"report","title":"assets/WELL-0019/maintenance-reports/MNT-0019-026.md","path":"assets/WELL-0019/m
aintenance-reports/MNT-0019-026.md"},"ev_e8d45b4fb4f81ec93ee508d5":{"id":"ev_e8d45b4fb4f81ec93ee508d5","source_id":"sr
c_b340b0ae12bd77619e26f2f1","source_kind":"maintenance","title":"MNT-0033-022","path":"assets/WELL-0033/maintenance.js
onl"},"src_0a87f9185e528b34c6596b40":{"id":"src_0a87f9185e528b34c6596b40","source_id":"src_0a87f9185e528b34c6596b40","
source_kind":"report","title":"assets/WELL-0033/maintenance-reports/MNT-0033-022.md","path":"assets/WELL-0033/maintena
nce-reports/MNT-0033-022.md"},"ev_e489cfaf1ef8497e17d4f216":{"id":"ev_e489cfaf1ef8497e17d4f216","source_id":"src_5343f
e4dd2873d1f6a393b71","source_kind":"maintenance","title":"MNT-0021-027","path":"assets/WELL-0021/maintenance.jsonl"},"
src_bf175ea96db967f925d1a9ea":{"id":"src_bf175ea96db967f925d1a9ea","source_id":"src_bf175ea96db967f925d1a9ea","source_
kind":"report","title":"assets/WELL-0021/maintenance-reports/MNT-0021-027.md","path":"assets/WELL-0021/maintenance-rep
orts/MNT-0021-027.md"},"ev_851bd55089bfe4d4e11f07c5":{"id":"ev_851bd55089bfe4d4e11f07c5","source_id":"src_9103555a2598
87061953df8a","source_kind":"maintenance","title":"MNT-0030-028","path":"assets/WELL-0030/maintenance.jsonl"},"src_fed
0a0be8d1b2b2ef660acb0":{"id":"src_fed0a0be8d1b2b2ef660acb0","source_id":"src_fed0a0be8d1b2b2ef660acb0","source_kind":"
report","title":"assets/WELL-0030/maintenance-reports/MNT-0030-028.md","path":"assets/WELL-0030/maintenance-reports/MN
T-0030-028.md"},"ev_af9304a8287e1c4ca1b6f693":{"id":"ev_af9304a8287e1c4ca1b6f693","source_id":"src_31bae7ff973ccd16eee
8069d","source_kind":"maintenance","title":"MNT-0255-027","path":"assets/WELL-0255/maintenance.jsonl"},"src_853f552b37
b7259f50709536":{"id":"src_853f552b37b7259f50709536","source_id":"src_853f552b37b7259f50709536","source_kind":"report"
,"title":"assets/WELL-0255/maintenance-reports/MNT-0255-027.md","path":"assets/WELL-0255/maintenance-reports/MNT-0255-
027.md"},"ev_de6a6bd374c222311d909d20":{"id":"ev_de6a6bd374c222311d909d20","source_id":"src_136edd10ba68506251046e23",
"source_kind":"maintenance","title":"MNT-0015-030","path":"assets/WELL-0015/maintenance.jsonl"},"src_05ebd6dc21b5bee4a
63a039b":{"id":"src_05ebd6dc21b5bee4a63a039b","source_id":"src_05ebd6dc21b5bee4a63a039b","source_kind":"report","title
":"assets/WELL-0015/maintenance-reports/MNT-0015-030.md","path":"assets/WELL-0015/maintenance-reports/MNT-0015-030.md"
},"ev_413b657baa1a720dc0fc8221":{"id":"ev_413b657baa1a720dc0fc8221","source_id":"src_c62d192595c2ba9b43489372","source
_kind":"maintenance","title":"MNT-0042-020","path":"assets/WELL-0042/maintenance.jsonl"},"src_05b33ce7c246fc953bb7c9fa
":{"id":"src_05b33ce7c246fc953bb7c9fa","source_id":"src_05b33ce7c246fc953bb7c9fa","source_kind":"report","title":"asse
ts/WELL-0042/maintenance-reports/MNT-0042-020.md","path":"assets/WELL-0042/maintenance-reports/MNT-0042-020.md"},"ev_a
93b2a7d0e278d3cad034eb3":{"id":"ev_a93b2a7d0e278d3cad034eb3","source_id":"src_98df1860ccb988b3e8f938c1","source_kind":
"maintenance","title":"MNT-0006-025","path":"assets/WELL-0006/maintenance.jsonl"},"src_554add9ed39d338a7f8e2efe":{"id"
:"src_554add9ed39d338a7f8e2efe","source_id":"src_554add9ed39d338a7f8e2efe","source_kind":"report","title":"assets/WELL
-0006/maintenance-reports/MNT-0006-025.md","path":"assets/WELL-0006/maintenance-reports/MNT-0006-025.md"},"ev_2d291bf3
16a69cdce5ef679e":{"id":"ev_2d291bf316a69cdce5ef679e","source_id":"src_816293105cfd004565ca59c8","source_kind":"mainte
nance","title":"MNT-0040-025","path":"assets/WELL-0040/maintenance.jsonl"},"src_ffb1649b6044c7a6acb9df7f":{"id":"src_f
fb1649b6044c7a6acb9df7f","source_id":"src_ffb1649b6044c7a6acb9df7f","source_kind":"report","title":"assets/WELL-0040/m
aintenance-reports/MNT-0040-025.md","path":"assets/WELL-0040/maintenance-reports/MNT-0040-025.md"},"ev_4ea815961fe619a
c38a83250":{"id":"ev_4ea815961fe619ac38a83250","source_id":"src_ef1967f024c6c990a643c21c","source_kind":"maintenance",
"title":"MNT-0279-028","path":"assets/WELL-0279/maintenance.jsonl"},"src_102c31d288fad986f2eac3aa":{"id":"src_102c31d2
88fad986f2eac3aa","source_id":"src_102c31d288fad986f2eac3aa","source_kind":"report","title":"assets/WELL-0279/maintena
nce-reports/MNT-0279-028.md","path":"assets/WELL-0279/maintenance-reports/MNT-0279-028.md"},"ev_def89e6e73e242e50a477c
59":{"id":"ev_def89e6e73e242e50a477c59","source_id":"src_6cc7ca9f0b7caf865843098a","source_kind":"context","title":"CT
X-0279-002","path":"assets/WELL-0279/context.jsonl"},"ev_01eac672d75187f18f0f67b5":{"id":"ev_01eac672d75187f18f0f67b5"
,"source_id":"src_b0f47835ea60ac4f7f94d96e","source_kind":"maintenance","title":"MNT-0041-034","path":"assets/WELL-004
1/maintenance.jsonl"},"src_18d6e8cfa38753eb5d690161":{"id":"src_18d6e8cfa38753eb5d690161","source_id":"src_18d6e8cfa38
753eb5d690161","source_kind":"report","title":"assets/WELL-0041/maintenance-reports/MNT-0041-034.md","path":"assets/WE
LL-0041/maintenance-reports/MNT-0041-034.md"},"ev_e6247f6404f79323f62332af":{"id":"ev_e6247f6404f79323f62332af","sourc
e_id":"src_daf1f7091f3b244c81157416","source_kind":"maintenance","title":"MNT-0023-030","path":"assets/WELL-0023/maint
enance.jsonl"},"src_ef59b5d70b778123d1fa48f3":{"id":"src_ef59b5d70b778123d1fa48f3","source_id":"src_ef59b5d70b778123d1
fa48f3","source_kind":"report","title":"assets/WELL-0023/maintenance-reports/MNT-0023-030.md","path":"assets/WELL-0023
/maintenance-reports/MNT-0023-030.md"},"ev_7962541db673c84b1c33d440":{"id":"ev_7962541db673c84b1c33d440","source_id":"
src_eca15ee92416fae32244ab6a","source_kind":"maintenance","title":"MNT-0013-037","path":"assets/WELL-0013/maintenance.
jsonl"},"src_25eeae438132839632c0cb46":{"id":"src_25eeae438132839632c0cb46","source_id":"src_25eeae438132839632c0cb46"
,"source_kind":"report","title":"assets/WELL-0013/maintenance-reports/MNT-0013-037.md","path":"assets/WELL-0013/mainte
nance-reports/MNT-0013-037.md"},"ev_0a903cfe491dd668762d137b":{"id":"ev_0a903cfe491dd668762d137b","source_id":"src_c62
d192595c2ba9b43489372","source_kind":"maintenance","title":"MNT-0042-027","path":"assets/WELL-0042/maintenance.jsonl"}
,"src_f797ac07c70497dccfbef879":{"id":"src_f797ac07c70497dccfbef879","source_id":"src_f797ac07c70497dccfbef879","sourc
e_kind":"report","title":"assets/WELL-0042/maintenance-reports/MNT-0042-027.md","path":"assets/WELL-0042/maintenance-r
eports/MNT-0042-027.md"},"ev_7bf2da5b0c4d9bd832025997":{"id":"ev_7bf2da5b0c4d9bd832025997","source_id":"src_bfe00af606
26bb46c4c20613","source_kind":"maintenance","title":"MNT-0089-025","path":"assets/WELL-0089/maintenance.jsonl"},"src_5
383f97a7dfd459c51dfe054":{"id":"src_5383f97a7dfd459c51dfe054","source_id":"src_5383f97a7dfd459c51dfe054","source_kind"
:"report","title":"assets/WELL-0089/maintenance-reports/MNT-0089-025.md","path":"assets/WELL-0089/maintenance-reports/
MNT-0089-025.md"},"ev_4f7aa9e69c51618770246d63":{"id":"ev_4f7aa9e69c51618770246d63","source_id":"src_129e38ef417b797f6
8484512","source_kind":"maintenance","title":"MNT-0065-024","path":"assets/WELL-0065/maintenance.jsonl"},"src_6884c517
608acf5fa973f047":{"id":"src_6884c517608acf5fa973f047","source_id":"src_6884c517608acf5fa973f047","source_kind":"repor
t","title":"assets/WELL-0065/maintenance-reports/MNT-0065-024.md","path":"assets/WELL-0065/maintenance-reports/MNT-006
5-024.md"},"ev_71f34b08863ca1398801177d":{"id":"ev_71f34b08863ca1398801177d","source_id":"src_92481b154f5438cc652ae0d8
","source_kind":"maintenance","title":"MNT-0069-034","path":"assets/WELL-0069/maintenance.jsonl"},"src_68324dca9e04e39
9749c959f":{"id":"src_68324dca9e04e399749c959f","source_id":"src_68324dca9e04e399749c959f","source_kind":"report","titl
e":"assets/WELL-0069/maintenance-reports/MNT-0069-034.md","path":"assets/WELL-0069/maintenance-reports/MNT-0069-034.m
d"},"ev_3e090317104c161c377efc5e":{"id":"ev_3e090317104c161c377efc5e","source_id":"src_4806f7023ddbb019480f7189","sour
ce_kind":"maintenance","title":"MNT-0088-031","path":"assets/WELL-0088/maintenance.jsonl"},"src_38ce02b336e8ae45a713a4
7b":{"id":"src_38ce02b336e8ae45a713a47b","source_id":"src_38ce02b336e8ae45a713a47b","source_kind":"report","title":"as
sets/WELL-0088/maintenance-reports/MNT-0088-031.md","path":"assets/WELL-0088/maintenance-reports/MNT-0088-031.md"},"ev
_8d57495f961089b2ad6c8f6c":{"id":"ev_8d57495f961089b2ad6c8f6c","source_id":"src_3d6caa0b32682b562dd0c223","source_kind
":"maintenance","title":"MNT-0063-031","path":"assets/WELL-0063/maintenance.jsonl"},"src_53991f1e41b3dc68ba855510":{"i
d":"src_53991f1e41b3dc68ba855510","source_id":"src_53991f1e41b3dc68ba855510","source_kind":"report","title":"assets/WE
LL-0063/maintenance-reports/MNT-0063-031.md","path":"assets/WELL-0063/maintenance-reports/MNT-0063-031.md"},"ev_826a47
3b3c433ebfe86f982c":{"id":"ev_826a473b3c433ebfe86f982c","source_id":"src_8883c6c830cb23cd48876787","source_kind":"main
tenance","title":"MNT-0058-031","path":"assets/WELL-0058/maintenance.jsonl"},"src_3b45f1e731b9f683b84dfb99":{"id":"src
_3b45f1e731b9f683b84dfb99","source_id":"src_3b45f1e731b9f683b84dfb99","source_kind":"report","title":"assets/WELL-0058

/maintenance-reports/MNT-0058-031.md","path":"assets/WELL-0058/maintenance-reports/MNT-0058-031.md"},"ev_7d603c183d1a89aabd417632":{"id":"ev_7d603c183d1a89aabd417632","source_id":"src_3fff06635abd6a444a9318a7","source_kind":"maintenance","title":"MNT-0097-032","path":"assets/WELL-0097/maintenance.jsonl"},"src_44b41e3dce157590816d1c9c":{"id":"src_44b41e3dce157590816d1c9c","source_id":"src_44b41e3dce157590816d1c9c","source_kind":"report","title":"assets/WELL-0097/maintenance-reports/MNT-0097-032.md","path":"assets/WELL-0097/maintenance-reports/MNT-0097-032.md"},"ev_22c5f8e7250f6cd563886071":{"id":"ev_22c5f8e7250f6cd563886071","source_id":"src_f161b2fd9c77aaa1474ddcc9","source_kind":"maintenance","title":"MNT-0288-028","path":"assets/WELL-0288/maintenance.jsonl"},"src_0bf23aa1b00c94713b4dd128":{"id":"src_0bf23aa1b00c94713b4dd128","source_id":"src_0bf23aa1b00c94713b4dd128","source_kind":"report","title":"assets/WELL-0288/maintenance-reports/MNT-0288-028.md","path":"assets/WELL-0288/maintenance-reports/MNT-0288-028.md"},"ev_fa65d1aa650da814063d887d":{"id":"ev_fa65d1aa650da814063d887d","source_id":"src_99c8c3234a984bb632010a0f","source_kind":"maintenance","title":"MNT-0264-026","path":"assets/WELL-0264/maintenance.jsonl"},"src_432a2a1763c016c81264eb25":{"id":"src_432a2a1763c016c81264eb25","source_id":"src_432a2a1763c016c81264eb25","source_kind":"report","title":"assets/WELL-0264/maintenance-reports/MNT-0264-026.md","path":"assets/WELL-0264/maintenance-reports/MNT-0264-026.md"},"ev_e81624e9576bf3244151e0b0":{"id":"ev_e81624e9576bf3244151e0b0","source_id":"src_084c84141e0712e2f43f47e6","source_kind":"maintenance","title":"MNT-0260-035","path":"assets/WELL-0260/maintenance.jsonl"},"src_07fd7a661b45618dbb43f3ff":{"id":"src_07fd7a661b45618dbb43f3ff","source_id":"src_07fd7a661b45618dbb43f3ff","source_kind":"report","title":"assets/WELL-0260/maintenance-reports/MNT-0260-035.md","path":"assets/WELL-0260/maintenance-reports/MNT-0260-035.md"},"ev_c3e1fc7c725f3f6ea6b2a26e":{"id":"ev_c3e1fc7c725f3f6ea6b2a26e","source_id":"src_176547ed2fe81f70d5f355c4","source_kind":"maintenance","title":"MNT-0096-037","path":"assets/WELL-0096/maintenance.jsonl"},"src_0b275954ccb4e56575566c2c":{"id":"src_0b275954ccb4e56575566c2c","source_id":"src_0b275954ccb4e56575566c2c","source_kind":"report","title":"assets/WELL-0096/maintenance-reports/MNT-0096-037.md","path":"assets/WELL-0096/maintenance-reports/MNT-0096-037.md"},"ev_b966b213ed933e42e251aaf1":{"id":"ev_b966b213ed933e42e251aaf1","source_id":"src_0009b4e22c2c9cbc08720bba","source_kind":"maintenance","title":"MNT-0077-027","path":"assets/WELL-0077/maintenance.jsonl"},"src_5dc8271c636cb1a138ef1177":{"id":"src_5dc8271c636cb1a138ef1177","source_id":"src_5dc8271c636cb1a138ef1177","source_kind":"report","title":"assets/WELL-0077/maintenance-reports/MNT-0077-027.md","path":"assets/WELL-0077/maintenance-reports/MNT-0077-027.md"},"ev_c3fb3f5faca88c118d5fa814":{"id":"ev_c3fb3f5faca88c118d5fa814","source_id":"src_bfe00af60626bb46c4c20613","source_kind":"maintenance","title":"MNT-0089-032","path":"assets/WELL-0089/maintenance.jsonl"},"src_44c024c3e854918b76ab8921":{"id":"src_44c024c3e854918b76ab8921","source_id":"src_44c024c3e854918b76ab8921","source_kind":"report","title":"assets/WELL-0089/maintenance-reports/MNT-0089-032.md","path":"assets/WELL-0089/maintenance-reports/MNT-0089-032.md"},"ev_8dfe96c34e43559ab7f4d2e4":{"id":"ev_8dfe96c34e43559ab7f4d2e4","source_id":"src_76f6ad68d90413e69e443f1d","source_kind":"maintenance","title":"MNT-0060-036","path":"assets/WELL-0060/maintenance.jsonl"},"src_6b66b69167082bac4b395204":{"id":"src_6b66b69167082bac4b395204","source_id":"src_6b66b69167082bac4b395204","source_kind":"report","title":"assets/WELL-0060/maintenance-reports/MNT-0060-036.md","path":"assets/WELL-0060/maintenance-reports/MNT-0060-036.md"},"ev_3ace77d4e38e5ae3a59e7ae8":{"id":"ev_3ace77d4e38e5ae3a59e7ae8","source_id":"src_f1fb22c0746a8677b18fea03","source_kind":"maintenance","title":"MNT-0075-028","path":"assets/WELL-0075/maintenance.jsonl"},"src_56fd89f29aa4c5d4544f8449":{"id":"src_56fd89f29aa4c5d4544f8449","source_id":"src_56fd89f29aa4c5d4544f8449","source_kind":"report","title":"assets/WELL-0075/maintenance-reports/MNT-0075-028.md","path":"assets/WELL-0075/maintenance-reports/MNT-0075-028.md"},"ev_2e84f0923f2b4a84e1750db4":{"id":"ev_2e84f0923f2b4a84e1750db4","source_id":"src_9b9cd9e1c9735c1cd38196ac","source_kind":"maintenance","title":"MNT-0071-032","path":"assets/WELL-0071/maintenance.jsonl"},"src_c640e53bfa95bdcd071ac64c":{"id":"src_c640e53bfa95bdcd071ac64c","source_id":"src_c640e53bfa95bdcd071ac64c","source_kind":"report","title":"assets/WELL-0071/maintenance-reports/MNT-0071-032.md","path":"assets/WELL-0071/maintenance-reports/MNT-0071-032.md"},"ev_31194a5b8cb1d8c6ff43d190":{"id":"ev_31194a5b8cb1d8c6ff43d190","source_id":"src_4c796194d9c27b6438fb9feb","source_kind":"maintenance","title":"MNT-0066-031","path":"assets/WELL-0066/maintenance.jsonl"},"src_43c4a5aa606602abe8821199":{"id":"src_43c4a5aa606602abe8821199","source_id":"src_43c4a5aa606602abe8821199","source_kind":"report","title":"assets/WELL-0066/maintenance-reports/MNT-0066-031.md","path":"assets/WELL-0066/maintenance-reports/MNT-0066-031.md"},"ev_3c3ffff544e7b4fa00a5ccda":{"id":"ev_3c3ffff544e7b4fa00a5ccda","source_id":"src_4c325b7e7e9d6706d326a8bb","source_kind":"maintenance","title":"MNT-0268-022","path":"assets/WELL-0268/maintenance.jsonl"},"src_9e42a812ea4bf956d836a9ec":{"id":"src_9e42a812ea4bf956d836a9ec","source_id":"src_9e42a812ea4bf956d836a9ec","source_kind":"report","title":"assets/WELL-0268/maintenance-reports/MNT-0268-022.md","path":"assets/WELL-0268/maintenance-reports/MNT-0268-022.md"},"ev_86246a6f84e810682201edf4":{"id":"ev_86246a6f84e810682201edf4","source_id":"src_ddd7c2aafce6b45b0a8daade","source_kind":"maintenance","title":"MNT-0080-025","path":"assets/WELL-0080/maintenance.jsonl"},"src_cbb0984132855770b4070700":{"id":"src_cbb0984132855770b4070700","source_id":"src_cbb0984132855770b4070700","source_kind":"report","title":"assets/WELL-0080/maintenance-reports/MNT-0080-025.md","path":"assets/WELL-0080/maintenance-reports/MNT-0080-025.md"},"ev_880d578a54cbdeff8b9f7832":{"id":"ev_880d578a54cbdeff8b9f7832","source_id":"src_79b452390c034bfaee47e73e","source_kind":"maintenance","title":"MNT-0085-031","path":"assets/WELL-0085/maintenance.jsonl"},"src_41f6904bb88f623cd2acb3b5":{"id":"src_41f6904bb88f623cd2acb3b5","source_id":"src_41f6904bb88f623cd2acb3b5","source_kind":"report","title":"assets/WELL-0085/maintenance-reports/MNT-0085-031.md","path":"assets/WELL-0085/maintenance-reports/MNT-0085-031.md"},"ev_5b09205c5adc40b9634508ee":{"id":"ev_5b09205c5adc40b9634508ee","source_id":"src_15cc8eea61a046f2b5c5e3fe","source_kind":"maintenance","title":"MNT-0084-032","path":"assets/WELL-0084/maintenance.jsonl"},"src_d2ee8c15926168afe94ae069":{"id":"src_d2ee8c15926168afe94ae069","source_id":"src_d2ee8c15926168afe94ae069","source_kind":"report","title":"assets/WELL-0084/maintenance-reports/MNT-0084-032.md","path":"assets/WELL-0084/maintenance-reports/MNT-0084-032.md"},"ev_8b1d9af0a8f1646d40de2fa6":{"id":"ev_8b1d9af0a8f1646d40de2fa6","source_id":"src_2a6540e8567c0e284263b9b1","source_kind":"maintenance","title":"MNT-0074-038","path":"assets/WELL-0074/maintenance.jsonl"},"src_8d406241f73f509a2016f299":{"id":"src_8d406241f73f509a2016f299","source_id":"src_8d406241f73f509a2016f299","source_kind":"report","title":"assets/WELL-0074/maintenance-reports/MNT-0074-038.md","path":"assets/WELL-0074/maintenance-reports/MNT-0074-038.md"},"ev_57842913e63577633a381f50":{"id":"ev_57842913e63577633a381f50","source_id":"src_79b452390c034bfaee47e73e","source_kind":"maintenance","title":"MNT-0085-022","path":"assets/WELL-0085/maintenance.jsonl"},"src_70c3f9c7b7d1cb1a87f97323":{"id":"src_70c3f9c7b7d1cb1a87f97323","source_id":"src_70c3f9c7b7d1cb1a87f97323","source_kind":"report","title":"assets/WELL-0085/maintenance-reports/MNT-0085-022.md","path":"assets/WELL-0085/maintenance-reports/MNT-0085-022.md"},"ev_796f963a7a2f25335f6e482d":{"id":"ev_796f963a7a2f25335f6e482d","source_id":"src_cb7f3308c3138764280dba3c","source_kind":"maintenance","title":"MNT-0100-031","path":"assets/WELL-0100/maintenance.jsonl"},"src_c862c252111613e3d04f7613":{"id":"src_c862c252111613e3d04f7613","source_id":"src_c862c252111613e3d04f7613","source_kind":"report","title":"assets/WELL-0100/maintenance-reports/MNT-0100-031.md","path":"assets/WELL-0100/maintenance-reports/MNT-0100-031.md"},"ev_2ed71ec7539701935018419d":{"id":"ev_2ed71ec7539701935018419d","source_id":"src_92481b154f5438cc652ae0d8","source_kind":"maintenance","title":"MNT-0069-032","path":"assets/WELL-0069/maintenance.jsonl"},"src_36542d200dca2ed6bf8ec427":{"id":"src_36542d200dca2ed6bf8ec427","source_id":"src_36542d200dca2ed6bf8ec427","source_kind":"report","title":"assets/WELL-0069/maintenance-reports/MNT-0069-032.md","path":"assets/WELL-0069/maintenance-reports/MNT-0069-032.md"},"ev_a31a4d122065cb257db8fca0":{"id":"ev_a31a4d122065cb257db8fca0","source_id":"src_f391bec5702c6223c68e7a97","source_kind":"maintenance","title":"MNT-0055-026","path":"assets/WELL-0055/maintenance.jsonl"},"src_38c79f559c392593f863110f":{"id":"src_38c79f559c392593f863110f","source_id":"src_38c79f559c392593f863110f","source_kind":"report","title":"assets/WELL-0055/maintenance-reports/MNT-0055-026.md","path":"assets/WELL-0055/maintenance-reports/MNT-0055-026.md"},"ev_138a6b5fef0dd1f34f206e97":{"id":"ev_138a6b5fef0dd1f34f206e97","source_id":"src_79b452390c034bfaee47e73e","source_kind":"maintenance","title":"MNT-0085-027","path":"assets/WELL-0085/maintenance.jsonl"},"src_d7d26e3ff87d0f5e733ea092":{"id":"src_d7d26e3ff87d0f5e733ea092","source_id":"src_d7d26e3ff87d0f5e733ea092","source_kind":"report","title":"assets/WELL-0085/maintenance-reports/MNT-0085-027.md","path":"assets/WELL-0085/maintenance-reports/MNT-0085-027.md"},"ev_8085287e4f1dbbaabce0f737":{"id":"ev_8085287e4f1dbbaabce0f737","source_id":"src_129e38ef417b797f68484512","source_kind":"maintenance","title":"MNT-0065-026","pat

h":"assets/WELL-0065/maintenance.jsonl"},"src_24b119b09aedfed71cbcd30e":{"id":"src_24b119b09aedfed71cbcd30e","source_id":"src_24b119b09aedfed71cbcd30e","source_kind":"report","title":"assets/WELL-0065/maintenance-reports/MNT-0065-026.md","path":"assets/WELL-0065/maintenance-reports/MNT-0065-026.md"},"ev_2ca77a93aa95f9f367cf4670":{"id":"ev_2ca77a93aa95f9f367cf4670","source_id":"src_00ee609d140664ad7e470101","source_kind":"maintenance","title":"MNT-0079-032","path":"assets/WELL-0079/maintenance.jsonl"},"src_3a414e02b31f0754a35b297a":{"id":"src_3a414e02b31f0754a35b297a","source_id":"src_3a414e02b31f0754a35b297a","source_kind":"report","title":"assets/WELL-0079/maintenance-reports/MNT-0079-032.md","path":"assets/WELL-0079/maintenance-reports/MNT-0079-032.md"},"ev_da69e1254a6529ced76fc5ae":{"id":"ev_da69e1254a6529ced76fc5ae","source_id":"src_a8f3e6b61076df21126738b9","source_kind":"maintenance","title":"MNT-0062-025","path":"assets/WELL-0062/maintenance.jsonl"},"src_c4b17da7657e589c59027a27":{"id":"src_c4b17da7657e589c59027a27","source_id":"src_c4b17da7657e589c59027a27","source_kind":"report","title":"assets/WELL-0062/maintenance-reports/MNT-0062-025.md","path":"assets/WELL-0062/maintenance-reports/MNT-0062-025.md"},"ev_6f0b9c8341256a45c8e7ab00":{"id":"ev_6f0b9c8341256a45c8e7ab00","source_id":"src_084c84141e0712e2f43f47e6","source_kind":"maintenance","title":"MNT-0260-031","path":"assets/WELL-0260/maintenance.jsonl"},"src_6d6df147315ec26ce171e981":{"id":"src_6d6df147315ec26ce171e981","source_id":"src_6d6df147315ec26ce171e981","source_kind":"report","title":"assets/WELL-0260/maintenance-reports/MNT-0260-031.md","path":"assets/WELL-0260/maintenance-reports/MNT-0260-031.md"},"ev_1b1196ae36fc627a93b3f520":{"id":"ev_1b1196ae36fc627a93b3f520","source_id":"src_15cc8eea61a046f2b5c5e3fe","source_kind":"maintenance","title":"MNT-0084-031","path":"assets/WELL-0084/maintenance.jsonl"},"src_5f8249f0134107dfe600963a":{"id":"src_5f8249f0134107dfe600963a","source_id":"src_5f8249f0134107dfe600963a","source_kind":"report","title":"assets/WELL-0084/maintenance-reports/MNT-0084-031.md","path":"assets/WELL-0084/maintenance-reports/MNT-0084-031.md"},"ev_e8603370f55551253dec7ea4":{"id":"ev_e8603370f55551253dec7ea4","source_id":"src_ff6dea100407d7ca3d7e82ef","source_kind":"maintenance","title":"MNT-0093-032","path":"assets/WELL-0093/maintenance.jsonl"},"src_4bd705292c662260967ce798":{"id":"src_4bd705292c662260967ce798","source_id":"src_4bd705292c662260967ce798","source_kind":"report","title":"assets/WELL-0093/maintenance-reports/MNT-0093-032.md","path":"assets/WELL-0093/maintenance-reports/MNT-0093-032.md"},"ev_747cbb853f87a42cdb7aec6e":{"id":"ev_747cbb853f87a42cdb7aec6e","source_id":"src_00ee609d140664ad7e470101","source_kind":"maintenance","title":"MNT-0079-036","path":"assets/WELL-0079/maintenance.jsonl"},"src_246e2ad972d6c30a4ed826d9":{"id":"src_246e2ad972d6c30a4ed826d9","source_id":"src_246e2ad972d6c30a4ed826d9","source_kind":"report","title":"assets/WELL-0079/maintenance-reports/MNT-0079-036.md","path":"assets/WELL-0079/maintenance-reports/MNT-0079-036.md"},"ev_999461c820b0a99894f2197c":{"id":"ev_999461c820b0a99894f2197c","source_id":"src_f3c8616f0acb22123aee1ae","source_kind":"maintenance","title":"MNT-0070-027","path":"assets/WELL-0070/maintenance.jsonl"},"src_9152fc4dd4473b4354335c53":{"id":"src_9152fc4dd4473b4354335c53","source_id":"src_9152fc4dd4473b4354335c53","source_kind":"report","title":"assets/WELL-0070/maintenance-reports/MNT-0070-027.md","path":"assets/WELL-0070/maintenance-reports/MNT-0070-027.md"},"ev_e3f7f4ad45e59e8bb4a3cca4":{"id":"ev_e3f7f4ad45e59e8bb4a3cca4","source_id":"src_816a181875a8815754b3e3d7","source_kind":"maintenance","title":"MNT-0078-022","path":"assets/WELL-0078/maintenance.jsonl"},"src_ebba510a592fc3144e4a4a97":{"id":"src_ebba510a592fc3144e4a4a97","source_id":"src_ebba510a592fc3144e4a4a97","source_kind":"report","title":"assets/WELL-0078/maintenance-reports/MNT-0078-022.md","path":"assets/WELL-0078/maintenance-reports/MNT-0078-022.md"},"ev_d491249355076386c7c4c6b0":{"id":"ev_d491249355076386c7c4c6b0","source_id":"src_136aa9083656cc5e4516d1c6","source_kind":"context","title":"CTX-0078-002","path":"assets/WELL-0078/context.jsonl"},"ev_023e9811208cb685deb5424c":{"id":"ev_023e9811208cb685deb5424c","source_id":"src_6c9165f9dcddf43313ce5dab","source_kind":"maintenance","title":"MNT-0252-028","path":"assets/WELL-0252/maintenance.jsonl"},"src_a15c31273e0deb0d20be24cc":{"id":"src_a15c31273e0deb0d20be24cc","source_id":"src_a15c31273e0deb0d20be24cc","source_kind":"report","title":"assets/WELL-0252/maintenance-reports/MNT-0252-028.md","path":"assets/WELL-0252/maintenance-reports/MNT-0252-028.md"},"ev_6cc0d5b6f2d48fcbcc4d5556":{"id":"ev_6cc0d5b6f2d48fcbcc4d5556","source_id":"src_15cc8eea61a046f2b5c5e3fe","source_kind":"maintenance","title":"MNT-0084-025","path":"assets/WELL-0084/maintenance.jsonl"},"src_9ee2d7bfb9a9f1e72b58e985":{"id":"src_9ee2d7bfb9a9f1e72b58e985","source_id":"src_9ee2d7bfb9a9f1e72b58e985","source_kind":"report","title":"assets/WELL-0084/maintenance-reports/MNT-0084-025.md","path":"assets/WELL-0084/maintenance-reports/MNT-0084-025.md"},"ev_a0b9d800fb49222f6c993c03":{"id":"ev_a0b9d800fb49222f6c993c03","source_id":"src_129e38ef417b797f68484512","source_kind":"maintenance","title":"MNT-0065-022","path":"assets/WELL-0065/maintenance.jsonl"},"src_ee8ca4ad5bd992558acfd8c7":{"id":"src_ee8ca4ad5bd992558acfd8c7","source_id":"src_ee8ca4ad5bd992558acfd8c7","source_kind":"report","title":"assets/WELL-0065/maintenance-reports/MNT-0065-022.md","path":"assets/WELL-0065/maintenance-reports/MNT-0065-022.md"},"ev_52101fb07895ad374eb47818":{"id":"ev_52101fb07895ad374eb47818","source_id":"src_7b1a85b53214a922202a1d0b","source_kind":"maintenance","title":"MNT-0090-030","path":"assets/WELL-0090/maintenance.jsonl"},"src_3be92ac562b1cc827facad83":{"id":"src_3be92ac562b1cc827facad83","source_id":"src_3be92ac562b1cc827facad83","source_kind":"report","title":"assets/WELL-0090/maintenance-reports/MNT-0090-030.md","path":"assets/WELL-0090/maintenance-reports/MNT-0090-030.md"},"ev_8ad0394eb6fecac67a7c17b5":{"id":"ev_8ad0394eb6fecac67a7c17b5","source_id":"src_d1620092c43ace1a1db92991","source_kind":"maintenance","title":"MNT-0292-024","path":"assets/WELL-0292/maintenance.jsonl"},"src_7a47f14f7de5a7c7588b7339":{"id":"src_7a47f14f7de5a7c7588b7339","source_id":"src_7a47f14f7de5a7c7588b7339","source_kind":"report","title":"assets/WELL-0292/maintenance-reports/MNT-0292-024.md","path":"assets/WELL-0292/maintenance-reports/MNT-0292-024.md"},"ev_0705f054fd3f5418058a6be0":{"id":"ev_0705f054fd3f5418058a6be0","source_id":"src_6c9165f9dcddf43313ce5dab","source_kind":"maintenance","title":"MNT-0252-030","path":"assets/WELL-0252/maintenance.jsonl"},"src_64b5f31c686c2e70ec688e21":{"id":"src_64b5f31c686c2e70ec688e21","source_id":"src_64b5f31c686c2e70ec688e21","source_kind":"report","title":"assets/WELL-0252/maintenance-reports/MNT-0252-030.md","path":"assets/WELL-0252/maintenance-reports/MNT-0252-030.md"},"ev_05cdc9bd9bf8609f19d2bf8a":{"id":"ev_05cdc9bd9bf8609f19d2bf8a","source_id":"src_816a181875a8815754b3e3d7","source_kind":"maintenance","title":"MNT-0078-026","path":"assets/WELL-0078/maintenance.jsonl"},"src_e48fd5d5081229581617aa2e":{"id":"src_e48fd5d5081229581617aa2e","source_id":"src_e48fd5d5081229581617aa2e","source_kind":"report","title":"assets/WELL-0078/maintenance-reports/MNT-0078-026.md","path":"assets/WELL-0078/maintenance-reports/MNT-0078-026.md"},"ev_9d6e370ab75de2a730003998":{"id":"ev_9d6e370ab75de2a730003998","source_id":"src_366a62090d1b8f2766fd5301","source_kind":"maintenance","title":"MNT-0072-029","path":"assets/WELL-0072/maintenance.jsonl"},"src_8d233504b365ece3afc4d166":{"id":"src_8d233504b365ece3afc4d166","source_id":"src_8d233504b365ece3afc4d166","source_kind":"report","title":"assets/WELL-0072/maintenance-reports/MNT-0072-029.md","path":"assets/WELL-0072/maintenance-reports/MNT-0072-029.md"},"ev_cb32c016fb7f86d21cfb72e3":{"id":"ev_cb32c016fb7f86d21cfb72e3","source_id":"src_2a1342391fa773b8d543417d","source_kind":"context","title":"CTX-0072-001","path":"assets/WELL-0072/context.jsonl"},"ev_d1df6269f93b6b5573feeb38":{"id":"ev_d1df6269f93b6b5573feeb38","source_id":"src_084c84141e0712e2f43f47e6","source_kind":"maintenance","title":"MNT-0260-033","path":"assets/WELL-0260/maintenance.jsonl"},"src_8ff4361f8474d50fa3fa6b57":{"id":"src_8ff4361f8474d50fa3fa6b57","source_id":"src_8ff4361f8474d50fa3fa6b57","source_kind":"report","title":"assets/WELL-0260/maintenance-reports/MNT-0260-033.md","path":"assets/WELL-0260/maintenance-reports/MNT-0260-033.md"},"ev_2cfbff4e6eb308951932d86c":{"id":"ev_2cfbff4e6eb308951932d86c","source_id":"src_9b9cd9e1c9735c1cd38196ac","source_kind":"maintenance","title":"MNT-0071-038","path":"assets/WELL-0071/maintenance.jsonl"},"src_3d8b813d1e6e4ba31c379647":{"id":"src_3d8b813d1e6e4ba31c379647","source_id":"src_3d8b813d1e6e4ba31c379647","source_kind":"report","title":"assets/WELL-0071/maintenance-reports/MNT-0071-038.md","path":"assets/WELL-0071/maintenance-reports/MNT-0071-038.md"},"ev_e3dd5211177476f8ab84d32f":{"id":"ev_e3dd5211177476f8ab84d32f","source_id":"src_a8f3e6b61076df21126738b9","source_kind":"maintenance","title":"MNT-0062-029","path":"assets/WELL-0062/maintenance.jsonl"},"src_ba27038a2026a742584b72cf":{"id":"src_ba27038a2026a742584b72cf","source_id":"src_ba27038a2026a742584b72cf","source_kind":"report","title":"assets/WELL-0062/maintenance-reports/MNT-0062-029.md","path":"assets/WELL-0062/maintenance-reports/MNT-0062-029.md"},"ev_4ddb3605095362c534c6cbf2":{"id":"ev_4ddb3605095362c534c6cbf2","source_id":"src_a7856119fc8cd3fe80647be2","source_kind":"maintenance","title":"MNT-0300-033","path":"assets/WELL-0300/maintenance.jsonl"},"src_e0932f96d53a2e10c0853143":{"id":"src_e0932f96d53a2e10c0853143","source_id":"src_e0932f96d53a2e10c0853143","source_kind":"report","title":"assets/WELL-0300/maintenance-reports/MNT-0300-033.md","path":"assets/WELL-0300/maintenance-reports/MNT-0300-033.md"},"ev_d072ede702878ee68b9840ea":{"id"

:"ev_d072ede702878ee68b9840ea","source_id":"src_c223c5cff2de6b407a41941a","source_kind":"maintenance","title":"MNT-0056-032","path":"assets/WELL-0056/maintenance.jsonl"},"src_a37c42c1a87caa007a154849":{"id":"src_a37c42c1a87caa007a154849","source_id":"src_a37c42c1a87caa007a154849","source_kind":"report","title":"assets/WELL-0056/maintenance-reports/MNT-0056-032.md","path":"assets/WELL-0056/maintenance-reports/MNT-0056-032.md"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported by Robert Hayes"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported by Nathan Pierce"}}
}
```
```

Question 11

Olivia Grant · Turn 1 · partial

Which region of the field consistently runs hotter?

```json
{
  "schema_version": "1.0",
  "answer_id": "c1fbc5c0-0d9c-4c2b-8f7f-a7e27508c564",
  "thread_id": "32b0f1e3-0696-4f3f-a071-beb09041d84e",
  "user_id": "U-501",
  "dataset_namespace": "asset-field-test-2027-01-15",
  "reference_date": "2027-01-15",
  "narrative": "Partial answer: verified data is shown below. The explanation could not be completed because the generated response did not complete or pass its evidence checks.",
  "blocks": [{"id":"c1fbc5c0-0d9c-4c2b-8f7f-a7e27508c564:verified:0","type":"table","title":"Verified data — explanation incomplete","result_set_id":"result_1d7f3eaf6c154dd7bac35b2bbe489aee","evidence_ids":["ev_062ce204bf8139998dceea5c","ev_f95667ecfcd3c3122a931684","src_215c78036f52b5303b330fe0","src_0b27ec48fd9b0f16a6cd84c6","src_330aa8bd8455ae32332cb94c","result_1d7f3eaf6c154dd7bac35b2bbe489aee","ev_04dc07d0d6b066004262dd43","ev_29d5a0cff366537c07ccecf4"],"encoding":{},"span":2}],
  "results": {"result_1d7f3eaf6c154dd7bac35b2bbe489aee":{"result_set_id":"result_1d7f3eaf6c154dd7bac35b2bbe489aee","dataset_revision":"687ade729fe09c4d15c18a94ae102fcbcf8f4868fda89eaeb140ce54a7756716","knowledge_revision":4,"columns":[{"key":"area_id","label":"Area Id"},{"key":"area_name","label":"Area Name"},{"key":"well_type","label":"Well Type"},{"key":"inspection_count","label":"Inspection Count"},{"key":"valid_temperature_count","label":"Valid Temperature Count"},{"key":"well_count","label":"Well Count"},{"key":"mean_wellhead_c","label":"Mean Wellhead C"},{"key":"mean_ambient_c","label":"Mean Ambient C"},{"key":"mean_delta_c","label":"Mean Delta C"},{"key":"producing_inspection_count","label":"Producing Inspection Count"},{"key":"mean_producing_delta_c","label":"Mean Producing Delta C"},{"key":"months_measured","label":"Months Measured"},{"key":"comparable_months_with_other_areas_same_type","label":"Comparable Months With Other Areas Same Type"},{"key":"months_highest_producing_delta_same_type","label":"Months Highest Producing Delta Same Type"},{"key":"unknown_count","label":"Unknown Count"},{"key":"assessment","label":"Assessment"}],"rows":[{"area_name":"Northeast Block 7","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.603267193793826,"valid_temperature_count":6703,"well_count":33,"producing_inspection_count":6332,"months_measured":52,"inspection_count":6703,"mean_delta_c":24.736729822467552,"mean_producing_delta_c":26.03681301326595,"mean_wellhead_c":46.33999701626138,"months_highest_producing_delta_same_type":11,"assessment":"measured","unknown_count":0,"well_type":"T200","area_id":"NE-07"},{"area_name":"Northeast Block 7","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.50441705187468,"valid_temperature_count":5841,"well_count":28,"producing_inspection_count":5564,"months_measured":52,"inspection_count":5841,"mean_delta_c":29.71915767847971,"mean_producing_delta_c":30.94769949676492,"mean_wellhead_c":51.22357473035439,"months_highest_producing_delta_same_type":4,"assessment":"measured","unknown_count":0,"well_type":"T350","area_id":"NE-07"},{"area_name":"Northeast Block 7","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.08590909090909,"valid_temperature_count":220,"well_count":1,"producing_inspection_count":215,"months_measured":52,"inspection_count":220,"mean_delta_c":35.87227272727273,"mean_producing_delta_c":36.47348837209302,"mean_wellhead_c":56.958181818181814,"months_highest_producing_delta_same_type":15,"assessment":"measured","unknown_count":0,"well_type":"T500","area_id":"NE-07"},{"area_name":"Northeast Block 8","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.494455470106672,"valid_temperature_count":8062,"well_count":38,"producing_inspection_count":7667,"months_measured":52,"inspection_count":8062,"mean_delta_c":24.74951624906971,"mean_producing_delta_c":25.886904917177514,"mean_wellhead_c":46.243971719176386,"months_highest_producing_delta_same_type":2,"assessment":"measured","unknown_count":0,"well_type":"T200","area_id":"NE-08"},{"area_name":"Northeast Block 8","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.475209140991634,"valid_temperature_count":4901,"well_count":23,"producing_inspection_count":4677,"months_measured":52,"inspection_count":4901,"mean_delta_c":29.868516629259336,"mean_producing_delta_c":31.071113961941418,"mean_wellhead_c":51.34372577025097,"months_highest_producing_delta_same_type":13,"assessment":"measured","unknown_count":0,"well_type":"T350","area_id":"NE-08"},{"area_name":"Northeast Block 8","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.563761467889908,"valid_temperature_count":218,"well_count":1,"producing_inspection_count":218,"months_measured":52,"inspection_count":218,"mean_delta_c":36.58715596330275,"mean_producing_delta_c":36.58715596330275,"mean_wellhead_c":58.15091743119266,"months_highest_producing_delta_same_type":20,"assessment":"measured","unknown_count":0,"well_type":"T500","area_id":"NE-08"},{"area_name":"Northwest Block 12","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.492660243543423,"valid_temperature_count":14946,"well_count":71,"producing_inspection_count":14228,"months_measured":52,"inspection_count":14946,"mean_delta_c":24.790713234310182,"mean_producing_delta_c":25.910486364914252,"mean_wellhead_c":46.28337347785361,"months_highest_producing_delta_same_type":3,"assessment":"measured","unknown_count":0,"well_type":"T200","area_id":"NW-12"},{"area_name":"Northwest Block 12","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.477093491626032,"valid_temperature_count":9434,"well_count":45,"producing_inspection_count":9008,"months_measured":52,"inspection_count":9434,"mean_delta_c":29.75999576001696,"mean_producing_delta_c":30.94593694493783,"mean_wellhead_c":51.237089251643,"months_highest_producing_delta_same_type":4,"assessment":"measured","unknown_count":0,"well_type":"T350","area_id":"NW-12"},{"area_name":"Northwest Block 12","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.50113156100886,"valid_temperature_count":7335,"well_count":34,"producing_inspection_count":6964,"months_measured":52,"inspection_count":7335,"mean_delta_c":34.74845262440354,"mean_producing_delta_c":36.21602527283171,"mean_wellhead_c":56.24958418541241,"months_highest_producing_delta_same_type":2,"assessment":"measured","unknown_count":0,"well_type":"T500","area_id":"NW-12"},{"area_name":"Southeast Block 31","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.581488337652722,"valid_temperature_count":2701,"well_count":14,"producing_inspection_count":2585,"months_measured":52,"inspection_count":2701,"mean_delta_c":24.846686412439837,"mean_producing_delta_c":25.837446808510638,"mean_wellhead_c":46.42817475009256,"months_highest_producing_delta_same_type":9,"assessment":"measured","unknown_count":0,"well_type":"T200","area_id":"SE-31"},{"area_name":"Southeast Block 31","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.452659225213395,"valid_temperature_count":1523,"well_count":7,"producing_inspection_count":1469,"months_measured":52,"inspection_count":1523,"mean_delta_c":29.97990807616546,"mean_producing_delta_c":30.903131381892443,"mean_wellhead_c":51.43256730137885,"months_highest_producing_delta_same_type":9,"assessment":"measured","unknown_count":0,"well_type":"T350","area_id":"SE-31"},{"area_name":"Southeast Block 31","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.447456325590323,"valid_temperature_count":5209,"well_count":29,"producing_inspection_count":5009,"months_measured":52,"inspection_count":5209,"mean_delta_c":35.14090996352467,"mean_producing_delta_c":36.25268516669994,"mean_wellhead_c":56.588366289114994,"months_highest_producing_delta_same_type":1,"assessment":"measured","unknown_count":0,"well_type":"T500","area_id":"SE-31"},{"area_name":"Southeast Block 32","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.568736332396124,"valid_temperature_count":12804,"well_count":62,"producing_inspection_count":12281,"months_measured":52,"inspection_count":12804,"mean_delta_c":24.98708216182443,"mean_producing_delta_c":25.946519013109683,"mean_wellhead_c":46.55581849422055,"months_highest_producing_delta_same_type":8,"assessment":"measured","unknown_count":0,"well_type":"T200","area_id":"SE-32"},{"area_name":"Southeast Block 3
```

```
2","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.593273758047467,"valid_temperature_count":104
07,"well_count":51,"producing_inspection_count":10015,"months_measured":52,"inspection_count":10407,"mean_delta_c":29.
965369462861535,"mean_producing_delta_c":30.93872191712431,"mean_wellhead_c":51.558643220909005,"months_highest_produc
ing_delta_same_type":2,"assessment":"measured","unknown_count":0,"well_type":"T350","area_id":"SE-32"},{"area_name":"S
outheast Block 32","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.481738256719417,"valid_temper
ature_count":7962,"well_count":37,"producing_inspection_count":7609,"months_measured":52,"inspection_count":7962,"mean
_delta_c":34.9716277317257,"mean_producing_delta_c":36.24882376133526,"mean_wellhead_c":56.453365988445114,"months_hig
hest_producing_delta_same_type":1,"assessment":"measured","unknown_count":0,"well_type":"T500","area_id":"SE-32"},{"ar
ea_name":"Southwest Block 23","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.49351756198347,"va
lid_temperature_count":7744,"well_count":36,"producing_inspection_count":7349,"months_measured":52,"inspection_count":
7744,"mean_delta_c":24.751200929752066,"mean_producing_delta_c":25.957449993196356,"mean_wellhead_c":46.24471849173554
,"months_highest_producing_delta_same_type":10,"assessment":"measured","unknown_count":0,"well_type":"T200","area_id":
"SW-23"},{"area_name":"Southwest Block 23","comparable_months_with_other_areas_same_type":52,"mean_ambient_c":21.48206
3624947678,"valid_temperature_count":4778,"well_count":24,"producing_inspection_count":4523,"months_measured":52,"insp
ection_count":4778,"mean_delta_c":29.596609460025117,"mean_producing_delta_c":30.956776475790406,"mean_wellhead_c":51.
07867308497279,"months_highest_producing_delta_same_type":10,"assessment":"measured","unknown_count":0,"well_type":"T3
50","area_id":"SW-23"},{"area_name":"Southwest Block 23","comparable_months_with_other_areas_same_type":52,"mean_ambie
nt_c":21.47715269804822,"valid_temperature_count":871,"well_count":4,"producing_inspection_count":823,"months_measured
":52,"inspection_count":871,"mean_delta_c":34.62273249138921,"mean_producing_delta_c":36.18262454434994,"mean_wellhead
_c":56.09988518943743,"months_highest_producing_delta_same_type":13,"assessment":"measured","unknown_count":0,"well_ty
pe":"T500","area_id":"SW-23"},{"area_name":"Southwest Block 24","comparable_months_with_other_areas_same_type":52,"mea
n_ambient_c":21.502926029962545,"valid_temperature_count":8544,"well_count":40,"producing_inspection_count":7993,"mont
hs_measured":52,"inspection_count":8544,"mean_delta_c":24.48684456928839,"mean_producing_delta_c":26.00536719629676,"m
ean_wellhead_c":45.98977059925094,"months_highest_producing_delta_same_type":9,"assessment":"measured","unknown_count"
:0,"well_type":"T200","area_id":"SW-24"},{"area_name":"Southwest Block 24","comparable_months_with_other_areas_same_ty
pe":52,"mean_ambient_c":21.413613613613613,"valid_temperature_count":4995,"well_count":23,"producing_inspection_count"
:4676,"months_measured":52,"inspection_count":4995,"mean_delta_c":29.31011011011011,"mean_producing_delta_c":30.977095
808383233,"mean_wellhead_c":50.72372372372372,"months_highest_producing_delta_same_type":10,"assessment":"measured","u
nknown_count":0,"well_type":"T350","area_id":"SW-24"}],"evidence_ids":["ev_062ce204bf8139998dceea5c","ev_f95667ecfcd3c
3122a931684","src_215c78036f52b5303b330fe0","src_0b27ec48fd9b0f16a6cd84c6","src_330aa8bd8455ae32332cb94c","result_1d7f
3eaf6c154dd7bac35b2bbe489aee","ev_04dc07d0d6b066004262dd43","ev_29d5a0cff366537c07ccecf4","ev_97e81ccb5c073406d88bca5e
","ev_6d4c2580788f8f728116ef52","ev_f23dcd3164f676b624562b1a","ev_f511bc1fac95db1a9d8b00bb","ev_d499901d5fc025b3869cc3
d2","ev_e4b3243121d2fc2bd80bf545","ev_5a800ac8a20feff37a61c268","ev_254479af0b1e6defbbb38127","ev_2e4657a04312b3a430b9
c2c4","ev_bd3345ef5a88a9f53ae33cbf","ev_d8e5101018149019b1f3396b","ev_863956543b31ec9a5ca44424","ev_9d2b5b785411671521
6cd2d0","ev_e62ae5db438d40082fdad0ff","ev_239b901294a9e89487fed284","ev_0a0760dbeb283dbb8d561004","ev_e46908b4cca71fb1
316653e9","ev_33557da3b83be9222637efd9","ev_a49927a92a4da394f3590993","ev_9bc4f299a0128361bc312b42","ev_91fd1faed7db62
66e26803e9","ev_d06ce0b4c5b94ee931fc9415","ev_2b6a1905f94bd2d8612576ab","ev_1f786b3e751b3fc77d74e47e","ev_7465f8fe2d45
33608b018c81","ev_bbfd0c5c087bf3ff151c56af","ev_94092cbeaad809410e043b96","ev_848c041b4fb8f2ff2be6c3d9","ev_5fc11dd2f6
da1ce9300da0aa","ev_211ff232033b86a600e0103e","ev_37bd562d0b2e24740abcfcc5","ev_ce5a0cb362da848b50bf0495","ev_8ed390ef
b4fe59afacfedc19","ev_c5887e24aa4c3416173b7981","ev_161751749e4ee884f3223997","ev_464d7cb35702e6fa3e59212f"],"provider
_coverage":{"unit":"temperature_profile","matching":20,"evaluated":20,"unknown":0,"import_issues":0,"status":"complete
","displayed_rows":20,"output_rows":20,"display_truncated":false,"aggregation_input_truncated":false},"trace_id":"trac
e_f946b9bd891f4993a80a4867a38ddf2a","warnings":["Missing records do not independently prove real-world inaction;
calendar reference date supplies no time of day.","Means are inspection-weighted observed temperatures, not flow
volumes or reservoir pressure. Compare same type and producing state; absolute wellhead heat also reflects ambient
weather. Monthly hottest counts allow ties and use only months with another area of that type; unmatched type/area
coverage is not field-wide consistency."],"bounds":{"start":null,"end":null,"closure":"both"},"operation":{"collection
":"assets","metric":"temperature_profile"},"summary":{"total_matching":20,"assessment_counts":{"measured":20},"area_co
unts":{"Northeast Block 7":3,"Northeast Block 8":3,"Northwest Block 12":3,"Southeast Block 31":3,"Southeast Block
32":3,"Southwest Block 23":3,"Southwest Block 24":2},"source_observation_count":125198,"profile_groups":20},"assessmen
t_counts":{"measured":20},"coverage":{"matching":20,"evaluated":20,"unknown":0}}},
  "warnings": ["Missing records do not independently prove real-world inaction; calendar reference date supplies no
time of day.","Means are inspection-weighted observed temperatures, not flow volumes or reservoir pressure. Compare
same type and producing state; absolute wellhead heat also reflects ambient weather. Monthly hottest counts allow ties
and use only months with another area of that type; unmatched type/area coverage is not field-wide consistency.","The
explanation is incomplete; the panels contain verified records."],
  "generation": {"status":"partial","model":"gemini-3.5-flash-lite","live":false,"verified_tool_data":true,"explanatio
n_error_code":"grounding_repair_budget","retry_after":null,"calls":[{"stage":"planner","usage":{"input_tokens":4359,"o
utput_tokens":199,"total_tokens":4558,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finis
h_reason":"STOP"},"call_id":697,"live":true},{"stage":"maker","usage":{"input_tokens":4500,"output_tokens":857,"total_
tokens":5357,"input_token_details":{"cache_read":0},"adapter":"langchain-google-genai","finish_reason":"STOP"},"call_i
d":701,"live":true}]},
  "evidence": {"ev_062ce204bf8139998dceea5c":{"id":"ev_062ce204bf8139998dceea5c","source_id":"src_37112cfdc630430dca55
f95a","source_kind":"inspections","title":"INS-0124-0001","path":"assets/WELL-0124/inspections.jsonl"},"ev_f95667ecfcd
3c3122a931684":{"id":"ev_f95667ecfcd3c3122a931684","source_id":"src_0ef438e5174941b0cb0722c9","source_kind":"inspectio
ns","title":"INS-0118-0001","path":"assets/WELL-0118/inspections.jsonl"},"src_215c78036f52b5303b330fe0":{"id":"src_215
c78036f52b5303b330fe0","source_id":"src_215c78036f52b5303b330fe0","source_kind":"manual","title":"fleet/well-types/T20
0.md","path":"fleet/well-types/T200.md"},"src_0b27ec48fd9b0f16a6cd84c6":{"id":"src_0b27ec48fd9b0f16a6cd84c6","source_i
d":"src_0b27ec48fd9b0f16a6cd84c6","source_kind":"manual","title":"fleet/well-types/T350.md","path":"fleet/well-types/T
350.md"},"src_330aa8bd8455ae32332cb94c":{"id":"src_330aa8bd8455ae32332cb94c","source_id":"src_330aa8bd8455ae32332cb94c
","source_kind":"manual","title":"fleet/well-types/T500.md","path":"fleet/well-types/T500.md"},"result_1d7f3eaf6c154dd
7bac35b2bbe489aee":{"id":"result_1d7f3eaf6c154dd7bac35b2bbe489aee","source_id":"result_1d7f3eaf6c154dd7bac35b2bbe489ae
e","source_kind":"aggregate_lineage","title":"result_1d7f3eaf6c154dd7bac35b2bbe489aee"},"ev_04dc07d0d6b066004262dd43":
{"id":"ev_04dc07d0d6b066004262dd43","source_id":"src_d117998b7c165b70817d4608","source_kind":"inspections","title":"IN
S-0144-0001","path":"assets/WELL-0144/inspections.jsonl"},"ev_29d5a0cff366537c07ccecf4":{"id":"ev_29d5a0cff366537c07cc
ecf4","source_id":"src_88f320e4a512c0abaf8ff57b","source_kind":"inspections","title":"INS-0125-0001","path":"assets/WE
LL-0125/inspections.jsonl"},"ev_97e81ccb5c073406d88bca5e":{"id":"ev_97e81ccb5c073406d88bca5e","source_id":"src_5415f01
9b67b2c9ca8b582b1","source_kind":"inspections","title":"INS-0285-0001","path":"assets/WELL-0285/inspections.jsonl"},"e
v_6d4c2580788f8f728116ef52":{"id":"ev_6d4c2580788f8f728116ef52","source_id":"src_5415f019b67b2c9ca8b582b1","source_kin
d":"inspections","title":"INS-0285-0002","path":"assets/WELL-0285/inspections.jsonl"},"ev_f23dcd3164f676b624562b1a":{"
id":"ev_f23dcd3164f676b624562b1a","source_id":"src_3b062a545de8efe88e97ec22","source_kind":"inspections","title":"INS-
0178-0001","path":"assets/WELL-0178/inspections.jsonl"},"ev_f511bc1fac95db1a9d8b00bb":{"id":"ev_f511bc1fac95db1a9d8b00
bb","source_id":"src_8b56aea344f5bf0cb2f3118a","source_kind":"inspections","title":"INS-0166-0001","path":"assets/WELL
-0166/inspections.jsonl"},"ev_d499901d5fc025b3869cc3d2":{"id":"ev_d499901d5fc025b3869cc3d2","source_id":"src_2042d5915
45351d636161194","source_kind":"inspections","title":"INS-0193-0001","path":"assets/WELL-0193/inspections.jsonl"},"ev_
```

```
e4b3243121d2fc2bd80bf545":{"id":"ev_e4b3243121d2fc2bd80bf545","source_id":"src_3964a8c9e1469da588053ece","source_kind"
:"inspections","title":"INS-0153-0001","path":"assets/WELL-0153/inspections.jsonl"},"ev_5a800ac8a20feff37a61c268":{"id
":"ev_5a800ac8a20feff37a61c268","source_id":"src_7b548555ab6bb8c0b985a29d","source_kind":"inspections","title":"INS-02
82-0001","path":"assets/WELL-0282/inspections.jsonl"},"ev_254479af0b1e6defbbb38127":{"id":"ev_254479af0b1e6defbbb38127
","source_id":"src_7b548555ab6bb8c0b985a29d","source_kind":"inspections","title":"INS-0282-0002","path":"assets/WELL-0
282/inspections.jsonl"},"ev_2e4657a04312b3a430b9c2c4":{"id":"ev_2e4657a04312b3a430b9c2c4","source_id":"src_10f1a667991
3fb6fd80626e0","source_kind":"inspections","title":"INS-0357-0001","path":"assets/WELL-0357/inspections.jsonl"},"ev_bd
3345ef5a88a9f53ae33cbf":{"id":"ev_bd3345ef5a88a9f53ae33cbf","source_id":"src_0e81932282e01726f2bc9456","source_kind":"
inspections","title":"INS-0307-0001","path":"assets/WELL-0307/inspections.jsonl"},"ev_d8e5101018149019b1f3396b":{"id":
"ev_d8e5101018149019b1f3396b","source_id":"src_04decbdee3b3d2e22694f004","source_kind":"inspections","title":"INS-0304
-0001","path":"assets/WELL-0304/inspections.jsonl"},"ev_863956543b31ec9a5ca44424":{"id":"ev_863956543b31ec9a5ca44424",
"source_id":"src_dec126b421567c19c9617c00","source_kind":"inspections","title":"INS-0346-0001","path":"assets/WELL-034
6/inspections.jsonl"},"ev_9d2b5b7854116715216cd2d0":{"id":"ev_9d2b5b7854116715216cd2d0","source_id":"src_ed1436a04c2ae
a6e3dc434e3","source_kind":"inspections","title":"INS-0446-0001","path":"assets/WELL-0446/inspections.jsonl"},"ev_e62a
e5db438d40082fdad0ff":{"id":"ev_e62ae5db438d40082fdad0ff","source_id":"src_3a2757a6341a9b51a2691357","source_kind":"in
spections","title":"INS-0370-0001","path":"assets/WELL-0370/inspections.jsonl"},"ev_239b901294a9e89487fed284":{"id":"e
v_239b901294a9e89487fed284","source_id":"src_67b5535bd2e55ebd07419e3c","source_kind":"inspections","title":"INS-0227-0
001","path":"assets/WELL-0227/inspections.jsonl"},"ev_0a0760dbeb283dbb8d561004":{"id":"ev_0a0760dbeb283dbb8d561004","s
ource_id":"src_0cd67765098b93cb509ad42f","source_kind":"inspections","title":"INS-0217-0001","path":"assets/WELL-0217/
inspections.jsonl"},"ev_e46908b4cca71fb1316653e9":{"id":"ev_e46908b4cca71fb1316653e9","source_id":"src_9fb2f8700578182
0906ad328","source_kind":"inspections","title":"INS-0240-0001","path":"assets/WELL-0240/inspections.jsonl"},"ev_33557d
a3b83be9222637efd9":{"id":"ev_33557da3b83be9222637efd9","source_id":"src_ec85b16f0db5212b421f490e","source_kind":"insp
ections","title":"INS-0221-0001","path":"assets/WELL-0221/inspections.jsonl"},"ev_a49927a92a4da394f3590993":{"id":"ev_
a49927a92a4da394f3590993","source_id":"src_f76682a5e2c9076080a09eec","source_kind":"inspections","title":"INS-0226-000
1","path":"assets/WELL-0226/inspections.jsonl"},"ev_9bc4f299a0128361bc312b42":{"id":"ev_9bc4f299a0128361bc312b42","sou
rce_id":"src_1d4804c234a236668c899c49","source_kind":"inspections","title":"INS-0235-0001","path":"assets/WELL-0235/in
spections.jsonl"},"ev_91fd1faed7db6266e26803e9":{"id":"ev_91fd1faed7db6266e26803e9","source_id":"src_067410af340707b62
42d9beb","source_kind":"inspections","title":"INS-0586-0001","path":"assets/WELL-0586/inspections.jsonl"},"ev_d06ce0b4
c5b94ee931fc9415":{"id":"ev_d06ce0b4c5b94ee931fc9415","source_id":"src_02171b87394acad881854f42","source_kind":"inspec
tions","title":"INS-0475-0001","path":"assets/WELL-0475/inspections.jsonl"},"ev_2b6a1905f94bd2d8612576ab":{"id":"ev_2b
6a1905f94bd2d8612576ab","source_id":"src_2fa288fe79fc1f6bf19becdf","source_kind":"inspections","title":"INS-0510-0001"
,"path":"assets/WELL-0510/inspections.jsonl"},"ev_1f786b3e751b3fc77d74e47e":{"id":"ev_1f786b3e751b3fc77d74e47e","sourc
e_id":"src_adec5595690b3c3c3d00e8d2","source_kind":"inspections","title":"INS-0555-0001","path":"assets/WELL-0555/insp
ections.jsonl"},"ev_7465f8fe2d4533608b018c81":{"id":"ev_7465f8fe2d4533608b018c81","source_id":"src_b009f16a59c4d1c76b5
61152","source_kind":"inspections","title":"INS-0590-0001","path":"assets/WELL-0590/inspections.jsonl"},"ev_bbfd0c5c08
7bf3ff151c56af":{"id":"ev_bbfd0c5c087bf3ff151c56af","source_id":"src_86d8c57e5ba1a0aa8657abff","source_kind":"inspecti
ons","title":"INS-0556-0001","path":"assets/WELL-0556/inspections.jsonl"},"ev_94092cbeaad809410e043b96":{"id":"ev_9409
2cbeaad809410e043b96","source_id":"src_a1861faf6179a04ea29f0a4d","source_kind":"inspections","title":"INS-0001-0001","
path":"assets/WELL-0001/inspections.jsonl"},"ev_848c041b4fb8f2ff2be6c3d9":{"id":"ev_848c041b4fb8f2ff2be6c3d9","source_
id":"src_799f76b3b95b083f4dd11b3a","source_kind":"inspections","title":"INS-0295-0001","path":"assets/WELL-0295/inspec
tions.jsonl"},"ev_5fc11dd2f6da1ce9300da0aa":{"id":"ev_5fc11dd2f6da1ce9300da0aa","source_id":"src_e93e50329eb49d1e7f3b6
efb","source_kind":"inspections","title":"INS-0005-0001","path":"assets/WELL-0005/inspections.jsonl"},"ev_211ff232033b
86a600e0103e":{"id":"ev_211ff232033b86a600e0103e","source_id":"src_46cda9c2c497725d7b7b541b","source_kind":"inspection
s","title":"INS-0038-0001","path":"assets/WELL-0038/inspections.jsonl"},"ev_37bd562d0b2e24740abcfcc5":{"id":"ev_37bd56
2d0b2e24740abcfcc5","source_id":"src_965ec61eed61fef3b002fee7","source_kind":"inspections","title":"INS-0287-0001","pa
th":"assets/WELL-0287/inspections.jsonl"},"ev_ce5a0cb362da848b50bf0495":{"id":"ev_ce5a0cb362da848b50bf0495","source_id
":"src_055558d29a6c3635c22a8c9b","source_kind":"inspections","title":"INS-0255-0001","path":"assets/WELL-0255/inspecti
ons.jsonl"},"ev_8ed390efb4fe59afacfedc19":{"id":"ev_8ed390efb4fe59afacfedc19","source_id":"src_24495f257acff36f3828b6e
1","source_kind":"inspections","title":"INS-0070-0001","path":"assets/WELL-0070/inspections.jsonl"},"ev_c5887e24aa4c34
16173b7981":{"id":"ev_c5887e24aa4c3416173b7981","source_id":"src_c83487c3f5b0fb9ce3d54fca","source_kind":"inspections"
,"title":"INS-0087-0001","path":"assets/WELL-0087/inspections.jsonl"},"ev_161751749e4ee884f3223997":{"id":"ev_16175174
9e4ee884f3223997","source_id":"src_7623237e34eaec98b4ba5869","source_kind":"inspections","title":"INS-0090-0001","path
":"assets/WELL-0090/inspections.jsonl"},"ev_464d7cb35702e6fa3e59212f":{"id":"ev_464d7cb35702e6fa3e59212f","source_id":
"src_fcb37a6c70db37329f87b83d","source_kind":"inspections","title":"INS-0081-0001","path":"assets/WELL-0081/inspection
s.jsonl"},"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765":{"id":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_id
":"memory:6f72ff2e-f14e-4db1-9d26-6e5b1f30b765","source_kind":"shared_knowledge","title":"Observation reported by
Nathan Pierce"},"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba":{"id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","sou
rce_id":"memory:c6e55d28-edbf-4149-8dc8-f381d41eadba","source_kind":"shared_knowledge","title":"Observation reported
by Robert Hayes"},"memory:2388cd76-a257-47f0-bf54-32aa83cec09f":{"id":"memory:2388cd76-a257-47f0-bf54-32aa83cec09f","s
ource_id":"memory:2388cd76-a257-47f0-bf54-32aa83cec09f","source_kind":"private_memory","title":"Work_Context reported
by Olivia Grant"},"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca":{"id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","s
ource_id":"memory:f8da1d07-fc0c-4989-93c7-24de35ec18ca","source_kind":"shared_knowledge","title":"Observation reported
by Nathan Pierce"}}
}
```