


Contents

KPI Charting on the Analysis Tab.	3
-----------------------------------	---


KPI Charting on the Analysis Tab

The KPI chart on teh Analysis tab is another view into your manufacturing quality by time and factory, machine, machine type, or single plot. Use the following steps to view this data.


- 1. Click the Analysis tab.
- 2. On the Update panel, select the criteria for your review from the Asset and Date pickers, specifically choosing Quality from the Defect picker.

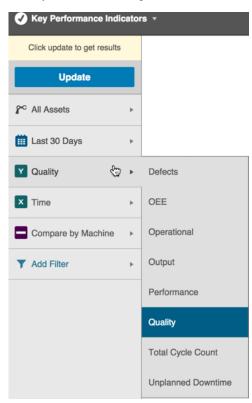

3. Select Time from the Time/Shift picker and the option of your choice from the Comparison picker (see image below).

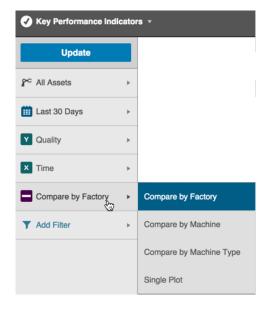

4. Click Update to view quality manufacturing production as measured by facility over time.

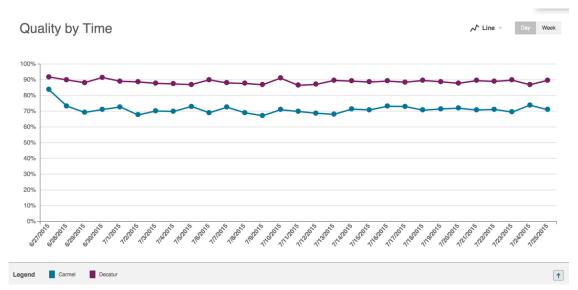

5. Click any point along the KPI chart graphs to display the Data tab with more details.