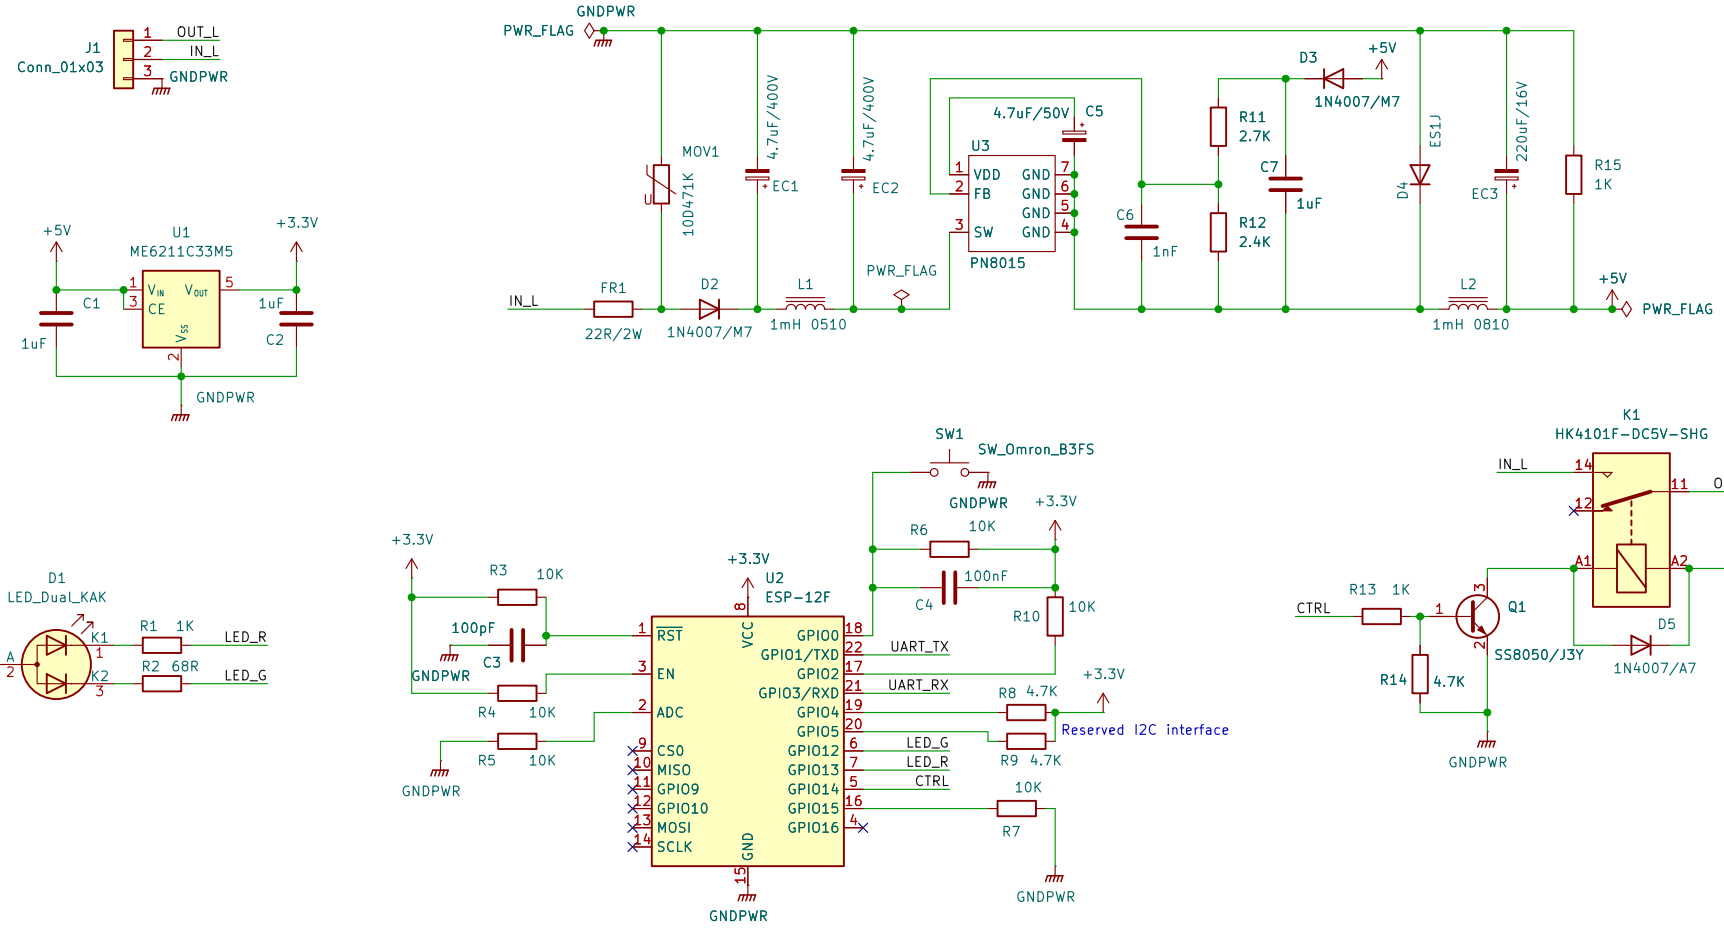

J1
Conn_01x03
OUT_L
IN_L
GNDPWR
U1
ME6211C33M5
+5V
+3.3V
C1
1uF
C2
1uF
GNDPWR
GNDPWR
PWR_FLAG
MOV1
10D471K
4.7uF/400V
EC1
4.7uF/400V
EC2
U3
PN8015
4.7uF/50V
C5
C6
1nF
R11
2.7K
R12
2.4K
C7
1uF
D3
1N4007/M7
+5V
D4
ES1J
EC3
220uF/16V
R15
1K
L2
1mH 0810
+5V
PWR_FLAG
IN_L
FR1
22R/2W
D2
1N4007/M7
L1
1mH 0510
PWR_FLAG
D1
LED_Dual_KAK
+3.3V
R1 1K
R2 68R
LED_R
LED_G
SW1
SW_Omron_B3FS
GNDPWR
+3.3V
R6 10K
C4 100nF
R10 10K
+3.3V
U2
ESP-12F
+3.3V
R3 10K
100pF
C3
R4 10K
R5 10K
GNDPWR
RST
EN
ADC
CS0
MISO
GPIO9
GPIO10
MOSI
SCLK
VCC
GND
GPIO0
GPIO1/TXD
GPIO2
GPIO3/RXD
GPIO4
GPIO5
GPIO12
GPIO13
GPIO14
GPIO15
GPIO16
UART_TX
UART_RX
LED_G
LED_R
CTRL
R8 4.7K
R9 4.7K
10K
R7
+3.3V
Reserved I2C interface
GNDPWR
K1
HK4101F-DC5V-SHG
IN_L
OUT_L
+5V
R13 1K
CTRL
Q1
SS8050/J3Y
R14 4.7K
D5
1N4007/A7
GNDPWR
+5V
UART_TX
UART_RX
J2
Conn_01x04
GNDPWR
When debugging the code, disconnect the AC 220V supply and use this connector to directly supply 5V for debugging.
Sheet: /
File: PCB1.kicad_sch
Title:
Size: A4
Date:
Rev:
KiCad E.D.A. 10.0.2
Id: 1/1