

ARCHIVE COPY - CA-D-317 COMPRESSED-AIR PACKAGE

Vendor issue B | 2008 preliminary package data | Retained for family-reference context

1. Preliminary package schedule


Field	Value	Comment
Item	Preliminary value	Archive note
Package tag	CA-D-317	Suffix A not assigned at issue B
Compressor tag	CA-C-317	Preliminary tag
Compressor model	VX-1400	Superseded by later package replacement
Dryer model	DH-1400	Heatless twin-tower
Rated flow	1400 scfm	At 100 psig
Operating pressure	100 psig	Nominal
Motor rating	225 kW, 1480 rpm	Preliminary motor schedule
Desiccant	Silica gel	Legacy charge
Purge configuration	Heatless, 15 percent	Fixed 12 mm orifice
Prefilter element	FPF-1400-GF	Legacy housing
Afterfilter element	AFE-1400-MC	Legacy housing
Receiver relief set pressure	115 psig	Original receiver schedule

Use limitation: preliminary values were issued before the 2019 compressor replacement and 2024 heated-purge dryer retrofit. Verify installed nameplates and current certificates before use.

2. Preliminary compressor performance points

Discharge pressure psig	Delivered flow scfm	Shaft power kW	Specific power kW/100 scfm
80	1485	218	14.68
90	1445	221	15.29
100	1400	225	16.07
110	1340	229	17.09
120	1265	233	18.42

Curve basis: VX-1400 package, 1480 rpm nominal, uncorrected vendor shop conditions. No current FT-317A multiplier, current purge flow, or current installed filter geometry is represented.

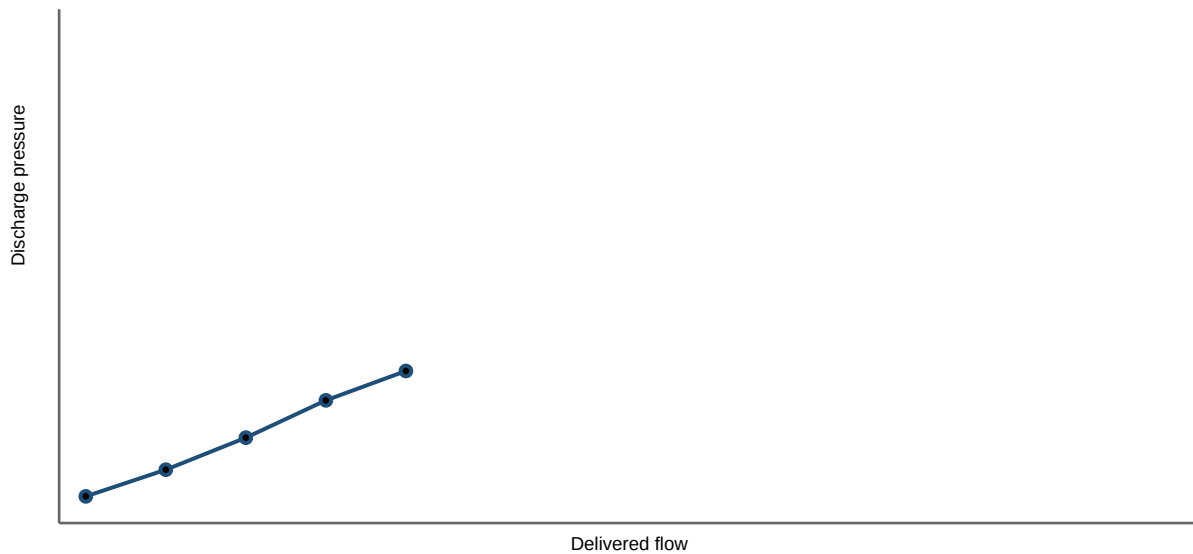

3. Archive configuration notes

Note ID	Archive statement	Current-package implication
LVD-01	Heatless purge valves sized for fixed 12 mm orifice	Does not represent OR-317-24 heated-purge configuration
LVD-02	Silica gel charge specified for DH-1400	Does not represent 70/30 alumina and molecular sieve charge
LVD-03	Relief valve serial not assigned	Cannot identify current installed relief valves
LVD-04	No calibrated delivered-flow factor	Cannot control corrected operating flow
LVD-05	No current filter bowl dimensions	Cannot control current element compatibility

Archive classification: related vendor-family context only. This issue is not an installed-condition certificate and does not supersede current field survey, calibration, work-order, safety, or certificate evidence.