



ID CONDITION REPORT

ATLANTIC GENEVA

IMO 9330848

Commissioned by:
Container Management Team

Organisation:
Sinokor Merchant Marine Co., Ltd

Inspected at:
Valetta, Malta

Date of inspection:
March 07 2026

ADDITIONAL ITEMS
Supplementary materials, accessible online.

 [View Documents](#)

 [View Images](#)

CONTENTS

TERMS OF USE	2
INSPECTION SUMMARY	3
VESSEL PARTICULARS	4
GRADE COMPARISON	5
GRADING DATA	7
DEFECTS LIST	9
DECARBONISATION SUMMARY	12
GRADING REPORT	13
14 Design and Construction	
15 Hull	
17 Mooring Decks	
19 Weather Decks and Fittings	
20 Ballast Tanks and Systems	
23 Accommodation	
26 Bridge and Navigation Equipment	
27 Engine Room and Machinery	
30 Fire Fighting Equipment and Systems	
31 Lifesaving Appliances	
32 Safe Working Environment	
33 Pollution Control	
35 Onboard Management	
36 Vessel Capabilities and Cargo Systems	
OPERATIONAL DATA	39
TECHNICAL REPORT	45
46 Design and Construction	
47 Hull	
48 Mooring Decks	
50 Weather Decks and Fittings	
52 Ballast Tanks and Systems	
54 Accommodation	
58 Bridge and Navigation Equipment	
61 Engine Room and Machinery	
68 Fire Fighting Equipment and Systems	
70 Lifesaving Appliances	
72 Safe Working Environment	
74 Pollution Control	
79 Onboard Management	
81 Vessel Capabilities and Cargo Systems	
86 Cargo Lifting Appliances	

REPORT TERMS OF USE

This report is intended for the sole use of **Container Management Team** and is designed to offer a condition evaluation of the subject vessel, as found on the day of the survey and in the opinion of the surveyor concerned. The report is subject to any access restrictions as described herein, and subject always to the level of cooperation afforded to the surveyor during the inspection itself. All details are given in good faith, and without guarantee.

This report has been prepared and issued by Idwal Marine Services Ltd to its Customer, **Container Management Team of Sinokor Merchant Marine Co., Ltd**, in accordance with, and subject to, the Terms of Service of Idwal Marine Services Ltd, a copy of which can be obtained at <https://www.idwalmarine.com/terms-and-conditions/terms-of-service>. Attention is particularly drawn to restrictions on reproduction and disclosure of, and limits on reliance on, this Report as more fully set out therein.

At Idwal, we are proud to run a carbon neutral business and provide the industry's first carbon neutral inspection service. Idwal has been carbon neutral since 2021 and has achieved PAS 2060 certification from Carbon Footprint Ltd.



Carbon
Neutral
Organisation
PAS 2060



INSPECTION SUMMARY



70

IDWAL
GRADE
Inspected. MAR-2026

Inspected at:
Valetta, Malta

Date of inspection:
07 Mar 2026

Status:
alongside discharging

Time aboard:
8.5 Hours

Documents provided:
Majority of documents provided

An ID Condition Inspection of the ATLANTIC GENEVA (ex. Max Champion) was conducted on the 7th March 2026 in Valetta, Malta by Idwal under instruction from Sinokor Merchant Marine Co Ltd. The ATLANTIC GENEVA is a 13,626 DWT, 9,940 Gross Tonnage, Singapore flagged, geared CV 1100 Plus Containership built by Qingshan Shipyard in China under Germanischer Lloyd supervision. The keel was laid on the 29th December 2004 with the vessel delivered to market on the 15th May 2007. The vessel is currently Classed with Bureau Veritas.

Good cooperation was provided by the ship's crew with the majority of documents provided for review. The vessel was alongside discharging at the time of inspection. The vessel was found to be in good overall condition although the Inspected Idwal Grade was below the industry average for vessels of a similar age, type and size, with several notable items found during the inspection. These are reported specifically in the notable items section of this report.

The vessel's last Special Survey was carried out on the 27th September 2022, with the next Special Survey due by the 14th May 2027. The vessel's Port State Control (PSC) history was found to be poor with fourteen deficiencies and one detention in the six inspections conducted in the past three years. The detention was at Trapani on the 25th May 2023 with deficiencies related to Fire drills, UMS Alarms, speed and distance indicator and Garbage management plan. Previous PSC issues have related to the main engine, fire dampers, ventilators/air pipes and casings, with the latter having been raised on more than one occasion including the latest PSC inspection at Marsaxlokk on the 7th August 2025 which also included insulation wetted through (oil) and with comments raised regarding cleanliness of the engine room, both of which still require improvement based on the inspection.

According to the provided IMO DCS Statement of Compliance (SoC) for 2024, which was the latest provided, the vessel's Carbon Intensity Indicator (CII) score was 23.467 g-CO₂/dwt-nm which places the vessel in Band E for that Calendar year. The Required annual operational CII is 17.552. The Forthcoming Regulatory Compliance rating has been graded as poor based on the Band E rating.

From 2024 onwards, any vessel that has an E rating in any year or D ratings for 3 consecutive years, is required to develop a corrective action plan in the SEEMP Part III which is required to be confirmed by the Flag Administration or Recognised Organisation (RO).


VESSEL PARTICULARS

Vessel name	Atlantic Geneva
Previous name	Max Champion
IMO number	9 3 3 0 8 4 8
Port of registry	Singapore
Ship type	Containership
Flag	Singapore
Classification society	Bureau Veritas
Registered owner	Silver Maritime Seven Pte Ltd
Technical manager	Columbia Shipmanagement-Sng
Shipbuilder	Qingshan Shipyard
Delivery date	15-May-07
Dead weight	13,626.00 Mt
Gross tonnage	9,940.00 Mt
Net tonnage	5,020.00 Mt
Length overall	147.84 M
Breadth	23.25 M
Depth	11.50 M
Summer draught	8.51 M
TEU	1,118.00
Lightweight	5,361.00 Mt

GRADE COMPARISON

[Launch Benchmarking](#)

This section of the report allows you to compare your ship's grade with similar ships. The chart below shows the distribution of Idwal Grades against your vessels sector.

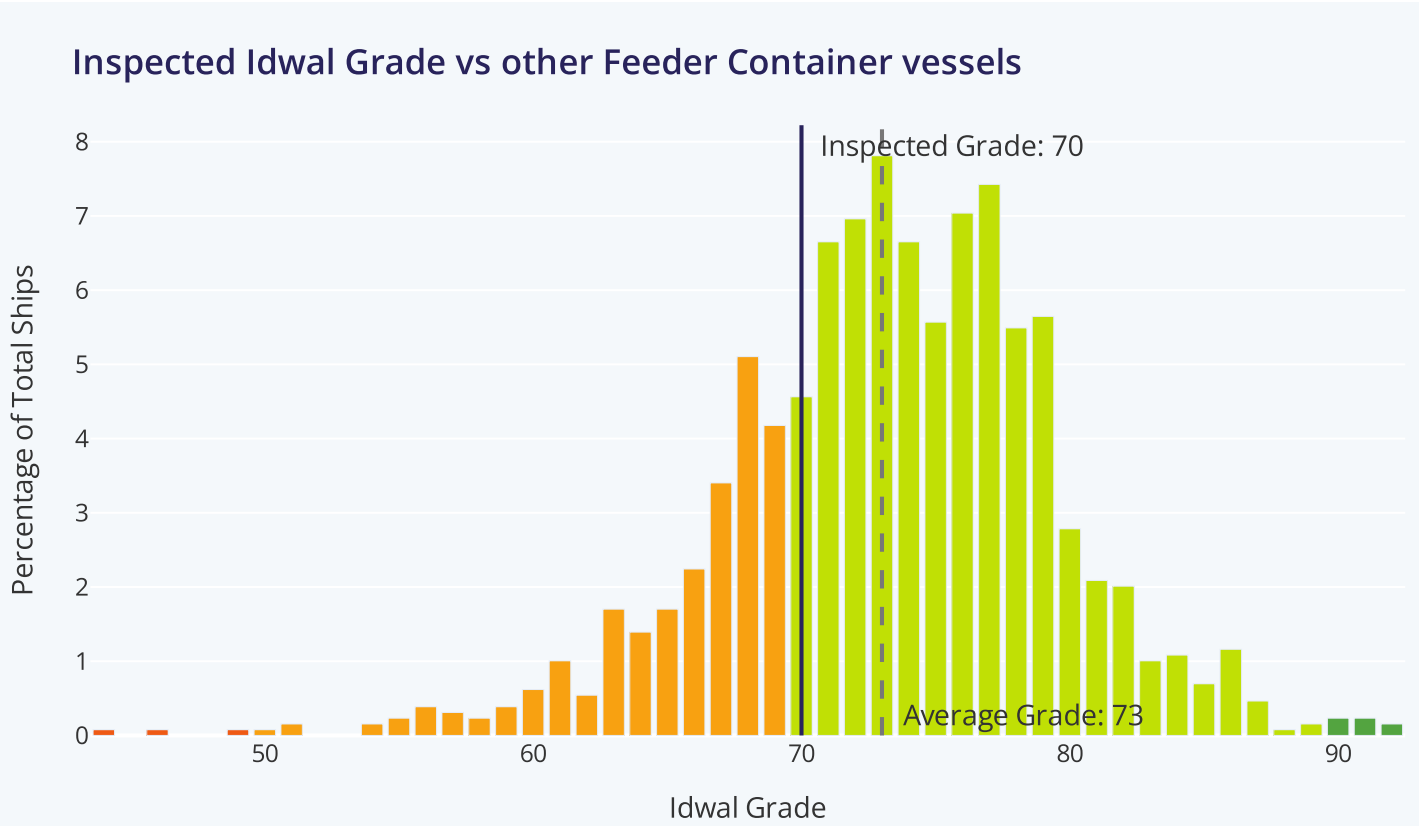

Key

Inspected Idwal Grade

Average Idwal Grade

Grade range

≥ 90

70 - 89

50 - 69

30 - 49


The ship's grade may appear different when compared with the average of the two graphs. This is as a result of the second graph comparing a smaller and more focused sample of ships.

For a more in-depth analysis of where your vessel compares amongst its peers, please contact your Idwal sales rep.

GRADE COMPARISON /

This section of the report allows you to compare your ship's grade with similar ships. The chart below shows the distribution of Idwal Grades against your vessels sector.

Inspected Idwal Grade vs other Feeder Container vessels, age 15-20 years

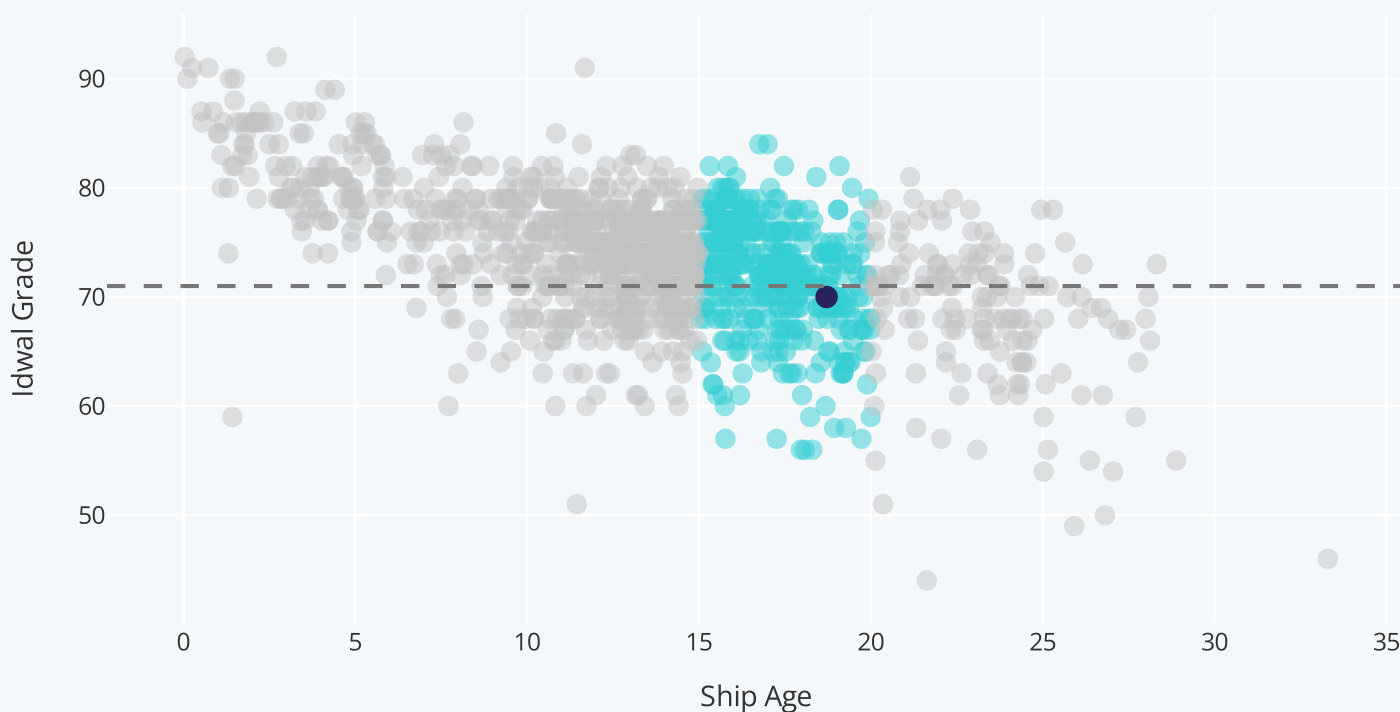

Key

Inspected Idwal Grade	Average Idwal Grade
All sector ships	Age comparable ships

The ship's grade may appear different when compared with the average of the two graphs. This is as a result of the second graph comparing a smaller and more focused sample of ships.

For a more in-depth analysis of where your vessel compares amongst its peers, please contact your Idwal sales rep.

GRADING DATA

[Launch Grading](#)

The Idwal Grade® is an industry recognised measure of asset integrity. Using proprietary algorithms, the Idwal Grade is programmatically calculated from over 500 individual data points, captured during a rigorous and standardised inspection process. Our data-driven methodology ensures that our reports are consistent, accurate and free from bias.

Sub-Grades

The methodology used to calculate the Idwal Grade® is also applied to the grading of the different vessel areas and categories. Two key areas are the overall vessel condition and vessel management:

Condition



71

Management



69

The following are grades representing individual areas of interest of the vessel:

⌘ Design and Construction



80

⌘ Hull



60

⌘ Mooring Decks



70

⌘ Weather Decks and Fittings



70

⌘ Ballast Tanks and Systems



60

⌘ Accommodation



70

⌘ Bridge and Navigation Equipment



80

⌘ Engine Room and Machinery



70

⌘ Fire Fighting Equipment and Systems



80

⌘ Lifesaving Appliances



80

⌘ Safe Working Environment



60

⌘ Pollution Control



80

⌘ Onboard Management



70

⌘ Vessel Capabilities and Cargo Systems



70

Forthcoming Regulatory Compliance



40

Crew Welfare



80

Crew Performance



70

Safety Management



80

Planned Maintenance System (PMS)



80

Classification and Certification



90

PSC Performance



40

DEFECTS LIST

[Launch Defects](#)

Priority	Grading area	Description	Recommendations
	Ballast Tanks and Systems	Defect ID: 1-598-074-886 The Fore Peak Tank first stringer was noted to have a crack, with wastage and diminution noted on the plate edges.	The area of damage should be reported to Class if not done so already and promptly and thoroughly repaired to Class satisfaction if required at the earliest opportunity.
	Fire Fighting Equipment and Systems	Defect ID: 1-598-218-260 The engine room emergency escape fire door was found to be tied back and held open.	Ensure fire doors are free from unauthorised 'hold-open' arrangements, as this can rapid increase the risk of a fire spreading, and would have been raised as a deficiency by PSC.
	Engine Room and Machinery	Defect ID: 1-598-242-829 The general cleanliness of the engine room had previously been noted by PSC, and while cleaning was evident, further bilge cleaning is recommended, with some laggings found damaged and partially stained.	Remedial housekeeping and cleaning should be carried out as soon as practical. The damaged, stained and partially detached laggings should also be replaced to avoid a repeat of the previous PSC deficiency.
	Safe Working Environment	Defect ID: 1-598-283-798 The lifeboat davit hooks had no safety latches.	Safety latches should be fitted to reduce the risk of accidents or injury during lifeboat retrieval.
	Vessel Capabilities and Cargo Systems	Defect ID: 2-034-290-702 The hatch cover rubber seals/gaskets were noted to be damaged in at least one location requiring repair and replacement.	The damaged seal and frame should be replaced at the first opportunity, to ensure weatherproof integrity.
	Pollution Control	Defect ID: 1-598-066-712 The vessel was not found to be Vessel General Permit (VGP) compliant, as the vessels Stern Tube and/or Bow Thruster or Controllable Pitch Propeller (CPP) had no valid oil-to-water interface controls such as Environmentally Acceptable Lubricants (EALs) or an Airseal fitted.	Various upgrades and modifications may be required if the vessel wishes to trade in the USA.
	Hull	Defect ID: 1-598-132-225 Minor indentations and rib caging were noted on the aft shell plate, with isolated areas of corrosion and detachment on the boot top and top sides. More developed areas of moderate scattered corrosion and detachment were noted on the antifouling.	It is recommended to internally inspect the areas of indentation to ensure that there is no coating cracking or deterioration. The hull corrosion should be touched up in the worst affected areas to reduce diminution.
	Engine Room and Machinery	Defect ID: 1-598-148-622 The IFO 80 low sulphur fuel oil bunkered on the 8th January 2026 at Malta was just outside the ISO 8217: 2017 specification as the total sediment was 0.11%, although this was within the acceptability criteria for ISO 4259 for a single result.	Although the acceptability criteria for IFO 80 - RMD 80 LS ranges from 0.1 to 0.15 % there was a note that Marlab had observed an increasing number of contamination cases involving organic chlorides from Malta ports, and to avoid potential machinery damage, it was strongly recommended to test the chlorine content using the EN 14077 method, as specified in ISO 8217.

	Ballast Tanks and Systems	Defect ID: 1-598-222-345 The Ballast Tank remote gauging system was reported to provide erratic readings which were described as inaccurate and unreliable based on the vessel own inspection reports.	It is recommended to investigate and resolve the remote gauging system in order to rectify the inaccuracies.
	Ballast Tanks and Systems	Defect ID: 1-598-255-111 Ballast tank corrosion was most prevalent on the first stringer floor plating, with corrosion breakthrough noted on the underside plate areas, frame face plates, welding seams and stiffeners. Moderate corrosion was noted in the Fore peak particularly on the upper shell plate welding seams were noted with moderate corrosion and although this had been coated recently, staining was evident.	The areas of corrosion should be de-scaled, primed and re-coated to avoid further deterioration.
	Mooring Decks	Defect ID: 1-598-283-781 Age related pitting was evident on the mooring winches and windlasses with developing corrosion noted on the brake band assemblies and foundations. The Windlass gypsy wheels were noted with moderate diminution and corrosion.	It is recommended to carry out cosmetic maintenance to address the corrosion although the diminution on the gypsy wheels may need to be built up during the next repair period.
	Engine Room and Machinery	Defect ID: 2-034-368-521 The emergency switchboard breakers were partially damaged.	It is advisable to check options for replacement of the damaged emergency switchboard circuit breakers.
	Hull	Defect ID: 2-034-376-708 Draft and load line markings were partially illegible, obscured by corrosion and staining.	The draft and load lines should be touched up at the earliest opportunity to ensure legibility.
	Engine Room and Machinery	Defect ID: 2-034-409-482 The engine room emergency escape floor was noted to be deformed.	The affected floor plate should be cropped and renewed when possible.
	Vessel Capabilities and Cargo Systems	Defect ID: 2-034-438-156 The bilge high level alarm in the No2 cargo hold on the starboard side was reported to be inoperative.	The defective high level alarm should be repaired or replaced at the first opportunity.
	Engine Room and Machinery	Defect ID: 3-217-285-120 A review of the supplied auxiliary engines running hours showed no areas of concern, although the 12,000 hour overhaul of auxiliary engine No1 was due imminently, with the running hours noted as 11,877 hours. Auxiliary engine No2 was also due overhaul this year and was at 10,178 hours.	The auxiliary engine No1 should be overhauled at the next opportunity, and the No2 engine overhaul scheduled when convenient.
	Accommodation	Defect ID: 3-628-232-704 Steps and platforms were noted to be partially holed with diminution and wastage on the plate edges.	The affected steps should be replaced and the platform edges cropped and renewed when possible.

	Accommodation	Defect ID: 1-598-066-698 Linoleum flooring in the accommodation was noted with damage, with chairs noted to have age-related deterioration, some of which had cracked covers, with floor tiles including in the galley were noted to be cracked.	It is recommended to replace the damaged linoleum and cracked galley floor tiles, and to re-cover or replace the damaged chairs.
	Mooring Decks	Defect ID: 1-598-160-899 Blistering and corrosion was noted on the mooring deck plate and welding seams, including near the bulwarks and mooring machinery.	It is advisable to de-scale, prime and re-coat the forward and aft decks at the next opportunity.
	Vessel Capabilities and Cargo Systems	Defect ID: 2-034-290-706 Cross deck stanchions and handrails were partially damaged.	The defective stanchions and handrails should be repaired or replaced at the next opportunity.
	Weather Decks and Fittings	Defect ID: 2-034-348-034 The main deck was noted with moderate with corrosion breakthrough on the main deck and cross deck walkways with historic pitting evident.	Areas of Coating Breakdown and Corrosion should be addressed when possible.
	Vessel Capabilities and Cargo Systems	Defect ID: 2-034-397-204 Cargo hold lights were noted to be inoperative during the inspection.	The lamps should be replaced although alternative lighting may need to be considered to improve reliability.
	Onboard Management	Defect ID: 2-034-425-867 The steering gear was missing emergency operation instructions.	The emergency operating instructions should be posted at the next opportunity.
	Pollution Control	Defect ID: 2-034-429-958 The sewage treatment plant covers were loose and were missing bolts.	The bolts should be replaced and the covers tightened at the next opportunity.

DECARBONISATION SUMMARY

As per the International Energy Efficiency Certificate (IEEC) provided, the vessel's attained EEXI score is 21.966 g-CO₂/tonne-mile within the required EEXI of 21.980 g-CO₂/tonne-mile. As per the information provided, the Main Engine Power has been limited to 6,780 kW from the original 9,730 kW in order to ensure the attained EEXI is within the Required EEXI. Therefore, the vessel fully complies with the MEPC 76 amendments to MARPOL Annex VI regulations 23 and 25. According to the provided IMO DCS Statement of Compliance (SoC) for 2024, which was the latest provided, the vessel's Carbon Intensity Indicator (CII) score was 23.467 g-CO₂/dwt-nm which places the vessel in Band E for that Calendar year. From 2024 onwards, any vessel that has an E rating in any year or D ratings for 3 consecutive years, is required to develop a corrective action plan in the SEEMP Part III which is required to be confirmed by the Flag Administration or Recognised Organisation (RO).

Energy Efficiency Existing Ship Index (EEXI)

Required EEXI

21.98
gCO₂/t.nm

Calculated Attained EEDI/EEXI

21.97
gCO₂/t.nm

This vessel meets the required EEDI/EEXI

Carbon Intensity Indicator (CII)

Required CII

17.55
gCO₂/t.nm

Last Recorded CII (2024)

23.467
gCO₂/t.nm

Last Attained CII Band (2024)

E

GRADING REPORT

- ⌘ Design and Construction
- ⌘ Hull
- ⌘ Mooring Decks
- ⌘ Weather Decks and Fittings
- ⌘ Ballast Tanks and Systems
- ⌘ Accommodation
- ⌘ Bridge and Navigation Equipment
- ⌘ Engine Room and Machinery
- ⌘ Fire Fighting Equipment and Systems
- ⌘ Lifesaving Appliances
- ⌘ Safe Working Environment
- ⌘ Pollution Control
- ⌘ Onboard Management
- ⌘ Vessel Capabilities and Cargo Systems

GRADING REPORT/

DESIGN AND CONSTRUCTION

80

[Review Technical Report](#)

The construction and design was found to be good overall, with the vessel built to IACS standards and Rules in China by Qingshan Shipyard with the keel laid on 29th December 2004. The vessel has five holds fitted with MacGregor weathertight, non sequential, pontoon hatch covers, with a total container capacity of 1,091 TEU (with 336 TEU in the holds and 755 TEU on deck), and is fitted with 145 reefer sockets (97 on deck and 48 in the holds). On the hatch covers there are container sockets and lashing eyes, and in the holds there are guide fittings and cones, lashing rods, turnbuckles and twist stackers provided. Two Liebherr CBW 45(40) / 26.5 (29.5) ST cargo electro-hydraulic cargo cranes are fitted. A Dangerous goods document of compliance certificate was issued by BV and is valid until the 14th May 2027, which is in line with the renewal surveys. The vessel is driven via a Renk RSV 1000 reduction gearbox, by a variable pitch, 5.4m, four bladed propeller. No spare propeller is carried, although a spare anchor, old towing wire and new spare cargo crane wire were noted to stored in the forward part of cargo hold no1. A Becker rudder/flap with Rolls Royce rotary vane RV 850-3 steering gear is fitted. The Main Engine is a Tier I MAN Diesel and Turbo 7L58/64 CD rated power 9,730 kW at 428 RPM, which has been limited to 6,780 kW for EEXI compliance. An AVK DSG 2,000 kW (2,500 kVA) at 1800 RPM AC 400V shaft generator is also provided. There are three Tier I Zhengjiang CME Co Ltd (MAN) 6L16/24 auxiliary engines rated 610 kW at 1200 RPM with Siemens 570 kW (757.5 kVA) 440V alternators. There is an MAN Nutzfahrzeuge AD type D2842LE201 Emergency/Harbour generator, rated 620 kW at 1800 RPM. A Jasram BU 90F 700 kW 1770 / 404 RPM bowthruster is fitted. A conventional Simplex compact SC2B shaft seal system is fitted and as no Environmentally Acceptable Lubricant (EAL) is in use, the vessel is not VGP compliant in this regard. The vessel is not on the Enhanced Survey Program or Extended Dry Docking schedule but does hold a Class notation for In Water Surveys. A Pannasia GloEn-P350 (350m3/hour capacity) D2, ultraviolet based Ballast Water Treatment system (BWTS) was installed on the 29th September 2022 as stated on the Class status report although IBWMC states that this was installed on the 14th September 2022. No USCG certificate of approval was provided. There are no energy saving features listed in the EEXI Technical file. An incinerator capable of burning sludge and a Hamworthy KSE Suzhou Ltd, type ST 1A super trident sewage treatment plant is fitted, compliant with MEPC 2 (VI). CSSC Nanjing Luzhou Machine Co Ltd, STD-02 Sewage treatment plant is fitted, and although there is no comminuter, a 9.6 m3 sewage holding tank is provided. Apart from the equipment required by international rules and regulations, the bridge is fitted with dual ECDIS, with conventional S-Band and X-Band radars. The engine room is provided with a centralised cooling system, dual air handling unit refrigeration compressors and is compliant with the requirements of Chapter II-1, Part E of SOLAS for "Periodically unattended machinery spaces (UMS)".

Defects

No defects



GRADING REPORT/


HULL

The hull was seen to be in fair overall condition, as inspected from the starboard side, and although the vessel was free of major structural defects there were , minor indentations and rib caging noted on the aft shell plate and boot top. Moderate scattered scaling, surface and spot corrosion covered approximately 15% of the surface area, with isolated areas of corrosion and detachment were present on the boot top and top sides, with more developed areas of moderate scattered corrosion and detachment on the antifouling. Hull markings were considered to be illegible with staining and detachment obscuring these. No marine fouling was observed. Fenders fitted to the hull were found in good overall condition. Annual surveys were last carried out on the 17th July 2025 at Malta, which included an underwater bottom survey, with the next docking and renewal surveys due by the 14th May 2027.

Defects

Priority	Description	Recommendations
	Defect ID: 1-598-132-225 Minor indentations and rib caging were noted on the aft shell plate, with isolated areas of corrosion and detachment on the boot top and top sides. More developed areas of moderate scattered corrosion and detachment were noted on the antifouling.	It is recommended to internally inspect the areas of indentation to ensure that there is no coating cracking or deterioration. The hull corrosion should be touched up in the worst affected areas to reduce diminution.

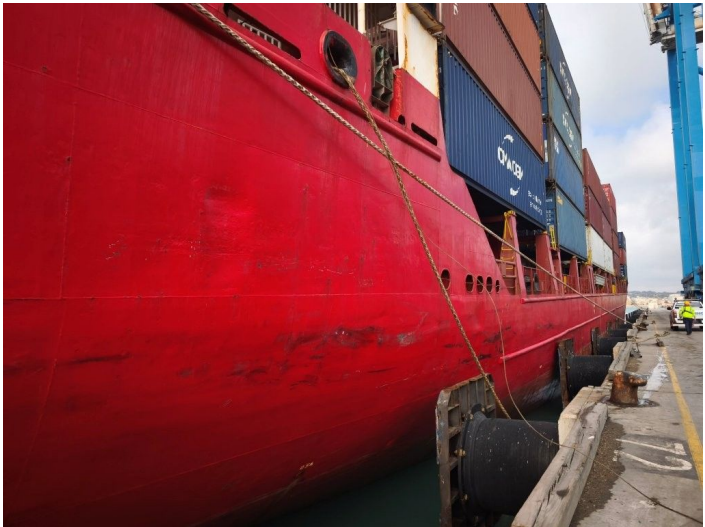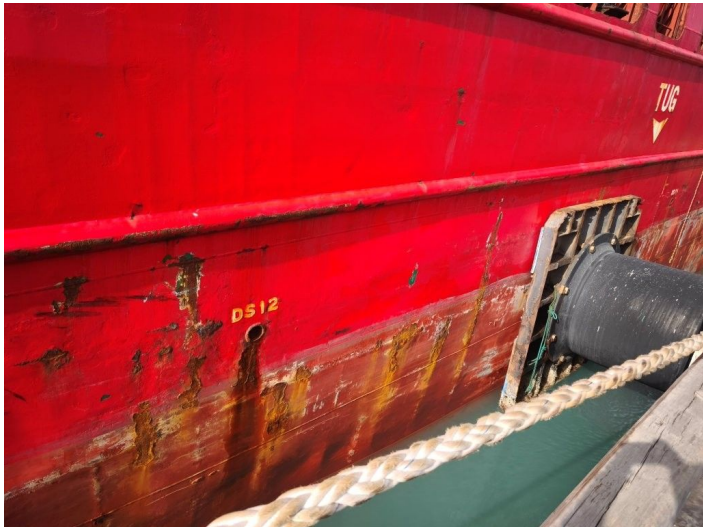

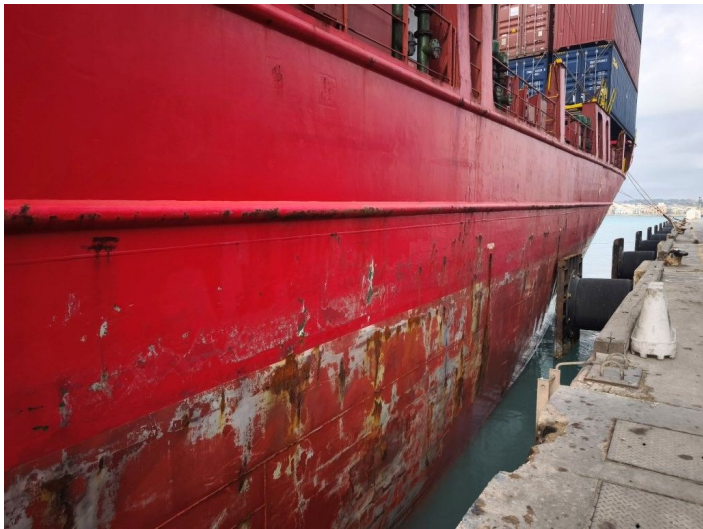

Defect ID: 2-034-376-708
Draft and load line markings were partially illegible, obscured by corrosion and staining.

The draft and load lines should be touched up at the earliest opportunity to ensure legibility.




GRADING REPORT/



MOORING DECKS

[Review Technical Report](#)

The Mooring decks were in fair to good condition overall, free of structural defects but showing moderate scattered scaling, pitting and surface corrosion on approximately 10% of the mooring deck plating total surface area. Age-related blistering and corrosion were present on the deck plate and welding seams, including near the bulwarks and mooring machinery. Deck fittings were noted with minor corrosion and staining on the mooring rollers and bollards, although the fairleads and rollers were free to turn when tested. All electric windlasses and winches were reported fully operational. Mooring machinery was noted with age-related pitting evident and with developing corrosion on the brake band assemblies and foundations. The Windlass gypsy wheels showed moderate diminution and corrosion, although the brake band linings were noted with substantial thickness. Mooring ropes were in good condition; however, anchor chains were noted with minor to moderate diminution, with surface corrosion evident. Mooring practices were good with snap-back zone warnings posted at entrances to mooring areas as per industry best practice. The Bosun's store was in good structural condition with no visible damage sighted or reported. Coatings were fully intact with no significant corrosion or coating breakdown. Housekeeping was fairly neat, with some scattered equipment present. The bitter end release arrangements were clear and unobstructed, and the emergency towing booklet was available near the Foc'sle.

Defects

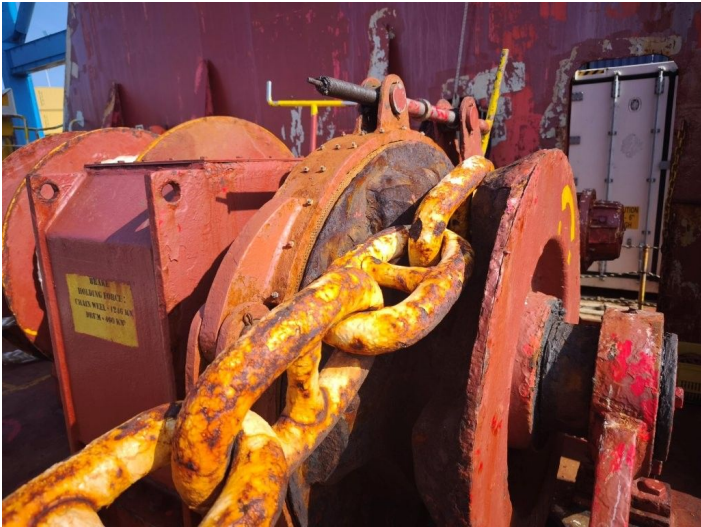Priority	Description	Recommendations
	Defect ID: 1-598-283-781 Age related pitting was evident on the mooring winches and windlasses with developing corrosion noted on the brake band assemblies and foundations. The Windlass gypsy wheels were noted with moderate diminution and corrosion.	It is recommended to carry out cosmetic maintenance to address the corrosion although the diminution on the gypsy wheels may need to be built up during the next repair period.
		
	Defect ID: 1-598-160-899 Blistering and corrosion was noted on the mooring deck plate and welding seams, including near the bulwarks and mooring machinery.	It is advisable to de-scale, prime and re-coat the forward and aft decks at the next opportunity.

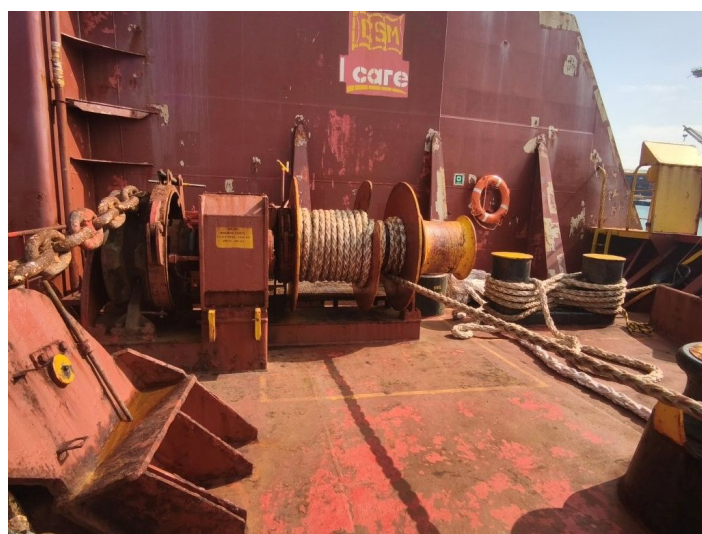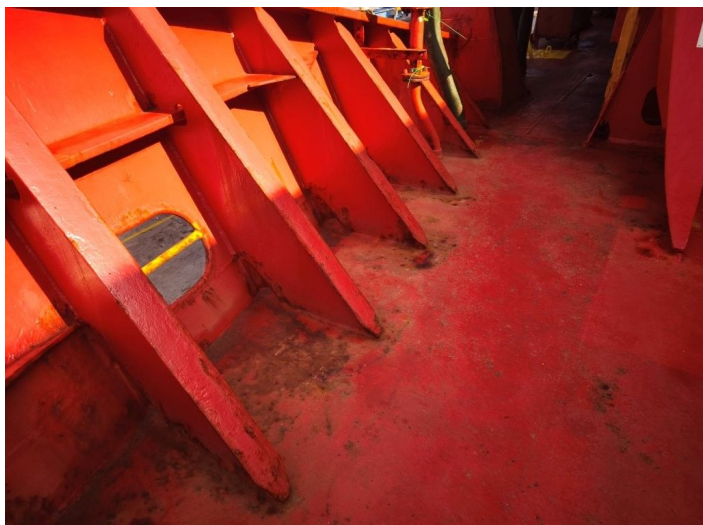

GRADING REPORT/

WEATHER DECKS AND FITTINGS



70

Review Technical Report

The Weather Decks and Fittings were in fair to good condition overall. The decks were free of structural defects but were noted with moderate scattered pitting, surface and spot corrosion affecting approximately 10% of the main deck plating total surface area. Corrosion breakthrough was evident on the main deck and cross deck walkways with historic pitting visible. Deck fittings were in fair condition, showing age-related diminution. Several handrails were partially deformed and the vent heads would benefit from further cosmetic maintenance. However, pipework and fittings were generally free of leakages. The accommodation ladders, gangways and provision crane were in good overall condition with no notable defects found.

Defects

Priority	Description	Recommendations
	Defect ID: 2-034-348-034 The main deck was noted with moderate with corrosion breakthrough on the main deck and cross deck walkways with historic pitting evident.	Areas of Coating Breakdown and Corrosion should be addressed when possible.

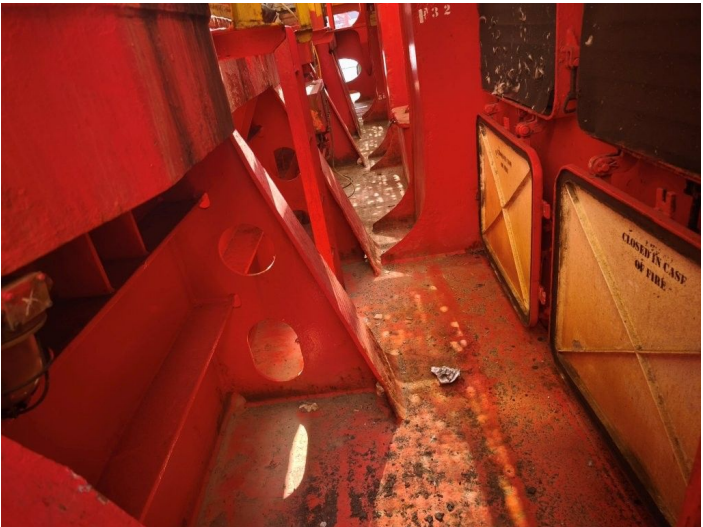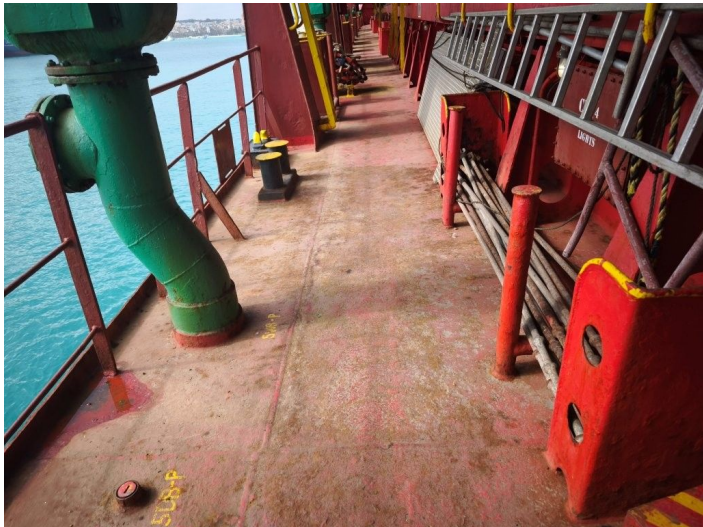

GRADING REPORT/

BALLAST TANKS AND SYSTEMS


60

Review Technical Report

Ballast tanks and systems were deemed to be in fair overall condition. The Deep Tank and Fore Peak were entered for inspection and an adequate quantity of photographs of previous tank entries reportedly taken on 27th February 2026 were provided by the vessel for review. The inspected ballast tanks were found to have structural defects with Fore Peak Tank first stringer was noted with a structural defect with a crack, and with wastage and diminution on the plate edges. The ballast tanks were noted with areas of moderate localised, surface and spot corrosion, up to approximately 10% of the ballast tanks total surface area. Corrosion was most prevalent on the stringer floor plating, with corrosion breakthrough noted on the underside plate areas, frame face plates, welding seams and stiffeners. Moderate corrosion was noted in the Fore Peak particularly on the upper shell plate welding seams and although this had been coated recently, staining was evident. As far as could be inspected, ballast tank fittings such as ladders and pipework were noted with age-related diminution with minor to moderate areas of corrosion on the vertical ladders and pipe penetrations. In the provided photographs, tanks are shown with a minimal amount of mud/sediment accumulation and were free of any signs of staining from sewage or marine fouling. The Tank remote gauging system was reported with erratic readings which were described as inaccurate and unreliable, based on the vessel's own inspection reports. However all ballast pumps were in good working order and in good visual condition.


Defects

Priority	Description	Recommendations
	Defect ID: 1-598-074-886 The Fore Peak Tank first stringer was noted to have a crack, with wastage and diminution noted on the plate edges.	The area of damage should be reported to Class if not done so already and promptly and thoroughly repaired to Class satisfaction if required at the earliest opportunity.
		
	Defect ID: 1-598-222-345 The Ballast Tank remote gauging system was reported to provide erratic readings which were described as inaccurate and unreliable based on the vessel own inspection reports.	It is recommended to investigate and resolve the remote gauging system in order to rectify the inaccuracies.

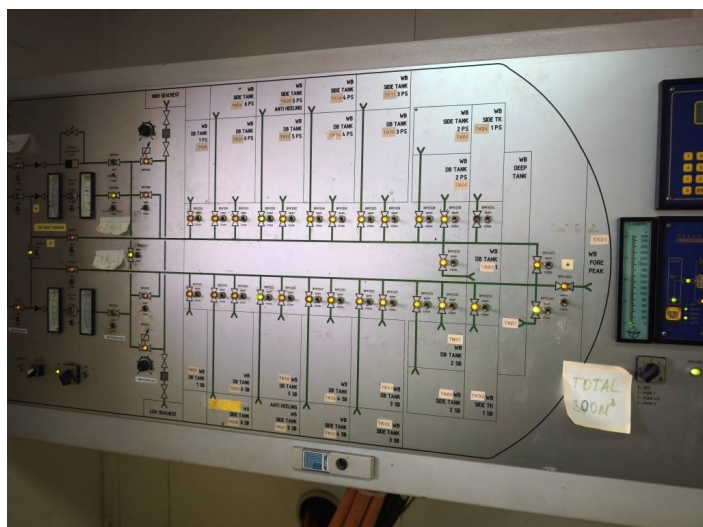**Defect ID: 1-598-255-111**

Ballast tank corrosion was most prevalent on the first stringer floor plating, with corrosion breakthrough noted on the underside plate areas, frame face plates, welding seams and stiffeners. Moderate corrosion was noted in the Fore peak particularly on the upper shell plate welding seams were noted with moderate corrosion and although this had been coated recently, staining was evident.

The areas of corrosion should be de-scaled, primed and re-coated to avoid further deterioration.

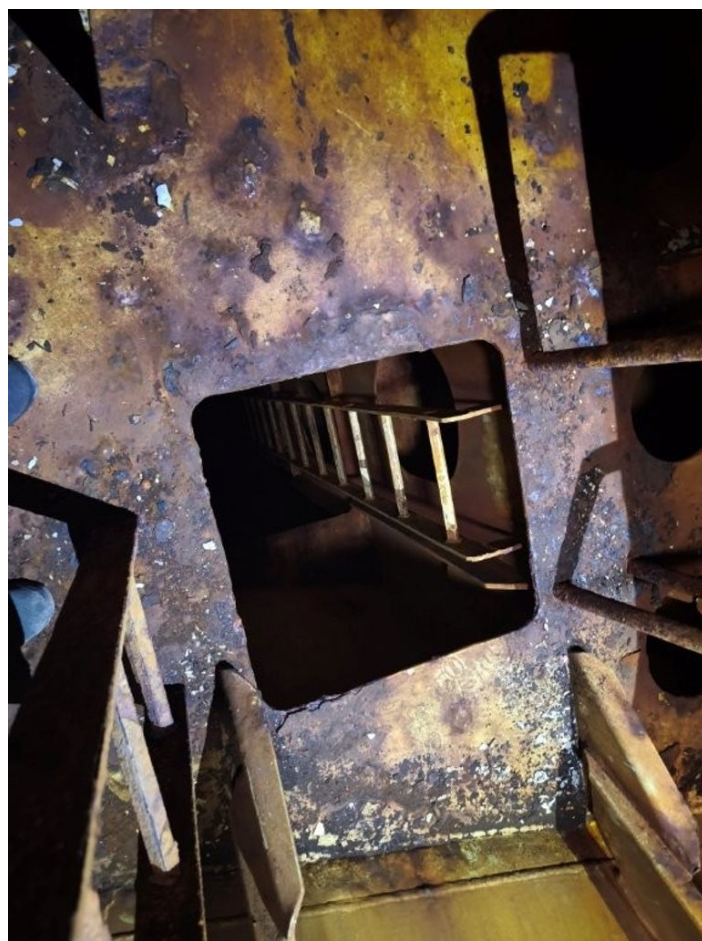



GRADING REPORT/

ACCOMMODATION




Review Technical Report

The accommodation areas were in fair to good condition overall with damaged linoleum flooring, with the chairs noted to have age-related deterioration, some of which had cracked covers. The levels of housekeeping and cleanliness were good, although some of the tiles were noted to be cracked, and in some areas where these had been painted, the coating was noted to have partially detached. The hospital was well equipped and ready for use with drugs controlled and secured, and the associated drugs log kept up to date. The accommodation was outfitted to an average quality. The Air Handling Unit (AHU) was maintaining a comfortable temperature and was in good condition with no defects. The galley equipment was in good overall condition with all equipment reportedly in good working order. The galley was in a clean condition with the galley hoods also kept clean. The vessel's walk-in cold rooms were clean and hygienic with temperatures at the required levels. Provision room components were generally free of frosting and deterioration. The external superstructure was free of structural defects and had only minor scattered, surface and spot corrosion, up to approximately 5% of the surface area, mainly located on the guard brackets, weld seams, free edges, and external decks of the accommodation. The external superstructure fittings such as lighting, vent heads, windows/portholes, stairways and railings were in good overall condition, with all external accommodation doors in good working order and properly closing. The vessel's Crew Welfare was found to be good overall. The average contract length was reported to be four months for the vessel's Officers and six months for the vessel's crew, with a crew suggestion policy in place. The vessel had free to access and limited use Wi-Fi onboard which was available to all crew. The approximate average internet speed was reported to be fast, indicating the crew could stream music or short videos in low quality. The vessel had various pieces of public recreational equipment that the crew could access, including free weights, fixed weight machine, treadmill, cycling machine, table tennis, television, games console, entertainment library - books, dvds, games, musical instruments and public computer. This equipment was in a good overall condition. As per crew reports, access is provided to catering facilities at all times, with crew given additional time and resources to celebrate religious and cultural events, such as Christmas or Independence days. Various facilities were provided in all crew cabins, including a sofa, desk and with ample storage. The crew have access to a well-stocked bond store. The vessel has onboard training facilities, and as per crew reports, additional periods of rest were given throughout the working week.

Defects

Priority	Description	Recommendations
	Defect ID: 3-628-232-704 Steps and platforms were noted to be partially holed with diminution and wastage on the plate edges.	The affected steps should be replaced and the platform edges cropped and renewed when possible.





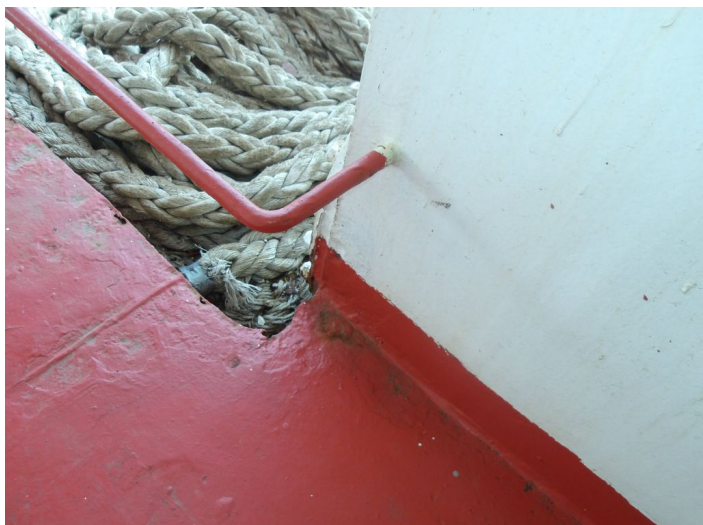

Defect ID: 1-598-066-698

Linoleum flooring in the accommodation was noted with damage, with chairs noted to have age-related deterioration, some of which had cracked covers, with floor tiles including in the galley were noted to be cracked.

It is recommended to replace the damaged linoleum and cracked galley floor tiles, and to re-cover or replace the damaged chairs.

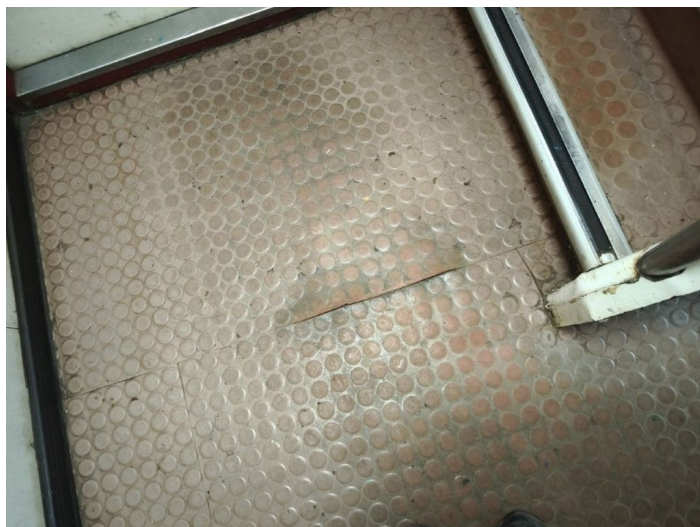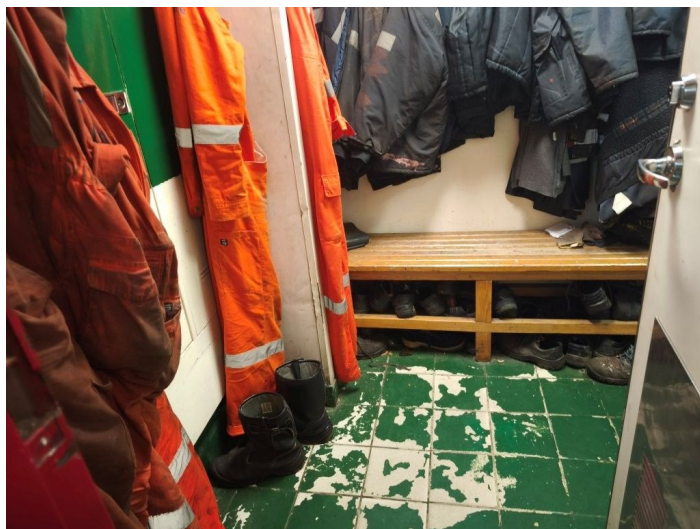

Positive items

Description	
	Positive ID: 3-536-052-224 The vessel is reportedly fitted with free to access limited use Wi-Fi system.

GRADING REPORT/

BRIDGE AND NAVIGATION EQUIPMENT



[Review Technical Report](#)

The Bridge and navigation equipment were found to be in good condition overall with housekeeping found to be good and with all bridge equipment reported to be fully operational. The vessel's VDR was free from any unanticipated alarms with collection instructions posted nearby and with the Bridge Navigation Watch Alarm System (BNWAS) reported to be fully operational. The vessel's primary means of navigation, as listed on form E of the safety equipment certificate is a dual ECDIS system which were found to be up to date. An in-date compass deviation card was seen to be posted near to the helm and the compass deviation log was well maintained and without any major deviations. The vessel is licensed to cover GMDSS sea areas A1, A2, and A3 and had a valid shore-servicing agreement in place. The radio batteries were seen to be well maintained and in good condition and the EPIRB, SART and VHF handheld batteries were all in date as required. Berth to berth passage plans were seen on-board and were signed by all navigating officers with nautical publications provided in Electronic format. Master's standing and night orders were found to be signed by all navigating officers with the bridge log book correctly filled in and the GMDSS logbook also up to date and correctly filled in. The Monkey island was found to be in a good overall condition with the mast, aerals and antennas seen to be satisfactory and free of defects.

Defects

No defects

GRADING REPORT/

ENGINE ROOM AND MACHINERY

70

Review Technical Report

The Engine room and machinery were found to be in fair to good overall condition with no significant defects reported or observed. However, the general levels of housekeeping and cleanliness in the engine room had previously been noted by PSC, and while cleaning was evident, further bilge cleaning is recommended, with some laggings found damaged and partially stained, which had also been raised by the last PSC inspection. During the inspection the auxiliary engines, purifiers, pumps, air compressors, sewage treatment plant, auxiliary boiler, refrigeration compressor and air conditioning compressor were seen running. A review of the supplied main engine running hours showed that all major components are reportedly subject to Condition Based Monitoring (CBM) and therefore maintenance requirements are ascertained from performance reports and inspections. Upon review of the latest main engine performance carried out on the 22nd February 2026, the engine power was noted to have been 5,643 kW (with 690 kWe) at 424 RPM stated as 58%, which was slightly low for an accurate assessment, although there were no significant issues noted, with ignition pressures ranging from 106 to 110 Bar, and exhaust gas temperatures between 289C (unit No1) to 327C (unit No4), although No1 unit appeared slightly low. Propulsion systems such as shafting arrangements were in good working condition. The bowruster was reportedly fully operational and seen to be in good condition with no major visible defects, although no recent lube oil analysis was provided so a full assessment was limited. The vessel is fitted with three auxiliary engines and one harbour/emergency generator which were all reported to be fully operational and were seen to be in good condition with no major visible defects. A review of the supplied auxiliary engines running hours showed no areas of concern, although the 12,000 hour overhaul of auxiliary engine No1 was due imminently, with the running hours noted as 11,877 hours. Auxiliary engine No2 was also due overhaul this year and was at 10,178 hours. Upon review of the latest auxiliary engine performance reports it was noted that there were no areas of concern. The vessel's thermal oil boiler was found to be fully operational and in good overall condition. A review of the supplied boiler and cooling water analysis reports showed no areas of concern. The steering gear was in good working order and free of leakages. A new calorifier was being installed during the inspection. The engine room structure, including bulkheads and frames, was seen to be in good condition and engine room fittings such as handrails, ladders, floor plates and lighting were also found in good condition. Engine room pipework was seen to be generally free of significant corrosion and free from leakages. Pipework was free of any temporary repairs including soft patches. Pipework insulation lagging was seen with some areas of deterioration and staining although anti-splash tape was seen to be in place at all required pipe connections. Bilge alarms were found to be fully operational during testing. All Engine Control Room automation and monitoring systems were found to be fully operational and with no serious active alarms present. No concerning engine room control system alarms were seen on the manually blocked/disabled alarm list. The engine room dead-man and engineer call alarms were found to be fully operational during testing. A review of the supplied lube oil analysis reports showed no significant areas of concern although only the Stern tube, main engine, auxiliary engines and emergency generator were provided. It should be noted that the previous stern tube analysis was in Caution due to raised copper wear (27PPM), although the latest sample was normal with no issues with wear materials or contaminants, although the TAN had dropped from 2.83 mg KOH/g, to 1.99 mg KOH/g based on the latest analysis. It was also noted from previous lube oil analysis report from May 2025 that there was a cautionary alert raised for the Main Engine Reduction Gear (Enclosed Gears) due to raised Tin (Sn) content, although no analysis was provided, which is recommended. The IFO 80 fuel oil analysis report from bunkers taken on the 8th January 2026 at Malta was noted with raised total sediment which was 0.11%, just outside the ISO 8217: 2017 specification, although this was within the acceptability criteria for ISO 4259 for a single result. It should be noted that acceptability criteria for IFO 80 - RMD 80 LS ranges from 0.1 to 0.15 %. There was also a note that Marlab had observed an increasing number of contamination cases involving organic chlorides from Malta ports, and to avoid potential machinery damage, it was strongly recommended to test the chlorine content using the EN 14077 method, as specified in ISO 8217. Engine room documentation such as the engine room log book, standing orders and NOx technical file were reviewed and found to be well maintained and up to date. All machinery and equipment manuals were reported to be available onboard. Package air conditioning units around the vessel were all operational and in good condition. The main switchboard was in good order although issues were noted with the circuit breakers on the emergency switchboard. However all insulation readings were seen to be adequate. Recent Megger test reports were seen with no abnormal findings. The emergency generator was tested during the inspection and found to be in good working order and was in good overall condition.

Defects


Priority	Description	Recommendations
----------	-------------	-----------------



Defect ID: 1-598-242-829

The general cleanliness of the engine room had previously been noted by PSC, and while cleaning was evident, further bilge cleaning is recommended, with some laggings found damaged and partially stained.

Remedial housekeeping and cleaning should be carried out as soon as practical. The damaged, stained and partially detached laggings should also be replaced to avoid a repeat of the previous PSC deficiency.

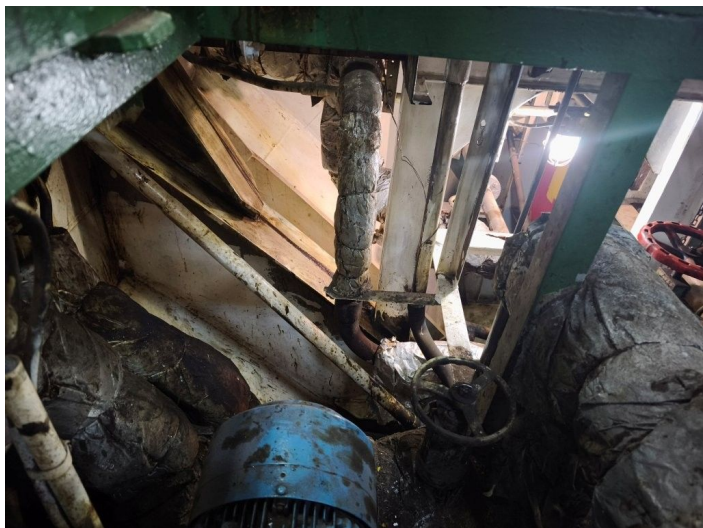

Defect ID: 1-598-148-622

The IFO 80 low sulphur fuel oil bunkered on the 8th January 2026 at Malta was just outside the ISO 8217: 2017 specification as the total sediment was 0.11%, although this was within the acceptability criteria for ISO 4259 for a single result.

Although the acceptability criteria for IFO 80 - RMD 80 LS ranges from 0.1 to 0.15 % there was a note that Marlab had observed an increasing number of contamination cases involving organic chlorides from Malta ports, and to avoid potential machinery damage, it was strongly recommended to test the chlorine content using the EN 14077 method, as specified in ISO 8217.



Defect ID: 2-034-368-521

The emergency switchboard breakers were partially damaged.

It is advisable to check options for replacement of the damaged emergency switchboard circuit breakers.



Defect ID: 2-034-409-482

The engine room emergency escape floor was noted to be deformed.

The affected floor plate should be cropped and renewed when possible.

**Defect ID: 3-217-285-120**

A review of the supplied auxiliary engines running hours showed no areas of concern, although the 12,000 hour overhaul of auxiliary engine No1 was due imminently, with the running hours noted as 11,877 hours. Auxiliary engine No2 was also due overhaul this year and was at 10,178 hours.

The auxiliary engine No1 should be overhauled at the next opportunity, and the No2 engine overhaul scheduled when convenient.



GRADING REPORT/

FIRE FIGHTING EQUIPMENT AND SYSTEMS


80

Review Technical Report

Fire Fighting Equipment and Systems were found to be in good condition overall although the oil-stained lagging in the engine could present a potential fire hazard, and it is recommended that this is replaced. However, servicing and inspections of firefighting equipment were all up to date as required. The fire detection and alarm system was fully operational and free of signs of tampering and alarms. The vessel is fitted with CO2 and Water Spray fixed firefighting in the engine room, CO2 for the cargo areas and Galley CO2. Fixed firefighting systems were all reported to be in good working condition with operating instructions clearly posted. The main and emergency fire pumps were reportedly fully operational and both were found to be in good condition, free of leakages. A fire pump was tested during the inspection and delivered adequate pressure. The fire main and ancillaries such as hydrants and valves were in good overall condition, free of defects. Fire extinguishers were all in good condition and all portable equipment were positioned in accordance with the fire plan. Firefighting outfits and associated equipment were all in good condition with BA equipment found fully charged and ready for use. Remote shutdown emergency devices such as quick closing valves, machinery stops and ventilation dampers were deemed to be in good overall condition with no defective shut down equipment. The fire doors were found to be in good condition and closing effectively, although an unauthorised 'hold-open' arrangement was noted, as the engine room emergency escape fire door was found to be tied back and was held permanently open.

Defects

Priority	Description	Recommendations
	Defect ID: 1-598-218-260 The engine room emergency escape fire door was found to be tied back and held open.	Ensure fire doors are free from unauthorised 'hold-open' arrangements, as this can rapid increase the risk of a fire spreading, and would have been raised as a deficiency by PSC.

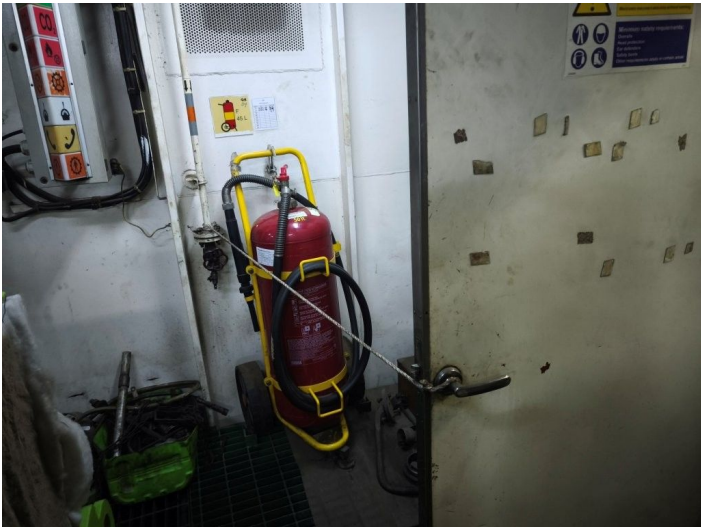

GRADING REPORT/

LIFESAVING APPLIANCES



Review Technical Report

Lifesaving appliances were seen to be in good overall condition with all equipment regularly serviced and inspected as required. The vessel is fitted with one free-fall lifeboat, which was seen to be in good overall condition externally and internally. The lifeboat engine was tested during the inspection and found to be in good working order. The vessel's rescue boat was found to be in good overall condition and ready for immediate use. The vessel is equipped with three life rafts, which were found to be in good condition with Hydrostatic Release Units (HRUs) in date and correctly rigged. Davits and lowering arrangements were found to be in good condition overall with evidence of regular maintenance, servicing and inspection sighted and evident. Ancillary lifesaving equipment such as lifejackets, immersion suits and EEBD's were found to be in good condition and ready for immediate use with man overboard smoke and light signals seen to be in date. Embarkation ladders were found to be in a good, well maintained condition with the pyrotechnics and line throwing apparatus found to be stored appropriately and within their expiry dates.

Defects

No defects

GRADING REPORT/

SAFE WORKING ENVIRONMENT



Review Technical Report

Safe working was deemed to be fair overall because an unsafe practice was observed as the engine room emergency escape fire door was found tied back and was held permanently open open. Improvements are also suggested regarding the safe working environment as the lifeboat davit hooks had no safety latches. In terms of fire prevention is it is also recommended to carry out further engine room cleaning, with oil-stained and deteriorated lagging requiring replacement. Hazards were seen to be clearly marked and external walkways adequately coated with non-slip paint and free of trip hazards. Adequate PPE was seen to be worn by crew at all times and portable gas detection meters were provided and calibrated. Hazardous substances were seen to be generally safely managed with appropriate Material Safety Data Sheets provided. Risk Assessments (RA) were seen to be up to date and satisfactory with enclosed space entry procedures followed and an effective Permit To Work (PTW) system in place. Main and emergency exits were clearly identified and unobstructed with all IMO signage seen to be satisfactory. The pilot ladder was seen to be in good condition and was secured in a safe manner. Regular drills were conducted on board with the last drill, which was an Abandon Ship Drill, conducted on the 6th March 2026.


Defects

Priority	Description	Recommendations
----------	-------------	-----------------



Defect ID: 1-598-283-798
The lifeboat davit hooks had no safety latches.

Safety latches should be fitted to reduce the risk of accidents or injury during lifeboat retrieval.

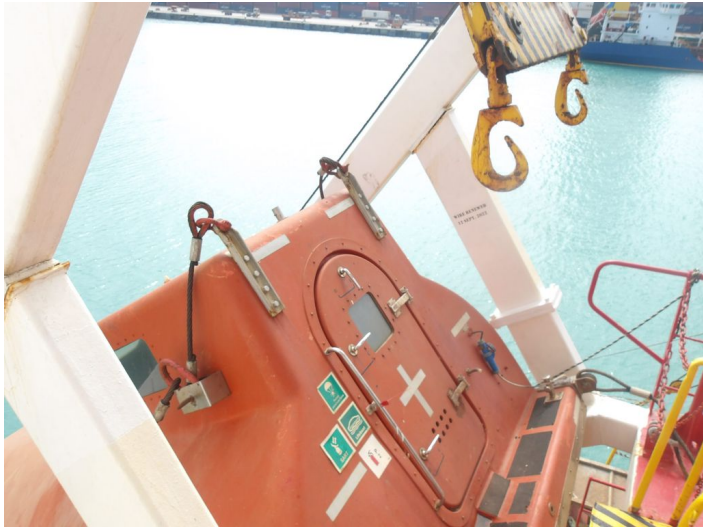

GRADING REPORT/

POLLUTION CONTROL

80

[Review Technical Report](#)

Pollution control was deemed to be good overall and generally found to be well implemented on board with the vessel free of pollution hazards. The vessel holds a Class-approved Inventory of Hazardous Materials, which is required for entry into EU ports. The vessel's Oily Water Separator (OWS) was found to be fully operational and in good overall condition, with no obvious defects. The OWS was simulation tested during the inspection and the 15ppm Oil Content Meter (OCM) was seen to be calibrated. The bilge overboard was seen to be sealed and locked against unauthorised opening and the oily water treatment system as a whole was seen to be free from signs of tampering or unauthorised modification. The SOPEP locker was found to be well stocked with SOPEP equipment in good condition and an accurate list of equipment posted nearby. The Oil Record Book (ORB) was seen to be well-maintained and up-to-date, with the last entry on the 28th February 2026. It was reported that an IMO approved Ballast Water Treatment System (BWTS) is fitted onboard with no documentation provided onboard to verify its USCG compliance. The BWRS was reported to be fully operational and in good overall condition. The vessel's ballast record book was seen to be up to date and correctly filled in. The vessel was not found to be Vessel General Permit (VGP) compliant, as the vessel had no valid oil-to-water interface controls such as Environmentally Acceptable Lubricants (EALs) or an Airseal. The vessel's sewage treatment plant was found to be fully operational although the covers were loose and were missing securing bolts. Garbage segregation was found to be good, with adequate, labelled containers and garbage seen to be well sorted and containers seen to be made of approved non-combustible materials. The Garbage Record Book (GRB) was seen to be well-maintained and up-to-date, with the last entry on the 20th February 2026. The Emission Control Area (ECA) change-over logbook was reviewed and found to be satisfactory with the date of last entry on the 20th February 2025 (due to trading in the Mediterranean). The vessel's incinerator was found to be fully operational and in good overall condition, with no obvious defects. The vessel complies with IMO 2020 regulations by employing the use of Very Low Sulphur Fuels Oils (VLSFO) with a sulphur content of less than 0.5%.

Defects

Priority	Description	Recommendations
	Defect ID: 1-598-066-712 The vessel was not found to be Vessel General Permit (VGP) compliant, as the vessels Stern Tube and/or Bow Thruster or Controllable Pitch Propeller (CPP) had no valid oil-to-water interface controls such as Environmentally Acceptable Lubricants (EALs) or an Airseal fitted.	Various upgrades and modifications may be required if the vessel wishes to trade in the USA.
	Defect ID: 2-034-429-958 The sewage treatment plant covers were loose and were missing bolts.	The bolts should be replaced and the covers tightened at the next opportunity.



GRADING REPORT/

ONBOARD MANAGEMENT

70

[Review Technical Report](#)

Onboard management was found to be fair to good overall, although further cosmetic deck maintenance, Safety checks and engine room cleaning is recommended. The computer-based Safety Management System (SMS) was functioning and well implemented in general, with Permits to Work (PTW), risk assessments and procedures understood and followed. Onboard management dealt with accidents, near misses and deficiencies in an effective manner, and regular safety committee meetings were carried out on board. The vessel's MLC certificate was valid with records of hours of rest (ILO) correct and up to date, and maximum work hours not regularly exceeded. The PMS system was kept up to date, though some critical overdue work orders were noted, such as the MGBS Control Panel (for Marine Growth). The type-approved software-based Planned Maintenance System (PMS) was fully integrated with the SMS for ordering of spares and general vessel management. The Port State Control (PSC) history was poor with fourteen deficiencies and one detention in the six inspections conducted in the past three years. The vessel's flag is not targeted by any Memorandum of Understanding (MoU) or the USCG. Security access controls were satisfactory with the vessel conforming to International Ship and Port Security (ISPS) standards. The Master and crew were prepared for the inspection and provided good cooperation with the majority of requested documents provided.

Defects

Priority	Description	Recommendations
	Defect ID: 2-034-425-867 The steering gear was missing emergency operation instructions.	The emergency operating instructions should be posted at the next opportunity.



VESSEL CAPABILITIES AND CARGO SYSTEMS



Review Technical Report

Vessel capabilities and cargo systems were deemed to be in a fair to good overall condition. Cargo hold No3 was partially inspected although due to the number of containers on board, the inspection was limited. However, photographs of previous hold entries and recent inspection reports from March 2026 were provided for review. From the photographs provided, it was seen that the cargo hold structural members were free of damage and had only minor scattered, surface and spot corrosion, up to approximately 5% of the surface area, mainly located on the tanktops, free edges, and bulkheads. Cell guides were free of damage and deformation. Cargo hold fittings such as ladders, handrail, ventilation ducts, light fixtures and pipe guards were noted with minor deformation. Some welding cones on deck and tank tops were missing and one guide fitting on deck between rows 00 and 02 was missing. It was also noted that the bilge high level alarm in the No2 hold on the starboard side was inoperative. The cargo holds were free of signs of water ingress both from internal and external sources. Mechanical ventilation systems were in good working order. The vessel is fitted with pontoon hatch covers. Hatch covers were found to have structural defects with hold No4B rubber packing on the hatch cover noted to be in poor condition, which was causing moderate issues with the hold sealing. The holds were noted with only minor scattered and surface corrosion, up to approximately 5% of the surface area. The condition of the hatch covers was difficult to assess as cargo was restricting access although minor areas of corrosion were noted on the side and top edges. Hatch cover rubber seals and retaining channels were in fair overall condition as one damaged seal was evident between No4B pontoons. Hatch coamings were found to be free of structural defects and had only minor localised, surface and spot corrosion, up to approximately 5% of the surface area, mainly located on the free edges, coaming table, plating edge intersection, and coaming guide. Compression bars/strips were seen to be in good condition. Cargo securing fittings such as container sockets, pad-eyes and D-rings were in fair condition as some welding cones on deck and tank's top were missing. Cargo securing equipment was plentiful with inspection records maintained and securing equipment in good condition as observed. Stability calculations were seen to be carried out and the vessel holds a Document of Compliance (DOC) for the carriage of Dangerous Goods (DG). The vessel is equipped to carry 220 Reefer containers whose temperatures were effectively monitored. Reefer sockets were seen in good condition with switchboards free of low insulation or earth faults. The vessel uses its own power for all Reefer containers, without the need for an additional auxiliary power unit. The vessel has two Liebherr CBW 45(40) / 26.5 (29.5) electro-hydraulic cargo cranes which were found to be in good overall condition, with the No2 crane inspected internally with no significant issues noted. The cranes were found to be generally free of significant structural defects and had only minor surface corrosion, up to approximately 5% of the surface area, mainly located on the pedestal, jib edges and hydraulic cylinders. Wires were in good overall condition as were motors and hydraulic systems, which were free of defects and leaks. Lifting appliances components, such as sheaves, blocks and cylinders were seen to be in a good overall condition with controls and operating positions in good condition and safety devices fully operational. The slewing bearings were found to be in a good overall condition with evidence of bearing rocking tests conducted and recorded. Lifting appliances were regularly examined by shore side technicians with maintenance records accurate and up-to-date.

Defects


Priority	Description	Recommendations
	Defect ID: 2-034-290-702 The hatch cover rubber seals/gaskets were noted to be damaged in at least one location requiring repair and replacement.	The damaged seal and frame should be replaced at the first opportunity, to ensure weatherproof integrity.



Defect ID: 2-034-438-156

The bilge high level alarm in the No2 cargo hold on the starboard side was reported to be inoperative.



The defective high level alarm should be repaired or replaced at the first opportunity.

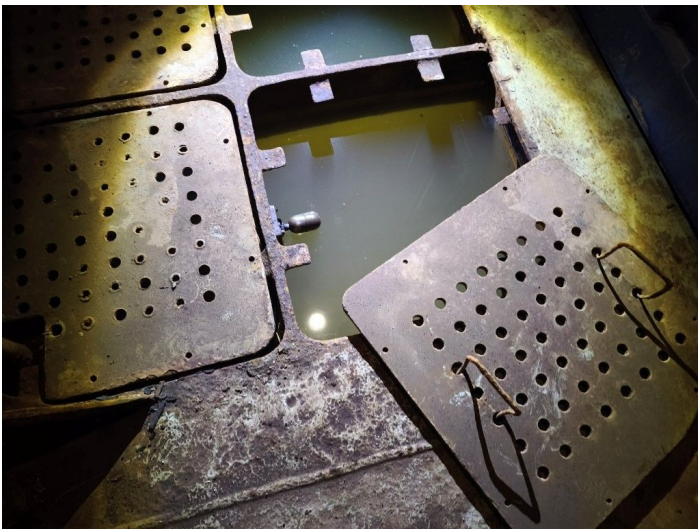

Defect ID: 2-034-290-706

Cross deck stanchions and handrails were partially damaged.


The defective stanchions and handrails should be repaired or replaced at the next opportunity.

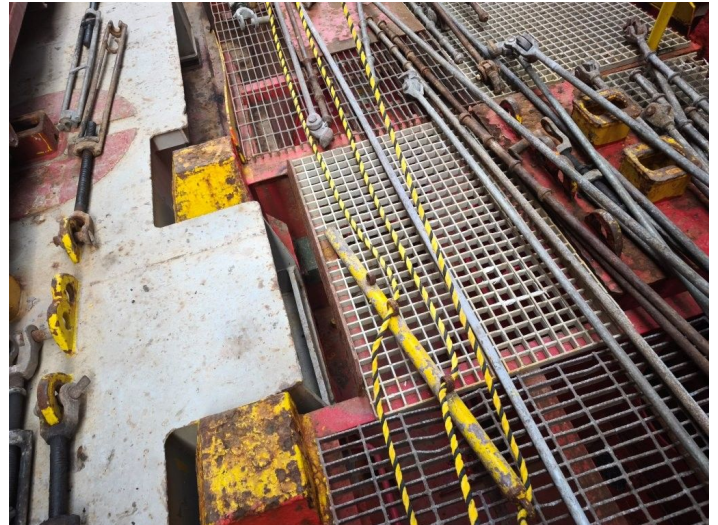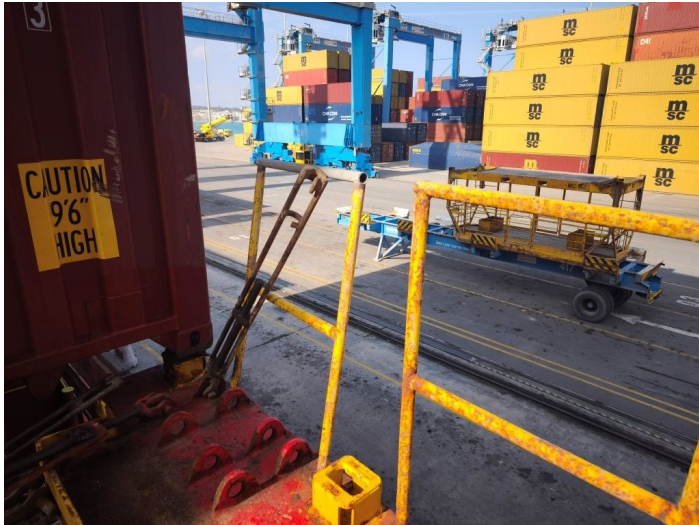

Defect ID: 2-034-397-204

Cargo hold lights were noted to be inoperative during the inspection.

The lamps should be replaced although alternative lighting may need to be considered to improve reliability.

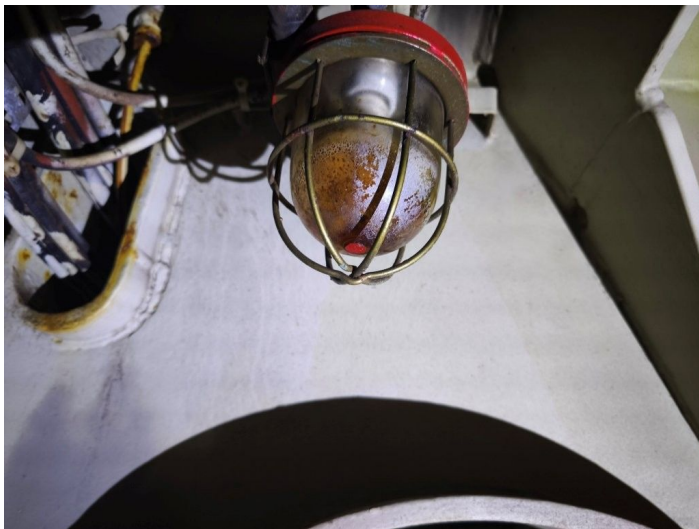

OPERATIONAL DATA

Operational Data Condition

Does the vessel have an Exhaust Gas Cleaning System (EGCS)?	No
Total High Sulphur Fuel Oil (HSFO) capacity:	0 m ³
Total Very and Ultra Low Sulphur Fuel Oil (VLSFO and ULSFO) capacity:	1200 m ³
Total Marine Gas Oil (MGO) and Diesel Oil (DO) capacity:	235 m ³
Does the vessel have any energy efficiency technologies installed?	No

Engines Table

	Main Engine 1	Main Engine 2	Aux Engine 1	Aux Engine 2	Aux Engine 3	Aux Engine 4
Designer	MAN B&W	N/A	MAN B&W	MAN B&W	MAN B&W	MAN B&W
Model	L58/64		6L16/24	6L16/24	6L16/24	D2842LE201
Original Power (MCR)	9730		610	610	610	620
Power (MCR lim) (if applicable)	6780					
Number of Cylinders	7		6	6	6	6
Speed (RPM)	428		1200	1200	1200	1800
Bore (mm)	580		160	160	160	128
Stroke (mm)	640		240	240	240	142
Specific Fuel Oil Consumption (SFOC) (g/kWhr) At 75% load for ME and 50% load for AEs, corrected to ISO conditions, as stated on Nox technical files	197.8		197.8	197.8	197.8	244
Nox Tier	1		1	1	1	1
System Oil Consumption (litres/day)	30		10	10	10	0.1
Total Running Hours (Hours)	76056		52315	49336	51063	3384
Major Overhaul Interval (Hours)			12000	12000	12000	
Running Hours since			11877	10178	4161	3384

last overhaul (Hours)						
--------------------------	--	--	--	--	--	--

Main Engine Maintenance

Component	Condition Based Monitoring?	Overhaul Interval
Cylinder Heads	Yes	
Pistons	Yes	
Bearings	Yes	
Cylinder Liners	Yes	
Turbocharger(s)	Yes	

Main Engine No.1	Unit Running Hours											
Component	1	2	3	4	5	6	7	8	9	10	11	12
Cylinder Heads	11370	11370	11370	11370	11370	11370	11370					
Pistons	11370	11370	11370	11370	11370	11370	11370					
Bearings	11370	11370	11370	11370	11370	11370	11370					
Cylinder Liners	11370	11370	11370	11370	11370	11370	11370					
Turbocharger(s)	11370											
Was there any overdue maintenance for any main/auxiliary engine ancillaries (exhaust valves, fuel pumps, fuel injectors etc.)?	Yes											

Main Engine

	Vessel Speed (knots)	Consumption (t/day)
Loaded Eco	13.5	23.5
Full Load	18.0	42.0

Auxiliary Engines (t/day)

At Sea	0.0
In Port	2.0

Boiler (t/day)

At Sea	0.0
Cargo Heating (if applicable)	0.0
In Port (Idle)	0.5
Cargo Operations (if applicable)	0.0

Class Surveys

Were all Class and Statutory certificates valid?	Yes
Is the vessel on the Extended Dry Docking (EDD) program?	No
Is the vessel on the Enhanced Survey Program (ESP)?	No
Does the vessel have an In Water Survey Class notation?	Yes
Is the vessel ice classed?	Yes
Ice class:	IC

Survey	Date Last Completed	Date Next Due
Main / Special / Renewal	27-Sept-22	14-May-27
Intermediate	15-Jul-24	07-Aug-30
Annual	17-Jul-25	14-May-26
Bottom In Water	17-Jul-25	14-May-27
Bottom in dry dock	27-Sept-22	14-May-27

What was the location of the last out-of-water docking?	Invalid-Date
Is the vessels last dry dock report provided and attached?	Yes
Has the vessel remained with the same flag since build?	No
Please provide further details	Cyprus (Until Dec 2015) Malta (Until Oct 2018) Liberia (Until Mar 2022) Singapore (To date)

Has the vessel remained with the same Class since build? Please provide further details	No		
	DNV - Det Norske Veritas		
In total, how many of the following does the vessel have? Conditions of Class, Recommendations of Class, Statutory Findings, Statutory Items, Conditions of Authority, etc.	0		
	Description	Area	Due Date
Does the vessel have any Class Memos, Observations or Additional Requirements? Please provide further details	Yes		
	10 Oct 2018 - Additional Notation "ICE" is inherited from DNVGL, Notation E 29 Sep 2022 BWTS installation has been carried out on this date. 08 Apr 2024 - Vessel complies with CSS (Cargo Stowage and Securing Code) 16 Jul 2024 At Owner's request , service notation changed from General Cargo Ship to Container Ship		
What was the status of the vessel at the time of inspection?	alongside discharging		

TECHNICAL REPORT

- ⌘ Design and Construction
- ⌘ Hull
- ⌘ Mooring Decks
- ⌘ Weather Decks and Fittings
- ⌘ Ballast Tanks and Systems
- ⌘ Accommodation
- ⌘ Bridge and Navigation Equipment
- ⌘ Engine Room and Machinery
- ⌘ Fire Fighting Equipment and Systems
- ⌘ Lifesaving Appliances
- ⌘ Safe Working Environment
- ⌘ Pollution Control
- ⌘ Onboard Management
- ⌘ Vessel Capabilities and Cargo Systems
- ⌘ Cargo Lifting Appliances

TECHNICAL REPORT/

DESIGN AND CONSTRUCTION

 Review Grading Report

Design and Construction Condition

Has the vessel been built to the standards and Rules of an IACS-member Class Society?	Yes
Under what IACS Class society supervision was the vessel built?	GL - Germanischer Lloyd
Did the vessel provide Ultrasonic Thickness Measurement (UTM) reports?	No, not available

Engine Room & Firefighting

Feature seen in the engine room What is the new maximum power of the Main Engine as limited by the EPL? (kW) Notes:	Engine Power Limiter (EPL)
	6780
	via MAN Alphasonic 2000 Propulsion Control System
Feature seen in the engine room Notes:	Incinerator sludge burning system
	CSSC-LZ-TEAMTEC, OG200C
Feature seen in the engine room Notes:	UMS Capabilities (regardless of Class notation)
	UMS is applicable, with remote alarm panels and . entries made in the engine log book.
Feature seen in the engine room Notes:	Centralised Sea Water cooling
	Heinrich Behrens HT and LT pumps are fitted.
Feature seen in the engine room Notes:	Dual Air Handling Unit Refrigeration compressors
	Two Bitzer 4G-302Y-40P compressors (for the AHU). Cooling and heating is available.

TECHNICAL REPORT/

HULL

 Review Grading Report

Hull Condition

What sections of the hull were inspected?	Stbd side
Was the vessel free of any major structural damage or indentations?	Yes
Was the vessel free of any minor structural damage or indentations?	No
Please provide further details	Minor indentations and rib caging were seen on the after shell plate and boot top.
What was the level of Hull coating breakdown and corrosion?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	Corrosion on the bow with staining noted from the sheer strakes. Isolated areas of corrosion and detachment on the boot top and top sides with more developed areas of moderate scattered corrosion and detachment on the antifouling.
The amount of surface area coating breakdown and corrosion was approximately:	15 %
Type of coating breakdown and corrosion:	Scaling
	Scattered
	Surface
	Spot
What was the condition of the hull markings?	Illegible
Please provide further details	Hull markings were seen to be illegible ; Touch up of hull markings should be considered at the earliest opportunity to ensure legibility
What level of marine fouling was seen?	None
Were fenders installed on the hull?	Yes
What condition were the fenders in?	Good

TECHNICAL REPORT

MOORING DECKS

 Review Grading Report

Mooring Decks Condition

Were the decks free of any structural damage or deformations?	Yes
What was the level of coating breakdown and corrosion observed on the decks?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	Age related blistering and corrosion on the deck plate and welding seams, including near the bulwarks and mooring machinery.
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Scaling
	Pitting
	Scattered
	Surface
What was the general condition of the deck fittings?	Fair
Please provide further details	Minor corrosion and staining on mooring rollers and bollards.
Were fairleads and mooring rollers free to move when tested?	Yes
Were all mooring machinery reported to be fully operational?	Yes
What type of windlass(es) and winches were fitted?	Electric
What was the condition of the mooring machinery?	Fair
Please provide further details	Age related pitting was evident with developing corrosion noted on the brake band assemblies and foundations. The Windlass gypsy wheels were noted with moderate diminution and corrosion.
What amount of band brake lining was seen to be remaining?	Substantial

What condition were the visible sections of the anchor chains seen to be in? Please provide further details	Fair
	Minor to moderate diminution was noted, with surface corrosion evident.
What type of mooring lines did the vessel have?	Rope
What was the condition of the mooring ropes / wires?	Good
Were safe mooring practices observed? i.e. no overlapping turns on split drum, chafing of lines or unsafe leading.	Yes
Was the last brake test seen to be stencilled on the mooring winches? Date of last test	Yes
	27-Sept-22
What type of snap back warning signs/zones were posted?	Signs at the entrance to the mooring decks
Was the Bosun's / Foc'sle store available for inspection?	Yes
What was the condition of the bosun's store structure?	Structurally sound with no visible damage
What was the condition of the bosun's store coatings?	Coatings fully intact with no corrosion
Was the condition of the bosun's store housekeeping?	Fairly neat with some scattered equipment
Were the bitter end release arrangements seen to be clear and unobstructed?	Yes
Was an 'emergency towing booklets/procedures' available near to the foc'sle?	Yes

TECHNICAL REPORT/

WEATHER DECKS AND FITTINGS

 Review Grading Report

Weather Decks and Fittings Condition

Were the decks free of any structural damage or deformations?	Yes
What was the level of coating breakdown and corrosion observed on the decks?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	Corrosion breakthrough on the main deck and cross deck walkways with historic pitting evident.
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Pitting
	Scattered
	Surface
	Spot
What was the general condition of the deck fittings e.g handrails, brackets, vent heads, walkways, lighting etc.? Please provide further details	Fair
	Deck fitting were noted with age related diminution, several hand rails were warped and the vent heads were in fair condition, with further cosmetic maintenance suggested.
Does the vessel have mooring winches fitted on the main deck?	No
Were deck equipment and pipework free of leakages?	Yes
What was the condition of the accommodation ladders or gangways?	Good
Was the vessel fitted with a provision lifting appliance(s)?	Yes
What was the condition of the provision lifting appliance(s)?	Good

Does the vessel carry any major spares on external decks e.g. propeller blades, anchor etc. Please provide further details	Yes
	Spare anchor, old towing wire and new spare cargo crane wire stored in cargo hold no. 1 forward part.

TECHNICAL REPORT/

BALLAST TANKS AND SYSTEMS

Review Grading Report

Ballast Tanks and Systems Condition

Were ballast tanks entered?	Yes
Please provide further details	Deep Tank and Fore Peak
Were recent (last 12 months) ballast tank inspection photographs provided?	Yes
Date the photographs were provided:	27-Feb-26
Were the tanks free of any structural damage or indentations?	No
Please provide further details	Fore Peak Tank first stringer was noted to have a crack with wastage and diminution noted on the plate edges.
What was the level of Ballast Tank coating breakdown and corrosion?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	Corrosion was most prevalent on the the stringer floor plating, with corrosion breakthrough noted on the underside plate areas, frame face plates, welding seams and stiffeners. Moderate corrosion was noted in the Fore peak particularly on the upper shell plate welding seams were noted with moderate corrosion and although this had been coated recently, staining was evident.
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Localised
	Surface
	Spot
What was the condition of ballast tank fittings (e.g. ladders, handrails, pipes & manhole seals)?	Fair
Please provide further details	Age related diminution with minor to moderate areas of corrosion on the vertical ladders and pipe penetrations.
Were the ballast tanks fitted with sacrificial anodes?	No

How much mud/sediment was seen inside the ballast tanks?	Minimal
Were the tanks seen to be free from any signs of staining from oil, sewage or marine fouling?	Yes
Were ballast tank manhole covers seen to be in good condition?	Yes
Were the remote ballast control systems fully operational (e.g. valves, gauging etc)?	No
Please provide further details	Issues were reported regarding the Tank remote gauging system with erratic readings which were described as inaccurate and unreliable based on the vessel own inspection reports.
Were the ballast and/or anti-heeling pumps reported to be fully operational?	Yes
What condition were the ballast and/or anti-heeling pumps in?	Good

TECHNICAL REPORT/

ACCOMMODATION

🔗 Review Grading Report

Internal Accommodation Condition

Were accommodation spaces used for their assigned purposes?	Yes
What was the condition of the flooring and wall coverings?	Poor
Please provide further details	Damaged linoleum flooring in the accommodation.
What was the condition of the upholstery and furniture?	Fair
Please provide further details	Age related deteriorated with some chairs noted with cracked covers.
What were the general levels of housekeeping and cleanliness?	Good
What was the level of hygiene of the sanitary facilities?	Fair
Please provide further details	Some tiles were found to be partially detached during the inspection, with coatings that had been applied had partially detached.
Was all laundry equipment in good working order?	Yes
Was the Hospital well equipped and ready for use?	Yes
Were the drugs found to be controlled and secured with the associated drugs log kept up to date?	Yes
What was the quality of accommodation outfitting?	Average quality of outfitting
Did the Air Handling Unit (AHU) maintain a comfortable temperature?	Yes
What was the condition of the AHU?	Good

Galley Condition

What was the level of cleanliness in the Galley?	Clean
Was all galley equipment operational?	Yes
What was the general condition of galley equipment?	Good

Were the insides of Galley hoods clean?	Yes
What type of cold provisions stores does the vessel have?	Walk-in stores / Cold rooms
Were provisions stores well organised with no provisions stored directly on the deck?	Yes
Were provisions stores clean and hygienic?	Yes
Were provisions stores at the required temperatures?	Yes
Were provision stores temperatures recorded and records kept nearby?	Yes
Were provisions machinery, pipework and door seals free of frosting and deterioration?	Yes
Were lock-in alarms or handles in good working condition?	Yes

External Areas Condition

Was the external Superstructure / Accommodation Block found to be free from damages?	Yes
Were accommodation external doors found to be in good condition and providing an adequate seal?	Yes
What was the level of external accommodation superstructure coating breakdown and corrosion?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the guard brackets, weld seams, free edges, and external decks of the accommodation.
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Scattered
	Surface
	Spot
What was the general condition of external superstructure fittings (e.g. lighting, vent heads, windows/portholes, stairways, railings etc.)?	Good

Crew Welfare

What is the average contract length for crew members?	Officers:	Crew:
	4 Months	6 Months
Was Wi-Fi provided on-board?	Yes, Free, Limited	
What is the approximate average internet speed?	Fast (Able to stream music or short videos in low quality)	
Is access provided to catering facilities or food at all times?	Yes	
What Public Recreation equipment did the crew have access to?	Free Weights	
	Fixed weight machine	
	Treadmill	
	Cycling Machine	
	Table Tennis	
	Television	
	Games console	
	Entertainment Library - Books, DVDs, Games, etc.	
	Musical Instruments	
	Public Computer	
What was the quality of crew recreation facilities?	Good	
Are crew given time and resources to celebrate religious or cultural events (i.e. Christmas, Independence days etc.)?	Yes	
What facilities were provided in crew cabins?	Off	
	Off	
	Sofa	
	Desk	
	Ample storage	

Does the vessel have any onboard training facilities?	Yes
Please provide further details	One Global learning package
Type of onboard training facilities:	Other
Is there a crew suggestion policy in place?	Yes
Does the crew have access to a bonded store?	Yes, well stocked
Are the crew given additional periods of rest throughout the working week (e.g Sunday off)?	Yes

TECHNICAL REPORT/

BRIDGE AND NAVIGATION EQUIPMENT

Review Grading Report

General Condition

Was all the bridge equipment reported to be fully operational?	Yes
Was the bridge found to be clean and well maintained with good housekeeping?	Yes
Were all required bridge equipment annual performance tests (e.g. VDR and AIS) completed in the last 12 months?	Yes
Was the vessel fitted with a Voyage Data Recorder (VDR)?	Yes
Type of VDR fitted:	VDR
Was the VDR seen to be free from any unanticipated alarms?	Yes
Were the VDR collection instructions posted and known to the Master?	Yes
Was the vessels Bridge Navigation and Watch Alarm System (BNWAS) fully operational, and turned on when at sea?	Yes
Normal time setting at sea	12 mins

Navigation Condition

What was the vessels primary & secondary means of navigation as listed on Form E?	Primary	Secondary
	ECDIS	ECDIS
Were the primary & secondary means of navigation found to be up to date?	Yes	
Latest update week	10	
Does the vessel receive up to date weather information?	Yes	
	07-Mar-26	
What type of weather updating service does the vessel use?	Other	
Please provide further details	by email	

Was an in-date compass deviation card posted near to the helm?	Yes
Was a compass deviation log kept, up to date and free of any major deviations?	Yes
Were azimuth rings (bearing diopters) found to be available on the bridge?	Yes

Communication Condition

What GMDSS sea areas was the vessel licensed to cover?	A1		
	A2		
	A3		
Were the radio batteries seen to be in good condition?	Yes		
Were the EPIRBs, SARTs and Emergency Hand Held VHF Batteries within their expiry dates?	Yes		
Battery expiry dates	EPIRBS	SARTs	VHF
	01-Jan-27	01-Feb-29	01-Apr-27
Was a valid GMDSS shore servicing certificate seen to be posted near to radio equipment?	Yes		

Documentation Condition

Were berth to berth passage plans seen on-board?	Yes
Were passage plans signed by all navigating officers?	Yes
What format were nautical publications provided in?	Electronic
Were the Master's standing orders and night orders found to be signed by all navigating officers?	Yes
Was the bridge log book up to date and correctly filled in?	Yes
Was the GMDSS log book up-to-date and correctly filled in?	Yes
Date of last test	07-Mar-26

External Condition

Was the Monkey Island found to be in good, well maintained condition?	Yes
Were the main mast, aerials and antennas seen to be in good condition and free from damage?	Yes
Were bridge wing manoeuvring controls fitted?	Yes
Were the bridge wing manoeuvring controls reported to be fully operational and free from signs of water ingress?	Yes
Were bridge wing engine speed and compass repeaters seen to be in good working condition?	Yes

TECHNICAL REPORT/

ENGINE ROOM AND MACHINERY

🔗 Review Grading Report

General Condition

Were all engine room bulkheads and frames seen to be in good structural condition?	Yes
Were the engine room fittings such as stairwells/ladders, handrails, floor plates and lighting found to be in good condition?	Yes
Was the duct keel in good condition and free from any signs of ingress or internal leakages?	N/A
What equipment was seen running?	Auxiliary Engines
	Purifiers
	Pumps
	Air compressors
	Sewage treatment plant
	Auxiliary Boiler
	Refrigeration Compressor
	Air Conditioning Compressor
Was the engine room free of any significant defects, either reported by crew or observed?	Yes
What were the general levels of housekeeping and cleanliness in the Engine Room? Please provide further details	Fair
	The general cleanliness of the engine room had previously been noted by PSC, and while cleaning was evident, further bilge cleaning is recommended, with some laggings found damaged and partially stained.
Were bilges and tank tops free of any significant oil and/or water?	Yes
Were bilge alarms found to be fully operational during testing?	Yes

Was the vessel equipped with adequate critical spares as recommended by the ship manager Safety Management System (SMS)?	Yes
Were spares neatly stowed and correctly secured?	Yes
Were all self-closing devices (sounding pipes, tank level gauge glasses etc.) in good working order?	Yes
Were any caution (amber) or action (red) alerts seen on the lube oil analysis reports?	No
Were any alerts or abnormal findings seen on the supplied fuel oil analysis reports?	Yes
Please provide further details	The IFO 80 bunkered on the 8th January 2026 at Malta was noted with raised total sediment which was 0.11%, just outside the ISO 8217: 2017 specification, although this was within the acceptability criteria for ISO 4259 for a single result. Acceptability criteria for IFO 80 - RMD 80 LS ranges from 0.1 to 0.15. There was also a note that Marlab had observed an increasing number of contamination cases involving organic chlorides from Malta ports, and to avoid potential machinery damage, it was strongly recommended to test the chlorine content using the EN 14077 method, as specified in ISO 8217.
Was the NOx Technical file kept up to date?	Yes
Date of entry:	09-Feb-26
Was the engine room logbook up to date, correctly filled in and without any obvious abnormalities recorded?	Yes
Were Chief Engineer Standing Orders clearly posted and signed by all engineers?	Yes
Were all machinery special tools provided and in good condition?	Yes
Were all machinery and equipment manuals reported to be available onboard?	Yes

Main Engine Condition

Was the main engine in good working condition?	Yes
In what condition was the Main Engine?	Good
Were any defects or abnormal findings seen on the supplied scavenge space inspection reports?	No
Were all maximum cylinder liner wear measurements seen to be within maker limits?	Yes
Were all main engine safeties reported to be fully operational? (e.g. oil mist detectors, bearing temperature sensors, low lube oil pressure trip etc.)	Yes
Were the main engine turning gear and flywheel in good condition?	Yes
Were the supplied main engine performance reports seen to be satisfactory?	No
Please provide further details	Main engine performance testing was carried out on the 22nd February 2026, with an engine power of 5643 kW (with 690 kWe) at 424 RPM and with engine power of 58%, which was slightly low for an accurate assessment, although there were no significant issues noted, with ignition pressures ranging from 106 to 110 Bar, and exhaust gas temperatures between 289C (unit No1) to 327C (unit No4), although No1 unit appeared slightly low.

Propulsion

What type of propulsion does the vessel have?	Controllable Pitch Propeller (CPP)
Were the Propulsion systems, including shafts, gearing and electric motors, if relevant, in good working condition?	Yes
What type of thruster systems does the vessel have?	Bow Thruster
Was the thruster(s) in good working condition?	Yes
In what condition was the thruster(s)?	Good

Power Generation

How many Auxiliary Engines does the vessel have?	3
--	---

Were the Auxiliary Engines in good working condition?	Yes
In what condition were the Auxiliary Engines?	Good
Were all auxiliary engine safeties reported to be fully operational? (low lube oil pressure, overspeed, high HT temperature etc.)	Yes
Were the supplied auxiliary engine performance reports seen to be satisfactory?	Yes
Does the vessel have a shaft generator?	Yes
Shaft Generator rated power (PTO) (kW):	2000
Was the shaft generator unit fully operational and in good condition?	Yes
Does the vessel have a shaft motor (Power Take-In)?	No

Auxiliary Machinery

Does the vessel have an Auxiliary Boiler?	Yes
What type of boiler is fitted?	Thermal Oil
Was the boiler(s) in good working condition?	Yes
In what condition was the boiler(s)?	Good
Were boiler safety valves in satisfactory condition?	Yes
Was it reported that any boiler tubes had been plugged? (including Economiser/EGB)	No
Was the Hot Well/Cascade Tank seen to be in good order and free from contaminants?	Yes
Were any abnormal findings observed on the supplied boiler and cooling water analysis reports?	No

What was the condition of the following equipment?	Fully operational?	Condition
Economiser/Exhaust Gas Boiler	Yes	Good
Purifiers	Yes	Good
Pumps	Yes	Good
Coolers and Heaters	Yes	Good
Sea Chests and Overboard Valves	Yes	Good
Air Compressors and Air Reservoirs	Yes	Good
Fresh Water Generator	Yes	Good
Filters	Yes	Good
Supply and Exhaust Fans	Yes	Good
Refrigeration and Air Conditioning Systems	Yes	Good
Impressed Current Cathodic Protection (ICCP) System	Yes	Good
Marine Growth Prevention System (MGPS)	Yes	Good
Automation Systems (e.g. viscometer, temperature controllers/valves, monitoring panels/screens etc.)	Yes	Good
Engine Room Crane	Yes	Good
Workshop Machinery including emergency stops	Yes	Good
Calorifier	Yes	Poor
Why was 'No', 'Fair' or 'Poor' selected above?	New calorifer found onboard in progress of installment	
Was all engine room pipework free of significant corrosion?	Yes	
Was all engine room pipework free of leakages?	Yes	
Was all pipework free of temporary repairs including soft patches?	Yes	
What condition was pipework insulation lagging in?	Some areas of deterioration and staining	
Was all anti-splash tape seen to be in place at the required engine room pipe connections?	Yes	

Was the steering gear in good working condition?	Yes
Was the steering gear free of leakages?	Yes
Was the emergency steering communication equipment and gyro repeater working as required?	Yes
Were emergency steering instructions posted nearby?	Yes
Was the Engine workshop clean and tidy?	Yes
Was all welding equipment including gas bottles, flame arrestors and associated fittings in good order and properly secured?	Yes

ECR and Electrical

Was the Engine Control Room clean and tidy?	Yes
Were all Engine Control Room automation and monitoring systems fully operational?	Yes
Was the Engine Control and Alarm system free of any serious active alarms?	Yes
Were any concerning engine room control system alarms seen to be manually blocked/disabled?	No
If the vessel has a UMS Class notation, does the machinery space operate in UMS mode?	Yes
Were the engine room deadman and engineer call alarms found fully operational during testing?	Yes
Were all package air conditioning units operational and in good condition? (e.g. ECR, bridge, galley, electrical rooms)	Yes
Were all Electrical distribution systems in good working condition?	Yes
Were Main Switchboard Insulation readings adequate?	Yes
Were any abnormal findings observed as per the latest Megger Test reports?	No
Were distribution and switchboard panels protected with approved rubber matting?	Yes

Was evidence of regular safety equipment testing available? (i.e. weekly, monthly and quarterly tests of bilge alarms, dampers, emergency machinery etc.)	Yes
Was the Emergency Generator tested during the inspection?	Yes
Was the Emergency Generator in working order?	Yes
Were Emergency Generator Starting instructions clearly posted?	Yes
What was the condition of the Emergency Generator?	Good
Was the "18 hour" fuel level marked on the emergency generator fuel tank?	Yes

TECHNICAL REPORT/

FIRE FIGHTING EQUIPMENT AND SYSTEMS

🔗 Review Grading Report

Fire and Safety Appliances Condition

Was the vessel free of fire hazards?	No		
Please provide further details	Oil stained lagging in the engine could present a potential fire hazard with it recommended that this is replaced.		
Was all fire and safety equipment regularly serviced?	Yes		
Date of last service	09-May-25		
Were all relevant Fire and Safety instructions correctly posted?	Yes		
What was the vessels Fixed fire detection systems?	Engine Room	Cargo Holds	Accommodation
	Flame	Smoke	Smoke
	Smoke		Heat
Was the fire detection system reportedly fully operational?	Yes		
Was the fire detection system free of alarms or signs of tampering?	Yes		
What is the vessels Fixed firefighting systems?	Engine Room	Cargo Holds	Accommodation
	CO2	CO2	Galley CO2
	Water Spray		
Were all fixed fire fighting systems in good working condition?	Yes		
Were clear operating instructions posted for the fixed firefighting systems?	Yes		
Was the fixed firefighting system release protected against unauthorised operation?	Yes		
Was the main fire pump working?	Yes		
Was the emergency fire pump working?	Yes		
Was a fire pump tested during the inspection?	Yes		

Did the fire pump maintain adequate pressure?	Yes
Were the main and emergency fire pumps in good condition and free of leakages?	Yes
What was the condition of the fire main and ancillaries such as pipework hydrants and valves?	Good
Does the vessel have a fire control station?	Yes
Were all portable equipment in place as per the fire plan?	Yes
Were all fire extinguishers in good condition?	Yes
Were the firefighting outfits and associated equipment in good condition?	Yes
Were the International Shore Connections on board?	Yes
Location:	Main Deck aft Port
Was the BA equipment fully charged in good condition?	Yes
Was the Quick Closing Valve system in good working order?	Yes
Were fire doors in good condition and effectively closing?	Yes
Were fire doors free of unauthorised "hold-open" arrangements?	No
Please provide further details	The engine room emergency escape fire door was found to be tied back and held open.
Were all ventilation dampers remote closing positions well labelled and in good working order?	Yes
Were all remote machinery shutdown systems well labelled and in good working order?	Yes

TECHNICAL REPORT/

LIFESAVING APPLIANCES

🔗 Review Grading Report

Lifesaving Appliances Condition

Were all Lifesaving Appliances regularly serviced?	Yes
Date of last service:	27-May-25
How many lifeboats is the vessel equipped with?	1
What type of lifeboat is the vessel fitted with?	Free-fall
What was the external condition of the lifeboat(s)?	Good
What was the internal condition of the lifeboat(s)?	Good
Were Lifeboat Engines able to be tested?	Yes
Were lifeboat engines in good working order?	Yes
What was the condition of the rescue boat?	Good
How many life rafts does the vessel have?	3
What was the condition of the life rafts?	Good
Were Liferaft Hydrostatic Release Units (HRU) in date and correctly rigged?	Yes
What was the condition of the Davits and lowering arrangements for the lifeboat(s), rescue boat and liferafts?	Good
What Date is the next Davit wire due for change?	17-Sept-27
Were legible launching/recovery instructions posted near to survival craft?	Yes
Was evidence of regular maintenance, service and inspection of the launching appliances sighted and evident?	Yes
What was the date of the last abandon ship drill?	06-Mar-26
Were all lifejackets, immersion suits, EEBDs and other lifesaving ancillary equipment in good condition and ready for use?	Yes
Were Man Overboard Buoy (MOB) smoke and light signals in date?	Yes

Were the embarkation ladders in a good, well maintained condition?	Yes
Were pyrotechnics and line throwing apparatus available, stored in an appropriate container and within their expiry dates?	Yes

TECHNICAL REPORT/

SAFE WORKING ENVIRONMENT

 Review Grading Report

Safe Working Environment Condition

Were any unsafe practices observed during the inspection?	Yes
Please provide further details	The engine room emergency escape fire door was found to be tied back and held open.
Did the vessel provide a safe working environment?	No
Please provide further details	The lifeboat davit hooks had no safety latches. Improvements are also recommended regarding fire prevention with replacement of oil stained lagging required in the engine room.
Were all hazard markings clear?	Yes
Were external walkways adequately coated with anti-slip paint and free of trip hazards?	Yes
Are all hazardous substances including safely managed and stored with relevant Material Safety Data Sheets (MSDS)?	Yes
Is Personal Protective Equipment (PPE) provided and worn by crew?	Yes
Are 'Enclosed Space Entry' procedures implemented?	Yes
Is an effective Permit To Work (PTW) process implemented?	Yes
Date of last PTW:	07-Mar-26
Is an effective Risk Assessment (RA) process in place?	Yes
Was evidence of the annual and 5-yearly inspections of both fixed and portable lifting equipment and appliances sighted?	Yes
Are main and emergency exits clearly identified and unobstructed?	Yes
Are sufficient portable oxygen and gas detection meters provided and regularly calibrated?	Yes
Date of last calibration:	06-Mar-26
What is the working language of the vessel?	English

Are standing orders, procedures, instructions and manufacturers' manuals written in a language which can be understood by the crew?	Yes
Are all IMO signs correctly placed, and compliant with IMO requirements?	Yes
Is the vessel equipped with an approved SOLAS training manual?	Yes
Were the Pilot Ladders in good condition?	Yes
Was the Pilot ladder seen to be secured in a safe manner?	Yes
Are regular drills conducted on board?	Yes
Last drill date	06-Mar-26
Last drill type	Abandon Ship Drill

TECHNICAL REPORT

POLLUTION CONTROL

 Review Grading Report

General Condition

Was Pollution Control well implemented within the on board Safety Management System (SMS)?	Yes
Is the vessel free of pollution hazards?	Yes, with no hazards
Does the vessel have a Class approved Inventory of Hazardous Materials (IHM)?	Yes
Please provide further details	The vessel holds a Class approved Inventory of Hazardous Material (IHM)

Oil - Marpol Annex I

Is an Oily Water Separator (OWS) fitted?	Yes
Was the OWS reportedly operational?	Yes
What was the condition of the OWS?	Good
Was the OWS Tested?	Yes
Means of testing	Simulated
Was the 15ppm meter calibrated?	Yes
Date of calibration	17-Jun-22
Was the Bilge Overboard valve secured against unauthorised opening with adequate signage and warnings posted?	Yes
Means of securing	Sealed
	Locked
Was the oily water treatment system including valves and pipework free of any signs of tampering, bypass, or modifications?	Yes
Was the SOPEP locker or box well stocked?	Yes
What was the condition of the SOPEP equipment?	Good

Was a list of SOPEP equipment posted and accurate?	Yes	
Was the Oil Record Book (ORB) up to date and correctly filled in?	Yes	
Date of last entry	28-Feb-26	
Category of last entry	C & I	
Were previous bunkering checklists correctly filled out?	Yes	
Date of last bunkering	08-Jan-26	
Were bunker samples correctly stored?	Yes	
Does the vessel have a Ballast Water Treatment System (BWTS) fitted?	Yes	
Ballast Water Treatment System	Manufacturer:	Panasia GloEn-P350 BWTS (350m3/hr capacity)
	Type:	UV
What regulation is listed on the Ballast Water Management Certificate?	D-2	
Type of BWTS approval (As reported / according to provided documentation):	IMO approval	
Was the BWTS operational?	Yes	
What was the condition of the BWTS?	Good	
Was the Ballast Record Book up to date and correctly filled in?	Yes	
Date of last entry	01-Mar-26	
Is the Vessel General Permit (VGP) compliant?	No	

Sewage - Marpol Annex IV

Was a Sewage Treatment Plant fitted?	Yes
Was the Sewage Treatment Plant operational?	Yes

What was the condition of the Sewage Treatment Plant?	Fair
Please provide further details	Sewage plant covers were loose and were missing bolts
Does the vessel have a sewage holding tank?	Yes
What was the condition of the Sewage Holding Tank?	Good

Garbage - Marpol Annex V

How was the condition of Garbage segregation?	Good
Were Garbage containers of approved, non-combustible type?	Yes
Was the Garbage Record Book (GRB) up to date and correctly filled in?	Yes
Date of last entry	20-Feb-26
Category of last entry	A, B and C

Air - Marpol Annex VI

How does the vessel comply with IMO 2020 regulations?	Use of Very Low Sulphur Fuel Oils (VLSFO), MGO, D0 etc.
Does the vessel use Ozone Depleting Substances (ODS) as Refrigerant Gas?	No
Was an Incinerator fitted?	Yes
Was the Incinerator operational?	Yes
What was the condition of the Incinerator?	Good
Does the vessel have an Emission Control Area (ECA) change-over log?	Yes
Date of last entry	20-Feb-25

EEXI

Does the vessel have an attained EEXI score as per her International Energy Efficiency Certificate (IEEC)?	Yes
What is the EEXI score?	21.966

Does the vessel have any energy efficiency technologies installed?	No	
Is the vessel ice classed?	Yes	
Ice class:	IC	
Main Engine(s)	Specific Fuel Oil Consumption (SFOC) (g/kWhr):	197.8
Auxiliary Engines	Specific Fuel Oil Consumption (SFOC) (g/kWhr):	197.8
Shaft Generator rated power (PTO) (kW):	2000	
Does the vessel have a shaft motor (Power Take-In)?	No	
What is the expiry date of the International Air Pollution Prevention (IAPP) certificate?	14-May-27	
	2024	23.467

TECHNICAL REPORT/

ONBOARD MANAGEMENT

Review Grading Report

Onboard Management Condition

Does the vessel have a functioning Safety Management System (SMS)?	Yes
How was the SMS Implemented?	Software / Electronic System
Were the officers familiar with, and allowed easy access to, the SMS?	Yes
Was the SMS well implemented on board, with Permits to Work, Risk Assessments and Safety procedures understood and followed?	Yes
Is the SMS system regularly reviewed by the Master?	Yes
Date of last review	28-Feb-26
Does the vessel management deal with accidents, near-misses and deficiencies in an effective manner?	Yes
Are regular safety committee and management meetings carried out on board?	Yes
Does the vessel have a valid MLC certificate?	Yes
Were Hours of Rest (ILO) records correct and up to date?	Yes
Last updated	06-Mar-26
Are hours of maximum permissible work regularly exceeded?	No
Is an effective Planned Maintenance System (PMS) implemented and kept up to date?	Yes
What type of Planned Maintenance System (PMS) does the vessel have?	Type-approved system
Name of PMS	AMOS
Was the PMS a fully integrated type system? (i.e. has integration with the SMS, spares ordering and is accessible by shore side management)	Yes

Were there any critical overdue PMS work orders?	Yes
Please provide further details	MGBS Control Panel (for Marine Growth)

Port State Control (PSC) inspection history

No. of Inspections in Past three years:	6
No. of Deficiencies in Past three years:	14
No. of Detentions in Past three years:	1
Is the vessel flag targeted by Port State Authorities?	No
Is an effective system of security access control, conforming to ISPS standards, in place upon boarding the vessel?	Yes
Type of access control	gangway watch rating and being escorted into the accommodation
Do the Master and Chief Engineer have an effective hand over procedures?	Yes
Are random or specific drug and alcohol testing carried out?	Yes
Tests Carried out by:	Onboard by Master
Were the Master and crew prepared for the Inspection?	Yes
What level of cooperation was provided by the crew and Master?	Good
Were documents provided as requested?	Majority of documents provided
What was the overall impression of the general management of the vessel?	Well managed

TECHNICAL REPORT/

VESSEL CAPABILITIES AND CARGO SYSTEMS - CONTAINERSHIPS

Review Grading Report

Vessel Capabilities and Cargo Systems - Containerships Condition

Cargo hold	Capacity in hold (TEU)	Capacity on deck (TEU)	Total (TEU)
Cargo Hold No.1	20	48	68
Cargo Hold No.2	42	89	131
Cargo Hold No.3	110	180	290
Cargo Hold No.4	112	215	327
Cargo Hold No.5	50	108	158
Cargo Hold No.6		122	122
Cargo Hold No.7			0
Cargo Hold No.8			0
Cargo Hold No.9			0
Additional Deck Stowage			0
Total	334	762	1096
How many cargo holds does the vessel have?	4		
Were the cargo holds able to be entered and inspected?	No		
Please provide further details	C/H no 3 partly inspected, at the time of inspection cargo present in all C/H's. Cargo operation started late afternoon		
Were recent vessel cargo hold inspection photographs provided?	Yes		
Date photographs were taken:	02-Mar-26		
Were recent inspection reports provided?	Yes		
Date of inspection reports:	02-Mar-26		

Were cargo holds structural members found to be free from damage (e.g. side plating, tank top and framing)?	Yes
Were the cargo hold fittings such as ladders, hand rails, and ventilation ducting found to be free from damage and deterioration?	No
Please provide further details	Some deformation was noted to the fittings although this was generally due to wear and tear. Some welding cones on deck and tank tops were missing and Hold No3B – one guide fitting on deck between rows 00 and 02 was missing.
Were the cell guides free from any significant damage or significant deformation?	Yes
What was the level of coating breakdown and corrosion observed in the Cargo Holds?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the tanktop, free edges, and bulkheads.
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Scattered
	Surface
	Spot
Were all cargo monitoring systems (e.g. bilge alarms, smoke detection systems etc.) fully operational and regularly tested?	No
Please provide further details	Bilge HLA stbd side was tested on
Were the cargo holds free from signs of significant water ingress?	Yes
Were the cargo holds free from signs of previous and/or current internal leaks? (e.g. from manholes, adjacent tanks, pipework and fittings etc.)	Yes
What is the method of cargo hold ventilation?	Mechanical
Were cargo hold ventilation systems in good working order?	Yes
Were the cross-deck areas seen to be free from waving of the deck plates or any signs of torsional deformation?	Yes

Is the fixed firefighting system in cargo spaces in apparent good condition?	Yes
--	-----

Hatch Covers

What type of hatch covers are fitted?	Pontoon
What was the make and model of the Hatch covers?	McGREGOR
Maximum weight of the heaviest pontoon (tons):	27
Were the hatch cover found to be free from structural damage? Please provide further details	No Hold No4B rubber packing on the hatch cover was in poor condition, which was causing moderate issues with the hold sealing.
What was the level of coating breakdown and corrosion observed on the hatch covers?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	This was difficult to assess as cargo was restricting access although minor areas of corrosion were noted on the side and top edges.
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Scattered Surface
What was the condition of the hatch cover rubber seals/gaskets and retaining channels? Please provide further details	Fair One damage seal was evident between No4B pontoons .
What was the condition of hatch cover securing arrangements?	Good
What was the condition of the hatch cover landing pads?	Good

Hatch Coamings

Were the hatch coamings found to be free from structural damage?	Yes
--	-----

What was the level of coating breakdown and corrosion observed on the hatch coamings?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the free edges, coaming table, plating edge intersection, and coaming guide
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Surface
	Spot
Were the compression bars/strips seen to be in good condition?	Yes
Were the hatch coaming drain channels seen to be free from corrosion, scaling or debris? Please provide further details	No
	N/A
Were hatch coaming non-return valves found to be clear and fully operational? Please provide further details	No
	N/A

Cargo Securing

What was the condition of fixed cargo securing fittings, such as container sockets, pad-eyes, D-rings and fixed stacking cones, etc.? Please provide further details	Fair
	Some welding cones on deck and tank's top were missing.
Was there an up to date Cargo Securing Equipment inventory?	Yes
Were there any shortfalls of cargo securing devices?	No
Were cargo securing device inspection records correctly maintained?	Yes
What was the condition of Cargo Securing Equipment?	Good
Was there an approved Cargo Loading Manual on board?	Yes
Was there an approved stability booklet on board?	Yes

Did the vessel use a Class-approved computer based loading/stability software?	Yes
Please provide further details	MACS 3
Were previous and current stability calculations seen to be carried out?	Yes
Does the vessel have a Document of Compliance (DOC) for the carriage of dangerous goods?	Yes
Are procedures for safe lashing and securing of containers being incorporated in the ship's SMS?	Yes
Are appropriate securing points being used for cargo securing?	Yes

Reefer Containers

Is the vessel equipped to carry Reefer containers?	Yes			
Reefer Capacity	On deck	In Holds	Water cooled Reefers	Total
	164	56		220
What condition were reefer electrical sockets in?	Good			
Was the reefer switchboard free of any low insulation or earth faults?	Yes			
Was the vessel's own electrical supply sufficient for all reefer containers, without the use of an additional Power Unit (package generator) ?	Yes			
Is there an effective system for monitoring reefer container temperatures?	Yes			
Please provide further details	Manual monitoring by crew			

TECHNICAL REPORT/

CARGO LIFTING APPLIANCES

Cargo Lifting Appliances Condition

Does the vessel have Cargo Lifting Appliances? i.e. Does the vessel have cargo cranes (Geared).	Yes		
Crane	Safe Working Load (SWL) (t)	Reach (m)	Date of last wire change
1	45	26.5	01-Apr-24
2	45	24.3	03-Apr-24
How many Cargo Lifting Appliances does the vessel have?	2		
What type of cargo lifting appliances are fitted?	Two Liebherr CBW 45(40) / 26.5 (29.5) ST electro-hydraulic cargo cranes.		
Were the cargo lifting appliances seen in operation?	No		
Were all cargo lifting appliances fully operational?	No		
Please provide further details	not seen during the inspection due to ongoing cargo operations with shore gantry crane.		
Were the cargo lifting appliances available for internal inspection?	Yes		
Please provide further details	Cargo Crane no.2		
Were the cargo lifting appliances found to be free from structural damage?	Yes		
What level of coating breakdown and corrosion was seen on the cargo lifting appliances?	Minor		
Coating breakdown and corrosion was mainly located in the following areas:	on the pedestal, jib edges and hydraulic cylinders.		
The amount of surface area coating breakdown and corrosion was approximately:	5 %		
Type of coating breakdown and corrosion:	Surface		
In what condition were the wires for the cargo lifting appliances?	Good		

In what condition were the cargo lifting appliances motors and hydraulic systems?	Good
In what condition were the cargo lifting appliances slewing bearings?	Good
Was slewing bearing wear monitored or rocking tests conducted and recorded?	Yes
Were all safety features and equipment (e.g. limit switches) fitted on the cargo lifting appliances fully operational?	Yes
In what condition were the cargo lifting appliances control and operating positions, including their operator cabs if fitted?	Good
Were cargo lifting appliances regularly examined by appropriately qualified shore side technician?	Yes
Were cargo lifting appliances angle indicators free to move?	Yes
Was the Safe Working Load (SWL) clearly marked on the cargo lifting appliances?	Yes
What condition were the cargo lifting appliances components such as sheaves, blocks and cylinders in?	Good
Were cargo lifting appliances maintenance records accurate and up to date?	Yes