



ID CONDITION REPORT

ATLANTIC MONACO

IMO 9356658

Commissioned by:
Container Management Team

Organisation:
Sinokor Merchant Marine Co., Ltd

Inspected at:
Malta Freeport, Malta

Date of inspection:
December 20 2025

ADDITIONAL ITEMS
Supplementary materials, accessible online.

 [View Documents](#)

 [View Images](#)

CONTENTS

TERMS OF USE	2
INSPECTION SUMMARY	3
VESSEL PARTICULARS	4
GRADE COMPARISON	5
GRADING DATA	7
DEFECTS LIST	9
DECARBONISATION SUMMARY	11
GRADING REPORT	12
13 Design and Construction	
15 Hull	
16 Mooring Decks	
17 Weather Decks and Fittings	
18 Ballast Tanks and Systems	
19 Accommodation	
21 Bridge and Navigation Equipment	
22 Engine Room and Machinery	
26 Fire Fighting Equipment and Systems	
28 Lifesaving Appliances	
29 Safe Working Environment	
33 Pollution Control	
35 Onboard Management	
36 Vessel Capabilities and Cargo Systems	
OPERATIONAL DATA	38
TECHNICAL REPORT	45
46 Design and Construction	
48 Hull	
49 Mooring Decks	
51 Weather Decks and Fittings	
52 Ballast Tanks and Systems	
54 Accommodation	
57 Bridge and Navigation Equipment	
60 Engine Room and Machinery	
67 Fire Fighting Equipment and Systems	
69 Lifesaving Appliances	
71 Safe Working Environment	
73 Pollution Control	
77 Onboard Management	
79 Vessel Capabilities and Cargo Systems	
84 Cargo Lifting Appliances	

REPORT TERMS OF USE

This report is intended for the sole use of **Container Management Team** and is designed to offer a condition evaluation of the subject vessel, as found on the day of the survey and in the opinion of the surveyor concerned. The report is subject to any access restrictions as described herein, and subject always to the level of cooperation afforded to the surveyor during the inspection itself. All details are given in good faith, and without guarantee.

This report has been prepared and issued by Idwal Marine Services Ltd to its Customer, **Container Management Team of Sinokor Merchant Marine Co., Ltd**, in accordance with, and subject to, the General Terms and Conditions of Idwal Marine Services Ltd, a copy of which can be obtained at <https://www.idwalmarine.com/terms-and-conditions/idwal-id>. Attention is particularly drawn to restrictions on reproduction and disclosure of, and limits on reliance on, this Report as more fully set out therein.

At Idwal, we are proud to run a carbon neutral business and provide the industry's first carbon neutral inspection service. Idwal has been carbon neutral since 2021 and has achieved PAS 2060 certification from Carbon Footprint Ltd.



Carbon
Neutral
Organisation
PAS 2060



INSPECTION SUMMARY



76

IDWAL
GRADE
Inspected. JAN-2026Inspected at:
Malta Freeport, MaltaDate of inspection:
20 Dec 2025Status:
alongside loadingTime aboard:
10 HoursDocuments provided:
Majority of documents provided

An ID Condition Inspection of the ATLANTIC MONACO (ex. Max Venture) was conducted on 20th December 2025 in Malta Freeport, Malta by Idwal under instruction from Sinokor Merchant Marine Co., Ltd.

The ATLANTIC MONACO is a 12,244 DWT, 10,609 GT, Singapore-flagged, geared Containership built by Anadolu Tuzla in Turkey under BV - Bureau Veritas supervision.

The keel was laid on 1-Oct-2006 and the vessel was delivered to market on 27-Feb-2008.

The vessel is currently Classed with Bureau Veritas.

The vessel is fitted with a MAN B&W 6S50MC-C main engine.

Good cooperation was provided by the ship's crew, with the majority of documents provided for review.

The vessel was alongside loading at the time of inspection.

The vessel was found to be in a good overall condition with an Inspected Idwal Grade above the industry average for vessels of a similar age, type and size but with several notable items found during the inspection. These are reported specifically in the notable items section of this report.

According to the information provided, the vessel's last Special Survey was carried out on 1-Jul-2023 with the next Special Survey due on 26-Feb-2028.

The vessel's Port State Control (PSC) history was found to be good to very good with 1 deficiency and 0 detentions in the 6 inspections conducted in the past 3 years.

According to the provided IMO DCS Statement of Compliance (SoC) for 2024, which was the latest provided, the vessel's Carbon Intensity Indicator (CII) score was 25.32 gCO₂/dwt.nm, which places the vessel in Band E for that Calendar year. In this regard, the Forthcoming Regulatory Compliance was graded as poor.

From 2024 onwards, any vessel that has an E rating in any year or D ratings for 3 consecutive years, is required to develop a corrective action plan in the SEEMP Part III which is required to be confirmed by the Flag Administration or Recognised Organisation (RO).


VESSEL PARTICULARS

Vessel name	Atlantic Monaco
Previous name	Max Venture
IMO number	9 3 5 6 6 5 8
Port of registry	Singapore
Ship type	Containership
Flag	Singapore
Classification society	Bureau Veritas
Registered owner	Silver Maritime Pte Ltd
Technical manager	Columbia Shipmanagement-Sng
Shipbuilder	Anadolu Tuzla
Delivery date	27-Feb-08
Dead weight	12,244.00 Mt
Gross tonnage	10,609.00 Mt
Net tonnage	4,844.00 Mt
Length overall	146.40 M
Breadth	22.60 M
Depth	11.30 M
Summer draught	8.25 M
TEU	1,022.00
Lightweight	5,644.00 Mt

GRADE COMPARISON

[Launch Benchmarking](#)

This section of the report allows you to compare your ship's grade with similar ships. The chart below shows the distribution of Idwal Grades against your vessels sector.

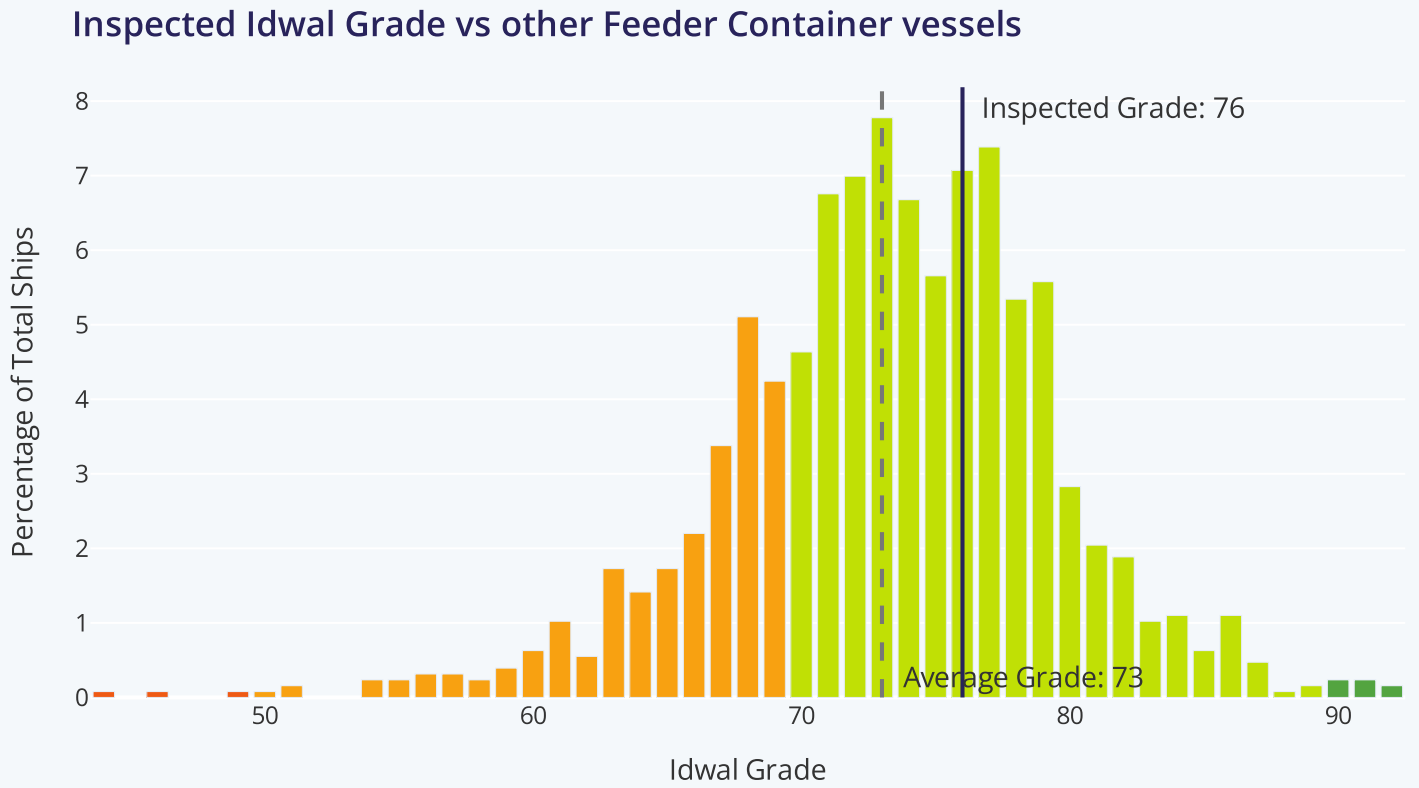

Key

Inspected Idwal Grade

Average Idwal Grade

Grade range

≥ 90

70 - 89

50 - 69

30 - 49


The ship's grade may appear different when compared with the average of the two graphs. This is as a result of the second graph comparing a smaller and more focused sample of ships.

For a more in-depth analysis of where your vessel compares amongst its peers, please contact your Idwal sales rep.

GRADE COMPARISON /

This section of the report allows you to compare your ship's grade with similar ships. The chart below shows the distribution of Idwal Grades against your vessels sector.

Inspected Idwal Grade vs other Feeder Container vessels, age 15-20 years

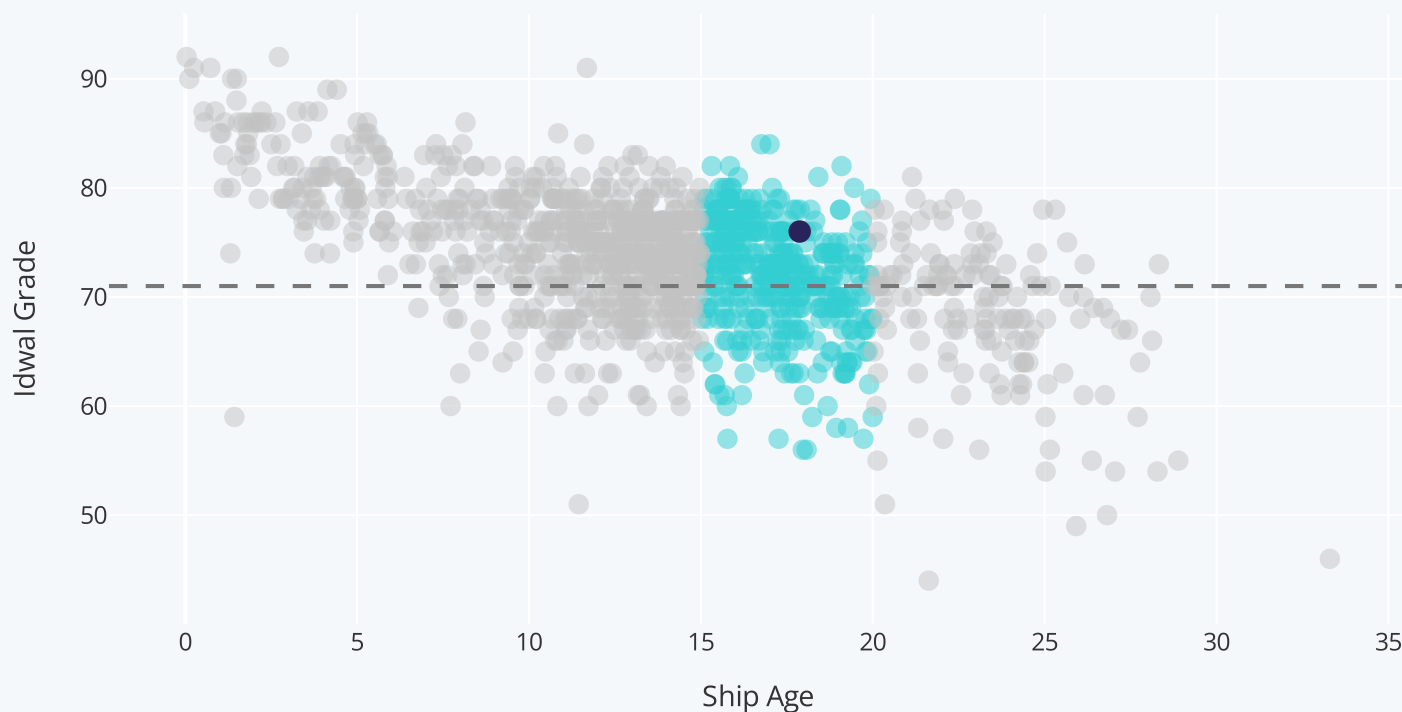

Key

Inspected Idwal Grade	Average Idwal Grade
All sector ships	Age comparable ships

The ship's grade may appear different when compared with the average of the two graphs. This is as a result of the second graph comparing a smaller and more focused sample of ships.

For a more in-depth analysis of where your vessel compares amongst its peers, please contact your Idwal sales rep.

GRADING DATA

[Launch Grading](#)

The Idwal Grade® is an industry recognised measure of asset integrity. Using proprietary algorithms, the Idwal Grade is programmatically calculated from over 500 individual data points, captured during a rigorous and standardised inspection process. Our data-driven methodology ensures that our reports are consistent, accurate and free from bias.

Sub-Grades

The methodology used to calculate the Idwal Grade® is also applied to the grading of the different vessel areas and categories. Two key areas are the overall vessel condition and vessel management:

Condition



Management



The following are grades representing individual areas of interest of the vessel:

⌘ Design and Construction



⌘ Hull



⌘ Mooring Decks



⌘ Weather Decks and Fittings



⌘ Ballast Tanks and Systems



⌘ Accommodation



⌘ Bridge and Navigation Equipment



⌘ Engine Room and Machinery



⌘ Fire Fighting Equipment and Systems



⌘ Lifesaving Appliances



⌘ Safe Working Environment



⌘ Pollution Control



⌘ Onboard Management



⌘ Vessel Capabilities and Cargo Systems



Forthcoming Regulatory Compliance



Crew Welfare



Crew Performance



Safety Management



Planned Maintenance System (PMS)



Classification and Certification



PSC Performance



DEFECTS LIST

[Launch Defects](#)

Priority	Grading area	Description	Recommendations
	Safe Working Environment	Defect ID: 4-135-587-840 Open hatch covers were seen with no temporary or fixed guard railings.	Temporary or fixed guard rails should be used when hatch covers are open, restricting the chances of possible harm.
	Safe Working Environment, Fire Fighting Equipment and Systems	Defect ID: 2-625-634-304 The paint store was seen with paint cans stored above the sprinkler heads, causing a safety hazard.	The maximum storage height red marker is to be applied to the area.
	Pollution Control	Defect ID: 4-177-661-959 The vessel was not found to be Vessel General Permit (VGP) compliant, as the vessels Stern Tube and Bow Thruster had no valid oil-to-water interface controls such as Environmentally Acceptable Lubricants (EALs) or an Airseal fitted.	Various upgrades and modifications may be required if the vessel wishes to trade in the USA.
	Ballast Tanks and Systems	Defect ID: 2-009-112-576 The ballast tanks were shown to have moderate scattered spot corrosion, up to approximately 10% of the ballast tanks' total surface area. The coating breakdown was mainly located around lightning holes, shell plating and frame edges.	Ballast tanks are to be fully appraised, and a repair and maintenance plan should be created for the forthcoming dry-docking.
	Engine Room and Machinery	Defect ID: 4-177-600-514 As per the provided documentation, the vessel was missing critical spares, such as Emergency air compressor gaskets and Emergency generator spares. However, most of these had been requested, and therefore did not affect the vessel's grade.	Ensure the vessel is equipped with all required critical spare parts.
	Vessel Capabilities and Cargo Systems	Defect ID: 4-181-897-217 The hatch covers were seen with moderate localised spot corrosion, up to approximately 5% of the surface area. The coating breakdown was mainly located on the top plates and around the rubber packing channels.	Crew remedial maintenance to be carried out.
	Mooring Decks, Safe Working Environment	Defect ID: 2-525-138-944 Mooring practices were seen not to be following the industry's safe practices. The winch clutch safety pins were seen missing.	Safety management system to be reviewed on best practices to be used during mooring and unmooring
	Engine Room and Machinery, Safe Working Environment	Defect ID: 2-709-659-648 Anti-splash tape was not seen to be in place at all required pipe connections.	To be rectified.

	Bridge and Navigation Equipment	Defect ID: 4-068-614-144 The Engine Power Limitation was not marked on the Pilot Card and wheel house poster.	To be rectified.
	Ballast Tanks and Systems	Defect ID: 88-174-592 It was also noted from the provided photographs, a crew repair of a crack was seen in the forepeak; it was unknown by the ship's crew whether this repair was notified to class.	Follow-up actions should be carried out to ensure class was informed of the repairs.
	Engine Room and Machinery	Defect ID: 2-730-631-168 A review of the supplied lube oil analysis reports showed the reduction gear enclosed gears sample was seen with an "attention" due to Iron and aluminium content.	Oil is still fit for purpose but requires further monitoring
	Safe Working Environment, Fire Fighting Equipment and Systems	Defect ID: 3-519-070-208 The engine space was not free of unauthorised 'hold-open' arrangements.	Safety management system to be reviewed.
	Engine Room and Machinery	Defect ID: 4-177-633-283 A review of the supplied lube oil analysis reports showed the steering gear was seen with an "attention" due to higher viscosity.	Oil is still fit for purpose but requires further monitoring
	Engine Room and Machinery	Defect ID: 4-177-768-449 The floor plating in the bow thruster room and engine space were loose and missing bolts.	Crew remedial maintenance to be carried out.
	Weather Decks and Fittings	Defect ID: 79-859-712 A review of the supplied lube oil analysis reports showed the provisions crane was seen with an "attention" due to the iron content.	Oil is still fit for purpose but requires further monitoring

DECARBONISATION SUMMARY

As per the International Energy Efficiency Certificate (IEEC) provided, the vessel's attained EEXI score is 23.9 gCO₂/tonne-miles within the required EEXI being 23.91 gCO₂/tonne-miles. As per the information provided, the Main Engine Power has been limited to 8000kW from the original 9480.0kW in order to ensure the attained EEXI is within the Required EEXI. Therefore, the vessel fully complies with the MEPC 76 amendments to MARPOL Annex VI regulations 23 and 25. According to the provided IMO DCS Statement of Compliance (SoC) for 2024, which was the latest provided, the vessel's Carbon Intensity Indicator (CII) score was 25.32 gCO₂/dwt.nm, which places the vessel in Band E for that Calendar year. In this regard, the Forthcoming Regulatory Compliance was graded as poor. From 2024 onwards, any vessel that has an E rating in any year or D ratings for 3 consecutive years, is required to develop a corrective action plan in the SEEMP Part III which is required to be confirmed by the Flag Administration or Recognised Organisation (RO).

Energy Efficiency Existing Ship Index (EEXI)

Required EEXI

23.91
gCO₂/t.nm

Calculated Attained EEDI/EEXI

23.90
gCO₂/t.nm

This vessel meets the required EEDI/EEXI

Carbon Intensity Indicator (CII)

Required CII

18.49
gCO₂/t.nm

Last Recorded CII (2024)

25.32
gCO₂/t.nm

Last Attained CII Band (2024)

E

GRADING REPORT

- ⌘ Design and Construction
- ⌘ Hull
- ⌘ Mooring Decks
- ⌘ Weather Decks and Fittings
- ⌘ Ballast Tanks and Systems
- ⌘ Accommodation
- ⌘ Bridge and Navigation Equipment
- ⌘ Engine Room and Machinery
- ⌘ Fire Fighting Equipment and Systems
- ⌘ Lifesaving Appliances
- ⌘ Safe Working Environment
- ⌘ Pollution Control
- ⌘ Onboard Management
- ⌘ Vessel Capabilities and Cargo Systems

GRADING REPORT/

DESIGN AND CONSTRUCTION



[Review Technical Report](#)

The construction and design were found to be good overall. The vessel was built to IACS standards and Rules in Turkey by Anadolu Tuzla with the keel laid on 1-Jun-2006. The vessel is a Containership, with 4 holds, driven by a controllable pitch propeller. The Main Engine is a NOx Tier 1, MAN B&W, and the vessel has 3 Auxiliary Engines, and a shaft generator. It is not on the Enhanced Survey Program or Extended Dry Docking schedule, but does hold a Class notation for In-Water Surveys. 2 Cargo Lifting Appliances are fitted. No UTM report was made available for review. Apart from the equipment required by international rules and regulations, the bridge is also fitted with enclosed bridge wings and differential-GPS. The engine room and machinery are fitted with inverter drives for the steering gear unit, engine power limiter, incinerator sludge burning system, UMS capabilities, 2-stroke engine adaptive lubricator, centralised seawater cooling and dual air handling unit refrigeration compressors.

Defects

No defects

Positive items

Description



Positive ID: 2-357-317-635

The engine space was fitted with inverter drives for the steering gear unit.



GRADING REPORT/

HULL



[Review Technical Report](#)

The hull was seen to be in good overall condition. The hull inspection was only possible from the starboard side. The hull was free of both major and minor structural defects. The hull was seen with only minor localised spot corrosion, up to approximately 5% of the surface area. The coating breakdown was mainly located on the upper antifouling area and stern plating. Hull markings were well-painted and legible, with minor marine fouling observed. The vessel's last out-of-water bottom survey was carried out on 13-Jun-2023, with the vessel's next out-of-water bottom survey due by 13-Jun-2026.

Defects

No defects

The mooring decks were seen to be in a good condition overall. The mooring decks were found to be free of structural defects and had only minor scattered spot corrosion, up to approximately 5% of the mooring deck plating total surface area. The coating breakdown was mainly located on the main walkways and around the base of fittings. Deck fittings were found to be in good condition, with fairleads and mooring rollers free to turn when tested. All electric windlasses and winches were reported to be fully operational. Mooring machinery was in generally good condition, with the band brake linings seen to have satisfactory thicknesses. Anchor chains and mooring ropes were in a good overall condition. Mooring practices were seen not to be following the industry's safe practices. The winch clutch safety pins were seen missing. Snap-back zone warnings were seen to be posted at the entrances to mooring areas as per industry best practice. The Bosun's store was found to be in good structural condition with no visible damage sighted or reported and with coatings fully intact with no significant corrosion or coating breakdown. Housekeeping was good, with all items neat and secured. The bitter end release arrangements were seen to be clear and unobstructed and the emergency towing booklet seen to be available near to the Foc'sle.

Defects

Priority	Description	Recommendations
----------	-------------	-----------------



Defect ID: 2-525-138-944
Mooring practices were seen not to be following the industry's safe practices. The winch clutch safety pins were seen missing.

Safety management system to be reviewed on best practices to be used during mooring and unmooring



GRADING REPORT/

WEATHER DECKS AND FITTINGS



[Review Technical Report](#)

The Weather Decks and Fittings were in good condition overall. The weather deck was found to be free of structural defects and displaying only minor localised spot corrosion. This corrosion affected approximately 5% of the main deck plating's total surface area, primarily located on main walkways and around the base of coaming supports. Deck fittings were in good condition, with pipework and fittings free of leakages. The accommodation ladders, gangways, and provisions lifting appliances were all in good overall condition, with no notable defects found.

Defects

Priority	Description	Recommendations
	Defect ID: 79-859-712 A review of the supplied lube oil analysis reports showed the provisions crane was seen with an "attention" due to the iron content.	Oil is still fit for purpose but requires further monitoring

GRADING REPORT/

BALLAST TANKS AND SYSTEMS



Review Technical Report

The Ballast Tanks and Systems were in fair to good condition overall. The ballast tanks were shown to have moderate scattered spot corrosion, up to approximately 10% of the ballast tanks' total surface area. The coating breakdown was mainly located around lightning holes, shell plating and frame edges. It was also noted from the provided photographs, a crew repair of a crack was seen in the forepeak; it was unknown by the ship's crew whether this repair was notified to class. Follow-up actions should be carried out to ensure the class was informed of the repairs. No ballast tanks were accessed during the inspection due to the reasons detailed below. Therefore, this section has been graded based on vessels of a similar age, type and size, along with any provided information by the vessel or relevant party. Ballast tanks could not be entered due to terminal/port restrictions. Photographs of previous tank entries reportedly taken on 7-Feb-2025 were provided for review. Although a satisfactory number of photographs were provided, as no entry was possible into the ballast tanks, an independent condition assessment of the tanks was not possible at the time of inspection, and the following assessments are based on the photographs provided by the vessel or relevant party. As far as can be seen in the photographs provided, no significant structural defects were pictured. In the provided photographs, ballast tank fittings such as ladders and pipework are shown to be in a good overall condition. In the provided photographs, tanks are shown with a minimal amount of mud/sediment accumulation but were free of any signs of staining from sewage or marine fouling. Ballast control systems, such as valves and gauges, were reported to be fully operational, and all ballast pumps were in good working order and in good visual condition.

Defects

Priority	Description	Recommendations
	Defect ID: 2-009-112-576 The ballast tanks were shown to have moderate scattered spot corrosion, up to approximately 10% of the ballast tanks' total surface area. The coating breakdown was mainly located around lightning holes, shell plating and frame edges.	Ballast tanks are to be fully appraised, and a repair and maintenance plan should be created for the forthcoming dry-docking.
	Defect ID: 88-174-592 It was also noted from the provided photographs, a crew repair of a crack was seen in the forepeak; it was unknown by the ship's crew whether this repair was notified to class.	Follow-up actions should be carried out to ensure class was informed of the repairs.

GRADING REPORT/

ACCOMMODATION



[Review Technical Report](#)

The accommodation areas were in good condition overall. The floor and wall coverings were in good condition. The upholstery and furniture were free from deterioration and defects. Housekeeping and cleanliness levels were good, with hygiene levels also good in the sanitary facilities. The hospital was well equipped and ready for use, with drugs controlled and secured, and the associated drugs log kept up to date. The accommodation was outfitted to an average quality. The Air Handling Unit (AHU) was maintaining a comfortable temperature and was in good condition with no defects. The galley equipment was in good overall condition, with all equipment reportedly in good working order. The galley was clean, with the galley hoods also kept clean. The vessel's walk-in cold rooms were clean and hygienic with temperatures at the required levels. Provision room components were generally free of frosting and deterioration. The external superstructure was free of structural defects, coating breakdown and corrosion. External superstructure fittings such as lighting, vent heads, windows/portholes, stairways, railings, etc. were in good overall condition, with all external accommodation doors in good working order and properly closing. The vessel's Crew Welfare was found to be good overall. The average contract length was reported to be 4 months for the vessel's Officers and 6 months for the vessel's crew, with a crew suggestion policy in place. The vessel had free-to-access and unlimited-use Wi-Fi onboard, available to all crew. The approximate average internet speed was fast, indicating the crew could stream music or short videos in low quality. The vessel had various pieces of public recreational equipment that the crew could access, including free weights, fixed weight machine, cycling machine, television, games console, musical instruments, barbecue, public computer and en-suite facilities for all crew members. This equipment was in good overall condition. As per crew reports, access is provided to catering facilities at all times. Crew were also given additional time and resources to celebrate religious and cultural events, such as Christmas or Independence days. Various facilities were provided in all crew cabins, including a sofa, a desk, and ample storage. The crew have access to a well-stocked bond store. The vessel has onboard training facilities. Additional periods of rest were given throughout the working week, as per crew reports.

Defects

No defects

Positive items

Description	
	Positive ID: 2-357-358-593 The vessel is reportedly fitted with free to access unlimited use Wi-Fi system

GRADING REPORT/

BRIDGE AND NAVIGATION EQUIPMENT

Review Technical Report

The Bridge and navigation equipment were found to be in good condition overall. The Engine Power Limitation was not marked on the Pilot Card and wheel house poster. The housekeeping was assessed as good, and all bridge equipment was reported as fully operational. The vessel's VDR was free from any unanticipated alarms with collection instructions posted nearby, and the Bridge Navigation Watch Alarm System (BNWAS) was reported to be fully operational. The vessel's primary means of navigation, as listed on form E of the safety equipment certificate, is a dual ECDIS system, which was found to be up to date. An in-date compass deviation card was posted near to the helm and the compass deviation log was well maintained without any major deviations. The vessel is licensed to cover GMDSS sea areas A1, A2, and A3 and had a valid shore-servicing agreement in place. The radio batteries were well maintained and in good condition, and the EPIRB, SART and VHF handheld batteries were all in date as required. Berth-to-berth passage plans were available on board and were signed by all navigating officers, with nautical publications provided in paper and electronic format. Master's standing and night orders were signed by all navigating officers, with the bridge log book correctly filled in and the GMDSS logbook also up to date and properly completed. The Monkey island was in good overall condition with the mast, aerials and antennas found to be satisfactory and free of defects.


Defects

Priority	Description	Recommendations
----------	-------------	-----------------



Defect ID: 4-068-614-144
The Engine Power Limitation was not marked on the Pilot Card and wheel house poster.

To be rectified.

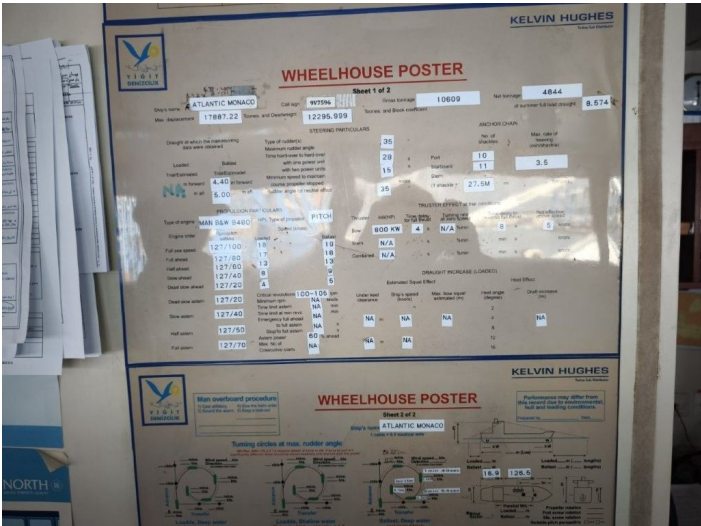

GRADING REPORT/

ENGINE ROOM AND MACHINERY



Review Technical Report

The Engine room and machinery were found to be in a good overall condition. A review of the supplied lube oil analysis reports showed the provisions crane was seen with an "attention" due to the iron content. A review of the supplied lube oil analysis reports showed the reduction gear enclosed gears sample was seen with an "attention" due to Iron and aluminium content. A review of the supplied lube oil analysis reports showed the steering gear was seen with an "attention" due to higher viscosity. As per the provided documentation, the vessel was missing critical spares, such as Emergency air compressor gaskets and Emergency generator spares. However, most of these had been requested, and therefore did not affect the vessel's grade. The floor plating in the bow thruster room and engine space were loose and missing bolts. No other significant defects were reported or observed. The general levels of housekeeping and cleanliness in the engine room were found to be good. During the inspection, the auxiliary engines, purifiers, pumps, air compressors, sewage treatment plant, auxiliary boiler, refrigeration compressor and air conditioning compressor were seen running. A review of the supplied scavenge space inspection reports showed no areas of concern. The supplied maximum cylinder liner wear measurements showed all readings to be within maker limits. A review of the supplied main engine running hours showed that cylinder liners are reportedly subject to Condition Based Monitoring (CBM) and that cylinder heads, pistons, bearings, turbocharger running hours were within their specified overhaul intervals. Upon review of the latest main engine performance report, it was noted that there were no areas of concern. Propulsion systems, such as shafting arrangements, were in good working condition. As per the memo reported in the BV Class status report, the bow thruster was reported to be out of operation. The vessel is fitted with 3 auxiliary engines, which were all reported to be fully operational and were seen to be in good condition with no major visible defects. A review of the supplied auxiliary engines' running hours showed no areas of concern. Upon review of the latest auxiliary engine performance reports, it was noted that, as per the data provided, the load wasn't sufficient to get an accurate test result. It is recommended to conduct the test with at least 70% load on the engines. The vessel's thermal oil boiler was found to be fully operational and in good overall condition. The steering gear was in good working order and free of leakages. All auxiliary machinery and equipment were reported to be fully operational and were observed in good visual condition. The engine room structure, including bulkheads and frames, was seen to be in good condition. However, engine room fittings such as handrails, ladders, floor plates and lighting were found in a fair condition. Engine room pipework was seen to be generally free of significant corrosion and free from leakages. Pipework was free of any temporary repairs, including soft patches. Pipework insulation lagging was seen with some areas of deterioration and staining. Anti-splash tape was not seen to be in place at all required pipe connections. Bilge alarms were found to be fully operational during testing. All Engine Control Room automation and monitoring systems were found to be fully operational and with no serious active alarms present. No concerning engine room control system alarms were seen on the manually blocked/disabled alarm list. The engine room Deadman, and engineer call alarms were found to be fully operational during testing. According to the provided information, the vessel was found not to be equipped with all the required critical spares as recommended by the Safety Management System (SMS). However, the majority of missing spares had been requisitioned. The supplied fuel oil analysis reports showed no alerts or abnormal findings. Engine room documentation such as the engine room log book, standing orders, NOx technical file etc. were reviewed and found to be well-maintained and up to date. All machinery and equipment manuals were reported to be available onboard. Package air conditioning units around the vessel were all operational and in good condition. Electrical distribution systems, including the main and emergency switchboards, were in good working order, with all insulation readings seen to be adequate. Recent Megger test reports were seen with no abnormal findings. The emergency generator was tested during the inspection and found to be in good working order and was in good overall condition.

Defects


Priority	Description	Recommendations
	Defect ID: 4-177-600-514 As per the provided documentation, the vessel was missing critical spares, such as Emergency air compressor gaskets and Emergency generator spares. However, most of these had been requested, and therefore did not affect the vessel's grade.	Ensure the vessel is equipped with all required critical spare parts.



Defect ID: 2-709-659-648

Anti-splash tape was not seen to be in place at all required pipe connections.

To be rectified.

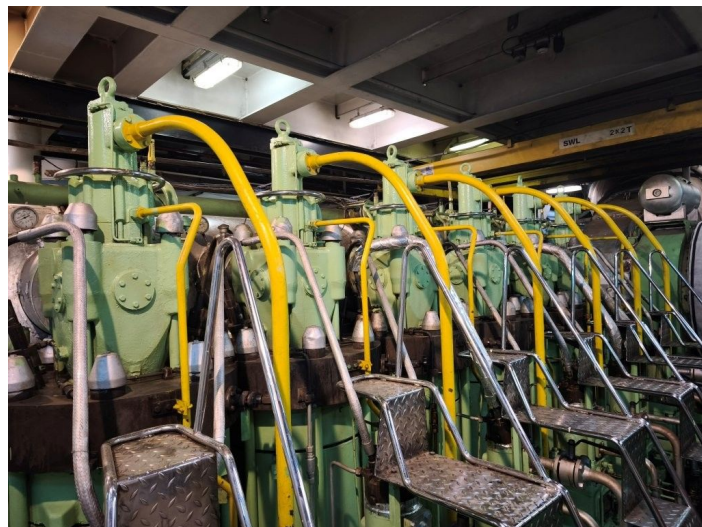

Defect ID: 2-730-631-168

A review of the supplied lube oil analysis reports showed the reduction gear enclosed gears sample was seen with an "attention" due to Iron and aluminium content.

Oil is still fit for purpose but requires further monitoring



Defect ID: 4-177-633-283

A review of the supplied lube oil analysis reports showed the steering gear was seen with an "attention" due to higher viscosity.


Oil is still fit for purpose but requires further monitoring



Defect ID: 4-177-768-449

The floor plating in the bow thruster room and engine space were loose and missing bolts.

Crew remedial maintenance to be carried out.

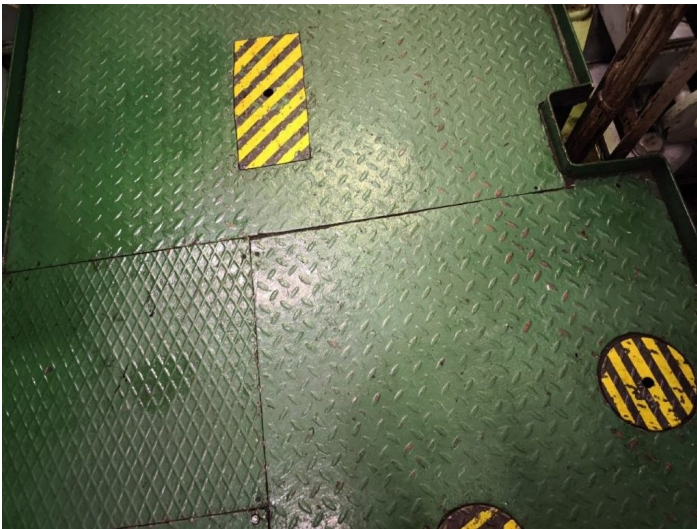

Positive items

Description	
	Positive ID: 2-651-004-928 The engine room and machinery are fitted with inverter drives for the steering gear unit, engine power limiter, incinerator sludge burning system, UMS capabilities, 2-stroke engine adaptive lubricator, centralised seawater cooling and dual air handling unit refrigeration compressors.

GRADING REPORT/

FIRE FIGHTING EQUIPMENT AND SYSTEMS

Review Technical Report

Fire-fighting equipment and Systems were in good condition overall. The vessel was generally free of fire hazards, with all firefighting equipment regularly serviced and inspected. The fire detection and alarm system was fully operational and free of signs of tampering and alarms. The vessel is fitted with CO2 and Water Spray fixed firefighting in the engine room, CO2 for the cargo areas and Galley CO2 in the accommodation. Fixed firefighting systems were all reported to be in good working condition with operating instructions clearly posted. The main and emergency fire pumps were reportedly fully operational, and both were in good condition, free of leakages. A fire pump was tested during the inspection and delivered adequate pressure. The fire main and ancillaries, such as hydrants and valves, were in good overall condition, free of defects. Fire extinguishers were all in good condition, and all portable equipment was positioned in accordance with the fire plan. Firefighting outfits and associated equipment were all in good condition, with BA equipment fully charged and ready for use. Remote shutdown emergency devices, such as quick closing valves, machinery stops and ventilation dampers, were in good overall condition with no defective shutdown equipment. The fire doors were in good condition, closing effectively; however, were not free of unauthorised 'hold-open' arrangements.

Defects

Priority	Description	Recommendations
----------	-------------	-----------------




Defect ID: 2-625-634-304
The paint store was seen with paint cans stored above the sprinkler heads, causing a safety hazard.

The maximum storage height red marker is to be applied to the area.



Defect ID: 3-519-070-208
The engine space was not free of unauthorised 'hold-open' arrangements.

Safety management system to be reviewed.

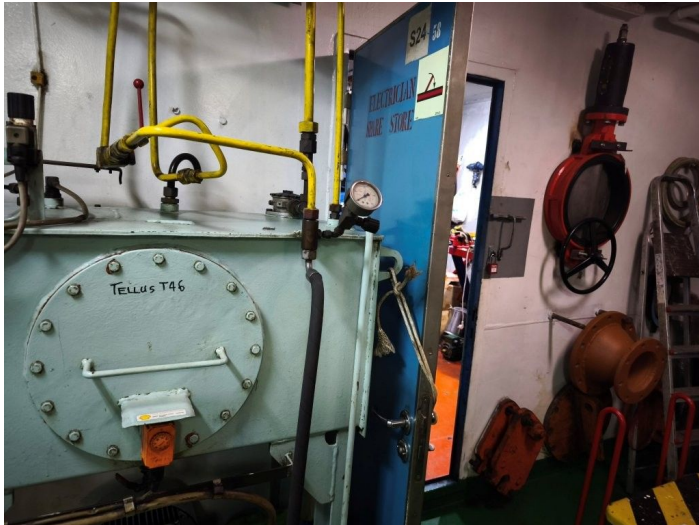

GRADING REPORT/

LIFESAVING APPLIANCES



[Review Technical Report](#)

Lifesaving appliances were seen to be in a good overall condition. All equipment was regularly serviced and inspected as required. The vessel is fitted with 1 free-fall lifeboat, which was seen to be in good overall condition externally and internally. The lifeboat engine was tested during the inspection and found to be in good working order. The vessel's rescue boat was found to be in a good overall condition and ready for immediate use. The vessel is equipped with 3 life rafts, which were found to be in good condition with Hydrostatic Release Units (HRUs) in date and correctly rigged. Davits and lowering arrangements were found to be in good condition overall, with evidence of regular maintenance, servicing and inspection sighted and evident. Ancillary lifesaving equipment such as lifejackets, immersion suits and EEBD's etc., were found to be in good condition and ready for immediate use, with man overboard smoke and light signals seen to be in date. Embarkation ladders were found to be in a good, well-maintained condition, with the pyrotechnics and line-throwing apparatus found to be stored appropriately and within their expiry dates.

Defects

No defects

GRADING REPORT/



SAFE WORKING ENVIRONMENT


[Review Technical Report](#)

Safe working was deemed to be fair overall. Open hatch covers were seen with no temporary or fixed guard railings. The paint store was seen with paint cans stored above the sprinkler heads, causing a safety hazard. The maximum storage height red marker is to be applied to the area. Mooring practices were seen not to be following the industry's safe practices. The winch clutch safety pins were seen missing. Anti-splash tape was not seen to be in place at all required pipe connections. The engine space was not free of unauthorised 'hold-open' arrangements. Multiple safety defects were noted, indicating breaches in the safety management system. In this regard, the Safety Management was graded as fair. It was noted that the cross-deck areas were seen without light fittings; to increase safety, illumination methods should be considered. Hazards were seen to be clearly marked and external walkways adequately coated with non-slip paint and free of trip hazards. Adequate PPE was seen to be worn by the crew at all times, and portable gas detection meters were provided and calibrated. Hazardous substances were seen to be generally safely managed with appropriate Material Safety Data Sheets provided. Risk Assessments (RA) were seen to be up to date and satisfactory, with enclosed space entry procedures followed and an effective Permit To Work (PTW) system in place. Main and emergency exits were clearly identified and unobstructed, with all IMO signage seen to be satisfactory. The pilot ladder was seen to be in good condition and was secured in a safe manner. Regular drills were conducted on board, with the last drill conducted on the 12-Dec-2025, which was a Launching Dedicated Rescue Boat drill.

Defects

Priority	Description	Recommendations
	Defect ID: 4-135-587-840 Open hatch covers were seen with no temporary or fixed guard railings.	Temporary or fixed guard rails should be used when hatch covers are open, restricting the chances of possible harm.

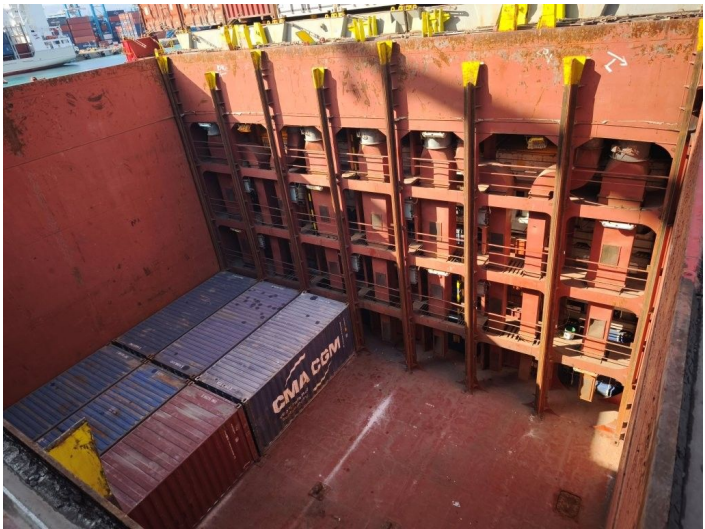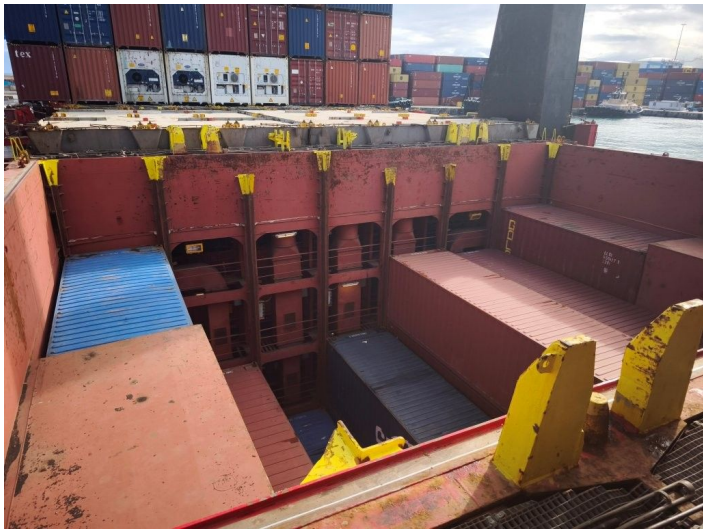

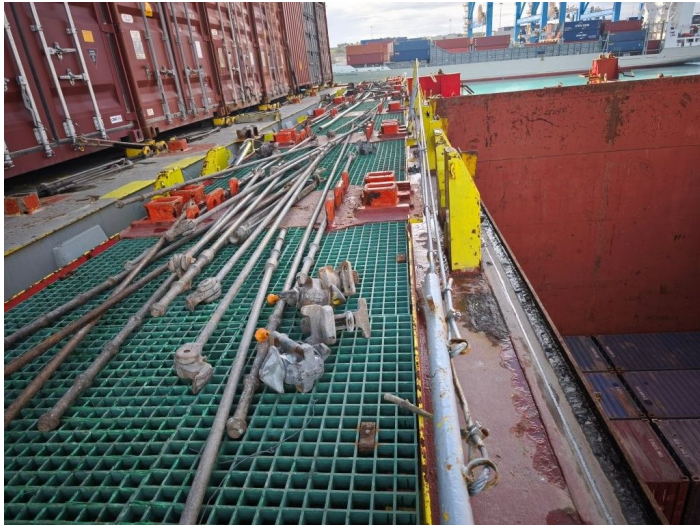

Defect ID: 2-625-634-304

The paint store was seen with paint cans stored above the sprinkler heads, causing a safety hazard.

The maximum storage height red marker is to be applied to the area.



Defect ID: 2-525-138-944

Mooring practices were seen not to be following the industry's safe practices. The winch clutch safety pins were seen missing.


Safety management system to be reviewed on best practices to be used during mooring and unmooring



Defect ID: 2-709-659-648

Anti-splash tape was not seen to be in place at all required pipe connections.

To be rectified.

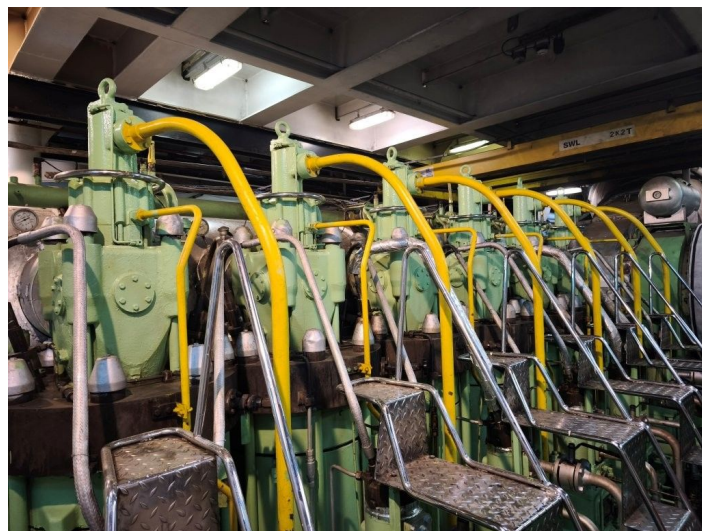




Defect ID: 3-519-070-208

The engine space was not free of unauthorised 'hold-open' arrangements.

Safety management system to be reviewed.

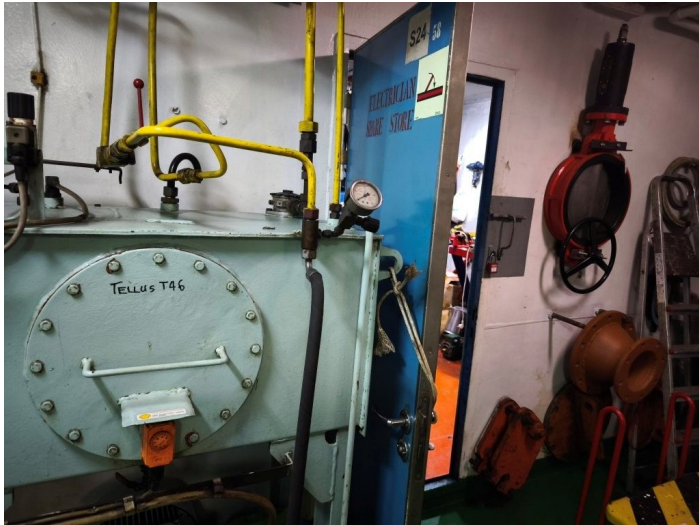

GRADING REPORT/

POLLUTION CONTROL

80

[Review Technical Report](#)

Pollution control was deemed to be good overall. The pollution control was generally found to be well implemented on board, with the vessel free of pollution hazards. The vessel holds a Class-approved Inventory of Hazardous Materials, which is required for entry into EU ports. The vessel's Oily Water Separator (OWS) was found to be fully operational and in good overall condition, with no obvious defects. The OWS was simulation tested during the inspection, and the 15ppm Oil Content Meter (OCM) was seen to be calibrated. The bilge overboard was seen to be sealed and locked against unauthorised opening, and the oily water treatment system as a whole was seen to be free from signs of tampering or unauthorised modification. The SOPEP locker or box was found to be well stocked with SOPEP equipment in good condition, and an accurate list of equipment was posted nearby. The Oil Record Book (ORB) was seen to be well-maintained and up-to-date, with the last entry on the 14-Dec-2025. It was reported that a US Coast Guard-approved Ballast Water Treatment System (BWTS) is fitted, which was reported to be fully operational and in good overall condition. The vessel's ballast record book was seen to be up to date and correctly filled in. The vessel was not found to be Vessel General Permit (VGP) compliant, as the vessel had no valid oil-to-water interface controls, such as Environmentally Acceptable Lubricants (EALs) or an Airseal. The vessel's sewage treatment plant was found to be fully operational and in good overall condition, with no obvious defects. Garbage segregation was found to be good, with adequate, labelled containers and garbage was seen to be well sorted and containers were seen to be made of approved non-combustible materials. The Garbage Record Book (GRB) was seen to be well-maintained and up-to-date, with the last entry on the 20-Dec-2025. The Emission Control Area (ECA) change-over logbook was reviewed and found to be satisfactory, with the date of last entry on 5-Sep-2024. The vessel's incinerator was found to be fully operational and in good overall condition, with no obvious defects. The vessel complies with IMO 2020 regulations by employing the use of Very Low Sulphur Fuels Oils (VLSFO) with a sulphur content of less than 0.5%.

Defects

Priority	Description	Recommendations
	Defect ID: 4-177-661-959 The vessel was not found to be Vessel General Permit (VGP) compliant, as the vessels Stern Tube and Bow Thruster had no valid oil-to-water interface controls such as Environmentally Acceptable Lubricants (EALs) or an Airseal fitted.	Various upgrades and modifications may be required if the vessel wishes to trade in the USA.

Positive items

Description

- ✓

Positive ID: 2-357-411-840

It was reported that a USCG approved BWTS is installed



GRADING REPORT/

ONBOARD MANAGEMENT



[Review Technical Report](#)

Onboard management was found to be good overall. The computer-based Safety Management System (SMS) was deemed to be functioning and well implemented in general, with Permits to Work (PTW), risk assessments and procedures understood and followed. Onboard management dealt with accidents, near misses and deficiencies in an effective manner and regular safety committee meetings were carried out on board. The vessel's MLC certificate was valid with records of hours of rest (ILO) correct and up to date, and maximum work hours not regularly exceeded. The PMS system was kept up to date with no critical overdue work orders. The type-approved software-based Planned Maintenance System (PMS) was fully integrated with the SMS for ordering of spares and general vessel management. The Port State Control (PSC) history was found to be good to very good, with 1 deficiency and 0 detentions in the 6 inspections conducted in the past 3 years. The vessel's flag is not targeted by any Memorandum of Understanding (MoU) or the USCG. Security access controls were deemed to be satisfactory, with the vessel conforming to International Ship and Port Security (ISPS) standards. The Master and crew were prepared for the inspection and provided good cooperation with the majority of the requested documents provided.

Defects

No defects

GRADING REPORT/

VESSEL CAPABILITIES AND CARGO SYSTEMS


80

 Review Technical Report

Vessel capabilities and cargo systems were deemed to be in a good overall condition. The hatch covers were seen with moderate localised spot corrosion, up to approximately 5% of the surface area. The coating breakdown was mainly located on the top plates and around the rubber packing channels. The No.3 cargo hold was entered for inspection, and photographs of hold entries in 25-Apr-2025 were provided for review. Inspection reports were also provided for review. From the photographs provided, it was seen that the cargo hold structural members were found to be free of damage and had only minor scattered spot corrosion, up to approximately 10% of the surface area. The coating breakdown was mainly located on the tank tops and the upper area of the bulkheads. Cell guides were free of damage and deformation. Cargo hold fittings such as ladders, handrail, ventilation ducts, light fixtures and pipe guards etc. were seen to be generally free of damage, and all cargo monitoring systems were fully operational. The cargo holds were free of signs of water ingress, both from internal and external sources. Mechanical ventilation systems were in good working order. The vessel is fitted with pontoon hatch covers. Hatch covers were found to be free of structural defects. Hatch cover rubber seals and retaining channels were in good overall condition. Hatch coamings were found to be free of structural defects and had only minor localised spot corrosion, up to approximately 5% of the surface area. The coating breakdown was mainly located on the table top section. Compression bars/strips were seen to be in good condition with hatch coaming drain channels free of corrosion, scaling and debris and the hatch coaming non-return valves clear and operational. Cargo securing fittings such as container sockets, pad-eyes and D-rings etc. were in good condition. Cargo securing equipment was plentiful, with inspection records maintained, and securing equipment in good condition as observed. Stability calculations were seen to be carried out, and the vessel holds a Document of Compliance (DOC) for the carriage of Dangerous Goods (DG). The vessel is equipped to carry 314 Reefer containers whose temperatures were effectively monitored. Reefer sockets were seen in good condition with switchboards free of low insulation or earth faults. The vessel uses its own power for all Reefer containers, without the need for an additional auxiliary power unit. The vessel has 2 cargo lifting appliances, which were found to be in a good overall condition. Cargo lifting appliances were seen in operation, and all were reported to be fully operational. Cargo lifting appliance No.1 was available for internal inspection. Lifting appliances were found to be generally free of significant structural defects and had only minor localised spot corrosion, up to approximately 5% of the surface area. The coating breakdown was mainly located on the pedestal. Wires were in good overall condition as were motors and hydraulic systems, which were free of defects and leaks. Lifting appliance components, such as sheaves, blocks and cylinders, were seen to be in a good overall condition, with controls and operating positions in good condition and safety devices fully operational. The slewing bearings were found to be in a good overall condition, though no evidence of bearing rocking tests was provided for review. Lifting appliances were regularly examined by shore-side technicians, with maintenance records accurate and up-to-date.

Defects

Priority	Description	Recommendations
	Defect ID: 4-181-897-217 The hatch covers were seen with moderate localised spot corrosion, up to approximately 5% of the surface area. The coating breakdown was mainly located on the top plates and around the rubber packing channels.	Crew remedial maintenance to be carried out.

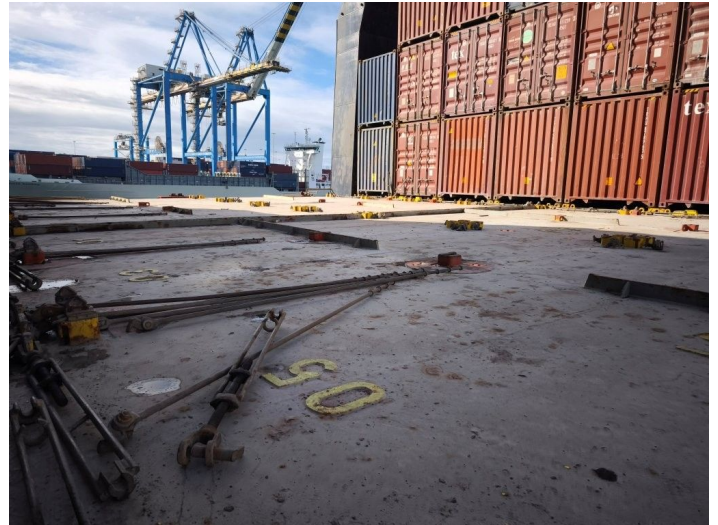

OPERATIONAL DATA

Operational Data Condition

Does the vessel have an Exhaust Gas Cleaning System (EGCS)?	No
Total High Sulphur Fuel Oil (HSFO) capacity:	0 m ³
Total Very and Ultra Low Sulphur Fuel Oil (VLSFO and ULSFO) capacity:	1632 m ³
Total Marine Gas Oil (MGO) and Diesel Oil (DO) capacity:	341 m ³
Does the vessel have any energy efficiency technologies installed?	Yes

Engines Table

	Main Engine 1	Main Engine 2	Aux Engine 1	Aux Engine 2	Aux Engine 3	Aux Engine 4
Designer	MAN B&W	N/A	Yanmar	Yanmar	Yanmar	
Model	MC-C		6N21AL-E	6N21AL-E	6N21AL-E	
Original Power (MCR)	9480		970	970	970	
Power (MCR lim) (if applicable)	8000					
Number of Cylinders	6		6	6	6	
Speed (RPM)	127		900	900	900	
Bore (mm)	500		210	210	210	
Stroke (mm)	2000		290	290	290	
Specific Fuel Oil Consumption (SFOC) (g/kWhr) At 75% load for ME and 50% load for AEs, corrected to ISO conditions, as stated on Nox technical files	176.8		176.8	176.8	176.8	
Nox Tier	1		1	1	1	
Cylinder Oil Consumption (litres/day)	215					
System Oil Consumption (litres/day)	15		3.0	3.0	3.0	
Total Running Hours (Hours)	56446		43769	53833	41850	
Major Overhaul			12000	12000	12000	

Interval (Hours)						
Running Hours since last overhaul (Hours)			3898	9475	9054	

Main Engine Maintenance

Component	Condition Based Monitoring?	Overhaul Interval
Cylinder Heads		12000
Pistons		8000
Bearings		12000
Cylinder Liners	Yes	32000
Turbocharger(s)		24000

Main Engine No.1	Unit Running Hours											
Component	1	2	3	4	5	6	7	8	9	10	11	12
Cylinder Heads	6994	4783	2140	3631	2420	1833						
Pistons	6994	6994	1470	3631	2420	6994						
Bearings	5554	5554	5554	5554	5554	5554						
Cylinder Liners	6994	6994	7382	3631	6994	6994						
Turbocharger(s)	6994											
Was there any overdue maintenance for any main/auxiliary engine ancillaries (exhaust valves, fuel pumps, fuel injectors etc.)?	No											

Main Engine

	Vessel Speed (knots)	Consumption (t/day)
Loaded Eco	12.0	19.5
Loaded Service	16.0	30.0
Ballast Eco	12.0	17.5

Ballast Service	16.0	28.0
Full Load	17.0	33.0

Auxiliary Engines (t/day)

At Sea	2.0
In Port	2.0

Boiler (t/day)

At Sea	1.5
In Port (Idle)	1.5

Class Surveys

Were all Class and Statutory certificates valid?	Yes
Is the vessel on the Extended Dry Docking (EDD) program?	No
Is the vessel on the Enhanced Survey Program (ESP)?	No
Does the vessel have an In Water Survey Class notation?	Yes
Is the vessel ice classed?	No

Survey	Date Last Completed	Date Next Due
Main / Special / Renewal	01-Jul-23	26-Feb-28
Intermediate		26-Feb-26
Annual	09-Apr-25	26-Feb-27
Bottom in dry dock	13-Jun-23	13-Jun-26

What was the location of the last out-of-water docking?	Carell S.A, Greece
Is the vessels last dry dock report provided and attached?	Yes

Has the vessel remained with the same flag since build?	No		
Please provide further details	Liberia since 01/12/2018, Malta since 01/12/2015 and also Germany since 01/12/2015		
Has the vessel remained with the same Class since build?	Yes		
In total, how many of the following does the vessel have?	0		
Conditions of Class, Recommendations of Class, Statutory Findings, Statutory Items, Conditions of Authority, etc.	Description	Area	Due Date
Does the vessel have any Class Memos, Observations or Additional Requirements?	Yes		
Please provide further details	Main engine crankshaft main journal n° 1 reduced in diameter from 600 mm to 588.5 mm. 03 Feb 2020 Bow thruster is out of operation. 28 Jan 2022 Indent on webframe with max deep approx 20mm located at STBD Fr 155 between L2 and L3, iwo passage way found acceptable. 28 Jan 2022 Indent on shell plate at STBD between fr 152 - 153 between L2 and L3, iwo passage way found acceptable. 28 Jan 2022 Indent on webframe loacted at STBD fr 156 between L2 and L3, iwo passageway found acceptable		
What was the status of the vessel at the time of inspection?	alongside loading		

TECHNICAL REPORT

- ⌘ Design and Construction
- ⌘ Hull
- ⌘ Mooring Decks
- ⌘ Weather Decks and Fittings
- ⌘ Ballast Tanks and Systems
- ⌘ Accommodation
- ⌘ Bridge and Navigation Equipment
- ⌘ Engine Room and Machinery
- ⌘ Fire Fighting Equipment and Systems
- ⌘ Lifesaving Appliances
- ⌘ Safe Working Environment
- ⌘ Pollution Control
- ⌘ Onboard Management
- ⌘ Vessel Capabilities and Cargo Systems
- ⌘ Cargo Lifting Appliances

TECHNICAL REPORT/

DESIGN AND CONSTRUCTION

Review Grading Report

Design and Construction Condition

Has the vessel been built to the standards and Rules of an IACS-member Class Society?	Yes
Under what IACS Class society supervision was the vessel built?	BV – Bureau Veritas
Did the vessel provide Ultrasonic Thickness Measurement (UTM) reports?	No, not available

Bridge & Communication

Feature seen on the bridge	Enclosed Bridge Wings
Feature seen on the bridge Notes:	Differential-GPS
	JRC / NWZ-4570

Engine Room & Firefighting

Feature seen in the engine room Notes:	Inverter drives for pumps and fan motors
	2 inverter drives for steering gear pumps
Feature seen in the engine room What is the new maximum power of the Main Engine as limited by the EPL? (kW) Notes:	Engine Power Limiter (EPL)
	8000
	Type: MAN OPL Alphatronic, Maker: MAN Energy solutions
Feature seen in the engine room Notes:	Incinerator sludge burning system
	TEAMTEC Type G200C 14824-01
Feature seen in the engine room Notes:	UMS Capabilities (regardless of Class notation)
	Class notation AUT-UMS included

Feature seen in the engine room	2-Stroke Engine Adaptive Cylinder Oil Control e.g. MAN B&W Alpha Lubricator
	Notes: Alpha lubricator is available
Feature seen in the engine room	Centralised Sea Water cooling
	Notes: manufacture: SONDEX A/S
Feature seen in the engine room	Dual Air Handling Unit Refrigeration compressors
	Notes: Available for both heating and cooling

TECHNICAL REPORT/

HULL

 Review Grading Report

Hull Condition

What sections of the hull were inspected?	Stbd side
Was the vessel free of any major structural damage or indentations?	Yes
Was the vessel free of any minor structural damage or indentations?	Yes
What was the level of Hull coating breakdown and corrosion?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on teh upper antifouling area, and stern plating
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Off
	Spot
What was the condition of the hull markings?	Well painted and clearly legible
What level of marine fouling was seen?	Minor
Were fenders installed on the hull?	No

TECHNICAL REPORT

MOORING DECKS

Review Grading Report

Mooring Decks Condition

Were the decks free of any structural damage or deformations?	Yes
What was the level of coating breakdown and corrosion observed on the decks?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the main walkways and around the base of fittings
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Scattered
	Spot
What was the general condition of the deck fittings?	Good
Were fairleads and mooring rollers free to move when tested?	Yes
Were all mooring machinery reported to be fully operational?	Yes
What type of windlass(es) and winches were fitted?	Electric
What was the condition of the mooring machinery?	Good
What amount of band brake lining was seen to be remaining?	Substantial
What condition were the visible sections of the anchor chains seen to be in?	Good
What type of mooring lines did the vessel have?	Rope
What was the condition of the mooring ropes / wires?	Good
Were safe mooring practices observed? i.e. no overlapping turns on split drum, chafing of lines or unsafe leading. Please provide further details	No
	winch clutch safety pins were seen missing
Was the last brake test seen to be stencilled on the mooring winches?	No
What type of snap back warning signs/zones were posted?	Signs at the entrance to the mooring decks

Was the Bosun's / Foc'sle store available for inspection?	Yes
What was the condition of the bosun's store structure?	Structurally sound with no visible damage
What was the condition of the bosun's store coatings?	Coatings fully intact with no corrosion
Was the condition of the bosun's store housekeeping?	Neat and tidy with items secured
Were the bitter end release arrangements seen to be clear and unobstructed?	Yes
Was an 'emergency towing booklets/procedures' available near to the foc'sle?	Yes

TECHNICAL REPORT/

WEATHER DECKS AND FITTINGS

 Review Grading Report

Weather Decks and Fittings Condition

Were the decks free of any structural damage or deformations?	Yes
What was the level of coating breakdown and corrosion observed on the decks?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the main walkways and around the base of coaming supports
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Spot
What was the general condition of the deck fittings e.g handrails, brackets, vent heads, walkways, lighting etc.?	Good
Does the vessel have mooring winches fitted on the main deck?	No
Were deck equipment and pipework free of leakages?	Yes
What was the condition of the accommodation ladders or gangways?	Good
Was the vessel fitted with a provision lifting appliance(s)?	Yes
What was the condition of the provision lifting appliance(s)?	Good
Does the vessel carry any major spares on external decks e.g. propeller blades, anchor etc.	No

TECHNICAL REPORT/

BALLAST TANKS AND SYSTEMS

Review Grading Report

Ballast Tanks and Systems Condition

Were ballast tanks entered?	No
Reason tanks were not entered:	Access not permitted by Terminal/Port
Were recent (last 12 months) ballast tank inspection photographs provided?	Yes
Date the photographs were provided:	07-Feb-25
Were the tanks free of any structural damage or indentations?	Yes
What was the level of Ballast Tank coating breakdown and corrosion?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	around lightning holes, shell plating and frame edges
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Scattered
	Off
	Spot
What was the condition of ballast tank fittings (e.g. ladders, handrails, pipes & manhole seals)?	Good
Were the ballast tanks fitted with sacrificial anodes?	No
How much mud/sediment was seen inside the ballast tanks?	Minimal
Were the tanks seen to be free from any signs of staining from oil, sewage or marine fouling?	Yes
Were ballast tank manhole covers seen to be in good condition?	Yes
Were the remote ballast control systems fully operational (e.g. valves, gauging etc)?	Yes

Were the ballast and/or anti-heeling pumps reported to be fully operational?	Yes
What condition were the ballast and/or anti-heeling pumps in?	Good

TECHNICAL REPORT/

ACCOMMODATION

Review Grading Report

Internal Accommodation Condition

Were accommodation spaces used for their assigned purposes?	Yes
What was the condition of the flooring and wall coverings?	Good
What was the condition of the upholstery and furniture?	Good
What were the general levels of housekeeping and cleanliness?	Good
What was the level of hygiene of the sanitary facilities?	Good
Was all laundry equipment in good working order?	Yes
Was the Hospital well equipped and ready for use?	Yes
Were the drugs found to be controlled and secured with the associated drugs log kept up to date?	Yes
What was the quality of accommodation outfitting?	Average quality of outfitting
Did the Air Handling Unit (AHU) maintain a comfortable temperature?	Yes
What was the condition of the AHU?	Good

Galley Condition

What was the level of cleanliness in the Galley?	Clean
Was all galley equipment operational?	Yes
What was the general condition of galley equipment?	Good
Were the insides of Galley hoods clean?	Yes
What type of cold provisions stores does the vessel have?	Walk-in stores / Cold rooms
Were provisions stores well organised with no provisions stored directly on the deck?	Yes
Were provisions stores clean and hygienic?	Yes

Were provisions stores at the required temperatures?	Yes
Were provision stores temperatures recorded and records kept nearby?	Yes
Were provisions machinery, pipework and door seals free of frosting and deterioration?	Yes
Were lock-in alarms or handles in good working condition?	Yes

External Areas Condition

Was the external Superstructure / Accommodation Block found to be free from damages?	Yes
Were accommodation external doors found to be in good condition and providing an adequate seal?	Yes
What was the level of external accommodation superstructure coating breakdown and corrosion?	None
What was the general condition of external superstructure fittings (e.g. lighting, vent heads, windows/portholes, stairways, railings etc.)?	Good

Crew Welfare

What is the average contract length for crew members?	Officers:	Crew:
	4 Months	6 Months
Was Wi-Fi provided on-board?	Yes, Free, Unlimited	
What is the approximate average internet speed?	Fast (Able to stream music or short videos in low quality)	
Is access provided to catering facilities or food at all times?	Yes	

What Public Recreation equipment did the crew have access to?	Free Weights
	Fixed weight machine
	Cycling Machine
	Television
	Games console
	Musical Instruments
	Barbecue
	Public Computer
	En-suite facilities for all crew members
What was the quality of crew recreation facilities?	Good
Are crew given time and resources to celebrate religious or cultural events (i.e. Christmas, Independence days etc.)?	Yes
What facilities were provided in crew cabins?	Off
	Sofa
	Desk
	Ample storage
Does the vessel have any onboard training facilities?	Yes
Please provide further details	One Learning
Type of onboard training facilities:	Other
Is there a crew suggestion policy in place?	Yes
Does the crew have access to a bonded store?	Yes, well stocked
Are the crew given additional periods of rest throughout the working week (e.g Sunday off)?	Yes

TECHNICAL REPORT/

BRIDGE AND NAVIGATION EQUIPMENT

Review Grading Report

General Condition

Was all the bridge equipment reported to be fully operational?	Yes
Was the bridge found to be clean and well maintained with good housekeeping?	Yes
Were all required bridge equipment annual performance tests (e.g. VDR and AIS) completed in the last 12 months?	Yes
Was the vessel fitted with a Voyage Data Recorder (VDR)?	Yes
Type of VDR fitted:	VDR
Was the VDR seen to be free from any unanticipated alarms?	Yes
Were the VDR collection instructions posted and known to the Master?	Yes
Was the vessels Bridge Navigation and Watch Alarm System (BNWAS) fully operational, and turned on when at sea?	Yes
Normal time setting at sea	12 mins

Navigation Condition

What was the vessels primary & secondary means of navigation as listed on Form E?	Primary	Secondary
	ECDIS	ECDIS
Were the primary & secondary means of navigation found to be up to date?	Yes	
Latest update week	49	
Does the vessel receive up to date weather information?	Yes	
	20-Dec-25	
What type of weather updating service does the vessel use?	Other	
Please provide further details	provided by Management Company	

Was an in-date compass deviation card posted near to the helm?	Yes
Was a compass deviation log kept, up to date and free of any major deviations?	Yes
Were azimuth rings (bearing diopters) found to be available on the bridge?	Yes

Communication Condition

What GMDSS sea areas was the vessel licensed to cover?	A1		
	A2		
	A3		
Were the radio batteries seen to be in good condition?	Yes		
Were the EPIRBs, SARTs and Emergency Hand Held VHF Batteries within their expiry dates?	Yes		
Battery expiry dates	EPIRBS	SARTs	VHF
	30-Nov-34	01-Oct-27	01-Feb-26
Was a valid GMDSS shore servicing certificate seen to be posted near to radio equipment?	Yes		

Documentation Condition

Were berth to berth passage plans seen on-board?	Yes
Were passage plans signed by all navigating officers?	Yes
What format were nautical publications provided in?	Paper and Electronic
Were the Master's standing orders and night orders found to be signed by all navigating officers?	Yes
Was the bridge log book up to date and correctly filled in?	Yes
Was the GMDSS log book up-to-date and correctly filled in?	Yes
Date of last test	19-Dec-25

External Condition

Was the Monkey Island found to be in good, well maintained condition?	Yes
Were the main mast, aerials and antennas seen to be in good condition and free from damage?	Yes
Were bridge wing manoeuvring controls fitted?	Yes
Were the bridge wing manoeuvring controls reported to be fully operational and free from signs of water ingress?	Yes
Were bridge wing engine speed and compass repeaters seen to be in good working condition?	Yes

TECHNICAL REPORT/

ENGINE ROOM AND MACHINERY

 Review Grading Report

General Condition

Were all engine room bulkheads and frames seen to be in good structural condition?	Yes
Were the engine room fittings such as stairwells/ladders, handrails, floor plates and lighting found to be in good condition?	No
Please provide further details	Floor plates loose , missing bolts including in bow thruster room adn engine space
Was the duct keel in good condition and free from any signs of ingress or internal leakages?	N/A
What equipment was seen running?	Auxiliary Engines
	Purifiers
	Pumps
	Air compressors
	Sewage treatment plant
	Auxiliary Boiler
	Refrigeration Compressor
	Air Conditioning Compressor
Was the engine room free of any significant defects, either reported by crew or observed?	Yes
What were the general levels of housekeeping and cleanliness in the Engine Room?	Good
Were bilges and tank tops free of any significant oil and/or water?	Yes
Were bilge alarms found to be fully operational during testing?	Yes
Was the vessel equipped with adequate critical spares as recommended by the ship manager Safety Management System (SMS)?	No

Were spares neatly stowed and correctly secured?	Yes
Were all self-closing devices (sounding pipes, tank level gauge glasses etc.) in good working order?	Yes
Were any caution (amber) or action (red) alerts seen on the lube oil analysis reports?	Yes
Please provide further details	the provisions crane was seen with a "caution" due to the iron content. the reduction gear enclosed gears sample was seen with an "attention" due to Iron and aluminium content the steering gear was seen with an "attention" due to higher viscosity
Were any alerts or abnormal findings seen on the supplied fuel oil analysis reports?	No
Was the NOx Technical file kept up to date?	Yes
Date of entry:	14-Oct-25
Was the engine room logbook up to date, correctly filled in and without any obvious abnormalities recorded?	Yes
Were Chief Engineer Standing Orders clearly posted and signed by all engineers?	Yes
Were all machinery special tools provided and in good condition?	Yes
Were all machinery and equipment manuals reported to be available onboard?	Yes

Main Engine Condition

Was the main engine in good working condition?	Yes
In what condition was the Main Engine?	Good
Were any defects or abnormal findings seen on the supplied scavenge space inspection reports?	No
Were all maximum cylinder liner wear measurements seen to be within maker limits?	Yes
Were all main engine safeties reported to be fully operational? (e.g. oil mist detectors, bearing temperature sensors, low lube oil pressure trip etc.)	Yes
Were the main engine turning gear and flywheel in good condition?	Yes
Were the supplied main engine performance reports seen to be satisfactory?	Yes

Propulsion

What type of propulsion does the vessel have?	Controllable Pitch Propeller (CPP)
Were the Propulsion systems, including shafts, gearing and electric motors, if relevant, in good working condition?	Yes
What type of thruster systems does the vessel have?	Bow Thruster
Was the thruster(s) in good working condition?	No
Please provide further details	As memo reported in BV Class status out of operation

Power Generation

How many Auxiliary Engines does the vessel have?	3
Were the Auxiliary Engines in good working condition?	Yes
In what condition were the Auxiliary Engines?	Good
Were all auxiliary engine safeties reported to be fully operational? (low lube oil pressure, overspeed, high HT temperature etc.)	Yes

Were the supplied auxiliary engine performance reports seen to be satisfactory?	No
Please provide further details	as per the data provided, the load wasn't sufficient to get an accurate test result. It is recommended to conduct the test with at least 70% load on the engines
Does the vessel have a shaft generator?	Yes
Shaft Generator rated power (PTO) (kW):	1200
Was the shaft generator unit fully operational and in good condition?	Yes
Does the vessel have a shaft motor (Power Take-In)?	No

Auxiliary Machinery

Does the vessel have an Auxiliary Boiler?	Yes
What type of boiler is fitted?	Thermal Oil
Was the boiler(s) in good working condition?	Yes
In what condition was the boiler(s)?	Good
Were boiler safety valves in satisfactory condition?	Yes
Was it reported that any boiler tubes had been plugged? (including Economiser/EGB)	No
Was the Hot Well/Cascade Tank seen to be in good order and free from contaminants?	Yes
Were any abnormal findings observed on the supplied boiler and cooling water analysis reports?	No

What was the condition of the following equipment?	Fully operational?	Condition
Economiser/Exhaust Gas Boiler	Yes	Good
Purifiers	Yes	Good
Pumps	Yes	Good
Coolers and Heaters	Yes	Good
Sea Chests and Overboard Valves	Yes	Good
Air Compressors and Air Reservoirs	Yes	Good
Fresh Water Generator	Yes	Good
Filters	Yes	Good
Supply and Exhaust Fans	Yes	Good
Refrigeration and Air Conditioning Systems	Yes	Good
Impressed Current Cathodic Protection (ICCP) System	N/A	N/A
Marine Growth Prevention System (MGPS)	N/A	N/A
Automation Systems (e.g. viscometer, temperature controllers/valves, monitoring panels/screens etc.)	Yes	Good
Engine Room Crane	Yes	Good
Workshop Machinery including emergency stops	Yes	Good
UV Sterilizer	Yes	Good
Fresh Water Mineralizer/Re-hardening Filter	N/A	N/A
Calorifier	Yes	Good
Was all engine room pipework free of significant corrosion?	Yes	
Was all engine room pipework free of leakages?	Yes	
Was all pipework free of temporary repairs including soft patches?	Yes	
What condition was pipework insulation lagging in?	Some areas of deterioration and staining	

Was all anti-splash tape seen to be in place at the required engine room pipe connections?	No
Was the steering gear in good working condition?	Yes
Was the steering gear free of leakages?	Yes
Was the emergency steering communication equipment and gyro repeater working as required?	Yes
Were emergency steering instructions posted nearby?	Yes
Was the Engine workshop clean and tidy?	Yes
Was all welding equipment including gas bottles, flame arrestors and associated fittings in good order and properly secured?	Yes

ECR and Electrical

Was the Engine Control Room clean and tidy?	Yes
Were all Engine Control Room automation and monitoring systems fully operational?	Yes
Was the Engine Control and Alarm system free of any serious active alarms?	Yes
Were any concerning engine room control system alarms seen to be manually blocked/disabled?	No
If the vessel has a UMS Class notation, does the machinery space operate in UMS mode?	Yes
Were the engine room deadman and engineer call alarms found fully operational during testing?	Yes
Were all package air conditioning units operational and in good condition? (e.g. ECR, bridge, galley, electrical rooms)	Yes
Were all Electrical distribution systems in good working condition?	Yes
Were Main Switchboard Insulation readings adequate?	Yes
Were any abnormal findings observed as per the latest Megger Test reports?	No
Were distribution and switchboard panels protected with approved rubber matting?	Yes

Was evidence of regular safety equipment testing available? (i.e. weekly, monthly and quarterly tests of bilge alarms, dampers, emergency machinery etc.)	Yes
Was the Emergency Generator tested during the inspection?	Yes
Was the Emergency Generator in working order?	Yes
Were Emergency Generator Starting instructions clearly posted?	Yes
What was the condition of the Emergency Generator?	Good
Was the "18 hour" fuel level marked on the emergency generator fuel tank?	Yes

TECHNICAL REPORT/

FIRE FIGHTING EQUIPMENT AND SYSTEMS

🔍 Review Grading Report

Fire and Safety Appliances Condition

Was the vessel free of fire hazards?	Yes		
Was all fire and safety equipment regularly serviced?	Yes		
Date of last service	19-Sept-25		
Were all relevant Fire and Safety instructions correctly posted?	Yes		
What was the vessels Fixed fire detection systems?	Engine Room	Cargo Holds	Accommodation
	Flame	Smoke	Smoke
	Smoke		Heat
	Heat		
Was the fire detection system reportedly fully operational?	Yes		
Was the fire detection system free of alarms or signs of tampering?	Yes		
What is the vessels Fixed firefighting systems?	Engine Room	Cargo Holds	Accommodation
	C02	C02	Galley C02
	Water Spray		
Were all fixed fire fighting systems in good working condition?	Yes		
Were clear operating instructions posted for the fixed firefighting systems?	Yes		
Was the fixed firefighting system release protected against unauthorised operation?	Yes		
Was the main fire pump working?	Yes		
Was the emergency fire pump working?	Yes		
Was a fire pump tested during the inspection?	Yes		
Did the fire pump maintain adequate pressure?	Yes		

Were the main and emergency fire pumps in good condition and free of leakages?	Yes
What was the condition of the fire main and ancillaries such as pipework hydrants and valves?	Good
Does the vessel have a fire control station?	Yes
Were all portable equipment in place as per the fire plan?	Yes
Were all fire extinguishers in good condition?	Yes
Were the firefighting outfits and associated equipment in good condition?	Yes
Were the International Shore Connections on board?	Yes
Location:	Upper Main Deck Area on Port Side
Was the BA equipment fully charged in good condition?	Yes
Was the Quick Closing Valve system in good working order?	Yes
Were fire doors in good condition and effectively closing?	Yes
Were fire doors free of unauthorised "hold-open" arrangements?	No
Were all ventilation dampers remote closing positions well labelled and in good working order?	Yes
Were all remote machinery shutdown systems well labelled and in good working order?	Yes

TECHNICAL REPORT/

LIFESAVING APPLIANCES

Review Grading Report

Lifesaving Appliances Condition

Were all Lifesaving Appliances regularly serviced?	Yes
Date of last service:	19-Sept-25
How many lifeboats is the vessel equipped with?	1
What type of lifeboat is the vessel fitted with?	Free-fall
What was the external condition of the lifeboat(s)?	Good
What was the internal condition of the lifeboat(s)?	Good
Were Lifeboat Engines able to be tested?	Yes
Were lifeboat engines in good working order?	Yes
What was the condition of the rescue boat?	Good
How many life rafts does the vessel have?	3
What was the condition of the life rafts?	Good
Were Liferaft Hydrostatic Release Units (HRU) in date and correctly rigged?	Yes
What was the condition of the Davits and lowering arrangements for the lifeboat(s), rescue boat and liferafts?	Good
What Date is the next Davit wire due for change?	14-Jun-29
Were legible launching/recovery instructions posted near to survival craft?	Yes
Was evidence of regular maintenance, service and inspection of the launching appliances sighted and evident?	Yes
What was the date of the last abandon ship drill?	14-Dec-25
Were all lifejackets, immersion suits, EEBDs and other lifesaving ancillary equipment in good condition and ready for use?	Yes
Were Man Overboard Buoy (MOB) smoke and light signals in date?	Yes

Were the embarkation ladders in a good, well maintained condition?	Yes
Were pyrotechnics and line throwing apparatus available, stored in an appropriate container and within their expiry dates?	Yes

TECHNICAL REPORT/

SAFE WORKING ENVIRONMENT

Review Grading Report

Safe Working Environment Condition

Were any unsafe practices observed during the inspection?	Yes
Please provide further details	Open hatch covers were seen with no temporary or fixed guard railings. The paint store was seen with paint cans stored above the sprinkler heads, causing a safety hazard. The maximum storage height red marker is to be applied to the area. Mooring practices were seen not to be following the industry's safe practices. The winch clutch safety pins were seen missing. Anti-splash tape was not seen to be in place at all required pipe connections.
Did the vessel provide a safe working environment?	Yes
Were all hazard markings clear?	Yes
Were external walkways adequately coated with anti-slip paint and free of trip hazards?	Yes
Are all hazardous substances including safely managed and stored with relevant Material Safety Data Sheets (MSDS)?	Yes
Is Personal Protective Equipment (PPE) provided and worn by crew?	Yes
Are 'Enclosed Space Entry' procedures implemented?	Yes
Is an effective Permit To Work (PTW) process implemented?	Yes
Date of last PTW:	08-Nov-25
Is an effective Risk Assessment (RA) process in place?	Yes
Was evidence of the annual and 5-yearly inspections of both fixed and portable lifting equipment and appliances sighted?	Yes
Are main and emergency exits clearly identified and unobstructed?	Yes
Are sufficient portable oxygen and gas detection meters provided and regularly calibrated?	Yes
Date of last calibration:	25-Aug-25

What is the working language of the vessel?	English
Are standing orders, procedures, instructions and manufacturers' manuals written in a language which can be understood by the crew?	Yes
Are all IMO signs correctly placed, and compliant with IMO requirements?	Yes
Is the vessel equipped with an approved SOLAS training manual?	Yes
Were the Pilot Ladders in good condition?	Yes
Was the Pilot ladder seen to be secured in a safe manner?	Yes
Are regular drills conducted on board?	Yes
Last drill date	12-Dec-25
Last drill type	Launching Dedicated Rescue Boat

TECHNICAL REPORT

POLLUTION CONTROL

 Review Grading Report

General Condition

Was Pollution Control well implemented within the on board Safety Management System (SMS)?	Yes
Is the vessel free of pollution hazards?	Yes, with no hazards
Does the vessel have a Class approved Inventory of Hazardous Materials (IHM)?	Yes
Please provide further details	The vessel holds a Class approved Inventory of Hazardous Material (IHM)

Oil - Marpol Annex I

Is an Oily Water Separator (OWS) fitted?	Yes
Was the OWS reportedly operational?	Yes
What was the condition of the OWS?	Good
Was the OWS Tested?	Yes
Means of testing	Simulated
Was the 15ppm meter calibrated?	Yes
Date of calibration	24-Feb-23
Was the Bilge Overboard valve secured against unauthorised opening with adequate signage and warnings posted?	Yes
Means of securing	Sealed
	Locked
Was the oily water treatment system including valves and pipework free of any signs of tampering, bypass, or modifications?	Yes
Was the SOPEP locker or box well stocked?	Yes
What was the condition of the SOPEP equipment?	Good

Was a list of SOPEP equipment posted and accurate?	Yes	
Was the Oil Record Book (ORB) up to date and correctly filled in?	Yes	
Date of last entry	14-Dec-25	
Category of last entry	I	
Were previous bunkering checklists correctly filled out?	Yes	
Date of last bunkering	20-Dec-25	
Were bunker samples correctly stored?	Yes	
Does the vessel have a Ballast Water Treatment System (BWTS) fitted?	Yes	
Ballast Water Treatment System	Manufacturer:	Panasia
	Type:	UV
What regulation is listed on the Ballast Water Management Certificate?	D-2	
Type of BWTS approval (As reported / according to provided documentation):	USCG approval	
Was the BWTS operational?	Yes	
What was the condition of the BWTS?	Good	
Was the Ballast Record Book up to date and correctly filled in?	Yes	
Date of last entry	14-Dec-25	
Is the Vessel General Permit (VGP) compliant?	No	

Sewage - Marpol Annex IV

Was a Sewage Treatment Plant fitted?	Yes
Was the Sewage Treatment Plant operational?	Yes
What was the condition of the Sewage Treatment Plant?	Good
Does the vessel have a sewage holding tank?	Yes

What was the condition of the Sewage Holding Tank?	Good
--	------

Garbage - Marpol Annex V

How was the condition of Garbage segregation?	Good
Were Garbage containers of approved, non-combustible type?	Yes
Was the Garbage Record Book (GRB) up to date and correctly filled in?	Yes
Date of last entry	20-Dec-25
Category of last entry	A, B, C

Air - Marpol Annex VI

How does the vessel comply with IMO 2020 regulations?	Use of Very Low Sulphur Fuel Oils (VLSFO), MGO, D0 etc.
Does the vessel use Ozone Depleting Substances (ODS) as Refrigerant Gas?	No
Was an Incinerator fitted?	Yes
Was the Incinerator operational?	Yes
What was the condition of the Incinerator?	Good
Does the vessel have an Emission Control Area (ECA) change-over log?	Yes
Date of last entry	05-Sept-24

EEXI

Does the vessel have an attained EEXI score as per her International Energy Efficiency Certificate (IEEC)?	Yes
What is the EEXI score?	23.9
Does the vessel have any energy efficiency technologies installed?	Yes
Is the vessel ice classed?	No

Main Engine(s)	Specific Fuel Oil Consumption (SFOC) (g/kWhr):	176.8
Auxiliary Engines	Specific Fuel Oil Consumption (SFOC) (g/kWhr):	176.8
Shaft Generator rated power (PTO) (kW):	1200	
Does the vessel have a shaft motor (Power Take-In)?	No	
What is the expiry date of the International Air Pollution Prevention (IAPP) certificate?	26-Feb-28	
	2024	25.32
	2023	23.13

TECHNICAL REPORT/

ONBOARD MANAGEMENT

Review Grading Report

Onboard Management Condition

Does the vessel have a functioning Safety Management System (SMS)?	Yes
How was the SMS Implemented?	Software / Electronic System
Were the officers familiar with, and allowed easy access to, the SMS?	Yes
Was the SMS well implemented on board, with Permits to Work, Risk Assessments and Safety procedures understood and followed?	Yes
Is the SMS system regularly reviewed by the Master?	Yes
Date of last review	30-Nov-25
Does the vessel management deal with accidents, near-misses and deficiencies in an effective manner?	Yes
Are regular safety committee and management meetings carried out on board?	Yes
Does the vessel have a valid MLC certificate?	Yes
Were Hours of Rest (ILO) records correct and up to date?	Yes
Last updated	30-Nov-25
Are hours of maximum permissible work regularly exceeded?	No
Is an effective Planned Maintenance System (PMS) implemented and kept up to date?	Yes
What type of Planned Maintenance System (PMS) does the vessel have?	Type-approved system
Name of PMS	AMOS
Was the PMS a fully integrated type system? (i.e. has integration with the SMS, spares ordering and is accessible by shore side management)	Yes
Were there any critical overdue PMS work orders?	No

Port State Control (PSC) inspection history

No. of Inspections in Past three years:	6
No. of Deficiencies in Past three years:	1
No. of Detentions in Past three years:	0
Is the vessel flag targeted by Port State Authorities?	No
Is an effective system of security access control, conforming to ISPS standards, in place upon boarding the vessel?	Yes
Type of access control	Upon boarding, a gangwaywatch is available. Identity documents are checked by the rating. Escorting of surveyors throughout the survey was observed.
Do the Master and Chief Engineer have an effective hand over procedures?	Yes
Are random or specific drug and alcohol testing carried out?	Yes
Tests Carried out by:	Onboard by Master
Were the Master and crew prepared for the Inspection?	Yes
What level of cooperation was provided by the crew and Master?	Good
Were documents provided as requested?	Majority of documents provided
What was the overall impression of the general management of the vessel?	Well managed

TECHNICAL REPORT/

VESSEL CAPABILITIES AND CARGO SYSTEMS - CONTAINERSHIPS

Review Grading Report

Vessel Capabilities and Cargo Systems - Containerships Condition

Cargo hold	Capacity in hold (TEU)	Capacity on deck (TEU)	Total (TEU)
Cargo Hold No.1	24	48	72
Cargo Hold No.2	86	138	224
Cargo Hold No.3	112	180	292
Cargo Hold No.4	106	311	417
Cargo Hold No.5	0	0	0
Cargo Hold No.6	0	0	0
Cargo Hold No.7	0	0	0
Cargo Hold No.8	0	0	0
Cargo Hold No.9	0	0	0
Additional Deck Stowage		0	0
Total	328	677	1005
How many cargo holds does the vessel have?	4		
Were the cargo holds able to be entered and inspected?	Yes		
Please provide further details	No . 3		
Were recent vessel cargo hold inspection photographs provided?	Yes		
Date photographs were taken:	18-Apr-25		
Were recent inspection reports provided?	Yes		
Date of inspection reports:	18-Apr-25		
Were cargo holds structural members found to be free from damage (e.g. side plating, tank top and framing)?	Yes		

Were the cargo hold fittings such as ladders, hand rails, and ventilation ducting found to be free from damage and deterioration?	Yes
Were the cell guides free from any significant damage or significant deformation?	Yes
What was the level of coating breakdown and corrosion observed in the Cargo Holds?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the tank tops and upper area of the bulkheads
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Scattered
	Off
	Spot
Were all cargo monitoring systems (e.g. bilge alarms, smoke detection systems etc.) fully operational and regularly tested?	Yes
Were cargo hold bilges clear of debris and oil contamination?	Yes
Were the cargo holds free from signs of significant water ingress?	Yes
Were the cargo holds free from signs of previous and/or current internal leaks? (e.g. from manholes, adjacent tanks, pipework and fittings etc.)	Yes
What is the method of cargo hold ventilation?	Mechanical
Were cargo hold ventilation systems in good working order?	Yes
Were the cross-deck areas seen to be free from waving of the deck plates or any signs of torsional deformation?	Yes
Is the fixed firefighting system in cargo spaces in apparent good condition?	Yes

Hatch Covers

What type of hatch covers are fitted?	Pontoon
---------------------------------------	---------

What was the make and model of the Hatch covers?	MacGregor Lift away hatch covers. 14 panels for hatches between 1 to 7, clear opening of 12,600 X 17,840.
Maximum weight of the heaviest pontoon (tons):	27
Were the hatch cover found to be free from structural damage?	Yes
What was the level of coating breakdown and corrosion observed on the hatch covers?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	on the top plates and around the rubber packing channels
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Spot
What was the condition of the hatch cover rubber seals/gaskets and retaining channels?	Good
What was the condition of hatch cover securing arrangements?	Good
What was the condition of the hatch cover landing pads?	Good

Hatch Coamings

Were the hatch coamings found to be free from structural damage?	Yes
What was the level of coating breakdown and corrosion observed on the hatch coamings?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on teh table top section
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Off
	Spot

Were the compression bars/strips seen to be in good condition?	Yes
Were the hatch coaming drain channels seen to be free from corrosion, scaling or debris?	Yes
Were hatch coaming non-return valves found to be clear and fully operational?	Yes

Cargo Securing

What was the condition of fixed cargo securing fittings, such as container sockets, pad-eyes, D-rings and fixed stacking cones, etc.?	Good
Was there an up to date Cargo Securing Equipment inventory?	Yes
Were there any shortfalls of cargo securing devices?	No
Were cargo securing device inspection records correctly maintained?	Yes
What was the condition of Cargo Securing Equipment?	Good
Was there an approved Cargo Loading Manual on board?	Yes
Was there an approved stability booklet on board?	Yes
Did the vessel use a Class-approved computer based loading/stability software?	Yes
Please provide further details	LOADSTAR
Were previous and current stability calculations seen to be carried out?	Yes
Does the vessel have a Document of Compliance (DOC) for the carriage of dangerous goods?	Yes
Are procedures for safe lashing and securing of containers being incorporated in the ship's SMS?	Yes
Are appropriate securing points being used for cargo securing?	Yes

Reefer Containers

Is the vessel equipped to carry Reefer containers?	Yes
--	-----

Reefer Capacity	On deck	In Holds	Water cooled Reefers	Total
	160	154		314
What condition were reefer electrical sockets in?	Good			
Was the reefer switchboard free of any low insulation or earth faults?	Yes			
Was the vessel's own electrical supply sufficient for all reefer containers, without the use of an additional Power Unit (package generator) ?	Yes			
Is there an effective system for monitoring reefer container temperatures? Please provide further details	Yes			
	Manual monitoring by crew			

TECHNICAL REPORT/

CARGO LIFTING APPLIANCES

Cargo Lifting Appliances Condition

Does the vessel have Cargo Lifting Appliances? i.e. Does the vessel have cargo cranes (Geared).	Yes		
Crane	Safe Working Load (SWL) (t)	Reach (m)	Date of last wire change
1	48	29.5	08-Apr-21
2	48	29.5	18-Jun-23
3	2		
4	2		
5	2		
How many Cargo Lifting Appliances does the vessel have?	2		
What type of cargo lifting appliances are fitted?	electro-hydraulic		
Were the cargo lifting appliances seen in operation?	Yes		
Were all cargo lifting appliances fully operational?	Yes		
Were the cargo lifting appliances available for internal inspection? Please provide further details	Yes		
	No.1		
Were the cargo lifting appliances found to be free from structural damage?	Yes		

What level of coating breakdown and corrosion was seen on the cargo lifting appliances?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the pedestal
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Off
	Spot
In what condition were the wires for the cargo lifting appliances?	Good
In what condition were the cargo lifting appliances motors and hydraulic systems?	Good
In what condition were the cargo lifting appliances slewing bearings?	Good
Was slewing bearing wear monitored or rocking tests conducted and recorded?	No
Please provide further details	Not provided for review
Were all safety features and equipment (e.g. limit switches) fitted on the cargo lifting appliances fully operational?	Yes
In what condition were the cargo lifting appliances control and operating positions, including their operator cabs if fitted?	Good
Were cargo lifting appliances regularly examined by appropriately qualified shore side technician?	Yes
Were cargo lifting appliances angle indicators free to move?	Yes
Was the Safe Working Load (SWL) clearly marked on the cargo lifting appliances?	Yes
What condition were the cargo lifting appliances components such as sheaves, blocks and cylinders in?	Good
Were cargo lifting appliances maintenance records accurate and up to date?	Yes