



ID CONDITION REPORT

ATLANTIC NORTH

IMO 9236597

Commissioned by:
Container Management Team

Organisation:
Sinokor Merchant Marine Co., Ltd

Inspected at:
Valetta, Malta

Date of inspection:
March 08 2026

ADDITIONAL ITEMS
Supplementary materials, accessible online.

 [View Documents](#)

 [View Images](#)

CONTENTS

TERMS OF USE	2
INSPECTION SUMMARY	3
VESSEL PARTICULARS	4
GRADE COMPARISON	5
GRADING DATA	7
DEFECTS LIST	9
GRADING REPORT	15
16 Design and Construction	
18 Hull	
20 Mooring Decks	
22 Weather Decks and Fittings	
23 Ballast Tanks and Systems	
26 Accommodation	
30 Bridge and Navigation Equipment	
31 Engine Room and Machinery	
35 Fire Fighting Equipment and Systems	
36 Lifesaving Appliances	
37 Safe Working Environment	
39 Pollution Control	
41 Onboard Management	
42 Vessel Capabilities and Cargo Systems	
OPERATIONAL DATA	51
TECHNICAL REPORT	57
58 Design and Construction	
59 Hull	
60 Mooring Decks	
62 Weather Decks and Fittings	
63 Ballast Tanks and Systems	
65 Accommodation	
69 Bridge and Navigation Equipment	
72 Engine Room and Machinery	
79 Fire Fighting Equipment and Systems	
81 Lifesaving Appliances	
83 Safe Working Environment	
85 Pollution Control	
90 Onboard Management	
92 Vessel Capabilities and Cargo Systems	
98 Cargo Lifting Appliances	

REPORT TERMS OF USE

This report is intended for the sole use of **Container Management Team** and is designed to offer a condition evaluation of the subject vessel, as found on the day of the survey and in the opinion of the surveyor concerned. The report is subject to any access restrictions as described herein, and subject always to the level of cooperation afforded to the surveyor during the inspection itself. All details are given in good faith, and without guarantee.

This report has been prepared and issued by Idwal Marine Services Ltd to its Customer, **Container Management Team of Sinokor Merchant Marine Co., Ltd**, in accordance with, and subject to, the Terms of Service of Idwal Marine Services Ltd, a copy of which can be obtained at <https://www.idwalmarine.com/terms-and-conditions/terms-of-service>. Attention is particularly drawn to restrictions on reproduction and disclosure of, and limits on reliance on, this Report as more fully set out therein.

At Idwal, we are proud to run a carbon neutral business and provide the industry's first carbon neutral inspection service. Idwal has been carbon neutral since 2021 and has achieved PAS 2060 certification from Carbon Footprint Ltd.



Carbon
Neutral
Organisation
PAS 2060



INSPECTION SUMMARY



71

IDWAL
GRADE
Inspected: MAR-2026

Inspected at:
Valetta, Malta

Date of inspection:
08 Mar 2026

Status:
alongside loading

Time aboard:
7.5 Hours

Documents provided:
Majority of documents provided

An ID Condition Inspection of the ATLANTIC NORTH (ex. Max Carrier) was conducted on the 8th of March 2026 in Valetta, Malta by Idwal under instruction from Sinokor Merchant Marine Co., Ltd.

The ATLANTIC NORTH is an 18,402 DWT, 14,241 GT, Singapore-flagged, geared 8125 Container Ship (Fully Cellular) built by Gdanska Stocznia Grupa Gdynia in Poland under GL - Germanischer Lloyd supervision. The keel was laid on the 27th of August 2001, and the vessel was delivered to market on the 15th of March 2002. The vessel is currently Classed with Det Norske Veritas. The vessel is fitted with a MAN B&W 7S50MC main engine.

Good cooperation was provided by the ship's crew with the majority of documents provided for review.

The vessel was alongside loading at the time of inspection.

The vessel was found to be in a good overall condition with an Inspected Idwal Grade above the industry average for vessels of a similar age, type, and size but with several notable items found during the inspection. These are reported specifically in the notable items section of this report.

According to the information provided, the vessel's last Special Survey was carried out on 12-Aug-22 with the next Special Survey due on 31-Mar-27. The vessel's Port State Control (PSC) history was found to be good to very good with 6 deficiencies and no detentions in the 6 inspections conducted in the past three years.

As per the International Energy Efficiency Certificate (IEEC) provided, the vessel's attained EEXI score is 19.4 gCO₂/tonne-miles within the required EEXI being 19.4 gCO₂/tonne-miles. As per the information provided, the Main Engine Power has been limited to 8,100 kW from the original 10,010.0 kW in order to ensure the attained EEXI is within the Required EEXI. Therefore, the vessel fully complies with the MEPC 76 amendments to MARPOL Annex VI regulations 23 and 25.

The Forthcoming Regulatory Compliance section was graded fair as no previous CII score was provided for the previous 2 years, or no data was provided to calculate CII for the previous 2 years.

From 2024 onwards, any vessel that has an E rating in any year or a D rating for 3 consecutive years is required to develop a corrective action plan in the SEEMP Part III which is required to be confirmed by the Flag Administration or Recognised Organisation (RO).


VESSEL PARTICULARS

Vessel name	Atlantic North
Previous name	Max Carrier
IMO number	9 2 3 6 5 9 7
Port of registry	Singapore
Ship type	Containership
Flag	Singapore
Classification society	Det Norske Veritas
Registered owner	Silver Maritime Pte Ltd
Technical manager	Columbia Shipmanagement-Geu
Shipbuilder	Gdanska Stocznia Grupa Gdynia
Delivery date	15-Mar-02
Dead weight	18,402.00 Mt
Gross tonnage	14,241.00 Mt
Net tonnage	6,256.00 Mt
Length overall	158.75 M
Breadth	24.00 M
Depth	13.90 M
Summer draught	10.20 M
TEU	1,129.00
Lightweight	6,814.00 Mt

GRADE COMPARISON

[Launch Benchmarking](#)

This section of the report allows you to compare your ship's grade with similar ships. The chart below shows the distribution of Idwal Grades against your vessels sector.

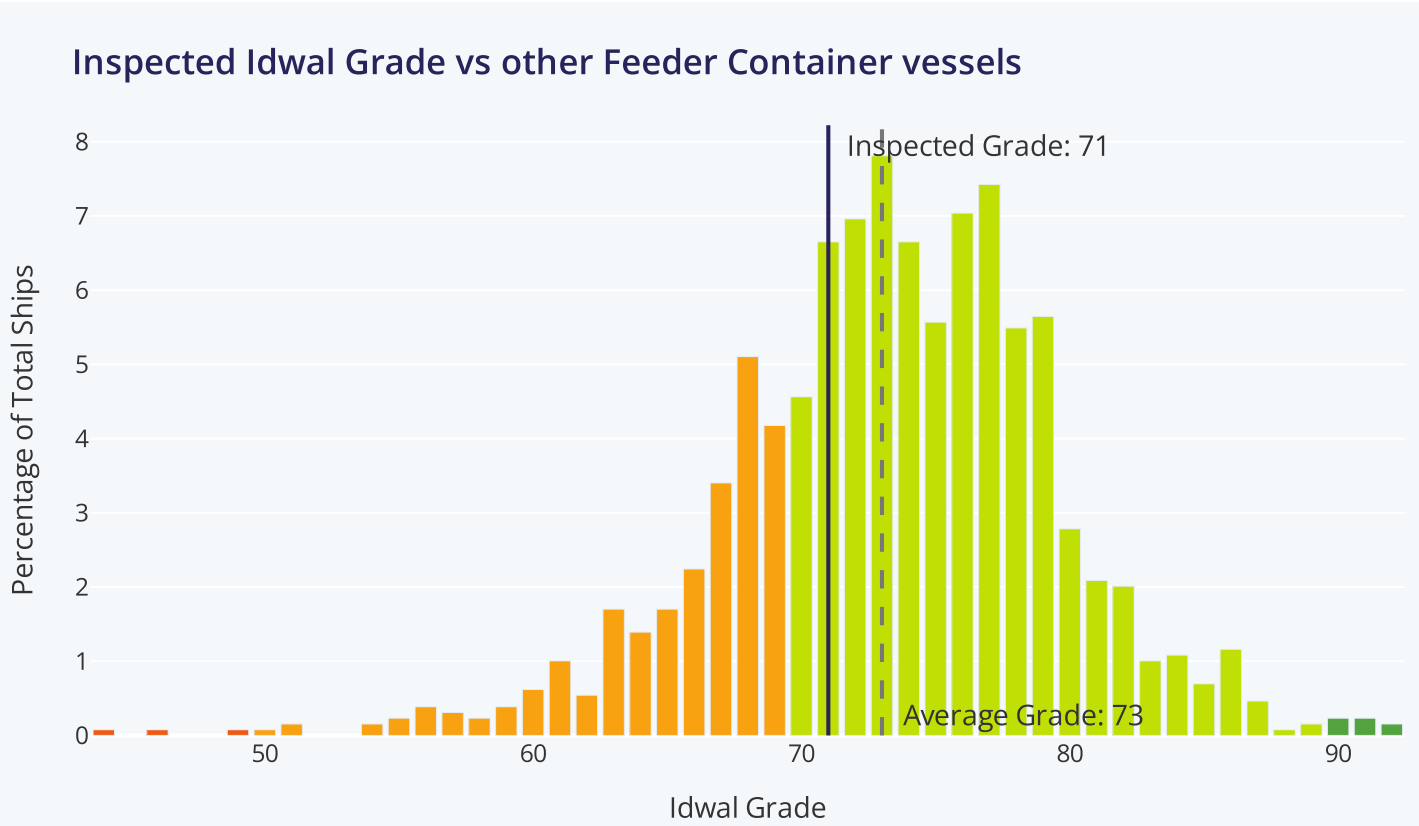

Key

Inspected Idwal Grade

Average Idwal Grade

Grade range

≥ 90

70 - 89

50 - 69

30 - 49


The ship's grade may appear different when compared with the average of the two graphs. This is as a result of the second graph comparing a smaller and more focused sample of ships.

For a more in-depth analysis of where your vessel compares amongst its peers, please contact your Idwal sales rep.

GRADE COMPARISON /

This section of the report allows you to compare your ship's grade with similar ships. The chart below shows the distribution of Idwal Grades against your vessels sector.

Inspected Idwal Grade vs other Feeder Container vessels, age 20-25 years

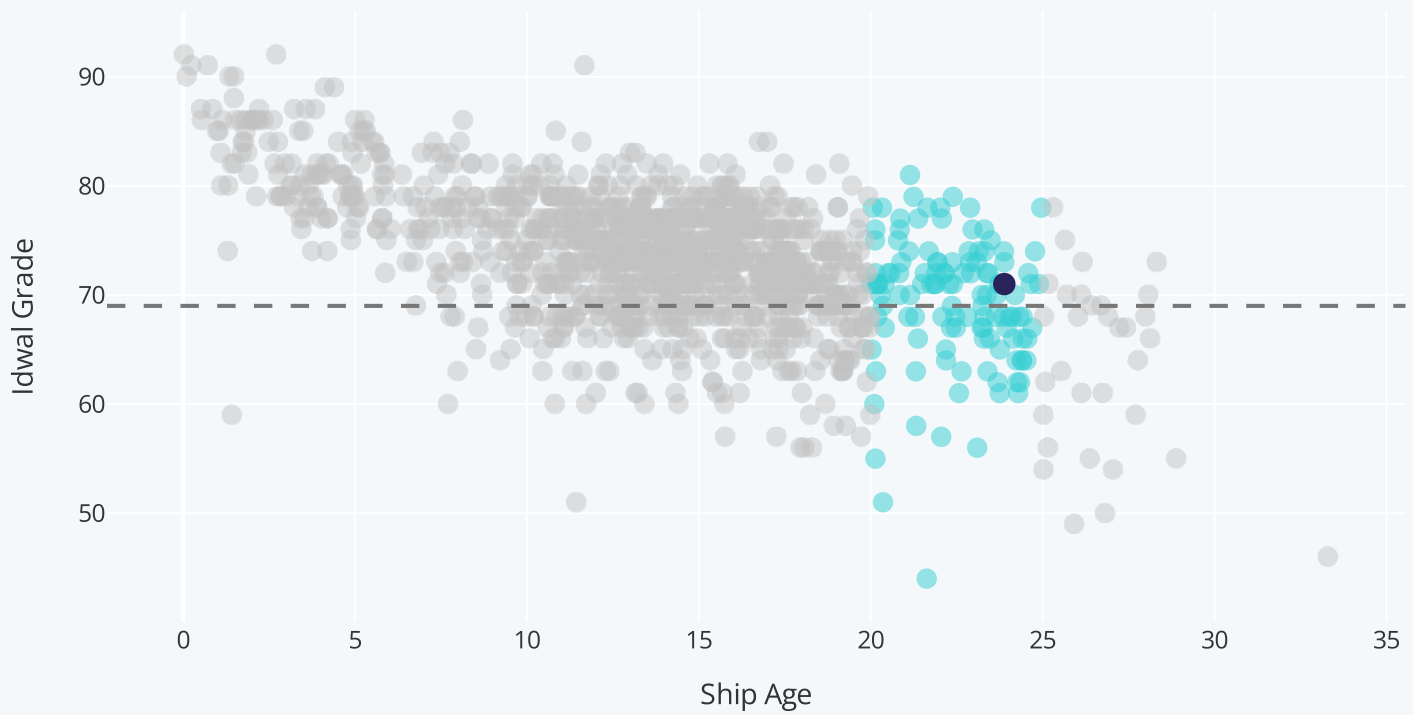

Key

- | | |
|-----------------------|----------------------|
| Inspected Idwal Grade | Average Idwal Grade |
| ● | --- |
| All sector ships | Age comparable ships |
| ● | ● |

The ship's grade may appear different when compared with the average of the two graphs. This is as a result of the second graph comparing a smaller and more focused sample of ships.

For a more in-depth analysis of where your vessel compares amongst its peers, please contact your Idwal sales rep.

GRADING DATA

[Launch Grading](#)

The Idwal Grade® is an industry recognised measure of asset integrity. Using proprietary algorithms, the Idwal Grade is programmatically calculated from over 500 individual data points, captured during a rigorous and standardised inspection process. Our data-driven methodology ensures that our reports are consistent, accurate and free from bias.

Sub-Grades

The methodology used to calculate the Idwal Grade® is also applied to the grading of the different vessel areas and categories. Two key areas are the overall vessel condition and vessel management:

Condition



Management



The following are grades representing individual areas of interest of the vessel:

⌘ Design and Construction



⌘ Hull



⌘ Mooring Decks



⌘ Weather Decks and Fittings



⌘ Ballast Tanks and Systems



⌘ Accommodation



⌘ Bridge and Navigation Equipment



⌘ Engine Room and Machinery



⌘ Fire Fighting Equipment and Systems



⌘ Lifesaving Appliances



⌘ Safe Working Environment



⌘ Pollution Control



⌘ Onboard Management



⌘ Vessel Capabilities and Cargo Systems



Forthcoming Regulatory Compliance



Crew Welfare



Crew Performance



Safety Management



Planned Maintenance System (PMS)



Classification and Certification



PSC Performance



DEFECTS LIST

[Launch Defects](#)

Priority	Grading area	Description	Recommendations
	Vessel Capabilities and Cargo Systems	Defect ID: 3-045-142-528 Based on the provided cargo holds inspection reports dated November 2025, the tank manhole covers, bilges/covers, and lighting/electrical were reported to be in fair condition. Several welded cones for containers in the cell guide part inside cargo holds No.2 and No.4 were reported to be missing, and several lamps in cargo holds No.2, No.3, and No.4 were reported to be busted. Signs of wastage were seen on the stacking cones of cargo hold No.2. The inspected cargo hold No.2 was found to have deformed railings and a sounding pipe.	Corrective actions are to be carried out to improve the condition of the cargo hold fittings.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-017-795 Some areas of the hatch cover cross joints' rubber gaskets were found worn and in deteriorated condition, and gaps were seen on the hatch cover rubber seals of some of the hatch covers. One of the hatch covers was found missing half of the rubber gasket of its cross joint. Some sections of some of the hatch covers' retaining channels were found to have signs of wastage.	Corrective actions are to be carried out to improve the condition of the hatch cover rubber gaskets and retaining channel.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-017-797 The coaming guide of hatch coaming No.1 forward starboard was found damaged.	Repairs are to be carried out to improve the condition of the coaming guide.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-116-106 Based on the provided cargo hold No.4 inspection report dated 28-Nov-25, the watertightness and rubber packing of the hatch cover were reported to be in fair condition. Based on the provided cargo holds No.2 and No.3 inspection reports dated November 2025, the watertightness, rubber packings, and top coatings were reported to be in fair condition. Based on the provided cargo hold No.1 inspection report dated 24-Nov-25, the underside, bearer pads, and rubber packings of the hatch cover were reported to be in fair condition.	Maintenance should be carried out to improve the condition of the hatch covers.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-169-346 Signs of wastage and deformation were seen on localized areas of the hatch covers' edges.	Repairs are to be carried out to improve the condition of the hatch covers.

	Vessel Capabilities and Cargo Systems	Defect ID: 474-189-828 Signs of wear were seen on the hatch coaming landing pads, and hatch cover support pads.	Maintenance should be carried out to improve the condition of the landing pads and support pads.
	Engine Room and Machinery	Defect ID: 58-826-776 As per the Condition of Class No. CC122, it was stated that the alternator of main generator No.1 needs to be repaired and tested to the satisfaction of a DNV surveyor. Until final repair the mitigating action as per risk assessment to be followed. Tug assistance to be requested based on master decision. The postponed due date of this Condition of Class is 05-Apr-26.	It was noted that the turbocharger and alternator of Auxiliary Engine No.1 were under repair during the time of inspection. Further investigation is recommended as repairs were still in progress after the Idwal inspection.
	Ballast Tanks and Systems	Defect ID: 58-896-389 Based on the provided ballast tanks inspection reports, the tank remote gauging systems of No.3BS and No.3BP Heeling tank, No.2BS, No.2BP, No.1B2PS, No.1B1SS, No.1B1PS, No.1A2SS, No.1A2P, No.4BS, No.4B, No.3AS, No.3AP, No.2AS, No.2AP, No.1B2S, No.1A1, No.3S DBT, No.3P DBT, No.2S DBT, No.2P DBT, No.4 DBT WBT, Fore Peak, and Aft Peak Tank were reported to be out of order or in poor condition.	Corrective actions are to be carried out to improve the operational condition of the ballast tanks' remote gauging systems.
	Engine Room and Machinery	Defect ID: 58-937-365 As per the provided running hours document dated February 2026, the burner fuel filter of the auxiliary boiler burner was overdue for the biannual service.	Further investigation is recommended, and carry out corrective actions to rectify the overdue item.
	Onboard Management	Defect ID: 1-854-066-688 As per the provided Class Status Report dated 02-Mar-26, multiple surveys including surveys of machinery items were marked as due including but not limited to the loadline annual survey, safety radio periodical, and machinery items.	For information.
	Engine Room and Machinery	Defect ID: 3-254-931-456 Oil leakage was seen on the surface of the steering gear.	Further investigation is recommended to determine the cause of the leakage and carry out corrective actions to rectify the leakage.
	Safe Working Environment	Defect ID: 3-775-029-248 The protective cover for the ER workshop lathe machine was found missing. The Hot well covers were found to have loose or missing bolts.	Corrective actions are to be carried out to rectify the defects.
	Vessel Capabilities and Cargo Systems	Defect ID: 473-972-747 Based on the provided cargo holds No.2, No.3, and No.4 inspection reports dated November 2025, the tanktop, and the forward, aft, port and starboard coaming externals were reported to be in fair coating condition. Based on the provided cargo hold No.1 inspection report dated 24-Nov-25, the aft, port, and starboard coaming externals were reported to be in fair coating condition.	Maintenance should be carried out to improve the condition of the cargo holds.

	Vessel Capabilities and Cargo Systems	Defect ID: 473-980-929 One of the vertical guides on the port bulkhead of cargo hold No.2 was found to have minor deformation. Based on the provided cargo hold photographs, minor deformation was pictured on one of the cell guides of bay 26.	For information.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-017-801 Based on the provided cargo holds No.2, No.3 and No.4 inspection reports dated November 2025, the fitting cleats of the coaming structure/fittings were reported to be in fair condition.	Maintenance should be carried out to improve the condition of the fitting cleats.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-116-104 Signs of wastage and developing corrosion were seen on some areas of the coamings' cross deck walkways.	Maintenance and repairs are to be carried out to improve the condition of the cross deck walkways.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-148-864 Based on the provided cargo hold photographs, minor indentations were pictured on the forward bulkhead of Bay 26, and aft bulkhead of bay 6.	For information only.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-202-118 Hatch coamings were found to have minor to moderate localised scaling and spot corrosion, up to approximately 10% of the surface area, mainly located on the coaming table and free edges.	Maintenance should be carried out to improve the condition of the hatch coamings.
	Vessel Capabilities and Cargo Systems	Defect ID: 474-214-407 Some sections of the hatch sills were found to have damage and prominent levels of corrosion.	Maintenance and repairs are to be carried out to improve the condition of the hatch sills.
	Engine Room and Machinery	Defect ID: 58-724-362 Leak stains were seen on the external casing of the Main Engine, and Signs of leakage were seen on one of the fuel injector pumps of the Main Engine.	Leak stains on the external casing of the Main Engine should be cleaned and carry out further checks to verify any active leakages. Carry out corrective actions to rectify the leakages.
	Vessel Capabilities and Cargo Systems	Defect ID: 58-744-847 Hydraulic oil leakages were seen on the motor and hydraulic platform of cargo crane No.2.	Further investigation is recommended to determine the cause of the leakage and carry out corrective actions to rectify the leakage.
	Ballast Tanks and Systems	Defect ID: 58-781-700 Some of the pipes and ladders of the inspected ballast tanks were found to have areas with developing corrosion and signs of coating breakdown.	Maintenance should be carried out to improve the condition of the ballast tanks' fittings.
	Hull	Defect ID: 58-785-792 Minor indentations and signs of rib caging were seen on the forebody and afterbody of the ship's hull.	For information only.

	Accommodation	Defect ID: 58-818-567 Ice accumulation was seen on some sections of the cold room refrigeration pipework.	Further investigation is recommended.
	Ballast Tanks and Systems	Defect ID: 58-822-674 Based on the provided ballast tanks inspection reports, the DB inboard WT girder, shell, transverse forward and aft bulkhead, side wing inb longitudinal bulkhead, and inb longitudinal bulkhead of some of the ballast tanks were reported to be in fair condition.	Maintenance should be carried out to improve the condition of the ballast tanks.
	Engine Room and Machinery	Defect ID: 58-834-967 As per the provided running hours document dated February 2026, some of the listed items were observed to have negative recorded running hours since last overhaul including but not limited to the valve clearance check of all cylinder units of Auxiliary Engine No.2, fuel valves cleaning, adjustment, and valve clearance of all cylinder units of Auxiliary Engine No.2, spindle speed check and ball bearings of spindle replacement of the ME LO Separator, and oil filter change of steering system 2. This is recommended to be further investigated to ensure that these items are not overdue.	Further investigation is recommended.
	Engine Room and Machinery	Defect ID: 58-859-528 As per the provided critical spares list dated 28-Feb-26, the FO high pressure pipe for the Main Engine and the Sleeve for the UV lamp of the Ballast Water Treatment system were recorded to have no available stock onboard. It was noted that order numbers were remarked in these items. It was also noted that the minimum ROB for the FO high-pressure pipe for the Main Engine was stated to be 0.	Further investigation is recommended and ensure that adequate critical spares are available onboard.
	Engine Room and Machinery	Defect ID: 58-859-542 As per the provided running hours document dated February 2026, some of the items were found to be almost due the recorded intervals including but not limited to the service of the Main Engine oil mist detector, service of the generator bearings of Auxiliary Engines No.1,2,3, replacement of the clutch shoes and ball bearings of spindle for the HFO Separator 1, and the coarse screen filter check and settling/clarifier tank inspection of the sewage plant.	Further investigation is recommended.
	Engine Room and Machinery	Defect ID: 58-863-627 According to the information provided by the crew, the bow thruster was reported to be non-operational.	Further investigation is recommended as no further information was provided by the crew and remedial repairs should be carried out as soon as practical to improve the operational condition of the bow thruster.

	Safe Working Environment	Defect ID: 58-863-630 Some of the floor plating of the engine space was found to have missing securing bolts, which increases the risk of slip and trip hazards in the area.	Replace the missing securing bolts of the engine room floor plating.
	Ballast Tanks and Systems	Defect ID: 58-871-827 Based on the provided ballast tanks photographs, prominent corrosion and coating breakdown were pictured in some areas of the ballast tanks and fittings such as access manhole, ladders, structural framing, framing edges, pipes, and weld seams. Spot of heavy corrosion was reported on the welded parts of the frames, longitudinal, beams, air vent access hole, entrances access and stiffeners of No.4BS. Slight to moderate spot rust formation was reported in the Fore Peak Tank.	Maintenance should be carried out to improve the condition of the ballast tanks and fittings.
	Engine Room and Machinery	Defect ID: 58-920-969 As per the provided lube oil analysis report dated 03-Dec-25 and 02-Feb-26, two cautionary alerts were issued for the Bow thruster and Stern tube lube oil samples. The Bow thruster and Stern tube lube oil samples were reported to have higher than normal TAN readings.	The oils should be refreshed/partially replenished and retested as soon as practical.
	Mooring Decks	Defect ID: 58-933-251 The last brake test was not seen to be stenciled on the mooring winches. According to the provided information by the crew, the last test was done during the vessel's last dry dock. However, no supporting documents were provided for review.	The date of the last brake test should be stencilled on the mooring winches when possible.
	Ballast Tanks and Systems	Defect ID: 58-937-361 Based on the provided ballast tanks inspection reports, the ladders and platforms, sounding pipe/cap/striker plate, other internal piping, and suction/delivery pipe/valve/mouth of some of the ballast tanks were reported to be in fair condition. The ladders and platforms of No.3BP Heeling tank were reported to be in poor condition.	Maintenance should be carried out to improve the condition of the ballast tanks' fittings.
	Ballast Tanks and Systems	Defect ID: 58-945-552 Based on the provided ballast tanks inspection reports, some areas of the ballast tanks were reported to have fair coating condition. The No.4BS was reported to have fair coating condition in all areas of the tank.	Maintenance should be carried out to improve the condition of the ballast tanks.
	Accommodation	Defect ID: 58-974-228 Galley floor drain channel was found dirty with accumulated grease.	Regular cleaning is recommended.

	Mooring Decks	Defect ID: 58-826-753 Some of the mooring machinery were found to have signs of developing corrosion on its warping drums and tension drums.	Maintenance should be carried out to reduce further development of corrosion.
	Mooring Decks	Defect ID: 58-871-810 Some of the mooring ropes were found to have signs of wear and fraying.	Further monitoring is recommended and carry out investigation to verify the service life of the mooring ropes. It is recommended to replace the mooring ropes that have exceeded its service life or are in deteriorated condition.
	Accommodation	Defect ID: 58-929-158 A missing tile was seen in the refrigerating room.	Areas of deteriorated coverings should be rectified when possible.

GRADING REPORT

- ⌘ Design and Construction
- ⌘ Hull
- ⌘ Mooring Decks
- ⌘ Weather Decks and Fittings
- ⌘ Ballast Tanks and Systems
- ⌘ Accommodation
- ⌘ Bridge and Navigation Equipment
- ⌘ Engine Room and Machinery
- ⌘ Fire Fighting Equipment and Systems
- ⌘ Lifesaving Appliances
- ⌘ Safe Working Environment
- ⌘ Pollution Control
- ⌘ Onboard Management
- ⌘ Vessel Capabilities and Cargo Systems

GRADING REPORT/

DESIGN AND CONSTRUCTION



[Review Technical Report](#)

The construction and design was found to be good overall, with the vessel built to IACS standards and Rules in Poland by Gdanska Stocznia Grupa Gdynia with the keel laid on 27-Aug-01. The vessel is a Container Ship (Fully Cellular), with 4 cargo holds, driven by a fixed pitch, direct drive propeller. The Main Engine is a NOx Tier 1, MAN B&W, and the vessel has 3 Auxiliary Engines and no shaft generator. It is not on the Enhanced Survey Program or Extended Dry Docking schedule and does not hold a Class notation for In-Water Surveys. 2 Cargo Lifting Appliances are fitted. No UTM report was made available for review. No additional Bridge or communication equipment was fitted apart from those required by international rules and regulations, though the engine room and machinery were fitted with an engine power limiter, UMS capabilities, and a 2-stroke engine mechanical lubricator.

Defects

No defects

Positive items

Description	
	Positive ID: 1-992-359-939 The following additional engine room machinery is installed: engine power limiter (EPL)

GRADING REPORT/

HULL






[Review Technical Report](#)

The hull was seen to be in a fair to good overall condition based on the number of indentations seen on the inspected areas of the ship's hull. The hull was able to be inspected from the starboard side only. The vessel was found to be free of major structural defects, however, minor indentations and signs of rib caging were seen on the forebody and afterbody of the ship's hull. The inspected areas of the ship's hull were found to have only minor scattered surface and spot corrosion, up to approximately 5% of the surface area, mainly located on the bulbous bow, boot top, and weld seams with fender marks and coating abrasion seen in some areas of the ship's hull. Hull markings were well-painted and legible with no marine fouling observed. The vessel's last bottom survey was credited on 07-Sept-25, with the vessel's next bottom survey due by 31-Mar-27.

Defects

Priority	Description	Recommendations
	Defect ID: 58-785-792 Minor indentations and signs of rib caging were seen on the forebody and afterbody of the ship's hull.	For information only.

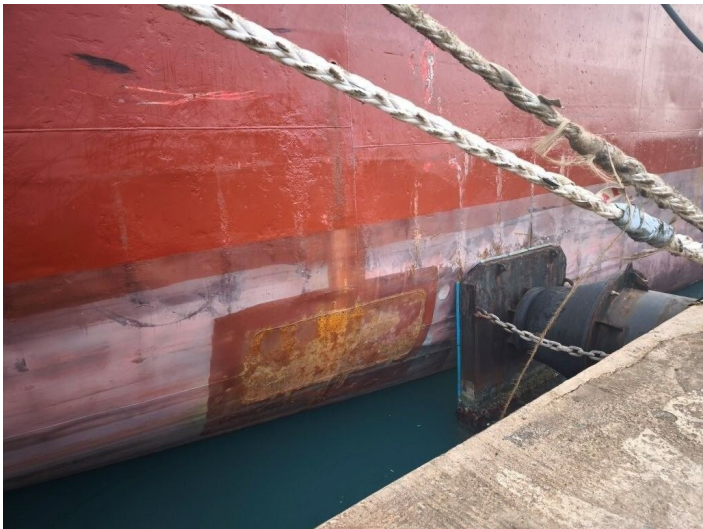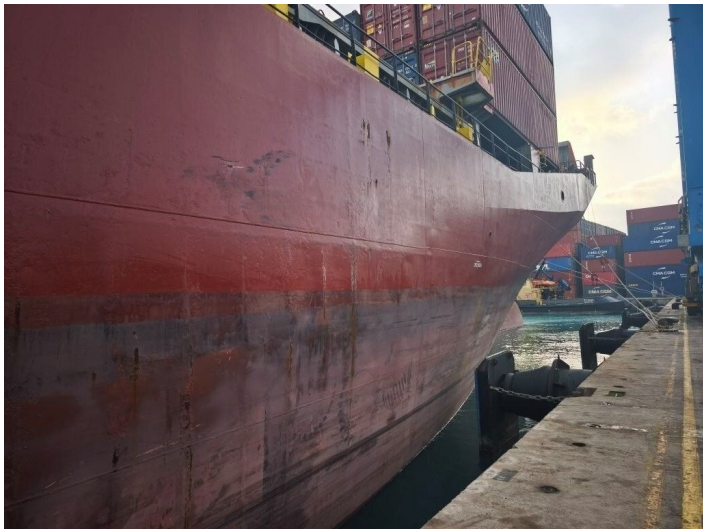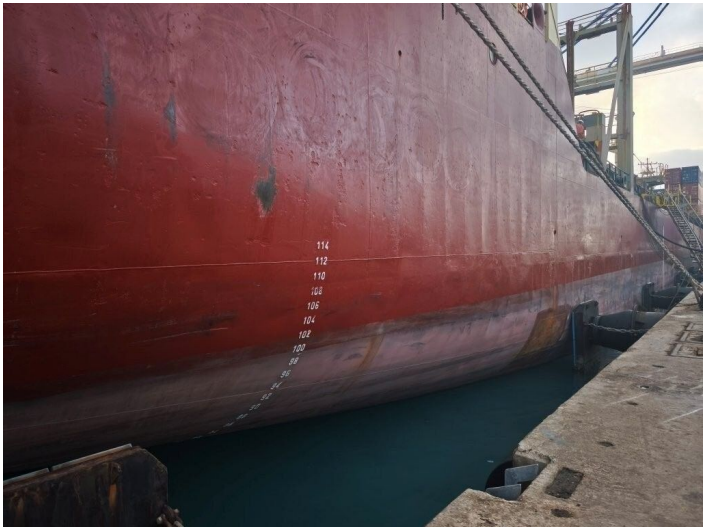

The Mooring decks were seen to be in a good condition overall with the decks found to be free of structural defects and had only minor localised surface corrosion, up to approximately 5% of the mooring deck plating total surface area, mainly located on the surrounding deck plating areas of the mooring machinery and fittings. Deck fittings were found to be in good condition with fairleads and mooring rollers free to turn when tested. All Electric windlasses and winches were reported to be fully operational. Mooring machinery was in generally good condition with coating abrasion and signs of developing corrosion observed on the warping drums and tension drums of some of the mooring machinery. The band brake linings were seen to have substantial thicknesses. Anchor chains were in good condition, and the mooring ropes were in generally good condition with discoloration and signs of wear and fraying seen on some of the mooring ropes. Mooring practices were seen to be good, and snap-back zone warnings were seen to be posted at the entrances to mooring areas as per industry best practice. The Bosun's store was found to be in good structural condition with no visible damage sighted or reported and with coatings fully intact with no significant corrosion or coating breakdown. Housekeeping was fairly neat, with some scattered equipment seen. The bitter end release arrangements were seen to be clear and unobstructed, and the emergency towing booklet was seen to be available near the Foc'sle.

Defects

Priority	Description	Recommendations
	Defect ID: 58-933-251 The last brake test was not seen to be stenciled on the mooring winches. According to the provided information by the crew, the last test was done during the vessel's last dry dock. However, no supporting documents were provided for review.	The date of the last brake test should be stencilled on the mooring winches when possible.
	Defect ID: 58-826-753 Some of the mooring machinery were found to have signs of developing corrosion on its warping drums and tension drums.	Maintenance should be carried out to reduce further development of corrosion.



**Defect ID: 58-871-810**

Some of the mooring ropes were found to have signs of wear and fraying.

Further monitoring is recommended and carry out investigation to verify the service life of the mooring ropes. It is recommended to replace the mooring ropes that have exceeded its service life or are in deteriorated condition.



GRADING REPORT/

WEATHER DECKS AND FITTINGS



[Review Technical Report](#)

The Weather Decks and Fittings were seen to be in good condition overall, with the decks found to be free of structural defects and had only minor localised surface corrosion, up to approximately 5-10% of the main deck plating total surface area, mainly located on the cross decks, deck plating and deck cell guides located at the forward of the superstructure, and surrounding deck plating areas of some of the weather deck fittings. Deck fittings were found to be in good condition with pipework and fittings free of leakages. The accommodation ladders and gangways were in a good overall condition, with no notable defects found, as were provisions lifting appliances.

Defects

No defects

GRADING REPORT/

BALLAST TANKS AND SYSTEMS


60

[Review Technical Report](#)

Ballast tanks and systems were deemed to be in a fair overall condition based on the following; Based on the provided ballast tanks inspection reports, the tank remote gauging systems of No.3BS and No.3BP Heeling tank, No.2BS, No.2BP, No.1B2PS, No.1B1SS, No.1B1PS, No.1A2 SS, No.1A2P, No.4BS, No.4B, No.3AS, No.3AP, No.2AS, No.2AP, No.1B2S, No.1A1, No.3S DBT, No.3P DBT, No.2S DBT, No.2P DBT, No.4 DBT WBT, Fore Peak, and Aft Peak Tank were reported to be out of order or in poor condition. Based on the provided ballast tanks inspection reports, some areas of the ballast tanks were reported to have fair coating condition. The No.4BS was reported to have fair coating condition in all areas of the tank. Based on the provided ballast tanks inspection reports, the ladders and platforms, sounding pipe/cap/striker plate, other internal piping, and suction/delivery pipe/valve/mouth of some of the ballast tanks were reported to be in fair condition. The ladders and platforms of No.3BP Heeling tank were reported to be in poor condition. Based on the provided ballast tanks inspection reports, the DB inboard WT girder, shell, transverse forward and aft bulkhead, side wing inb longitudinal bulkhead, and inb longitudinal bulkhead of some of the ballast tanks were reported to be in fair condition. Based on the provided ballast tanks photographs, prominent corrosion and coating breakdown were pictured in some areas of the ballast tanks and fittings such as access manhole, ladders, structural framing, framing edges, pipes, and weld seams. Spot of heavy corrosion was reported on the welded parts of the frames, longitudinal, beams, air vent access hole, entrances access and stiffeners of No.4BS. Slight to moderate spot rust formation was reported in the Fore Peak Tank. No.2P/S WBT were entered for inspection, and low-quality photographs of previous tank entries reportedly taken on 04-Sept-25 were provided by the vessel or relevant party for review. The inspected ballast tanks were found to be generally free of significant structural defects and had only minor scattered surface and spot corrosion, up to approximately 5% of the ballast tanks' total surface area, mainly located on the free edges, plating edge intersection, weld seams, and crop-repaired areas. As far as could be inspected, the inspected ballast tank fittings such as ladders and pipework were seen to be in fair to good condition as some of the pipes and ladders of the inspected ballast tanks were found to have areas with developing corrosion and signs of coating breakdown. In the provided photographs, tanks are shown with a minimal amount of mud/sediment accumulation but were free of any signs of staining from sewage or marine fouling. All ballast pumps were in good working order and in good visual condition.

Defects

Priority	Description	Recommendations
	Defect ID: 58-896-389 Based on the provided ballast tanks inspection reports, the tank remote gauging systems of No.3BS and No.3BP Heeling tank, No.2BS, No.2BP, No.1B2PS, No.1B1SS, No.1B1PS, No.1A2 SS, No.1A2P, No.4BS, No.4B, No.3AS, No.3AP, No.2AS, No.2AP, No.1B2S, No.1A1, No.3S DBT, No.3P DBT, No.2S DBT, No.2P DBT, No.4 DBT WBT, Fore Peak, and Aft Peak Tank were reported to be out of order or in poor condition.	Corrective actions are to be carried out to improve the operational condition of the ballast tanks' remote gauging systems.
	Defect ID: 58-781-700 Some of the pipes and ladders of the inspected ballast tanks were found to have areas with developing corrosion and signs of coating breakdown.	Maintenance should be carried out to improve the condition of the ballast tanks' fittings.

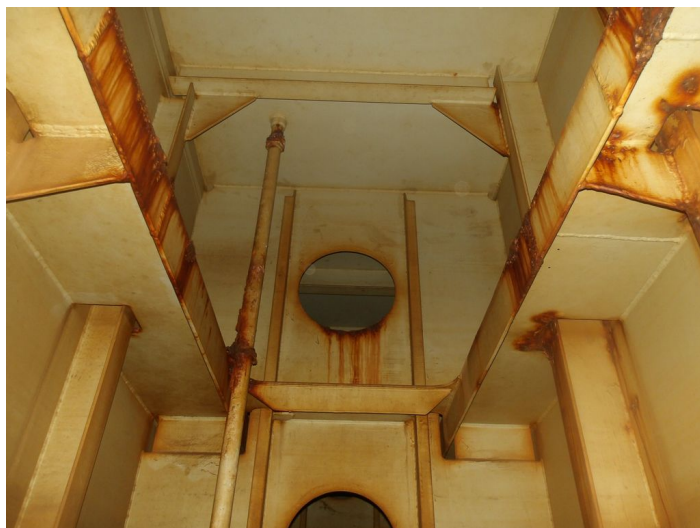**Defect ID: 58-822-674**


Based on the provided ballast tanks inspection reports, the DB inboard WT girder, shell, transverse forward and aft bulkhead, side wing inb longitudinal bulkhead, and inb longitudinal bulkhead of some of the ballast tanks were reported to be in fair condition.

Maintenance should be carried out to improve the condition of the ballast tanks.

**Defect ID: 58-871-827**

Based on the provided ballast tanks photographs, prominent corrosion and coating breakdown were pictured in some areas of the ballast tanks and fittings such as access manhole, ladders, structural framing, framing edges, pipes, and weld seams. Spot of heavy corrosion was reported on the welded parts of the frames, longitudinal, beams, air vent access hole, entrances access and stiffeners of No.4BS. Slight to moderate spot rust formation was reported in the Fore Peak Tank.

Maintenance should be carried out to improve the condition of the ballast tanks and fittings.

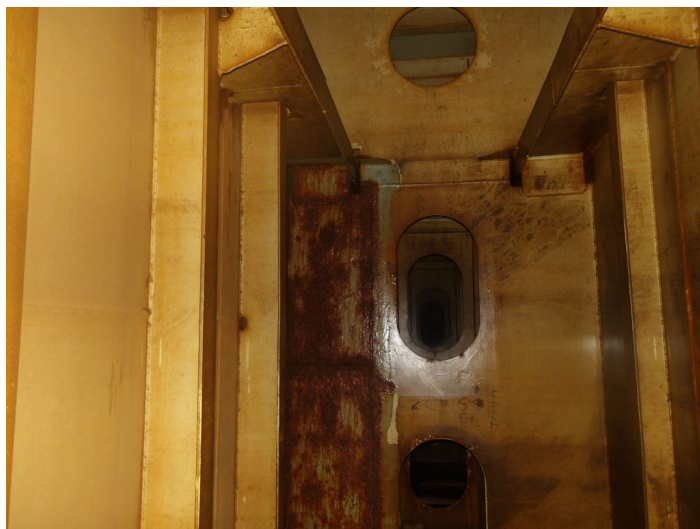

**Defect ID: 58-937-361**

Based on the provided ballast tanks inspection reports, the ladders and platforms, sounding pipe/cap/striker plate, other internal piping, and suction/delivery pipe/valve/mouth of some of the ballast tanks were reported to be in fair condition. The ladders and platforms of No.3BP Heeling tank were reported to be in poor condition.

Maintenance should be carried out to improve the condition of the ballast tanks' fittings.

**Defect ID: 58-945-552**

Based on the provided ballast tanks inspection reports, some areas of the ballast tanks were reported to have fair coating condition. The No.4BS was reported to have fair coating condition in all areas of the tank.

Maintenance should be carried out to improve the condition of the ballast tanks.

GRADING REPORT/

ACCOMMODATION

70

Review Technical Report

The accommodation areas were seen to be in a fair to good condition overall based on the following; A missing tile was seen in the refrigerating room. Ice accumulation was seen on some sections of the cold room refrigeration pipework. The galley floor drain channel was found dirty with accumulated grease. The wall coverings were found to be in generally good condition, and the upholstery and furniture were found to be free from deterioration and defects. The levels of housekeeping and cleanliness were found to be good with levels of hygiene also seen to be good in the sanitary facilities. The hospital was seen to be well equipped and ready for use with the drugs seen to be controlled and secured, and with the associated drugs log kept up to date. The accommodation was found to be outfitted to an average quality. The Air Handling Unit (AHU) was found to be maintaining a comfortable temperature and was seen to be in good condition with no defects. The galley equipment was deemed to be in a good overall condition with all equipment reportedly in good working order. The galley was found to be in a clean condition with the galley hoods also found to be kept clean. Provision stores' temperatures were seen to be at the correct levels. The external superstructure was found to be free of structural defects and had only minor localised surface and spot corrosion, up to approximately 5% of the surface area, mainly located on the free edges and external decks of the accommodation. The external superstructure fittings such as lighting, vent heads, windows/portholes, stairways, railings, etc., were seen to be in a good overall condition with all external accommodation doors in good working order and properly closing. The vessel's Crew Welfare was found to be good overall. The average contract length was reported to be 6 Months for the vessel's Officers and 9 Months for the vessel's crew, with it noted that a crew suggestion policy was seen to be in place. The vessel was reported to have paid to access and limited use Wi-Fi onboard, which was available to all crew. It was reported that the approximate average internet speed was very fast, indicating the crew could stream HD videos with ease. The vessel was seen to have various pieces of public recreational equipment that the crew could access, including free weights, fixed weight machine, cycling machine, table tennis, swimming pool, television, games console, karaoke, entertainment library - books, DVDs, games, etc., public computer, and en-suite facilities for all crew members. This equipment was found to be in good overall condition. As per crew reports, access is provided to catering facilities at all times. It was seen that various facilities were provided in all crew cabins, including a sofa and a desk. It was also stated that the crew has access to a well-stocked bond store. It was stated that the vessel has onboard training facilities as provided by One Learn, with it also noted as per crew reports, additional periods of rest were given throughout the working week.

Defects

Priority	Description	Recommendations
	Defect ID: 58-818-567 Ice accumulation was seen on some sections of the cold room refrigeration pipework.	Further investigation is recommended.





Defect ID: 58-974-228

Galley floor drain channel was found dirty with accumulated grease.

Regular cleaning is recommended.



Defect ID: 58-929-158

A missing tile was seen in the refrigerating room.

Areas of deteriorated coverings should be rectified when possible.



Positive items

Description	
	Positive ID: 1-992-491-009 The vessel is reportedly fitted with paid to access limited use Wi-Fi system

GRADING REPORT/

BRIDGE AND NAVIGATION EQUIPMENT



[Review Technical Report](#)

The Bridge and navigation equipment were found to be in good condition overall with housekeeping found to be good, and with all bridge equipment reported to be fully operational. The vessel's S-VDR was found to be free from any unanticipated alarms with collection instructions posted nearby, and with the Bridge Navigation Watch Alarm System (BNWAS) reported to be fully operational. The vessel's primary means of navigation, as listed on form E of the safety equipment certificate, is a dual ECDIS system, which was found to be up to date. An in-date compass deviation card was seen to be posted near the helm, and the compass deviation log was well maintained and without any major deviations. The vessel is licensed to cover GMDSS sea areas A1, A2, and A3 and had a valid shore-servicing agreement in place. The radio batteries were seen to be well maintained and in good condition, and the EPIRB, SART, and VHF handheld batteries were all in date as required. Berth-to-berth passage plans were seen on board and were signed by all navigating officers with nautical publications provided in Electronic format. Master's standing and night orders were found to be signed by all navigating officers with the bridge log book correctly filled in, and the GMDSS logbook was also up to date and correctly filled in. The Monkey Island was found to be in a good overall condition with the mast, aerials, and antennas seen to be satisfactory and free of defects.

Defects

No defects

GRADING REPORT/

ENGINE ROOM AND MACHINERY

60

Review Technical Report

The Engine room and machinery were found to be in a fair overall condition based on the open Condition of Class related to this section and the following; As per the Condition of Class No. CC122, it was stated that the alternator of main generator No.1 needs to be repaired and tested to the satisfaction of a DNV surveyor. Until final repair the mitigating action as per risk assessment to be followed. Tug assistance to be requested based on master decision. The postponed due date of this Condition of Class is 05-Apr-26. It was noted that the turbocharger and alternator of Auxiliary Engine No.1 were under repair during the time of inspection. Leak stains were seen on the external casing of the Main Engine, and Signs of leakage were seen on one of the fuel injector pumps of the Main Engine. According to the information provided by the crew, the bow thruster was reported to be non-operational. Oil leakage was seen on the surface of the steering gear. As per the provided running hours document dated February 2026, the burner fuel filter of the auxiliary boiler burner was overdue for the biannual service. No significant defects were reported or observed. The general levels of housekeeping and cleanliness in the engine room were found to be good. During the inspection the auxiliary engines, purifiers, pumps, sewage treatment plant, auxiliary boiler, refrigeration compressor, and air conditioning compressor were seen running. A review of the supplied main engine running hours showed that no major components were overdue their specified overhaul intervals. It should be noted that for this model of engine, piston overhauls can be extended to 32,000 hours if subject to Condition Based Monitoring (CBM). Upon review of the latest main engine performance report it was noted that there were no areas of concern. As per the provided Inspection through scavenge Ports dated 20-Feb-26, medium deposits were reported on the topland of cylinder units No.1,2,3,4,6, and 7, and ringland 1 of cylinder unit No.3. Light deposits were reported on the ringland 1 of cylinder units No.1,4,5,6, and 7, and topland of cylinder unit No.5. Sludge deposits were reported on the scavenge box of all cylinder units. Propulsion systems such as shafting arrangements were in good working condition. The vessel is fitted with 3 auxiliary engines, which were all reported to be fully operational and were seen to be in good condition with no major visible defects. As per the provided running hours document dated February 2026, some of the items were found to be almost due the recorded intervals including but not limited to the service of the Main Engine oil mist detector, service of the generator bearings of Auxiliary Engines No.1,2,3, replacement of the clutch shoes and ball bearings of spindle for the HFO Separator 1, and the coarse screen filter check and settling/clarifier tank inspection of the sewage plant. As per the provided running hours document dated February 2026, some of the listed items were observed to have negative recorded running hours since last overhaul including but not limited to the valve clearance check of all cylinder units of Auxiliary Engine No.2, fuel valves cleaning, adjustment, and valve clearance of all cylinder units of Auxiliary Engine No.2, spindle speed check and ball bearings of spindle replacement of the ME LO Separator, and oil filter change of steering system 2. This is recommended to be further investigated to ensure that these items are not overdue. Upon review of the latest auxiliary engine performance reports, no concerns were noted on the observed parameters recorded in the provided Auxiliary Engines No.3 performance report. However, based on the provided Auxiliary Engine No.2 performance report dated 20-Feb-26, the performance test was carried out below the recommended load of 70% for accurate readings. It is recommended to redo the test at the recommended load to obtain accurate data readings. It should be noted that the Auxiliary Engine No.1 performance report was not provided for review. The vessel's steam boiler was found to be fully operational and in good overall condition. The Hot Well/Cascade Tank was seen to be in good order and free from contaminants. A review of the supplied boiler and cooling water analysis reports showed no areas of concern. The steering gear was in good working order but wasn't free of leakages. All auxiliary machinery and equipment were reported to be fully operational and were observed in good visual condition. The engine room structure, including bulkheads and frames, was seen to be in good condition, and engine room fittings such as handrails, ladders, floor plates, and lighting were also found in good condition. Engine room pipework was seen to be generally free of significant corrosion and free from leakages. Pipework was free of any temporary repairs including soft patches. Pipework insulation lagging was seen to be clean and intact, and anti-splash tape was seen to be in place at all required pipe connections. Bilge alarms were found to be fully operational during testing. All Engine Control Room automation and monitoring systems were found to be fully operational and with no serious active alarms present. No concerning engine room control system alarms were seen on the manually blocked/disabled alarm list. The engine room deadman and engineer call alarms were found to be fully operational during testing. According to the provided information, the vessel was found to not be equipped with all required critical spares as recommended by the Safety Management System (SMS). As per the provided critical spares list dated 28-Feb-26, the FO high pressure pipe for the Main Engine and the Sleeve for the UV lamp of the Ballast Water Treatment system were recorded to have no available stock onboard. It was noted that order numbers were remarked in these items. It was also noted that the minimum ROB for the FO high-pressure pipe for the Main Engine was stated to be 0. Further investigation is recommended and ensure that adequate critical spares are available onboard. As per the provided lube oil analysis report dated 03-Dec-25 and 02-Feb-26, two cautionary alerts were issued for the Bow thruster and Stern tube lube oil samples. The Bow thruster and Stern tube lube oil samples were reported to have higher than normal TAN readings. The supplied fuel oil analysis reports showed no alerts or abnormal findings. It was noted from the provided MGO fuel analysis report (interim) dated 05-Mar-26, the final report was not yet available as the HFRR lubricity test was in progress. It should be noted that expert comments and suggestions and recommendations for pour point and sulphur were recorded in the provided IFO fuel analysis report dated 11-Feb-26. Further review is recommended. Engine room documentation such as the engine room log book, standing orders, NOx technical file, etc., was reviewed and found to be well-maintained and up to date. All machinery and equipment manuals were reported to be available onboard. Package air conditioning units around the vessel were all operational and in good condition. Electrical distribution systems including the main and emergency switchboards were in good working order with all insulation

readings seen to be adequate. Recent Megger test reports were seen with no abnormal findings. The emergency generator was tested during the inspection and found to be in good working order and was in good overall condition.

Defects

Priority	Description	Recommendations
	Defect ID: 58-826-776 As per the Condition of Class No. CC122, it was stated that the alternator of main generator No.1 needs to be repaired and tested to the satisfaction of a DNV surveyor. Until final repair the mitigating action as per risk assessment to be followed. Tug assistance to be requested based on master decision. The postponed due date of this Condition of Class is 05-Apr-26.	It was noted that the turbocharger and alternator of Auxiliary Engine No.1 were under repair during the time of inspection. Further investigation is recommended as repairs were still in progress after the Idwal inspection.
	Defect ID: 58-937-365 As per the provided running hours document dated February 2026, the burner fuel filter of the auxiliary boiler burner was overdue for the biannual service.	Further investigation is recommended, and carry out corrective actions to rectify the overdue item.
	Defect ID: 3-254-931-456 Oil leakage was seen on the surface of the steering gear.	Further investigation is recommended to determine the cause of the leakage and carry out corrective actions to rectify the leakage.
		
	Defect ID: 58-724-362 Leak stains were seen on the external casing of the Main Engine, and Signs of leakage were seen on one of the fuel injector pumps of the Main Engine.	Leak stains on the external casing of the Main Engine should be cleaned and carry out further checks to verify any active leakages. Carry out corrective actions to rectify the leakages.

**Defect ID: 58-834-967**

As per the provided running hours document dated February 2026, some of the listed items were observed to have negative recorded running hours since last overhaul including but not limited to the valve clearance check of all cylinder units of Auxiliary Engine No.2, fuel valves cleaning, adjustment, and valve clearance of all cylinder units of Auxiliary Engine No.2, spindle speed check and ball bearings of spindle replacement of the ME LO Separator, and oil filter change of steering system 2. This is recommended to be further investigated to ensure that these items are not overdue.

Further investigation is recommended.

**Defect ID: 58-859-528**

As per the provided critical spares list dated 28-Feb-26, the FO high pressure pipe for the Main Engine and the Sleeve for the UV lamp of the Ballast Water Treatment system were recorded to have no available stock onboard. It was noted that order numbers were remarked in these items. It was also noted that the minimum ROB for the FO high-pressure pipe for the Main Engine was stated to be 0.

Further investigation is recommended and ensure that adequate critical spares are available onboard.

**Defect ID: 58-859-542**

As per the provided running hours document dated February 2026, some of the items were found to be almost due the recorded intervals including but not limited to the service of the Main Engine oil mist detector, service of the generator bearings of Auxiliary Engines No.1,2,3, replacement of the clutch shoes and ball bearings of spindle for the HFO Separator 1, and the coarse screen filter check and settling/clarifier tank inspection of the sewage plant.

Further investigation is recommended.

**Defect ID: 58-863-627**

According to the information provided by the crew, the bow thruster was reported to be non-operational.

Further investigation is recommended as no further information was provided by the crew and remedial repairs should be carried out as soon as practical to improve the operational condition of the bow thruster.

**Defect ID: 58-920-969**

As per the provided lube oil analysis report dated 03-Dec-25 and 02-Feb-26, two cautionary alerts were issued for the Bow thruster and Stern tube lube oil samples. The Bow thruster and Stern tube lube oil samples were reported to have higher than normal TAN readings.

The oils should be refreshed/partially replenished and retested as soon as practical.

GRADING REPORT/

FIRE FIGHTING EQUIPMENT AND SYSTEMS

80

[Review Technical Report](#)

Fire Fighting Equipment and Systems were found to be in good condition overall and generally free of fire hazards with all firefighting equipment seen to be regularly serviced and inspected. The fire detection and alarm system was found to be fully operational and was free of signs of tampering and alarms. The vessel is fitted with CO2 fixed firefighting in the engine room, CO2 for the cargo areas, and Galley CO2 in the accommodation. Fixed firefighting systems were all reported to be in good working condition with operating instructions clearly posted. The main and emergency fire pumps were reportedly fully operational, and both were found to be in good condition, free of leakages. A fire pump was tested during the inspection and was found to deliver adequate pressure. The fire main and ancillaries such as hydrants and valves were in good overall condition, free of defects. Fire extinguishers were all in good condition, and all portable equipment was positioned in accordance with the fire plan. Firefighting outfits and associated equipment were all in good condition with BA equipment found fully charged and ready for use. Remote shutdown emergency devices such as quick-closing valves, machinery stops, and ventilation dampers were deemed to be in a good overall condition with no defective shutdown equipment. The fire doors were found to be in good condition, closing effectively and free from any unauthorised 'hold-open' arrangements.

Defects

No defects

GRADING REPORT/

LIFESAVING APPLIANCES



 Review Technical Report

Lifesaving appliances were seen to be in a good overall condition with all equipment regularly serviced and inspected as required. The vessel is fitted with 1 free-fall lifeboat, which was seen to be in good overall condition externally and internally. The lifeboat engine was tested during the inspection and found to be in good working order. The vessel's rescue boat was found to be in a good overall condition and ready for immediate use. The vessel is equipped with 3 life rafts, which were found to be in good condition with Hydrostatic Release Units (HRUs) in date and correctly rigged. Davits and lowering arrangements were found to be in good condition overall with evidence of regular maintenance, servicing, and inspection sighted and evident. Ancillary lifesaving equipment such as lifejackets, immersion suits, EEBDs, etc., was found to be in good condition and ready for immediate use with man overboard smoke and light signals seen to be in date. Embarkation ladders were found to be in a good, well-maintained condition with the pyrotechnics and line-throwing apparatus found to be stored appropriately and within their expiry dates.

Defects

No defects

SAFE WORKING ENVIRONMENT

Safe working was deemed to be fair to good overall based on the following; Some of the floor plating of the engine space was found to have missing securing bolts, which increases the risk of slip and trip hazards in the area. The protective cover for the ER workshop lathe machine was found missing. The Hot well covers were found to have loose or missing bolts. No unsafe practices were observed during the inspection. Hazards were seen to be clearly marked and external walkways adequately coated with non-slip paint and free of trip hazards. Adequate PPE was seen to be worn by the crew at all times, and portable gas detection meters were provided and calibrated. Hazardous substances were seen to be generally safely managed with appropriate Material Safety Data Sheets provided. Risk Assessments (RA) were seen to be up to date and satisfactory with enclosed space entry procedures followed and an effective Permit To Work (PTW) system in place. Main and emergency exits were clearly identified and unobstructed with all IMO signage seen to be satisfactory. The pilot ladder was seen to be in good condition and was secured in a safe manner. Regular drills were conducted on board with the last drill conducted on the 28-Feb-26, which was an ISPS drill.

Defects

Priority	Description	Recommendations
----------	-------------	-----------------




Defect ID: 3-775-029-248
The protective cover for the ER workshop lathe machine was found missing. The Hot well covers were found to have loose or missing bolts.

Corrective actions are to be carried out to rectify the defects.



Defect ID: 58-863-630
Some of the floor plating of the engine space was found to have missing securing bolts, which increases the risk of slip and trip hazards in the area.

Replace the missing securing bolts of the engine room floor plating.

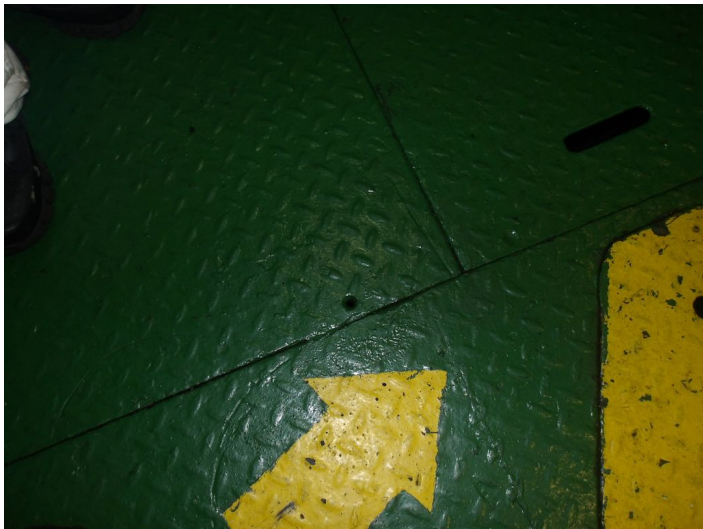

GRADING REPORT/

POLLUTION CONTROL



[Review Technical Report](#)

Pollution control was deemed to be good overall and generally found to be well implemented on board with the vessel free of pollution hazards. The vessel holds a Class-approved Inventory of Hazardous Materials, which is required for entry into EU ports. The vessel's Oily Water Separator (OWS) was found to be fully operational and in good overall condition, with no obvious defects. The OWS was simulation tested during the inspection, and the 15ppm Oil Content Meter (OCM) was seen to be calibrated. The bilge overboard was seen to be sealed and locked against unauthorised opening, and the oily water treatment system as a whole was seen to be free from signs of tampering or unauthorised modification. The SOPEP locker or box was found to be well stocked with SOPEP equipment in good condition, and an accurate list of equipment was posted nearby. The Oil Record Book (ORB) was seen to be well-maintained and up-to-date, with the last entry on 02-Mar-26. It was reported that a US coastguard approved Ballast Water Treatment System (BWTS) is fitted, which was reported to be fully operational and in good overall condition. The vessel's ballast record book was seen to be up to date and correctly filled in. The vessel is reportedly using an Environmentally Acceptable Lubricant (EAL) in the stern tube and is therefore Vessel General Permit (VGP) compliant in this regard. The vessel's sewage treatment plant was found to be fully operational and in good overall condition, with no obvious defects. Garbage segregation was found to be good, with adequate, labelled containers and garbage seen to be well sorted, and containers were seen to be made of approved non-combustible materials. The Garbage Record Book (GRB) was seen to be well-maintained and up-to-date, with the last entry on 08-Mar-26. The Emission Control Area (ECA) change-over logbook was reviewed and found to be satisfactory with the date of last entry on 24-Apr-25. No incinerator is fitted on the vessel, and combustible garbage is landed ashore for processing. The vessel complies with IMO 2020 regulations by employing the use of Very Low Sulphur Fuels Oils (VLSFO) with a sulphur content of less than 0.5%.

Defects

No defects

Positive items

Description	
	Positive ID: 1-992-519-684 The vessel is reportedly using an Environmentally Acceptable Lubricant (EAL) in the stern tube and is therefore Vessel General Permit (VGP) compliant in this regard.
	Positive ID: 1-992-544-256 It was reported that a USCG approved BWTS is installed

GRADING REPORT/

ONBOARD MANAGEMENT



[Review Technical Report](#)

Onboard management was found to be fair to good overall based on the backlog of maintenance observed in some areas of the vessel. The computer-based Safety Management System (SMS) was deemed to be functioning and well implemented in general, with Permits to Work (PTW), risk assessments, and procedures understood and followed. Onboard management was found to deal with accidents, near misses, and deficiencies in an effective manner, and regular safety committee meetings were carried out on board. The vessel's MLC certificate was valid with records of hours of rest (ILO) correct and up to date, and maximum work hours not regularly exceeded. The PMS system was found to be kept up to date with no critical overdue work orders. The type-approved software-based Planned Maintenance System (PMS) was fully integrated with the SMS for ordering of spares and general vessel management. The Port State Control (PSC) history was found to be good to very good with 6 deficiencies and no detentions in the 6 inspections conducted in the past three years. The vessel's flag is not targeted by any Memorandum of Understanding (MoU) or the USCG. The Classification and Certification section was graded fair to good as the vessel has an open Condition of Class. Security access controls were deemed to be satisfactory with the vessel conforming to International Ship and Port Security (ISPS) standards. The Master and crew were prepared for the inspection and provided good cooperation with the majority of requested documents provided.

Defects

Priority	Description	Recommendations
	Defect ID: 1-854-066-688 As per the provided Class Status Report dated 02-Mar-26, multiple surveys including surveys of machinery items were marked as due including but not limited to the loadline annual survey, safety radio periodical, and machinery items.	For information.

VESSEL CAPABILITIES AND CARGO SYSTEMS

Vessel capabilities and cargo systems were deemed to be in a poor overall condition based on the following; The inspected cargo hold No.2 was found to have deformed railings and a sounding pipe. Based on the provided cargo holds inspection reports dated November 2025, the tank manhole covers, bilges/covers, and lighting/electrical were reported to be in fair condition. Several welded cones for containers in the cell guide part inside cargo holds No.2 and No.4 were reported to be missing, and several lamps in cargo holds No.2, No.3, and No.4 were reported to be busted. Signs of wastage were seen on the stacking cones of cargo hold No.2. Signs of wastage and deformation were seen on localized areas of the hatch covers' edges. Some areas of the hatch cover cross joints' rubber gaskets were found worn and in deteriorated condition, and gaps were seen on the hatch cover rubber seals of some of the hatch covers. One of the hatch covers was found missing half of the rubber gasket of its cross joint. Some sections of some of the hatch covers' retaining channels were found to have signs of wastage. The coaming guide of hatch coaming No.1 forward starboard was found damaged. Signs of wear were seen on the hatch coaming landing pads, and hatch cover support pads. Some sections of the hatch sills were found to have damage and prominent levels of corrosion. Based on the provided cargo hold No.4 inspection report dated 28-Nov-25, the watertightness and rubber packing of the hatch cover were reported to be in fair condition. Based on the provided cargo holds No.2 and No.3 inspection reports dated November 2025, the watertightness, rubber packings, and top coatings were reported to be in fair condition. Based on the provided cargo hold No.1 inspection report dated 24-Nov-25, the underside, bearer pads, and rubber packings of the hatch cover were reported to be in fair condition. Based on the provided cargo holds No.2, No.3 and No.4 inspection reports dated November 2025, the fitting cleats of the coaming structure/fittings were reported to be in fair condition. Signs of wastage and developing corrosion were seen on some areas of the coamings' cross deck walkways. Based on the provided cargo holds No.2, No.3, and No.4 inspection reports dated November 2025, the tanktop, and the forward, aft, port and starboard coaming externals were reported to be in fair coating condition. Based on the provided cargo hold No.1 inspection report dated 24-Nov-25, the aft, port, and starboard coaming externals were reported to be in fair coating condition. Hydraulic oil leakages were seen on the motor and hydraulic platform of cargo crane No.2. Cargo Hold No.2 was entered for inspection, and photographs of previous hold entries reportedly taken in Nov-25 were provided for review. Inspection reports were also provided for review. Based on the provided cargo hold photographs, minor indentations were pictured on the forward bulkhead of Bay 26, and aft bulkhead of bay 6. The inspected cargo hold was found to have only minor localised spot corrosion, up to approximately 5% of the surface area, mainly located on the tanktop, weld seams, and free edges with rust stains seen in some areas of the cargo hold bulkheads. One of the vertical guides on the port bulkhead of cargo hold No.2 was found to have minor deformation. Based on the provided cargo hold photographs, minor deformation was pictured on one of the cell guides of bay 26. All cargo monitoring systems were fully operational. The inspected cargo hold was free of signs of water ingress both from internal and external sources. Mechanical ventilation systems were in good working order. The vessel is fitted with pontoon hatch covers. Hatch covers were found to have only minor scattered pitting and spot corrosion, up to approximately 5-10% of the surface area, mainly located on the free edges, cross joints, and top and side plating with rust stains seen in different areas of the hatch covers. Hatch coamings were found to have minor to moderate localised scaling and spot corrosion, up to approximately 10% of the surface area, mainly located on the coaming table and free edges. Hatch coaming non-return valves were clear and operational. Cargo securing equipment was plentiful with inspection records maintained, and securing equipment in good condition as observed. Stability calculations were seen to be carried out, and the vessel holds a Document of Compliance (DOC) for the carriage of Dangerous Goods (DG). The vessel is equipped to carry 215 Reefer containers whose temperatures were effectively monitored. Reefer sockets were seen in good condition with switchboards free of low insulation or earth faults. The vessel uses its own power for all Reefer containers, without the need for an additional auxiliary power unit. The vessel has 2 cargo lifting appliances. Both Cargo Cranes were being tested by the DNV surveyor in attendance at the time of the inspection and all were reported to be fully operational. Cargo lifting appliance No.2 was available for internal inspection. Lifting appliances were found to be generally free of significant structural defects and were free of significant coating breakdown and corrosion. The inspected cargo crane's wires were in good overall condition. The inspected cargo crane's components, such as sheaves, blocks, and cylinders, were seen to be in a good overall condition with controls and operating positions in good condition and safety devices fully operational. The slewing bearings of the inspected cargo crane were found to be in a good overall condition with evidence of bearing rocking tests conducted and recorded. Lifting appliances were regularly examined by shore-side technicians with maintenance records accurate and up-to-date.

Defects

Priority	Description	Recommendations
----------	-------------	-----------------

**Defect ID: 3-045-142-528**

Based on the provided cargo holds inspection reports dated November 2025, the tank manhole covers, bilges/covers, and lighting/electrical were reported to be in fair condition. Several welded cones for containers in the cell guide part inside cargo holds No.2 and No.4 were reported to be missing, and several lamps in cargo holds No.2, No.3, and No.4 were reported to be busted. Signs of wastage were seen on the stacking cones of cargo hold No.2. The inspected cargo hold No.2 was found to have deformed railings and a sounding pipe.


Corrective actions are to be carried out to improve the condition of the cargo hold fittings.



**Defect ID: 474-017-795**

Some areas of the hatch cover cross joints' rubber gaskets were found worn and in deteriorated condition, and gaps were seen on the hatch cover rubber seals of some of the hatch covers. One of the hatch covers was found missing half of the rubber gasket of its cross joint. Some sections of some of the hatch covers' retaining channels were found to have signs of wastage.

Corrective actions are to be carried out to improve the condition of the hatch cover rubber gaskets and retaining channel.

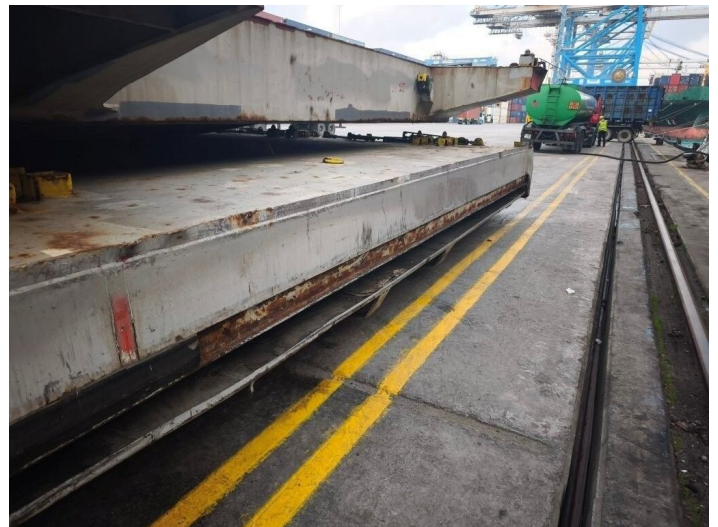



Defect ID: 474-017-797

The coaming guide of hatch coaming No.1 forward starboard was found damaged.

Repairs are to be carried out to improve the condition of the coaming guide.



**Defect ID: 474-116-106**

Based on the provided cargo hold No.4 inspection report dated 28-Nov-25, the watertightness and rubber packing of the hatch cover were reported to be in fair condition. Based on the provided cargo holds No.2 and No.3 inspection reports dated November 2025, the watertightness, rubber packings, and top coatings were reported to be in fair condition. Based on the provided cargo hold No.1 inspection report dated 24-Nov-25, the underside, bearer pads, and rubber packings of the hatch cover were reported to be in fair condition.

Maintenance should be carried out to improve the condition of the hatch covers.

**Defect ID: 474-169-346**

Signs of wastage and deformation were seen on localized areas of the hatch covers' edges.

Repairs are to be carried out to improve the condition of the hatch covers.





Defect ID: 474-189-828

Signs of wear were seen on the hatch coaming landing pads, and hatch cover support pads.

Maintenance should be carried out to improve the condition of the landing pads and support pads.



Defect ID: 473-972-747

Based on the provided cargo holds No.2, No.3, and No.4 inspection reports dated November 2025, the tanktop, and the forward, aft, port and starboard coaming externals were reported to be in fair coating condition. Based on the provided cargo hold No.1 inspection report dated 24-Nov-25, the aft, port, and starboard coaming externals were reported to be in fair coating condition.

Maintenance should be carried out to improve the condition of the cargo holds.



Defect ID: 473-980-929

One of the vertical guides on the port bulkhead of cargo hold No.2 was found to have minor deformation. Based on the provided cargo hold photographs, minor deformation was pictured on one of the cell guides of bay 26.

For information.

**Defect ID: 474-017-801**


Based on the provided cargo holds No.2, No.3 and No.4 inspection reports dated November 2025, the fitting cleats of the coaming structure/fittings were reported to be in fair condition.

Maintenance should be carried out to improve the condition of the fitting cleats.

**Defect ID: 474-116-104**

Signs of wastage and developing corrosion were seen on some areas of the coamings' cross deck walkways.

Maintenance and repairs are to be carried out to improve the condition of the cross deck walkways.

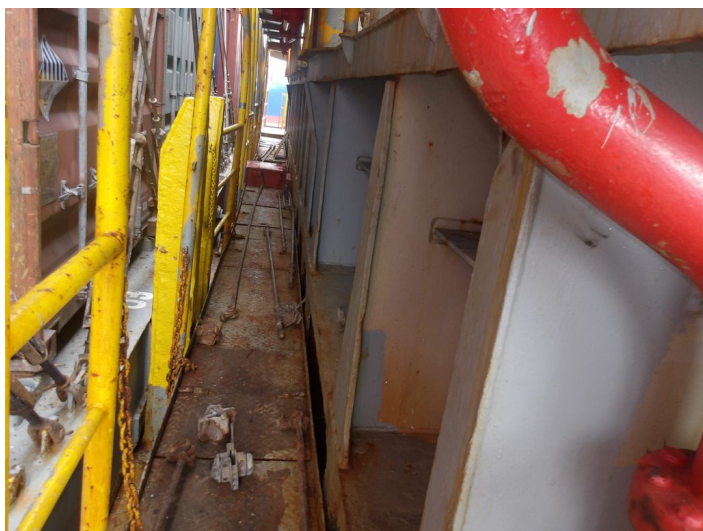**Defect ID: 474-148-864**

Based on the provided cargo hold photographs, minor indentations were pictured on the forward bulkhead of Bay 26, and aft bulkhead of bay 6.

For information only.

**Defect ID: 474-202-118**

Hatch coamings were found to have minor to moderate localised scaling and spot corrosion, up to approximately 10% of the surface area, mainly located on the coaming table and free edges.



Maintenance should be carried out to improve the condition of the hatch coamings.



Defect ID: 474-214-407

Some sections of the hatch sills were found to have damage and prominent levels of corrosion.


Maintenance and repairs are to be carried out to improve the condition of the hatch sills.

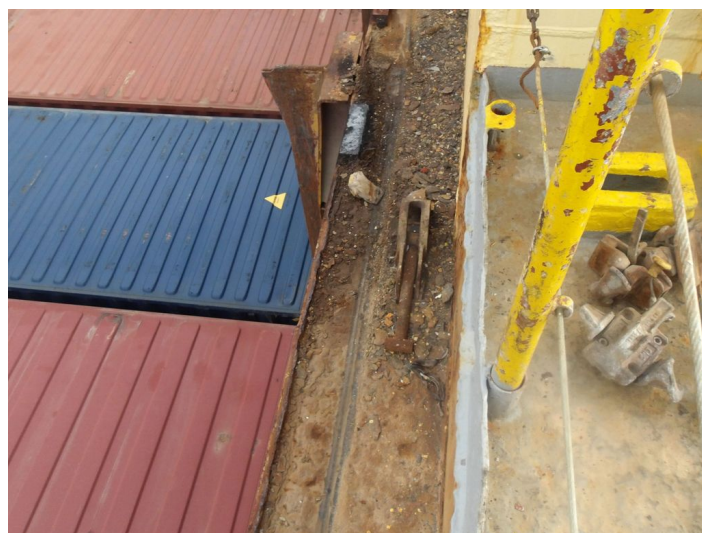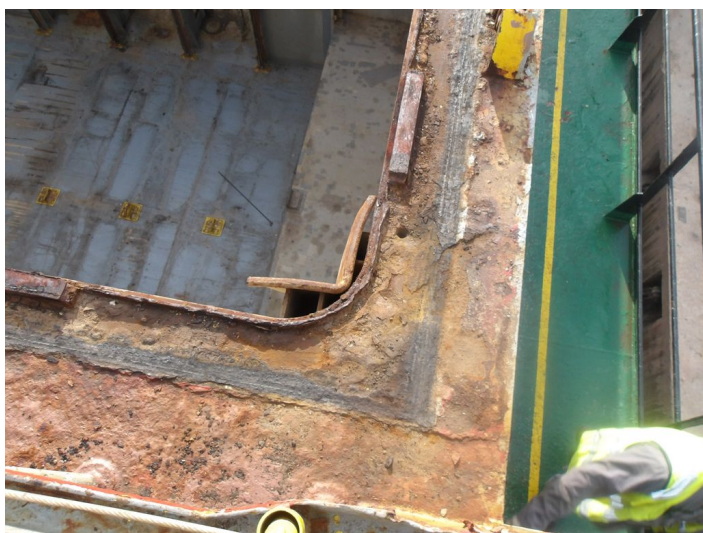

Defect ID: 58-744-847

Hydraulic oil leakages were seen on the motor and hydraulic platform of cargo crane No.2.

Further investigation is recommended to determine the cause of the leakage and carry out corrective actions to rectify the leakage.

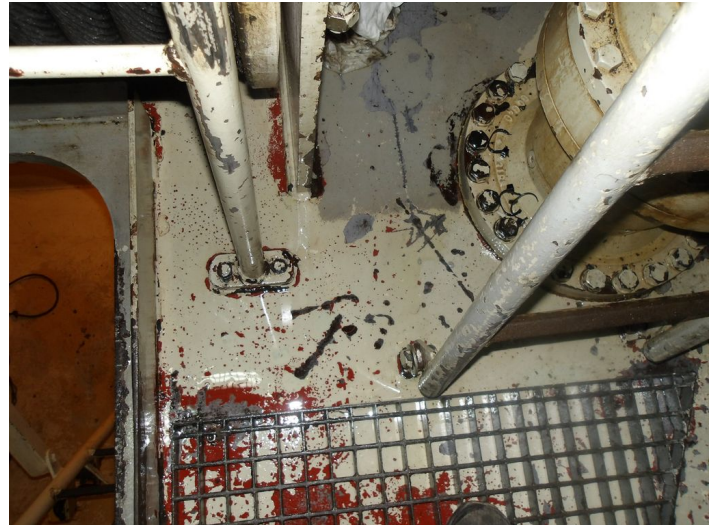

OPERATIONAL DATA

Operational Data Condition

Does the vessel have an Exhaust Gas Cleaning System (EGCS)?	No
Total High Sulphur Fuel Oil (HSFO) capacity:	0 m ³
Total Very and Ultra Low Sulphur Fuel Oil (VLSFO and ULSFO) capacity:	1469 m ³
Total Marine Gas Oil (MGO) and Diesel Oil (DO) capacity:	151 m ³
Does the vessel have any energy efficiency technologies installed?	No

Engines Table

	Main Engine 1	Main Engine 2	Aux Engine 1	Aux Engine 2	Aux Engine 3	Aux Engine 4
Designer	MAN B&W	N/A	Wartsila	Wartsila	Wartsila	
Model	MC		6L20C2	6L20C2	6L20C2	
Original Power (MCR)	10010		1020	1020	1020	
Power (MCR lim) (if applicable)	8100					
Number of Cylinders	7		6	6	6	
Speed (RPM)	127		900	900	900	
Bore (mm)	500		200	200	200	
Stroke (mm)	1910		280	280	280	
Specific Fuel Oil Consumption (SFOC) (g/kWhr) At 75% load for ME and 50% load for AEs, corrected to ISO conditions, as stated on Nox technical files	176.4		215	215	215	
Nox Tier	1		1	1	1	
Cylinder Oil Consumption (litres/day)	240					
System Oil Consumption (litres/day)	20		7	7	7	
Total Running Hours (Hours)	103580		89347	79112	97619	
Major Overhaul			14000	14000	14000	

Interval (Hours)						
Running Hours since last overhaul (Hours)			2298	2497	2398	

Main Engine Maintenance

Component	Condition Based Monitoring?	Overhaul Interval
Cylinder Heads		8000
Pistons		8000
Bearings		8000
Cylinder Liners		16000
Turbocharger(s)		24000

Main Engine No.1	Unit Running Hours											
Component	1	2	3	4	5	6	7	8	9	10	11	12
Cylinder Heads	1467	1467	1467	1467	1467	1467	1467					
Pistons	1467	1467	1467	1467	1467	1467	1467					
Bearings	1467	1467	1467	1467	1467	1467	1467					
Cylinder Liners	10645	10645	10645	10645	10645	10645	10645					
Turbocharger(s)	10645											
Was there any overdue maintenance for any main/auxiliary engine ancillaries (exhaust valves, fuel pumps, fuel injectors etc.)?	No											

Main Engine

	Vessel Speed (knots)	Consumption (t/day)
Loaded Eco	10.0	15.0
Loaded Service	13.0	21.0

Auxiliary Engines (t/day)

At Sea	1.8
In Port	1.8

Boiler (t/day)

At Sea	0.0
In Port (Idle)	1.3

Class Surveys

Were all Class and Statutory certificates valid?	Yes
Is the vessel on the Extended Dry Docking (EDD) program?	No
Is the vessel on the Enhanced Survey Program (ESP)?	No
Does the vessel have an In Water Survey Class notation?	No
Is the vessel ice classed?	No

Survey	Date Last Completed	Date Next Due
Main / Special / Renewal	12-Aug-22	31-Mar-27
Intermediate	20-Jun-25	
Annual		30-Mar-26
Bottom in dry dock	07-Sept-25	31-Mar-27

What was the location of the last out-of-water docking?	Carell SA Shipping & Ship Repairs, Syros (Greece)
Is the vessels last dry dock report provided and attached?	Yes
Has the vessel remained with the same flag since build?	No
Please provide further details	Germany Marshall Islands Malta Liberia
Has the vessel remained with the same Class since build?	Yes

In total, how many of the following does the vessel have? Conditions of Class, Recommendations of Class, Statutory Findings, Statutory Items, Conditions of Authority, etc.	1		
	Description	Area	Due Date
	As per the Condition of Class No. CC122, it was stated that the alternator of main generator No.1 needs to be repaired and tested to the satisfaction of a DNV surveyor. Until final repair the mitigating action as per risk assessment to be followed. Tug assistance to be requested based on master decision.	Machinery and Machinery Spaces	05-Apr-26
Does the vessel have any Class Memos, Observations or Additional Requirements?	No		
What was the status of the vessel at the time of inspection?	alongside loading		

TECHNICAL REPORT

- ⌘ Design and Construction
- ⌘ Hull
- ⌘ Mooring Decks
- ⌘ Weather Decks and Fittings
- ⌘ Ballast Tanks and Systems
- ⌘ Accommodation
- ⌘ Bridge and Navigation Equipment
- ⌘ Engine Room and Machinery
- ⌘ Fire Fighting Equipment and Systems
- ⌘ Lifesaving Appliances
- ⌘ Safe Working Environment
- ⌘ Pollution Control
- ⌘ Onboard Management
- ⌘ Vessel Capabilities and Cargo Systems
- ⌘ Cargo Lifting Appliances

TECHNICAL REPORT/

DESIGN AND CONSTRUCTION

 Review Grading Report

Design and Construction Condition

Has the vessel been built to the standards and Rules of an IACS-member Class Society?	Yes
Under what IACS Class society supervision was the vessel built?	GL - Germanischer Lloyd
Did the vessel provide Ultrasonic Thickness Measurement (UTM) reports?	No, not available

Engine Room & Firefighting

Feature seen in the engine room What is the new maximum power of the Main Engine as limited by the EPL? (kW) Notes:	Engine Power Limiter (EPL)
	8100
	Limited MCR with EPL = 8100 KW at 118.3 RPM
Feature seen in the engine room	UMS Capabilities (regardless of Class notation)
Feature seen in the engine room	2-Stroke Engine Adaptive Cylinder Oil Control e.g. MAN B&W Alpha Lubricator

TECHNICAL REPORT/

HULL

 Review Grading Report

Hull Condition

What sections of the hull were inspected?	Stbd side
Was the vessel free of any major structural damage or indentations?	Yes
Was the vessel free of any minor structural damage or indentations?	No
Please provide further details	Minor indentations and signs of rib caging were seen on the forebody and afterbody of the ship's hull
What was the level of Hull coating breakdown and corrosion?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the bulbous bow, boot top, and weld seams with fender marks and coating abrasion seen in some areas of the ship's hull
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Scattered
	Surface
	Spot
What was the condition of the hull markings?	Well painted and clearly legible
What level of marine fouling was seen?	None
Were fenders installed on the hull?	No

TECHNICAL REPORT

MOORING DECKS

 Review Grading Report

Mooring Decks Condition

Were the decks free of any structural damage or deformations?	Yes
What was the level of coating breakdown and corrosion observed on the decks?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the surrounding deck plating areas of the mooring machinery and fittings
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Surface
What was the general condition of the deck fittings?	Good
Were fairleads and mooring rollers free to move when tested?	Yes
Were all mooring machinery reported to be fully operational?	Yes
What type of windlass(es) and winches were fitted?	Electric
What was the condition of the mooring machinery?	Good
What amount of band brake lining was seen to be remaining?	Substantial
What condition were the visible sections of the anchor chains seen to be in?	Good
What type of mooring lines did the vessel have?	Rope
What was the condition of the mooring ropes / wires?	Good
Were safe mooring practices observed? i.e. no overlapping turns on split drum, chafing of lines or unsafe leading.	Yes
Was the last brake test seen to be stencilled on the mooring winches?	No
Please provide further details	According to the crew test done during last dry dock but no document provided

What type of snap back warning signs/zones were posted?	Signs at the entrance to the mooring decks
Was the Bosun's / Foc'sle store available for inspection?	Yes
What was the condition of the bosun's store structure?	Structurally sound with no visible damage
What was the condition of the bosun's store coatings?	Coatings fully intact with no corrosion
Was the condition of the bosun's store housekeeping?	Fairly neat with some scattered equipment
Were the bitter end release arrangements seen to be clear and unobstructed?	Yes
Was an 'emergency towing booklets/procedures' available near to the foc'sle?	Yes

TECHNICAL REPORT/

WEATHER DECKS AND FITTINGS

Review Grading Report

Weather Decks and Fittings Condition

Were the decks free of any structural damage or deformations?	Yes
What was the level of coating breakdown and corrosion observed on the decks?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the cross decks, deck plating and deck cell guides located at the forward of the superstructure, and surrounding deck plating areas of some of the weather deck fittings
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Localised
	Surface
What was the general condition of the deck fittings e.g handrails, brackets, vent heads, walkways, lighting etc.?	Good
Does the vessel have mooring winches fitted on the main deck?	No
Were deck equipment and pipework free of leakages?	Yes
What was the condition of the accommodation ladders or gangways?	Good
Was the vessel fitted with a provision lifting appliance(s)?	Yes
What was the condition of the provision lifting appliance(s)?	Good
Does the vessel carry any major spares on external decks e.g. propeller blades, anchor etc.	No

TECHNICAL REPORT/

BALLAST TANKS AND SYSTEMS

Review Grading Report

Ballast Tanks and Systems Condition

Were ballast tanks entered?	Yes
Please provide further details	No. 2P/S WBT
Were recent (last 12 months) ballast tank inspection photographs provided?	Yes
Date the photographs were provided:	04-Sept-25
Were the tanks free of any structural damage or indentations?	Yes
What was the level of Ballast Tank coating breakdown and corrosion?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the free edges, plating edge intersection, weld seams, and crop repaired areas
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Scattered
	Surface
	Spot
What was the condition of ballast tank fittings (e.g. ladders, handrails, pipes & manhole seals)?	Fair
Please provide further details	fair to good condition as some of the pipes and ladders of the inspected ballast tanks were found to have areas with developing corrosion and signs of coating breakdown
Were the ballast tanks fitted with sacrificial anodes?	No
How much mud/sediment was seen inside the ballast tanks?	Minimal
Were the tanks seen to be free from any signs of staining from oil, sewage or marine fouling?	Yes
Were ballast tank manhole covers seen to be in good condition?	Yes

Were the remote ballast control systems fully operational (e.g. valves, gauging etc)? Please provide further details	No
	Based on the provided ballast tanks inspection reports, the tank remote gauging systems of No.3BS and No.3BP Heeling tank, No.2BS, No.2BP, No.1B2PS, No.1B1SS, No.1B1PS, No.1A2 SS, No.1A2P, No.4BS, No.4B, No.3AS, No.3AP, No.2AS, No.2AP, No.1B2S, No.1A1, No.3S DBT, No.3P DBT, No.2S DBT, No.2P DBT, No.4 DBT WBT, Fore Peak, and Aft Peak Tank were reported to be out of order or in poor condition.
Were the ballast and/or anti-heeling pumps reported to be fully operational?	Yes
What condition were the ballast and/or anti-heeling pumps in?	Good

TECHNICAL REPORT/

ACCOMMODATION

 Review Grading Report

Internal Accommodation Condition

Were accommodation spaces used for their assigned purposes?	Yes
What was the condition of the flooring and wall coverings?	Fair
Please provide further details	The wall coverings were found to be in generally good condition. A missing tile was seen on the refrigerating room.
What was the condition of the upholstery and furniture?	Good
What were the general levels of housekeeping and cleanliness?	Good
What was the level of hygiene of the sanitary facilities?	Good
Was all laundry equipment in good working order?	Yes
Was the Hospital well equipped and ready for use?	Yes
Were the drugs found to be controlled and secured with the associated drugs log kept up to date?	Yes
What was the quality of accommodation outfitting?	Average quality of outfitting
Did the Air Handling Unit (AHU) maintain a comfortable temperature?	Yes
What was the condition of the AHU?	Good

Galley Condition

What was the level of cleanliness in the Galley?	Clean
Was all galley equipment operational?	Yes
What was the general condition of galley equipment?	Good
Were the insides of Galley hoods clean?	Yes
What type of cold provisions stores does the vessel have?	Walk-in stores / Cold rooms

Were provisions stores well organised with no provisions stored directly on the deck?	Yes
Were provisions stores clean and hygienic?	Yes
Were provisions stores at the required temperatures?	Yes
Were provision stores temperatures recorded and records kept nearby?	Yes
Were provisions machinery, pipework and door seals free of frosting and deterioration?	No
Please provide further details	Ice accumulation was seen on some section of the cold room refrigeration's pipework
Were lock-in alarms or handles in good working condition?	Yes

External Areas Condition

Was the external Superstructure / Accommodation Block found to be free from damages?	Yes
Were accommodation external doors found to be in good condition and providing an adequate seal?	Yes
What was the level of external accommodation superstructure coating breakdown and corrosion?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the free edges and external decks of the accommodation
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Surface
	Spot
What was the general condition of external superstructure fittings (e.g. lighting, vent heads, windows/portholes, stairways, railings etc.)?	Good

Crew Welfare

What is the average contract length for crew members?	Officers:	Crew:
	6 Months	9 Months
Was Wi-Fi provided on-board?	Yes. Paid, Limited	
What is the approximate average internet speed?	Very Fast (Able to stream HD film)	
Is access provided to catering facilities or food at all times?	Yes	
What Public Recreation equipment did the crew have access to?	Free Weights	
	Fixed weight machine	
	Cycling Machine	
	Table Tennis	
	Swimming Pool	
	Television	
	Games console	
	Karaoke	
	Entertainment Library - Books, DVDs, Games, etc.	
	Public Computer	
	En-suite facilities for all crew members	
What was the quality of crew recreation facilities?	Good	
What facilities were provided in crew cabins?	Sofa	
	Desk	
Does the vessel have any onboard training facilities?	Yes	
	ONE LEARN	
Type of onboard training facilities:	Other	
Is there a crew suggestion policy in place?	Yes	
Does the crew have access to a bonded store?	Yes, well stocked	

Are the crew given additional periods of rest throughout the working week (e.g Sunday off)?	Yes
---	-----

TECHNICAL REPORT/

BRIDGE AND NAVIGATION EQUIPMENT

🔗 Review Grading Report

General Condition

Was all the bridge equipment reported to be fully operational?	Yes
Was the bridge found to be clean and well maintained with good housekeeping?	Yes
Were all required bridge equipment annual performance tests (e.g. VDR and AIS) completed in the last 12 months?	Yes
Was the vessel fitted with a Voyage Data Recorder (VDR)?	Yes
Type of VDR fitted:	S-VDR
Was the VDR seen to be free from any unanticipated alarms?	Yes
Were the VDR collection instructions posted and known to the Master?	Yes
Was the vessels Bridge Navigation and Watch Alarm System (BNWAS) fully operational, and turned on when at sea?	Yes
Normal time setting at sea	12 mins

Navigation Condition

What was the vessels primary & secondary means of navigation as listed on Form E?	Primary	Secondary
	ECDIS	ECDIS
Were the primary & secondary means of navigation found to be up to date?	Yes	
Latest update week	10	
Does the vessel receive up to date weather information?	Yes	
	08-Mar-26	
What type of weather updating service does the vessel use?	Digital subscription	
Was an in-date compass deviation card posted near to the helm?	Yes	

Was a compass deviation log kept, up to date and free of any major deviations?	Yes
Were azimuth rings (bearing diopters) found to be available on the bridge?	Yes

Communication Condition

What GMDSS sea areas was the vessel licensed to cover?	A1		
	A2		
	A3		
Were the radio batteries seen to be in good condition?	Yes		
Were the EPIRBs, SARTs and Emergency Hand Held VHF Batteries within their expiry dates?	Yes		
Battery expiry dates	EPIRBS	SARTs	VHF
	01-Oct-27	01-Aug-29	01-Aug-29
Was a valid GMDSS shore servicing certificate seen to be posted near to radio equipment?	Yes		

Documentation Condition

Were berth to berth passage plans seen on-board?	Yes
Were passage plans signed by all navigating officers?	Yes
What format were nautical publications provided in?	Electronic
Were the Master's standing orders and night orders found to be signed by all navigating officers?	Yes
Was the bridge log book up to date and correctly filled in?	Yes
Was the GMDSS log book up-to-date and correctly filled in?	Yes
Date of last test	07-Mar-26

External Condition

Was the Monkey Island found to be in good, well maintained condition?	Yes
---	-----

Were the main mast, aerials and antennas seen to be in good condition and free from damage?	Yes
Were bridge wing manoeuvring controls fitted?	Yes
Were the bridge wing manoeuvring controls reported to be fully operational and free from signs of water ingress?	Yes
Were bridge wing engine speed and compass repeaters seen to be in good working condition?	Yes

TECHNICAL REPORT/

ENGINE ROOM AND MACHINERY

 Review Grading Report

General Condition

Were all engine room bulkheads and frames seen to be in good structural condition?	Yes
Were the engine room fittings such as stairwells/ladders, handrails, floor plates and lighting found to be in good condition?	Yes
Was the duct keel in good condition and free from any signs of ingress or internal leakages?	N/A
What equipment was seen running?	Auxiliary Engines
	Purifiers
	Pumps
	Sewage treatment plant
	Auxiliary Boiler
	Refrigeration Compressor
	Air Conditioning Compressor
Was the engine room free of any significant defects, either reported by crew or observed?	Yes
What were the general levels of housekeeping and cleanliness in the Engine Room?	Good
Were bilges and tank tops free of any significant oil and/or water?	Yes
Were bilge alarms found to be fully operational during testing?	Yes
Was the vessel equipped with adequate critical spares as recommended by the ship manager Safety Management System (SMS)?	No
Were spares neatly stowed and correctly secured?	Yes
Were all self-closing devices (sounding pipes, tank level gauge glasses etc.) in good working order?	Yes

Were any caution (amber) or action (red) alerts seen on the lube oil analysis reports?	Yes
Please provide further details	As per the provided lube oil analysis report dated 03-Dec-25 and 02-Feb-26, two cautionary alerts were issued for the Bow thruster and Stern tube lube oil samples. The Bow thruster and Stern tube lube oil samples were reported to have higher than normal TAN readings
Were any alerts or abnormal findings seen on the supplied fuel oil analysis reports?	No
Was the NOx Technical file kept up to date?	Yes
Date of entry:	04-Sept-25
Was the engine room logbook up to date, correctly filled in and without any obvious abnormalities recorded?	Yes
Were Chief Engineer Standing Orders clearly posted and signed by all engineers?	Yes
Were all machinery special tools provided and in good condition?	Yes
Were all machinery and equipment manuals reported to be available onboard?	Yes

Main Engine Condition

Was the main engine in good working condition?	Yes
In what condition was the Main Engine?	Fair
Were any defects or abnormal findings seen on the supplied scavenge space inspection reports?	No
Were all maximum cylinder liner wear measurements seen to be within maker limits?	Not available
Were all main engine safeties reported to be fully operational? (e.g. oil mist detectors, bearing temperature sensors, low lube oil pressure trip etc.)	Yes
Were the main engine turning gear and flywheel in good condition?	Yes
Were the supplied main engine performance reports seen to be satisfactory?	Yes

Propulsion

What type of propulsion does the vessel have?	Fixed Pitch Propeller (FPP)
Were the Propulsion systems, including shafts, gearing and electric motors, if relevant, in good working condition?	Yes
What type of thruster systems does the vessel have?	Bow Thruster
Was the thruster(s) in good working condition?	No
Please provide further details	According to the information provided by the crew, the bow thruster was non-operational

Power Generation

How many Auxiliary Engines does the vessel have?	3
Were the Auxiliary Engines in good working condition?	Yes
In what condition were the Auxiliary Engines?	Good
Were all auxiliary engine safeties reported to be fully operational? (low lube oil pressure, overspeed, high HT temperature etc.)	Yes
Were the supplied auxiliary engine performance reports seen to be satisfactory?	No
Please provide further details	No concerns were noted on the observed parameters recorded in the provided Auxiliary Engines No.3 performance report. However, based on the provided Auxiliary Engine No.2 performance report dated 20-Feb-26, the performance test was carried out below the recommended load of 70% for accurate readings. It is recommended to redo the test at the recommended load to obtain accurate data readings. It should be noted that the Auxiliary Engine No.1 performance report was not provided for review
Does the vessel have a shaft generator?	No
Does the vessel have a shaft motor (Power Take-In)?	No

Auxiliary Machinery

Does the vessel have an Auxiliary Boiler?	Yes
---	-----

What type of boiler is fitted?	Steam
Was the boiler(s) in good working condition?	Yes
In what condition was the boiler(s)?	Good
Were boiler safety valves in satisfactory condition?	Yes
Was it reported that any boiler tubes had been plugged? (including Economiser/EGB)	No
Was the Hot Well/Cascade Tank seen to be in good order and free from contaminants?	Yes
Were any abnormal findings observed on the supplied boiler and cooling water analysis reports?	No

What was the condition of the following equipment?	Fully operational?	Condition
Economiser/Exhaust Gas Boiler	Yes	Good
Purifiers	Yes	Good
Pumps	Yes	Good
Coolers and Heaters	Yes	Good
Sea Chests and Overboard Valves	Yes	Good
Air Compressors and Air Reservoirs	Yes	Good
Fresh Water Generator	Yes	Good
Filters	Yes	Good
Supply and Exhaust Fans	Yes	Good
Refrigeration and Air Conditioning Systems	Yes	Good
Automation Systems (e.g. viscometer, temperature controllers/valves, monitoring panels/screens etc.)	Yes	Good
Engine Room Crane	Yes	Good
Workshop Machinery including emergency stops	Yes	Good
UV Sterilizer	Yes	Good
Fresh Water Mineralizer/Re-hardening Filter	Yes	Good
Calorifier	Yes	Good
Was all engine room pipework free of significant corrosion?	Yes	
Was all engine room pipework free of leakages?	Yes	
Was all pipework free of temporary repairs including soft patches?	Yes	
What condition was pipework insulation lagging in?	All clean and intact	
Was all anti-splash tape seen to be in place at the required engine room pipe connections?	Yes	
Was the steering gear in good working condition?	Yes	

Was the steering gear free of leakages?	No
Was the emergency steering communication equipment and gyro repeater working as required?	Yes
Were emergency steering instructions posted nearby?	Yes
Was the Engine workshop clean and tidy?	Yes
Was all welding equipment including gas bottles, flame arrestors and associated fittings in good order and properly secured?	Yes

ECR and Electrical

Was the Engine Control Room clean and tidy?	Yes
Were all Engine Control Room automation and monitoring systems fully operational?	Yes
Was the Engine Control and Alarm system free of any serious active alarms?	Yes
Were any concerning engine room control system alarms seen to be manually blocked/disabled?	No
If the vessel has a UMS Class notation, does the machinery space operate in UMS mode?	Yes
Were the engine room deadman and engineer call alarms found fully operational during testing?	Yes
Were all package air conditioning units operational and in good condition? (e.g. ECR, bridge, galley, electrical rooms)	Yes
Were all Electrical distribution systems in good working condition?	Yes
Were Main Switchboard Insulation readings adequate?	Yes
Were any abnormal findings observed as per the latest Megger Test reports?	No
Were distribution and switchboard panels protected with approved rubber matting?	Yes
Was evidence of regular safety equipment testing available? (i.e. weekly, monthly and quarterly tests of bilge alarms, dampers, emergency machinery etc.)	Yes

Was the Emergency Generator tested during the inspection?	Yes
Was the Emergency Generator in working order?	Yes
Were Emergency Generator Starting instructions clearly posted?	Yes
What was the condition of the Emergency Generator?	Good
Was the "18 hour" fuel level marked on the emergency generator fuel tank?	Yes

TECHNICAL REPORT/

FIRE FIGHTING EQUIPMENT AND SYSTEMS

🔍 Review Grading Report

Fire and Safety Appliances Condition

Was the vessel free of fire hazards?	Yes		
Was all fire and safety equipment regularly serviced?	Yes		
Date of last service	22-Feb-26		
Were all relevant Fire and Safety instructions correctly posted?	Yes		
What was the vessels Fixed fire detection systems?	Engine Room	Cargo Holds	Accommodation
	Flame	Smoke	Smoke
	Smoke		
	Heat		
Was the fire detection system reportedly fully operational?	Yes		
Was the fire detection system free of alarms or signs of tampering?	Yes		
What is the vessels Fixed firefighting systems?	Engine Room	Cargo Holds	Accommodation
	CO2	CO2	Galley CO2
Were all fixed fire fighting systems in good working condition?	Yes		
Were clear operating instructions posted for the fixed firefighting systems?	Yes		
Was the fixed firefighting system release protected against unauthorised operation?	Yes		
Was the main fire pump working?	Yes		
Was the emergency fire pump working?	Yes		
Was a fire pump tested during the inspection?	Yes		
Did the fire pump maintain adequate pressure?	Yes		
Were the main and emergency fire pumps in good condition and free of leakages?	Yes		

What was the condition of the fire main and ancillaries such as pipework hydrants and valves?	Good
Does the vessel have a fire control station?	Yes
Were all portable equipment in place as per the fire plan?	Yes
Were all fire extinguishers in good condition?	Yes
Were the firefighting outfits and associated equipment in good condition?	Yes
Were the International Shore Connections on board?	Yes
Location:	Main Deck Port Side
Was the BA equipment fully charged in good condition?	Yes
Was the Quick Closing Valve system in good working order?	Yes
Were fire doors in good condition and effectively closing?	Yes
Were fire doors free of unauthorised "hold-open" arrangements?	Yes
Were all ventilation dampers remote closing positions well labelled and in good working order?	Yes
Were all remote machinery shutdown systems well labelled and in good working order?	Yes

TECHNICAL REPORT/

LIFESAVING APPLIANCES

 Review Grading Report

Lifesaving Appliances Condition

Were all Lifesaving Appliances regularly serviced?	Yes
Date of last service:	21-Nov-25
How many lifeboats is the vessel equipped with?	1
What type of lifeboat is the vessel fitted with?	Free-fall
What was the external condition of the lifeboat(s)?	Good
What was the internal condition of the lifeboat(s)?	Good
Were Lifeboat Engines able to be tested?	Yes
Were lifeboat engines in good working order?	Yes
What was the condition of the rescue boat?	Good
How many life rafts does the vessel have?	3
What was the condition of the life rafts?	Good
Were Liferaft Hydrostatic Release Units (HRU) in date and correctly rigged?	Yes
What was the condition of the Davits and lowering arrangements for the lifeboat(s), rescue boat and liferafts?	Good
What Date is the next Davit wire due for change?	29-Jan-30
Were legible launching/recovery instructions posted near to survival craft?	Yes
Was evidence of regular maintenance, service and inspection of the launching appliances sighted and evident?	Yes
What was the date of the last abandon ship drill?	07-Feb-26
Were all lifejackets, immersion suits, EEBDs and other lifesaving ancillary equipment in good condition and ready for use?	Yes
Were Man Overboard Buoy (MOB) smoke and light signals in date?	Yes

Were the embarkation ladders in a good, well maintained condition?	Yes
Were pyrotechnics and line throwing apparatus available, stored in an appropriate container and within their expiry dates?	Yes

TECHNICAL REPORT/

SAFE WORKING ENVIRONMENT

Review Grading Report

Safe Working Environment Condition

Were any unsafe practices observed during the inspection?	No
Did the vessel provide a safe working environment? Please provide further details	No Some of the floor plating of the engine space was found to have missing securing bolts, which increases the risk of slip and trip hazards in the area. The protective cover for the ER workshop lathe machine was found missing. The Hot well covers were found to have loose or missing bolts.
Were all hazard markings clear?	Yes
Were external walkways adequately coated with anti-slip paint and free of trip hazards?	Yes
Are all hazardous substances including safely managed and stored with relevant Material Safety Data Sheets (MSDS)?	Yes
Is Personal Protective Equipment (PPE) provided and worn by crew?	Yes
Are 'Enclosed Space Entry' procedures implemented?	Yes
Is an effective Permit To Work (PTW) process implemented?	Yes
Date of last PTW:	08-Mar-26
Is an effective Risk Assessment (RA) process in place?	Yes
Was evidence of the annual and 5-yearly inspections of both fixed and portable lifting equipment and appliances sighted?	Yes
Are main and emergency exits clearly identified and unobstructed?	Yes
Are sufficient portable oxygen and gas detection meters provided and regularly calibrated?	Yes
Date of last calibration:	03-Feb-26
What is the working language of the vessel?	English

Are standing orders, procedures, instructions and manufacturers' manuals written in a language which can be understood by the crew?	Yes
Are all IMO signs correctly placed, and compliant with IMO requirements?	Yes
Is the vessel equipped with an approved SOLAS training manual?	Yes
Were the Pilot Ladders in good condition?	Yes
Was the Pilot ladder seen to be secured in a safe manner?	Yes
Are regular drills conducted on board?	Yes
Last drill date	28-Feb-26
Last drill type	ISPS

TECHNICAL REPORT

POLLUTION CONTROL

 Review Grading Report

General Condition

Was Pollution Control well implemented within the on board Safety Management System (SMS)?	Yes
Is the vessel free of pollution hazards?	Yes, with no hazards
Does the vessel have a Class approved Inventory of Hazardous Materials (IHM)?	Yes
Please provide further details	The vessel holds a Class approved Inventory of Hazardous Material (IHM)

Oil - Marpol Annex I

Is an Oily Water Separator (OWS) fitted?	Yes
Was the OWS reportedly operational?	Yes
What was the condition of the OWS?	Good
Was the OWS Tested?	Yes
Means of testing	Simulated
Was the 15ppm meter calibrated?	Yes
Date of calibration	04-Jul-22
Was the Bilge Overboard valve secured against unauthorised opening with adequate signage and warnings posted?	Yes
Means of securing	Sealed
	Locked
Was the oily water treatment system including valves and pipework free of any signs of tampering, bypass, or modifications?	Yes
Was the SOPEP locker or box well stocked?	Yes
What was the condition of the SOPEP equipment?	Good

Was a list of SOPEP equipment posted and accurate?	Yes	
Was the Oil Record Book (ORB) up to date and correctly filled in?	Yes	
Date of last entry	02-Mar-26	
Category of last entry	I	
Were previous bunkering checklists correctly filled out?	Yes	
Date of last bunkering	08-Mar-26	
Were bunker samples correctly stored?	Yes	
Does the vessel have a Ballast Water Treatment System (BWTS) fitted?	Yes	
Ballast Water Treatment System	Manufacturer:	Panasia Co., Ltd.
	Type:	Other
	Other type:	UV + Filtration
What regulation is listed on the Ballast Water Management Certificate?	D-2	
Type of BWTS approval (As reported / according to provided documentation):	USCG approval	
Was the BWTS operational?	Yes	
What was the condition of the BWTS?	Good	
Was the Ballast Record Book up to date and correctly filled in?	Yes	
Date of last entry	05-Mar-26	
Is the Vessel General Permit (VGP) compliant?	Yes	
Please provide further details	Stern Tube EAL and Bow Thruster EAL	
How is the vessel VGP Compliant? *Environmentally Acceptable Lubricant	Stern Tube EAL	
Stern Tube Type of EAL	Fuchs Plantogear 100S	

Sewage - Marpol Annex IV

Was a Sewage Treatment Plant fitted?	Yes
Was the Sewage Treatment Plant operational?	Yes
What was the condition of the Sewage Treatment Plant?	Good
Does the vessel have a sewage holding tank?	Yes
What was the condition of the Sewage Holding Tank?	Good

Garbage - Marpol Annex V

How was the condition of Garbage segregation?	Good
Were Garbage containers of approved, non-combustible type?	Yes
Was the Garbage Record Book (GRB) up to date and correctly filled in?	Yes
Date of last entry	08-Mar-26
Category of last entry	A, B, C and F

Air - Marpol Annex VI

How does the vessel comply with IMO 2020 regulations?	Use of Very Low Sulphur Fuel Oils (VLSFO), MGO, D0 etc.
Does the vessel use Ozone Depleting Substances (ODS) as Refrigerant Gas?	No
Was an Incinerator fitted?	No
Does the vessel have an Emission Control Area (ECA) change-over log?	Yes
Date of last entry	24-Apr-25

EEXI

Does the vessel have an attained EEXI score as per her International Energy Efficiency Certificate (IEEC)?	Yes
What is the EEXI score?	19.4

Does the vessel have any energy efficiency technologies installed?	No	
Is the vessel ice classed?	No	
Main Engine(s)	Specific Fuel Oil Consumption (SFOC) (g/kWhr):	176.4
Auxiliary Engines	Specific Fuel Oil Consumption (SFOC) (g/kWhr):	215
Does the vessel have a shaft motor (Power Take-In)?	No	
What is the expiry date of the International Air Pollution Prevention (IAPP) certificate?	31-Mar-27	

TECHNICAL REPORT/

ONBOARD MANAGEMENT

Review Grading Report

Onboard Management Condition

Does the vessel have a functioning Safety Management System (SMS)?	Yes
How was the SMS Implemented?	Software / Electronic System
Were the officers familiar with, and allowed easy access to, the SMS?	Yes
Was the SMS well implemented on board, with Permits to Work, Risk Assessments and Safety procedures understood and followed?	Yes
Is the SMS system regularly reviewed by the Master?	Yes
Date of last review	28-Feb-26
Does the vessel management deal with accidents, near-misses and deficiencies in an effective manner?	Yes
Are regular safety committee and management meetings carried out on board?	Yes
Does the vessel have a valid MLC certificate?	Yes
Were Hours of Rest (ILO) records correct and up to date?	Yes
Last updated	07-Mar-26
Are hours of maximum permissible work regularly exceeded?	No
Is an effective Planned Maintenance System (PMS) implemented and kept up to date?	Yes
What type of Planned Maintenance System (PMS) does the vessel have?	Type-approved system
Name of PMS	AMOS
Was the PMS a fully integrated type system? (i.e. has integration with the SMS, spares ordering and is accessible by shore side management)	Yes
Were there any critical overdue PMS work orders?	No

Port State Control (PSC) inspection history

No. of Inspections in Past three years:	6
No. of Deficiencies in Past three years:	6
No. of Detentions in Past three years:	0
Is the vessel flag targeted by Port State Authorities?	No
Is an effective system of security access control, conforming to ISPS standards, in place upon boarding the vessel?	Yes
Type of access control	Yes upon boarding we were requested our identification documents and were escorted into the accommodation
Do the Master and Chief Engineer have an effective hand over procedures?	Yes
Are random or specific drug and alcohol testing carried out?	Yes
Tests Carried out by:	Onboard by Master
Were the Master and crew prepared for the Inspection?	Yes
What level of cooperation was provided by the crew and Master?	Good
Were documents provided as requested?	Majority of documents provided
What was the overall impression of the general management of the vessel?	Well managed

TECHNICAL REPORT/

VESSEL CAPABILITIES AND CARGO SYSTEMS - CONTAINERSHIPS

 Review Grading Report

Vessel Capabilities and Cargo Systems - Containerships Condition

Cargo hold	Capacity in hold (TEU)	Capacity on deck (TEU)	Total (TEU)
Cargo Hold No.1	70	114	184
Cargo Hold No.2	142	171	313
Cargo Hold No.3	206	180	386

Cargo Hold No.4	99	106	205
Cargo Hold No.5		114	114
Cargo Hold No.6			0
Cargo Hold No.7			0
Cargo Hold No.8			0
Cargo Hold No.9			0
Additional Deck Stowage			0
Total	517	685	1202
How many cargo holds does the vessel have?	4		
Were the cargo holds able to be entered and inspected?	Yes		
Please provide further details	Cargo Hold No.2		
Were recent vessel cargo hold inspection photographs provided?	Yes		
Date photographs were taken:	24-Nov-25		
Were recent inspection reports provided?	Yes		
Date of inspection reports:	24-Nov-25		
Were cargo holds structural members found to be free from damage (e.g. side plating, tank top and framing)?	No		
Please provide further details	Based on the provided cargo hold photographs, minor indentations were pictured on the forward bulkhead of Bay 26, and aft bulkhead of bay 6.		

Were the cargo hold fittings such as ladders, hand rails, and ventilation ducting found to be free from damage and deterioration?	No
Please provide further details	The inspected cargo hold No.2 was found to have deformed railings and sounding pipe. Based on the provided cargo holds inspection reports dated November 2025, the tank manhole covers, bilges/covers, and lighting/electrical were reported to be in fair condition. Several welded cone for container in cell guide part inside cargo holds No.2 and No.4 were reported to be missing, and several lamp in cargo holds No.2, No.3, and No.4 were reported to be busted
Were the cell guides free from any significant damage or significant deformation?	No
Please provide further details	One of the vertical guides on the port bulkhead of cargo hold No.2 was found to have minor deformation. Based on the provided cargo hold photographs, minor deformation was pictured on one of the cell guides of bay 26.
What was the level of coating breakdown and corrosion observed in the Cargo Holds?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the tanktop, weld seams, and free edges with rust stains seen in some areas of the cargo hold bulkheads
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Spot
Were all cargo monitoring systems (e.g. bilge alarms, smoke detection systems etc.) fully operational and regularly tested?	Yes
Were cargo hold bilges clear of debris and oil contamination?	Yes
Were the cargo holds free from signs of significant water ingress?	Yes
Were the cargo holds free from signs of previous and/or current internal leaks? (e.g. from manholes, adjacent tanks, pipework and fittings etc.)	Yes
What is the method of cargo hold ventilation?	Mechanical
Were cargo hold ventilation systems in good working order?	Yes

Is the fixed firefighting system in cargo spaces in apparent good condition?	Yes
--	-----

Hatch Covers

What type of hatch covers are fitted?	Pontoon
What was the make and model of the Hatch covers?	MCGREGOR Lift away type
Maximum weight of the heaviest pontoon (tons):	27
Were the hatch cover found to be free from structural damage?	No
Please provide further details	Signs of wastage and deformation were seen on localized areas of the hatch covers' edges
What was the level of coating breakdown and corrosion observed on the hatch covers?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	on the free edges, cross joints, and top and side plating with rust stains seen in different areas of the hatch covers
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Pitting
	Scattered
	Spot
What was the condition of the hatch cover rubber seals/gaskets and retaining channels?	Fair
Please provide further details	Some areas of the hatch cover cross joints' rubber gaskets were found worn and in deteriorated condition, and gaps were seen on the hatch cover rubber seals of some of the hatch covers. One of the hatch covers were found missing half of the rubber gasket of its cross joint. Some sections of some of the hatch covers' retaining channels were found to have signs of wastage
What was the condition of hatch cover securing arrangements?	Good

What was the condition of the hatch cover landing pads?	Fair
Please provide further details	Signs of wear were seen on the hatch coaming landing pads and hatch cover support pads

Hatch Coamings

Were the hatch coamings found to be free from structural damage?	No
Please provide further details	The coaming guide of hatch coaming No.1 forward starboard was found damaged.
What was the level of coating breakdown and corrosion observed on the hatch coamings?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	on the coaming table and free edges
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Scaling
	Localised
	Spot
Were the compression bars/strips seen to be in good condition?	N/A
Were the hatch coaming drain channels seen to be free from corrosion, scaling or debris?	No
Please provide further details	Some sections of the hatch sills were found to have damages and prominent levels of corrosion
Were hatch coaming non-return valves found to be clear and fully operational?	Yes

Cargo Securing

What was the condition of fixed cargo securing fittings, such as container sockets, pad-eyes, D-rings and fixed stacking cones, etc.?	Fair			
Please provide further details	Based on the provided cargo hold inspection reports, several welded cones for container in the cell guide part inside cargo holds No.2 and No.4 were reported to be missing and signs of wastage were seen on the stacking cones of cargo hold No.2			
Was there an up to date Cargo Securing Equipment inventory?	Yes			
Were there any shortfalls of cargo securing devices?	No			
Were cargo securing device inspection records correctly maintained?	Yes			
What was the condition of Cargo Securing Equipment?	Good			
Was there an approved Cargo Loading Manual on board?	Yes			
Was there an approved stability booklet on board?	Yes			
Did the vessel use a Class-approved computer based loading/stability software?	Yes			
Please provide further details	MACS3 VERSION NET 1.1.63.129			
Were previous and current stability calculations seen to be carried out?	Yes			
Does the vessel have a Document of Compliance (DOC) for the carriage of dangerous goods?	Yes			
Are procedures for safe lashing and securing of containers being incorporated in the ship's SMS?	Yes			
Are appropriate securing points being used for cargo securing?	Yes			

Reefer Containers

Is the vessel equipped to carry Reefer containers?	Yes			
Reefer Capacity	On deck	In Holds	Water cooled Reefers	Total
	179	36		215

What condition were reefer electrical sockets in?	Good
Was the reefer switchboard free of any low insulation or earth faults?	Yes
Was the vessel's own electrical supply sufficient for all reefer containers, without the use of an additional Power Unit (package generator) ?	Yes
Is there an effective system for monitoring reefer container temperatures? Please provide further details	Yes
	Manual monitoring by crew

TECHNICAL REPORT/

CARGO LIFTING APPLIANCES

Cargo Lifting Appliances Condition

Does the vessel have Cargo Lifting Appliances? i.e. Does the vessel have cargo cranes (Geared).	Yes		
Crane	Safe Working Load (SWL) (t)	Reach (m)	Date of last wire change
1	43	28	01-Sept-25
2	43	28	01-Sept-25
How many Cargo Lifting Appliances does the vessel have?	2		
What type of cargo lifting appliances are fitted?	DK II 43028		
Were the cargo lifting appliances seen in operation?	Yes		
Were all cargo lifting appliances fully operational?	Yes		
Were the cargo lifting appliances available for internal inspection?	Yes		
Please provide further details	Cargo Crane No.2		
Were the cargo lifting appliances found to be free from structural damage?	Yes		
What level of coating breakdown and corrosion was seen on the cargo lifting appliances?	None		
In what condition were the wires for the cargo lifting appliances?	Good		
In what condition were the cargo lifting appliances motors and hydraulic systems?	Fair		
Please provide further details	Hydraulic oil leakages were seen on the motor and hydraulic platform of cargo crane No.2		
In what condition were the cargo lifting appliances slewing bearings?	Good		
Was slewing bearing wear monitored or rocking tests conducted and recorded?	Yes		

Were all safety features and equipment (e.g. limit switches) fitted on the cargo lifting appliances fully operational?	Yes
In what condition were the cargo lifting appliances control and operating positions, including their operator cabs if fitted?	Good
Were cargo lifting appliances regularly examined by appropriately qualified shore side technician?	Yes
Were cargo lifting appliances angle indicators free to move?	Yes
Was the Safe Working Load (SWL) clearly marked on the cargo lifting appliances?	Yes
What condition were the cargo lifting appliances components such as sheaves, blocks and cylinders in?	Good
Were cargo lifting appliances maintenance records accurate and up to date?	Yes