



ID CONDITION REPORT

ATLANTIC PIONEER

IMO 9388417

Commissioned by:
Container Management Team

Organisation:
Sinokor Merchant Marine Co., Ltd

Inspected at:
Qingdao, China

Date of inspection:
December 01 2025

ADDITIONAL ITEMS
Supplementary materials, accessible online.

 [View Documents](#)

 [View Images](#)

CONTENTS

TERMS OF USE	2
INSPECTION SUMMARY	3
VESSEL PARTICULARS	4
GRADE COMPARISON	5
GRADING DATA	7
DEFECTS LIST	9
GRADING REPORT	12
13 Design and Construction	
14 Hull	
17 Mooring Decks	
20 Weather Decks and Fittings	
23 Ballast Tanks and Systems	
25 Accommodation	
27 Bridge and Navigation Equipment	
28 Engine Room and Machinery	
29 Fire Fighting Equipment and Systems	
30 Lifesaving Appliances	
31 Safe Working Environment	
32 Pollution Control	
35 Onboard Management	
36 Vessel Capabilities and Cargo Systems	
OPERATIONAL DATA	37
TECHNICAL REPORT	42
43 Design and Construction	
44 Hull	
45 Mooring Decks	
47 Weather Decks and Fittings	
48 Ballast Tanks and Systems	
50 Accommodation	
53 Bridge and Navigation Equipment	
56 Engine Room and Machinery	
62 Fire Fighting Equipment and Systems	
64 Lifesaving Appliances	
66 Safe Working Environment	
68 Pollution Control	
72 Onboard Management	
74 Vessel Capabilities and Cargo Systems	

REPORT TERMS OF USE

This report is intended for the sole use of **Container Management Team** and is designed to offer a condition evaluation of the subject vessel, as found on the day of the survey and in the opinion of the surveyor concerned. The report is subject to any access restrictions as described herein, and subject always to the level of cooperation afforded to the surveyor during the inspection itself. All details are given in good faith, and without guarantee.

This report has been prepared and issued by Idwal Marine Services Ltd to its Customer, **Container Management Team of Sinokor Merchant Marine Co., Ltd**, in accordance with, and subject to, the General Terms and Conditions of Idwal Marine Services Ltd, a copy of which can be obtained at <https://www.idwalmarine.com/terms-and-conditions/idwal-id>. Attention is particularly drawn to restrictions on reproduction and disclosure of, and limits on reliance on, this Report as more fully set out therein.

At Idwal, we are proud to run a carbon neutral business and provide the industry's first carbon neutral inspection service. Idwal has been carbon neutral since 2021 and has achieved PAS 2060 certification from Carbon Footprint Ltd.



Carbon
Neutral
Organisation
PAS 2060



INSPECTION SUMMARY



71

IDWAL
GRADE
Inspected. DEC-2025

Inspected at:
Qingdao, China

Date of inspection:
01 Dec 2025

Status:
alongside loading

Time aboard:
9.5 Hours

Documents provided:
Majority of documents provided

An Idwal ID Condition Inspection of the ATLANTIC PIONEER (ex. Max Supporter) was conducted on the 1st December 2025 in Qingdao, China by Idwal under instruction from Sinokor Merchant Marine Co., Ltd.

The ATLANTIC PIONEER is an 8,732 DWT, 7,532 GT, Singapore-flagged, gearless CW 700 Containership built by Cassens Werft GmbH in Germany under Germanischer Lloyd (GL) supervision. The keel was laid on 22nd November 2004, and the vessel was delivered to market on 8th February 2008. The vessel is currently classed with Bureau Veritas and is fitted with a Caterpillar MaK 8M43C main engine.

Good cooperation was provided by the ship's crew, with the majority of documents provided for review. The crew facilitated safe entry for inspection of ballast tanks No.8 port and cargo hold No.3. The vessel was alongside loading at the time of inspection.

The vessel was found to be in good overall condition with an Inspected Idwal Grade at the industry average for vessels of a similar age, type and size. Notable items were identified during the inspection; these are reported specifically in the notable items section of this report.

According to the information provided, the vessel's last Special Survey was carried out on 24th March 2023, with the next Special Survey due on 7th February 2028. The vessel's Port State Control (PSC) history was found to be fair to good, with 8 deficiencies and 0 detentions in the 3 inspections conducted in the past 3 years.

According to the provided IMO DCS Statement of Compliance (SoC) for 2024, which was the latest provided, the vessel's Carbon Intensity Indicator (CII) score was 26.99 gCO₂/dwt.nm, which places the vessel in Band E for that Calendar year.

From 2024 onwards, any vessel that has an E rating in any year or D ratings for 3 consecutive years is required to develop a corrective action plan in the SEEMP Part III, which is required to be confirmed by the Flag Administration or Recognised Organisation (RO).


VESSEL PARTICULARS

Vessel name	Atlantic Pioneer
Previous name	Max Supporter
IMO number	9 3 8 8 4 1 7
Port of registry	Singapore
Ship type	Containership
Flag	Singapore
Classification society	Bureau Veritas
Registered owner	Silver Maritime Fifteen Pte
Technical manager	Columbia Shipmanagement-Sng
Shipbuilder	Cassens Werft Gmbh
Delivery date	08-Feb-08
Dead weight	8,732.00 Mt
Gross tonnage	7,532.00 Mt
Net tonnage	3,553.00 Mt
Length overall	127.00 M
Breadth	20.40 M
Depth	10.35 M
Summer draught	7.75 M
TEU	724.00
Lightweight	3,784.00 Mt

GRADE COMPARISON

[Launch Benchmarking](#)

This section of the report allows you to compare your ship's grade with similar ships. The chart below shows the distribution of Idwal Grades against your vessels sector.

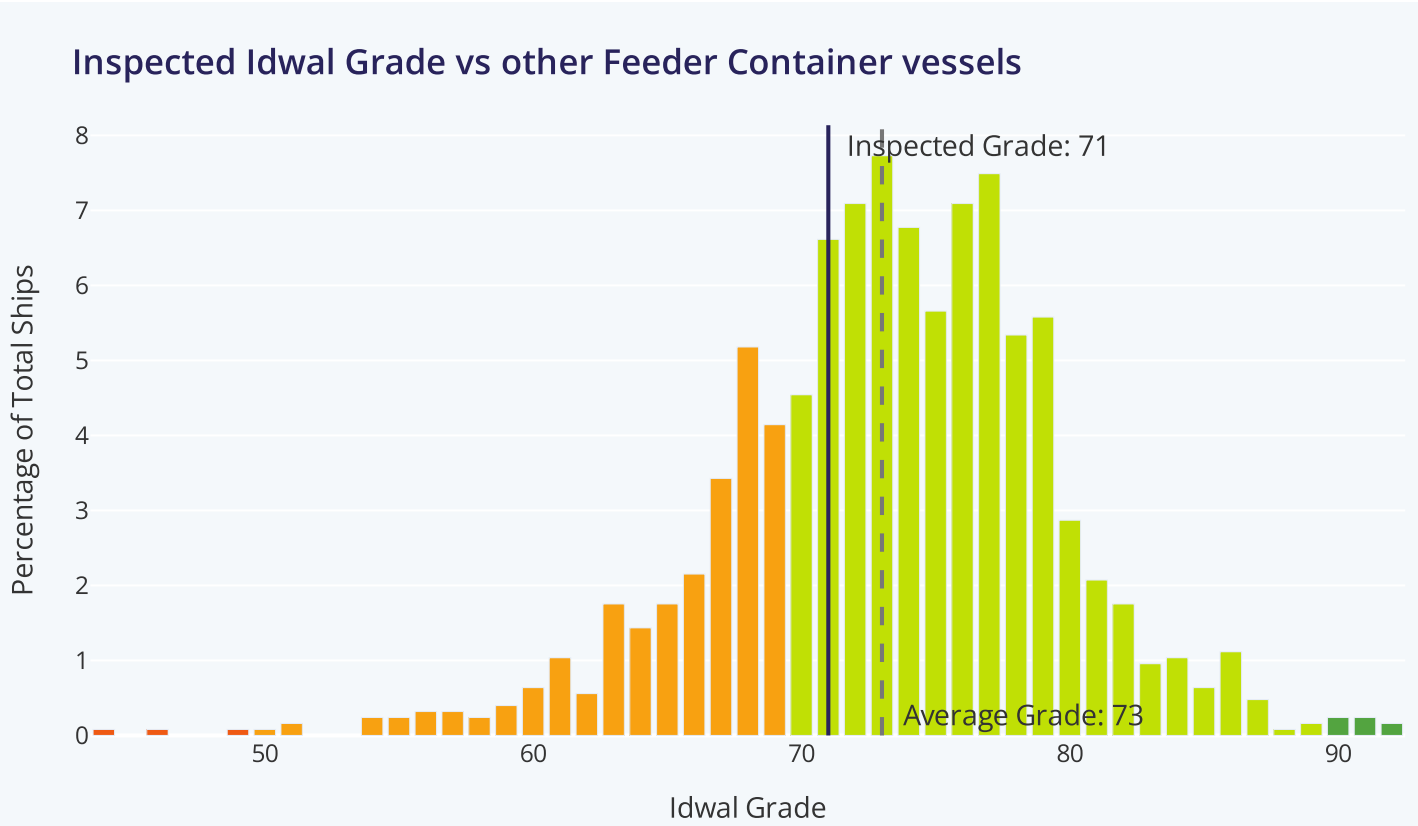

Key

Inspected Idwal Grade

Average Idwal Grade

Grade range

≥ 90

70 - 89

50 - 69

30 - 49


The ship's grade may appear different when compared with the average of the two graphs. This is as a result of the second graph comparing a smaller and more focused sample of ships.

For a more in-depth analysis of where your vessel compares amongst its peers, please contact your Idwal sales rep.

GRADE COMPARISON /

This section of the report allows you to compare your ship's grade with similar ships. The chart below shows the distribution of Idwal Grades against your vessels sector.

Inspected Idwal Grade vs other Feeder Container vessels, age 15-20 years

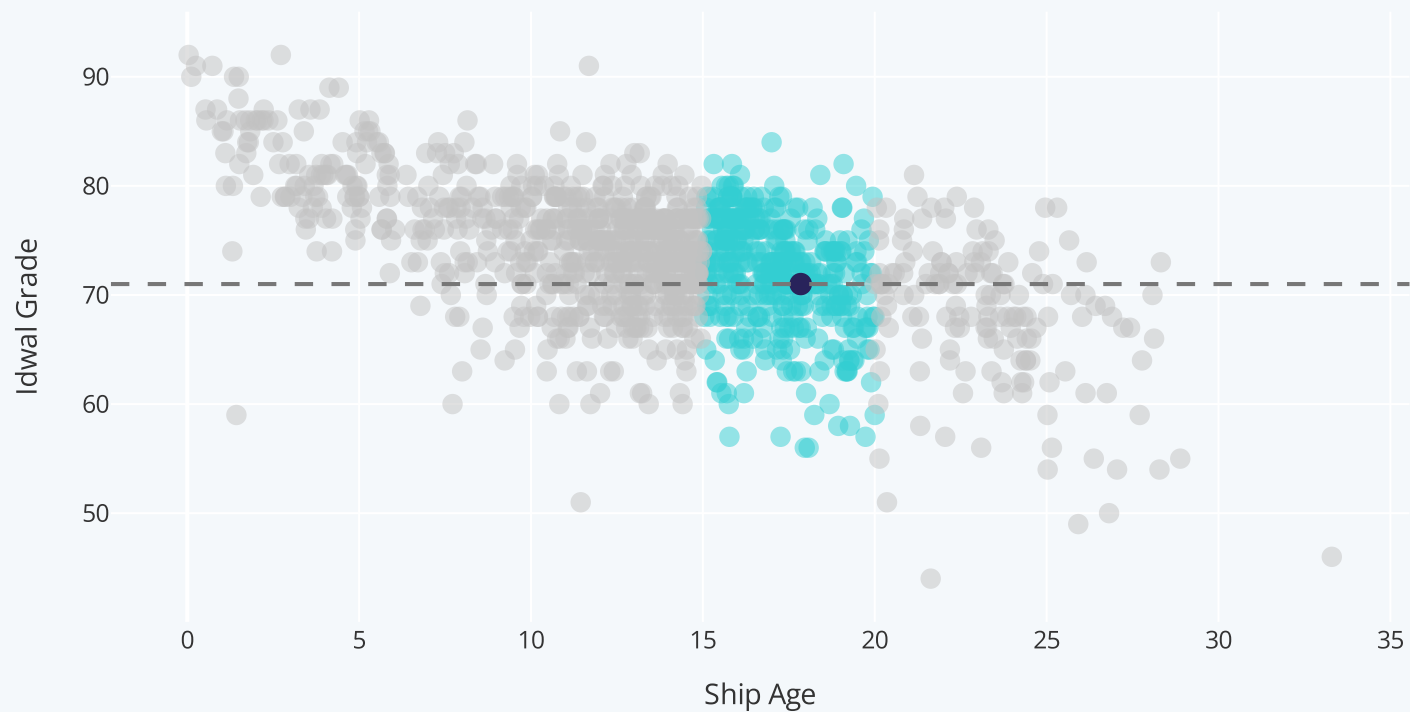

Key

- Inspected Idwal Grade

Average Idwal Grade
- All sector ships

Age comparable ships

The ship's grade may appear different when compared with the average of the two graphs. This is as a result of the second graph comparing a smaller and more focused sample of ships.

For a more in-depth analysis of where your vessel compares amongst its peers, please contact your Idwal sales rep.

GRADING DATA

Launch Grading

71

IDWAL
 GRADE
 Inspected. DEC-2025

The Idwal Grade® is an industry recognised measure of asset integrity. Using proprietary algorithms, the Idwal Grade is programmatically calculated from over 500 individual data points, captured during a rigorous and standardised inspection process. Our data-driven methodology ensures that our reports are consistent, accurate and free from bias.

Sub-Grades

The methodology used to calculate the Idwal Grade® is also applied to the grading of the different vessel areas and categories. Two key areas are the overall vessel condition and vessel management:



The following are grades representing individual areas of interest of the vessel:

Design and Construction	Hull
Mooring Decks	Weather Decks and Fittings
Ballast Tanks and Systems	Accommodation
Bridge and Navigation Equipment	Engine Room and Machinery
Fire Fighting Equipment and Systems	Lifesaving Appliances
Safe Working Environment	Pollution Control
Onboard Management	Vessel Capabilities and Cargo Systems
Forthcoming Regulatory Compliance	Crew Welfare
Crew Performance	Safety Management
Planned Maintenance System (PMS)	Classification and Certification
PSC Performance	

DEFECTS LIST

[Launch Defects](#)

Priority	Grading area	Description	Recommendations
	Engine Room and Machinery	Defect ID: 2-319-630-348 According to the supplied information, the following main engine components were overdue for overhaul. This included the main engine cylinder heads No.3, No.6, and No.8, and the injection pump for cylinders No.1, No.2, No.3, No.4, and No.5. All had exceeded the 15,000 hours since the previous overhaul.	All overdue maintenance should be planned and carried out as soon as practical.
	Mooring Decks	Defect ID: 4-265-680-896 As reported by the crew, the port side anchor and chains had not been used for a long time due to missing studs. As such, the port side anchor is only used for emergencies.	The crew reported that the required spares to rectify the issues have been ordered and will be replaced during the next dry dock repair.
	Hull	Defect ID: 2-319-507-456 Coating breakdown and corrosion on the hull was seen to be moderate, notably on the top side and vertical side aft and at midships.	Areas of coating breakdown and corrosion should be addressed when possible.
	Hull	Defect ID: 2-243-952-640 Minor indentation was observed on the forward section on the starboard side of the hull. Diameter approximately 150mm, and depth approximately 20-30mm.	The areas of damage should be promptly inspected and monitored, and reported to class where required.
	Mooring Decks	Defect ID: 2-319-552-514 Windlass band brakes had only minimal thicknesses remaining	Band brake linings to be renewed when possible.
	Weather Decks and Fittings	Defect ID: 2-319-618-067 Coating breakdown and corrosion on the main deck was seen to be moderate, notably on the cross deck areas and the walkways on port and starboard.	Areas of coating breakdown and corrosion should be addressed when possible.
	Hull	Defect ID: 2-319-470-593 Hull markings were seen to be partly obscured, notably the plimsoll marking and tug markings.	Touch up of hull markings should be considered at the earliest opportunity to ensure legibility.
	Mooring Decks	Defect ID: 2-319-552-516 Bitter end release arrangements for the starboard anchor were obstructed.	Ensure easy access is provided to bitter end release arrangements.
	Mooring Decks	Defect ID: 2-319-556-630 A minor leak was observed from the port side anchor wash piping.	Remedial repairs to be carried out at the earliest opportunity.

	Pollution Control	Defect ID: 2-319-667-215 SOPEP equipment posted had not been reviewed for over a month.	Review the SOPEP equipment and inventory.
	Pollution Control	Defect ID: 2-319-699-985 The lid on the garbage container for oily rags was not an approved material.	Arrange the supply of a suitable garbage container and lid made of a non-combustible material.
	Safe Working Environment	Defect ID: 2-319-704-078 It was noted that the main deck was not applied with a suitable anti-slip coating.	Anti-slip coating to be reapplied as soon as possible.
	Weather Decks and Fittings	Defect ID: 2-831-187-968 Evidence of a leakage observed from the drainage pipe in the passage way for the port side bunker station.	Chief officer will arrange to check and repair the leakage drainage pipe in due course
	Mooring Decks	Defect ID: 2-319-486-999 The starboard anchor chain was noted to be twisted.	To be rectified at the next opportunity.
	Ballast Tanks and Systems	Defect ID: 2-319-515-653 Coating breakdown and corrosion within the inspected ballast tanks was seen to be moderate, notably on the bulkheads, plating, free edges, longitudinals and stiffener plate.	Areas of coating breakdown and corrosion should be addressed when possible.
	Ballast Tanks and Systems	Defect ID: 2-319-671-302 Ballast tank fittings were found in a fair condition due to moderate coating breakdown and corrosion observed on the pipework, supporting brackets and ladders.	Areas of coating breakdown and corrosion should be addressed when possible.
	Mooring Decks	Defect ID: 2-319-536-131 The last brake test was not seen to be stencilled on the mooring winches.	The date of the last brake test should be stencilled on the mooring winches when possible.
	Lifesaving Appliances	Defect ID: 2-319-581-197 The covers of the embarkation ladders located on port and starboard were noted to be holed; additionally, the covers of the pilot ladders were notably small.	Remedial repairs to be carried out at the earliest opportunity.
	Bridge and Navigation Equipment	Defect ID: 2-319-667-210 The monkey island was observed with deposits of soot on the deck plating.	Crew maintenance to be carried out when possible.
	Weather Decks and Fittings	Defect ID: 2-831-245-314 The entrance to the bunker station on the port side of the main deck was not stencilled.	Markings to identify the space to be applied at the earliest opportunity.
	Lifesaving Appliances	Defect ID: 2-831-384-583 The liferafts located forward, port and starboard did not have the vessel's name and port of registry displayed on the container of the liferafts.	Crew to ensure the vessel's name and port of registry are marked on the liferafts.

GRADING REPORT

- ⌘ Design and Construction
- ⌘ Hull
- ⌘ Mooring Decks
- ⌘ Weather Decks and Fittings
- ⌘ Ballast Tanks and Systems
- ⌘ Accommodation
- ⌘ Bridge and Navigation Equipment
- ⌘ Engine Room and Machinery
- ⌘ Fire Fighting Equipment and Systems
- ⌘ Lifesaving Appliances
- ⌘ Safe Working Environment
- ⌘ Pollution Control
- ⌘ Onboard Management
- ⌘ Vessel Capabilities and Cargo Systems

GRADING REPORT/

DESIGN AND CONSTRUCTION



[Review Technical Report](#)

The construction and design was found to be good overall, with the vessel built to IACS standards and rules in Germany by Cassens Werft GmbH. The vessel is a Containership, with 3 holds, driven by a controllable pitch propeller. The Main Engine is a NOx Tier 1, Caterpillar KG 8M43C, and the vessel has 2 Caterpillar KG 6M20 Auxiliary Engines and a shaft generator. It is not on the Enhanced Survey Program or Extended Dry Docking schedule. Although the classification certificate lists a notation for INWATERSURVEY, given that the vessel is over 15 years old, special consideration and approval would be required from the classification society and flag state administration. No documentation was provided in this regard. As detailed in the supplied class status report, the Class Memorandum issued on 20-Aug-18, it was stated that the additional notation "ICE" is inherited from DNV GL notation "E". No additional information or documentation was provided in this regard. No Cargo Lifting Appliances are fitted. No UTM report was made available for review. No additional Bridge or communication equipment are fitted apart from those required by international rules and regulations, though the engine room and machinery were fitted with UMS capabilities and centralised seawater cooling.

Defects

No defects

GRADING REPORT/


HULL



[Review Technical Report](#)

The hull was seen to be in a fair to good overall condition, due to the level of corrosion sighted on the starboard side of the hull and the partly obscured hull markings. An inspection of the hull was possible from the starboard side only. The vessel was free of major structural defects; however, a minor indentation was noted on the forward section on the starboard side of the hull, diameter of approximately 150mm and a depth of approximately 20-30mm. Moderate pitting and spot corrosion affecting up to approximately 20% of the surface area was also observed. A minor section of coating breakdown was also noted on the top side of the forward section. Hull markings were seen to be partly obscured, notably the plimsoll marking and tug markings. Minor marine fouling was observed. The vessel is fitted with fenders, which were observed in good overall condition. The vessel's last out-of-water bottom survey was carried out on 24th March 2023, with the next out-of-water bottom survey due by 24th March 2026.

Defects

Priority	Description	Recommendations
	Defect ID: 2-319-507-456 Coating breakdown and corrosion on the hull was seen to be moderate, notably on the top side and vertical side aft and at midships.	Areas of coating breakdown and corrosion should be addressed when possible.

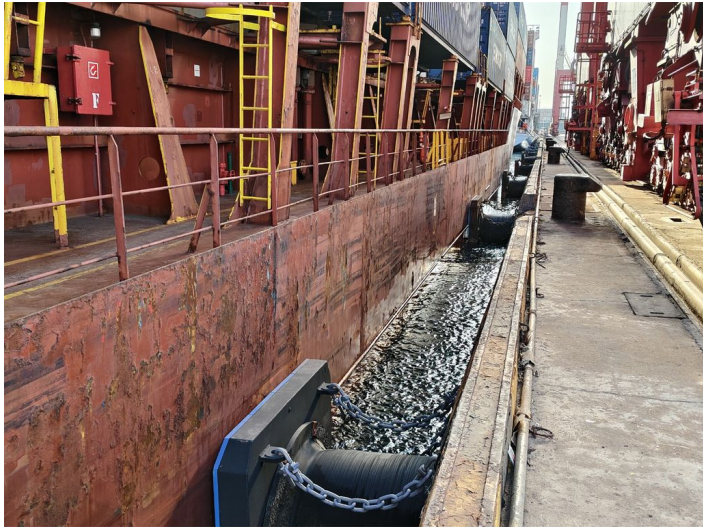


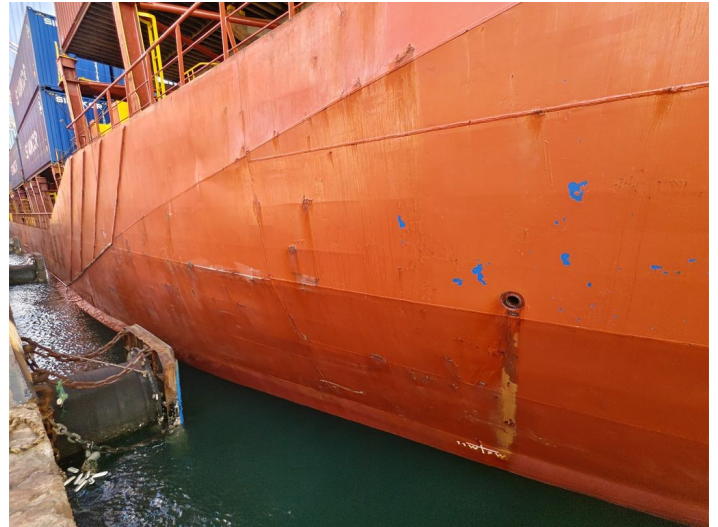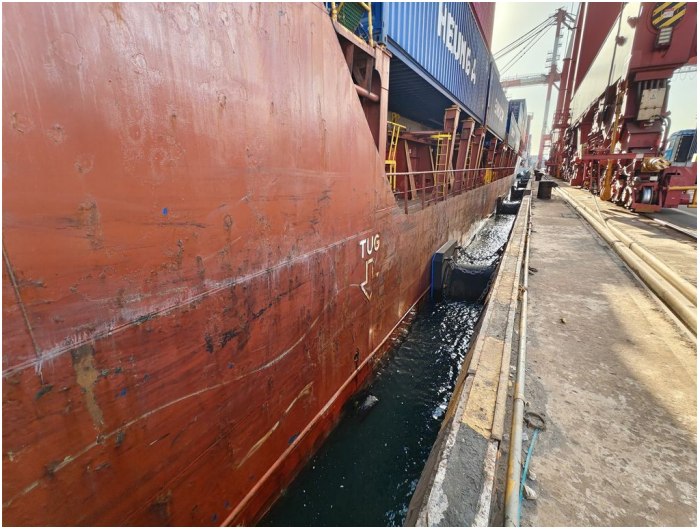

Defect ID: 2-243-952-640

Minor indentation was observed on the forward section on the starboard side of the hull. Diameter approximately 150mm, and depth approximately 20-30mm.



The areas of damage should be promptly inspected and monitored, and reported to class where required.

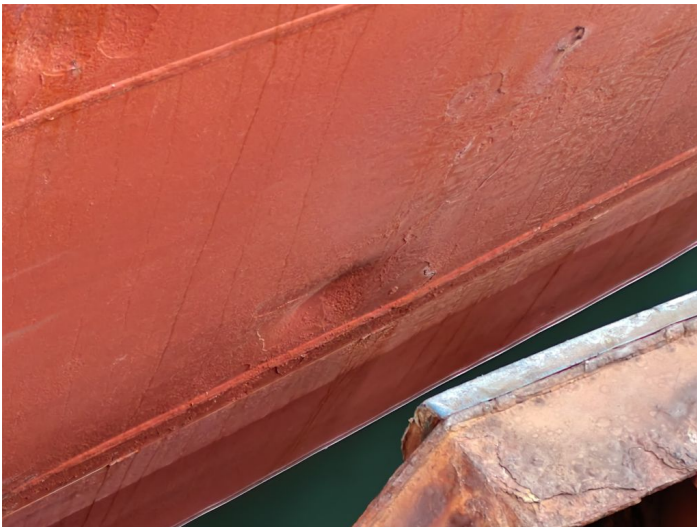

Defect ID: 2-319-470-593

Hull markings were seen to be partly obscured, notably the plimsoll marking and tug markings.

Touch up of hull markings should be considered at the earliest opportunity to ensure legibility.

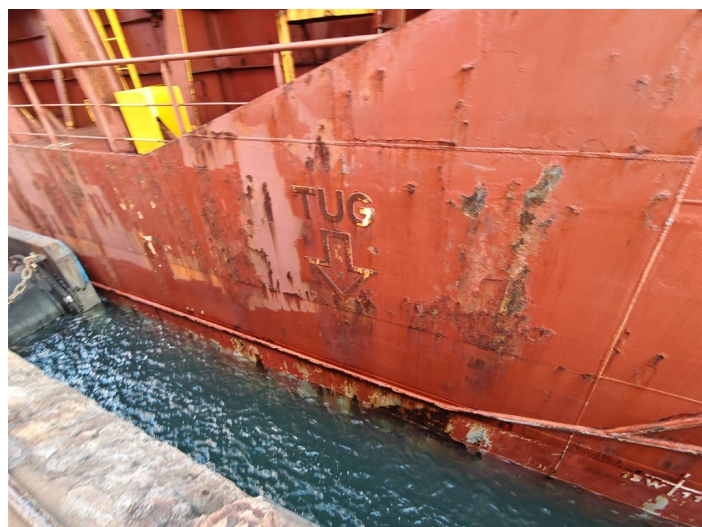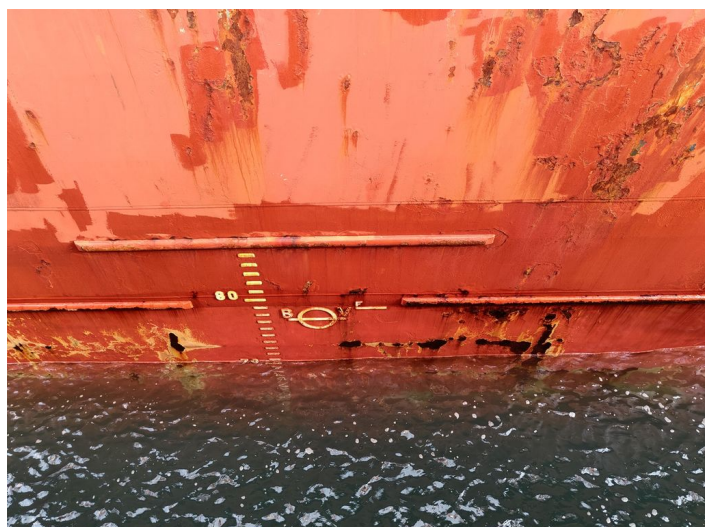

GRADING REPORT/

MOORING DECKS




Review Technical Report

The mooring decks were in fair condition overall, due to the reported issues with the port anchor chain, obstructed bitter end release arrangements, and the minimal remaining band brake thickness. The mooring decks were free of structural defects with only minor localised pitting and spot corrosion covering approximately 10% of the mooring deck plating total surface area. Corrosion was observed mainly in the deck surface and free edge area. Deck fittings were in good condition, with a sample of fairleads and mooring rollers free to turn when tested. All electric windlasses and winches were reported as fully operational. Mooring machinery was in generally good condition; however, band brake thicknesses were minimal and would require replacement. The last brake test was not seen to be stencilled on the mooring winches. Mooring ropes were in good condition, whilst anchor chains were in fair condition, as a twist was noted to the starboard anchor chain. As reported by the crew, the port side anchor and chains had not been used for a long time due to missing studs. As such, the port side anchor is only used for emergencies. The crew reported that the required spares to rectify the issues have been ordered and will be replaced during the next dry dock repair. Mooring practices were good, and snap-back zone warnings were posted at the entrances to mooring areas as per industry best practice. The Bosun's store was in good structural condition with no visible damage sighted or reported, but with early-stage coating breakdown and corrosion observed. Housekeeping was fairly neat, with some scattered equipment seen. Within the bosun store, a minor leak was observed from the port side anchor wash piping. The bitter end release arrangements for the starboard anchor were obstructed, which may delay the emergency release of the anchor. The emergency towing booklet was available near the Foc'sle.

Defects

Priority	Description	Recommendations
	Defect ID: 4-265-680-896 As reported by the crew, the port side anchor and chains had not been used for a long time due to missing studs. As such, the port side anchor is only used for emergencies.	The crew reported that the required spares to rectify the issues have been ordered and will be replaced during the next dry dock repair.
	Defect ID: 2-319-552-514 Windlass band brakes had only minimal thicknesses remaining	Band brake linings to be renewed when possible.
	Defect ID: 2-319-552-516 Bitter end release arrangements for the starboard anchor were obstructed.	Ensure easy access is provided to bitter end release arrangements.

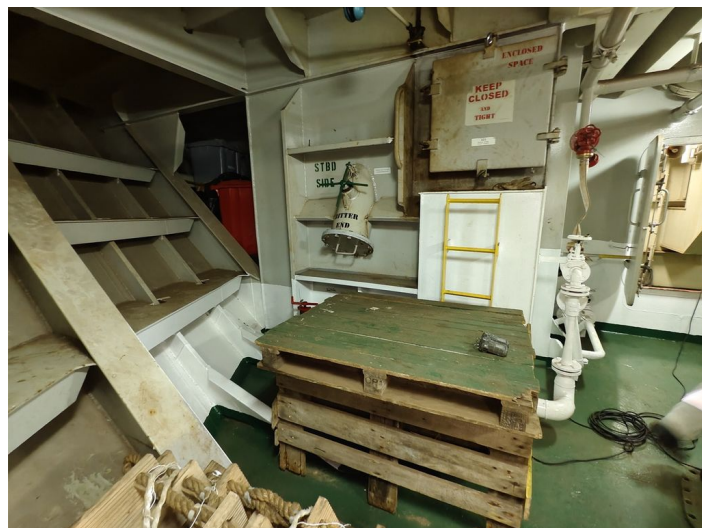

Defect ID: 2-319-556-630

A minor leak was observed from the port side anchor wash piping.


Remedial repairs to be carried out at the earliest opportunity.



Defect ID: 2-319-486-999

The starboard anchor chain was noted to be twisted.


To be rectified at the next opportunity.

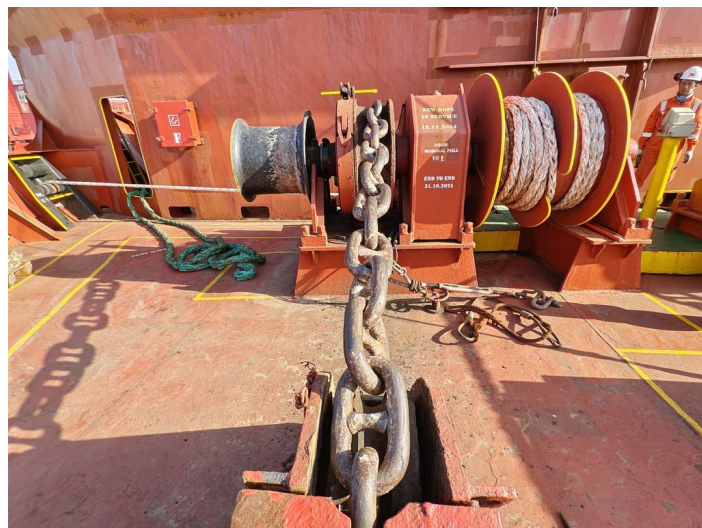

Defect ID: 2-319-536-131

The last brake test was not seen to be stencilled on the mooring winches.

The date of the last brake test should be stencilled on the mooring winches when possible.

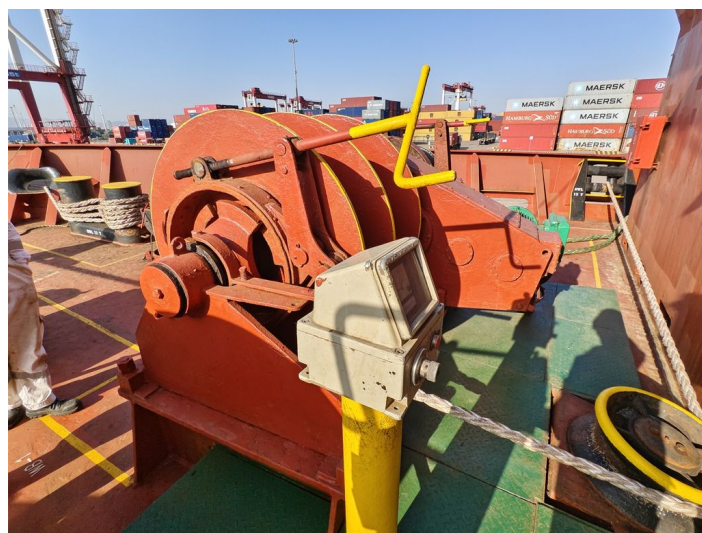

GRADING REPORT/



WEATHER DECKS AND FITTINGS

[Review Technical Report](#)

The Weather Decks and Fittings were seen to be in fair to good condition overall, due to the level of corrosion sighted, notably on the cross-deck areas. The decks were free of structural defects but had moderate pitting and spot corrosion affecting approximately 15% of the main deck plating's total surface area. This corrosion was observed mainly on the main deck and cross-deck areas. Deck fittings were in good condition, with pipework and fittings free of leakages. The accommodation ladders, gangways and provisions lifting appliances were all in good overall condition, with no notable defects found.

Defects


Priority	Description	Recommendations
	Defect ID: 2-319-618-067 Coating breakdown and corrosion on the main deck was seen to be moderate, notably on the cross deck areas and the walkways on port and starboard.	Areas of coating breakdown and corrosion should be addressed when possible.

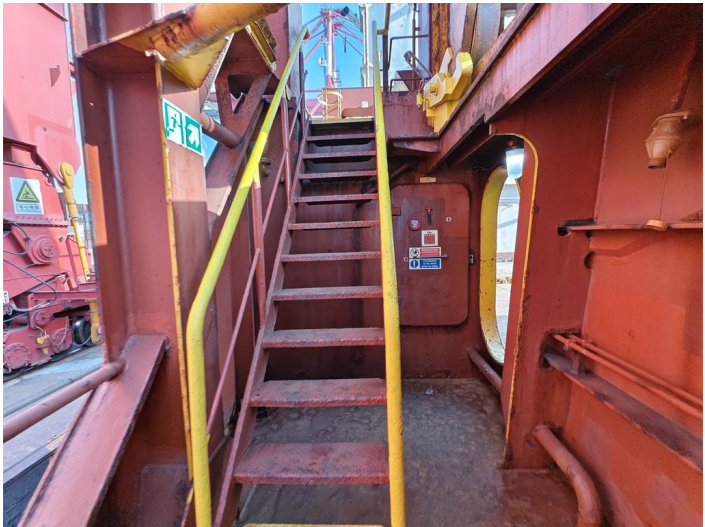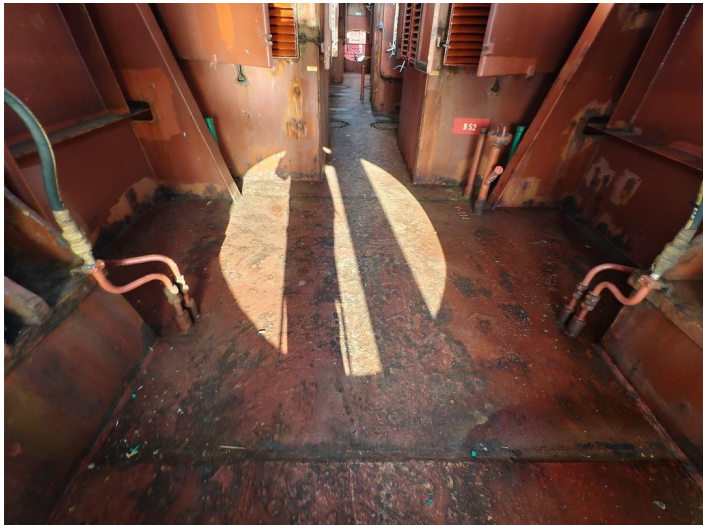



Defect ID: 2-831-187-968
Evidence of a leakage observed from the drainage pipe in the passage way for the port side bunker station.

Chief officer will arrange to check and repair the leakage drainage pipe in due course

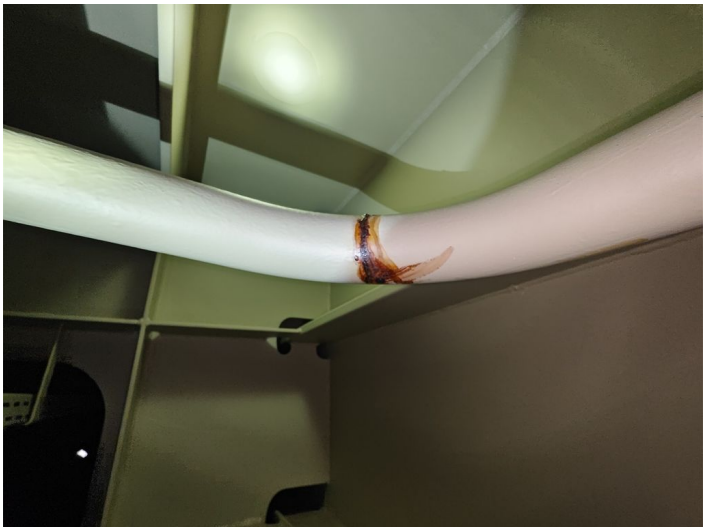

Defect ID: 2-831-245-314
The entrance to the bunker station on the port side of the main deck was not stencilled.

Markings to identify the space to be applied at the earliest opportunity.

GRADING REPORT/

BALLAST TANKS AND SYSTEMS

60

[Review Technical Report](#)

Ballast tanks and systems were deemed to be in fair overall condition, due to the level of corrosion observed within the inspected tanks, including the coating breakdown and corrosion of ballast tank fittings. During the inspection, the forepeak tank and WBT No.18 P were entered for inspection. Inspection reports and photographs of the most recent ballast tank entries reportedly taken by the crew between the 3rd October 2025 and 11th November 2025 were provided for review. The inspection reports and photographs are of double bottom tank No.3 S, double bottom tank No.4 P, wing tank No.13 S, wing tank No.14 P, WBT No.16 P, and wing tank No.18 P. The condition assessment of the ballast tanks is limited in all regards to the tanks inspected, and the photos from the historical inspections provided by the crew. The inspected ballast tanks were found to be generally free of significant structural defects but had moderate pitting and surface corrosion, up to approximately 35% of the ballast tanks total surface area, mainly located on the bulkheads, plating, free edges, longitudinals and stiffener plate. As far as could be inspected, ballast tank fittings were found in a fair condition due to moderate coating breakdown and corrosion observed on the pipework, supporting brackets and ladders. In the provided photographs, tanks are shown with a minimal amount of mud/sediment accumulation but were free of any signs of staining from sewage or marine fouling. Ballast control systems, such as valves and gauges, were reported to be fully operational, and all ballast pumps were in good working order and in good visual condition.

Defects

Priority	Description	Recommendations
	Defect ID: 2-319-515-653 Coating breakdown and corrosion within the inspected ballast tanks was seen to be moderate, notably on the bulkheads, plating, free edges, longitudinals and stiffener plate.	Areas of coating breakdown and corrosion should be addressed when possible.





Defect ID: 2-319-671-302

Ballast tank fittings were found in a fair condition due to moderate coating breakdown and corrosion observed on the pipework, supporting brackets and ladders.

Areas of coating breakdown and corrosion should be addressed when possible.



GRADING REPORT/

ACCOMMODATION



[Review Technical Report](#)

The accommodation areas were in good condition overall, with floor and wall coverings in good condition and upholstery and furniture free from deterioration and defects. The levels of housekeeping and cleanliness were good, with hygiene levels also good in the sanitary facilities. The hospital was well equipped and ready for use, with drugs controlled and secured, and the associated drugs log kept up to date. The accommodation was outfitted to an average quality. The Air Handling Unit (AHU) was maintaining a comfortable temperature and was in good condition with no defects. The galley equipment was in good overall condition, with all equipment reportedly in good working order. The galley was in a clean condition, with the galley hoods also kept clean. The vessel's stand alone/domestic cold provisions stores were clean and hygienic with temperatures at the required levels. The external superstructure was free of structural defects and had only minor localised pitting and spot corrosion, up to approximately 5% of the surface area, mainly located on the free edge areas, particularly on higher sections of the accommodation. The external superstructure fittings, such as lighting, vent heads, windows/portholes, stairways, railings etc. were in fair overall condition due to corrosion observed on the edge of portholes, lighting support etc., but with all external accommodation doors in good working order and properly closing. The vessel's Crew Welfare was found to be good overall. The average contract length was reported to be 6 months for the vessel's officers and 9 months for the vessel's crew, with it noted that a crew suggestion policy was in place. The vessel was reported to have free to access and limited use Wi-Fi onboard which was available to all crew. It was reported that the approximate internet speed was average, indicating the crew were able to access social media apps and websites with ease. The vessel had various pieces of public recreational equipment that the crew could access, including free weights, television, karaoke, musical instruments, barbecue, and public computer. It was noted that the available recreational equipment was limited. As per crew reports, access is provided to catering facilities at all times, with it also reported that crew were given additional time and resources to celebrate religious and cultural events. Various facilities were provided in all crew cabins, including en-suite facilities, sofa, desk, and ample storage, with reports of a fridge being provided in crew cabins. It was also stated that the crew have access to a well-stocked bond store. It was stated that the vessel has onboard training facilities as provided by KAIRO/Cape, with it also noted as per crew reports additional periods of rest were given throughout the working week.

Defects

No defects

Positive items

Description	
	Positive ID: 1-036-251-137 The vessel is reportedly fitted with free to access limited use Wi-Fi system

BRIDGE AND NAVIGATION EQUIPMENT

The Bridge and navigation equipment were found to be in good condition overall, with housekeeping found to be good and with all bridge equipment reported to be fully operational. The vessel's VDR was found to be free from any unanticipated alarms, with collection instructions posted nearby, and with the Bridge Navigation Watch Alarm System (BNWAS) reported to be fully operational. The vessel's primary means of navigation, as listed on form E of the safety equipment certificate, is paper charts, which were found to be up to date. An in-date compass deviation card was seen to be posted near the helm, and the compass deviation log was well maintained and without any major deviations. The vessel is licensed to cover GMDSS sea areas A1, A2, and A3 and had a valid shore-servicing agreement in place. The radio batteries were seen to be well maintained and in good condition, and the EPIRB, SART and VHF handheld batteries were all in date as required. Berth-to-berth passage plans were seen onboard and were signed by all navigating officers with nautical publications provided in paper and electronic format. Master's standing and night orders were found to be signed by all navigating officers, with the bridge logbook and the GMDSS logbook up to date and correctly completed. The Monkey Island was noted to be covered with soot deposits due to the design and location of the funnel. However, the mast, aerials and antennas were seen to be satisfactory and free of defects.


Defects

Priority	Description	Recommendations
----------	-------------	-----------------



Defect ID: 2-319-667-210
The monkey island was observed with deposits of soot on the deck plating.

Crew maintenance to be carried out when possible.

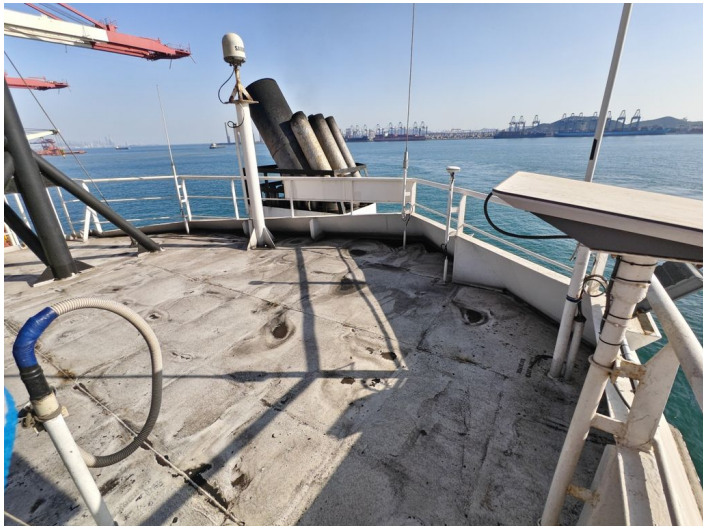

GRADING REPORT/

ENGINE ROOM AND MACHINERY

70

Review Technical Report

The Engine room and machinery were found to be in a fair to good overall condition due to the overdue maintenance of main engine components. No significant defects were reported or observed. The general levels of housekeeping and cleanliness in the engine room were found to be good. During the inspection, the auxiliary engines, purifiers, pumps, air compressors, sewage treatment plant, auxiliary boiler, refrigeration compressor and air conditioning compressor were seen running. Scavenge space inspection reports were not available for review, but have been requested from the vessel manager/owner. Maximum cylinder liner wear measurements were not available, as it was reported that the cylinder liners are renewed at 30,000 hours, and no measurements are taken. According to the supplied information, the following main engine components were overdue for overhaul. This included the main engine cylinder heads No.3, No.6, and No.8, and the injection pump for cylinders No.1, No.2, No.3, No.4, and No.5. All had exceeded the 15,000 hours since the previous overhaul. Upon review of the latest main engine performance report, it was noted that there were no areas of concern. Propulsion systems, such as shafting arrangements, were in good working condition. Thrusters were reportedly fully operational and seen to be in good condition with no major visible defects. The vessel is fitted with 2 auxiliary engines, which were all reported to be fully operational and were seen to be in good condition with no major visible defects. A review of the supplied auxiliary engines' running hours showed no areas of concern. Upon review of the latest auxiliary engine performance reports, it was noted that there were no areas of concern. The vessel's thermal oil boiler was found to be fully operational and in good overall condition. The steering gear was in good working order and free of leakages. All auxiliary machinery and equipment were reported to be fully operational and observed in good visual condition. The engine room structure, including bulkheads and frames, was seen to be in good condition, and engine room fittings such as handrails, ladders, floor plates and lighting were also found in good condition. Engine room pipework was seen to be generally free of significant corrosion and free from leakages. Pipework was free of any temporary repairs, including soft patches. Pipework insulation lagging was seen with some areas of deterioration and staining, and anti-splash tape was seen to be in place at all required pipe connections. Bilge alarms were found to be fully operational during testing. All Engine Control Room automation and monitoring systems were found to be fully operational and with no serious active alarms present. No concerning engine room control system alarms were seen on the manually blocked/disabled alarm list. The engine room deadman and engineer call alarms were found to be fully operational during testing. A review of the supplied lube oil analysis reports showed no areas of concern. Fuel oil analysis reports were not available for review, but have been requested from the vessel manager/owner. Engine room documentation, such as the engine room logbook, standing orders, NOx technical file etc. were reviewed and found to be well-maintained and up to date. All machinery and equipment manuals were reported to be available onboard. Package air conditioning units around the vessel were all operational and in good condition. Electrical distribution systems, including the main and emergency switchboards, were in good working order, with all insulation readings seen to be adequate. Recent Megger test reports were seen with no abnormal findings. The emergency generator was tested during the inspection and found to be in good working order and was in good overall condition.

Defects

Priority	Description	Recommendations
	Defect ID: 2-319-630-348 According to the supplied information, the following main engine components were overdue for overhaul. This included the main engine cylinder heads No.3, No.6, and No.8, and the injection pump for cylinders No.1, No.2, No.3, No.4, and No.5. All had exceeded the 15,000 hours since the previous overhaul.	All overdue maintenance should be planned and carried out as soon as practical.

GRADING REPORT/

FIRE FIGHTING EQUIPMENT AND SYSTEMS



[Review Technical Report](#)

Fire Fighting Equipment and Systems were found to be in good condition overall and generally free of fire hazards, with all firefighting equipment seen to be regularly serviced and inspected. The fire detection and alarm system was fully operational and free of signs of tampering and alarms. The vessel is fitted with CO2 and water spray fixed firefighting in the engine room and within the cargo areas. No fixed firefighting systems are fitted within the accommodation. Fixed firefighting systems were all reported to be in good working condition with operating instructions clearly posted. The main and emergency fire pumps were reportedly fully operational, and both were found to be in good condition, free of leakages. A fire pump was tested during the inspection and was found to deliver adequate pressure. The fire main and ancillaries, such as hydrants and valves, were in good overall condition, free of defects. Fire extinguishers were all in good condition, and all portable equipment were positioned in accordance with the fire plan. Firefighting outfits and associated equipment were all in good condition, with BA equipment found fully charged and ready for use. Remote shutdown emergency devices, such as quick closing valves, machinery stops and ventilation dampers, were deemed to be in good overall condition with no defective shutdown equipment. The fire doors were found to be in good condition, closing effectively and free from any unauthorised 'hold-open' arrangements.

Defects

No defects

Lifesaving appliances were seen to be in good overall condition, with all equipment regularly serviced and inspected as required. The vessel is fitted with 1 free-fall lifeboat, which was seen to be in good overall condition externally and internally. The lifeboat engine was tested during the inspection and found to be in good working order. The vessel's rescue boat was found to be in good overall condition and ready for immediate use. The vessel is equipped with 3 life rafts, which were found to be in good condition with Hydrostatic Release Units (HRUs) in date and correctly rigged. Davits and lowering arrangements were found to be in good condition overall, with evidence of regular maintenance, servicing and inspection sighted and evident. Ancillary lifesaving equipment such as lifejackets, immersion suits and EEBD's etc. were found to be in good condition and ready for immediate use, with man overboard smoke and light signals seen to be in date. Embarkation ladders were not found to be well-maintained due to port and starboard side embarkation ladder covers found partly holed, though the pyrotechnics and line-throwing apparatus were seen to be appropriately stored and within their expiry dates.

Defects

Priority	Description	Recommendations
----------	-------------	-----------------



Defect ID: 2-319-581-197
The covers of the embarkation ladders located on port and starboard were noted to be holed; additionally, the covers of the pilot ladders were notably small.

Remedial repairs to be carried out at the earliest opportunity.



Defect ID: 2-831-384-583
The liferafts located forward, port and starboard did not have the vessel's name and port of registry displayed on the container of the liferafts.

Crew to ensure the vessel's name and port of registry are marked on the liferafts.

GRADING REPORT/

SAFE WORKING ENVIRONMENT


80

[Review Technical Report](#)

Safe working was deemed to be good overall, with no unsafe practices observed during the inspection and the vessel presenting a generally safe working environment. Hazards were seen to be clearly marked, though improvements could be made to external walkways due to the main deck anti-slip not being adequately coated. Adequate PPE was seen to be worn by the crew at all times, and portable gas detection meters were provided and calibrated. Hazardous substances were seen to be generally safely managed with appropriate Material Safety Data Sheets provided. Risk Assessments (RA) were seen to be up to date and satisfactory, with enclosed space entry procedures followed and an effective Permit To Work (PTW) system in place. Main and emergency exits were clearly identified and unobstructed, with all IMO signage seen to be satisfactory. The pilot ladder was seen to be in good condition and was secured in a safe manner. Regular drills were conducted on board, with the last drill conducted on 26th November 2025, which was a rescue boat launching drill.

Defects

Priority	Description	Recommendations
	Defect ID: 2-319-704-078 It was noted that the main deck was not applied with a suitable anti-slip coating.	Anti-slip coating to be reapplied as soon as possible.

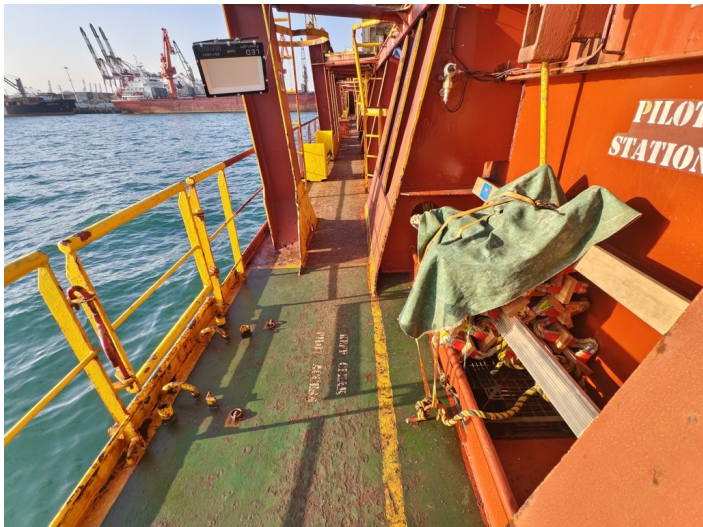

GRADING REPORT/

POLLUTION CONTROL

80

 Review Technical Report

Pollution control was deemed to be good overall and generally found to be well implemented onboard, with the vessel free of pollution hazards. The vessel holds a class-approved Inventory of Hazardous Materials, which is required for entry into EU ports. The vessel's Oily Water Separator (OWS) was found to be fully operational and in good overall condition, with no obvious defects. The OWS was simulation tested during the inspection, and the 15ppm Oil Content Meter (OCM) was seen to be calibrated. The bilge overboard was seen to be sealed and locked against unauthorised opening, and the oily water treatment system as a whole was seen to be free from signs of tampering or unauthorised modification. The SOPEP locker or box was found to be well stocked with SOPEP equipment in good condition, though the SOPEP inventory was not up to date, with its last review dated on the 30th October 2025. The Oil Record Book (ORB) was seen to be well-maintained and up-to-date, with the last entry on the 30th November 2025. It was reported that a US coastguard approved Ballast Water Treatment System (BWTS) is fitted which was found to be fully operational and in good overall condition. The vessel's ballast record book was seen to be up to date and correctly filled in. The vessel was not found to be Vessel General Permit (VGP) compliant, as the vessel had no valid oil-to-water interface controls, such as Environmentally Acceptable Lubricants (EALs) or an Airseal. The vessel's sewage treatment plant was found to be fully operational and in good overall condition, with no obvious defects. Garbage segregation was found to be good, with adequate, labelled containers, and garbage was seen to be well sorted, though the lid of the oily rags garbage container was not made of approved non-combustible materials. The Garbage Record Book (GRB) was seen to be well-maintained and up-to-date, with the last entry on the 29th November 2025. The Emission Control Area (ECA) change-over logbook was reviewed and found to be satisfactory, with the date of last entry on 28th November 2025. As per the Statutory Memorandum issued on 24th April 2025, it was stated that as per the declaration of ship owner, the incinerator which had been originally installed on board, is no longer in use, All references to the incinerator have been removed from the statutory certificates, and no further statutory surveys or inspections related to the incinerator are required unless the equipment is reinstated for use. The vessel complies with IMO 2020 regulations by employing the use of Very Low Sulphur Fuels Oils (VLSFO) with a sulphur content of less than 0.5%.

Defects

Priority	Description	Recommendations
	Defect ID: 2-319-667-215 SOPEP equipment posted had not been reviewed for over a month.	Review the SOPEP equipment and inventory.
	Defect ID: 2-319-699-985 The lid on the garbage container for oily rags was not an approved material.	Arrange the supply of a suitable garbage container and lid made of a non-combustible material.



Positive items

Description	
	Positive ID: 1-036-132-352 It was reported that a USCG approved BWTS is installed

GRADING REPORT/

ONBOARD MANAGEMENT



[Review Technical Report](#)

Onboard management was found to be good overall. The computer-based Safety Management System (SMS) was functioning and well implemented in general, with Permits to Work (PTW), risk assessments and procedures understood and followed. Onboard management dealt with accidents, near misses and deficiencies in an effective manner, and regular safety committee meetings were carried out on board. The vessel's MLC certificate was valid with records of hours of rest (ILO) correct and up to date, and maximum work hours not regularly exceeded. The PMS system was kept up to date, though some critical overdue work orders were noted, including the main engine components including main engine cylinder heads No.3, No.6, and No.8, and the injection pump for cylinders No.1, No.2, No.3, No.4, and No.5. Crew performance has been graded fair to good due to the overdue maintenance and the cosmetic appearance including coating breakdown and corrosion observed in a number of areas on the vessel. The non-type-approved software-based Planned Maintenance System (PMS) was not fully integrated with the SMS for ordering of spares and general vessel management. As such the PMS has been graded fair accordingly. The Port State Control (PSC) history was fair to good, with 8 deficiencies and 0 detentions in the 3 inspections conducted in the past 3 years. The vessel's flag is not targeted by any Memorandum of Understanding (MoU) or the USCG. Security access controls were satisfactory, with the vessel conforming to International Ship and Port Security (ISPS) standards. The Master and crew were prepared for the inspection and provided good cooperation with the majority of the requested documents provided.

Defects

No defects

GRADING REPORT/

VESSEL CAPABILITIES AND CARGO SYSTEMS



Review Technical Report

Vessel capabilities and cargo systems were deemed to be in fair to good overall condition due to the level of corrosion sighted within the cargo hold and from the provided photographs. Holds No.3 cargo hold were entered for inspection, and photographs of all cargo hold entries reportedly from 25th October 2025 were provided for review. From the photographs provided, it was seen that the cargo hold structural members were free of damage and had only minor localised pitting and spot corrosion, up to approximately 10% of the surface area, mainly located on the tank top and side plate welding seam area. Cell guides were free of damage and deformation. Cargo hold fittings such as ladders, handrail, ventilation ducts, light fixtures and pipe guards etc. were seen to be generally free of damage, and all cargo monitoring systems were fully operational. The cargo holds were free of signs of water ingress, both from internal and external sources. Mechanical ventilation systems were in good working order. The vessel is fitted with hydraulic folding hatch covers, which were seen to be well aligned and closing correctly. Hatch covers were found to be free of structural defects and had only minor localised pitting and spot corrosion, up to approximately 15% of the surface area. Corrosion was observed mainly in the top surface round socket seat area. Hatch cover rubber seals and retaining channels were in good overall condition. Hatch coamings were found to be free of structural defects and had only minor localised pitting and spot corrosion, up to approximately 10% of the surface area. Corrosion was observed mainly in the top surface and free edge area. Compression bars/strips were seen to be in good condition with hatch coaming drain channels free of corrosion, scaling and debris and the hatch coaming non-return valves clear and operational. Cargo securing fittings such as container sockets, pad-eyes and D-rings etc. were in fair condition due to corrosion mainly located in the container sockets. Cargo securing equipment was plentiful, with inspection records maintained and securing equipment in good condition as observed. Stability calculations were seen to be carried out, and the vessel holds a Document of Compliance (DOC) for the carriage of Dangerous Goods (DG). The vessel is equipped to carry 156 reefer containers whose temperatures were effectively monitored. Reefer sockets were seen in good condition with switchboards free of low insulation or earth faults. The vessel uses its own power for all Reefer containers, without the need for an additional auxiliary power unit.

Defects

No defects

OPERATIONAL DATA

Operational Data Condition

Does the vessel have an Exhaust Gas Cleaning System (EGCS)?	No
Total High Sulphur Fuel Oil (HSFO) capacity:	0 m ³
Total Very and Ultra Low Sulphur Fuel Oil (VLSFO and ULSFO) capacity:	810.1 m ³
Total Marine Gas Oil (MGO) and Diesel Oil (DO) capacity:	108 m ³
Does the vessel have any energy efficiency technologies installed?	No

Engines Table

	Main Engine 1	Main Engine 2	Aux Engine 1	Aux Engine 2	Aux Engine 3	Aux Engine 4
Designer	Caterpillar		Caterpillar	Caterpillar		
Model	8M43C		6M20	6M20		
Original Power (MCR)	7200		1020	1020		
Number of Cylinders	8		6	6		
Speed (RPM)	500		900	900		
Bore (mm)	430		200	200		
Stroke (mm)	610		300	300		
Specific Fuel Oil Consumption (SFOC) (g/kWhr) At 75% load for ME and 50% load for AEs, corrected to ISO conditions, as stated on Nox technical files	185.3		185.3	185.3		
Nox Tier	1		1	1		
System Oil Consumption (litres/day)	35		7	7		
Total Running Hours (Hours)	79939		43609	47871		
Major Overhaul Interval (Hours)			15000	15000		
Running Hours since last overhaul (Hours)			9678	12947		

Main Engine Maintenance

Component	Condition Based Monitoring?	Overhaul Interval
Cylinder Heads		15000
Pistons		30000
Bearings		30000
Cylinder Liners		30000
Turbocharger(s)		12000

Main Engine No.1	Unit Running Hours											
Component	1	2	3	4	5	6	7	8	9	10	11	12
Cylinder Heads	3677	8983	15107	4242	8983	15456	8983	15166				
Pistons	15166	15286	15107	15286	15107	15456	8983	15166				
Bearings	15107	15107	15107	15107	15107	15107	15107	15107	15107			
Cylinder Liners	15166	15166	15166	15166	15166	15166	15166	15166				
Turbocharger(s)	8983											
Was there any overdue maintenance for any main/auxiliary engine ancillaries (exhaust valves, fuel pumps, fuel injectors etc.)? Please provide further details	Yes											
	ME - cylinder heads 3,6.8; Fuel pressure pump 1-5; Camshaft/Crankshaft damper, L0 cooler chemical cleaning over due AE No.1 &No.2 - AIR cooler cleaning over due											

Main Engine

	Vessel Speed (knots)	Consumption (t/day)
Loaded Eco	12.1	17.0
Loaded Service	13.5	23.0
Ballast Eco	12.5	14.5
Ballast Service	14.5	21.0
Full Load	15.5	29.0

Auxiliary Engines (t/day)

At Sea	0.0
In Port	1.1

Boiler (t/day)

At Sea	0.0
Cargo Heating (if applicable)	0.0
In Port (Idle)	0.4
Cargo Operations (if applicable)	0.0

Class Surveys

Were all Class and Statutory certificates valid?	Yes
Is the vessel on the Extended Dry Docking (EDD) program?	No
Is the vessel on the Enhanced Survey Program (ESP)?	No
Does the vessel have an In Water Survey Class notation?	No
Is the vessel ice classed?	Yes

Survey	Date Last Completed	Date Next Due
Main / Special / Renewal	24-Mar-23	07-Feb-28
Intermediate		07-May-26
Annual	24-Apr-25	07-May-26
Bottom in dry dock	24-Mar-23	24-Mar-26

What was the location of the last out-of-water docking?	Yeosu Ocean Shipyard , South Korea
Is the vessels last dry dock report provided and attached?	Yes

Has the vessel remained with the same flag since build? Please provide further details	No		
	Singapore Since 01/12/2022 Liberia Since 001/08/2028 Malta Since 01/12/2015 Antigua and Barbuda Since 01/02/2008		
Has the vessel remained with the same Class since build? Please provide further details	No		
	GL - Germanischer Lloyd		
In total, how many of the following does the vessel have? Conditions of Class, Recommendations of Class, Statutory Findings, Statutory Items, Conditions of Authority, etc.	0		
	Description	Area	Due Date
Does the vessel have any Class Memos, Observations or Additional Requirements? Please provide further details	Yes		
	Additional nation "ICE" is inherited from DNV GL notation "E"		
What was the status of the vessel at the time of inspection?	alongside loading		

TECHNICAL REPORT

- ⌘ Design and Construction
- ⌘ Hull
- ⌘ Mooring Decks
- ⌘ Weather Decks and Fittings
- ⌘ Ballast Tanks and Systems
- ⌘ Accommodation
- ⌘ Bridge and Navigation Equipment
- ⌘ Engine Room and Machinery
- ⌘ Fire Fighting Equipment and Systems
- ⌘ Lifesaving Appliances
- ⌘ Safe Working Environment
- ⌘ Pollution Control
- ⌘ Onboard Management
- ⌘ Vessel Capabilities and Cargo Systems

TECHNICAL REPORT/

DESIGN AND CONSTRUCTION

 Review Grading Report

Design and Construction Condition

Has the vessel been built to the standards and Rules of an IACS-member Class Society?	Yes
Under what IACS Class society supervision was the vessel built?	GL - Germanischer Lloyd
Did the vessel provide Ultrasonic Thickness Measurement (UTM) reports?	No, not available

Engine Room & Firefighting

Feature seen in the engine room Notes:	Incinerator sludge burning system
	fitted but not in use (refer to the memo listed within the supplied class status report)
Feature seen in the engine room Notes:	UMS Capabilities (regardless of Class notation)
	UMS
Feature seen in the engine room Notes:	Centralised Sea Water cooling
	LT coolers

TECHNICAL REPORT/

HULL

Review Grading Report

Hull Condition

What sections of the hull were inspected?	Stbd side
Was the vessel free of any major structural damage or indentations?	Yes
Was the vessel free of any minor structural damage or indentations?	No
Please provide further details	STBD side - FWD shell plate minor indentation. Diameter approximately 150mm, Depth approximately 20-30mm
What was the level of Hull coating breakdown and corrosion?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	corrosion was observed mainly located in the top side aft and at midship area. coating breakdown observed on the vertical side
The amount of surface area coating breakdown and corrosion was approximately:	20 %
Type of coating breakdown and corrosion:	Pitting
	Spot
What was the condition of the hull markings?	Partly obscured
Please provide further details	Hull markings were seen to be partly obscured; Touch up of hull markings should be considered at the earliest opportunity
What level of marine fouling was seen?	Minor
Were fenders installed on the hull?	Yes
What condition were the fenders in?	Good

TECHNICAL REPORT

MOORING DECKS

 Review Grading Report

Mooring Decks Condition

Were the decks free of any structural damage or deformations?	Yes
What was the level of coating breakdown and corrosion observed on the decks?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	Corrosion was observed mainly located in the deck surface and free edge area
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Localised
	Pitting
	Spot
What was the general condition of the deck fittings?	Good
Were fairleads and mooring rollers free to move when tested?	Yes
Were all mooring machinery reported to be fully operational?	Yes
What type of windlass(es) and winches were fitted?	Electric
What was the condition of the mooring machinery?	Good
What amount of band brake lining was seen to be remaining? Please provide further details	Minimal, requiring change
	Windlass band brakes had only minimal thicknesses remaining
What condition were the visible sections of the anchor chains seen to be in? Please provide further details	Fair
	STBD side anchor chain observed twisted;
What type of mooring lines did the vessel have?	Rope
What was the condition of the mooring ropes / wires?	Good
Were safe mooring practices observed? i.e. no overlapping turns on split drum, chafing of lines or unsafe leading.	Yes

Was the last brake test seen to be stencilled on the mooring winches? Please provide further details	No
	No brake indicator fitted, No details of brake test being performed
What type of snap back warning signs/zones were posted?	Signs at the entrance to the mooring decks
Was the Bosun's / Foc'sle store available for inspection?	Yes
What was the condition of the bosun's store structure?	Structurally sound with no visible damage
What was the condition of the bosun's store coatings?	Minor instances of coating breakdown and corrosion
Was the condition of the bosun's store housekeeping?	Fairly neat with some scattered equipment
Were the bitter end release arrangements seen to be clear and unobstructed? Please provide further details	No
	Bitter end release arrangements were obstructed
Was an 'emergency towing booklets/procedures' available near to the foc'sle?	Yes

TECHNICAL REPORT/

WEATHER DECKS AND FITTINGS

 Review Grading Report

Weather Decks and Fittings Condition

Were the decks free of any structural damage or deformations?	Yes
What was the level of coating breakdown and corrosion observed on the decks?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	Corrosion was observed mainly located on the main deck and cross deck areas
The amount of surface area coating breakdown and corrosion was approximately:	15 %
Type of coating breakdown and corrosion:	Pitting
	Spot
What was the general condition of the deck fittings e.g handrails, brackets, vent heads, walkways, lighting etc.?	Good
Does the vessel have mooring winches fitted on the main deck?	No
Were deck equipment and pipework free of leakages?	Yes
What was the condition of the accommodation ladders or gangways?	Good
Was the vessel fitted with a provision lifting appliance(s)?	Yes
What was the condition of the provision lifting appliance(s)?	Good
Does the vessel carry any major spares on external decks e.g. propeller blades, anchor etc.	No

TECHNICAL REPORT/

BALLAST TANKS AND SYSTEMS

Review Grading Report

Ballast Tanks and Systems Condition

Were ballast tanks entered?	Yes
Please provide further details	FPT and WBT-18P
Were recent (last 12 months) ballast tank inspection photographs provided?	Yes
Date the photographs were provided:	12-Nov-25
Were the tanks free of any structural damage or indentations?	Yes
What was the level of Ballast Tank coating breakdown and corrosion?	Moderate
Coating breakdown and corrosion was mainly located in the following areas:	mainly located in the tank frame, free edge, stiffener plate etc area.
The amount of surface area coating breakdown and corrosion was approximately:	35 %
Type of coating breakdown and corrosion:	Pitting
	Surface
What was the condition of ballast tank fittings (e.g. ladders, handrails, pipes & manhole seals)?	Fair
Please provide further details	Moderate corrosion was observed on the tank fittings
Were the ballast tanks fitted with sacrificial anodes?	No
How much mud/sediment was seen inside the ballast tanks?	Minimal
Were the tanks seen to be free from any signs of staining from oil, sewage or marine fouling?	Yes
Were ballast tank manhole covers seen to be in good condition?	No
Please provide further details	moderate corrosion was observed on the manhole cover underneath and the cover holder.

Were the remote ballast control systems fully operational (e.g. valves, gauging etc)?	Yes
Were the ballast and/or anti-heeling pumps reported to be fully operational?	Yes
What condition were the ballast and/or anti-heeling pumps in?	Good

TECHNICAL REPORT/

ACCOMMODATION

Review Grading Report

Internal Accommodation Condition

Were accommodation spaces used for their assigned purposes?	Yes
What was the condition of the flooring and wall coverings?	Good
What was the condition of the upholstery and furniture?	Good
What were the general levels of housekeeping and cleanliness?	Good
What was the level of hygiene of the sanitary facilities?	Good
Was all laundry equipment in good working order?	Yes
Was the Hospital well equipped and ready for use?	Yes
Were the drugs found to be controlled and secured with the associated drugs log kept up to date?	Yes
What was the quality of accommodation outfitting?	Average quality of outfitting
Did the Air Handling Unit (AHU) maintain a comfortable temperature?	Yes
What was the condition of the AHU?	Good

Galley Condition

What was the level of cleanliness in the Galley?	Clean
Was all galley equipment operational?	Yes
What was the general condition of galley equipment?	Good
Were the insides of Galley hoods clean?	Yes
What type of cold provisions stores does the vessel have?	Stand alone / Domestic
Were provisions stores well organised with no provisions stored directly on the deck?	Yes
Were provisions stores clean and hygienic?	Yes

Were provisions stores at the required temperatures?	Yes
Were provision stores temperatures recorded and records kept nearby?	Yes

External Areas Condition

Was the external Superstructure / Accommodation Block found to be free from damages?	Yes
Were accommodation external doors found to be in good condition and providing an adequate seal?	Yes
What was the level of external accommodation superstructure coating breakdown and corrosion?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	located on the free edge areas particularly in higher sections of the accommodation
The amount of surface area coating breakdown and corrosion was approximately:	5 %
Type of coating breakdown and corrosion:	Localised
	Pitting
	Spot
What was the general condition of external superstructure fittings (e.g. lighting, vent heads, windows/portholes, stairways, railings etc.)? Please provide further details	Fair
	Corrosion was observed on the edge of port holes, lighting support etc

Crew Welfare

What is the average contract length for crew members?	Officers:	Crew:
	6 Months	9 Months
Was Wi-Fi provided on-board?	Yes, Free, Limited	
What is the approximate average internet speed?	Average (Able to access social media apps and websites with ease)	
Is access provided to catering facilities or food at all times?	Yes	

What Public Recreation equipment did the crew have access to?	Free Weights
	Television
	Karaoke
	Musical Instruments
	Barbecue
	Public Computer
	En-suite facilities for all crew members
What was the quality of crew recreation facilities? Please provide further details	Fair
	the public recreation equipment quantity is limited
Are crew given time and resources to celebrate religious or cultural events (i.e. Christmas, Independence days etc.)?	Yes
What facilities were provided in crew cabins?	Fridge
	Sofa
	Desk
	Ample storage
Does the vessel have any onboard training facilities? Please provide further details	Yes
	KAIRO /CAPE
Type of onboard training facilities:	Other
Is there a crew suggestion policy in place?	Yes
Does the crew have access to a bonded store?	Yes, well stocked
Are the crew given additional periods of rest throughout the working week (e.g Sunday off)?	Yes

TECHNICAL REPORT/

BRIDGE AND NAVIGATION EQUIPMENT

 Review Grading Report

General Condition

Was all the bridge equipment reported to be fully operational?	Yes
Was the bridge found to be clean and well maintained with good housekeeping?	Yes
Were all required bridge equipment annual performance tests (e.g. VDR and AIS) completed in the last 12 months?	Yes
Was the vessel fitted with a Voyage Data Recorder (VDR)?	Yes
Type of VDR fitted:	VDR
Was the VDR seen to be free from any unanticipated alarms?	Yes
Were the VDR collection instructions posted and known to the Master?	Yes
Was the vessels Bridge Navigation and Watch Alarm System (BNWAS) fully operational, and turned on when at sea?	Yes
Normal time setting at sea	12 mins

Navigation Condition

What was the vessels primary & secondary means of navigation as listed on Form E?	Primary	Secondary
	Paper Charts	
Were the primary & secondary means of navigation found to be up to date?	Yes	
Latest update week	49	
Does the vessel receive up to date weather information?	Yes	
	01-Dec-25	
What type of weather updating service does the vessel use?	Weather fax	
Was an in-date compass deviation card posted near to the helm?	Yes	

Was a compass deviation log kept, up to date and free of any major deviations?	Yes
Were azimuth rings (bearing diopters) found to be available on the bridge?	No
Please provide further details	Azimuth rings (bearing diopters) were not available on the bridge

Communication Condition

What GMDSS sea areas was the vessel licensed to cover?	A1		
	A2		
	A3		
Were the radio batteries seen to be in good condition?	Yes		
Were the EPIRBs, SARTs and Emergency Hand Held VHF Batteries within their expiry dates?	Yes		
Battery expiry dates	EPIRBs	SARTs	VHF
	31-Jan-37	30-Apr-26	30-Mar-28
Was a valid GMDSS shore servicing certificate seen to be posted near to radio equipment?	Yes		

Documentation Condition

Were berth to berth passage plans seen on-board?	Yes
Were passage plans signed by all navigating officers?	Yes
What format were nautical publications provided in?	Paper and Electronic
Were the Master's standing orders and night orders found to be signed by all navigating officers?	Yes
Was the bridge log book up to date and correctly filled in?	Yes
Was the GMDSS log book up-to-date and correctly filled in?	Yes
Date of last test	01-Dec-25

External Condition

Was the Monkey Island found to be in good, well maintained condition? Please provide further details	No
	The compass deck found covered with soot deposits.
Were the main mast, aerials and antennas seen to be in good condition and free from damage?	Yes
Were bridge wing manoeuvring controls fitted?	Yes
Were the bridge wing manoeuvring controls reported to be fully operational and free from signs of water ingress?	Yes
Were bridge wing engine speed and compass repeaters seen to be in good working condition?	Yes

TECHNICAL REPORT/

ENGINE ROOM AND MACHINERY

Review Grading Report

General Condition

Were all engine room bulkheads and frames seen to be in good structural condition?	Yes
Were the engine room fittings such as stairwells/ladders, handrails, floor plates and lighting found to be in good condition?	Yes
Was the duct keel in good condition and free from any signs of ingress or internal leakages?	N/A
What equipment was seen running?	Auxiliary Engines
	Purifiers
	Pumps
	Air compressors
	Sewage treatment plant
	Auxiliary Boiler
	Refrigeration Compressor
	Air Conditioning Compressor
Was the engine room free of any significant defects, either reported by crew or observed?	Yes
What were the general levels of housekeeping and cleanliness in the Engine Room?	Good
Were bilges and tank tops free of any significant oil and/or water?	Yes
Were bilge alarms found to be fully operational during testing?	Yes
Was the vessel equipped with adequate critical spares as recommended by the ship manager Safety Management System (SMS)?	Yes
Were spares neatly stowed and correctly secured?	Yes

Were all self-closing devices (sounding pipes, tank level gauge glasses etc.) in good working order?	Yes
Were any caution (amber) or action (red) alerts seen on the lube oil analysis reports?	No
Were any alerts or abnormal findings seen on the supplied fuel oil analysis reports?	Not available
Was the NOx Technical file kept up to date?	Yes
Date of entry:	20-Nov-25
Was the engine room logbook up to date, correctly filled in and without any obvious abnormalities recorded?	Yes
Were Chief Engineer Standing Orders clearly posted and signed by all engineers?	Yes
Were all machinery special tools provided and in good condition?	Yes
Were all machinery and equipment manuals reported to be available onboard?	Yes

Main Engine Condition

Was the main engine in good working condition?	Yes
In what condition was the Main Engine?	Good
Were any defects or abnormal findings seen on the supplied scavenge space inspection reports?	Not available
Were all maximum cylinder liner wear measurements seen to be within maker limits?	Not available
Were all main engine safeties reported to be fully operational? (e.g. oil mist detectors, bearing temperature sensors, low lube oil pressure trip etc.)	Yes
Were the main engine turning gear and flywheel in good condition?	Yes
Were the supplied main engine performance reports seen to be satisfactory?	Yes

Propulsion

What type of propulsion does the vessel have?	Controllable Pitch Propeller (CPP)
Were the Propulsion systems, including shafts, gearing and electric motors, if relevant, in good working condition?	Yes
What type of thruster systems does the vessel have?	Bow Thruster
Was the thruster(s) in good working condition?	Yes
In what condition was the thruster(s)?	Good

Power Generation

How many Auxiliary Engines does the vessel have?	2
Were the Auxiliary Engines in good working condition?	Yes
In what condition were the Auxiliary Engines?	Good
Were all auxiliary engine safeties reported to be fully operational? (low lube oil pressure, overspeed, high HT temperature etc.)	Yes
Were the supplied auxiliary engine performance reports seen to be satisfactory?	Yes
Does the vessel have a shaft generator?	Yes
Shaft Generator rated power (PTO) (kW):	1032
Was the shaft generator unit fully operational and in good condition?	Yes
Does the vessel have a shaft motor (Power Take-In)?	Yes

Auxiliary Machinery

Does the vessel have an Auxiliary Boiler?	Yes
What type of boiler is fitted?	Thermal Oil
Was the boiler(s) in good working condition?	Yes
In what condition was the boiler(s)?	Good
Were boiler safety valves in satisfactory condition?	Yes

Was it reported that any boiler tubes had been plugged? (including Economiser/EGB)	No	
Was the Hot Well/Cascade Tank seen to be in good order and free from contaminants?	Yes	
Were any abnormal findings observed on the supplied boiler and cooling water analysis reports?	No	
What was the condition of the following equipment?	Fully operational?	Condition
Economiser/Exhaust Gas Boiler	Yes	Good
Purifiers	Yes	Good
Pumps	Yes	Good
Coolers and Heaters	Yes	Good
Sea Chests and Overboard Valves	Yes	Good
Air Compressors and Air Reservoirs	Yes	Good
Fresh Water Generator	Yes	Good
Filters	Yes	Good
Supply and Exhaust Fans	Yes	Good
Refrigeration and Air Conditioning Systems	Yes	Good
Automation Systems (e.g. viscometer, temperature controllers/valves, monitoring panels/screens etc.)	Yes	Good
Engine Room Crane	Yes	Good
Workshop Machinery including emergency stops	Yes	Good
UV Sterilizer	Yes	Good
Fresh Water Mineralizer/Re-hardening Filter	Yes	Good
Calorifier	Yes	Good
Was all engine room pipework free of significant corrosion?	Yes	
Was all engine room pipework free of leakages?	Yes	

Was all pipework free of temporary repairs including soft patches?	Yes
What condition was pipework insulation lagging in?	Some areas of deterioration and staining
Was all anti-splash tape seen to be in place at the required engine room pipe connections?	Yes
Was the steering gear in good working condition?	Yes
Was the steering gear free of leakages?	Yes
Was the emergency steering communication equipment and gyro repeater working as required?	Yes
Were emergency steering instructions posted nearby?	Yes
Was the Engine workshop clean and tidy?	Yes
Was all welding equipment including gas bottles, flame arrestors and associated fittings in good order and properly secured?	Yes

ECR and Electrical

Was the Engine Control Room clean and tidy?	Yes
Were all Engine Control Room automation and monitoring systems fully operational?	Yes
Was the Engine Control and Alarm system free of any serious active alarms?	Yes
Were any concerning engine room control system alarms seen to be manually blocked/disabled?	No
If the vessel has a UMS Class notation, does the machinery space operate in UMS mode?	Yes
Were the engine room deadman and engineer call alarms found fully operational during testing?	Yes
Were all package air conditioning units operational and in good condition? (e.g. ECR, bridge, galley, electrical rooms)	Yes
Were all Electrical distribution systems in good working condition?	Yes
Were Main Switchboard Insulation readings adequate?	Yes

Were any abnormal findings observed as per the latest Megger Test reports?	No
Were distribution and switchboard panels protected with approved rubber matting?	Yes
Was evidence of regular safety equipment testing available? (i.e. weekly, monthly and quarterly tests of bilge alarms, dampers, emergency machinery etc.)	Yes
Was the Emergency Generator tested during the inspection?	Yes
Was the Emergency Generator in working order?	Yes
Were Emergency Generator Starting instructions clearly posted?	Yes
What was the condition of the Emergency Generator?	Good
Was the "18 hour" fuel level marked on the emergency generator fuel tank?	Yes

TECHNICAL REPORT/

FIRE FIGHTING EQUIPMENT AND SYSTEMS

🔍 Review Grading Report

Fire and Safety Appliances Condition

Was the vessel free of fire hazards?	Yes		
Was all fire and safety equipment regularly serviced?	Yes		
Date of last service	24-Apr-25		
Were all relevant Fire and Safety instructions correctly posted?	Yes		
What was the vessels Fixed fire detection systems?	Engine Room	Cargo Holds	Accommodation
	Flame		Smoke
	Smoke		Heat
Was the fire detection system reportedly fully operational?	Yes		
Was the fire detection system free of alarms or signs of tampering?	Yes		
What is the vessels Fixed firefighting systems?	Engine Room	Cargo Holds	Accommodation
	CO2	CO2	None
	Water Spray	Water Spray	
Were all fixed fire fighting systems in good working condition?	Yes		
Were clear operating instructions posted for the fixed firefighting systems?	Yes		
Was the fixed firefighting system release protected against unauthorised operation?	Yes		
Was the main fire pump working?	Yes		
Was the emergency fire pump working?	Yes		
Was a fire pump tested during the inspection?	Yes		
Did the fire pump maintain adequate pressure?	Yes		
Were the main and emergency fire pumps in good condition and free of leakages?	Yes		

What was the condition of the fire main and ancillaries such as pipework hydrants and valves?	Good
Does the vessel have a fire control station?	No
Were all portable equipment in place as per the fire plan?	Yes
Were all fire extinguishers in good condition?	Yes
Were the firefighting outfits and associated equipment in good condition?	Yes
Were the International Shore Connections on board?	Yes
Location:	P & S side of main deck near the accommodation
Was the BA equipment fully charged in good condition?	Yes
Was the Quick Closing Valve system in good working order?	Yes
Were fire doors in good condition and effectively closing?	Yes
Were fire doors free of unauthorised "hold-open" arrangements?	Yes
Were all ventilation dampers remote closing positions well labelled and in good working order?	Yes
Were all remote machinery shutdown systems well labelled and in good working order?	Yes

TECHNICAL REPORT/

LIFESAVING APPLIANCES

 Review Grading Report

Lifesaving Appliances Condition

Were all Lifesaving Appliances regularly serviced?	Yes
Date of last service:	24-Apr-25
How many lifeboats is the vessel equipped with?	1
What type of lifeboat is the vessel fitted with?	Free-fall
What was the external condition of the lifeboat(s)?	Good
What was the internal condition of the lifeboat(s)?	Good
Were Lifeboat Engines able to be tested?	Yes
Were lifeboat engines in good working order?	Yes
What was the condition of the rescue boat?	Good
How many life rafts does the vessel have?	3
What was the condition of the life rafts?	Good
Were Liferaft Hydrostatic Release Units (HRU) in date and correctly rigged?	Yes
What was the condition of the Davits and lowering arrangements for the lifeboat(s), rescue boat and liferafts?	Good
What Date is the next Davit wire due for change?	18-Feb-28
Were legible launching/recovery instructions posted near to survival craft?	Yes
Was evidence of regular maintenance, service and inspection of the launching appliances sighted and evident?	Yes
What was the date of the last abandon ship drill?	16-Nov-25
Were all lifejackets, immersion suits, EEBDs and other lifesaving ancillary equipment in good condition and ready for use?	Yes
Were Man Overboard Buoy (MOB) smoke and light signals in date?	Yes

Were the embarkation ladders in a good, well maintained condition? Please provide further details	No
	Port and starboard side embarkation ladder cover found partly holed
Were pyrotechnics and line throwing apparatus available, stored in an appropriate container and within their expiry dates?	Yes

TECHNICAL REPORT/

SAFE WORKING ENVIRONMENT

🔗 Review Grading Report

Safe Working Environment Condition

Were any unsafe practices observed during the inspection?	No
Did the vessel provide a safe working environment?	Yes
Were all hazard markings clear?	Yes
Were external walkways adequately coated with anti-slip paint and free of trip hazards?	No
Please provide further details	Main deck the anti-slip not adequately coated
Are all hazardous substances including safely managed and stored with relevant Material Safety Data Sheets (MSDS)?	Yes
Is Personal Protective Equipment (PPE) provided and worn by crew?	Yes
Are 'Enclosed Space Entry' procedures implemented?	Yes
Is an effective Permit To Work (PTW) process implemented?	Yes
Date of last PTW:	01-Dec-25
Is an effective Risk Assessment (RA) process in place?	Yes
Was evidence of the annual and 5-yearly inspections of both fixed and portable lifting equipment and appliances sighted?	Yes
Are main and emergency exits clearly identified and unobstructed?	Yes
Are sufficient portable oxygen and gas detection meters provided and regularly calibrated?	Yes
Date of last calibration:	09-Oct-25
What is the working language of the vessel?	English
Are standing orders, procedures, instructions and manufacturers' manuals written in a language which can be understood by the crew?	Yes

Are all IMO signs correctly placed, and compliant with IMO requirements?	Yes
Is the vessel equipped with an approved SOLAS training manual?	Yes
Were the Pilot Ladders in good condition?	Yes
Was the Pilot ladder seen to be secured in a safe manner?	Yes
Are regular drills conducted on board?	Yes
Last drill date	26-Nov-25
Last drill type	launching rescue boat

TECHNICAL REPORT

POLLUTION CONTROL

 Review Grading Report

General Condition

Was Pollution Control well implemented within the on board Safety Management System (SMS)?	Yes
Is the vessel free of pollution hazards?	Yes, with no hazards
Does the vessel have a Class approved Inventory of Hazardous Materials (IHM)?	Yes
Please provide further details	The vessel holds a Class approved Inventory of Hazardous Material (IHM)

Oil - Marpol Annex I

Is an Oily Water Separator (OWS) fitted?	Yes
Was the OWS reportedly operational?	Yes
What was the condition of the OWS?	Good
Was the OWS Tested?	Yes
Means of testing	Simulated
Was the 15ppm meter calibrated?	Yes
Date of calibration	27-Feb-25
Was the Bilge Overboard valve secured against unauthorised opening with adequate signage and warnings posted?	Yes
Means of securing	Sealed
	Locked
Was the oily water treatment system including valves and pipework free of any signs of tampering, bypass, or modifications?	Yes
Was the SOPEP locker or box well stocked?	Yes
What was the condition of the SOPEP equipment?	Good

Was a list of SOPEP equipment posted and accurate? Please provide further details	No	
	SOPEP material inventory last inspection on 30 Oct 2025 which was not update monthly	
Was the Oil Record Book (ORB) up to date and correctly filled in? Date of last entry Category of last entry	Yes	
	30-Nov-25	
	C	
Were previous bunkering checklists correctly filled out? Date of last bunkering	Yes	
	23-Nov-25	
Were bunker samples correctly stored?	Yes	
Does the vessel have a Ballast Water Treatment System (BWTS) fitted?	Yes	
Ballast Water Treatment System	Manufacturer:	PANASIA
	Type:	Other
	Other type:	Filtration and UV disinfection
What regulation is listed on the Ballast Water Management Certificate?	D-2	
Type of BWTS approval (As reported / according to provided documentation):	USCG approval	
Was the BWTS operational?	Yes	
What was the condition of the BWTS?	Good	
Was the Ballast Record Book up to date and correctly filled in? Date of last entry	Yes	
	29-Nov-25	
Is the Vessel General Permit (VGP) compliant?	No	

Sewage - Marpol Annex IV

Was a Sewage Treatment Plant fitted?	Yes
Was the Sewage Treatment Plant operational?	Yes

What was the condition of the Sewage Treatment Plant?	Good
Does the vessel have a sewage holding tank?	No

Garbage - Marpol Annex V

How was the condition of Garbage segregation?	Good
Were Garbage containers of approved, non-combustible type?	No
Please provide further details	The garbage container for waste rags the cover in the engine room was not metal material
Was the Garbage Record Book (GRB) up to date and correctly filled in?	Yes
Date of last entry	29-Nov-25
Category of last entry	B

Air - Marpol Annex VI

How does the vessel comply with IMO 2020 regulations?	Use of Very Low Sulphur Fuel Oils (VLSFO), MGO, D0 etc.
Does the vessel use Ozone Depleting Substances (ODS) as Refrigerant Gas?	No
Was an Incinerator fitted?	Yes
Was the Incinerator operational?	No
	Incinerator was not in use
What was the condition of the Incinerator?	Fair
Please provide further details	Incinerator was not in use
Does the vessel have an Emission Control Area (ECA) change-over log?	Yes
Date of last entry	28-Nov-25

EEXI

Does the vessel have an attained EEXI score as per her International Energy Efficiency Certificate (IEEC)?	Yes	
What is the EEXI score?	30.877	
Does the vessel have any energy efficiency technologies installed?	No	
Is the vessel ice classed?	Yes	
Main Engine(s)	Specific Fuel Oil Consumption (SFOC) (g/kWhr):	185.3
Auxiliary Engines	Specific Fuel Oil Consumption (SFOC) (g/kWhr):	185.3
Shaft Generator rated power (PTO) (kW):	1032	
Does the vessel have a shaft motor (Power Take-In)?	Yes	
What is the expiry date of the International Air Pollution Prevention (IAPP) certificate?	07-Jan-28	
What were the vessel's CII scores (From the IMO DCS data)? (gramsCO2/ton.Nautical mile)	2024	26.99
	2023	25.964
	2022	30.90

TECHNICAL REPORT/

ONBOARD MANAGEMENT

 Review Grading Report

Onboard Management Condition

Does the vessel have a functioning Safety Management System (SMS)?	Yes
How was the SMS Implemented?	Software / Electronic System
Were the officers familiar with, and allowed easy access to, the SMS?	Yes
Was the SMS well implemented on board, with Permits to Work, Risk Assessments and Safety procedures understood and followed?	Yes
Is the SMS system regularly reviewed by the Master?	Yes
Date of last review	19-Oct-25
Does the vessel management deal with accidents, near-misses and deficiencies in an effective manner?	Yes
Are regular safety committee and management meetings carried out on board?	Yes
Does the vessel have a valid MLC certificate?	Yes
Were Hours of Rest (ILO) records correct and up to date?	Yes
Last updated	30-Nov-25
Are hours of maximum permissible work regularly exceeded?	No
Is an effective Planned Maintenance System (PMS) implemented and kept up to date?	Yes
What type of Planned Maintenance System (PMS) does the vessel have?	Non-type-approved system
Was the PMS a fully integrated type system? (i.e. has integration with the SMS, spares ordering and is accessible by shore side management)	No

Were there any critical overdue PMS work orders?	Yes
Please provide further details	ME - cylinder heads 3,6.8; Fuel pressure pump 1-5; Camshaft/Crankshaft damper, L0 cooler chemical cleaning. AE No.1 &No.2 - AIR cooler cleaning.

Port State Control (PSC) inspection history

No. of Inspections in Past three years:	3
No. of Deficiencies in Past three years:	8
No. of Detentions in Past three years:	0
Is the vessel flag targeted by Port State Authorities?	No
Is an effective system of security access control, conforming to ISPS standards, in place upon boarding the vessel?	Yes
Type of access control	Gangway control
Do the Master and Chief Engineer have an effective hand over procedures?	Yes
Are random or specific drug and alcohol testing carried out?	Yes
Tests Carried out by:	Onboard by Master
Were the Master and crew prepared for the Inspection?	Yes
What level of cooperation was provided by the crew and Master?	Good
Were documents provided as requested?	Majority of documents provided
What was the overall impression of the general management of the vessel?	Well managed

TECHNICAL REPORT/

VESSEL CAPABILITIES AND CARGO SYSTEMS - CONTAINERSHIPS

 Review Grading Report

Vessel Capabilities and Cargo Systems - Containerships Condition

Cargo hold	Capacity in hold (TEU)	Capacity on deck (TEU)	Total (TEU)
------------	---------------------------	---------------------------	----------------

Cargo Hold No.1	65	80	145
Cargo Hold No.2	94	151	245
Cargo Hold No.3	86	160	246
Cargo Hold No.4		88	88
Cargo Hold No.5			0
Cargo Hold No.6			0
Cargo Hold No.7			0
Cargo Hold No.8			0
Cargo Hold No.9			0
Additional Deck Stowage			0
Total	245	479	724
How many cargo holds does the vessel have?	3		
Were the cargo holds able to be entered and inspected? Please provide further details	Yes		
	No.3 cargo hold		
Were recent vessel cargo hold inspection photographs provided? Date photographs were taken:	Yes		
	08-Oct-25		
Were recent inspection reports provided?	No		
Were cargo holds structural members found to be free from damage (e.g. side plating, tank top and framing)?	Yes		
Were the cargo hold fittings such as ladders, hand rails, and ventilation ducting found to be free from damage and deterioration?	Yes		
Were the cell guides free from any significant damage or significant deformation?	Yes		

What was the level of coating breakdown and corrosion observed in the Cargo Holds?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	mainly located on the tank top and side plate welding seam area
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Localised
	Pitting
	Spot
Were all cargo monitoring systems (e.g. bilge alarms, smoke detection systems etc.) fully operational and regularly tested?	Yes
Were cargo hold bilges clear of debris and oil contamination?	Yes
Were the cargo holds free from signs of significant water ingress?	Yes
Were the cargo holds free from signs of previous and/or current internal leaks? (e.g. from manholes, adjacent tanks, pipework and fittings etc.)	Yes
What is the method of cargo hold ventilation?	Mechanical
Were cargo hold ventilation systems in good working order?	Yes
Were the cross-deck areas seen to be free from waving of the deck plates or any signs of torsional deformation?	Yes
Is the fixed firefighting system in cargo spaces in apparent good condition?	Yes

Hatch Covers

What type of hatch covers are fitted?	Hydraulic folding type
What was the make and model of the Hatch covers?	MACGREGOR
Maximum weight of the heaviest pontoon (tons):	29
Were the hatch covers found to be correctly aligned?	Yes
Were the hatch cover found to be free from structural damage?	Yes

What was the level of coating breakdown and corrosion observed on the hatch covers?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	Corrosion was observed mainly located in the top surface round socket seat area
The amount of surface area coating breakdown and corrosion was approximately:	15 %
Type of coating breakdown and corrosion:	Localised
	Pitting
	Spot
What was the condition of the hatch cover rubber seals/gaskets and retaining channels?	Good
What was the condition of hatch cover securing arrangements?	Good
What was the condition of the hatch cover landing pads?	Good

Hatch Coamings

Were the hatch coamings found to be free from structural damage?	Yes
What was the level of coating breakdown and corrosion observed on the hatch coamings?	Minor
Coating breakdown and corrosion was mainly located in the following areas:	Corrosion was observed mainly located in the top surface and free edge area
The amount of surface area coating breakdown and corrosion was approximately:	10 %
Type of coating breakdown and corrosion:	Localised
	Pitting
	Spot
Were the compression bars/strips seen to be in good condition?	Yes
Were the hatch coaming drain channels seen to be free from corrosion, scaling or debris?	Yes

Were hatch coaming non-return valves found to be clear and fully operational?	Yes
---	-----

Cargo Securing

What was the condition of fixed cargo securing fittings, such as container sockets, pad-eyes, D-rings and fixed stacking cones, etc.? Please provide further details	Fair Corrosion was observed mainly located in the container sockets
Was there an up to date Cargo Securing Equipment inventory?	Yes
Were there any shortfalls of cargo securing devices?	No
Were cargo securing device inspection records correctly maintained?	Yes
What was the condition of Cargo Securing Equipment?	Good
Was there an approved Cargo Loading Manual on board?	Yes
Was there an approved stability booklet on board?	Yes
Did the vessel use a Class-approved computer based loading/stability software? Please provide further details	Yes Loadstar
Were previous and current stability calculations seen to be carried out?	Yes
Does the vessel have a Document of Compliance (DOC) for the carriage of dangerous goods?	Yes
Are procedures for safe lashing and securing of containers being incorporated in the ship's SMS?	Yes
Are appropriate securing points being used for cargo securing?	Yes

Reefer Containers

Is the vessel equipped to carry Reefer containers?	Yes			
Reefer Capacity	On deck	In Holds	Water cooled Reefers	Total
	110	46		156

What condition were reefer electrical sockets in?	Good
Was the reefer switchboard free of any low insulation or earth faults?	Yes
Was the vessel's own electrical supply sufficient for all reefer containers, without the use of an additional Power Unit (package generator) ?	Yes
Is there an effective system for monitoring reefer container temperatures? Please provide further details	Yes
	Manual monitoring by crew