

Intest32.exe and Optotest32.exe

ASIC related errors listing

The reproduction, transmission or use of this document or its content is not permitted without express written authority. Offenders will be liable for damages. All rights, including rights created by patent grant or registration of utility model or design, are reserved.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 1 de 30	

1 Introduction

1.1 Objective

The purpose of this document is to describe all possible error codes related to ASIC sensor.


1.2 Underlying documentation

Title	Number	Revision	Date
Note On Calibration Errors	Note On Calibration Errors.pdf	1.0	24.07.2012

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 2 de 30	

2 Programmer module errors

These errors are visible in pop-up error message with a generic message for programmer module error.

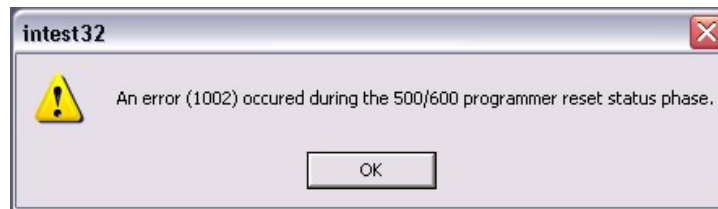

These errors correspond to an error detected by the programmer module. Below, you can find a description of all error codes when it's needed. If it's possible a Hints is also specified to try to solve the problem.

Errors names	Error codes
NO_ERRORS	0
ERR_SERIAL_PORT_OPEN	1000
ERR_BUFFER_ALLOC	1001
ERR_RESET_STATUS_SEND	1002
ERR_SWAP_PC_PROG_SEND	1003
ERR_STATUS_STATE_AFTER_STATUS_RESET	1004
ERR_MES_PHASE_SEND	1005
ERR_TNRST_ORDER_SEND	1006
ERR_LOCK_SENSOR	1007
ERR_UNLOCK_SENSOR	1008
ERR_PC_RS232_RECEIVE_TIMEOUT	1009
ERR_PC_RS232_TOO_MUCH_BYTES_RECEIVED	1010
ERR_PC_RS232_RECEIVE_INSTRUCTION_BUFFER_EXTRACT	1011
ERR_PC_RS232_RECEIVE_STATUS_BIT_FIELD_EXTRACT	1012
ERR_UNKNOWN_COMMAND	1013
ERR_IC_TIMEOUT	1014
ERR_DATA_TIMEOUT	1015
ERR_INSTR_TIMEOUT	1016
ERR_OPERATION_CODE	1017
ERR_SENSOR_ON	1018
ERR_SENSOR_OFF	1019
ERR_PROG_OFF	1020
ERR_SHORT_CIRCUIT_DETECTED	1021
ERR_LOW_BAT	1022
ERR_RMSB_NOT_OPENED	1023
ERR_CHECKSUM	1024
ERR_EVENT_FLAG	1025

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 3 de 30	

2.1 NO_ERRORS (0)

2.1.1 Description

No error with programmer module.

2.2 ERR_SERIAL_PORT_OPEN (1000)

2.2.1 Description

Error during serial COM port opening.

2.2.2 Hints

Check serial COM port configuration

2.3 ERR_BUFFER_ALLOC (1001)

2.3.1 Description

Error during buffer memory allocation

2.3.2 Hints

Check buffer mapping in configuration file

2.4 ERR_RESET_STATUS_SEND (1002)

2.4.1 Description

Error during "RESET STATUS" command sending.

2.4.2 Hints

The "RESET STATUS" command is the first command send at the program startup. If this error occurs during startup, check the programmer module connection and serial cable connection.

2.5 ERR_SWAP_PC_PROG_SEND (1003)

2.5.1 Description

Error during "SWAP PC PROG" command sending.

2.5.2 Hints

The "SWAP PC PROG" command is the communication between programmer and computer. Check the programmer module connection and serial cable connection.

2.6 ERR_STATUS_STATE_AFTER_STATUS_RESET (1004)

2.6.1 Description

Error after "RESET STATUS" command.

2.7 ERR_MES_PHASE_SEND (1005)

2.7.1 Description

Error during "MES PHASE" command sending.

2.7.2 Hints

The "MES_PHASE" command is used to synchronize ASIC baudrate and programmer baudrate or to check if the sensor is ready to communicate (unlocked). Check if the sensor works correctly by a manual test.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 4 de 30	

2.8 ERR_TNRST_ORDER_SEND (1006)

2.8.1 Description

Error during "TNRST ORDER" command sending.

2.9 ERR_LOCK_SENSOR (1007)

2.9.1 Description

Error when we try to lock (ready to use not for communication) the sensor.

2.10 ERR_UNLOCK_SENSOR (1008)

2.10.1 Description

Error when we try to unlock the sensor.

2.10.2 Hints

The "unlock" phase is done to prepare the sensor for the communication. Check if the sensor works correctly by a manual test.

2.11 ERR_PC_RS232_RECEIVE_TIMEOUT (1009)

2.11.1 Description

Timeout during a communication between computer and programmer.

2.11.2 Hints

The computer doesn't receive the data from the programmer. Check the programmer module connection and serial cable connection.

2.12 ERR_PC_RS232_TOO_MUCH_BYTES_RECEIVED (1010)

2.12.1 Description

Too much bytes received for a communication

2.13 ERR_PC_RS232_RECEIVE_INSTRUCTION_BUFFER_EXTRACT (1011)

2.13.1 Description

Error during instruction buffer extract.

2.13.2 Hints

The received buffer is composed of several blocks. The instruction buffer is the first block. Check the buffer mapping in configuration file.

2.14 ERR_PC_RS232_RECEIVE_STATUS_BIT_FIELD_EXTRACT (1012)

2.14.1 Description

Error during instruction buffer extract.

2.14.2 Hints

The received buffer is composed of several blocks. The status buffer is the second block. Check the buffer mapping in configuration file.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 5 de 30	

2.15 ERR_UNKNOWN_COMMAND (1013)

2.15.1 Description

The programmer module doesn't recognize the command sent.

2.15.2 Hints

Reset programmer module.

2.16 ERR_IC_TIMEOUT (1014)

2.16.1 Description

Timeout during a communication between programmer and sensor.

2.16.2 Hints

Check if the sensor works correctly by a manual test.

2.17 ERR_DATA_TIMEOUT (1015)

2.17.1 Description

Error during last data register transmission between computer and programmer

2.18 ERR_INSTR_TIMEOUT (1016)

2.18.1 Description

Error during last instruction register transmission between computer and programmer

2.19 ERR_OPERATION_CODE (1017)

2.19.1 Description

Error during last operation code transmission between computer and programmer

2.20 ERR_SENSOR_ON (1018)

2.20.1 Description

Error during "SENSOR ON" command sending.

2.21 ERR_SENSOR_OFF (1019)

2.21.1 Description

Error during "SENSOR OFF" command sending.

2.22 ERR_PROG_OFF (1020)

2.22.1 Description

Error during "PROG OFF" command sending.

2.23 ERR_SHORT_CIRCUIT_DETECTED (1021)

2.23.1 Description

An overload has occurred on V+ terminal. Output voltage has been disabled. Send a "RESET STATUS" command in order to reset the short detected flag and enable the output voltage. (Imax continuous assured = 50mA).

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 6 de 30	

2.23.2 Hints

Check if the sensor works correctly by a manual test. There is probably a short between wires or between wire and housing.

2.24 ERR_LOW_BAT (1022)

2.24.1 Description

Internal programmer module supply voltage < 4.7 V

2.24.2 Hints

Only possible with standalone programmer module.

2.25 ERR_RMSB_NOT_OPENED (1023)

2.25.1 Description

The power supply relay is defective on programmer module.

2.25.2 Hints

Change K3 relay on programmer module.

2.26 ERR_CHECKSUM (1024)

2.26.1 Description

On IOLink frame (CTX610, CTX710, CTX1000), there is several bits used as checksum. This error occurs when the checksum is not correct.

2.27 ERR_EVENT_FLAG (1025)

On IOLink frame (CTX610, CTX710, CTX1000), there is a bit used as event information. It's necessary to read memory to know the exact event (not used for the moment).

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 7 de 30	

3 IC 600 CTX600

This ASIC type is no longer used. Only custom compliant is possible. Ask to Group.Tester@contrinex.com to have more details.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 8 de 30	

4 IC 500 CTX503

Check the document "Note On Calibration Errors".

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 9 de 30	

5 IC 600 CTX610

These errors are visible as a measure result. The measure used is "eeprom_integrity". Below, you can find a description of all error codes. If it's possible a Hints is also specified to try to solve the problem.

Errors names	Error codes
ERR_CALIB_610IC_NO_ERROR	0
ERR_CALIB_610IC_SMD_UNLOCK_TEST	-4001
ERR_CALIB_610IC_FINAL_FUNCTIONAL_TEST	-4002
ERR_CALIB_610IC_LOCK_SENSOR	-4003
ERR_CALIB_610IC_SAVE_EEPROM_CONTENT	-4004
ERR_CALIB_610IC_CHECK_EEPROM_MEMORY_CONTENT	-4005
ERR_CALIB_610IC_DISABLE_FORCED_EEPROM_WRITE	-4006
ERR_CALIB_610IC_SAVE_SENSOR_ID	-4007
ERR_CALIB_610IC_WRITE_EEPROM_ONLY	-4008
ERR_CALIB_610IC_COPY_RAM_TO_EEPROM	-4009
ERR_CALIB_610IC_ENABLE_FORCED_EEPROM_WRITE	-4010
ERR_CALIB_610IC_ADJUST_HSYT80	-4011
ERR_CALIB_610IC_ADJUST_HSYT100	-4012
ERR_CALIB_610IC_ADJUST_SEUIL80	-4013
ERR_CALIB_610IC_ADJUST_SEUIL100	-4014
ERR_CALIB_610IC_PRECONFIG	-4015
ERR_CALIB_610IC_THERMAL_CHARACTERIZATION	-4016
ERR_CALIB_610IC_GET_TEMP	-4017
ERR_CALIB_610IC_HANDLE_TRIM_DATA	-4018
ERR_CALIB_610IC_HANDLE_PRESET_DATA	-4019
ERR_CALIB_610IC_PREPARE_FOR_CALIBRATION	-4020
ERR_CALIB_610IC_WRONG_MODE_FOR_ELECTRICAL_TEST	-4021

5.1 ERR_CALIB_610IC_SMD_UNLOCK_TEST (-4001)

5.1.1 Description

Error during smd unlock test

5.1.2 Hints

Only on SMT tester.

5.2 ERR_CALIB_610IC_FINAL_FUNCTIONAL_TEST (-4002)

5.2.1 Description

Error during final communication test

5.2.2 Hints

Only on JIT tester (JIT tester is no longer used).

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 10 de 30	

5.3 ERR_CALIB_610IC_LOCK_SENSOR (-4003)

5.3.1 Description

Error during lock test

5.4 ERR_CALIB_610IC_SAVE_EEPROM_CONTENT (-4004)

5.4.1 Description

Error during store test report measures

5.4.2 Hints

Check database connection if exists.

5.5 ERR_CALIB_610IC_CHECK_EEPROM_MEMORY_CONTENT (-4005)

5.5.1 Description

Error during EEPROM memory content control

5.6 ERR_CALIB_610IC_DISABLE_FORCED_EEPROM_WRITE (-4006)

5.6.1 Description

Error during deactivation of the forced EEPROM write.

5.7 ERR_CALIB_610IC_SAVE_SENSOR_ID (-4007)

5.7.1 Description

Error during product traceability

5.7.2 Hints

Check database connection or path for traceability files.

5.8 ERR_CALIB_610IC_WRITE_EEPROM_ONLY (-4008)

5.8.1 Description

Error during write EEPROM only fields

5.9 ERR_CALIB_610IC_COPY_RAM_TO_EEPROM (-4009)

5.9.1 Description

Error during copying RAM field to EEPROM field

5.10 ERR_CALIB_610IC_ENABLE_FORCED_EEPROM_WRITE (-4010)

5.10.1 Description

Error during deactivation of the forced EEPROM write.

5.11 ERR_CALIB_610IC_ADJUST_HSYT80 (-4011)

5.11.1 Description

Error during reserve hysteresis (suhys_in field) adjustment

5.11.2 Hints

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 11 de 30	

5.12 ERR_CALIB_610IC_ADJUST_HSYT100 (-4012)**5.12.1 Description**

Error during hysteresis (hys_in field) adjustment

5.12.2 Hints**5.13 ERR_CALIB_610IC_ADJUST_SEUIL80 (-4013)****5.13.1 Description**

Error during reserve threshold (su_in field) adjustment

5.13.2 Hints**5.14 ERR_CALIB_610IC_ADJUST_SEUIL100 (-4014)****5.14.1 Description**

Error during threshold (sn_in field) adjustment

5.14.2 Hints**5.15 ERR_CALIB_610IC_PRECONFIG (-4015)****5.15.1 Description**

Error during ASIC initialization.

5.16 ERR_CALIB_610IC_THERMAL_CHARACTERIZATION (-4016)**5.16.1 Description**

Error during thermal characterization

5.16.2 Hints

Only on thermal tester.

5.17 ERR_CALIB_610IC_GET_TEMP (-4017)**5.17.1 Description**

Error during thermal characterization

5.17.2 Hints

Only on thermal tester.

5.18 ERR_CALIB_610IC_HANDLE_TRIM_DATA (-4018)**5.18.1 Description**

Error during trimming data handling

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 12 de 30	

5.19 ERR_CALIB_610IC_HANDLE_PRESET_DATA (-4019)

5.19.1 Description

Error during preset data handling.

5.19.2 Hints

Check if preset data checksum control is activated or not (option).

5.20 ERR_CALIB_610IC_PREPARE_FOR_CALIBRATION (-4020)

5.20.1 Description

Error during preparation for calibration. In general case, this is not possible to unlock the sensor.

5.20.2 Hints

5.21 ERR_CALIB_610IC_WRONG_MODE_FOR_ELECTRICAL_TEST (-4021)

5.21.1 Description

Wrong mode for electrical test.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 13 de 30	

6 IC 700 CTX710

These errors are visible as a measure result. The measure used is "eeprom_integrity". Below, you can find a description of all error codes. If it's possible a Hints is also specified to try to solve the problem.

Errors names	Error codes
ERR_CALIB_710IC_NO_ERROR	0
ERR_CALIB_710IC_LOCK_SENSOR	-3001
ERR_CALIB_710IC_SAVE_EEPROM_CONTENT	-3002
ERR_CALIB_710IC_CHECK_EEPROM_MEMORY_CONTENT	-3003
ERR_CALIB_710IC_SAVE_SENSOR_ID	-3004
ERR_CALIB_710IC_WRITE_EEPROM_ONLY	-3005
ERR_CALIB_710IC_COPY_RAM_TO_EEPROM	-3006
ERR_CALIB_710IC_ADJUST_HSYT	-3007
ERR_CALIB_710IC_ADJUST_SEUIL80	-3008
ERR_CALIB_710IC_ADJUST_SEUIL100	-3009
ERR_CALIB_710IC_CONFIGURE_BITE_MODE	-3010
ERR_CALIB_710IC_PRECONFIG	-3011
ERR_CALIB_710IC_HANDLE_PRESET_DATA	-3012
ERR_CALIB_710IC_PREPARE_FOR_CALIBRATION	-3013

6.1 ERR_CALIB_710IC_LOCK_SENSOR (-3001)

6.1.1 Description

Error during lock test

6.2 ERR_CALIB_710IC_SAVE_EEPROM_CONTENT (-3002)

6.2.1 Description

Error during store test report measures

6.2.2 Hints

Check database connection if exists.

6.3 ERR_CALIB_710IC_CHECK_EEPROM_MEMORY_CONTENT (-3003)

6.3.1 Description

Error during EEPROM memory content control

6.3.2 Hints

Can happen when coil wire or counter-coil wire is broken

6.4 ERR_CALIB_710IC_SAVE_SENSOR_ID (-3004)

6.4.1 Description

Error during product traceability

6.4.2 Hints

Check database connection or path for traceability files.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 14 de 30	

6.5 ERR_CALIB_710IC_WRITE_EEPROM_ONLY (-3005)

6.5.1 Description

Error during write EEPROM only fields

6.6 ERR_CALIB_710IC_COPY_RAM_TO_EEPROM (-3006)

6.6.1 Description

Error during copying RAM field to EEPROM field

6.7 ERR_CALIB_710IC_ADJUST_HSYT (-3007)

6.7.1 Description

Error during hysteresis (hyst field) adjustment

6.8 ERR_CALIB_710IC_ADJUST_SEUIL80 (-3008)

6.8.1 Description

Error during reserve threshold (seuil80 field) adjustment

6.9 ERR_CALIB_710IC_ADJUST_SEUIL100 (-3009)

6.9.1 Description

Error during threshold (seuil100 field) adjustment

6.9.2 Hints

Can happen when coil/counter-coil polarity is not right causing a saturated Voutana. So the sensor cannot be adjusted.

6.10 ERR_CALIB_710IC_CONFIGURE_BITE_MODE (-3010)

6.10.1 Description

Error during configuration in BITE mode

6.10.2 Hints

Only on SMT tester. BITE mode is used for detection simulation.

6.11 ERR_CALIB_710IC_PRECONFIG (-3011)

6.11.1 Description

Error during ASIC initialization.

6.12 ERR_CALIB_710IC_HANDLE_PRESET_DATA (-3012)

6.12.1 Description

Error during preset data handling.

6.13 ERR_CALIB_710IC_PREPARE_FOR_CALIBRATION (-3013)

6.13.1 Description

Error during preparation for calibration. In general case, this is not possible to unlock the sensor.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 15 de 30	

6.13.2 Hints

Happen when IC cannot start correctly (short-circuit on internal sensor DC voltage (5V, 7.5V) or when there is a problem with the output transistor or a bad connection with the power supply).

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 16 de 30	

7 IC CTX1000

These errors are visible as a measure result. The measure used is "eeprom_integrity". Below, you can find a description of all error codes. If it's possible a Hints is also specified to try to solve the problem.

Errors names	Error codes
ERR_CALIB_1000IC_NO_ERROR	0
ERR_CALIB_1000IC_LOCK_SENSOR	-5001
ERR_CALIB_1000IC_SAVE_EEPROM_CONTENT	-5002
ERR_CALIB_1000IC_CHECK_EEPROM_MEMORY_CONTENT	-5003
ERR_CALIB_1000IC_SET_SEED_VALUE	-5004
ERR_CALIB_1000IC_SAVE_SENSOR_ID	-5005
ERR_CALIB_1000IC_WRITE_EEPROM_ONLY	-5006
ERR_CALIB_1000IC_COPY_RAM_TO_EEPROM	-5007
ERR_CALIB_1000IC_ENABLE_REGULATION	-5008
ERR_CALIB_1000IC_THERMAL_CHARACTERIZATION	-5009
ERR_CALIB_1000IC_ADJUST_HSYT	-5010
ERR_CALIB_1000IC_ADJUST_SEUIL100	-5011
ERR_CALIB_1000IC_SET_TUNING_TO_MAX	-5012
ERR_CALIB_1000IC_PRECONFIG	-5013
ERR_CALIB_1000IC_DISABLE_REGULATION	-5014
ERR_CALIB_1000IC_HANDLE_TRIM_DATA	-5015
ERR_CALIB_1000IC_HANDLE_PRESET_DATA	-5016
ERR_CALIB_1000IC_PREPARE_FOR_CALIBRATION	-5017
ERR_CALIB_1000IC_LOCK_SENSOR_DURING_FORCE_PRECONFIG	-5018
ERR_CALIB_1000IC_SAVE_EEPROM_CONTENT_DURING_FORCE_PRECONFIG	-5019
ERR_CALIB_1000IC_CHECK_EEPROM_MEMORY_CONTENT_DURING_FORCE_PRECONFIG	-5020
ERR_CALIB_1000IC_SET_SEED_VALUE_DURING_FORCE_PRECONFIG	-5021
ERR_CALIB_1000IC_SAVE_SENSOR_ID_DURING_FORCE_PRECONFIG	-5022
ERR_CALIB_1000IC_WRITE_EEPROM_ONLY_DURING_FORCE_PRECONFIG	-5023
ERR_CALIB_1000IC_COPY_RAM_TO_EEPROM_DURING_FORCE_PRECONFIG	-5024
ERR_CALIB_1000IC_ENABLE_REGULATION_DURING_FORCE_PRECONFIG	-5025
ERR_CALIB_1000IC_PRECONFIG_DURING_FORCE_PRECONFIG	-5026
ERR_CALIB_1000IC_DISABLE_REGULATION_DURING_FORCE_PRECONFIG	-5027
ERR_CALIB_1000IC_HANDLE_TRIM_DATA_DURING_FORCE_PRECONFIG	-5028
ERR_CALIB_1000IC_HANDLE_PRESET_DATA_DURING_FORCE_PRECONFIG	-5029
ERR_CALIB_1000IC_PREPARE_FOR_CALIBRATION_DURING_FORCE_PRECONFIG	-5030

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 17 de 30	

7.1 ERR_CALIB_1000IC_LOCK_SENSOR (-5001)

7.1.1 Description

Error during lock test

7.2 ERR_CALIB_1000IC_SAVE_EEPROM_CONTENT (-5002)

7.2.1 Description

Error during store test report measures

7.2.2 Hints

Check database connection if exists.

7.3 ERR_CALIB_1000IC_CHECK_EEPROM_MEMORY_CONTENT (-5003)

7.3.1 Description

Error during EEPROM memory content control

7.4 ERR_CALIB_1000IC_SET_SEED_VALUE (-5004)

7.4.1 Description

Error during setting the seed value

7.4.2 Hints

7.5 ERR_CALIB_1000IC_SAVE_SENSOR_ID (-5005)

7.5.1 Description

Error during product traceability

7.5.2 Hints

Check database connection or path for traceability files.

7.6 ERR_CALIB_1000IC_WRITE_EEPROM_ONLY (-5006)

7.6.1 Description

Error during write EEPROM only fields

7.7 ERR_CALIB_1000IC_COPY_RAM_TO_EEPROM (-5007)

7.7.1 Description

Error during copying RAM field to EEPROM field

7.8 ERR_CALIB_1000IC_ENABLE_REGULATION (-5008)

7.8.1 Description

Error during LED regulation activation

7.8.2 Hints

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 18 de 30	

7.9 ERR_CALIB_1000IC_THERMAL_CHARACTERIZATION (-5009)

7.9.1 Description

Error during thermal compensation

7.9.2 Hints

7.10 ERR_CALIB_1000IC_ADJUST_HSYT (-5010)

7.10.1 Description

Error during hysteresis adjustment

7.10.2 Hints

Only on LH type. Not use for the moment.

7.11 ERR_CALIB_1000IC_ADJUST_SEUIL100 (-5011)

7.11.1 Description

Error during threshold (seuil100 field) adjustment

7.11.2 Hints

7.12 ERR_CALIB_1000IC_SET_TUNING_TO_MAX (-5012)

7.12.1 Description

Error during setting the tuning to maximum (potentiometer or teach)

7.12.2 Hints

7.13 ERR_CALIB_1000IC_PRECONFIG (-5013)

7.13.1 Description

Error during ASIC initialization.

7.13.2 Hints

7.14 ERR_CALIB_1000IC_DISABLE_REGULATION (-5014)

7.14.1 Description

Error during LED regulation deactivation

7.14.2 Hints

7.15 ERR_CALIB_1000IC_HANDLE_TRIM_DATA (-5015)

7.15.1 Description

Error during trimming data handling

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 19 de 30	

7.16 ERR_CALIB_1000IC_HANDLE_PRESET_DATA (-5016)

7.16.1 Description

Error during preset data handling.

7.16.2 Hints

Check if preset data checksum control is activated or not (option).

7.17 ERR_CALIB_1000IC_PREPARE_FOR_CALIBRATION (-5017)

7.17.1 Description

Error during preparation for calibration. In general case, this is not possible to unlock the sensor.

7.17.2 Hints

7.18 ERR_CALIB_1000IC_LOCK_SENSOR_DURING_FORCE_PRECONFIG(-5018)

7.18.1 Description

Error during lock test during force preconfiguration

7.19 ERR_CALIB_1000IC_SAVE_EEPROM_CONTENT_DURING_FORCE_PRECONFIG (-5019)

7.19.1 Description

Error during store test report measures during force preconfiguration

7.19.2 Hints

Check database connection if exists.

7.20 ERR_CALIB_1000IC_CHECK_EEPROM_MEMORY_CONTENT_DURING_FORCE_PRECONFIG (-5020)

7.20.1 Description

Error during EEPROM memory content control during force preconfiguration

7.21 ERR_CALIB_1000IC_SET_SEED_VALUE_DURING_FORCE_PRECONFIG (-5021)

7.21.1 Description

Error during setting the seed value during force preconfiguration

7.21.2 Hints

7.22 ERR_CALIB_1000IC_SAVE_SENSOR_ID_DURING_FORCE_PRECONFIG (-5022)

7.22.1 Description

Error during product traceability during force preconfiguration

7.22.2 Hints

Check database connection or path for traceability files.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 20 de 30	

7.23 ERR_CALIB_1000IC_WRITE_EEPROM_ONLY_DURING_FORCE_PRECONFIG (-5023)

7.23.1 Description

Error during write EEPROM only fields during force preconfiguration

7.24 ERR_CALIB_1000IC_COPY_RAM_TO_EEPROM_DURING_FORCE_PRECONFIG (-5024)

7.24.1 Description

Error during copying RAM field to EEPROM field during force preconfiguration

7.25 ERR_CALIB_1000IC_ENABLE_REGULATION_DURING_FORCE_PRECONFIG (-5025)

7.25.1 Description

Error during LED regulation activation during force preconfiguration

7.25.2 Hints

7.26 ERR_CALIB_1000IC_PRECONFIG_DURING_FORCE_PRECONFIG (-5026)

7.26.1 Description

Error during ASIC initialization during force preconfiguration

7.26.2 Hints

7.27 ERR_CALIB_1000IC_DISABLE_REGULATION_DURING_FORCE_PRECONFIG (-5027)

7.27.1 Description

Error during LED regulation deactivation during force preconfiguration

7.27.2 Hints

7.28 ERR_CALIB_1000IC_HANDLE_TRIM_DATA_DURING_FORCE_PRECONFIG (-5028)

7.28.1 Description

Error during trimming data handling during force preconfiguration

7.29 ERR_CALIB_1000IC_HANDLE_PRESET_DATA_DURING_FORCE_PRECONFIG (-5029)

7.29.1 Description

Error during preset data handling during force preconfiguration

7.29.2 Hints

Check if preset data checksum control is activated or not (option).

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 21 de 30	

7.30 ERR_CALIB_1000IC_PREPARE_FOR_CALIBRATION_DURING_FORCE_PRECONFIG (-5030)

7.30.1 Description

Error during preparation for calibration during force preconfiguration. In general case, this is not possible to unlock the sensor.

7.30.2 Hints

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 22 de 30	

8 IC500 CTX510

These errors are visible as a measure result. The measure used is "eeprom_integrity". Below, you can find a description of all error codes. If it's possible a Hints is also specified to try to solve the problem.

Errors names	Error codes
ERR_CALIB_510IC_NO_ERROR	0
ERR_CALIB_510IC_LOCK_SENSOR	-7001
ERR_CALIB_510IC_SAVE_EEPROM_CONTENT	-7002
ERR_CALIB_510IC_CHECK_EEPROM_MEMORY_CONTENT	-7003
ERR_CALIB_510IC_SAVE_SENSOR_ID	-7004
ERR_CALIB_510IC_WRITE_EEPROM_ONLY	-7005
ERR_CALIB_510IC_COPY_RAM_TO_EEPROM	-7006
ERR_CALIB_510IC_CALIBR_SPV3_HYS	-7007
ERR_CALIB_510IC_CALIBR_SPV3	-7008
ERR_CALIB_510IC_CALIBR_SPV2_HYS	-7009
ERR_CALIB_510IC_CALIBR_SPV2	-7010
ERR_CALIB_510IC_CALIBR_SPV1_HYS	-7011
ERR_CALIB_510IC_CALIBR_SPV1	-7012
ERR_CALIB_510IC_TEMP_COMP	-7013
ERR_CALIB_510IC_VASS_READING	-7014
ERR_CALIB_510IC_VRCU_READING	-7015
ERR_CALIB_510IC_TEMPERATURE_MEASUREMENT	-7016
ERR_CALIB_510IC_THERMAL_CHARACTERIZATION	-7017
ERR_CALIB_510IC_PRECONFIG	-7018
ERR_CALIB_510IC_TRIM_5V4	-7019
ERR_CALIB_510IC_HANDLE_TRIM_DATA	-7020
ERR_CALIB_510IC_HANDLE_PRESET_DATA	-7021
ERR_CALIB_510IC_PREPARE_FOR_CALIBRATION	-7022
ERR_CALIB_510IC_VRCUOFF_READING	-7023
ERR_CALIB_510IC_VRCUON_READING	-7024
ERR_CALIB_510IC_CALIBR_UDIST_1	-7025
ERR_CALIB_510IC_CALIBR_UDIST_5	-7026

8.1 ERR_CALIB_510IC_LOCK_SENSOR (-7001)

8.1.1 Description

Error during lock test

8.2 ERR_CALIB_510IC_SAVE_EEPROM_CONTENT (-7002)

8.2.1 Description

Error during store test report measures

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 23 de 30	

8.2.2 Hints

Check database connection if exists

8.3 ERR_CALIB_510IC_CHECK_EEPROM_MEMORY_CONTENT (-7003)

8.3.1 Description

Error during EEPROM memory content control

8.3.2 Hints

Can happen when coil wire is broken

8.4 ERR_CALIB_510IC_SAVE_SENSOR_ID (-7004)

8.4.1 Description

Error during product traceability

8.4.2 Hints

Check database connection or path for traceability files.

8.5 ERR_CALIB_510IC_WRITE_EEPROM_ONLY (-7005)

8.5.1 Description

Error during write EEPROM only fields

8.6 ERR_CALIB_510IC_COPY_RAM_TO_EEPROM (-7006)

8.6.1 Description

Error during copying RAM field to EEPROM field

8.7 ERR_CALIB_510IC_CALIBR_SPV3_HYS (-7007)

8.7.1 Description

Error during hysteresis 3 (hyst field) adjustment

8.8 ERR_CALIB_510IC_CALIBR_SPV3 (-7008)

8.8.1 Description

Error during SPV 3 adjustment

8.9 ERR_CALIB_510IC_CALIBR_SPV2_HYS (-7009)

8.9.1 Description

Error during hysteresis 2 (hyst field) adjustment

8.10 ERR_CALIB_510IC_CALIBR_SPV2 (-7010)

8.10.1 Description

Error during SPV 2 adjustment

8.11 ERR_CALIB_510IC_CALIBR_SPV1_HYS (-7011)

8.11.1 Description

Error during hysteresis 1 (hyst field) adjustment

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 24 de 30	

8.12 ERR_CALIB_510IC_CALIBR_SPV1 (-7012)**8.12.1 Description**

Error during SPV 1 adjustment

8.13 ERR_CALIB_510IC_TEMP_COMP (-7013)**8.13.1 Description**

Error during LUT value writing in RAM

8.13.2 Hints

Check in prm file if LUT values isn't bigger than 2^n (n = bit nbr of lut asic field)

8.14 ERR_CALIB_510IC_VASS_READING (-7014)**8.14.1 Description**

Error during reading VASS value by the BMUX

8.15 ERR_CALIB_510IC_VRCU_READING (-7015)**8.15.1 Description**

Error during reading VRCU value by the BMUX

8.16 ERR_CALIB_510IC_TEMPERATURE_MEASUREMENT (-7016)**8.16.1 Description**

Error during reading VPTAT value by the BMUX

8.17 ERR_CALIB_510IC_THERMAL_CHARACTERIZATION (-7017)**8.17.1 Description**

Error during writing neutral LUT value in RAM

In validation mode, check if the Excel file is the right one

8.18 ERR_CALIB_510IC_PRECONFIG (-7018)**8.18.1 Description**

Error during ASIC initialization.

8.19 ERR_CALIB_510IC_TRIM_5V4 (-7019)**8.19.1 Description**

Error during 5V4 trimming

8.20 ERR_CALIB_510IC_HANDLE_TRIM_DATA (-7020)**8.20.1 Description**

Error during handling trimming data (1V3, 3V5, VMV, VBG, ERRIRCUxm)

8.21 ERR_CALIB_510IC_HANDLE_PRESET_DATA (-7021)**8.21.1 Description**

Error during preset data handling.

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 25 de 30	

8.22 ERR_CALIB_510IC_PREPARE_FOR_CALIBRATION (-7022)

8.22.1 Description

Error during preparation for calibration. In general case, this is not possible to unlock the sensor.

8.22.2 Hints

Happen when IC cannot start correctly (short-circuit on internal sensor DC voltage (5V, 7.5V) or when there is a problem with the output transistor or a bad connection with the power supply).

8.23 ERR_CALIB_510IC_VRCUOFF_READING (-7023)

8.23.1 Description

Read VRCUOFF value in the sensor

8.24 ERR_CALIB_510IC_VRCUON_READING (-7024)

8.24.1 Description

Read VRCUON value in the sensor

8.25 ERR_CALIB_510IC_CALIBR_UDIST_1 (-7025)

8.25.1 Description

Adjustment of SELVOUTOFFSET, Analog distance 1

8.25.2 Hints

Check in filter file -> 5V4V don't be sectioned if IcPreconfig isn't sectioned too
Check Voltmeter 0 calibration

8.26 ERR_CALIB_510IC_CALIBR_UDIST_5 (-7026)

8.26.1 Description

Adjustment of VANAREF, Analog distance 5

8.26.2 Hints

Check in filter file -> 5V4V don't be sectioned if IcPreconfig isn't sectioned too
Check Voltmeter 0 calibration

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 26 de 30	

9 IC700 CTX720

These errors are visible as a measure result. The measure used is "eeprom_integrity". Below, you can find a description of all error codes. If it's possible a Hints is also specified to try to solve the problem.

Errors names	Error codes
ERR_CALIB_720IC_NO_ERROR	0
ERR_CALIB_720IC_LOCK_SENSOR	-8001
ERR_CALIB_720IC_SAVE_EEPROM_CONTENT	-8002
ERR_CALIB_720IC_CHECK_EEPROM_MEMORY_CONTENT	-8003
ERR_CALIB_720IC_SAVE_SENSOR_ID	-8004
ERR_CALIB_720IC_WRITE_EEPROM_ONLY	-8005
ERR_CALIB_720IC_COPY_RAM_TO_EEPROM	-8006
ERR_CALIB_720IC_CALIBR_SPV2_HYS	-8007
ERR_CALIB_720IC_CALIBR_SPV2	-8008
ERR_CALIB_720IC_CALIBR_SPV1_HYS	-8009
ERR_CALIB_720IC_CALIBR_SPV1	-8010
ERR_CALIB_720IC_TEMP_COMP	-8011
ERR_CALIB_720IC_TEMPERATURE_MEASUREMENT	-8012
ERR_CALIB_720IC_THERMAL_CHARACTERIZATION	-8013
ERR_CALIB_720IC_PRECONFIG	-8014
ERR_CALIB_720IC_TRIM_VREG	-8015
ERR_CALIB_720IC_HANDLE_TRIM_DATA	-8016
ERR_CALIB_720IC_HANDLE_PRESET_DATA	-8017
ERR_CALIB_720IC_PREPARE_FOR_CALIBRATION	-8018

9.1 ERR_CALIB_720IC_LOCK_SENSOR (-8001)

9.1.1 Description

Error during lock test

9.2 ERR_CALIB_720IC_SAVE_EEPROM_CONTENT (-8002)

9.2.1 Description

Error during store test report measures

9.2.2 Hints

Check database connection if exists

9.3 ERR_CALIB_720IC_CHECK_EEPROM_MEMORY_CONTENT (-8003)

9.3.1 Description

Error during EEPROM memory content control

9.3.2 Hints

Can happen when coil wire is broken

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 27 de 30	

9.4 ERR_CALIB_720IC_SAVE_SENSOR_ID (-8004)

9.4.1 Description

Error during product traceability

9.4.2 Hints

Check database connection or path for traceability files.

9.5 ERR_CALIB_720IC_WRITE_EEPROM_ONLY (-8005)

9.5.1 Description

Error during write EEPROM only fields

9.6 ERR_CALIB_720IC_COPY_RAM_TO_EEPROM (-8006)

9.6.1 Description

Error during copying RAM field to EEPROM field

9.7 ERR_CALIB_720IC_CALIBR_SPV2_HYS (-8007)

9.7.1 Description

Error during hysteresis 2 (hyst field) adjustment

9.8 ERR_CALIB_720IC_CALIBR_SPV2 (-8008)

9.8.1 Description

Error during SPV 2 adjustment

9.9 ERR_CALIB_720IC_CALIBR_SPV1_HYS (-8009)

9.9.1 Description

Error during hysteresis 1 (hyst field) adjustment

9.10 ERR_CALIB_720IC_CALIBR_SPV1 (-8010)

9.10.1 Description

Error during SPV 1 adjustment

9.11 ERR_CALIB_720IC_TEMP_COMP (-8011)

9.11.1 Description

Error during LUT value writing in RAM

9.11.2 Hints

Check in prm file if LUT values isn't bigger than 2^n (n = bit nbr of lut asic field)

9.12 ERR_CALIB_720IC_TEMPERATURE_MEASUREMENT (-8012)

9.12.1 Description

Error during reading VPTAT value by the BMUX

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 28 de 30	

9.13 ERR_CALIB_720IC_THERMAL_CHARACTERIZATION (-8013)

9.13.1 Description

Error during writing neutral LUT value in RAM
In validation mode, check if the Excel file is the right one

9.14 ERR_CALIB_720IC_PRECONFIG (-8014)

9.14.1 Description

Error during ASIC initialization.

9.15 ERR_CALIB_720IC_TRIM_VREG (-8015)

9.15.1 Description

Error during VREG trimming

9.16 ERR_CALIB_720IC_HANDLE_TRIM_DATA (-8016)

9.16.1 Description

Error during handling trimming data

9.17 ERR_CALIB_720IC_HANDLE_PRESET_DATA (-8017)

9.17.1 Description

Error during preset data handling.

9.18 ERR_CALIB_720IC_PREPARE_FOR_CALIBRATION (-8018)

9.18.1 Description

Error during preparation for calibration. In general case, this is not possible to unlock the sensor.

9.18.2 Hints

Happen when IC cannot start correctly (short-circuit on internal sensor DC voltage (5V, 7.5V) or when there is a problem with the output transistor or a bad connection with the power supply).

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 29 de 30	

10 Document history

Rev.	Pages	Date	Resp.	Description
1	All	17.02.17	GA	First version of the document
2	23-26	01.03.19	JYE	Add CTX510
3	27-30	13.12.2019	JYE	Add CTX720

Date & visa 1 st edition	Realised by	Modified by	Edition	Modified on	Signature
17.02.17 GA	TO	JYE	2	13.12.219	AQ
		Asic related errors listing		C.CQ9.27.A37.4	
				Page 30 de 30	