
DRIVE, CONTROLS AND PARTS


For the electrician and assembler - simple functional diagram, safety items and purchasing list

CONTROL FLOW

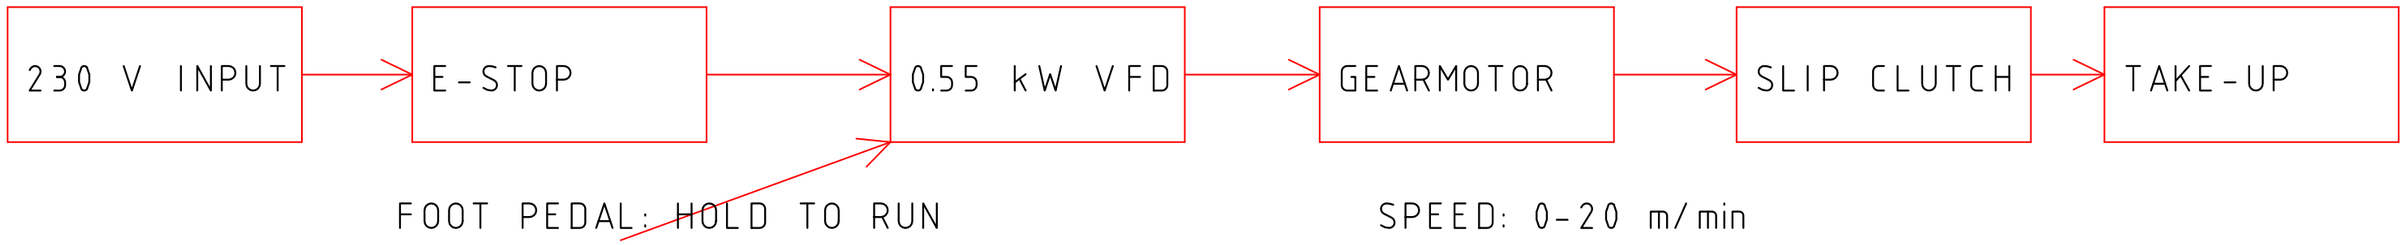

TARGET 5000 m / SHIFT | NORMAL 12-15 m/min | MAX 20 m/min

COUNTER

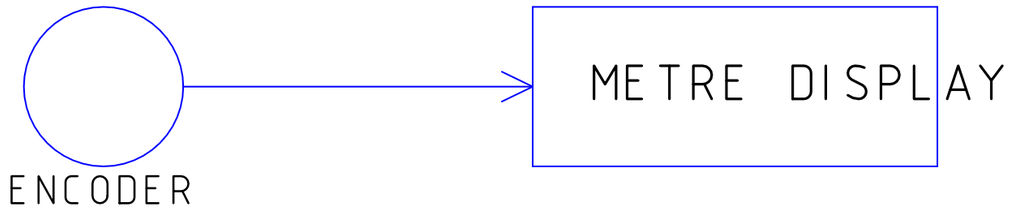

SAFETY

1. Large red E-STOP
2. Hold-to-run foot pedal
3. Fixed coupling/chain guards
4. Adjustable torque limiter
5. Earth the metal frame
6. No exposed pinch points

PURCHASE LIST

1	0.55 kW geared motor + VFD	1 set
2	UCP207 pillow-block bearings	6
3	1024 PPR incremental encoder	1
4	100 OD measuring roller	1
5	80 OD spring nip roller	1
6	35 DIA EN8 shafts	2
7	E-stop, pedal, isolator, enclosure	1 set
8	Torque limiter / slip clutch	1
9	Guards, feet and fasteners	1 set

CALIBRATION

1. Thread fabric with low tension.
2. Reset and run a measured 10 m.
3. Correct the counter roller constant.
4. Test three 20 m runs; error <1%.
5. Repeat after changing roller covering.

	FABRIC METER S4 / 4	REV C A3 1:5	PROVISIONAL VERIFY FIRST