

Engineering Instruction

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

SUBJECT: LANDING GEAR - MAIN LANDING GEAR COMPLETE - INTRODUCTION OF A NEW CAP - <u>GROUP , CONFIG. 1</u>			
COMPLIANCE:			
SOURCE DOCUMENTS:		A/C CONFIGURATION (As per source document) GROUP , CONFIG. 1	
AIRCRAFT / ENGINE / COMPONENT EFFECTIVITY LIST			
A/C MSN	A/C Registration	Engine/Component Serial No	Engine/Component Part No
Concurrent Requirements:			
1. None.			
Mandated by: ☐ Company/Operator ☐ AD	Trades/Skills: ☐ Avionics ☐ Airframe ☐ Power Plant ☐ Others...		Location: ☐ Hangar ☐ Line ☐ Shop
ETOPS Affected: ☐ Yes ☐ No	Estimated Man-Hours: 1.00	Estimated Elapsed Hours: 1.00	
Weight & Balance: 1. There will be an increase in weight of 0,030 kg (0.0661 lb) for each main landing gear. A total increase in weight for the aircraft of 0,060 kg (0.1322 lb).		Electrical Load Data: 1. Not changed.	
Operational Impact / Caution :			
Revision Comment :			
Description :			
- Safran Landing Systems tells operators that a new cap is introduced to prevent contact between the 1M strut harness and a bolt in the location of the sliding piston fork. - Safran Landing Systems recommend that you do this Service Bulletin on main landing gears on which: - the strike number 10 has not been cancelled on the 10-357303 LH Series and 10-357403 RH Series shock strut dressings nameplate and looks like this 10 .			
©			
SAFRAN LANDING SYSTEMS 2019 (AND SUBSEQUENT REVISION PAGE DATES)			
This document and all information contained herein is the sole property of Safran Landing Systems (and/or its affiliated companies). No intellectual property rights are granted by the delivery of this document or the disclosure of its content. This document shall not be reproduced to a third party without the express written consent of Safran Landing Systems (and/or the appropriate affiliated company).			

		Engineering Instruction			
EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

SERVICE BULLETIN				
ORIGINATING ENGINEER	Name:		Signature:	
	Email:		Contact N°:	
CHECKED BY:	Name:		Signature:	

Engineering Instruction

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

MATERIAL REQUIREMENT

The I/D codes below give information which help you to understand the instruction/disposition.

I/D Code Instruction/information

A New part

B Part that can be obtained from the old one

C Expendable part

D Old part to be discarded

E Part of new design valid for new manufacture

F Part number change only

Interchangeability codes (IC) given below show basic information to help you understand the interchangeability of parts. For full explanation of interchangeability codes, please refer to the latest edition of ATA specification 2000.

IC Instruction/information

01 One-way interchangeable

02 Two-way interchangeable

03 Not interchangeable

04 Interchangeable as a set

05 Qualified Interchangeability

The table that follows tells operators of the items that are necessary to do this Service Bulletin. It does not include tools or materials that are referred to in the Component Maintenance Manuals. Prices shown in the table that follows are for a quantity 1 of each part.

SERVICE BULLETIN

TOOL REQUIREMENT

None

REFERENCES / GENERAL COMMENT / NOTES / CAUTIONS

References:

Engineering Instruction

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

1. Safran Landing Systems UK Ltd Component Maintenance Manual 32-13-06.
 2. Safran Landing Systems UK Ltd Modification Form No. EDES2-0037-0337, issue 1.
 3. This Service Bulletin refers to Process Specifications (M-DLPS, M-DLNDT and PCS): these are available in the Safran Landing Systems Technical Publications on-line service.
 4. This Service Bulletin is subject to aircraft modification No. 112981 L04001 (classified minor) and is covered by aircraft Service Bulletin A350-32-P031. Under no circumstances should the modified equipment, resulting from the application of this SB,
be installed on the aircraft type unless its aircraft SB is approved.
1. Safran Landing Systems UK Ltd Component Maintenance Manual 32-13-02.
 2. Safran Landing Systems UK Ltd Component Maintenance Manual 32-13-06.

REFERENCES TASKS:

(List AMM/CMM task(s) referred in the bulletin or source modification document that are required for the EI accomplishment.)

Task	Description	CDCCL Affected
		☐ Yes ☐ No
		☐ Yes ☐ No
		☐ Yes ☐ No
		☐ Yes ☐ No
		☐ Yes ☐ No
		☐ Yes ☐ No
		☐ Yes ☐ No
		☐ Yes ☐ No
		☐ Yes ☐ No

GENERAL COMMENT / NOTES / CAUTIONS:

GROUP , Configuration 1

Engineering Instruction

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

ACKNOWLEDGEMENT				Sign/Stamp/Date
Prior proceeding with Accomplishment Instructions				
1. All Materials / Tools / Kits related to the accomplishment of this EI, has been reviewed and verified for availability prior proceeding with the accomplishment of the EI.				
2. Signing of IIR/RII E.g: Tasks/Steps identified in the EI requiring Independent Inspection:				
Accomplishment Instructions:	MECH. Sign/Staff No/Date	INSP. Sign/Stamp/Date	II - Independent Inspection Sign/Stamp/Date/Time	
Ensure that an Independent Inspection is accomplished on the tasks/steps identified in this EI as requiring an Independent Inspection. (Record: Sign/Stamp/Date/Time EYEng 4-43)				
3. All certifying engineers/staff involved in the accomplishment of this EI must independently review the EI and the subsequent related tasks and subtasks called by higher level tasks prior to accomplishment, ensuring to identify any further Independent Inspection Requirement tasks/steps and follow EYEng TPM 4-43 or customer EO/WO/Task Card requirements.				

Engineering Instruction

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

The same person shall not carry out and inspect work, in relation to a maintenance task involving some element of disassembly/reassembly of several aircraft components of the same type, fitted to more than one system on the same aircraft during a particular maintenance check.
NOTE: Refer to TPM 4-43 for Independent Inspection Requirements.

Accomplishment Instructions:	MECH	INSP	Independent Inspection (II)
	Sign/Staff No/ Date	Sign/Stamp/ Date	Sign/Stamp/Date/ Time

General			
1. Not applicable.			
Preparation			
1. Refer to Airbus Service Bulletin A350-32-P031.			
Procedure			
1. Procedure (refer to CMM 32-13-06 and Figures 1 to 3 of this Service Bulletin). - Remove the cotter pins (2-10). - At the applicable assembly step of the shock strut dressings: 1 Install the new lower cap 55-3573319-00 on the nuts (2-20). 2 Install the cotter pins (2-10) with their heads parallel to the bolt (2-40) head. Make sure that the heads of the cotter pins are hard against castellations of the nuts (2-20). Bend the legs of the cotter pins laterally around the nut castellations to safety them: refer to PCS-7610. NOTE: The cotter pins (2-10) are used to keep the lower cap 55-3573319-00 in position. 3 Apply sealant to the nuts (2-20) and the cotter pins (2-10): refer to PCS-7200. 4 Install the new upper cap 55-3573317-00 on the lower cap 55-3573319-00. 5 Install the new cotter pins MS24665-155 through the upper cap 55-3573317-00 and the lower cap 55-3573319-00 and safety them: refer to PCS-7610. 6 Complete the assembly of the shock strut dressings: refer to ASSEMBLY in the CMM. SERVICE BULLETIN			
Re-Identification of equipment			
NOTE: When it is necessary to replace the identification nameplate identify the replacement nameplate with all the applicable data.			
1. After you have done this Service Bulletin: - cancel the related strike number 10 on the 10-357303 LH Series and 10-357403 RH Series shock strut dressings nameplate, refer to M-DLPS1006-5 and cancel like this 10 - write the Service Bulletin number 10-355-32-29 in the applicable aircraft and landing gear records.			
Test			

Ensure the work area is clear of all tools, equipment and any other extraneous parts and material, and that all access panels removed have been refitted. Please feedback any issue or suggestion for improvement with regards to the content of this EI to ENGSAVI@etihad.ae & ENGSTRINT@etihad.ae.


Engineering Instruction

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

1. Not applicable.			
Close-up			
1. Refer to aircraft Service Bulletin A350-32-P031.			

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

SERVICE BULLETIN

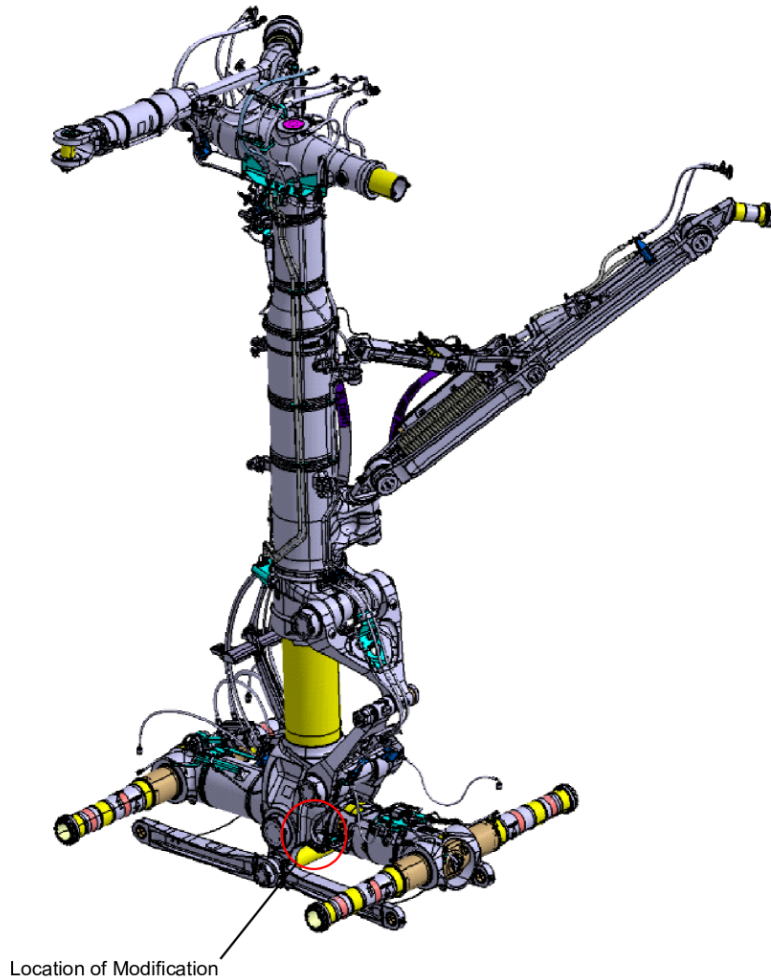


LH Main Landing Gear View from Outboard - Location of Modification
Figure 1

Service Bulletin No. 10-355-32-29
Page 6

Oct 22/2019

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

SERVICE BULLETIN

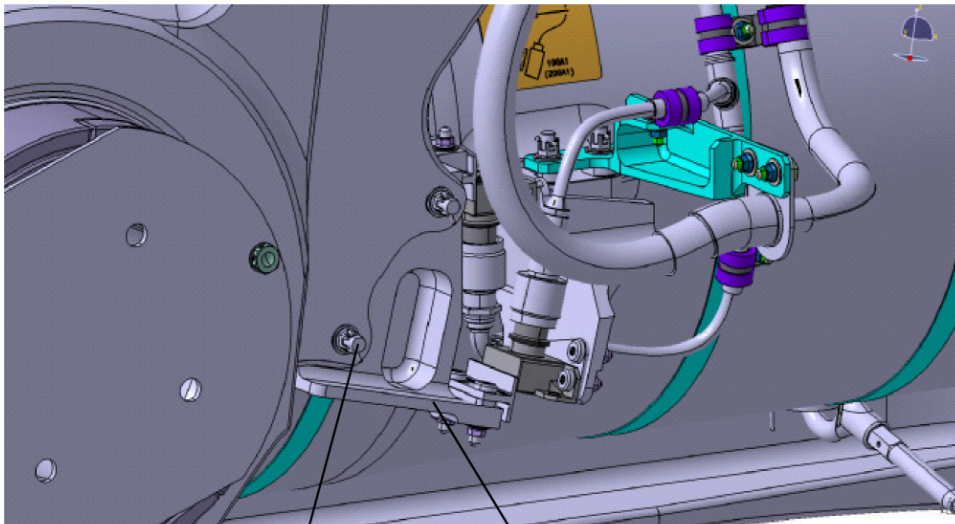

Bolt (2-40)
Flat Washer (2-30)
Nut (2-20)
Cotter Pin (2-10)
(CMM 32-13-06)

LH Bogie Angle Target Bracket
(2-100) (CMM 32-13-06)



Before Modification
Figure 2

Service Bulletin No. 10-355-32-29
Page 7

Oct 22/2019

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

SERVICE BULLETIN

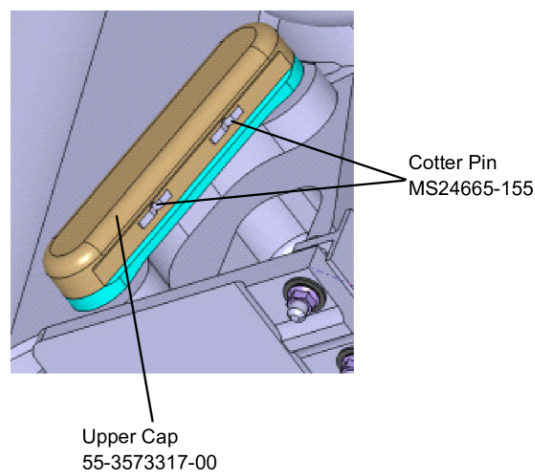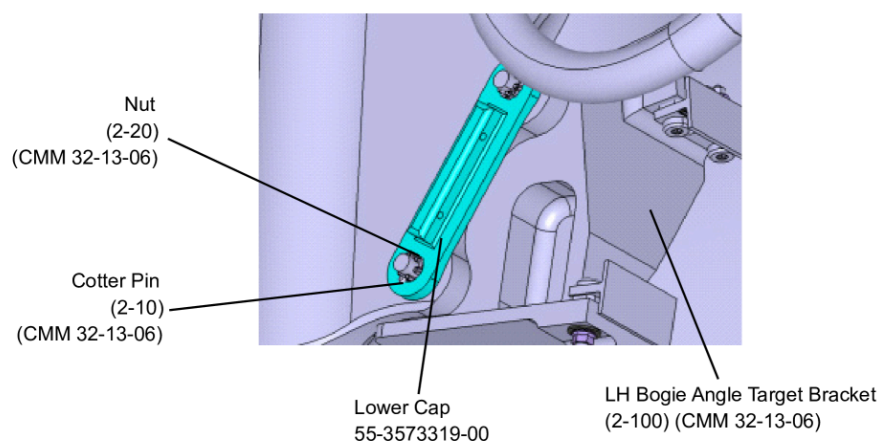

After Modification
Figure 3

Service Bulletin No. 10-355-32-29
Page 8

Oct 22/2019

SERVICE BULLETIN

1. Safran Landing Systems and Safran Landing Systems Services Contacts
 1. Refer to the Safran Landing Systems website (safrangroup.com) for the latest list of contact names, addresses and numbers.

Engineering Instruction

EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

Original Equipment Manufacturers		
Safran Landing Systems Canada Inc. 574 Monarch Avenue Ajax, Ontario L1S 2G8 CANADA Tel: 905-683-3100 Fax: 905-683-6936	Safran Landing Systems UK Ltd Cheltenham Road Gloucester GL2 9QH ENGLAND Tel: +44(0)1452 712424 Fax: +44(0)1452 713821	Safran Landing Systems SAS Site Jean-Paul Béchat Inovel Parc Sud 7, rue Général Valérie André 78140 Vélizy - Villacoublay FRANCE Tel: +33 146 29 81 00 Fax: +33 146 29 8770
Customer Support Centers (CSC)		
For AOG (commercial and technical): aogcsc.sls@safrangroup.com		
For Europe - Africa - Middle East customers: eamecsc.sls@safrangroup.com Tel: +33 1 5521 2590		
For Americas customers: americascsc.sls@safrangroup.com Tel: +1 404 305 2626		
For Asia-Pacific customers: asiacsc.sls@safrangroup.com Tel: +65 6245 5688		
Repair and Overhaul Facilities		
Safran Landing Systems Canada Inc. 574 Monarch Avenue Ajax, Ontario L1S 2G8 CANADA Tel: 905-683-3100 Fax: 905-683-0378	Safran Landing Systems Services UK Ltd Meteor Business Park Cheltenham Road Gloucester GL2 9QL ENGLAND Tel: +44(0)1452 713111 Fax: +44(0)1452 716500	Safran Landing Systems SAS 3, rue Antoine de St Exupery, BP110 67124 Molsheim Cedex FRANCE Tel: (33) 38838 9200 Fax: (33) 38838 9399
Safran Landing Systems Services Singapore Pte Ltd 21 Loyang Crescent, Loyang Industrial Estate SINGAPORE 508985 Tel: (65) 6545 9455 Fax: (65) 6542 3936	Safran Landing Systems Services Americas SA de CV Av. La Noria Parque Industrial Querétaro Carretera QRO-SLP, Km. 28.5 Querétaro, QRO 76220 MEXICO Tel: +52 (442) 19 25 800 Fax: +52 (442) 19 25 801	HYDREP Aéroport de Dinard-Pleurtuit-Saint-Malo Bâtiment 20 BP90154 35801 DINARD Cedex FRANCE Tel: (33) 2 99 82 79 79 Fax: (33) 2 99 82 79 97

		Engineering Instruction			
EI No:	1	REVISION:	1	DATE:	17/01/2023
CUSTOMER:	1	A/C TYPE:	1		

APPENDIX	
None	