


Receiver Drier Cartridge



Material

Item	Specification
Motorcraft® PAG Refrigerant Compressor Oil YN-12-D	WSH-M1C231-B

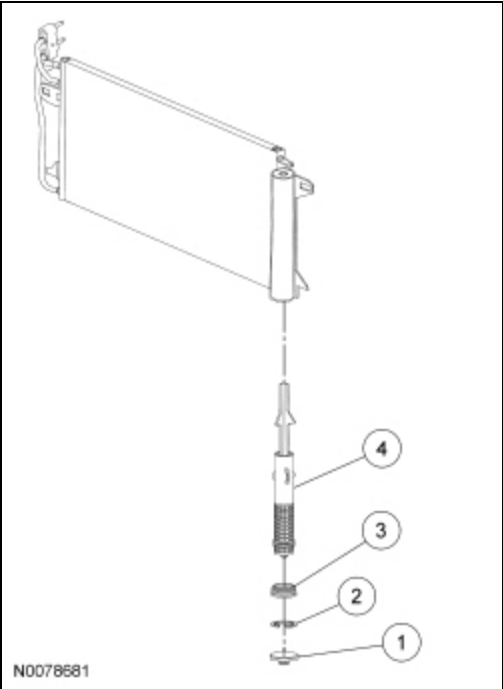

Item	Part Number	Description
1	—	Plastic receiver/drier cap (part of 19C836 kit)
2	—	Snap ring (part of 19C836 kit)
3	—	Receiver/drier plug (part of 19C836 kit)
4	19C836 19C836	Receiver/drier cartridge

Removal and Installation


NOTICE: If replacing the receiver drier cartridge or the desiccant bag with a desiccant bag, the bag must be installed first or component damage may occur.

NOTE: Installation of a new receiver/drier desiccant cartridge is not required when repairing the A/C system, except when there is physical evidence of contamination from a failed A/C compressor or damage to the receiver/drier desiccant cartridge. Damage to the receiver/drier desiccant cartridge includes physical damage to the receiver/drier desiccant cartridge or moisture contamination. Moisture contamination results only from a complete loss of refrigerant and equalization of the refrigerant system pressure with atmospheric pressure for a period longer than one hour. If even a slight amount of positive refrigerant pressure is present in the system before repairs are carried out, the receiver/drier desiccant cartridge should not be replaced.


NOTE: The receiver drier cartridge may be replaced with a desiccant bag.

NOTE: Condenser core with receiver drier cartridge shown, condenser core with a desiccant bag similar.

1. Remove the condenser core. Refer to Condenser Core in this section.
2. Unscrew and remove the plastic receiver/drier cap.
3. Remove the receiver/drier plug.
 1. Push the receiver/drier plug upwards and remove the snap ring.
 2. Install a M5 bolt in the center of the receiver drier plug and remove the plug.

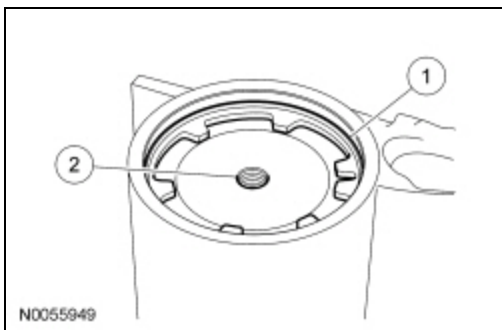

4. Using a suitable tool, grasp the receiver/drier cartridge grab handle and remove the receiver/drier cartridge.

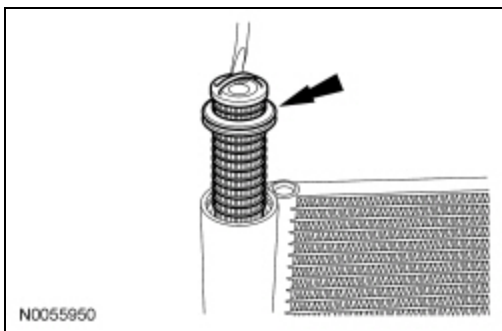

5. To install, reverse the removal procedure.
 - Lubricate the receiver/drier plug O-ring seals using residual refrigerant oil from inside the receiver/drier.