

铜·铝合金用2刃球头铣刀

Copper · Aluminum Alloy 2-Flute Ball Endmills

2刃·球头2-Flute·Ball

槽切Slotting

切槽De-slotting

曲面Profiling

圆弧Radius

细部Miniature

半精加工Semi-Finishing

精加工Finishing

超精加工Micro-Finishing

切削条件Cutting Conditions

外径公差Tolerance

1≤D≤3: 0~-0.01
4≤D≤10: 0~-0.015

R公差Tolerance

±0.005


h5

0~-0.005

(mm)



高耐溶着性能。最适合铝合金·铜的加工。tac涂层。
High welding resistance makes it ideal for machining aluminum alloys and copper.tac coating.

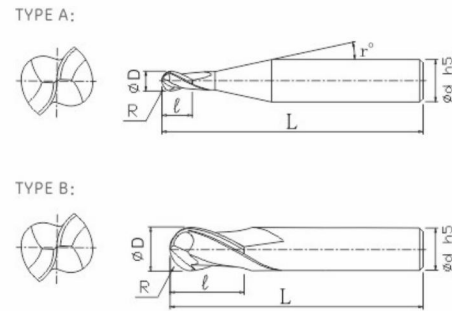

- 针对铜电极加工用的球头铣刀。
- 采用优化的刀刃形状和tac涂层，可确保长时间进行持续稳定的高品质加工。
- Ball end milling cutter for copper electrode machining.
- High quality and stable milling performance with long tool life by optimized design and tac COATING.



产品代码 Code No.	规格型号 Spec Typ.	球头半径(R) Radius	刃长(l) Length of Cut	外径(D) Dia.	颈角(r) Neck Taper Angle	柄径(d) Shank Dia.	全长(L) Overall Length	形状 Type	定价 Retail Price
FX3B0102	R0.5x2L	R0.5	2	1	12°	4	50	A	
FX3B0152	R0.75x3L	R0.75	3	1.5	12°	4	50	A	
FX3B0202	R1x4L	R1	4	2	12°	4	50	A	
FX3B0302	R1.5x6L	R1.5	6	3	12°	4	50	A	
FX3B0302D3	R1.5x6L	R1.5	6	3	—	3	50	B	
FX3B0402	R2x6L	R2	6	4	—	4	50	B	
FX3IB0402	R2x6L	R2	6	4	—	4	75	B	
FX3B0502	R2.5x9L	R2.5	9	5	12°	6	50	A	
FX3B0602	R3x9L	R3	9	6	—	6	50	B	
FX3B0602L	R3x9L	R3	9	6	—	6	60	B	
FX3IB0602	R3x9L	R3	9	6	—	6	75	B	
FX3JB0602	R3x9L	R3	9	6	—	6	100	B	
FX3B0802	R4x12L	R4	12	8	—	8	60	B	
FX3IB0802	R4x12L	R4	12	8	—	8	75	B	
FX3JB0802	R4x12L	R4	12	8	—	8	100	B	
FX3B1002	R5x15L	R5	15	10	—	10	75	B	
FX3JB1002	R5x15L	R5	15	10	—	10	100	B	

加工材料 Work Material	铜合金 Copper			铝合金 Aluminum Alloy		
切削速度 Cutting Speed	70~100m/min			100~200m/min		
球头半径(R) Radius	主轴转速 Spindle Speed	进给速度 Feed		主轴转速 Spindle Speed	进给速度 Feed	
	min-1	mm/min		min-1	mm/min	
		粗加工 Roughing	精加工 Finishing		粗加工 Roughing	精加工 Finishing
0.5	32,000	200	550	47,000	320	860
0.75	21,000	200	550	47,000	320	860
1	16,000	200	550	23,800	600	860
1.5	11,000	250	700	16,000	750	1,650
2	8,000	250	700	12,000	750	1,650
2.5	6,400	250	700	9,600	750	1,650
3	5,300	250	700	8,000	750	1,650
4	4,000	250	700	6,000	750	1,650
5	3,200	250	700	4,800	750	1,650
切深量 Depth of Cut	粗加工 Roughing 精加工 Finishing (R : 球头半径 Radius)					
备注 Notes	※ 建议使用油冷冷却方式。 ※ 请以相同的比率调整主轴转速和进给速度。 ※ 严禁用于钢。 ※ Use cutting fluid. ※ Adjust both spindle speed and feed at the same rate. ※ Don't use for cutting steels.					