

Hu v. Hyundai Motor America

AG Case No. NC-1-1249605441 · VIN: KM8KNDDF9RU253237

EXHIBIT 10 — SMART DIAGNOSIS FAULT CODE REPORT & DIAGNOSTIC FEE DEMANDS

Consumer: Jimmy Y. Hu · Hearing: June 9, 2026 · Arbitrator: Maneesha Sharma

I. SOURCE DOCUMENTS

This exhibit is drawn from two versions of the Hyundai Smart Diagnosis printout, scan reference SHyundai Se26010917440, generated at Paramus Hyundai on January 8, 2026 at 12:50 PM during the diagnostic evaluation following the January 6–7, 2026 complete battery failure events. Both printouts contain identical diagnostic trouble code (DTC) data; they differ only in the handwritten diagnostic fee notation (\$1,040 on one, \$540 on the other). Original PDFs of both source documents are attached behind this cover sheet.

II. DIAGNOSTIC SCAN METADATA

Scan Reference	SHyundai Se26010917440 / Session B(B)AANJ0332601080341
Date / Time	January 8, 2026 at 12:50 PM
Vehicle	2024 Hyundai IONIQ 5 (NE EV) / 70kW + 160kW dual motor
VIN Confirmed	KM8KNDDF9RU253237
Tool S/W Version	NNH-02-0102 · VCI Ver. 03.25
Systems Scanned	5 systems
Total DTCs Found	7 DTCs (Active + History)
Critical Finding	Battery/charging system faults (VCMS, ABSC) are in separate systems from headlamp faults (ICU)

III. COMPLETE DTC LISTING WITH STRATEGIC ANNOTATION

Codes highlighted in red are the primary battery/charging defect codes central to this claim. Codes in gray are lighting/radar system codes that Hyundai personnel cited as a possible cause — a theory definitively refuted by the February 19, 2026 warranty diagnosis (RO #370267).

System / Module	DTC Code	Description	Category	Strategic Significance
VCMS (Vehicle Charging Management System)	P1BAD92	Battery Charger Coupler Temperature too High	Powertrain	PRIMARY DEFECT — directly establishes battery/charging system failure; entirely unrelated to headlamp
ABSESC (ABS/ESC)	C110213	Battery Voltage Low	Chassis	PRIMARY DEFECT — confirms low battery voltage system-wide; entirely unrelated to headlamp
ADAS_DRV (ADAS Driving ECU)	C188186	FR/RR CRDR Signal Error Fault	Chassis/ADAS	Radar sensor error — consistent with right headlamp area damage; does NOT cause battery failure
C_RADAR (Corner Radar)	C270754	Control Module Missing Calibration (Front Right)	Chassis/ADAS	Calibration fault — right-front sensor area; does NOT cause battery failure
ICU (Integrated Central Control Unit)	8235300	Dedicated DRL RH SCG (Daytime Running Light Right Short-Circuit to Ground)	Body	RIGHT HEADLAMP — lighting/cosmetic fault; separate system from battery
ICU (Integrated Central Control Unit)	8258A00	External Tail Lamp Front Right Circuit Short to Ground	Body	RIGHT LAMP CIRCUIT — lighting fault; separate system from battery

System / Module	DTC Code	Description	Category	Strategic Significance
ICU (Integrated Central Control Unit)	C162800	CAN Time Out CLU (Central Logic Unit communication timeout)	Body	Network timeout — may cascade from headlamp circuit but does NOT explain battery death

IV. STRATEGIC SIGNIFICANCE — WHY THIS DOCUMENT IS CRITICAL

This Smart Diagnosis printout establishes four key facts:

- The battery/charging system (VCMS) and chassis battery voltage (ABSC/ESC) failures are recorded in entirely separate ECU modules from the right headlamp faults (ICU). These are distinct electronic systems. A broken headlamp assembly cannot cause a VCMS battery charger fault.
- Hyundai's own diagnostic tool — not Consumer's testimony — generated these codes. This is Hyundai's own equipment identifying a powertrain/battery failure.
- The headlamp codes (8235300, 8258A00) are consistent with the pre-existing cosmetic damage present since December 22, 2024, which was not flagged when the vehicle was returned to Consumer on August 7, 2025 after the first 126-day repair event.
- The February 19, 2026 warranty confirmation (RO #370267) — which authorized battery replacement at no charge — directly refutes any claim that the headlamp caused the battery failures.

In summary: Hyundai's own Smart Diagnosis system shows P1BAD92 and C110213 as battery/powertrain system faults on January 8, 2026. Six weeks later, Hyundai's own technicians confirmed those same faults were warranty-covered manufacturing defects requiring battery replacement. The headlamp was irrelevant.

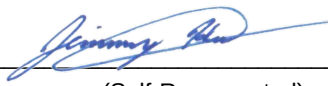
V. DIAGNOSTIC FEE DEMANDS — CHRONOLOGY

The same Smart Diagnosis printout contains handwritten dealer notations demanding diagnostic fees before the dealer would proceed with warranty inspection of a battery failure — despite the fact that the vehicle's battery failure was ultimately confirmed as a warranty-covered defect. Consumer paid the \$540 fee under protest. It was not refunded after warranty confirmation.

Date	Amount Demanded	Document	Context
01/08/2026	\$1,040.00	SHyundai Se26010917440 (initial fee version)	Handwritten note on Smart Diagnosis report: "In the system we need 4 hours of Diagnosis \$1040 of Diagnose the vehicle in order to see what else vehicle needs." Dealer demanded this fee before proceeding with warranty inspection for a battery failure event — January 6–7, 2026.
~02/13/2026	\$540.00	SHyundai Se26010917440 (revised fee version)	Revised diagnostic fee demanded when vehicle was towed to Paramus Hyundai after the February 9, 2026 battery failure (RO #370267). Consumer signed the \$540 Hyundai Service Diagnostic Agreement under protest, stating the fee should be waived if the defect proved warranty-covered. On February 19, 2026, the dealer confirmed the root cause was a warranty-covered defect.

Consumer Certification

I, Jimmy Y. Hu, certify under penalty of perjury that the foregoing description of the Smart Diagnosis documents is true and accurate.

Signature:  Date: 6/1/2026
Jimmy Y. Hu, Consumer (Self-Represented)

This document is Exhibit 10 to Consumer's submission in Hu v. Hyundai Motor America, AG Case No. NC-1-1249605441.

The two source PDFs (SHyundai Se26010917440 — \$1,040 version and \$540 version) are attached as pages 2–3 of this exhibit.