
DI57Q-02

Wireless Door Lock Buzzer Circuit

WIRING DIAGRAM

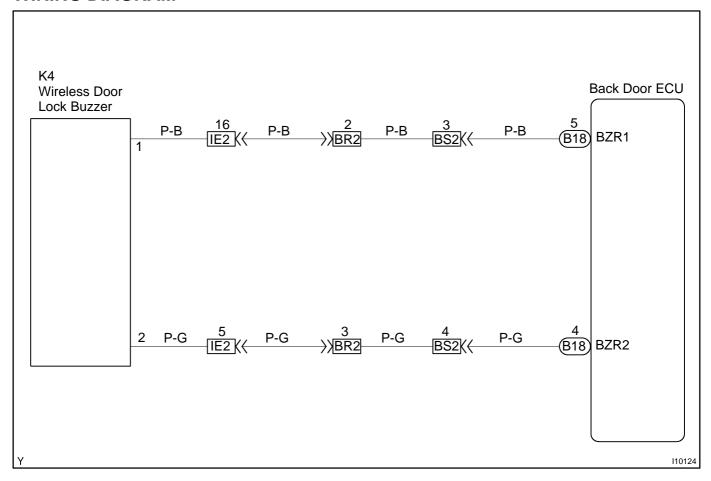

2002 4RUNNER (RM887U)

Author: Date: 750

INSPECTION PROCEDURE

1 Check wireless door lock buzzer (See page BE-93).

NG

Replace wireless door lock buzzer.

OK

2 Check harness and connector between wireless door lock buzzer and back door ECU (See page IN-28).

NG

Repair or replace harness or connector.

OK

Proceed to next circuit inspection shown on problem symptoms table (See page DI-556).

2002 4RUNNER (RM887U)

Author: Date: 751