Inspection report

AV-26-004181 | Site visit 2026-09-14 | Report revision 1

INSURED	Cedar Quay Warehousing LLC
SITE	Building 4, East Quay Industrial Park, Fairhaven
REPORTED EVENT	Wind damage and subsequent water entry at the east roof corner
INSPECTING ADJUSTER	Alex Rowan

1. Reported circumstances

The site manager reported displaced roof sheets after overnight high winds. Water was discovered beside pallet storage at the east wall when the building opened. Staff isolated the affected aisle and arranged temporary weather protection. No business-interruption amount has been agreed.

2. Observations and limitations

The east roof corner has displaced metal sheets and temporary blue weather protection. Interior ceiling insulation is locally stained. Cartons beside the east wall show moisture exposure. These observations alone do not establish when the opening formed or whether all stock was damaged in this event.

See the embedded annotated photo exhibit and case-specific location sketch. Both are original synthetic scenario exhibits; they do not establish cause, timing, liability or coverage.

Preliminary repair scope

AV-26-004181 | Revision 1 | 2026-09-14 | USD; tax excluded

Item / description	Qty	Unit	Rate	Amount
Temporary weather protection	1	LS	1,800.00	1,800.00
Replace roof sheets and membrane	120	m2	60.00	7,200.00
Drying equipment and monitoring	4	days	650.00	2,600.00
Ceiling insulation replacement	40	m2	85.00	3,400.00
Debris handling and disposal	1	LS	900.00	900.00
Moisture survey and reporting	1	LS	2,500.00	2,500.00
PRELIMINARY TOTAL				**18,400.00**

Scope qualifications

Quantities are provisional. Reserves, preliminary repair estimates, later proposals and any eventual payment are different measures. No completed work, cause or insurer approval is certified.

Obtain the roofer’s before-and-after photographs, itemized stock inventory and the prior roof-maintenance record. Reinspection is scheduled for 2026-09-20 at 10:00 using the west service door.

Annotated photo exhibit

AV-26-004181 | Synthetic scenario photos; original JPGs retained separately

PHOTO EXHIBIT | AV-26-004181





A - Displaced roof sheets / temporary tarp

B - Local interior moisture staining

Synthetic photos. Annotations describe appearances, not cause, timing, liability or coverage.


How to read this exhibit

Marks A and B refer to visible appearances only. Compare the embedded images with the inspection narrative and the separate original JPGs. Not every visually useful detail is transcribed into the report text.

These are generated scenario images, not independently dated field photographs. A later image cannot prove an earlier event sequence or reveal concealed conditions.

Location and evidence sketch

AV-26-004181 | Embedded case-specific diagram - not to scale

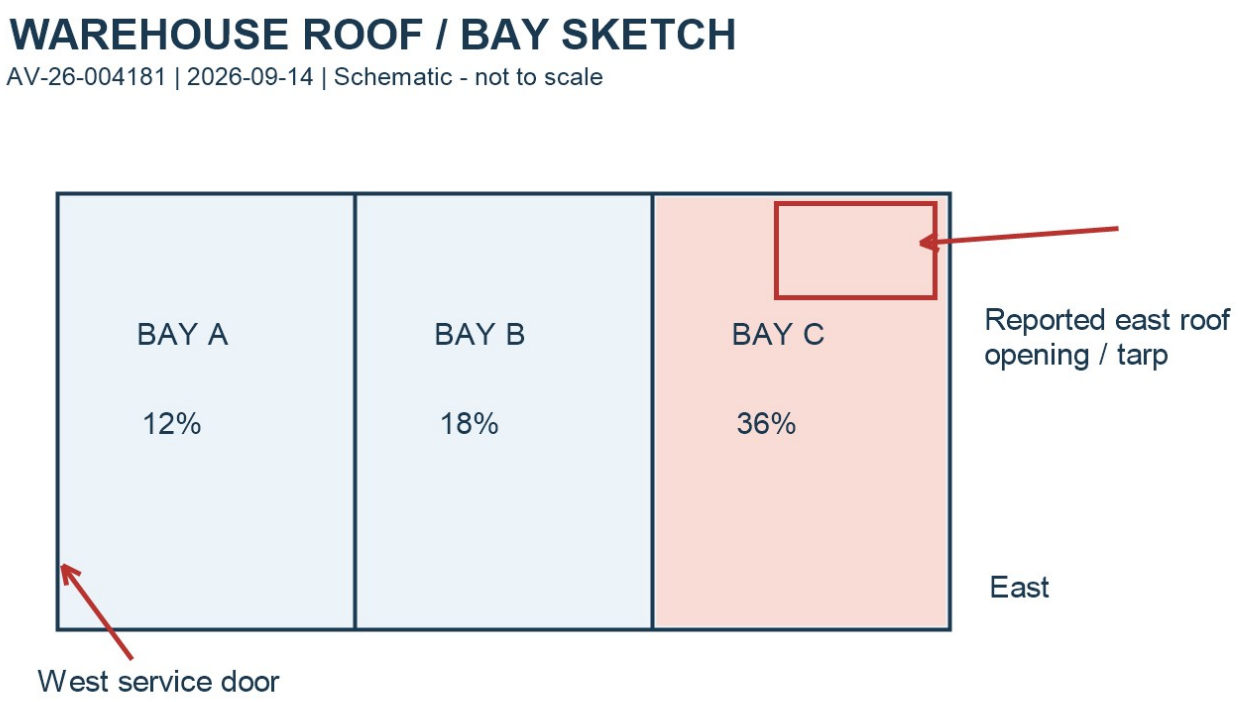

Interpretation and unresolved evidence

The warehouse sketch locates the reported east roof opening, the west service door and the illustrated bay readings. The location and moisture exhibit are not a verified cause assessment.

The incident form records 09:20. A later manager email reports 09:40 and says the first time was transcribed from a handwritten note. Neither time has been independently corroborated.