



DESIGN & CONSTRUCTION
PO Box 26•County Hall
Preston•PR1 8RE
Tel: 01772 533276
Email: philip.rawcliffe@lancashire.gov.uk

Asbestos Survey Report –
Management Survey

**Lyngarth, Old House Lane,
Marton, Blackpool, FY4 5LD**

Our Reference: PG152/15PR
Surveyor(s): P.Rawcliffe
Date of Survey: 17th April 2015

In Accordance with Control of Asbestos Regulations 2012



Signed:

A handwritten signature in black ink, appearing to be 'P. Rawcliffe'.

Date: 06.05.2015

Approved Signatory: P Rawcliffe BSc Hons CCP

CONTENTS

1. Introduction
2. Methodology
3. Exclusions
4. Conclusions
5. Recommendations

APPENDIX 1 : Survey Details

- 1(a) Asbestos Register
- 1(b) Risk Assessment
- 1(c) Areas Not Inspected
- 1(d) Site Plans

APPENDIX 2 : Analytical Reports

APPENDIX 3 : Photographs

APPENDIX 4 : General Exclusions

1. INTRODUCTION

On the instruction of Mark Rendell (Lancashire County Council) a representative of Design & Construction has attended Lyngarth, Old House Lane, Marton, Blackpool, FY4 5LD to carry out a Management Asbestos Survey. **The survey only included the areas marked on the floor plans (Appendix 1d) as directed by Mark Rendell. The purpose of the survey was to identify the presence of any asbestos containing materials.**

General Description of Areas Surveyed	
Use	Residential
Number of Storeys	Two
Internal Walls/Partitions	Solid & stud partition
External Walls	Brick
Internal Ceilings	Lath & plaster / plasterboard
Internal floors	Wood (first floor); Solid & wood (ground floor)
Other features	Slate roof

2. METHODOLOGY

Management Survey

The purpose of this type of survey is to locate as far as reasonably practicable, the presence and extent of any asbestos containing material. Representative samples are collected and analysed to confirm the presence or absence of asbestos containing materials. If the material sampled is found to contain asbestos, other similar homogeneous materials used in the same way in the building can be strongly presumed to contain asbestos.

The sampling strategy is designed to cause minimal damage to the fabric of the building. As such, it should be noted that materials behind wall panels, fixed ceilings etc may contain asbestos. This should be borne in mind when undertaking major structural work. In the event of major structural work or demolition, a Refurbishment and Demolition Survey should be carried out.

Sampling is not undertaken where damage may affect the efficiency of the plant, e.g. flue pipes and gaskets.

Sampling is also not carried out where there is a physical danger present such as electricity fuse boxes/distribution boards etc, boilers, machines in operation etc.

Bulk sampling strategies and procedures have been performed in accordance with HSG 264 – Asbestos: The Survey Guide.

Material Assessment Scores

Materials with assessment scores of 10 or more are regarded as having a high potential to release fibres, if disturbed. Scores of between 7 and 9 are regarded as having a medium potential, and between 5 and 6 a low potential. Scores of 4 or less have a very low potential to release fibres. Non-asbestos materials are not scored.

Priority Assessment Scores

The priority assessment looks at the likelihood of someone disturbing the ACMs. Four parameters determine the likelihood of this occurring:

Maintenance activity
Occupant activity
Likelihood of disturbance
Human exposure potential

The parameters are scored on a scale of 0 to 3, which when added together give the overall priority rating.

Total Risk Score

In some cases there may be ACMs in many different locations throughout your premises. Budget and time constraints may not allow you to deal with all of them straight away, if this is the case you will have to prioritise them, dealing with those that pose the highest risk to health first. You can do this by dealing with the ACMs that have been given the highest Total Risk Assessment Score first. The Total Risk Assessment Score is the sum of the Material Risk Assessment Score and the Priority Assessment Score:

Total risk = Material assessment score + Priority assessment score

Risk Score Assessment

20 or More	High Risk
14 to 19	Medium Risk
9 to 13	Low Risk
8 and below	Very Low Risk

3. EXCLUSIONS

Whilst every effort has been made to identify and examine all suspect materials within the areas of the premises visited, we cannot guarantee that all asbestos containing materials have been located. Some materials may well be hidden within the fabric of the building and may only become evident when any demolition work or major refurbishment is being carried out within or on the premises.

The Management Survey does not extend to removing **fixed** tiles/boarding to inspect what is behind, although checks above removable suspended ceilings are made along with any roof space or accessible ducting and vertical risers. Products such as chrysotile rope within older electrical switchgear are beyond the scope of the survey and under normal conditions will present a low risk if present.

4. CONCLUSIONS

The Management Asbestos survey conducted at Lyngarth, Old House Lane, Marton, Blackpool, FY4 5LD identified the following asbestos containing materials (ACM's):

- Asbestos cement debris to the grounds of the Lyngarth property. The debris was located adjacent to the front door. The debris was found to be in a poor condition and partially buried in the ground. The total area affected was approximately 1m².

5. RECOMMENDATIONS

- The identified asbestos cement debris within the grounds of the Lyngarth property must be removed by a licensed asbestos contractor (LCC approved) at the earliest opportunity.
- No access was gained to the external outbuildings as they had been secured to prevent access. Please contact LCC Design & Construction to arrange a further inspection once the security fittings have been removed and access can be gained.
- The grounds to the Lyngarth property were inspected during the survey. However, the plot was heavily overgrown with vegetation, which prevented a thorough visual inspection. Any work within the grounds must be undertaken with caution due to potential asbestos debris concealed by the vegetation (e.g. asbestos cement from a former outbuilding). Please contact LCC Design & Construction for further advice if any work is planned within the grounds of the Lyngarth property.

Where identified asbestos containing materials (ACMs) are to be retained, it is important to implement a management programme, which should include:

- Producing of a register of the locations of all the ACMs being retained on the premises.
- A maintenance system being set up requiring that anyone carrying out work in the building should consult the register to ensure that any activity being carried out will not disturb the ACMs.
- The register is updated as and when any ACMs are removed or repaired etc.
- That the ACMs are inspected visually on a regular basis and a record of the inspection is made.
- Any retained ACMs within the premises should be encapsulated if not already sealed and preferably labelled with asbestos warning labels or tape.
- Carry out a Refurbishment or Demolition Survey before any major refurbishment or demolition work takes place.

APPENDIX 1:

SURVEY DETAILS

1(a) Asbestos Register

1(b) Risk Assessment

1(c) Areas Not Inspected

1(d) Site Plan

Appendix 1(a) - Asbestos Register: Lyngarth, Old House Lane, Marton, Blackpool, FY4 5LD

Room Number	Location	Product Type	Extent	Accessibility	Condition	Surface Treatment	Asbestos Type	Sample Number / Presumed	Material Assessment Score	Priority Assessment Score	Action
External	Grounds	Asbestos Cement debris	1m ²	Easy	Poor	Partially buried	Chrysotile	PH14855B	6	6	Remove – HSE licensed asbestos contractor

Material assessment scores above 10 have a high potential to release fibres

APPENDIX 1(b) - Risk Assessment

Reference:	Premises Name and Address:							Client			Survey Date(s)		Surveyor(s)	
PG152/15PR	Lyngarth Marton							LCC			17.04.2015		PR	
Sample Number	Room	Location	Material Classification	Material Assessment					Priority Assessment					Total of Assessment Scores
				score 1-3 Product Type	score 0-3 Extent Of Damage	score 0-3 Surface Treatment	score 1-3 Asbestos Type	Material Assessment Score	score 0-3 Normal Occupant Activity	score 0-3 Likelihood of Disturbance	score 0-3 Human Exposure Potential	score 0-3 Maintenance Activity	Priority Assessment Score	
PH14855B	External	Grounds	Asbestos Cement debris	1	3	1	1	6	1	2	2	1	6	12


Appendix 1(c)

Areas Not Inspected

Building	Area [*]
Lyngarth, Old House Lane, Marton, Blackpool, FY4 5LD	Refer to the site plans in section 1(d). Any areas not highlighted are outside the scope of this survey. <u>Any areas which have not been accessed or inspected must be presumed to contain asbestos until a further inspection has taken place.</u> No access was gained to the external outbuildings as they had been secured to prevent access. Please contact LCC Design & Construction to arrange a further inspection once the security fittings have been removed and access can be gained.

^{*} Please note the information contained within section 2 (Methodology) and section 3 (Exclusions).

Appendix 1(d) – Floor Plans

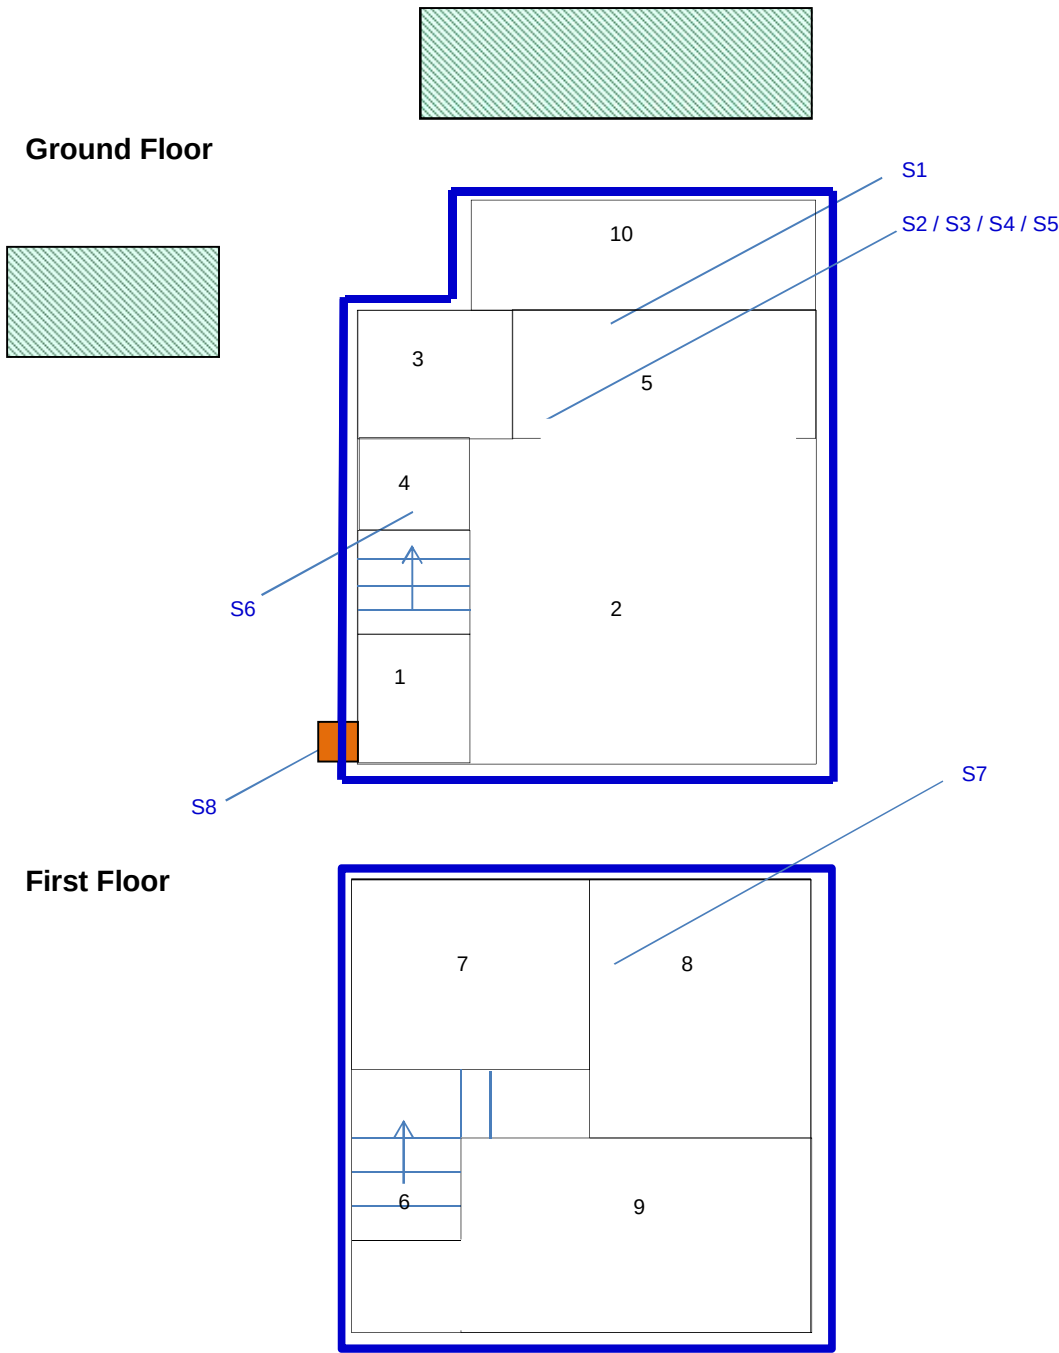

KEY (print in colour only; Sx – Sampling Point):

Areas covered by the survey contained within the blue line: 	Areas outside the scope of the survey: 	Asbestos cement debris: 
--	---	--

APPENDIX 2:

ANALYTICAL REPORTS



Submitting Authority - NAME AND ADDRESS :

PHIL RAWCLIFFE
BUILDING, DESIGN & CONSTRUCTION
LANCASHIRE COUNTY COUNCIL
COUNTY HALL
PRESTON

**a UKAS
Testing Laboratory
No. 0625**

Environment Directorate
Dr. A. C. Smith, County Analyst & Chief Scientific Advisor
BSc, PhD, MChemA, CSci, CChem, MRSC
Pedders Way, Riversway Docklands
Ashton-on-Ribble, PRESTON, PR2 2TX

REPORT NO: PH14848B

Please ask for: Asbestos Team
Tel. No.: [01772] 721660

REPORT DATE: 21.04.15

email: scientificservices@lancashire.gov.uk

ASBESTOS IDENTIFICATION REPORT

The sample(s) received from LYNGARTH MARTON have been analysed in accordance with current Health and Safety Executive Guidance with the following results:

ANALYST: P. HOOD

Lab.Ref.No.	Your Ref.No.	Sampling Location	Date of submission to Laboratory	Type of Asbestos	
PH14848B	PG152/15PR-1	COATING TO SINK AREA 5	21.04.15	NO ASBESTOS DETECTED	S1
PH14849B	PG152/15PR-2	BROWN FLOOR TILES AREA 5	21.04.15	NO ASBESTOS DETECTED	S2
PH14850B	PG152/15PR-3	GREY + BLUE FLOOR TILES AREA 5	21.04.15	NO ASBESTOS DETECTED	S3
PH14851B	PG152/15PR-4	BLACK + WHITE FLOORING AREA 5	21.04.15	NO ASBESTOS DETECTED	S4
PH14852B	PG152/15PR-5	BROWN + WHITE FLOORING AREA 5	21.04.15	NO ASBESTOS DETECTED	S5
PH14853B	PG152/15PR-6	GREEN RUBBER FLOORING AREA 4	21.04.15	NO ASBESTOS DETECTED	S6
PH14854B	PG152/15PR-7	LINO UNDER CARPET AREA 8	21.04.15	NO ASBESTOS DETECTED	S7
PH14855B	PG152/15PR-8	CEMENT DEBRIS IN GROUNDS	21.04.15	CHRYSTOLE	S8

DISCLAIMER:

The sample(s) have been submitted by the client and as such, the County Analyst can accept no responsibility for sampling procedures, the representative nature of the samples or accuracy relating to the sample description/location.

The Lancashire County Scientific Services is accredited by U.K.A.S. for:-

- (a) the sampling of air for fibre counting and bulk materials for asbestos identification
- (b) fibre counting including on-site counting
- (c) analysis of bulk materials for asbestos identification

The methods and procedures used are performed in accordance with current Health and Safety Executive Guidance – HSG 248 and CM2.OP1 Analysis of Materials for the Presence of Asbestos and Identification by Polarised Light Microscopy.

Opinions and interpretations given in this report are not subject to accreditation by U.K.A.S.

Approved Signatory:

P. Rawcliffe
Principal Scientific Officer

A. Blake
Senior Scientist

I. Dawson ✓
Senior Scientist

Signed: *[Signature]*


Date: 22.4.15

CM2-RPT-7
Issue No. 5
February 2013

APPENDIX 3 – PHOTOGRAPHS



1. Asbestos cement debris within the grounds of the Lyngarth property – adjacent to front door.

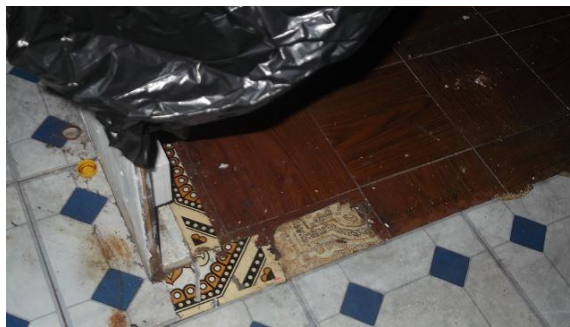

2. No asbestos detected in the floor tiles and lino – area 5.



3. No asbestos detected in the floor tiles – areas 3, 5, & 10.



4. No asbestos detected in the flooring material – area 4.



5. No asbestos containing materials to the Creda TSR12AW / TSR18AW & TSR24AW heaters – areas 1, 9 & 2.



6. Modern distribution board – area 1.



7. No asbestos detected in the lino flooring under the carpet – area 8.



8. MMMF insulation in the roof space.



9. No access to the out buildings in the grounds of the Lyngarth property.

APPENDIX 4 – GENERAL EXCLUSIONS

Health and Safety is an important consideration during our surveys and if the team find an area where access or sampling will present an unacceptable risk the survey will be suspended until suitable controls have been implemented. Such situations will include: accessing confined spaces, work at heights, work near active equipment etc.

Areas above office equipment, process equipment, etc. will not be accessed where there is a risk to the surveyors and will be subject to a visual assessment only.

Surveying of live plant, heaters or process equipment shall be restricted to accessible external areas only. LCC Building Design & Construction survey teams are not trained to dismantle and reassemble these items and will not compromise any fixed guards, etc.

Moving plant and equipment shall be excluded from the survey unless an inspection is requested by the client. Access will only be gained once the plant has been isolated by the client.

Lift shafts will only be accessed by the survey team when accompanied by a competent lift engineer. In the absence of a lift engineer, the lift shaft shall be presumed to contain asbestos.

Flooded basements or other areas where surfaces are covered by water or other liquids shall be recorded as inaccessible areas. LCC Building Design & Construction cannot be held responsible for the presence of asbestos in flooded areas.

LCC Building Design & Construction shall only access high-level roofs from safe working platforms or edge protected flat roof areas. LCC Building Design & Construction cannot therefore accept responsibility for asbestos products located on non-accessible high roofs areas.

LCC Building Design & Construction shall not normally access loft spaces that are not immediately visible or accessible from safe walkways. Periodic inspection will be made beneath loft insulation.

HSG 264 – The Survey guide allows surveyors to presume or strongly presume that visually similar materials are likely to contain or not contain asbestos. In these instances there is the possibility that visually similar rogue items of asbestos containing material may not be identified.

During the survey, the survey team will use their judgement to determine whether it is possible to sample materials without causing damage to the structural integrity of the building. Examples of this may be that sampling of the roofing felt may result in a leak in the roof, or breaking an external under-window panel may result in weather penetration. In such instances either no sample will be taken, and a presumption made, or a much smaller than normal sample will be taken. For small samples the accuracy of the analysis will be reduced.

Textured/decorative coatings are non-homogeneous materials and do not have an even distribution of asbestos throughout the material and asbestos may only be present at trace levels. LCC Building Design & Construction will endeavour to take representative samples of these materials but cannot accept responsibility for localised inconsistencies in their composition.

In buildings where there are large amounts of stored items, LCC Building Design & Construction cannot accept responsibility for any asbestos containing materials which have been concealed by these items.

The survey shall not include any items contained within the ground beneath or adjacent to the surveyed areas, or items stored inside containers, drawers, cupboards, etc. within the building/site.

LCC Building Design & Construction cannot accept responsibility for the identification of any sealed void within structures such as bricked up basement rooms, service risers, etc. or where there is no evidence to support its presence such as clearly marked drawings. Accurate site plans are extremely important in this regard.