
Corners_Numbering with Coordinates for layout print >>Help

folder location and subfolders :

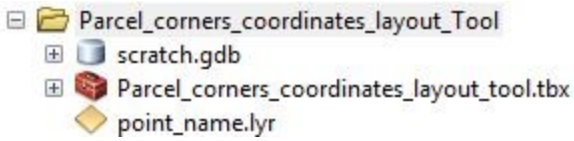

- Scratchworkspace.gdb: the default and scratch file Geodatabase in which the **Corners_Coordinates** feature class will be saved.


-Parcel_corners_coordinates_layout_tool.tbx

- point_name.lyr : used in the model builder to layout the corners coordinates directly with the symbology and label.


-Prerequisites:

1- Start Edit with any line feature class.


2- Zoom to the parcel you need to layout their corners coordinates.

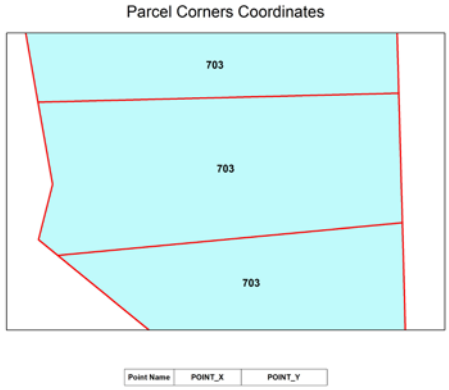


3- Draw a line passing by parcel's corners.

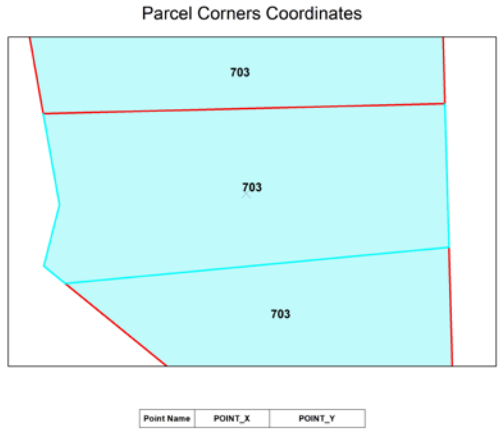

4- Use the tool by dragging the line feature class to the input box in the tool.

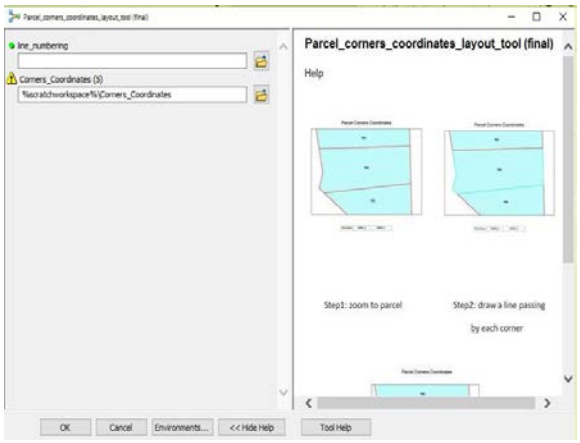

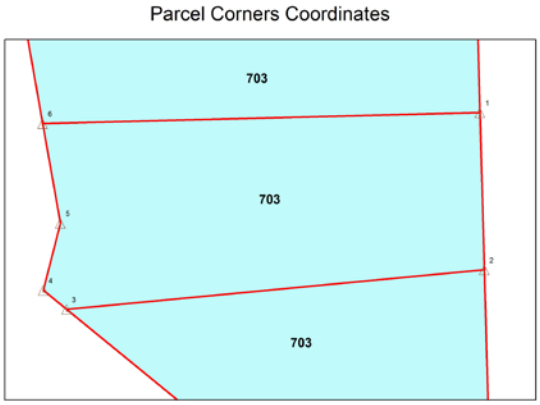

Point Name	POINT_X	POINT_Y
1	195758.979794463	972058.364415789
2	195759.491126872	972040.057705825
3	195710.74893781	972035.461201573
4	195708.035760397	972037.676538307
5	195710.022727415	972045.487890042
6	195707.95224933	972057.093492668

5-Use (Graphic Table Eliment): Create a Dynamic Table in your Map Layout to update the corners coordinates within the table layout based on the parcel's corners you need.

-Need to install **Production mapping product.**




Create a Dynamic Table in your Map Lay

-

6-Inside the Tool:

- Modify the tool environments (scratch and default Workspaces) from:
  Start edit a model…from (model) menu select (model properties) then click Environment tab…go to Workspace and put the path of (Scratchworkspace.gdb).
- The Output Coordinate System = The input Coordinate System

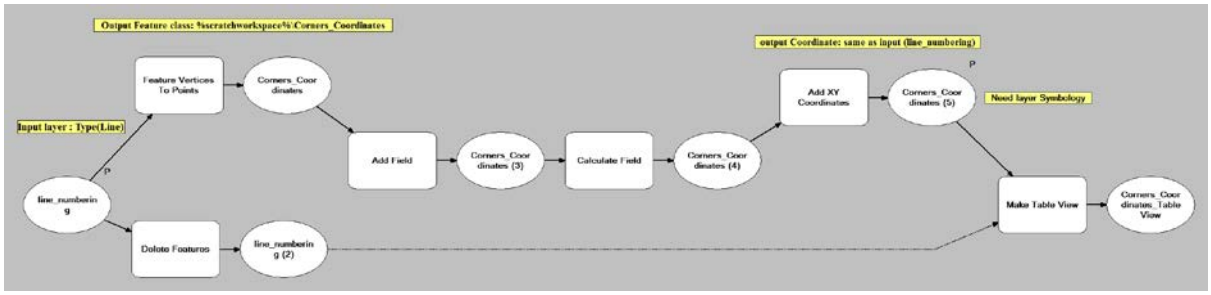

Corners_Numbering with Coordinates for layout print Tool in ModelBuilder