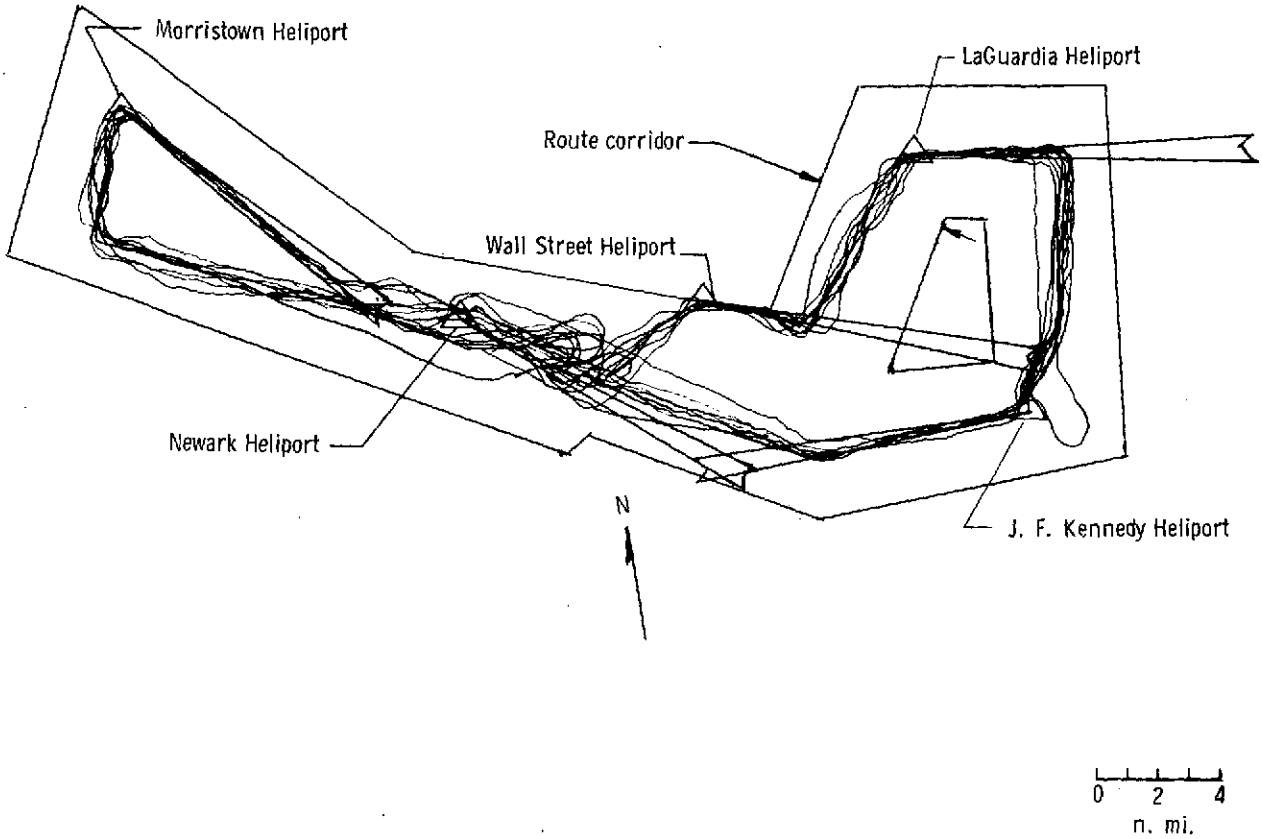

Figure 7.- Ground-track composite.

indicates the direction of the course center line, whereas the simulated MLS provided no information outside a $\pm 30^{\circ}$ angle from the center line. The pilots regarded this as an undesirable characteristic which, coupled with the fact that the course-deviation indicator was not driven out of view prior to interception of the localizer beam, sometimes resulted in a tendency to turn in the wrong direction.

Some of the intercept angles were considered to be too large, which resulted in overshoots during localizer capture; however, all the pilots were able to accomplish the task. Although a smaller angle would probably have increased precision, it would have tended to increase flight time because of the need to start the turn-on farther out.

Approach precision.- During the tests, 72 approaches were initiated, of which 3 were aborted. The aborted approaches would have resulted in the execution of missed-approach procedures under operation conditions, but such procedures were not defined for these tests. Two of the approaches were aborted because of excessive localizer error at or near the decision height, whereas the third was aborted because of excessive deviation from the nominal airspeed.

Plots showing localizer, glide-slope, and airspeed control achieved by each pilot are presented in figures 8, 9, and 10, respectively, for the six approaches involved in one