ROSEN
API 653 Internal Inspection Preliminary Report

ROSEN Project Number 0-1000-18486

TransMontaigne

TK 201
Port Everglades, FL (North)
Diameter: 117 ft.
Inspection Date: July 31, 2026
Inspector: J. Bell (Authorized Inspector, API 653 Cert. No. 32508)



This document is classified as confidential

ROSEN
empowered by technology

Client	TransMontaigne
ROSEN Project No.	0-1000-18486
ROSEN Tank Name	TK 201
Inspection Date	July 31, 2026
Report Date	August 4, 2026

ROSEN
empowered by technology
14120 Interdrive East
Houston, Texas 77032
USA
Phone +1-281-442-8282
Fax +1-281-442-8866
www.rosen-group.com

©ROSEN GROUP 2024
CONFIDENTIALITY AND COPYRIGHT

THIS REPORT (INCLUDING ANY ENCLOSURES, ATTACHMENTS AND DIGITAL DELIVERABLES) (THE "REPORT") IS OF A PRELIMINARY NATURE AND HAS BEEN PREPARED FOR THE EXCLUSIVE USE AND BENEFIT OF THE ADDRESSEE(S) AND SOLELY FOR THE PURPOSE FOR WHICH IT IS PROVIDED. NOTHING IN THIS REPORT SHOULD BE CONSIDERED A GUARANTEE OR WARRANTY OF THE CORRECTNESS OR COMPLETENESS OF DATA OR CONCLUSIONS CONTAINED HEREIN. UNLESS ROSEN PROVIDES EXPRESS PRIOR WRITTEN CONSENT, NO PART OF THIS REPORT SHOULD BE REPRODUCED, DISTRIBUTED OR OTHERWISE COMMUNICATED TO ANY THIRD PARTY. ROSEN DOES NOT ACCEPT ANY LIABILITY IF THIS REPORT IS USED FOR AN ALTERNATIVE PURPOSE FROM WHICH IT IS INTENDED, NOR SHALL ROSEN HAVE ANY LIABILITY TO ANY THIRD PARTY IN RESPECT OF THIS REPORT. ROSEN COLLECTS DATA USING VARIOUS PHYSICAL PRINCIPLES. ROSEN PROCESSES THIS DATA IN VARIOUS WAYS TO PRODUCE REPORTS THAT INCLUDE BUT ARE NOT LIMITED TO TEXT, IMAGES, TABLES, LISTINGS, AND GRAPHS. THE DATA PROCESSING ROSEN COMPLETES INCLUDES BUT IS NOT LIMITED TO INTEGRATION WITH OTHER DATA, DISTANCE ADAPTATION, NOISE FILTERING, INTERPOLATION, AND CALCULATIONS.

Prepared by: 
J. Bell (Authorized Inspector, API 653 Cert. No. 32508)

	Date	**Pages**	**Description**	**Prepared by**	

ROSEN
empowered by technology

Table of Contents

1	**| Recommendations and Monitoring**	**5**
2	**| Tank Details**	**7**
3	**| Summary of Assessment**	**8**
3.1	**Introduction**	**8**
3.2	**References Utilized**	**8**
3.2.1	Department of Transportation (DOT)	8
3.2.2	Non-DOT	9
3.3	**General**	**10**
3.3.1	Nameplate	10
3.3.2	Site and Dike Inspection	10
3.3.3	Tank Grounding	11
3.4	**Bottom**	**11**
3.4.1	Slope	11
3.4.2	Existing Bottom Patches	11
3.4.3	Bottom Sumps	12
3.4.4	Internal Piping	12
3.5	**Settlement**	**12**
3.5.1	Shell Settlement	12
3.5.2	Edge Settlement	12
3.6	**Shell**	**13**
3.6.1	Coating Survey	13
3.6.2	Shell Thickness Survey	13
3.6.3	Automatic Tape Gauge	13
3.6.4	Shell Inserts	14
3.6.5	Threaded Connections	14
3.6.6	Shell Appurtenances	15
3.6.7	Shell Manway	16
3.7	**Fixed Roof**	**16**
3.7.1	Fixed Roof Survey	16
3.7.2	Handrails and Stairway	17
3.7.3	Fixed Roof Support Structure	17
3.7.4	Fixed Roof Scaffold-Cable Support	18
3.7.5	Fixed Roof Appurtenances	18
3.7.6	Fixed Roof Venting	19
4	**| Bottom Assessment**	**20**
4.1	**Tank Bottom Condition**	**20**
4.1.1	Inspection Overview	20
4.1.2	Corrosion Survey	20
4.1.3	Repairs	20
4.2	**ROSOFT**	**21**
4.2.1	Floor Map (Bottom Layout)	21
4.2.2	Floor Map (Repair Threshold – 100%)	21

4.2.3 Feature Statistics from Repair Threshold 21
4.2.4 Feature List 21
4.2.5 Floor Map (Repair Recommendations) 21
4.2.6 List of Repair Patches/Plates 21
4.2.7 Repair Patch/Plate Summary 21
4.2.8 Plate Repair Printouts 21
4.3 Bottom Assessment with Coating (Rejection Limits) 22

5 | Settlement Assessment 23
5.1 Differential Settlement 23

6 | Shell Assessment 24
6.1 Liquid Load Condition 24
6.2 Shell Thickness Assessment (Minimum Allowable Shell Thickness) 26
6.3 Shell Thickness Measurements 27
6.4 Shell Appurtenances 28

7 | Fixed Roof Assessment 29
7.1 Fixed Roof Appurtenance 29

1 | Recommendations and Monitoring

1. Replace the bottom in kind with new 0.250-inch carbon steel bottom plates.

2. The tank coating should be monitored to determine when coating or spot coating may be deemed necessary.

3. Consideration should be given to installing an original nameplate with all appurtenant tank information mounted on a bracket on the tank shell or reinforcement plate above Manway A.

4. Consideration should be given to removing all dirt and debris from the lower 3-6 inches of the shell and regrade the areas around the tank to allow for water to drain away from the tank shell.

5. Consideration should be given to replacing the uninsulated cable with an insulated cable and installing three (3) additional grounding lugs attached to the external shell equipped with new insulated grounding cables and ground rods in sequential locations around the perimeter of the tank, per Client Policy.

6. Consideration should be given to installing a flanged connection point on the internal diffuser line at nozzle location T, per Client Policy.

7. Consideration should be given to sandblasting the shell and removing all old sealant from the rivets and seams. Additionally, new epoxy or polyurethane sealant should be installed to all shell plate seams and rivets and recoating applied to the external shell.

8. Consideration should be given to installing two (2) 2 inch welded nozzles with new welded pressure relief piping and connections near Nozzles F and G, per Client Policy.

9. Consideration should be given to replacing the 2 inch water draw nozzles at locations D and U with new 4 inch welded nozzles and appropriate reinforcement plates, per Client Policy.

10. Consideration should be given to replacing the threaded connections at shell nozzle locations E, F, G, and H with new welded connections, per Client Policy.

11. Consideration should be given to removing the plug from the telltale hole in the reinforcement plate at shell nozzle location F.

12. Recommend repairing or replacing the valve at shell nozzle location F.

13. Recommend replacing the 20 inch shell manway at nozzle location L with a new 30 inch manway and appropriate reinforcement plate, per Client Repair Scope of Work.

14. Consideration should be given to removing the vertical ladder and installing a new spiral stairway that will allow for better access to the fixed roof deck.

15. Consideration should be given to removing the residual product from the fixed roof gauge hatch cover to allow for the cover to opened freely.

Recommendations and Monitoring, contd.

16. Consideration should be given to replacing the screens on all three (3) fixed roof vents.

2 | Tank Details

The following is a brief summary of the tank details. Other parameters are included in this document where relevant.

General			
Tank Number		201	
Tank Type		FR	*Fixed Roof*
Design Standard		API 12C	*Per Previous Report*
Construction Date	[year]	1933	
Manufacturer		Unknown	
Original Nameplate Present	[y/n]	No	
Repair/Alteration Nameplate Present	[y/n]	No	
DOT Regulated	[y/n]	No	
As-built Drawing Available	[y/n]	No	
Dimensions			
Diameter	[ft]	117.00	
Height	[ft]	41.25	
Maximum Filling Height	[ft]	36.60	*Calculated*
Maximum Filling Height for Hydrotest	[ft]	34.47	*Calculated*
Capacity	[bbl]	78,989	*Calculated*
Fixed Roof			
Roof Type		Cone	
Material Type		Unknown Carbon Steel	
Weld Type		Lap	
Internal Coating	[y/n]	No	
Shell			
Primary Material		Unknown Carbon Steel	
Secondary Material		Unknown Carbon Steel	
Weld Type		Riveted	
Internal Coating	[y/n]	No	
Shell Stiffener Installed	[y/n]	No	
Bottom			
Installed Date	[year]	1933	
Nominal Thickness Bottom	[in]	0.250	
Nominal Thickness Sketch	[in]	0.250	
Weld Type		Riveted	
Internal Coating	[y/n]	Yes	
Foundation			
Type		Earthen	
Leak Detection Present	[y/n]	No	
Operational			
Product Stored		#6 Oil	
Gravity of Product	[-]	0.88	*Per Previous Report*
Storage Temperature	[°F]	<200	

3 | Summary of Assessment

3.1 Introduction

The condition of TK 201 for TransMontaigne in Port Everglades, FL (North) has been inspected by the Survey Engineer(s) by means of a Detailed Visual Inspection (DVI) in combination with necessary NDT equipment. This DVI includes inspection of the tank exterior and interior in accordance with API Standard 653. Any evidence of leaks; shell distortions; signs of settlement; corrosion; condition of the foundation; coatings and appurtenances have been documented for follow-up action by an authorized API 653 Inspector. The survey was concluded on July 31, 2026. This section provides a summary of the inspection findings. Details of the findings are included in this document where relevant.

This inspection report should be read in conjunction with API Standard 653, particularly if the reader is not familiar with this Standard and the terms used in it, as some terms are particular to the Standard. We have exercised and applied API Standard 653 in good faith and have provided/presented all details in accordance with this Standard. However, evaluation for structural integrity of areas that do not meet the Standard is often case-by-case and depends on the available information. For information not available or provided, assumptions have been made on basis of best experiences within our company. When necessary, our engineers will recognize and report whether a storage tank engineer's judgment is required. Consequently, we are receptive to any request to reprocess the tank data in accordance with the differing interpretations of the API Standard 653.

3.2 References Utilized

3.2.1 Department of Transportation (DOT)

The listed editions of the following standards were utilized during the inspection:

[1] API Std. 650, *"Welded Tanks for Oil Storage"* 14th edition, August 2025.

[2] API RP 652, *"Lining of Aboveground Petroleum Storage Tank Bottoms"* 5th edition, May 2020.

[3] API Std. 653, *"Tank Inspection, Repair, Alteration, and Reconstruction"* 3rd edition, December 2001 (including Addendum 1 (September 2003), Addendum 2 (November 2005), Addendum 3 February 2008), Errata (April 2008).

3.2.2 Non-DOT

The most recent editions of the following standards were used during the inspection:

[1] API RP 575, *"Inspection of Atmospheric and Low-Pressure Storage Tanks"*
[2] API Std. 650, *"Welded Steel Tanks for Oil Storage"*
[3] API RP 652, *"Lining of Aboveground Petroleum Storage Tank Bottoms"*
[4] API Std. 653, *"Tank Inspection, Repair, Alteration and Reconstruction"*
[5] API RP 2015, *"Safe Entry and Cleaning of Petroleum Storage Tanks"*
[6] API RP 2000, *"Venting Atmospheric and Low-Pressure Storage Tanks"*
[7] DT-G-MFL-001P, *"NDT Procedure, Magnetic Flux Leakage Inspection of Ferromagnetic Tank Bottom And Annular Plates Using Rosen's Tank Bottom Inspection Tool (TBIT Ultra)"*
[8] UT-01, *ROSEN Procedure, "Procedure for wall thickness measurements of steel plates by Ultrasound Testing"*
[9] MT-01, *ROSEN Procedure, "Procedure for Magnetic Particle Examination"*
[10] PT-01, *ROSEN Procedure, "Procedure for Liquid Penetrant Examination"*
[11] API-01, *ROSEN Procedure, "Procedure for the off-stream inspection of vertical above ground storage tanks in accordance with API Standard 653 requirements"*

3.3 General

3.3.1 Nameplate

Visual inspection revealed a nameplate was not attached to the storage tank over Manway A. Consideration should be given to installing an original nameplate with all appurtenant tank information mounted on a bracket on the tank shell or reinforcement plate above Manway A.






3.3.2 Site and Dike Inspection

No severe issues were noted with the tank site and dike wall while performing a visual inspection. The grade surrounding the tank was covering the shell 3-6 inches on approximately 50% of the tank. The areas around the tank should be regraded to allow for water to flow away from the tank shell.



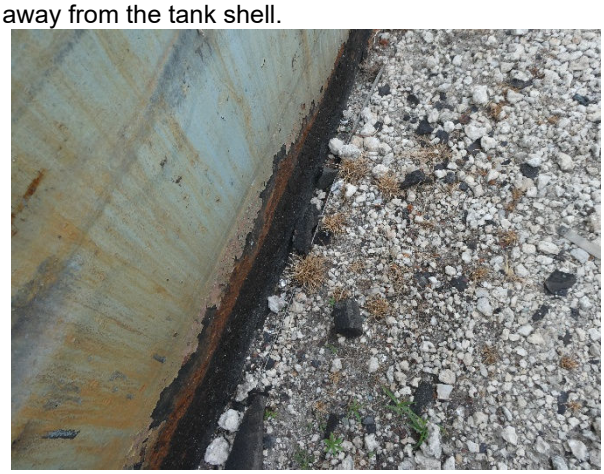

3.3.3 Tank Grounding

A visual assessment of the tank grounding system was performed. The tank shell was grounded in one (1) location through an uninsulated cable secured to the external shell. The grounding strap was located at station 189.2 (measured in feet counterclockwise from Manway A) and exceeds the maximum 100-foot spacing (per API 650). Consideration should be given to replacing the uninsulated cable with an insulated cable and installing three (3) additional grounding lugs attached to the external shell equipped with new insulated grounding cables and ground rods in sequential locations around the perimeter of the tank, per Client Policy.



3.4 Bottom

3.4.1 Slope

The Inspector recorded measurements on the tank bottom interior to identify if the bottom was a cone up or cone down configuration. The Inspector noted the tank had a cone down bottom with a difference in elevation of 6 inches from the shell to the center of the tank bottom.

3.4.2 Existing Bottom Patches

Visual inspection was performed on the existing bottom patches. At the time of the inspection 91 bottom patches were installed.





3.4.3 Bottom Sumps

The ultrasonic thickness measurements performed on the two (2) bottom sumps did not reveal any external corrosion. Visual inspection of the bottom sumps revealed no significant corrosion or pitting present.





3.4.4 Internal Piping

Ultrasonic thickness measurements were recorded and visual inspection was performed on the internal piping. Inspector noted no significant pitting present. The Inspector also noted the diffuser did not have a flange connection installed after the shell penetration, as required by the client. Consideration should be given to installing a flanged connection.





3.5 Settlement

3.5.1 Shell Settlement

Laser survey measurements were recorded at twelve (12) locations spaced equally around the tank circumference. The calculated allowable critical deflection was 1.56 inches and the measurements recorded were within the permissible limits set forth in *API Standard 653, Appendix B*.

3.5.2 Edge Settlement

An evaluation of edge settlement was not performed due to the configuration of the existing riveted bottom. There were no visual signs of edge settlement present.

3.6 Shell

3.6.1 Coating Survey

Tank shell coating visual survey revealed coating failure present on the entire external shell. The tank should be cleaned and recoating and all shell seams and rivets should have an epoxy or polyurethane sealant installed prior to coating.





3.6.2 Shell Thickness Survey

Shell ultrasonic thickness measurements were recorded on all seven (7) shell courses. The recorded measurements were utilized to calculate minimum required thicknesses and maximum filling height in accordance with *API Standard 653, Section 4.3.3*.

3.6.3 Automatic Tape Gauge

Visual inspection was performed on the automatic tape gauge head and tape guide. Inspector noted no areas of concern with the tank gauge or associated components.





3.6.4 Shell Inserts

Ultrasonic thickness measurements recorded on shell inserts did not reveal any general thinning of shell inserts. A visual inspection of the shell inserts did not reveal any notable issues at the time of the inspection.





3.6.5 Threaded Connections

Visual inspection of the shell appurtenances revealed thermo-relief lines were threaded and attached to the nozzle necks of shell Nozzles F and G. Inspector also noted product staining present on the line connections. Consideration should be given to installing new 2 inch nozzles equipped with new welded pressure relief lines and connections near these locations.





3.6.6 Shell Appurtenances

Ultrasonic thickness measurements were performed on the appurtenance necks, flanges, and reinforcement plates. Recorded measurements revealed insufficient wall thicknesses on the necks of Nozzles B, E, N, O, P, Q, R, S, T, U, V, W, X, Y, and Z as specified by *API Standard 650 Tables 5-6b and 5-4b.* This information is provided for client knowledge only and no repairs are recommended. A visual inspection revealed Nozzles E, F, G, and H were threaded connections. Inspector noted Nozzles E and G were not welded to the internal shell. Per Client Policy, Inspector recommends threaded connections be replaced with welded fittings. Additionally, the water draw off Nozzles D and U were 2 inches in diameter. The Inspector recommends the 2 inch water draw off nozzles be replaced with 4 inch nozzles and appropriate reinforcement plates fitted with Oceco non-freeze water draw valves, per Client Policy. Inspector also noted product staining from the valve at nozzle location F. Recommend repairing the valve at Nozzle F.









3.6.7 Shell Manway

Inspector noted that Manway L was a 20 inch riveted manway and does not meet current code requirements, per API 650. Consideration should be given to replacing the manway with a new 30 inch manway and appropriate reinforcing plate, per Client Policy. There were no vertical welds or existing nozzles that would limit the installation of the new manway. The manway has a 28 inch centerline.





3.7 Fixed Roof

3.7.1 Fixed Roof Survey

An ultrasonic thickness survey was performed on the fixed roof deck plates. There was no notable metal loss recorded. Visual inspection revealed minor coating failure present. The coating should be monitored and new coating applied when deemed necessary.





3.7.2 Handrails and Stairway


A visual inspection was performed on the vertical ladder system. Inspector noted coating failure with corrosion and metal loss present on the ladder supports, treads, and handrails. The stairway handrail measured 28 inches high, which does not meet current OSHA standards. Further visual inspection revealed the handrail installed on the fixed roof covered approximately 10% of the perimeter. The width of the stairs was 26 inches wide, which does not meet future OSHA standards. Consideration should be given to removing the vertical ladder and installing a new spiral stairway that will allow for better access to the fixed roof deck.





3.7.3 Fixed Roof Support Structure

Ultrasonic thickness measurements were recorded on the fixed roof API column (two structural channels stitch welded together). No significant metal loss was recorded. A visual inspection performed from the ground level did not reveal any irregularities such as deformation, missing, loose, or severely corroded support components. The Inspector noted a total of 19 columns installed at the time of the inspection.

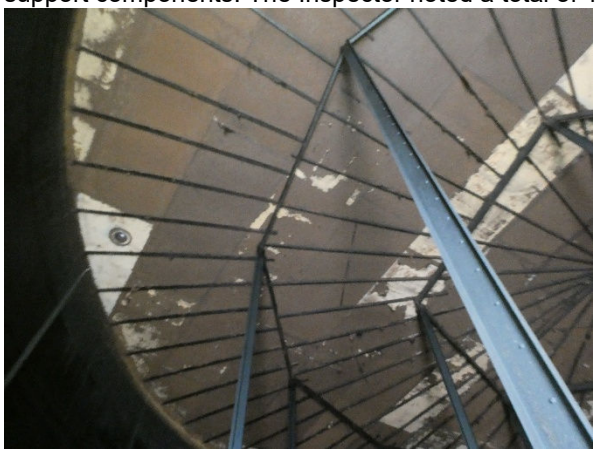



3.7.4 Fixed Roof Scaffold-Cable Support

Visual inspection revealed a fixed roof scaffold-cable support was installed on the fixed roof.



3.7.5 Fixed Roof Appurtenances

Ultrasonic thickness measurements were performed on the appurtenance necks, flanges, and reinforcement plates. No significant metal loss was recorded. A visual inspection revealed minor coating failure present. The coating should be monitored and new coating applied when deemed necessary. Inspector also noted residual product buildup present on the gauge hatch cover which is causing the cover to stick and not able to be opened. Consideration should be given to removing the residual product from the gauge hatch cover.





3.7.6 Fixed Roof Venting

A visual inspection was performed on the venting system installed on the fixed roof. Inspector noted two (2) free vents and one (1) gooseneck vent installed on the fixed roof. The vent nozzles and covers showed signs of coating failure. The coating should be monitored and new coating applied when deemed necessary. The gooseneck vent had no screen present and the two (2) free vents had damaged screens. Consideration should be given to replacing the screens on all three (3) roof vents.





4 | Bottom Assessment

4.1 Tank Bottom Condition

The tank bottom was cleaned prior to the inspection. The tank was sufficiently clean enough for the bottom survey. Please note that the presence of scale could have a negative effect on the survey results. There were no hazardous vapors or gases inside, which was established by daily gas tests.

The pre inspection activities consisted of a visual inspection, numbering the bottom plates for reference purposes, and preparing the tank floor drawing. Corrosion mapping of the bottom floor was carried out by means of ROSEN's Tank Bottom Inspection Tool (TBIT-ULTRA) in accordance with procedure DT-G-MFL-001P. Detailed information regarding preparation, system set-up, calibration, signals analysis and reporting can be found herein.

In case an increased level of confidence was required or in case of difficult accessible areas (including so called blind zones), the Survey Engineer has used an additional inspection methodology with similar or improved local detection and sizing capability compared to the TBIT. These additional inspection techniques may include caliper and depth-gauge measurements, ultrasonic inspection (UT), eddy current testing (ECT) and detailed visual inspection (DVI). The determination of which follow-up technique has been used by the Survey Engineer depends on many parameters including type, location and extent of the defect detected. No exclusive guidance can be given here. However, all anomalies found with the additional and/or follow-up techniques were manually reported into the provided ROSEN Software (ROSOFT).

4.1.1 Inspection Overview

The inspected area contained 110 bottom plates. The recorded data was complete and of acceptable quality and could be evaluated without major restrictions.

Areas not covered by the Tank Bottom Inspection Tool (blind zones), were visually and/or spot UT checked. Features with an online evaluated depth of more than 20%t were reported (wherein t as the actual plate thickness).

Initially, features with an online evaluated depth of more than 49%t were marked on the bottom plates inside the tank.

NOTE: The ROSEN Inspection Engineers are well-trained experienced inspectors and are familiar with API Standard 653. They are performing their inspection surveys with the utmost knowledge, attention and accuracy. Although our equipment proved very high accuracy during operation, ROSEN maintains a confidence level of 85%.

ROSEN cannot be held responsible for any damages during or after the inspection. The client should consider our report as a recommendation for maintenance of the inspected tanks. The client is responsible for repair threshold and executed repairs on the tank bottom plates.

4.1.2 Corrosion Survey

The inspected area of the tank bottom contained 5,077 anomalies with a metal loss over the repair threshold of 49%. Anticipated repair patches were laid out by the Inspector in order to best cover the features in a manner according to API Standard 653.

4.1.3 Repairs

All repairs to the tank bottom should be made in accordance with API Standard 653 guidelines *(API Standard 653, Section 9.10).* Following the installation of repair patches, proper NDT methods should be performed for post repair inspections.

4.2 ROSOFT

4.2.1 Floor Map (Bottom Layout)

A bottom layout with the orientation of the coordination system of each plate is attached hereafter.

4.2.2 Floor Map (Repair Threshold – 100%)

The floor map view of indication recorded during the bottom MFL inspection is attached hereafter. Other indications above the marking (repair) threshold are given. Thresholds vary from tank to tank and also depend on remaining life calculation (i.e., 10 yr. or 20 yr.)

4.2.3 Feature Statistics from Repair Threshold

A statistical view (bar graph) of indication recorded from repair threshold is attached hereafter.

4.2.4 Feature List

A list of indications recorded from repair threshold is attached hereafter.

4.2.5 Floor Map (Repair Recommendations)

A floor map view with all repair patch recommendations is attached hereafter. Some indications may not be covered by patch repair(s) since another repair method will be used (i.e., weld overlays or applying an internal coating). These types of repair methods are only applicable to topside indications.

4.2.6 List of Repair Patches/Plates

A list detailing specific information on every patch repair including plate location, dimension, type, and X & Y coordinates is attached hereafter.

4.2.7 Repair Patch/Plate Summary

An overall list of repair patches needed and grouped by patch size is attached hereafter.


4.2.8 Plate Repair Printouts

Dependent on repairs, a batch print of individual page plate views will be provided. Each individual page printout will demonstrate the amount of patch repairs recommended and will also provide a coordinate measurement per repair.

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Floor Map (Bottom Layout)


plate coordinate systems definition
(single arrows mark Y directions on small plates)

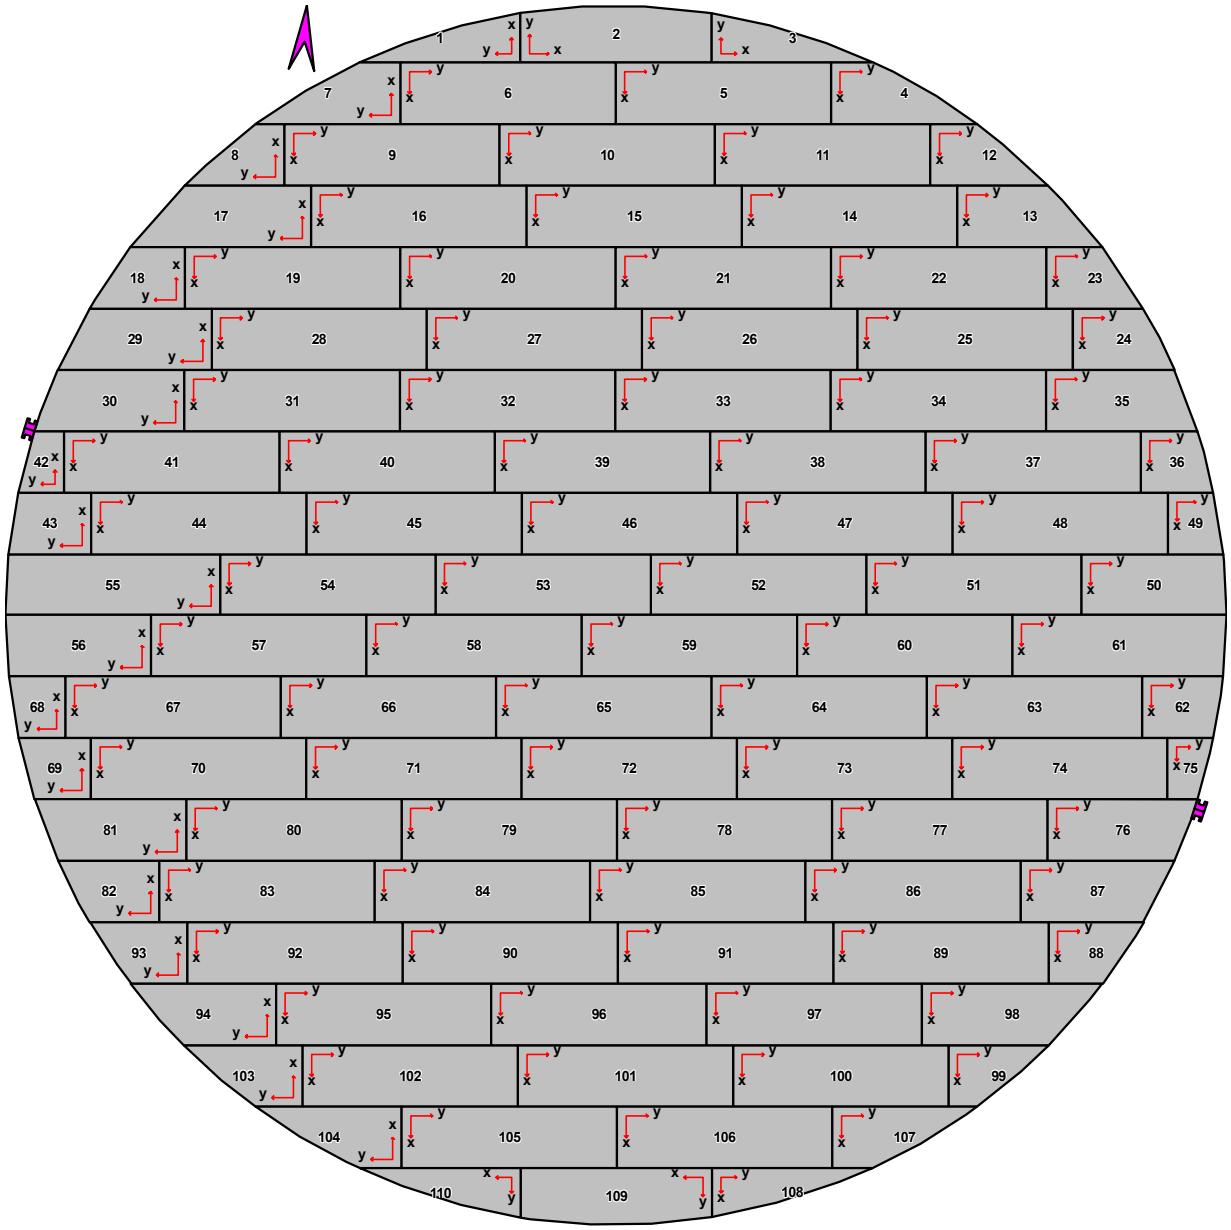

White Border: Inspection Side Features	0
Black Border: Non Inspection Side Features	0

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Floor Map (Repair Threshold - 100%)

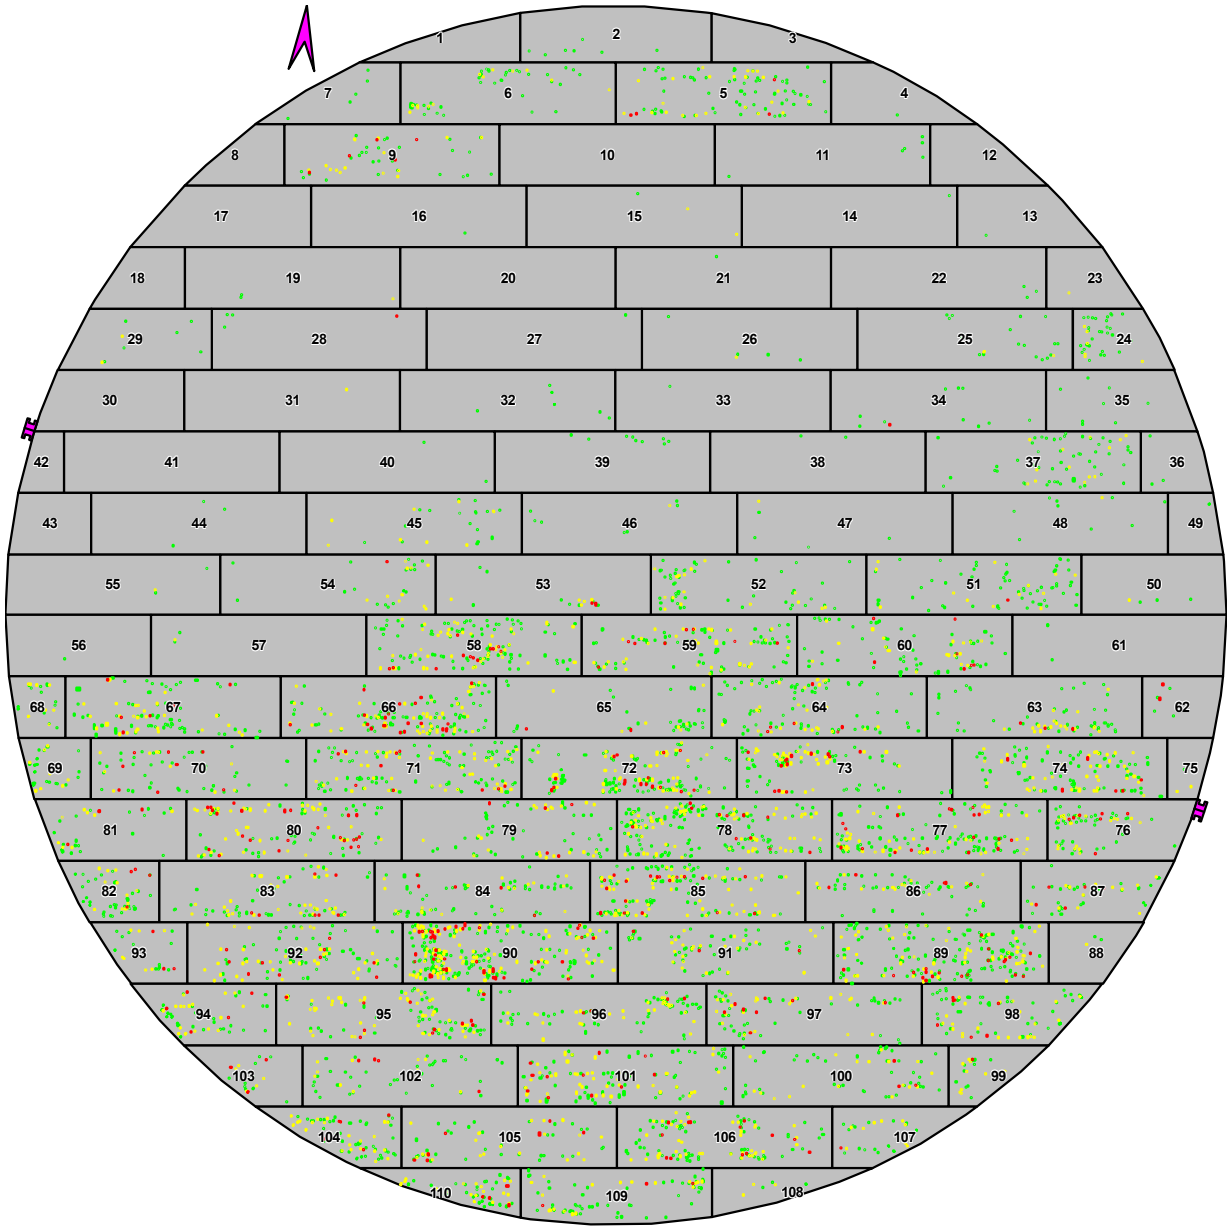

Classification

Feature


0	20 %
3145	40 %
1515	60 %
417	80 %
	100%

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature Statistics from Repair Threshold

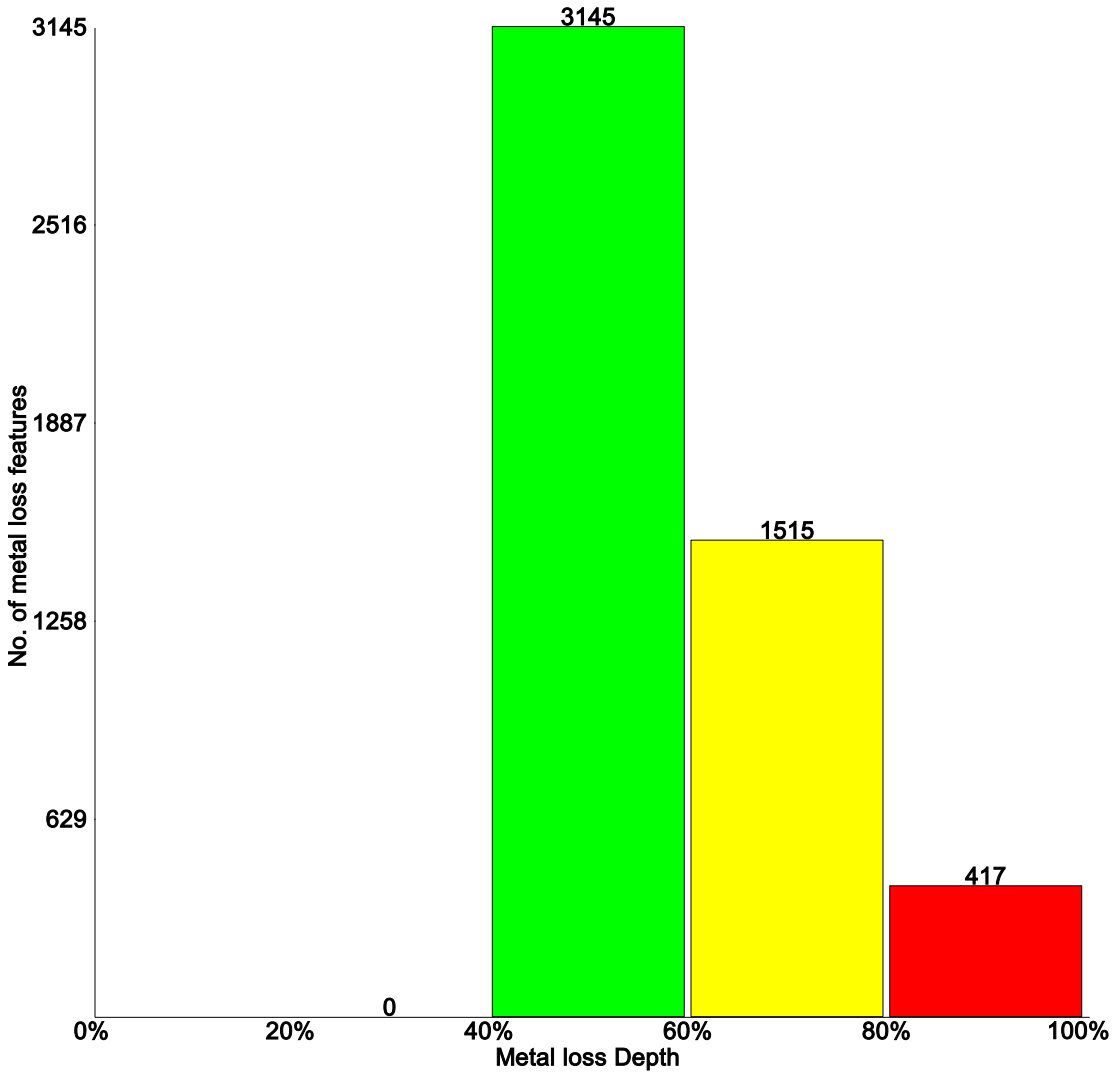

Feature Filter Settings

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.

All Plates ; All Feature Types ; All Methods

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1	2	9.84	13.58	0.60	0.34	52	Metal Loss	TBit	SK	Inspection Side
2	2	61.10	13.82	0.98	0.57	52	Metal Loss	TBit	SK	Inspection Side
3	2	93.11	12.20	0.44	0.47	54	Metal Loss	TBit	SK	Inspection Side
4	2	156.14	14.25	0.54	0.40	56	Metal Loss	TBit	SK	Inspection Side
5	2	51.34	14.41	0.45	0.43	57	Metal Loss	TBit	SK	Inspection Side
6	2	28.31	9.29	0.60	0.39	57	Metal Loss	TBit	SK	Inspection Side
7	2	71.02	26.69	0.73	0.38	58	Metal Loss	TBit	SK	Inspection Side
8	4	59.76	75.71	0.56	0.37	55	Metal Loss	TBit	SK	Inspection Side
9	5	35.83	181.81	0.79	0.79	49	Metal Loss	Visual	SK	Inspection Side
10	5	34.69	182.05	0.79	0.79	50	Metal Loss	Visual	SK	Inspection Side
11	5	21.73	238.70	0.26	0.47	49	Metal Loss	TBit	SK	Non Inspection Side
12	5	8.82	135.51	0.46	0.48	49	Metal Loss	TBit	SK	Inspection Side
13	5	34.96	205.28	0.50	0.40	49	Metal Loss	TBit	SK	Inspection Side
14	5	55.43	42.13	0.52	0.36	49	Metal Loss	TBit	SK	Inspection Side
15	5	47.60	203.74	0.78	0.64	49	Metal Loss	TBit	SK	Inspection Side
16	5	16.61	85.63	0.79	0.27	49	Metal Loss	TBit	SK	Inspection Side
17	5	4.96	219.57	1.03	0.59	49	Metal Loss	TBit	SK	Inspection Side
18	5	44.76	138.43	1.12	0.48	49	Metal Loss	TBit	SK	Inspection Side
19	5	15.83	78.58	1.14	0.34	49	Metal Loss	TBit	SK	Inspection Side
20	5	59.17	143.27	1.18	0.52	49	Metal Loss	TBit	SK	Inspection Side
21	5	52.13	111.38	1.19	0.77	49	Metal Loss	TBit	SK	Inspection Side
22	5	32.36	55.16	1.22	0.23	49	Metal Loss	TBit	SK	Inspection Side
23	5	9.06	46.06	0.26	0.23	50	Metal Loss	TBit	SK	Inspection Side
24	5	47.80	223.11	0.36	0.22	50	Metal Loss	TBit	SK	Inspection Side
25	5	57.87	162.76	0.52	0.38	50	Metal Loss	TBit	SK	Inspection Side
26	5	60.20	193.54	0.53	0.14	50	Metal Loss	TBit	SK	Inspection Side
27	5	42.36	195.79	0.56	0.39	50	Metal Loss	TBit	SK	Inspection Side
28	5	53.23	45.83	0.59	0.32	50	Metal Loss	TBit	SK	Inspection Side
29	5	18.23	53.15	0.69	0.27	50	Metal Loss	TBit	SK	Inspection Side
30	5	32.32	194.02	0.69	0.24	50	Metal Loss	TBit	SK	Inspection Side
31	5	47.91	158.11	0.75	0.38	50	Metal Loss	TBit	SK	Inspection Side
32	5	58.15	45.00	1.16	0.50	50	Metal Loss	TBit	SK	Inspection Side
33	5	47.91	142.01	1.36	0.77	50	Metal Loss	TBit	SK	Inspection Side
34	5	36.02	147.52	0.33	0.40	51	Metal Loss	TBit	SK	Inspection Side
35	5	38.35	219.21	0.37	0.32	51	Metal Loss	TBit	SK	Inspection Side
36	5	17.40	56.38	0.72	0.39	51	Metal Loss	TBit	SK	Inspection Side
37	5	33.35	160.12	0.79	0.35	51	Metal Loss	TBit	SK	Inspection Side
38	5	60.24	90.83	0.92	0.28	51	Metal Loss	TBit	SK	Inspection Side
39	5	17.40	162.72	1.05	0.48	51	Metal Loss	TBit	SK	Inspection Side
40	5	36.65	211.77	1.29	0.76	51	Metal Loss	TBit	SK	Inspection Side
41	5	60.51	187.76	1.40	0.72	51	Metal Loss	TBit	SK	Inspection Side
42	5	51.54	149.13	0.16	0.28	52	Metal Loss	TBit	SK	Inspection Side
43	5	20.79	160.83	0.45	0.36	52	Metal Loss	TBit	SK	Inspection Side
44	5	23.23	147.05	0.66	0.51	52	Metal Loss	TBit	SK	Inspection Side
45	5	32.64	203.15	0.72	0.52	52	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
46	5	32.32	142.91	0.97	0.22	52	Metal Loss	TBit	SK	Inspection Side
47	5	32.48	144.37	1.02	0.30	52	Metal Loss	TBit	SK	Inspection Side
48	5	46.46	190.51	1.33	0.53	52	Metal Loss	TBit	SK	Inspection Side
49	5	7.64	136.73	0.45	0.31	53	Metal Loss	TBit	SK	Inspection Side
50	5	9.17	157.17	0.47	0.49	53	Metal Loss	TBit	SK	Inspection Side
51	5	22.91	195.87	0.51	0.41	53	Metal Loss	TBit	SK	Inspection Side
52	5	7.36	54.25	0.58	0.46	53	Metal Loss	TBit	SK	Inspection Side
53	5	54.92	52.05	0.69	0.47	53	Metal Loss	TBit	SK	Inspection Side
54	5	7.48	32.99	0.78	0.48	53	Metal Loss	TBit	SK	Inspection Side
55	5	17.09	103.43	0.91	0.24	53	Metal Loss	TBit	SK	Inspection Side
56	5	21.30	130.20	1.13	0.31	53	Metal Loss	TBit	SK	Inspection Side
57	5	19.80	196.02	0.68	0.42	54	Metal Loss	TBit	SK	Inspection Side
58	5	47.24	220.98	0.89	0.38	54	Metal Loss	TBit	SK	Inspection Side
59	5	53.27	32.40	0.97	0.44	54	Metal Loss	TBit	SK	Inspection Side
60	5	56.14	52.80	1.01	0.45	54	Metal Loss	TBit	SK	Inspection Side
61	5	17.20	88.23	1.04	0.23	54	Metal Loss	TBit	SK	Inspection Side
62	5	61.22	78.35	1.11	0.30	54	Metal Loss	TBit	SK	Inspection Side
63	5	21.38	190.94	0.32	0.32	56	Metal Loss	TBit	SK	Inspection Side
64	5	56.02	240.39	0.44	0.32	56	Metal Loss	TBit	SK	Inspection Side
65	5	20.16	164.84	0.55	0.59	56	Metal Loss	TBit	SK	Inspection Side
66	5	34.57	106.61	0.60	0.36	56	Metal Loss	TBit	SK	Inspection Side
67	5	6.57	135.94	1.03	0.40	56	Metal Loss	TBit	SK	Inspection Side
68	5	52.60	171.42	1.39	0.69	56	Metal Loss	TBit	SK	Inspection Side
69	5	7.24	94.61	1.54	0.41	56	Metal Loss	TBit	SK	Inspection Side
70	5	57.01	113.70	0.67	0.31	58	Metal Loss	TBit	SK	Inspection Side
71	5	16.54	150.55	0.71	0.32	58	Metal Loss	TBit	SK	Inspection Side
72	5	19.61	90.08	0.88	0.40	58	Metal Loss	TBit	SK	Inspection Side
73	5	5.55	48.78	0.73	0.47	59	Metal Loss	TBit	SK	Inspection Side
74	5	61.10	182.24	0.76	0.24	59	Metal Loss	TBit	SK	Inspection Side
75	5	19.25	136.14	0.95	0.53	59	Metal Loss	TBit	SK	Inspection Side
76	5	15.83	183.07	1.15	0.49	59	Metal Loss	TBit	SK	Inspection Side
77	5	57.83	103.11	0.83	0.37	60	Metal Loss	TBit	SK	Inspection Side
78	5	9.53	157.09	0.92	0.53	60	Metal Loss	TBit	SK	Inspection Side
79	5	60.04	76.73	1.07	0.42	60	Metal Loss	TBit	SK	Inspection Side
80	5	46.26	54.13	0.60	0.43	61	Metal Loss	TBit	SK	Inspection Side
81	5	45.00	178.74	0.96	0.31	62	Metal Loss	TBit	SK	Inspection Side
82	5	57.20	191.61	1.04	0.39	62	Metal Loss	TBit	SK	Inspection Side
83	5	32.32	185.87	1.11	0.31	62	Metal Loss	TBit	SK	Inspection Side
84	5	15.98	148.43	1.42	0.59	62	Metal Loss	TBit	SK	Inspection Side
85	5	5.51	99.80	0.72	0.35	63	Metal Loss	TBit	SK	Inspection Side
86	5	9.06	151.34	0.93	0.37	63	Metal Loss	TBit	SK	Inspection Side
87	5	56.54	57.83	0.83	0.38	64	Metal Loss	TBit	SK	Inspection Side
88	5	9.61	162.17	0.91	0.51	65	Metal Loss	TBit	SK	Inspection Side
89	5	18.11	65.55	1.28	0.39	65	Metal Loss	TBit	SK	Inspection Side
90	5	60.24	92.24	0.98	0.35	67	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
91	5	44.57	221.10	0.99	0.49	67	Metal Loss	TBit	SK	Inspection Side
92	5	16.02	107.76	1.11	0.35	68	Metal Loss	TBit	SK	Inspection Side
93	5	16.61	148.90	0.76	0.42	69	Metal Loss	TBit	SK	Inspection Side
94	5	58.27	163.39	0.76	0.30	69	Metal Loss	TBit	SK	Inspection Side
95	5	56.93	41.46	0.87	0.35	69	Metal Loss	TBit	SK	Inspection Side
96	5	50.94	148.15	0.93	0.65	69	Metal Loss	TBit	SK	Inspection Side
97	5	20.39	25.98	0.68	0.40	71	Metal Loss	TBit	SK	Inspection Side
98	5	15.91	135.47	1.31	0.30	73	Metal Loss	TBit	SK	Inspection Side
99	5	16.61	168.98	0.84	0.93	75	Metal Loss	TBit	SK	Inspection Side
100	5	57.83	9.57	0.75	0.39	76	Metal Loss	TBit	SK	Inspection Side
101	5	58.74	175.67	1.03	0.43	81	Metal Loss	TBit	SK	Inspection Side
102	5	58.23	23.86	1.16	0.64	84	Metal Loss	TBit	SK	Inspection Side
103	5	59.92	17.48	1.29	1.09	84	Metal Loss	TBit	SK	Inspection Side
104	5	19.41	181.50	0.86	0.62	88	Metal Loss	TBit	SK	Inspection Side
105	6	12.91	92.17	0.48	0.43	49	Metal Loss	TBit	SK	Inspection Side
106	6	59.92	49.61	0.59	0.43	49	Metal Loss	TBit	SK	Inspection Side
107	6	47.52	15.12	0.75	0.44	49	Metal Loss	TBit	SK	Inspection Side
108	6	21.26	173.27	1.11	0.49	49	Metal Loss	TBit	SK	Inspection Side
109	6	50.39	46.57	1.34	0.66	49	Metal Loss	TBit	SK	Inspection Side
110	6	50.59	11.85	2.22	0.51	49	Metal Loss	TBit	SK	Inspection Side
111	6	8.70	125.28	0.47	0.28	50	Metal Loss	TBit	SK	Inspection Side
112	6	48.70	26.93	0.57	0.40	50	Metal Loss	TBit	SK	Inspection Side
113	6	13.39	92.48	0.68	0.35	50	Metal Loss	TBit	SK	Inspection Side
114	6	20.00	116.02	0.75	0.37	50	Metal Loss	TBit	SK	Inspection Side
115	6	51.77	13.31	0.96	0.45	50	Metal Loss	TBit	SK	Inspection Side
116	6	57.72	42.09	0.21	0.32	51	Metal Loss	TBit	SK	Inspection Side
117	6	56.54	150.71	0.46	0.34	51	Metal Loss	TBit	SK	Inspection Side
118	6	14.45	92.09	0.51	0.40	51	Metal Loss	TBit	SK	Inspection Side
119	6	13.27	146.73	0.54	0.50	51	Metal Loss	TBit	SK	Inspection Side
120	6	8.07	198.11	0.62	0.51	51	Metal Loss	TBit	SK	Inspection Side
121	6	24.76	183.15	0.97	0.33	51	Metal Loss	TBit	SK	Inspection Side
122	6	48.31	11.61	0.43	0.42	52	Metal Loss	TBit	SK	Inspection Side
123	6	8.62	133.27	0.46	0.39	52	Metal Loss	TBit	SK	Inspection Side
124	6	17.13	89.96	0.51	0.45	52	Metal Loss	TBit	SK	Inspection Side
125	6	22.52	91.81	0.52	0.40	52	Metal Loss	TBit	SK	Inspection Side
126	6	37.72	139.76	0.55	0.46	52	Metal Loss	TBit	SK	Inspection Side
127	6	13.43	205.35	0.56	0.53	52	Metal Loss	TBit	SK	Inspection Side
128	6	10.35	136.30	0.63	0.44	52	Metal Loss	TBit	SK	Inspection Side
129	6	46.61	12.24	1.69	0.51	52	Metal Loss	TBit	SK	Inspection Side
130	6	10.87	121.30	0.33	0.29	53	Metal Loss	TBit	SK	Inspection Side
131	6	7.13	98.66	0.43	0.41	53	Metal Loss	TBit	SK	Inspection Side
132	6	5.67	189.45	0.82	0.40	53	Metal Loss	TBit	SK	Inspection Side
133	6	19.88	115.28	0.56	0.39	54	Metal Loss	TBit	SK	Inspection Side
134	6	46.06	35.00	0.59	0.34	54	Metal Loss	TBit	SK	Inspection Side
135	6	56.18	178.11	0.66	0.37	54	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
136	6	59.13	27.44	0.12	0.32	55	Metal Loss	TBit	SK	Inspection Side
137	6	13.62	168.50	0.84	0.39	55	Metal Loss	TBit	SK	Inspection Side
138	6	7.95	100.98	0.85	0.54	55	Metal Loss	TBit	SK	Inspection Side
139	6	23.27	107.99	0.49	0.31	56	Metal Loss	TBit	SK	Inspection Side
140	6	13.82	120.24	0.52	0.41	56	Metal Loss	TBit	SK	Inspection Side
141	6	48.43	18.62	0.79	0.44	56	Metal Loss	TBit	SK	Inspection Side
142	6	52.01	32.24	1.08	0.47	56	Metal Loss	TBit	SK	Inspection Side
143	6	9.65	92.83	0.55	0.30	57	Metal Loss	TBit	SK	Inspection Side
144	6	55.83	178.07	0.63	0.34	57	Metal Loss	TBit	SK	Inspection Side
145	6	9.45	101.38	0.64	0.51	57	Metal Loss	TBit	SK	Inspection Side
146	6	19.76	173.03	0.86	0.52	60	Metal Loss	TBit	SK	Inspection Side
147	6	8.03	105.67	0.44	0.33	61	Metal Loss	TBit	SK	Inspection Side
148	6	47.52	37.52	0.62	0.36	61	Metal Loss	TBit	SK	Inspection Side
149	6	49.92	32.36	0.78	0.39	61	Metal Loss	TBit	SK	Inspection Side
150	6	56.57	10.98	0.92	0.40	62	Metal Loss	TBit	SK	Inspection Side
151	6	16.14	94.65	0.56	0.43	63	Metal Loss	TBit	SK	Inspection Side
152	6	51.73	19.96	0.61	0.40	63	Metal Loss	TBit	SK	Inspection Side
153	6	30.91	239.17	0.48	0.33	64	Metal Loss	TBit	SK	Inspection Side
154	6	49.02	14.02	1.05	0.39	65	Metal Loss	TBit	SK	Inspection Side
155	6	13.15	90.79	0.60	0.42	67	Metal Loss	TBit	SK	Inspection Side
156	6	9.41	128.62	0.49	0.38	68	Metal Loss	TBit	SK	Inspection Side
157	6	49.41	19.57	1.10	0.35	71	Metal Loss	TBit	SK	Inspection Side
158	6	8.35	145.04	0.61	0.32	74	Metal Loss	TBit	SK	Inspection Side
159	7	25.63	57.76	0.89	0.44	53	Metal Loss	TBit	SK	Inspection Side
160	7	34.65	51.10	0.59	0.41	54	Metal Loss	TBit	SK	Inspection Side
161	7	6.77	128.58	0.53	0.45	57	Metal Loss	TBit	SK / CA	Inspection Side
162	7	49.80	37.76	0.47	0.43	58	Metal Loss	TBit	SK	Inspection Side
163	7	61.93	37.20	0.67	0.44	59	Metal Loss	TBit	SK / CA	Inspection Side
164	9	56.97	236.22	0.54	0.42	49	Metal Loss	TBit	SK	Inspection Side
165	9	26.97	107.64	0.62	0.34	49	Metal Loss	TBit	SK	Inspection Side
166	9	57.20	107.17	0.63	0.52	49	Metal Loss	TBit	SK	Inspection Side
167	9	15.71	117.32	1.21	0.83	49	Metal Loss	TBit	SK	Inspection Side
168	9	12.91	81.69	1.22	0.61	49	Metal Loss	TBit	SK	Inspection Side
169	9	53.98	19.13	0.62	0.32	50	Metal Loss	TBit	SK	Inspection Side
170	9	17.28	114.33	0.65	0.16	50	Metal Loss	TBit	SK	Inspection Side
171	9	31.65	211.73	0.69	0.22	50	Metal Loss	TBit	SK	Inspection Side
172	9	35.39	85.55	1.02	0.22	50	Metal Loss	TBit	SK	Inspection Side
173	9	60.91	21.50	0.58	0.32	51	Metal Loss	TBit	SK	Inspection Side
174	9	29.92	192.24	0.99	0.39	51	Metal Loss	TBit	SK	Inspection Side
175	9	26.30	93.90	0.50	0.43	52	Metal Loss	TBit	SK	Inspection Side
176	9	16.97	189.33	0.72	0.25	52	Metal Loss	TBit	SK	Inspection Side
177	9	60.00	204.49	0.85	0.31	52	Metal Loss	TBit	SK	Inspection Side
178	9	63.78	47.56	0.93	0.53	53	Metal Loss	TBit	SK	Inspection Side
179	9	15.12	224.49	1.04	0.30	53	Metal Loss	TBit	SK	Inspection Side
180	9	32.09	93.43	0.97	0.31	54	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
181	9	42.91	101.34	1.07	0.22	54	Metal Loss	TBit	SK	Inspection Side
182	9	26.06	131.38	0.70	0.16	56	Metal Loss	TBit	SK	Inspection Side
183	9	52.60	129.45	0.71	0.35	56	Metal Loss	TBit	SK	Inspection Side
184	9	56.57	28.31	1.70	0.84	56	Metal Loss	TBit	SK	Inspection Side
185	9	57.32	177.76	0.68	0.43	57	Metal Loss	TBit	SK	Inspection Side
186	9	41.97	107.83	0.95	0.28	57	Metal Loss	TBit	SK	Inspection Side
187	9	38.39	76.10	1.13	0.61	57	Metal Loss	TBit	SK	Inspection Side
188	9	58.15	209.13	1.31	0.81	57	Metal Loss	TBit	SK	Inspection Side
189	9	42.05	123.35	0.85	0.34	58	Metal Loss	TBit	SK	Inspection Side
190	9	32.09	88.58	0.93	0.35	59	Metal Loss	TBit	SK	Inspection Side
191	9	15.16	225.51	1.12	0.42	60	Metal Loss	TBit	SK	Inspection Side
192	9	32.32	113.62	0.42	0.48	61	Metal Loss	TBit	SK	Inspection Side
193	9	52.28	27.80	0.75	0.37	61	Metal Loss	TBit	SK	Inspection Side
194	9	49.92	69.06	1.05	1.04	61	Metal Loss	TBit	SK	Inspection Side
195	9	59.84	129.37	1.12	0.53	63	Metal Loss	TBit	SK	Inspection Side
196	9	55.00	63.70	0.44	0.35	65	Metal Loss	TBit	SK	Inspection Side
197	9	55.79	112.80	0.82	0.50	66	Metal Loss	TBit	SK	Inspection Side
198	9	47.17	47.52	0.92	0.39	66	Metal Loss	TBit	SK	Inspection Side
199	9	52.28	59.33	1.01	0.33	66	Metal Loss	TBit	SK	Inspection Side
200	9	16.89	80.04	0.98	0.88	67	Metal Loss	TBit	SK	Inspection Side
201	9	51.61	52.40	1.19	0.54	67	Metal Loss	TBit	SK	Inspection Side
202	9	53.03	130.63	0.80	0.40	69	Metal Loss	TBit	SK	Inspection Side
203	9	15.16	186.02	1.13	0.47	69	Metal Loss	TBit	SK	Inspection Side
204	9	15.63	107.09	1.22	0.30	73	Metal Loss	TBit	SK	Inspection Side
205	9	17.87	80.63	0.83	0.35	76	Metal Loss	TBit	SK	Inspection Side
206	9	17.36	150.94	0.97	0.48	80	Metal Loss	TBit	SK	Inspection Side
207	9	35.91	74.13	1.06	0.39	85	Metal Loss	TBit	SK	Inspection Side
208	9	55.16	28.46	1.51	0.69	85	Metal Loss	TBit	SK	Inspection Side
209	9	17.68	105.67	1.24	0.93	92	Metal Loss	TBit	SK	Inspection Side
210	9	40.51	126.50	1.66	0.70	97	Metal Loss	TBit	SK	Inspection Side
211	11	27.68	216.89	0.57	0.41	54	Metal Loss	TBit	SK	Inspection Side
212	11	37.52	237.76	0.46	0.32	56	Metal Loss	TBit	SK	Inspection Side
213	11	30.28	214.37	0.87	0.51	56	Metal Loss	TBit	SK	Inspection Side
214	11	59.61	15.91	0.71	0.38	57	Metal Loss	TBit	SK	Inspection Side
215	11	14.17	237.24	0.95	0.45	58	Metal Loss	TBit	SK	Inspection Side
216	11	21.22	237.28	0.98	0.43	58	Metal Loss	TBit	SK	Inspection Side
217	13	56.38	32.99	0.31	0.27	58	Metal Loss	TBit	SK	Non Inspection Side
218	14	11.10	237.28	0.48	0.42	56	Metal Loss	TBit	SK	Inspection Side
219	15	8.94	127.32	0.70	0.37	56	Metal Loss	TBit	SK	Inspection Side
220	15	26.30	184.45	0.32	0.41	67	Metal Loss	TBit	SK	Inspection Side
221	15	55.24	240.43	0.83	0.38	67	Metal Loss	TBit	SK	Inspection Side
222	16	53.82	175.87	0.80	0.28	52	Metal Loss	TBit	SK	Inspection Side
223	19	57.28	63.74	0.66	0.39	55	Metal Loss	TBit	SK	Inspection Side
224	19	54.21	64.53	0.67	0.36	57	Metal Loss	TBit	SK	Inspection Side
225	19	58.86	237.60	0.86	0.43	68	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
226	21	10.35	115.00	1.14	0.45	57	Metal Loss	TBit	SK	Inspection Side
227	22	50.35	234.80	0.66	0.33	57	Metal Loss	TBit	SK	Inspection Side
228	22	44.92	220.75	0.34	0.35	58	Metal Loss	TBit	SK	Inspection Side
229	22	57.13	224.37	0.71	0.39	58	Metal Loss	TBit	SK	Inspection Side
230	23	52.13	25.63	0.77	0.35	70	Metal Loss	TBit	SK	Inspection Side
231	24	24.96	17.52	0.12	0.19	49	Metal Loss	TBit	SK	Inspection Side
232	24	41.42	16.22	0.19	0.40	49	Metal Loss	TBit	SK	Inspection Side
233	24	49.37	52.95	0.32	0.33	49	Metal Loss	TBit	SK	Inspection Side
234	24	26.38	32.76	0.39	0.35	49	Metal Loss	TBit	SK	Inspection Side
235	24	46.26	12.40	0.42	0.33	49	Metal Loss	TBit	SK	Inspection Side
236	24	10.04	12.13	0.42	0.40	49	Metal Loss	TBit	SK	Inspection Side
237	24	22.17	42.40	0.60	0.55	49	Metal Loss	TBit	SK	Inspection Side
238	24	21.57	17.83	0.70	0.49	49	Metal Loss	TBit	SK	Inspection Side
239	24	34.41	21.61	0.39	0.36	50	Metal Loss	TBit	SK	Inspection Side
240	24	9.61	17.17	0.49	0.36	50	Metal Loss	TBit	SK	Inspection Side
241	24	5.67	56.61	0.57	0.47	51	Metal Loss	TBit	SK	Inspection Side
242	24	9.17	39.33	0.77	0.50	51	Metal Loss	TBit	SK	Inspection Side
243	24	29.76	44.92	1.03	0.72	51	Metal Loss	TBit	SK	Inspection Side
244	24	25.79	30.04	0.70	0.33	52	Metal Loss	TBit	SK	Inspection Side
245	24	20.79	38.78	0.47	0.39	53	Metal Loss	TBit	SK	Inspection Side
246	24	41.10	15.31	0.62	0.51	53	Metal Loss	TBit	SK	Inspection Side
247	24	7.01	44.25	0.71	0.33	53	Metal Loss	TBit	SK	Inspection Side
248	24	42.36	18.23	0.97	0.52	54	Metal Loss	TBit	SK	Inspection Side
249	24	49.88	10.12	0.50	0.39	55	Metal Loss	TBit	SK	Inspection Side
250	24	53.07	35.51	0.56	0.34	55	Metal Loss	TBit	SK	Inspection Side
251	24	48.70	33.39	0.63	0.39	55	Metal Loss	TBit	SK	Inspection Side
252	24	13.50	38.19	0.81	0.49	55	Metal Loss	TBit	SK	Inspection Side
253	24	41.93	8.58	0.41	0.37	56	Metal Loss	TBit	SK	Inspection Side
254	24	27.60	39.25	0.46	0.34	56	Metal Loss	TBit	SK	Inspection Side
255	24	52.48	31.61	0.80	0.38	56	Metal Loss	TBit	SK	Inspection Side
256	24	10.87	25.71	0.94	0.52	56	Metal Loss	TBit	SK	Inspection Side
257	24	5.51	43.15	1.14	0.33	56	Metal Loss	TBit	SK	Inspection Side
258	24	58.78	18.62	0.57	0.43	57	Metal Loss	TBit	SK	Inspection Side
259	24	36.57	65.83	0.73	0.52	58	Metal Loss	TBit	SK	Inspection Side
260	24	10.31	22.01	0.28	0.36	59	Metal Loss	TBit	SK	Inspection Side
261	24	20.08	13.03	0.29	0.30	61	Metal Loss	TBit	SK	Inspection Side
262	24	25.91	15.98	0.62	0.36	64	Metal Loss	TBit	SK	Inspection Side
263	24	54.37	13.62	0.53	0.43	66	Metal Loss	TBit	SK	Inspection Side
264	24	39.33	16.18	0.70	0.31	67	Metal Loss	TBit	SK	Inspection Side
265	24	52.09	13.78	0.52	0.40	68	Metal Loss	TBit	SK	Inspection Side
266	24	60.00	78.98	0.73	0.42	68	Metal Loss	TBit	SK	Inspection Side
267	25	52.72	221.54	0.82	0.46	52	Metal Loss	TBit	SK	Inspection Side
268	25	51.89	144.65	1.31	0.55	52	Metal Loss	TBit	SK	Non Inspection Side
269	25	58.31	211.65	0.61	0.32	53	Metal Loss	TBit	SK	Inspection Side
270	25	52.32	139.69	0.84	0.56	53	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
271	25	7.44	108.58	0.44	0.57	54	Metal Loss	TBit	SK	Inspection Side
272	25	7.05	102.56	0.54	0.40	54	Metal Loss	TBit	SK	Inspection Side
273	25	8.82	215.43	0.60	0.36	54	Metal Loss	TBit	SK	Inspection Side
274	25	10.87	105.28	0.37	0.33	55	Metal Loss	TBit	SK	Inspection Side
275	25	39.72	225.83	0.53	0.41	55	Metal Loss	TBit	SK	Inspection Side
276	25	32.68	119.72	0.74	0.39	55	Metal Loss	TBit	SK	Inspection Side
277	25	39.76	229.65	0.43	0.46	56	Metal Loss	TBit	SK	Inspection Side
278	25	8.62	186.73	1.14	0.36	56	Metal Loss	TBit	SK	Inspection Side
279	25	40.16	184.45	0.46	0.31	57	Metal Loss	TBit	SK	Inspection Side
280	25	41.73	191.02	0.54	0.35	57	Metal Loss	TBit	SK	Inspection Side
281	25	23.78	174.88	0.62	0.36	57	Metal Loss	TBit	SK	Inspection Side
282	25	56.26	217.40	0.92	0.44	57	Metal Loss	TBit	SK	Inspection Side
283	25	54.76	204.53	0.67	0.46	58	Metal Loss	TBit	SK	Inspection Side
284	25	49.09	145.12	1.44	0.49	60	Metal Loss	TBit	SK	Inspection Side
285	25	53.39	224.65	0.67	0.44	75	Metal Loss	TBit	SK	Inspection Side
286	26	52.36	144.25	1.73	0.84	54	Metal Loss	TBit	SK	Inspection Side
287	26	58.35	181.14	0.96	0.41	58	Metal Loss	TBit	SK	Inspection Side
288	26	51.97	109.57	1.31	0.30	58	Metal Loss	TBit	SK	Inspection Side
289	26	8.86	30.16	0.69	0.41	59	Metal Loss	TBit	SK	Inspection Side
290	26	55.20	107.95	0.91	0.31	75	Metal Loss	TBit	SK	Inspection Side
291	27	7.01	227.72	1.41	0.80	51	Metal Loss	TBit	SK	Inspection Side
292	28	6.81	24.41	0.74	0.42	54	Metal Loss	TBit	SK	Inspection Side
293	28	6.54	18.03	0.59	0.41	57	Metal Loss	TBit	SK	Inspection Side
294	28	20.79	15.20	0.72	0.31	59	Metal Loss	TBit	SK	Inspection Side
295	28	8.23	212.17	0.86	0.59	80	Metal Loss	TBit	SK	Inspection Side
296	29	43.35	40.04	0.51	0.41	54	Metal Loss	TBit	SK	Inspection Side
297	29	21.18	12.76	0.92	0.43	54	Metal Loss	TBit	SK	Inspection Side
298	29	55.94	23.46	0.53	0.40	55	Metal Loss	TBit	SK	Inspection Side
299	29	9.96	122.91	0.53	0.32	56	Metal Loss	TBit	SK	Non Inspection Side
300	29	25.71	100.63	0.98	0.37	56	Metal Loss	TBit	SK	Inspection Side
301	29	56.30	98.54	1.02	0.67	57	Metal Loss	TBit	SK	Inspection Side
302	29	39.06	102.76	1.19	0.67	79	Metal Loss	TBit	SK	Inspection Side
303	29	9.09	125.75	1.37	0.48	79	Metal Loss	TBit	SK	Non Inspection Side
304	31	22.01	185.43	1.41	0.62	79	Metal Loss	TBit	SK	Inspection Side
305	32	46.22	88.31	0.98	0.72	54	Metal Loss	TBit	SK	Inspection Side
306	32	39.09	176.61	0.57	0.48	55	Metal Loss	TBit	SK	Inspection Side
307	32	25.31	173.54	0.69	0.36	56	Metal Loss	TBit	SK	Inspection Side
308	32	17.32	171.06	0.44	0.45	57	Metal Loss	TBit	SK	Inspection Side
309	32	54.61	239.29	0.47	0.37	57	Metal Loss	TBit	SK	Inspection Side
310	32	47.56	228.66	1.44	0.51	58	Metal Loss	TBit	SK	Inspection Side
311	33	18.39	62.24	0.87	0.53	55	Metal Loss	TBit	SK	Inspection Side
312	34	57.17	227.52	0.55	0.40	50	Metal Loss	TBit	SK	Non Inspection Side
313	34	60.31	180.98	0.48	0.39	54	Metal Loss	TBit	SK	Inspection Side
314	34	20.31	146.06	0.85	0.36	54	Metal Loss	TBit	SK	Inspection Side
315	34	21.38	131.14	0.99	0.53	54	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
316	34	52.44	33.50	1.17	0.47	54	Metal Loss	TBit	SK	Inspection Side
317	34	64.17	169.06	1.33	0.44	54	Metal Loss	TBit	SK	Inspection Side
318	34	58.86	61.50	0.63	0.29	55	Metal Loss	TBit	SK	Inspection Side
319	34	20.47	151.18	0.81	0.34	55	Metal Loss	TBit	SK	Inspection Side
320	34	56.54	151.38	0.89	0.54	57	Metal Loss	TBit	SK	Inspection Side
321	34	63.94	33.15	0.95	0.43	59	Metal Loss	TBit	SK	Inspection Side
322	34	62.17	67.36	1.32	0.99	80	Metal Loss	TBit	SK	Inspection Side
323	35	38.03	65.63	0.49	0.39	54	Metal Loss	TBit	SK	Inspection Side
324	35	37.52	116.46	0.59	0.36	55	Metal Loss	TBit	SK	Inspection Side
325	35	60.16	79.37	0.66	0.43	55	Metal Loss	TBit	SK	Inspection Side
326	35	58.39	41.42	1.32	0.67	55	Metal Loss	TBit	SK	Inspection Side
327	35	21.57	16.42	0.54	0.34	56	Metal Loss	TBit	SK	Inspection Side
328	35	61.57	41.65	1.02	0.64	57	Metal Loss	TBit	SK	Inspection Side
329	35	20.20	72.24	0.44	0.35	58	Metal Loss	TBit	SK	Inspection Side
330	35	8.82	47.80	0.44	0.31	58	Metal Loss	TBit	SK	Inspection Side
331	36	55.67	25.63	0.68	0.40	56	Metal Loss	TBit	SK	Inspection Side
332	36	59.80	12.72	0.99	0.35	56	Metal Loss	TBit	SK	Inspection Side
333	36	4.76	10.63	0.78	0.44	59	Metal Loss	TBit	SK	Inspection Side
334	37	25.71	177.20	0.44	0.38	49	Metal Loss	TBit	SK	Inspection Side
335	37	32.68	105.43	0.51	0.40	49	Metal Loss	TBit	SK	Inspection Side
336	37	25.28	210.35	0.57	0.37	49	Metal Loss	TBit	SK	Inspection Side
337	37	62.28	20.67	0.58	0.29	49	Metal Loss	TBit	SK	Inspection Side
338	37	17.32	231.73	0.95	0.47	49	Metal Loss	TBit	SK	Inspection Side
339	37	23.82	234.88	1.11	0.31	49	Metal Loss	TBit	SK	Inspection Side
340	37	39.76	81.69	1.40	0.71	49	Metal Loss	TBit	SK	Inspection Side
341	37	57.40	148.03	0.22	0.40	50	Metal Loss	TBit	SK	Inspection Side
342	37	14.45	198.46	0.51	0.44	50	Metal Loss	TBit	SK	Inspection Side
343	37	60.83	139.06	0.57	0.33	50	Metal Loss	TBit	SK	Inspection Side
344	37	45.08	82.13	0.81	0.42	50	Metal Loss	TBit	SK	Inspection Side
345	37	61.61	182.24	0.97	0.53	50	Metal Loss	TBit	SK	Inspection Side
346	37	8.82	147.36	1.17	0.35	50	Metal Loss	TBit	SK	Inspection Side
347	37	5.55	179.69	1.20	0.71	50	Metal Loss	TBit	SK	Inspection Side
348	37	35.16	155.39	0.12	0.36	51	Metal Loss	TBit	SK	Inspection Side
349	37	7.95	154.33	0.38	0.35	51	Metal Loss	TBit	SK	Inspection Side
350	37	42.36	145.24	0.82	0.45	51	Metal Loss	TBit	SK	Inspection Side
351	37	33.86	187.95	0.95	0.42	51	Metal Loss	TBit	SK	Inspection Side
352	37	22.99	194.76	0.63	0.43	52	Metal Loss	TBit	SK	Inspection Side
353	37	42.76	161.50	0.78	0.44	52	Metal Loss	TBit	SK	Inspection Side
354	37	27.76	169.61	0.82	0.62	52	Metal Loss	TBit	SK	Inspection Side
355	37	57.09	141.77	0.92	0.57	52	Metal Loss	TBit	SK	Inspection Side
356	37	59.88	114.13	0.33	0.36	53	Metal Loss	TBit	SK	Inspection Side
357	37	6.10	133.19	0.34	0.31	53	Metal Loss	TBit	SK	Inspection Side
358	37	20.98	231.85	0.47	0.39	53	Metal Loss	TBit	SK	Inspection Side
359	37	63.39	177.09	0.49	0.41	53	Metal Loss	TBit	SK	Inspection Side
360	37	6.93	203.19	0.50	0.30	53	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
361	37	10.87	211.26	0.53	0.36	53	Metal Loss	TBit	SK	Inspection Side
362	37	57.40	151.14	0.60	0.34	53	Metal Loss	TBit	SK	Inspection Side
363	37	12.91	122.32	0.73	0.34	53	Metal Loss	TBit	SK	Inspection Side
364	37	37.80	122.56	0.93	0.54	53	Metal Loss	TBit	SK	Inspection Side
365	37	54.17	169.53	2.13	1.85	53	Metal Loss	TBit	SK	Inspection Side
366	37	7.05	125.31	0.48	0.34	54	Metal Loss	TBit	SK	Inspection Side
367	37	48.66	201.26	0.72	0.40	54	Metal Loss	TBit	SK	Inspection Side
368	37	2.32	160.59	0.72	0.45	54	Metal Loss	TBit	SK	Inspection Side
369	37	59.02	226.85	1.18	0.31	54	Metal Loss	TBit	SK	Inspection Side
370	37	55.71	169.53	2.21	1.87	54	Metal Loss	TBit	SK	Inspection Side
371	37	7.17	138.46	0.62	0.45	55	Metal Loss	TBit	SK	Inspection Side
372	37	25.39	175.59	0.66	0.41	55	Metal Loss	TBit	SK	Inspection Side
373	37	59.88	154.41	0.74	0.50	55	Metal Loss	TBit	SK	Inspection Side
374	37	22.95	129.06	0.49	0.39	56	Metal Loss	TBit	SK	Inspection Side
375	37	41.06	129.84	0.69	0.39	56	Metal Loss	TBit	SK	Inspection Side
376	37	21.85	154.69	0.58	0.44	57	Metal Loss	TBit	SK	Inspection Side
377	37	5.12	159.17	0.97	0.32	57	Metal Loss	TBit	SK	Inspection Side
378	37	6.85	14.49	1.24	1.03	57	Metal Loss	TBit	SK	Inspection Side
379	37	40.47	193.86	0.44	0.34	58	Metal Loss	TBit	SK	Inspection Side
380	37	37.95	227.01	0.49	0.43	58	Metal Loss	TBit	SK	Inspection Side
381	37	44.45	79.45	0.84	0.49	58	Metal Loss	TBit	SK	Inspection Side
382	37	58.54	112.56	0.84	0.34	58	Metal Loss	TBit	SK	Inspection Side
383	37	52.64	28.62	1.32	0.81	58	Metal Loss	TBit	SK	Inspection Side
384	37	35.28	155.39	0.14	0.32	59	Metal Loss	TBit	SK	Inspection Side
385	37	7.72	188.90	0.61	0.34	59	Metal Loss	TBit	SK	Inspection Side
386	37	56.42	126.06	0.50	0.34	60	Metal Loss	TBit	SK	Inspection Side
387	37	9.02	222.91	0.70	0.49	60	Metal Loss	TBit	SK	Inspection Side
388	37	57.99	182.17	0.64	0.44	61	Metal Loss	TBit	SK	Inspection Side
389	37	18.31	210.47	0.73	0.40	62	Metal Loss	TBit	SK	Inspection Side
390	37	20.35	157.32	0.75	0.33	62	Metal Loss	TBit	SK	Inspection Side
391	37	59.80	117.01	0.74	0.34	63	Metal Loss	TBit	SK	Inspection Side
392	37	51.50	193.90	0.94	0.42	63	Metal Loss	TBit	SK	Inspection Side
393	37	40.47	164.61	0.72	0.34	65	Metal Loss	TBit	SK	Inspection Side
394	37	9.02	119.33	1.01	0.49	65	Metal Loss	TBit	SK	Inspection Side
395	37	6.14	188.39	0.62	0.53	66	Metal Loss	TBit	SK	Inspection Side
396	37	43.66	127.36	0.63	0.30	68	Metal Loss	TBit	SK	Inspection Side
397	37	51.69	187.60	0.93	0.45	68	Metal Loss	TBit	SK	Inspection Side
398	37	4.45	229.65	0.96	0.40	70	Metal Loss	TBit	SK	Inspection Side
399	38	6.14	155.08	0.90	0.62	54	Metal Loss	TBit	SK	Inspection Side
400	38	4.92	104.06	0.72	0.41	59	Metal Loss	TBit	SK	Inspection Side
401	39	8.27	107.72	0.59	0.35	56	Metal Loss	TBit	SK	Inspection Side
402	39	11.34	168.86	0.80	0.54	56	Metal Loss	TBit	SK	Inspection Side
403	39	11.02	199.29	0.50	0.33	57	Metal Loss	TBit	SK	Inspection Side
404	39	3.62	87.40	1.29	0.41	57	Metal Loss	TBit	SK	Inspection Side
405	39	5.12	150.79	0.45	0.39	58	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
406	39	13.94	194.06	0.46	0.32	58	Metal Loss	TBit	SK	Inspection Side
407	39	8.07	193.07	0.55	0.34	58	Metal Loss	TBit	SK	Inspection Side
408	39	10.04	161.42	0.85	0.47	58	Metal Loss	TBit	SK	Inspection Side
409	39	6.14	157.95	0.94	0.53	59	Metal Loss	TBit	SK	Inspection Side
410	40	12.20	165.35	0.56	0.32	56	Metal Loss	TBit	SK	Inspection Side
411	40	56.73	236.38	0.75	0.32	58	Metal Loss	TBit	SK	Inspection Side
412	44	18.43	152.64	0.47	0.37	55	Metal Loss	TBit	SK	Inspection Side
413	44	9.61	128.66	0.59	0.32	57	Metal Loss	TBit	SK	Inspection Side
414	44	60.24	93.70	1.54	0.62	59	Metal Loss	TBit	SK	Inspection Side
415	45	41.73	195.43	0.58	0.39	49	Metal Loss	TBit	SK	Non Inspection Side
416	45	19.76	141.06	0.70	0.54	49	Metal Loss	TBit	SK	Inspection Side
417	45	51.18	212.28	2.42	0.93	49	Metal Loss	TBit	SK	Inspection Side
418	45	7.36	174.21	0.88	0.45	50	Metal Loss	TBit	SK	Inspection Side
419	45	37.52	113.11	0.92	0.53	51	Metal Loss	TBit	SK	Inspection Side
420	45	55.79	109.37	0.92	0.36	52	Metal Loss	TBit	SK	Inspection Side
421	45	19.25	129.61	0.64	0.46	54	Metal Loss	TBit	SK	Inspection Side
422	45	34.88	187.09	0.71	0.47	54	Metal Loss	TBit	SK	Inspection Side
423	45	20.91	206.77	0.72	0.34	54	Metal Loss	TBit	SK	Inspection Side
424	45	19.45	221.22	0.79	0.44	54	Metal Loss	TBit	SK	Inspection Side
425	45	22.44	193.86	1.05	0.34	54	Metal Loss	TBit	SK	Inspection Side
426	45	58.07	195.12	1.32	0.67	54	Metal Loss	TBit	SK	Inspection Side
427	45	55.75	196.30	1.51	0.58	55	Metal Loss	TBit	SK	Inspection Side
428	45	8.35	192.87	0.69	0.40	56	Metal Loss	TBit	SK	Inspection Side
429	45	22.95	175.20	0.43	0.35	57	Metal Loss	TBit	SK	Inspection Side
430	45	21.30	193.35	0.99	0.40	57	Metal Loss	TBit	SK	Inspection Side
431	45	56.50	66.42	0.82	0.39	59	Metal Loss	TBit	SK	Inspection Side
432	45	18.43	122.95	0.62	0.39	60	Metal Loss	TBit	SK	Inspection Side
433	45	59.61	24.57	0.78	0.43	61	Metal Loss	TBit	SK	Inspection Side
434	45	31.18	28.86	1.69	0.50	61	Metal Loss	TBit	SK	Inspection Side
435	45	9.72	174.13	1.03	0.37	62	Metal Loss	TBit	SK	Inspection Side
436	45	53.39	107.28	1.21	0.97	63	Metal Loss	TBit	SK	Inspection Side
437	45	56.02	137.76	1.40	0.59	65	Metal Loss	TBit	SK	Inspection Side
438	45	59.37	183.19	1.41	0.65	65	Metal Loss	TBit	SK	Inspection Side
439	45	20.51	213.74	0.85	0.33	66	Metal Loss	TBit	SK	Inspection Side
440	45	21.38	214.33	0.83	0.41	69	Metal Loss	TBit	SK	Inspection Side
441	46	14.13	178.03	1.14	0.49	50	Metal Loss	TBit	SK	Inspection Side
442	46	44.33	120.51	1.10	0.71	51	Metal Loss	TBit	SK	Inspection Side
443	46	45.16	116.97	0.62	0.30	52	Metal Loss	TBit	SK	Non Inspection Side
444	46	33.19	22.48	1.09	0.36	54	Metal Loss	TBit	SK	Inspection Side
445	46	9.02	177.13	1.09	0.76	55	Metal Loss	TBit	SK	Inspection Side
446	46	20.55	9.80	1.00	0.33	58	Metal Loss	TBit	SK	Inspection Side
447	46	31.50	14.72	0.82	0.35	59	Metal Loss	TBit	SK	Inspection Side
448	46	14.13	169.09	0.68	0.60	64	Metal Loss	TBit	SK	Non Inspection Side
449	47	51.81	174.06	0.63	0.44	55	Metal Loss	TBit	SK	Inspection Side
450	47	61.81	81.46	0.35	0.32	56	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
451	47	51.02	20.08	0.70	0.38	57	Metal Loss	TBit	SK	Inspection Side
452	47	22.20	24.80	1.17	0.44	58	Metal Loss	TBit	SK	Inspection Side
453	47	9.13	24.65	0.74	0.44	61	Metal Loss	TBit	SK	Inspection Side
454	48	53.11	76.42	0.38	0.49	54	Metal Loss	TBit	SK	Inspection Side
455	48	5.12	182.76	0.51	0.32	55	Metal Loss	TBit	SK	Inspection Side
456	48	14.61	120.55	1.16	0.43	55	Metal Loss	TBit	SK	Inspection Side
457	48	9.06	119.49	1.21	0.48	55	Metal Loss	TBit	SK	Inspection Side
458	48	5.55	110.79	0.44	0.36	56	Metal Loss	TBit	SK	Inspection Side
459	48	40.98	158.74	0.55	0.35	56	Metal Loss	TBit	SK	Inspection Side
460	48	20.75	70.39	0.55	0.45	57	Metal Loss	TBit	SK	Inspection Side
461	48	37.17	205.47	0.62	0.45	57	Metal Loss	TBit	SK	Inspection Side
462	48	9.92	242.64	0.67	0.36	57	Metal Loss	TBit	SK	Inspection Side
463	48	5.31	171.10	0.77	0.38	60	Metal Loss	TBit	SK	Inspection Side
464	49	12.64	47.13	1.00	0.58	55	Metal Loss	TBit	SK / CA	Inspection Side
465	50	51.97	86.69	1.60	0.40	51	Metal Loss	TBit	SK	Inspection Side
466	50	50.94	125.12	0.88	0.46	53	Metal Loss	TBit	SK	Non Inspection Side
467	50	54.25	67.32	0.90	0.44	56	Metal Loss	TBit	SK	Inspection Side
468	50	51.97	54.96	1.39	0.58	75	Metal Loss	TBit	SK	Inspection Side
469	51	29.57	164.06	0.63	0.45	49	Metal Loss	TBit	SK	Inspection Side
470	51	37.28	200.55	0.64	0.41	49	Metal Loss	TBit	SK	Inspection Side
471	51	17.60	231.81	0.70	0.44	49	Metal Loss	TBit	SK	Inspection Side
472	51	44.25	225.67	0.74	0.41	49	Metal Loss	TBit	SK	Inspection Side
473	51	35.39	185.79	0.92	0.50	49	Metal Loss	TBit	SK	Inspection Side
474	51	63.74	71.34	1.02	0.76	49	Metal Loss	TBit	SK	Inspection Side
475	51	49.06	53.07	1.35	0.51	49	Metal Loss	TBit	SK	Inspection Side
476	51	41.34	196.06	0.12	0.32	50	Metal Loss	TBit	SK	Inspection Side
477	51	35.71	217.83	0.44	0.36	50	Metal Loss	TBit	SK	Inspection Side
478	51	52.20	204.17	0.57	0.38	50	Metal Loss	TBit	SK	Inspection Side
479	51	22.20	108.54	0.71	0.54	50	Metal Loss	TBit	SK	Inspection Side
480	51	29.65	75.00	0.77	0.43	50	Metal Loss	TBit	SK	Inspection Side
481	51	58.62	87.48	0.84	0.56	50	Metal Loss	TBit	SK	Inspection Side
482	51	42.72	174.37	1.15	0.76	50	Metal Loss	TBit	SK	Inspection Side
483	51	19.21	215.43	1.30	0.47	50	Metal Loss	TBit	SK	Inspection Side
484	51	60.39	89.80	1.45	0.58	50	Metal Loss	TBit	SK	Inspection Side
485	51	38.54	180.35	0.14	0.45	51	Metal Loss	TBit	SK	Non Inspection Side
486	51	33.27	218.07	0.54	0.37	51	Metal Loss	TBit	SK	Inspection Side
487	51	16.54	123.31	0.91	0.61	51	Metal Loss	TBit	SK	Inspection Side
488	51	35.31	233.70	1.20	0.54	51	Metal Loss	TBit	SK	Inspection Side
489	51	56.69	197.87	0.49	0.45	52	Metal Loss	TBit	SK	Inspection Side
490	51	21.42	160.00	0.54	0.35	52	Metal Loss	TBit	SK	Inspection Side
491	51	8.82	126.10	0.61	0.41	52	Metal Loss	TBit	SK	Inspection Side
492	51	49.61	178.31	0.75	0.33	52	Metal Loss	TBit	SK	Inspection Side
493	51	12.24	126.02	0.83	0.47	52	Metal Loss	TBit	SK	Inspection Side
494	51	5.12	222.60	1.02	0.37	52	Metal Loss	TBit	SK	Inspection Side
495	51	11.22	160.67	1.12	0.46	52	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
496	51	61.22	184.17	0.63	0.33	53	Metal Loss	TBit	SK	Inspection Side
497	51	6.65	84.88	0.69	0.38	53	Metal Loss	TBit	SK	Inspection Side
498	51	37.17	200.43	0.75	0.43	53	Metal Loss	TBit	SK	Inspection Side
499	51	25.39	121.02	0.98	0.44	53	Metal Loss	TBit	SK	Inspection Side
500	51	37.72	213.78	0.48	0.41	54	Metal Loss	TBit	SK	Inspection Side
501	51	41.10	180.63	0.57	0.47	54	Metal Loss	TBit	SK	Inspection Side
502	51	20.20	161.18	0.96	0.35	54	Metal Loss	TBit	SK	Inspection Side
503	51	57.01	200.04	1.20	0.49	54	Metal Loss	TBit	SK	Inspection Side
504	51	19.25	10.63	0.43	0.31	55	Metal Loss	TBit	SK	Inspection Side
505	51	26.26	157.60	0.66	0.41	55	Metal Loss	TBit	SK	Inspection Side
506	51	59.02	206.50	0.73	0.44	55	Metal Loss	TBit	SK	Inspection Side
507	51	32.13	90.75	0.82	0.47	55	Metal Loss	TBit	SK	Inspection Side
508	51	31.26	234.80	1.13	0.63	55	Metal Loss	TBit	SK	Inspection Side
509	51	17.56	216.50	1.46	0.49	55	Metal Loss	TBit	SK	Inspection Side
510	51	56.69	13.46	2.52	0.50	55	Metal Loss	TBit	SK	Inspection Side
511	51	54.21	190.83	0.44	0.35	56	Metal Loss	TBit	SK	Inspection Side
512	51	37.76	63.03	0.50	0.33	56	Metal Loss	TBit	SK	Inspection Side
513	51	37.91	212.40	0.50	0.44	56	Metal Loss	TBit	SK	Inspection Side
514	51	51.93	14.09	1.12	1.84	56	Metal Loss	TBit	SK	Non Inspection Side
515	51	45.79	241.14	1.13	0.33	56	Metal Loss	TBit	SK	Inspection Side
516	51	22.52	159.61	0.46	0.32	57	Metal Loss	TBit	SK	Inspection Side
517	51	44.53	187.83	0.59	0.47	57	Metal Loss	TBit	SK	Inspection Side
518	51	30.08	159.06	0.60	0.34	57	Metal Loss	TBit	SK	Inspection Side
519	51	37.83	154.02	0.69	0.37	57	Metal Loss	TBit	SK	Inspection Side
520	51	57.80	240.24	1.34	0.52	57	Metal Loss	TBit	SK	Inspection Side
521	51	59.29	150.67	1.99	0.49	57	Metal Loss	TBit	SK	Inspection Side
522	51	5.31	38.50	0.39	0.31	58	Metal Loss	TBit	SK	Inspection Side
523	51	4.65	221.77	0.61	0.39	58	Metal Loss	TBit	SK	Inspection Side
524	51	6.10	231.14	0.79	0.42	58	Metal Loss	TBit	SK	Inspection Side
525	51	12.72	218.15	0.12	0.48	59	Metal Loss	TBit	SK	Inspection Side
526	51	12.72	217.95	0.56	0.51	59	Metal Loss	TBit	SK	Inspection Side
527	51	61.42	151.89	0.67	0.32	59	Metal Loss	TBit	SK	Inspection Side
528	51	32.32	90.83	0.84	0.51	59	Metal Loss	TBit	SK	Inspection Side
529	51	59.02	121.89	0.88	0.52	59	Metal Loss	TBit	SK	Inspection Side
530	51	8.03	13.50	0.48	0.36	60	Metal Loss	TBit	SK	Non Inspection Side
531	51	22.28	216.69	0.75	0.60	61	Metal Loss	TBit	SK	Inspection Side
532	51	61.42	200.04	1.35	0.42	62	Metal Loss	TBit	SK	Inspection Side
533	51	8.86	147.28	0.70	0.35	63	Metal Loss	TBit	SK	Inspection Side
534	51	59.21	145.51	0.53	0.51	64	Metal Loss	TBit	SK	Inspection Side
535	51	45.39	175.24	0.82	0.44	64	Metal Loss	TBit	SK	Inspection Side
536	51	44.13	203.07	0.84	0.39	65	Metal Loss	TBit	SK	Inspection Side
537	51	52.01	115.79	1.30	0.48	65	Metal Loss	TBit	SK	Inspection Side
538	51	59.92	16.18	1.33	0.58	65	Metal Loss	TBit	SK	Inspection Side
539	51	35.24	185.71	0.88	0.50	66	Metal Loss	TBit	SK	Inspection Side
540	51	23.35	239.25	0.48	0.32	68	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
541	51	43.94	100.04	0.67	0.36	69	Metal Loss	TBit	SK	Inspection Side
542	51	16.77	11.57	1.24	0.56	70	Metal Loss	TBit	SK	Inspection Side
543	51	51.85	162.01	1.01	0.82	96	Metal Loss	TBit	SK	Inspection Side
544	52	18.11	37.95	0.47	0.49	49	Metal Loss	TBit	SK	Inspection Side
545	52	9.02	166.50	0.48	0.38	49	Metal Loss	TBit	SK	Inspection Side
546	52	47.40	28.78	0.61	0.37	49	Metal Loss	TBit	SK	Inspection Side
547	52	44.41	28.58	0.62	0.36	49	Metal Loss	TBit	SK	Inspection Side
548	52	7.95	227.56	0.63	0.40	49	Metal Loss	TBit	SK	Inspection Side
549	52	61.34	210.43	0.64	0.48	49	Metal Loss	TBit	SK	Inspection Side
550	52	6.46	13.94	0.65	0.36	49	Metal Loss	TBit	SK	Inspection Side
551	52	32.28	27.68	0.85	0.35	49	Metal Loss	TBit	SK	Inspection Side
552	52	49.37	39.29	0.94	0.52	49	Metal Loss	TBit	SK	Inspection Side
553	52	57.76	162.01	1.06	0.32	49	Metal Loss	TBit	SK	Inspection Side
554	52	50.67	183.54	0.42	0.19	50	Metal Loss	TBit	SK	Inspection Side
555	52	60.24	38.15	0.44	0.34	50	Metal Loss	TBit	SK	Inspection Side
556	52	8.15	89.09	0.80	0.59	50	Metal Loss	TBit	SK	Inspection Side
557	52	19.25	149.41	0.82	0.32	50	Metal Loss	TBit	SK	Inspection Side
558	52	61.73	159.96	0.83	0.48	50	Metal Loss	TBit	SK	Inspection Side
559	52	33.78	26.18	0.87	0.40	50	Metal Loss	TBit	SK	Inspection Side
560	52	21.34	27.91	0.99	0.45	50	Metal Loss	TBit	SK	Inspection Side
561	52	18.35	10.79	1.33	0.64	50	Metal Loss	TBit	SK	Inspection Side
562	52	49.92	24.41	1.66	0.48	50	Metal Loss	TBit	SK	Inspection Side
563	52	60.63	33.66	1.74	0.40	50	Metal Loss	TBit	SK	Inspection Side
564	52	42.40	31.50	1.86	0.43	50	Metal Loss	TBit	SK	Inspection Side
565	52	27.24	22.68	0.55	0.31	51	Metal Loss	TBit	SK	Inspection Side
566	52	55.75	30.55	0.66	0.44	51	Metal Loss	TBit	SK	Inspection Side
567	52	10.87	51.93	0.68	0.44	51	Metal Loss	TBit	SK	Inspection Side
568	52	55.08	11.34	1.66	0.71	51	Metal Loss	TBit	SK	Inspection Side
569	52	25.98	32.13	0.60	0.30	52	Metal Loss	TBit	SK	Inspection Side
570	52	44.69	31.57	0.63	0.43	52	Metal Loss	TBit	SK	Inspection Side
571	52	23.58	22.20	0.80	0.54	52	Metal Loss	TBit	SK	Inspection Side
572	52	32.64	196.34	0.81	0.30	52	Metal Loss	TBit	SK	Inspection Side
573	52	8.82	49.76	1.94	0.33	52	Metal Loss	TBit	SK	Inspection Side
574	52	25.71	16.22	0.56	0.37	53	Metal Loss	TBit	SK	Inspection Side
575	52	17.01	28.90	0.76	0.42	53	Metal Loss	TBit	SK	Inspection Side
576	52	49.65	10.20	0.90	0.33	53	Metal Loss	TBit	SK	Inspection Side
577	52	41.06	163.78	0.95	0.46	53	Metal Loss	TBit	SK	Inspection Side
578	52	52.32	24.57	1.67	0.44	53	Metal Loss	TBit	SK	Inspection Side
579	52	43.82	162.28	0.53	0.35	54	Metal Loss	TBit	SK	Inspection Side
580	52	62.01	10.94	0.84	0.60	54	Metal Loss	TBit	SK	Inspection Side
581	52	57.72	198.78	0.57	0.47	55	Metal Loss	TBit	SK	Inspection Side
582	52	60.20	104.88	0.93	0.51	55	Metal Loss	TBit	SK	Non Inspection Side
583	52	54.25	154.57	1.19	0.52	55	Metal Loss	TBit	SK	Inspection Side
584	52	17.60	39.06	0.61	0.47	56	Metal Loss	TBit	SK	Inspection Side
585	52	47.20	117.64	0.51	0.35	57	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
586	52	18.82	50.08	0.83	0.47	57	Metal Loss	TBit	SK	Inspection Side
587	52	5.75	120.47	1.23	0.66	57	Metal Loss	TBit	SK	Inspection Side
588	52	17.76	12.13	0.85	0.31	58	Metal Loss	TBit	SK	Inspection Side
589	52	52.13	88.31	1.27	0.70	58	Metal Loss	TBit	SK	Non Inspection Side
590	52	58.15	176.85	0.47	0.30	59	Metal Loss	TBit	SK	Inspection Side
591	52	56.81	113.74	0.56	0.48	60	Metal Loss	TBit	SK	Inspection Side
592	52	6.81	61.85	0.67	0.32	60	Metal Loss	TBit	SK	Inspection Side
593	52	48.86	16.14	0.73	0.34	60	Metal Loss	TBit	SK	Inspection Side
594	52	42.60	37.83	0.94	0.37	60	Metal Loss	TBit	SK	Inspection Side
595	52	16.54	46.06	1.47	0.49	60	Metal Loss	TBit	SK	Inspection Side
596	52	16.22	4.29	0.48	0.37	61	Metal Loss	TBit	SK	Inspection Side
597	52	23.07	38.39	0.55	0.32	61	Metal Loss	TBit	SK	Inspection Side
598	52	62.36	16.26	0.77	0.35	61	Metal Loss	TBit	SK	Inspection Side
599	52	54.29	168.78	0.86	0.40	62	Metal Loss	TBit	SK	Inspection Side
600	52	49.29	25.24	1.05	0.47	63	Metal Loss	TBit	SK	Inspection Side
601	52	23.82	31.97	1.89	0.77	65	Metal Loss	TBit	SK	Inspection Side
602	52	43.62	165.08	0.55	0.37	67	Metal Loss	TBit	SK	Inspection Side
603	52	25.20	29.92	1.93	0.89	68	Metal Loss	TBit	SK	Inspection Side
604	52	61.26	195.87	0.72	0.57	73	Metal Loss	TBit	SK	Inspection Side
605	52	56.85	34.45	1.82	0.75	73	Metal Loss	TBit	SK	Inspection Side
606	52	60.20	199.57	0.88	0.51	75	Metal Loss	TBit	SK	Inspection Side
607	53	57.64	164.45	1.47	0.99	49	Metal Loss	TBit	SK	Inspection Side
608	53	57.64	185.75	1.82	0.71	50	Metal Loss	TBit	SK	Inspection Side
609	53	56.69	153.35	0.58	0.39	54	Metal Loss	TBit	SK	Inspection Side
610	53	14.45	50.75	0.84	0.48	55	Metal Loss	TBit	SK	Inspection Side
611	53	19.21	58.94	1.45	0.71	55	Metal Loss	TBit	SK	Inspection Side
612	53	51.61	143.94	1.17	0.54	56	Metal Loss	TBit	SK	Inspection Side
613	53	57.56	43.23	1.78	0.55	57	Metal Loss	TBit	SK	Inspection Side
614	53	53.35	180.08	0.63	0.62	58	Metal Loss	TBit	SK	Inspection Side
615	53	51.57	178.86	1.13	0.78	60	Metal Loss	TBit	SK	Inspection Side
616	53	57.64	166.89	1.20	0.99	60	Metal Loss	TBit	SK	Inspection Side
617	53	51.93	164.33	0.84	0.34	62	Metal Loss	TBit	SK	Inspection Side
618	53	53.43	170.28	0.91	0.40	62	Metal Loss	TBit	SK	Inspection Side
619	53	50.98	17.91	1.00	0.50	63	Metal Loss	TBit	SK	Inspection Side
620	53	55.71	183.11	0.73	1.05	97	Metal Loss	TBit	SK	Inspection Side
621	53	57.64	183.62	1.13	0.66	98	Metal Loss	TBit	SK	Inspection Side
622	53	55.31	178.98	1.21	0.80	98	Metal Loss	TBit	SK	Inspection Side
623	54	55.94	198.15	0.59	0.43	49	Metal Loss	TBit	SK	Inspection Side
624	54	5.31	215.67	0.36	0.89	50	Metal Loss	TBit	SK	Inspection Side
625	54	8.50	149.45	0.61	0.38	50	Metal Loss	TBit	SK	Inspection Side
626	54	42.48	142.36	1.32	0.72	50	Metal Loss	TBit	SK	Inspection Side
627	54	56.57	179.88	0.43	0.36	51	Metal Loss	TBit	SK	Inspection Side
628	54	16.77	218.27	0.61	0.42	52	Metal Loss	TBit	SK	Inspection Side
629	54	59.88	192.13	0.66	0.44	52	Metal Loss	TBit	SK	Inspection Side
630	54	17.64	212.87	0.76	0.28	52	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
631	54	57.40	189.45	0.52	0.46	53	Metal Loss	TBit	SK	Inspection Side
632	54	17.09	222.60	0.88	0.41	53	Metal Loss	TBit	SK	Inspection Side
633	54	42.60	212.76	1.25	0.48	54	Metal Loss	TBit	SK	Inspection Side
634	54	11.57	222.28	0.83	0.48	55	Metal Loss	TBit	SK	Inspection Side
635	54	39.37	153.90	0.50	0.32	57	Metal Loss	TBit	SK	Inspection Side
636	54	9.45	14.49	0.51	0.40	57	Metal Loss	TBit	SK	Inspection Side
637	54	7.32	231.54	0.58	0.35	57	Metal Loss	TBit	SK	Inspection Side
638	54	52.01	19.61	1.28	0.80	57	Metal Loss	TBit	SK	Non Inspection Side
639	54	41.42	209.88	0.12	0.36	58	Metal Loss	TBit	SK	Inspection Side
640	54	7.44	212.17	0.36	0.52	60	Metal Loss	TBit	SK	Non Inspection Side
641	54	52.91	204.88	0.69	0.43	60	Metal Loss	TBit	SK	Inspection Side
642	54	51.73	167.99	0.74	0.39	60	Metal Loss	TBit	SK	Inspection Side
643	54	59.06	233.43	1.03	0.59	60	Metal Loss	TBit	SK	Inspection Side
644	54	45.87	208.15	1.19	0.61	61	Metal Loss	TBit	SK	Inspection Side
645	54	62.05	235.28	1.25	0.57	62	Metal Loss	TBit	SK	Inspection Side
646	54	12.09	237.87	0.94	0.52	63	Metal Loss	TBit	SK	Inspection Side
647	54	47.40	191.57	0.52	0.36	64	Metal Loss	TBit	SK	Inspection Side
648	54	15.47	214.02	0.87	1.00	75	Metal Loss	TBit	SK	Inspection Side
649	54	15.20	218.50	0.33	0.31	77	Metal Loss	TBit	SK	Inspection Side
650	54	8.03	190.79	0.92	1.08	96	Metal Loss	TBit	SK	Inspection Side
651	55	25.31	73.94	0.95	0.30	49	Metal Loss	TBit	SK	Inspection Side
652	55	25.59	73.98	0.64	0.32	59	Metal Loss	TBit	SK	Inspection Side
653	55	53.43	15.28	0.97	0.50	59	Metal Loss	TBit	SK	Inspection Side
654	55	28.90	74.33	0.48	0.63	66	Metal Loss	TBit	SK	Non Inspection Side
655	56	20.35	99.06	1.17	0.37	56	Metal Loss	TBit	SK	Inspection Side
656	57	30.59	27.17	0.94	0.53	53	Metal Loss	TBit	SK	Non Inspection Side
657	57	20.08	32.72	0.93	0.40	54	Metal Loss	TBit	SK	Inspection Side
658	57	28.35	27.28	0.93	0.68	71	Metal Loss	TBit	SK	Non Inspection Side
659	58	10.51	167.87	0.38	0.44	49	Metal Loss	TBit	SK	Inspection Side
660	58	21.93	75.87	0.54	0.24	49	Metal Loss	TBit	SK	Inspection Side
661	58	12.32	41.18	0.85	0.39	49	Metal Loss	TBit	SK	Inspection Side
662	58	59.13	123.94	0.98	0.42	49	Metal Loss	TBit	SK	Inspection Side
663	58	53.07	98.94	1.06	0.52	49	Metal Loss	TBit	SK	Non Inspection Side
664	58	49.41	165.83	0.48	0.34	50	Metal Loss	TBit	SK	Inspection Side
665	58	23.90	35.67	0.50	0.36	50	Metal Loss	TBit	SK	Inspection Side
666	58	49.33	135.20	0.52	0.52	50	Metal Loss	TBit	SK	Inspection Side
667	58	36.14	156.34	0.55	0.20	50	Metal Loss	TBit	SK	Inspection Side
668	58	6.42	137.87	0.55	0.49	50	Metal Loss	TBit	SK	Inspection Side
669	58	11.65	22.87	0.58	0.45	50	Metal Loss	TBit	SK	Inspection Side
670	58	22.13	19.37	0.61	0.31	50	Metal Loss	TBit	SK	Inspection Side
671	58	5.79	23.50	0.68	0.54	50	Metal Loss	TBit	SK	Non Inspection Side
672	58	47.09	38.98	0.75	0.39	50	Metal Loss	TBit	SK	Non Inspection Side
673	58	46.42	50.39	0.86	0.62	50	Metal Loss	TBit	SK	Non Inspection Side
674	58	49.92	130.39	0.92	0.41	50	Metal Loss	TBit	SK	Inspection Side
675	58	10.98	207.95	0.98	0.47	50	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
676	58	34.21	163.15	1.00	0.50	50	Metal Loss	TBit	SK	Inspection Side
677	58	18.70	106.18	1.04	0.45	50	Metal Loss	TBit	SK	Inspection Side
678	58	15.79	177.40	1.08	0.32	50	Metal Loss	TBit	SK	Inspection Side
679	58	18.90	165.79	1.16	0.56	50	Metal Loss	TBit	SK	Inspection Side
680	58	12.01	63.58	1.24	0.43	50	Metal Loss	TBit	SK	Inspection Side
681	58	22.13	132.24	1.48	0.69	50	Metal Loss	TBit	SK	Inspection Side
682	58	46.34	175.67	1.49	0.56	50	Metal Loss	TBit	SK	Inspection Side
683	58	21.61	73.82	0.44	0.24	51	Metal Loss	TBit	SK	Inspection Side
684	58	47.64	88.27	1.27	0.49	51	Metal Loss	TBit	SK	Inspection Side
685	58	49.33	42.91	1.30	0.55	51	Metal Loss	TBit	SK	Inspection Side
686	58	51.38	232.76	1.51	0.66	51	Metal Loss	TBit	SK	Inspection Side
687	58	53.46	163.86	1.53	0.63	51	Metal Loss	TBit	SK	Inspection Side
688	58	53.15	225.16	2.47	0.55	51	Metal Loss	TBit	SK	Inspection Side
689	58	9.49	176.89	0.44	0.31	52	Metal Loss	TBit	SK	Inspection Side
690	58	51.77	217.76	0.46	0.31	52	Metal Loss	TBit	SK	Inspection Side
691	58	43.43	156.85	0.64	0.30	52	Metal Loss	TBit	SK	Inspection Side
692	58	55.39	133.27	0.78	0.54	52	Metal Loss	TBit	SK	Inspection Side
693	58	38.66	15.12	0.91	0.39	52	Metal Loss	TBit	SK	Inspection Side
694	58	6.57	173.58	0.95	0.53	52	Metal Loss	TBit	SK	Inspection Side
695	58	23.82	121.02	1.15	0.52	52	Metal Loss	TBit	SK	Inspection Side
696	58	15.83	16.97	1.18	1.60	52	Metal Loss	TBit	SK	Non Inspection Side
697	58	8.50	112.32	0.58	0.37	53	Metal Loss	TBit	SK	Inspection Side
698	58	5.51	166.93	0.62	0.44	53	Metal Loss	TBit	SK	Inspection Side
699	58	52.01	29.41	0.76	0.58	53	Metal Loss	TBit	SK	Inspection Side
700	58	24.88	95.83	0.82	0.40	53	Metal Loss	TBit	SK	Inspection Side
701	58	6.42	36.10	0.88	0.51	53	Metal Loss	TBit	SK	Inspection Side
702	58	46.97	85.71	0.92	0.46	53	Metal Loss	TBit	SK	Inspection Side
703	58	60.79	99.96	0.96	0.71	53	Metal Loss	TBit	SK	Inspection Side
704	58	46.10	204.53	1.00	2.09	53	Metal Loss	TBit	SK	Non Inspection Side
705	58	61.69	164.06	1.01	0.38	53	Metal Loss	TBit	SK	Non Inspection Side
706	58	12.28	138.74	1.06	0.48	53	Metal Loss	TBit	SK	Inspection Side
707	58	52.01	116.18	1.19	0.60	53	Metal Loss	TBit	SK	Inspection Side
708	58	15.91	97.72	1.29	0.69	53	Metal Loss	TBit	SK	Inspection Side
709	58	6.42	118.74	1.31	0.44	53	Metal Loss	TBit	SK	Inspection Side
710	58	16.61	146.50	0.70	0.28	54	Metal Loss	TBit	SK	Inspection Side
711	58	21.38	215.20	1.00	0.48	54	Metal Loss	TBit	SK	Inspection Side
712	58	55.31	218.70	1.01	0.42	54	Metal Loss	TBit	SK	Inspection Side
713	58	9.29	89.37	1.09	0.42	54	Metal Loss	TBit	SK	Inspection Side
714	58	6.77	114.49	0.48	0.40	55	Metal Loss	TBit	SK	Inspection Side
715	58	14.65	10.28	0.49	0.34	55	Metal Loss	TBit	SK	Inspection Side
716	58	41.73	140.20	0.74	0.46	55	Metal Loss	TBit	SK	Inspection Side
717	58	10.51	151.69	0.82	0.37	55	Metal Loss	TBit	SK	Inspection Side
718	58	18.54	74.69	0.89	0.53	55	Metal Loss	TBit	SK	Inspection Side
719	58	38.74	137.99	0.99	0.29	55	Metal Loss	TBit	SK	Inspection Side
720	58	45.71	78.35	1.13	0.49	55	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
721	58	61.77	173.78	1.18	0.76	55	Metal Loss	TBit	SK	Non Inspection Side
722	58	45.91	139.29	1.32	0.37	55	Metal Loss	TBit	SK	Inspection Side
723	58	50.71	61.26	1.60	0.52	55	Metal Loss	TBit	SK	Inspection Side
724	58	36.10	140.63	1.61	0.72	55	Metal Loss	TBit	SK	Inspection Side
725	58	44.33	158.66	2.03	0.48	55	Metal Loss	TBit	SK	Inspection Side
726	58	12.13	122.87	0.61	0.42	56	Metal Loss	TBit	SK	Inspection Side
727	58	53.98	52.32	0.75	0.38	56	Metal Loss	TBit	SK	Inspection Side
728	58	61.97	229.92	1.09	1.19	56	Metal Loss	TBit	SK	Inspection Side
729	58	15.83	131.73	1.14	0.53	56	Metal Loss	TBit	SK	Inspection Side
730	58	15.83	20.04	1.17	0.27	56	Metal Loss	TBit	SK	Inspection Side
731	58	19.57	204.72	1.38	0.44	56	Metal Loss	TBit	SK	Non Inspection Side
732	58	9.72	93.50	0.62	0.49	57	Metal Loss	TBit	SK	Inspection Side
733	58	48.23	49.84	0.70	0.41	57	Metal Loss	TBit	SK	Inspection Side
734	58	4.69	161.10	0.96	0.51	57	Metal Loss	TBit	SK	Inspection Side
735	58	16.50	109.88	1.52	0.92	57	Metal Loss	TBit	SK	Inspection Side
736	58	9.96	238.46	1.54	0.57	57	Metal Loss	TBit	SK	Non Inspection Side
737	58	49.49	114.92	1.62	0.42	57	Metal Loss	TBit	SK	Inspection Side
738	58	18.19	103.70	1.03	0.69	58	Metal Loss	TBit	SK	Inspection Side
739	58	50.55	139.09	1.06	0.80	58	Metal Loss	TBit	SK	Inspection Side
740	58	61.42	109.96	1.12	0.39	58	Metal Loss	TBit	SK	Inspection Side
741	58	10.47	148.39	1.31	0.42	58	Metal Loss	TBit	SK	Inspection Side
742	58	45.87	150.75	1.54	0.46	58	Metal Loss	TBit	SK	Inspection Side
743	58	61.14	110.08	1.03	0.42	59	Metal Loss	TBit	SK	Inspection Side
744	58	45.04	75.63	1.34	0.88	59	Metal Loss	TBit	SK	Inspection Side
745	58	45.47	165.39	1.44	1.48	59	Metal Loss	TBit	SK	Non Inspection Side
746	58	60.94	37.05	2.27	0.47	59	Metal Loss	TBit	SK	Non Inspection Side
747	58	24.09	143.94	0.81	0.41	60	Metal Loss	TBit	SK	Inspection Side
748	58	39.69	62.32	0.93	0.41	60	Metal Loss	TBit	SK	Inspection Side
749	58	34.02	163.43	1.05	0.42	60	Metal Loss	TBit	SK	Inspection Side
750	58	60.87	32.91	2.43	0.55	60	Metal Loss	TBit	SK	Non Inspection Side
751	58	21.61	119.76	0.53	0.43	61	Metal Loss	TBit	SK	Inspection Side
752	58	21.22	168.50	0.64	0.37	61	Metal Loss	TBit	SK	Inspection Side
753	58	19.80	110.04	1.21	0.43	61	Metal Loss	TBit	SK	Inspection Side
754	58	4.88	40.91	0.57	0.38	62	Metal Loss	TBit	SK	Inspection Side
755	58	19.41	85.00	0.61	0.55	62	Metal Loss	TBit	SK	Inspection Side
756	58	10.51	66.54	1.07	0.41	62	Metal Loss	TBit	SK	Inspection Side
757	58	60.83	15.87	2.50	0.70	62	Metal Loss	TBit	SK	Non Inspection Side
758	58	36.22	149.45	0.81	0.38	63	Metal Loss	TBit	SK	Inspection Side
759	58	53.19	130.63	0.86	0.39	63	Metal Loss	TBit	SK	Inspection Side
760	58	45.31	55.94	1.59	0.67	63	Metal Loss	TBit	SK	Inspection Side
761	58	59.33	124.92	0.78	0.35	64	Metal Loss	TBit	SK	Inspection Side
762	58	43.46	153.62	0.61	0.44	65	Metal Loss	TBit	SK	Inspection Side
763	58	8.03	100.83	0.52	0.32	66	Metal Loss	TBit	SK	Inspection Side
764	58	23.43	95.83	0.69	0.34	66	Metal Loss	TBit	SK	Inspection Side
765	58	54.88	184.88	1.08	0.56	66	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
766	58	46.50	30.04	1.13	0.35	66	Metal Loss	TBit	SK	Inspection Side
767	58	47.13	97.52	1.76	0.57	66	Metal Loss	TBit	SK	Inspection Side
768	58	44.06	139.33	0.61	0.37	67	Metal Loss	TBit	SK	Non Inspection Side
769	58	48.54	155.75	0.71	0.39	67	Metal Loss	TBit	SK	Inspection Side
770	58	60.00	65.51	0.93	0.47	67	Metal Loss	TBit	SK	Inspection Side
771	58	23.11	81.89	0.98	0.31	67	Metal Loss	TBit	SK	Inspection Side
772	58	21.02	93.11	1.87	0.53	68	Metal Loss	TBit	SK	Inspection Side
773	58	39.61	148.11	0.63	0.39	69	Metal Loss	TBit	SK	Inspection Side
774	58	39.92	158.39	1.04	0.41	69	Metal Loss	TBit	SK	Inspection Side
775	58	47.13	70.12	1.31	0.45	69	Metal Loss	TBit	SK	Inspection Side
776	58	9.41	104.33	0.56	0.39	70	Metal Loss	TBit	SK	Inspection Side
777	58	47.44	139.02	0.81	0.37	70	Metal Loss	TBit	SK	Inspection Side
778	58	60.20	122.05	1.00	0.34	70	Metal Loss	TBit	SK	Inspection Side
779	58	61.18	30.43	1.80	0.56	70	Metal Loss	TBit	SK	Non Inspection Side
780	58	16.42	64.17	0.87	0.32	71	Metal Loss	TBit	SK	Inspection Side
781	58	34.13	141.57	1.28	0.58	71	Metal Loss	TBit	SK	Inspection Side
782	58	9.29	206.42	2.87	0.90	71	Metal Loss	TBit	SK	Inspection Side
783	58	50.12	133.70	0.78	0.41	73	Metal Loss	TBit	SK	Inspection Side
784	58	61.30	69.29	1.57	0.50	73	Metal Loss	TBit	SK	Non Inspection Side
785	58	13.23	236.54	1.23	1.55	74	Metal Loss	TBit	SK	Inspection Side
786	58	15.91	165.51	1.33	0.45	74	Metal Loss	TBit	SK	Inspection Side
787	58	61.22	65.55	1.73	0.72	74	Metal Loss	TBit	SK	Non Inspection Side
788	58	16.81	94.25	0.90	0.86	77	Metal Loss	TBit	SK	Inspection Side
789	58	54.02	238.27	2.14	0.90	79	Metal Loss	TBit	SK	Inspection Side
790	58	22.91	104.37	0.96	0.40	80	Metal Loss	TBit	SK	Inspection Side
791	58	38.70	141.97	0.87	0.47	81	Metal Loss	TBit	SK	Inspection Side
792	58	36.34	151.38	0.86	0.34	83	Metal Loss	TBit	SK	Inspection Side
793	58	41.34	153.90	0.75	0.38	84	Metal Loss	TBit	SK	Inspection Side
794	58	47.52	118.98	0.80	0.40	85	Metal Loss	TBit	SK	Inspection Side
795	58	61.38	26.18	1.42	0.68	87	Metal Loss	TBit	SK	Inspection Side
796	58	38.74	145.12	0.46	0.39	94	Metal Loss	TBit	SK	Inspection Side
797	58	60.12	30.63	1.14	0.43	94	Metal Loss	TBit	SK	Inspection Side
798	58	61.38	79.72	1.20	0.36	96	Metal Loss	TBit	SK	Inspection Side
799	58	51.54	127.17	1.40	0.51	96	Metal Loss	TBit	SK	Inspection Side
800	58	38.46	145.08	0.69	0.48	97	Metal Loss	TBit	SK	Inspection Side
801	58	46.18	110.75	1.20	0.85	98	Metal Loss	TBit	SK	Inspection Side
802	58	48.82	122.24	1.23	0.69	98	Metal Loss	TBit	SK	Inspection Side
803	59	59.02	191.10	0.28	0.47	49	Metal Loss	TBit	SK	Inspection Side
804	59	11.18	236.73	0.51	0.46	49	Metal Loss	TBit	SK	Inspection Side
805	59	55.16	139.21	0.80	0.31	49	Metal Loss	TBit	SK	Inspection Side
806	59	46.18	235.59	0.85	0.43	49	Metal Loss	TBit	SK	Inspection Side
807	59	56.14	28.11	0.90	0.32	49	Metal Loss	TBit	SK	Inspection Side
808	59	63.98	159.29	0.99	0.47	49	Metal Loss	TBit	SK	Inspection Side
809	59	59.41	105.00	1.16	0.41	49	Metal Loss	TBit	SK	Inspection Side
810	59	16.93	137.48	1.26	1.21	49	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
811	59	31.69	220.87	1.44	0.60	49	Metal Loss	TBit	SK	Inspection Side
812	59	11.61	226.06	0.79	0.47	50	Metal Loss	TBit	SK	Inspection Side
813	59	31.22	109.69	0.86	0.43	50	Metal Loss	TBit	SK	Inspection Side
814	59	25.51	146.50	1.42	0.76	50	Metal Loss	TBit	SK	Inspection Side
815	59	19.53	140.83	1.51	0.62	50	Metal Loss	TBit	SK	Inspection Side
816	59	32.20	13.50	1.67	0.43	50	Metal Loss	TBit	SK	Inspection Side
817	59	56.34	180.63	2.11	1.46	50	Metal Loss	TBit	SK	Inspection Side
818	59	66.14	148.19	2.46	0.67	50	Metal Loss	TBit	SK	Inspection Side
819	59	40.24	154.69	2.61	2.66	50	Metal Loss	TBit	SK	Inspection Side
820	59	55.08	15.83	0.48	0.30	51	Metal Loss	TBit	SK	Inspection Side
821	59	20.20	127.40	0.82	0.41	51	Metal Loss	TBit	SK	Inspection Side
822	59	24.09	100.47	0.87	0.40	51	Metal Loss	TBit	SK	Inspection Side
823	59	20.04	94.37	1.08	0.40	51	Metal Loss	TBit	SK	Inspection Side
824	59	29.96	236.97	1.16	0.58	51	Metal Loss	TBit	SK	Inspection Side
825	59	31.10	74.49	1.46	0.89	51	Metal Loss	TBit	SK	Inspection Side
826	59	24.92	235.00	0.70	0.46	52	Metal Loss	TBit	SK	Inspection Side
827	59	31.89	206.61	0.92	0.25	52	Metal Loss	TBit	SK	Inspection Side
828	59	32.52	129.17	1.14	0.67	52	Metal Loss	TBit	SK	Inspection Side
829	59	31.69	16.57	1.26	0.21	52	Metal Loss	TBit	SK	Inspection Side
830	59	43.03	153.23	1.27	0.66	52	Metal Loss	TBit	SK	Inspection Side
831	59	61.02	38.90	1.33	0.61	52	Metal Loss	TBit	SK	Inspection Side
832	59	35.35	127.95	0.43	0.32	53	Metal Loss	TBit	SK	Inspection Side
833	59	17.60	149.25	0.70	0.41	53	Metal Loss	TBit	SK	Inspection Side
834	59	30.51	128.07	0.78	0.25	53	Metal Loss	TBit	SK	Inspection Side
835	59	32.01	210.16	0.86	0.40	53	Metal Loss	TBit	SK	Inspection Side
836	59	45.35	136.46	0.86	2.06	53	Metal Loss	TBit	SK	Non Inspection Side
837	59	55.55	38.90	1.05	0.32	53	Metal Loss	TBit	SK	Inspection Side
838	59	54.72	233.70	1.24	0.66	53	Metal Loss	TBit	SK	Inspection Side
839	59	29.02	208.86	1.37	0.53	53	Metal Loss	TBit	SK	Inspection Side
840	59	25.20	95.55	1.76	0.80	53	Metal Loss	TBit	SK	Inspection Side
841	59	59.37	159.92	0.17	0.51	54	Metal Loss	TBit	SK	Non Inspection Side
842	59	27.05	218.27	0.67	0.43	54	Metal Loss	TBit	SK	Inspection Side
843	59	32.01	95.31	0.79	0.94	54	Metal Loss	TBit	SK	Inspection Side
844	59	17.20	166.77	0.88	0.42	54	Metal Loss	TBit	SK	Inspection Side
845	59	53.66	134.29	1.04	0.44	54	Metal Loss	TBit	SK	Inspection Side
846	59	16.06	198.43	1.20	1.80	54	Metal Loss	TBit	SK	Non Inspection Side
847	59	53.46	230.67	0.87	0.54	55	Metal Loss	TBit	SK	Inspection Side
848	59	58.58	18.35	0.98	0.58	55	Metal Loss	TBit	SK	Inspection Side
849	59	28.19	70.94	1.26	0.58	55	Metal Loss	TBit	SK	Inspection Side
850	59	30.12	120.98	1.57	0.61	55	Metal Loss	TBit	SK	Non Inspection Side
851	59	16.57	23.27	2.25	0.83	55	Metal Loss	TBit	SK	Non Inspection Side
852	59	27.91	65.55	0.67	0.32	56	Metal Loss	TBit	SK	Inspection Side
853	59	30.31	197.13	0.84	0.30	56	Metal Loss	TBit	SK	Inspection Side
854	59	32.24	162.60	1.85	0.65	56	Metal Loss	TBit	SK	Non Inspection Side
855	59	17.05	216.14	0.97	0.37	57	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
856	59	61.61	162.40	1.03	0.47	57	Metal Loss	TBit	SK	Inspection Side
857	59	25.00	205.00	1.26	0.73	57	Metal Loss	TBit	SK	Inspection Side
858	59	16.14	140.75	1.39	0.85	57	Metal Loss	TBit	SK	Inspection Side
859	59	25.12	58.39	1.68	0.73	57	Metal Loss	TBit	SK	Inspection Side
860	59	59.45	220.12	0.55	0.36	58	Metal Loss	TBit	SK	Inspection Side
861	59	30.87	201.61	0.64	0.31	58	Metal Loss	TBit	SK	Inspection Side
862	59	54.84	48.46	0.88	0.50	58	Metal Loss	TBit	SK	Inspection Side
863	59	28.90	83.66	1.02	0.50	58	Metal Loss	TBit	SK	Inspection Side
864	59	32.52	215.39	1.28	1.02	58	Metal Loss	TBit	SK	Non Inspection Side
865	59	28.90	73.94	1.34	0.50	58	Metal Loss	TBit	SK	Inspection Side
866	59	16.22	24.09	1.37	0.40	58	Metal Loss	TBit	SK	Inspection Side
867	59	11.02	235.79	1.01	0.50	59	Metal Loss	TBit	SK	Inspection Side
868	59	61.93	20.24	1.20	1.49	59	Metal Loss	TBit	SK	Non Inspection Side
869	59	27.72	46.97	0.94	0.46	60	Metal Loss	TBit	SK	Inspection Side
870	59	16.06	145.31	1.23	0.29	60	Metal Loss	TBit	SK	Inspection Side
871	59	29.29	129.88	1.35	0.36	60	Metal Loss	TBit	SK	Inspection Side
872	59	50.12	50.87	0.66	0.38	61	Metal Loss	TBit	SK	Inspection Side
873	59	28.70	210.59	0.75	0.43	61	Metal Loss	TBit	SK	Inspection Side
874	59	26.69	68.27	0.83	0.97	61	Metal Loss	TBit	SK	Inspection Side
875	59	62.87	159.72	1.04	0.60	61	Metal Loss	TBit	SK	Inspection Side
876	59	56.02	194.13	1.14	0.39	61	Metal Loss	TBit	SK	Inspection Side
877	59	15.91	217.48	0.91	0.35	62	Metal Loss	TBit	SK	Inspection Side
878	59	59.33	25.47	1.33	0.36	62	Metal Loss	TBit	SK	Inspection Side
879	59	31.18	153.78	3.94	1.14	62	Metal Loss	TBit	SK	Non Inspection Side
880	59	57.28	132.72	0.48	0.32	64	Metal Loss	TBit	SK	Inspection Side
881	59	53.43	30.24	0.56	0.46	64	Metal Loss	TBit	SK	Inspection Side
882	59	24.33	107.99	0.58	0.22	64	Metal Loss	TBit	SK	Non Inspection Side
883	59	16.14	128.98	1.11	0.40	64	Metal Loss	TBit	SK	Inspection Side
884	59	59.06	191.93	1.12	0.37	66	Metal Loss	TBit	SK	Inspection Side
885	59	67.17	146.65	0.79	0.40	67	Metal Loss	TBit	SK	Inspection Side
886	59	57.64	186.10	0.85	0.36	67	Metal Loss	TBit	SK	Inspection Side
887	59	53.50	47.60	0.98	0.35	67	Metal Loss	TBit	SK	Inspection Side
888	59	32.52	75.91	1.32	0.71	67	Metal Loss	TBit	SK	Non Inspection Side
889	59	32.09	133.31	1.17	0.29	68	Metal Loss	TBit	SK	Inspection Side
890	59	59.84	148.35	1.30	0.61	68	Metal Loss	TBit	SK	Inspection Side
891	59	37.32	236.26	0.73	0.36	69	Metal Loss	TBit	SK	Inspection Side
892	59	31.93	154.13	2.24	1.62	70	Metal Loss	TBit	SK	Non Inspection Side
893	59	16.06	116.02	1.25	0.29	72	Metal Loss	TBit	SK	Inspection Side
894	59	62.09	50.59	1.01	0.35	73	Metal Loss	TBit	SK	Inspection Side
895	59	54.61	13.94	1.07	0.48	73	Metal Loss	TBit	SK	Inspection Side
896	59	16.22	83.90	1.31	0.35	73	Metal Loss	TBit	SK	Inspection Side
897	59	56.06	180.75	2.22	1.45	74	Metal Loss	TBit	SK	Inspection Side
898	59	32.56	120.55	1.22	0.83	75	Metal Loss	TBit	SK	Inspection Side
899	59	32.56	193.70	1.22	0.44	75	Metal Loss	TBit	SK	Inspection Side
900	59	16.93	148.74	2.20	0.73	76	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
901	59	17.05	170.31	0.89	0.38	77	Metal Loss	TBit	SK	Inspection Side
902	59	32.01	223.62	0.94	0.37	80	Metal Loss	TBit	SK	Inspection Side
903	59	32.52	60.79	1.15	0.38	82	Metal Loss	TBit	SK	Inspection Side
904	59	29.92	175.20	0.85	0.46	83	Metal Loss	TBit	SK	Inspection Side
905	59	32.28	95.16	1.80	0.80	84	Metal Loss	TBit	SK	Inspection Side
906	59	16.42	127.56	1.03	0.43	86	Metal Loss	TBit	SK	Inspection Side
907	59	30.43	53.43	0.85	0.41	88	Metal Loss	TBit	SK	Inspection Side
908	59	16.81	119.72	1.09	0.43	91	Metal Loss	TBit	SK	Inspection Side
909	59	59.53	19.17	1.04	0.41	97	Metal Loss	TBit	SK	Inspection Side
910	60	52.60	13.58	0.92	0.56	49	Metal Loss	TBit	SK	Inspection Side
911	60	29.76	206.69	1.03	0.35	49	Metal Loss	TBit	SK	Inspection Side
912	60	40.12	132.44	1.06	0.76	49	Metal Loss	TBit	SK	Inspection Side
913	60	22.36	177.17	1.10	0.72	49	Metal Loss	TBit	SK	Non Inspection Side
914	60	56.50	215.98	1.41	0.31	49	Metal Loss	TBit	SK	Inspection Side
915	60	58.70	13.58	1.43	0.39	49	Metal Loss	TBit	SK	Inspection Side
916	60	8.74	90.31	1.56	0.68	49	Metal Loss	TBit	SK	Inspection Side
917	60	65.28	119.09	1.70	0.72	49	Metal Loss	TBit	SK	Inspection Side
918	60	3.43	25.04	0.44	0.29	50	Metal Loss	TBit	SK	Non Inspection Side
919	60	56.69	206.34	0.58	0.30	50	Metal Loss	TBit	SK	Inspection Side
920	60	42.44	28.54	0.90	0.55	50	Metal Loss	TBit	SK	Inspection Side
921	60	15.79	119.21	0.96	0.48	50	Metal Loss	TBit	SK	Inspection Side
922	60	53.15	122.05	0.45	0.37	51	Metal Loss	TBit	SK	Inspection Side
923	60	38.46	8.19	0.78	0.41	51	Metal Loss	TBit	SK	Inspection Side
924	60	4.92	36.97	0.83	0.54	51	Metal Loss	TBit	SK	Inspection Side
925	60	60.08	87.40	0.93	0.38	51	Metal Loss	TBit	SK	Inspection Side
926	60	64.80	172.40	1.93	0.37	51	Metal Loss	TBit	SK	Inspection Side
927	60	43.82	84.88	0.54	0.30	52	Metal Loss	TBit	SK	Inspection Side
928	60	47.72	122.13	0.63	0.47	52	Metal Loss	TBit	SK	Inspection Side
929	60	3.62	20.20	0.66	0.60	52	Metal Loss	TBit	SK	Inspection Side
930	60	57.20	136.93	0.75	0.36	52	Metal Loss	TBit	SK	Inspection Side
931	60	60.20	197.76	0.80	0.40	52	Metal Loss	TBit	SK	Inspection Side
932	60	32.48	202.09	0.96	0.44	52	Metal Loss	TBit	SK	Inspection Side
933	60	27.17	74.65	0.99	0.46	52	Metal Loss	TBit	SK	Inspection Side
934	60	36.65	102.24	0.46	0.47	53	Metal Loss	TBit	SK	Non Inspection Side
935	60	31.85	222.95	0.53	0.50	53	Metal Loss	TBit	SK	Inspection Side
936	60	55.75	28.66	0.67	0.44	53	Metal Loss	TBit	SK	Inspection Side
937	60	4.65	32.24	0.80	0.42	53	Metal Loss	TBit	SK	Inspection Side
938	60	44.09	238.19	0.82	0.42	53	Metal Loss	TBit	SK	Inspection Side
939	60	61.38	187.44	0.89	0.53	53	Metal Loss	TBit	SK	Inspection Side
940	60	50.39	118.23	1.00	0.52	53	Metal Loss	TBit	SK	Inspection Side
941	60	23.66	133.70	1.22	0.39	53	Metal Loss	TBit	SK	Inspection Side
942	60	13.43	63.90	1.28	0.48	53	Metal Loss	TBit	SK	Inspection Side
943	60	19.09	215.31	2.01	1.11	53	Metal Loss	TBit	SK	Inspection Side
944	60	65.47	161.57	2.96	1.05	53	Metal Loss	TBit	SK	Inspection Side
945	60	66.61	117.83	0.38	0.23	54	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
946	60	55.75	141.73	0.52	0.38	54	Metal Loss	TBit	SK	Inspection Side
947	60	62.76	136.93	0.89	0.47	54	Metal Loss	TBit	SK	Inspection Side
948	60	6.10	26.46	0.45	0.39	55	Metal Loss	TBit	SK	Inspection Side
949	60	48.74	182.52	0.70	0.45	55	Metal Loss	TBit	SK	Inspection Side
950	60	69.09	118.19	1.17	0.62	55	Metal Loss	TBit	SK	Inspection Side
951	60	29.88	198.50	1.29	0.25	55	Metal Loss	TBit	SK	Inspection Side
952	60	27.68	103.35	1.59	0.55	55	Metal Loss	TBit	SK	Inspection Side
953	60	51.81	46.46	1.68	0.51	55	Metal Loss	TBit	SK	Inspection Side
954	60	32.32	199.69	0.49	0.49	56	Metal Loss	TBit	SK	Inspection Side
955	60	65.35	117.60	0.54	0.38	56	Metal Loss	TBit	SK	Non Inspection Side
956	60	8.54	84.53	0.55	0.24	56	Metal Loss	TBit	SK	Non Inspection Side
957	60	44.02	181.73	0.75	0.33	56	Metal Loss	TBit	SK	Inspection Side
958	60	4.92	47.87	1.02	0.64	56	Metal Loss	TBit	SK	Inspection Side
959	60	8.27	92.13	0.76	0.65	57	Metal Loss	TBit	SK	Inspection Side
960	60	50.16	135.75	0.91	0.51	57	Metal Loss	TBit	SK	Inspection Side
961	60	53.19	201.06	1.27	0.72	57	Metal Loss	TBit	SK	Non Inspection Side
962	60	6.93	93.98	1.66	0.51	57	Metal Loss	TBit	SK	Inspection Side
963	60	66.50	157.99	0.60	0.38	58	Metal Loss	TBit	SK	Inspection Side
964	60	33.78	176.06	1.15	0.45	58	Metal Loss	TBit	SK	Inspection Side
965	60	58.70	209.92	1.24	0.49	58	Metal Loss	TBit	SK	Inspection Side
966	60	26.38	100.75	1.27	0.60	58	Metal Loss	TBit	SK	Inspection Side
967	60	55.59	141.46	0.63	0.40	59	Metal Loss	TBit	SK	Inspection Side
968	60	23.70	222.32	0.73	0.42	59	Metal Loss	TBit	SK	Inspection Side
969	60	61.69	125.28	1.00	0.51	59	Metal Loss	TBit	SK	Inspection Side
970	60	46.30	180.47	1.27	0.47	60	Metal Loss	TBit	SK	Inspection Side
971	60	65.00	136.38	1.10	0.62	61	Metal Loss	TBit	SK	Inspection Side
972	60	32.32	47.44	1.25	0.41	61	Metal Loss	TBit	SK	Inspection Side
973	60	46.10	173.58	1.66	0.50	62	Metal Loss	TBit	SK	Non Inspection Side
974	60	36.46	101.14	0.58	0.38	63	Metal Loss	TBit	SK	Inspection Side
975	60	6.81	33.54	1.03	0.59	63	Metal Loss	TBit	SK	Inspection Side
976	60	26.30	99.02	1.16	0.46	63	Metal Loss	TBit	SK	Inspection Side
977	60	44.33	186.46	1.21	0.97	63	Metal Loss	TBit	SK	Inspection Side
978	60	29.69	211.14	0.93	0.34	64	Metal Loss	TBit	SK	Inspection Side
979	60	57.68	195.24	1.05	0.63	64	Metal Loss	TBit	SK	Inspection Side
980	60	56.42	187.87	0.73	0.36	69	Metal Loss	TBit	SK	Inspection Side
981	60	30.16	178.19	1.86	0.50	70	Metal Loss	TBit	SK	Non Inspection Side
982	60	45.35	171.22	1.26	0.79	75	Metal Loss	TBit	SK	Inspection Side
983	60	32.01	190.31	0.82	0.40	76	Metal Loss	TBit	SK	Inspection Side
984	60	30.79	198.31	0.92	0.31	76	Metal Loss	TBit	SK	Inspection Side
985	60	16.22	86.22	2.28	1.54	76	Metal Loss	TBit	SK	Non Inspection Side
986	60	40.79	104.84	2.45	0.69	76	Metal Loss	TBit	SK	Inspection Side
987	60	52.76	17.44	0.47	0.34	79	Metal Loss	TBit	SK	Inspection Side
988	60	57.40	199.45	0.80	0.40	80	Metal Loss	TBit	SK	Inspection Side
989	60	4.02	87.44	1.22	0.99	86	Metal Loss	TBit	SK	Inspection Side
990	60	44.21	182.87	0.84	0.40	95	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
991	60	4.76	180.75	1.02	0.36	97	Metal Loss	TBit	SK	Inspection Side
992	60	57.20	202.44	1.04	0.50	97	Metal Loss	TBit	SK	Inspection Side
993	60	61.50	191.06	1.42	0.43	98	Metal Loss	TBit	SK	Inspection Side
994	60	53.90	88.62	1.50	0.75	98	Metal Loss	TBit	SK	Inspection Side
995	61	11.46	40.28	1.76	0.44	51	Metal Loss	TBit	SK	Inspection Side
996	61	11.69	40.51	1.04	0.42	54	Metal Loss	TBit	SK	Inspection Side
997	61	51.02	45.31	1.03	0.41	56	Metal Loss	TBit	SK	Inspection Side
998	62	39.80	14.29	0.74	0.47	55	Metal Loss	TBit	SK	Inspection Side
999	62	13.58	31.69	0.65	0.33	58	Metal Loss	TBit	SK	Inspection Side
1000	62	45.12	35.75	0.81	0.28	58	Metal Loss	TBit	SK	Inspection Side
1001	62	24.02	17.48	1.27	0.92	59	Metal Loss	TBit	SK	Inspection Side
1002	62	8.90	23.58	1.77	1.47	98	Metal Loss	TBit	SK	Inspection Side
1003	62	25.67	20.24	2.55	1.24	98	Metal Loss	TBit	SK	Inspection Side
1004	63	56.73	207.68	0.28	0.57	49	Metal Loss	TBit	SK	Inspection Side
1005	63	50.51	76.34	0.40	0.36	49	Metal Loss	TBit	SK	Inspection Side
1006	63	37.64	191.65	0.47	0.38	49	Metal Loss	TBit	SK	Inspection Side
1007	63	7.87	180.16	0.84	0.45	49	Metal Loss	TBit	SK	Inspection Side
1008	63	53.23	36.10	0.85	0.56	49	Metal Loss	TBit	SK	Inspection Side
1009	63	38.54	159.72	1.17	0.72	49	Metal Loss	TBit	SK	Inspection Side
1010	63	54.57	160.83	0.31	0.32	50	Metal Loss	TBit	SK	Inspection Side
1011	63	53.31	202.95	0.54	0.54	50	Metal Loss	TBit	SK	Inspection Side
1012	63	54.09	109.96	0.89	0.74	50	Metal Loss	TBit	SK	Inspection Side
1013	63	37.76	121.85	0.96	0.36	50	Metal Loss	TBit	SK	Inspection Side
1014	63	13.27	167.95	1.02	0.46	50	Metal Loss	TBit	SK	Inspection Side
1015	63	20.79	206.77	1.08	0.61	50	Metal Loss	TBit	SK	Inspection Side
1016	63	63.31	216.06	0.12	0.54	51	Metal Loss	TBit	SK	Inspection Side
1017	63	55.39	207.56	0.27	0.55	51	Metal Loss	TBit	SK	Inspection Side
1018	63	53.23	204.69	0.56	0.42	51	Metal Loss	TBit	SK	Inspection Side
1019	63	56.10	192.28	0.69	0.48	51	Metal Loss	TBit	SK	Inspection Side
1020	63	61.10	215.51	0.12	0.33	52	Metal Loss	TBit	SK	Inspection Side
1021	63	10.55	45.31	0.21	0.36	52	Metal Loss	TBit	SK	Inspection Side
1022	63	54.72	211.61	0.64	0.50	52	Metal Loss	TBit	SK	Inspection Side
1023	63	62.48	42.68	0.79	0.30	52	Metal Loss	TBit	SK	Inspection Side
1024	63	24.13	13.86	1.42	0.76	52	Metal Loss	TBit	SK	Inspection Side
1025	63	57.72	190.04	0.48	0.41	53	Metal Loss	TBit	SK	Inspection Side
1026	63	42.17	12.68	0.50	0.46	53	Metal Loss	TBit	SK	Inspection Side
1027	63	56.38	188.27	0.70	0.33	53	Metal Loss	TBit	SK	Inspection Side
1028	63	40.59	156.85	0.91	0.51	53	Metal Loss	TBit	SK	Inspection Side
1029	63	54.57	126.26	1.18	0.27	53	Metal Loss	TBit	SK	Inspection Side
1030	63	62.20	168.23	1.19	0.55	53	Metal Loss	TBit	SK	Inspection Side
1031	63	62.80	151.22	1.54	0.33	53	Metal Loss	TBit	SK	Inspection Side
1032	63	63.11	216.02	0.33	0.49	54	Metal Loss	TBit	SK	Inspection Side
1033	63	61.69	34.96	0.69	0.33	54	Metal Loss	TBit	SK	Inspection Side
1034	63	20.31	13.94	0.91	0.57	54	Metal Loss	TBit	SK	Inspection Side
1035	63	13.07	49.33	1.04	0.47	54	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1036	63	58.78	196.65	0.38	0.34	55	Metal Loss	TBit	SK	Inspection Side
1037	63	16.77	32.76	0.57	0.41	55	Metal Loss	TBit	SK	Inspection Side
1038	63	66.81	187.64	0.58	0.44	55	Metal Loss	TBit	SK	Inspection Side
1039	63	55.59	160.87	0.76	0.32	55	Metal Loss	TBit	SK	Inspection Side
1040	63	59.33	139.25	1.04	0.54	55	Metal Loss	TBit	SK	Inspection Side
1041	63	58.07	172.36	1.21	0.39	55	Metal Loss	TBit	SK	Inspection Side
1042	63	51.30	147.48	0.49	0.39	56	Metal Loss	TBit	SK	Inspection Side
1043	63	37.09	146.02	0.73	0.44	56	Metal Loss	TBit	SK	Inspection Side
1044	63	14.09	154.41	0.76	0.34	56	Metal Loss	TBit	SK	Inspection Side
1045	63	38.43	204.57	0.66	0.41	57	Metal Loss	TBit	SK	Inspection Side
1046	63	52.99	192.24	0.73	0.39	57	Metal Loss	TBit	SK	Inspection Side
1047	63	60.24	94.25	1.08	0.63	57	Metal Loss	TBit	SK	Inspection Side
1048	63	9.21	202.48	0.53	0.41	58	Metal Loss	TBit	SK	Inspection Side
1049	63	60.39	196.22	0.81	0.34	58	Metal Loss	TBit	SK	Inspection Side
1050	63	15.12	50.28	0.66	0.42	59	Metal Loss	TBit	SK	Inspection Side
1051	63	46.38	115.16	0.82	0.23	59	Metal Loss	TBit	SK	Inspection Side
1052	63	62.99	123.23	1.42	0.38	60	Metal Loss	TBit	SK	Inspection Side
1053	63	55.59	128.11	0.55	0.33	61	Metal Loss	TBit	SK	Inspection Side
1054	63	50.94	145.71	0.87	0.49	61	Metal Loss	TBit	SK	Inspection Side
1055	63	58.90	121.26	1.39	0.61	61	Metal Loss	TBit	SK	Inspection Side
1056	63	38.90	145.04	0.72	0.45	62	Metal Loss	TBit	SK	Inspection Side
1057	63	57.28	158.19	0.56	0.35	63	Metal Loss	TBit	SK	Inspection Side
1058	63	60.24	88.70	0.99	0.42	63	Metal Loss	TBit	SK	Inspection Side
1059	63	57.72	142.09	1.72	0.48	63	Metal Loss	TBit	SK	Inspection Side
1060	63	14.80	207.68	0.51	0.39	65	Metal Loss	TBit	SK	Inspection Side
1061	63	56.73	127.99	0.67	0.32	65	Metal Loss	TBit	SK	Inspection Side
1062	63	40.28	172.80	0.52	0.44	66	Metal Loss	TBit	SK	Inspection Side
1063	63	59.17	191.54	0.70	0.39	66	Metal Loss	TBit	SK	Inspection Side
1064	63	53.46	148.54	1.44	0.29	66	Metal Loss	TBit	SK	Inspection Side
1065	63	56.61	153.31	0.86	0.45	69	Metal Loss	TBit	SK	Inspection Side
1066	63	57.48	192.28	0.64	0.37	71	Metal Loss	TBit	SK	Inspection Side
1067	63	60.20	160.04	0.59	0.36	72	Metal Loss	TBit	SK	Inspection Side
1068	63	62.48	130.04	2.71	0.68	72	Metal Loss	TBit	SK	Inspection Side
1069	63	60.12	169.61	1.31	0.39	74	Metal Loss	TBit	SK	Inspection Side
1070	63	57.01	135.12	0.89	0.43	79	Metal Loss	TBit	SK	Inspection Side
1071	63	62.80	197.24	1.00	0.40	79	Metal Loss	TBit	SK	Inspection Side
1072	63	53.27	107.13	1.09	0.33	89	Metal Loss	TBit	SK	Inspection Side
1073	63	59.41	135.31	1.07	0.39	97	Metal Loss	TBit	SK	Inspection Side
1074	63	60.20	167.05	2.01	0.63	97	Metal Loss	TBit	SK	Inspection Side
1075	64	54.29	102.80	0.48	0.35	49	Metal Loss	TBit	SK	Inspection Side
1076	64	39.13	55.20	0.54	0.23	49	Metal Loss	TBit	SK	Inspection Side
1077	64	60.24	187.68	0.56	0.29	49	Metal Loss	TBit	SK	Inspection Side
1078	64	6.18	15.28	0.56	0.41	49	Metal Loss	TBit	SK	Inspection Side
1079	64	11.42	62.80	0.56	0.48	49	Metal Loss	TBit	SK	Inspection Side
1080	64	3.19	79.84	0.63	0.42	49	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1081	64	49.33	14.41	0.67	0.32	49	Metal Loss	TBit	SK	Inspection Side
1082	64	54.49	81.10	0.86	0.29	49	Metal Loss	TBit	SK	Inspection Side
1083	64	19.80	190.08	0.92	0.41	49	Metal Loss	TBit	SK	Inspection Side
1084	64	10.12	111.18	0.99	0.32	49	Metal Loss	TBit	SK	Inspection Side
1085	64	11.89	91.30	1.11	0.85	49	Metal Loss	TBit	SK	Inspection Side
1086	64	17.36	115.31	1.46	0.38	49	Metal Loss	TBit	SK	Inspection Side
1087	64	52.44	15.12	1.52	0.60	49	Metal Loss	TBit	SK	Inspection Side
1088	64	65.71	35.94	1.62	0.52	49	Metal Loss	TBit	SK	Inspection Side
1089	64	60.79	145.51	0.44	0.57	50	Metal Loss	TBit	SK	Non Inspection Side
1090	64	55.28	50.91	0.55	0.33	50	Metal Loss	TBit	SK	Inspection Side
1091	64	57.95	74.13	0.55	0.38	50	Metal Loss	TBit	SK	Inspection Side
1092	64	39.84	211.89	0.97	0.49	50	Metal Loss	TBit	SK	Inspection Side
1093	64	9.41	169.88	1.23	0.51	50	Metal Loss	TBit	SK	Inspection Side
1094	64	57.87	173.27	1.00	0.38	51	Metal Loss	TBit	SK	Inspection Side
1095	64	61.69	41.54	1.47	0.73	51	Metal Loss	TBit	SK	Inspection Side
1096	64	10.67	92.28	0.34	0.49	52	Metal Loss	TBit	SK	Inspection Side
1097	64	57.60	37.56	0.40	0.32	52	Metal Loss	TBit	SK	Inspection Side
1098	64	4.72	46.18	0.45	0.43	52	Metal Loss	TBit	SK	Inspection Side
1099	64	20.67	11.14	0.61	0.46	52	Metal Loss	TBit	SK	Inspection Side
1100	64	6.69	172.05	0.77	0.40	52	Metal Loss	TBit	SK	Inspection Side
1101	64	66.81	56.57	0.99	0.47	52	Metal Loss	TBit	SK	Inspection Side
1102	64	16.02	104.17	1.02	0.74	52	Metal Loss	TBit	SK	Inspection Side
1103	64	36.93	92.87	1.04	0.36	52	Metal Loss	TBit	SK	Inspection Side
1104	64	13.39	131.50	1.19	0.51	52	Metal Loss	TBit	SK	Inspection Side
1105	64	59.17	102.36	1.24	0.67	52	Metal Loss	TBit	SK	Inspection Side
1106	64	56.61	110.87	1.46	0.53	52	Metal Loss	TBit	SK	Inspection Side
1107	64	12.48	95.71	2.02	0.59	52	Metal Loss	TBit	SK	Inspection Side
1108	64	39.21	45.39	0.59	0.37	53	Metal Loss	TBit	SK	Inspection Side
1109	64	19.80	228.74	0.62	0.39	53	Metal Loss	TBit	SK	Inspection Side
1110	64	7.64	55.20	0.62	0.56	53	Metal Loss	TBit	SK	Inspection Side
1111	64	41.34	190.43	0.69	0.46	53	Metal Loss	TBit	SK	Inspection Side
1112	64	13.31	118.98	0.71	0.44	53	Metal Loss	TBit	SK	Inspection Side
1113	64	20.28	8.66	0.89	0.46	53	Metal Loss	TBit	SK	Inspection Side
1114	64	3.66	58.11	1.08	0.65	53	Metal Loss	TBit	SK	Inspection Side
1115	64	58.07	225.39	1.23	0.49	53	Metal Loss	TBit	SK	Inspection Side
1116	64	4.49	134.09	1.27	0.50	53	Metal Loss	TBit	SK	Inspection Side
1117	64	53.50	67.95	1.51	0.68	53	Metal Loss	TBit	SK	Non Inspection Side
1118	64	42.64	43.98	1.85	0.40	53	Metal Loss	TBit	SK	Inspection Side
1119	64	9.02	157.05	0.27	0.39	54	Metal Loss	TBit	SK	Inspection Side
1120	64	60.51	164.29	0.41	0.28	54	Metal Loss	TBit	SK	Inspection Side
1121	64	44.45	82.09	0.57	0.39	54	Metal Loss	TBit	SK	Inspection Side
1122	64	9.29	97.91	0.77	0.43	54	Metal Loss	TBit	SK	Inspection Side
1123	64	33.94	105.75	0.80	0.46	54	Metal Loss	TBit	SK	Inspection Side
1124	64	50.87	16.10	0.81	0.33	54	Metal Loss	TBit	SK	Inspection Side
1125	64	6.89	34.41	0.94	0.37	54	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1126	64	44.88	166.34	1.13	0.86	54	Metal Loss	TBit	SK	Inspection Side
1127	64	18.43	95.35	0.65	0.42	55	Metal Loss	TBit	SK	Inspection Side
1128	64	39.76	48.78	0.36	0.33	56	Metal Loss	TBit	SK	Inspection Side
1129	64	56.34	102.95	0.54	0.36	56	Metal Loss	TBit	SK	Inspection Side
1130	64	18.35	118.58	0.83	0.42	56	Metal Loss	TBit	SK	Inspection Side
1131	64	7.09	130.43	0.86	0.52	56	Metal Loss	TBit	SK	Inspection Side
1132	64	53.46	224.17	1.25	0.48	56	Metal Loss	TBit	SK	Inspection Side
1133	64	14.02	26.65	1.01	0.47	57	Metal Loss	TBit	SK	Inspection Side
1134	64	10.12	18.11	1.15	0.52	57	Metal Loss	TBit	SK	Inspection Side
1135	64	7.48	156.42	1.21	0.56	57	Metal Loss	TBit	SK	Inspection Side
1136	64	63.39	139.69	2.33	0.39	57	Metal Loss	TBit	SK	Inspection Side
1137	64	65.20	121.18	0.53	0.47	58	Metal Loss	TBit	SK	Inspection Side
1138	64	64.17	192.80	1.32	0.40	58	Metal Loss	TBit	SK	Inspection Side
1139	64	62.32	236.69	1.43	0.82	58	Metal Loss	TBit	SK	Inspection Side
1140	64	58.78	178.46	2.28	0.41	58	Metal Loss	TBit	SK	Inspection Side
1141	64	7.09	69.72	0.40	0.32	59	Metal Loss	TBit	SK	Inspection Side
1142	64	25.28	94.76	0.44	0.40	59	Metal Loss	TBit	SK	Inspection Side
1143	64	5.59	74.21	0.69	0.39	59	Metal Loss	TBit	SK	Inspection Side
1144	64	60.79	138.15	0.97	0.75	59	Metal Loss	TBit	SK	Inspection Side
1145	64	39.84	54.17	0.48	0.34	60	Metal Loss	TBit	SK	Inspection Side
1146	64	7.17	77.60	1.27	0.66	60	Metal Loss	TBit	SK	Inspection Side
1147	64	32.52	99.33	0.48	0.39	61	Metal Loss	TBit	SK	Inspection Side
1148	64	35.31	132.05	0.50	0.46	61	Metal Loss	TBit	SK	Inspection Side
1149	64	5.12	128.19	0.64	0.44	61	Metal Loss	TBit	SK	Inspection Side
1150	64	63.50	68.15	0.65	0.49	61	Metal Loss	TBit	SK	Non Inspection Side
1151	64	8.70	45.87	0.77	0.61	61	Metal Loss	TBit	SK	Inspection Side
1152	64	12.95	106.69	0.57	0.31	62	Metal Loss	TBit	SK	Inspection Side
1153	64	59.92	122.05	1.10	0.41	62	Metal Loss	TBit	SK	Inspection Side
1154	64	3.39	122.01	0.67	0.40	63	Metal Loss	TBit	SK	Inspection Side
1155	64	9.57	123.43	1.52	0.91	63	Metal Loss	TBit	SK	Inspection Side
1156	64	34.76	55.12	0.49	0.41	64	Metal Loss	TBit	SK	Inspection Side
1157	64	38.35	51.97	0.74	0.46	64	Metal Loss	TBit	SK	Inspection Side
1158	64	3.90	120.94	0.93	0.43	64	Metal Loss	TBit	SK	Inspection Side
1159	64	58.70	120.35	0.69	0.43	65	Metal Loss	TBit	SK	Inspection Side
1160	64	3.98	131.14	0.66	0.63	67	Metal Loss	TBit	SK	Inspection Side
1161	64	60.71	107.01	1.22	0.35	67	Metal Loss	TBit	SK	Inspection Side
1162	64	62.80	138.15	1.04	0.48	69	Metal Loss	TBit	SK	Inspection Side
1163	64	57.64	190.67	1.00	0.50	71	Metal Loss	TBit	SK	Inspection Side
1164	64	53.50	96.73	1.03	0.43	71	Metal Loss	TBit	SK	Inspection Side
1165	64	62.28	53.50	0.90	0.45	72	Metal Loss	TBit	SK	Inspection Side
1166	64	59.33	78.82	1.03	0.56	72	Metal Loss	TBit	SK	Inspection Side
1167	64	61.46	115.12	0.84	0.39	74	Metal Loss	TBit	SK	Inspection Side
1168	64	38.50	109.25	0.79	0.36	75	Metal Loss	TBit	SK	Inspection Side
1169	64	55.00	12.68	1.71	0.88	77	Metal Loss	TBit	SK	Inspection Side
1170	64	60.39	175.63	0.64	0.48	79	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1171	64	63.07	64.41	0.91	0.58	83	Metal Loss	TBit	SK	Inspection Side
1172	64	53.82	94.49	1.17	0.63	85	Metal Loss	TBit	SK	Inspection Side
1173	64	8.70	115.43	1.50	0.53	90	Metal Loss	TBit	SK	Inspection Side
1174	64	63.50	144.72	0.81	0.39	92	Metal Loss	TBit	SK	Inspection Side
1175	64	57.95	67.44	0.72	0.45	95	Metal Loss	TBit	SK	Inspection Side
1176	64	58.07	149.57	2.16	0.81	97	Metal Loss	TBit	SK	Inspection Side
1177	65	23.54	134.25	0.50	0.40	49	Metal Loss	TBit	SK	Inspection Side
1178	65	59.41	152.36	0.78	1.68	49	Metal Loss	TBit	SK	Inspection Side
1179	65	56.73	222.09	0.95	0.36	49	Metal Loss	TBit	SK	Inspection Side
1180	65	10.04	13.74	1.21	0.40	49	Metal Loss	TBit	SK	Inspection Side
1181	65	13.15	223.15	2.51	0.49	49	Metal Loss	TBit	SK	Inspection Side
1182	65	60.24	217.80	0.43	0.29	50	Metal Loss	TBit	SK	Non Inspection Side
1183	65	58.43	236.54	0.52	0.28	50	Metal Loss	TBit	SK	Non Inspection Side
1184	65	40.47	149.57	1.11	0.47	50	Metal Loss	TBit	SK	Inspection Side
1185	65	38.86	237.72	0.38	0.43	51	Metal Loss	TBit	SK	Non Inspection Side
1186	65	53.03	235.94	0.42	0.47	51	Metal Loss	TBit	SK	Inspection Side
1187	65	37.95	232.05	0.57	0.34	51	Metal Loss	TBit	SK	Inspection Side
1188	65	50.83	211.26	1.27	0.43	51	Metal Loss	TBit	SK	Inspection Side
1189	65	13.62	227.09	2.32	0.52	51	Metal Loss	TBit	SK	Inspection Side
1190	65	15.94	130.59	0.47	0.37	52	Metal Loss	TBit	SK	Inspection Side
1191	65	51.22	209.72	0.83	0.43	52	Metal Loss	TBit	SK	Inspection Side
1192	65	57.72	206.06	1.04	0.70	52	Metal Loss	TBit	SK	Inspection Side
1193	65	62.95	20.35	0.39	0.18	53	Metal Loss	TBit	SK	Inspection Side
1194	65	54.09	226.81	1.11	0.65	53	Metal Loss	TBit	SK	Inspection Side
1195	65	53.39	220.79	1.26	0.63	53	Metal Loss	TBit	SK	Inspection Side
1196	65	52.52	199.61	0.54	0.42	54	Metal Loss	TBit	SK	Inspection Side
1197	65	14.65	199.92	0.84	0.40	54	Metal Loss	TBit	SK	Inspection Side
1198	65	54.69	228.19	0.85	0.46	54	Metal Loss	TBit	SK	Inspection Side
1199	65	55.00	214.37	1.38	0.80	54	Metal Loss	TBit	SK	Inspection Side
1200	65	60.98	220.35	1.02	0.44	55	Metal Loss	TBit	SK	Inspection Side
1201	65	61.81	203.27	1.28	0.35	55	Metal Loss	TBit	SK	Inspection Side
1202	65	5.35	12.09	1.15	0.58	56	Metal Loss	TBit	SK	Inspection Side
1203	65	57.72	210.71	0.79	0.33	57	Metal Loss	TBit	SK	Inspection Side
1204	65	57.20	214.76	0.60	0.32	58	Metal Loss	TBit	SK	Inspection Side
1205	65	39.37	231.54	0.61	0.41	58	Metal Loss	TBit	SK	Inspection Side
1206	65	56.89	24.45	1.17	0.56	58	Metal Loss	TBit	SK	Inspection Side
1207	65	53.62	162.52	1.77	0.76	58	Metal Loss	TBit	SK	Non Inspection Side
1208	65	59.61	23.66	0.98	0.61	59	Metal Loss	TBit	SK	Inspection Side
1209	65	54.29	218.39	0.95	0.25	62	Metal Loss	TBit	SK	Inspection Side
1210	65	61.10	211.38	0.65	0.32	63	Metal Loss	TBit	SK	Non Inspection Side
1211	65	9.96	237.09	0.66	0.45	64	Metal Loss	TBit	SK	Inspection Side
1212	65	57.95	208.46	1.19	0.46	64	Metal Loss	TBit	SK	Inspection Side
1213	65	62.80	143.94	0.76	0.41	75	Metal Loss	TBit	SK	Inspection Side
1214	65	16.50	65.28	1.35	0.41	75	Metal Loss	TBit	SK	Inspection Side
1215	65	53.43	171.34	1.33	0.56	77	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1216	65	61.26	154.13	2.06	0.45	97	Metal Loss	TBit	SK	Inspection Side
1217	65	60.00	34.65	0.86	1.39	98	Metal Loss	TBit	SK	Inspection Side
1218	66	58.58	232.60	0.12	0.36	49	Metal Loss	TBit	SK	Inspection Side
1219	66	10.35	233.66	0.75	0.44	49	Metal Loss	TBit	SK	Inspection Side
1220	66	44.37	205.71	0.85	0.28	49	Metal Loss	TBit	SK	Inspection Side
1221	66	10.83	95.67	0.90	0.56	49	Metal Loss	TBit	SK	Inspection Side
1222	66	65.47	169.92	0.97	0.48	49	Metal Loss	TBit	SK	Inspection Side
1223	66	28.78	176.06	1.01	0.44	49	Metal Loss	TBit	SK	Inspection Side
1224	66	65.47	197.91	1.08	0.36	49	Metal Loss	TBit	SK	Inspection Side
1225	66	56.89	198.39	1.11	0.61	49	Metal Loss	TBit	SK	Inspection Side
1226	66	30.83	117.36	1.17	0.26	49	Metal Loss	TBit	SK	Inspection Side
1227	66	31.30	203.15	1.38	0.45	49	Metal Loss	TBit	SK	Inspection Side
1228	66	33.82	126.46	0.65	0.33	50	Metal Loss	TBit	SK	Inspection Side
1229	66	57.64	179.21	0.66	0.41	50	Metal Loss	TBit	SK	Inspection Side
1230	66	40.94	129.69	0.70	0.48	50	Metal Loss	TBit	SK	Inspection Side
1231	66	61.10	204.88	0.75	0.42	50	Metal Loss	TBit	SK	Inspection Side
1232	66	55.20	128.03	0.77	0.33	50	Metal Loss	TBit	SK	Inspection Side
1233	66	29.61	12.20	0.79	0.54	50	Metal Loss	TBit	SK	Inspection Side
1234	66	55.98	119.09	1.13	3.93	50	Metal Loss	TBit	SK	Non Inspection Side
1235	66	41.61	122.80	1.18	0.41	50	Metal Loss	TBit	SK	Inspection Side
1236	66	47.24	130.08	1.25	0.25	50	Metal Loss	TBit	SK	Inspection Side
1237	66	54.25	125.63	2.99	0.74	50	Metal Loss	TBit	SK	Inspection Side
1238	66	61.26	68.98	0.43	0.33	51	Metal Loss	TBit	SK	Inspection Side
1239	66	63.11	170.35	0.56	0.49	51	Metal Loss	TBit	SK	Inspection Side
1240	66	9.45	221.89	0.57	0.66	51	Metal Loss	TBit	SK	Inspection Side
1241	66	46.34	139.84	0.69	0.22	51	Metal Loss	TBit	SK	Inspection Side
1242	66	25.39	200.91	0.70	0.42	51	Metal Loss	TBit	SK	Inspection Side
1243	66	22.52	171.61	0.70	0.38	51	Metal Loss	TBit	SK	Inspection Side
1244	66	59.41	173.15	0.79	0.37	51	Metal Loss	TBit	SK	Inspection Side
1245	66	30.94	220.63	0.79	0.35	51	Metal Loss	TBit	SK	Inspection Side
1246	66	20.59	217.72	0.86	0.44	51	Metal Loss	TBit	SK	Inspection Side
1247	66	46.50	210.43	0.90	0.22	51	Metal Loss	TBit	SK	Inspection Side
1248	66	64.09	138.39	0.99	0.53	51	Metal Loss	TBit	SK	Inspection Side
1249	66	58.27	105.08	1.03	0.47	51	Metal Loss	TBit	SK	Inspection Side
1250	66	47.28	110.04	1.19	0.24	51	Metal Loss	TBit	SK	Inspection Side
1251	66	47.24	160.47	1.29	0.38	51	Metal Loss	TBit	SK	Non Inspection Side
1252	66	33.27	195.71	1.30	0.52	51	Metal Loss	TBit	SK	Inspection Side
1253	66	45.12	88.82	0.59	0.30	52	Metal Loss	TBit	SK	Inspection Side
1254	66	33.23	228.35	0.63	0.45	52	Metal Loss	TBit	SK	Inspection Side
1255	66	62.72	107.64	0.70	0.30	52	Metal Loss	TBit	SK	Inspection Side
1256	66	55.31	40.79	0.79	0.48	52	Metal Loss	TBit	SK	Inspection Side
1257	66	24.17	172.05	1.11	0.40	52	Metal Loss	TBit	SK	Inspection Side
1258	66	46.73	143.74	1.15	1.87	52	Metal Loss	TBit	SK	Non Inspection Side
1259	66	63.58	19.29	1.16	0.52	52	Metal Loss	TBit	SK	Inspection Side
1260	66	55.28	39.21	0.67	0.36	53	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1261	66	54.25	171.02	0.68	0.41	53	Metal Loss	TBit	SK	Inspection Side
1262	66	29.41	13.78	0.70	0.45	53	Metal Loss	TBit	SK	Inspection Side
1263	66	40.51	114.37	0.75	0.31	53	Metal Loss	TBit	SK	Inspection Side
1264	66	50.47	234.49	0.85	0.43	53	Metal Loss	TBit	SK	Inspection Side
1265	66	19.25	230.43	0.85	0.49	53	Metal Loss	TBit	SK	Inspection Side
1266	66	63.19	211.93	1.00	0.40	53	Metal Loss	TBit	SK	Inspection Side
1267	66	47.36	186.81	1.08	0.29	53	Metal Loss	TBit	SK	Inspection Side
1268	66	47.24	103.23	1.09	0.22	53	Metal Loss	TBit	SK	Inspection Side
1269	66	42.44	178.54	0.38	0.49	54	Metal Loss	TBit	SK	Inspection Side
1270	66	12.28	216.81	0.39	0.36	54	Metal Loss	TBit	SK	Inspection Side
1271	66	37.05	45.91	0.62	0.42	54	Metal Loss	TBit	SK	Inspection Side
1272	66	57.48	156.42	0.79	0.33	54	Metal Loss	TBit	SK	Inspection Side
1273	66	61.73	20.91	0.82	0.37	54	Metal Loss	TBit	SK	Inspection Side
1274	66	17.72	238.11	0.90	0.41	54	Metal Loss	TBit	SK	Inspection Side
1275	66	38.11	15.67	0.58	0.43	55	Metal Loss	TBit	SK	Inspection Side
1276	66	42.99	50.35	0.64	0.43	55	Metal Loss	TBit	SK	Inspection Side
1277	66	67.20	185.35	0.87	0.45	55	Metal Loss	TBit	SK	Inspection Side
1278	66	43.07	14.72	0.96	0.38	55	Metal Loss	TBit	SK	Inspection Side
1279	66	32.32	120.04	0.98	0.33	55	Metal Loss	TBit	SK	Inspection Side
1280	66	54.37	198.58	1.04	0.59	55	Metal Loss	TBit	SK	Inspection Side
1281	66	31.14	106.69	1.19	0.71	55	Metal Loss	TBit	SK	Non Inspection Side
1282	66	54.57	43.50	1.20	0.32	55	Metal Loss	TBit	SK	Inspection Side
1283	66	61.61	226.10	0.72	0.23	56	Metal Loss	TBit	SK	Non Inspection Side
1284	66	30.47	167.76	0.96	0.38	56	Metal Loss	TBit	SK	Inspection Side
1285	66	30.59	24.21	1.11	0.25	56	Metal Loss	TBit	SK	Inspection Side
1286	66	44.13	93.94	0.66	0.29	57	Metal Loss	TBit	SK	Non Inspection Side
1287	66	45.91	208.94	0.86	0.25	57	Metal Loss	TBit	SK	Inspection Side
1288	66	45.83	159.21	0.90	0.48	57	Metal Loss	TBit	SK	Non Inspection Side
1289	66	61.46	100.00	0.94	0.45	57	Metal Loss	TBit	SK	Inspection Side
1290	66	9.84	226.06	0.95	0.74	57	Metal Loss	TBit	SK	Inspection Side
1291	66	10.83	26.89	1.06	0.48	57	Metal Loss	TBit	SK	Inspection Side
1292	66	46.97	128.39	1.07	0.53	57	Metal Loss	TBit	SK	Inspection Side
1293	66	44.13	112.68	1.14	0.35	57	Metal Loss	TBit	SK	Inspection Side
1294	66	47.32	158.54	1.15	0.77	57	Metal Loss	TBit	SK	Inspection Side
1295	66	56.38	120.63	1.23	0.91	57	Metal Loss	TBit	SK	Inspection Side
1296	66	7.95	220.87	0.56	0.39	58	Metal Loss	TBit	SK	Inspection Side
1297	66	10.04	232.95	0.62	0.33	58	Metal Loss	TBit	SK	Inspection Side
1298	66	43.43	200.20	0.91	0.42	58	Metal Loss	TBit	SK	Inspection Side
1299	66	47.17	116.26	1.42	0.85	58	Metal Loss	TBit	SK	Non Inspection Side
1300	66	53.62	96.61	1.78	0.84	58	Metal Loss	TBit	SK	Non Inspection Side
1301	66	57.64	194.72	0.77	0.46	59	Metal Loss	TBit	SK	Inspection Side
1302	66	46.65	113.27	0.83	0.56	59	Metal Loss	TBit	SK	Inspection Side
1303	66	46.97	176.69	0.88	0.30	59	Metal Loss	TBit	SK	Inspection Side
1304	66	20.94	216.61	1.01	0.41	59	Metal Loss	TBit	SK	Inspection Side
1305	66	47.13	204.65	1.52	0.47	59	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1306	66	32.05	150.12	1.58	0.36	59	Metal Loss	TBit	SK	Inspection Side
1307	66	55.51	35.63	0.93	0.34	60	Metal Loss	TBit	SK	Inspection Side
1308	66	45.83	213.86	0.98	0.38	60	Metal Loss	TBit	SK	Inspection Side
1309	66	47.40	151.97	1.00	0.68	60	Metal Loss	TBit	SK	Inspection Side
1310	66	7.05	227.28	1.04	0.44	60	Metal Loss	TBit	SK	Inspection Side
1311	66	30.59	15.51	1.14	0.32	60	Metal Loss	TBit	SK	Inspection Side
1312	66	57.01	162.36	1.19	0.77	60	Metal Loss	TBit	SK	Inspection Side
1313	66	61.10	178.90	0.54	0.70	61	Metal Loss	TBit	SK	Inspection Side
1314	66	43.39	57.20	0.82	0.47	61	Metal Loss	TBit	SK	Inspection Side
1315	66	45.24	108.35	0.84	0.37	61	Metal Loss	TBit	SK	Inspection Side
1316	66	42.64	163.15	0.99	0.34	61	Metal Loss	TBit	SK	Inspection Side
1317	66	46.85	111.50	1.12	0.37	61	Metal Loss	TBit	SK	Inspection Side
1318	66	31.26	202.13	1.27	0.32	61	Metal Loss	TBit	SK	Inspection Side
1319	66	62.95	198.82	1.40	0.98	62	Metal Loss	TBit	SK	Inspection Side
1320	66	31.02	141.81	1.69	0.85	62	Metal Loss	TBit	SK	Non Inspection Side
1321	66	59.41	199.41	1.71	0.56	62	Metal Loss	TBit	SK	Inspection Side
1322	66	10.87	17.68	0.59	0.37	63	Metal Loss	TBit	SK	Inspection Side
1323	66	42.64	167.48	0.89	0.33	63	Metal Loss	TBit	SK	Inspection Side
1324	66	59.76	69.29	1.19	0.62	63	Metal Loss	TBit	SK	Non Inspection Side
1325	66	35.67	207.28	1.26	0.46	63	Metal Loss	TBit	SK	Inspection Side
1326	66	55.51	94.84	0.80	0.42	64	Metal Loss	TBit	SK	Inspection Side
1327	66	56.89	172.28	1.30	0.73	64	Metal Loss	TBit	SK	Inspection Side
1328	66	47.20	181.61	1.36	0.60	64	Metal Loss	TBit	SK	Non Inspection Side
1329	66	37.09	44.37	0.67	0.46	65	Metal Loss	TBit	SK	Inspection Side
1330	66	63.90	178.90	0.66	0.40	66	Metal Loss	TBit	SK	Inspection Side
1331	66	46.97	171.30	1.83	0.87	66	Metal Loss	TBit	SK	Non Inspection Side
1332	66	64.96	167.52	0.72	0.34	67	Metal Loss	TBit	SK	Inspection Side
1333	66	62.52	57.28	0.54	0.37	68	Metal Loss	TBit	SK	Inspection Side
1334	66	42.76	209.76	0.51	0.37	69	Metal Loss	TBit	SK	Inspection Side
1335	66	62.95	163.11	0.69	0.31	69	Metal Loss	TBit	SK	Inspection Side
1336	66	62.36	156.46	0.74	0.38	69	Metal Loss	TBit	SK	Inspection Side
1337	66	63.19	219.29	0.83	0.65	69	Metal Loss	TBit	SK	Inspection Side
1338	66	17.13	215.08	1.12	1.25	69	Metal Loss	TBit	SK	Inspection Side
1339	66	54.13	119.06	2.83	1.46	69	Metal Loss	TBit	SK	Non Inspection Side
1340	66	27.05	172.52	0.89	0.36	72	Metal Loss	TBit	SK	Inspection Side
1341	66	11.93	216.85	0.84	0.47	73	Metal Loss	TBit	SK	Inspection Side
1342	66	61.89	170.75	0.98	0.63	73	Metal Loss	TBit	SK	Inspection Side
1343	66	30.83	90.24	1.17	0.37	73	Metal Loss	TBit	SK	Inspection Side
1344	66	42.64	185.24	2.14	0.61	74	Metal Loss	TBit	SK	Inspection Side
1345	66	45.59	166.97	1.27	0.71	75	Metal Loss	TBit	SK	Non Inspection Side
1346	66	11.46	220.55	0.78	0.37	76	Metal Loss	TBit	SK	Inspection Side
1347	66	57.28	119.09	1.26	3.45	76	Metal Loss	TBit	SK	Non Inspection Side
1348	66	45.24	98.27	2.06	0.88	76	Metal Loss	TBit	SK	Inspection Side
1349	66	53.50	10.28	1.61	0.69	77	Metal Loss	TBit	SK	Non Inspection Side
1350	66	65.00	159.17	0.86	0.42	79	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1351	66	30.71	153.86	1.04	0.30	81	Metal Loss	TBit	SK	Inspection Side
1352	66	47.09	119.53	1.61	0.79	81	Metal Loss	TBit	SK	Non Inspection Side
1353	66	15.12	95.20	1.11	0.41	83	Metal Loss	TBit	SK	Inspection Side
1354	66	24.06	160.39	1.45	1.05	87	Metal Loss	TBit	SK	Inspection Side
1355	66	44.13	95.67	1.02	0.54	88	Metal Loss	TBit	SK	Inspection Side
1356	66	61.81	189.57	1.70	0.55	89	Metal Loss	TBit	SK	Inspection Side
1357	66	42.91	123.35	0.90	0.57	90	Metal Loss	TBit	SK	Inspection Side
1358	66	53.82	160.67	1.14	1.03	95	Metal Loss	TBit	SK	Inspection Side
1359	66	31.34	135.83	1.06	0.81	96	Metal Loss	TBit	SK	Inspection Side
1360	66	56.30	118.39	1.17	2.18	96	Metal Loss	TBit	SK	Non Inspection Side
1361	66	54.33	191.34	0.90	0.38	97	Metal Loss	TBit	SK	Inspection Side
1362	66	55.16	10.71	1.05	0.54	97	Metal Loss	TBit	SK	Inspection Side
1363	66	54.80	99.09	1.10	0.97	97	Metal Loss	TBit	SK	Inspection Side
1364	66	60.12	189.80	1.29	0.41	97	Metal Loss	TBit	SK	Inspection Side
1365	66	53.50	145.63	1.53	0.81	97	Metal Loss	TBit	SK	Inspection Side
1366	66	63.31	141.57	1.74	0.69	97	Metal Loss	TBit	SK	Inspection Side
1367	66	59.57	103.46	2.05	0.96	97	Metal Loss	TBit	SK	Inspection Side
1368	66	7.83	218.50	1.23	0.58	98	Metal Loss	TBit	SK	Inspection Side
1369	66	64.29	136.69	1.49	0.56	98	Metal Loss	TBit	SK	Inspection Side
1370	66	60.51	185.51	2.34	0.61	98	Metal Loss	TBit	SK	Inspection Side
1371	67	56.34	94.96	0.54	0.44	49	Metal Loss	TBit	SK	Inspection Side
1372	67	57.44	120.39	0.58	0.39	49	Metal Loss	TBit	SK	Inspection Side
1373	67	65.67	175.67	0.75	0.42	49	Metal Loss	TBit	SK	Inspection Side
1374	67	9.06	194.69	0.79	0.51	49	Metal Loss	TBit	SK	Inspection Side
1375	67	8.15	99.29	0.83	0.41	49	Metal Loss	TBit	SK	Inspection Side
1376	67	8.58	110.47	0.95	0.50	49	Metal Loss	TBit	SK	Inspection Side
1377	67	69.92	218.86	1.06	2.31	49	Metal Loss	TBit	SK	Non Inspection Side
1378	67	64.17	57.48	2.10	0.72	49	Metal Loss	TBit	SK	Inspection Side
1379	67	67.17	34.96	2.91	0.80	49	Metal Loss	TBit	SK	Inspection Side
1380	67	56.22	97.09	0.51	0.44	50	Metal Loss	TBit	SK	Inspection Side
1381	67	6.54	131.73	0.58	0.46	50	Metal Loss	TBit	SK	Inspection Side
1382	67	9.06	126.93	0.73	0.39	50	Metal Loss	TBit	SK	Inspection Side
1383	67	55.51	116.77	0.87	0.85	50	Metal Loss	TBit	SK	Inspection Side
1384	67	58.58	133.58	1.13	0.39	50	Metal Loss	TBit	SK	Inspection Side
1385	67	44.92	106.06	1.37	0.78	50	Metal Loss	TBit	SK	Inspection Side
1386	67	56.18	41.85	1.55	1.56	50	Metal Loss	TBit	SK	Non Inspection Side
1387	67	56.42	75.55	2.37	0.26	50	Metal Loss	TBit	SK	Inspection Side
1388	67	59.41	130.83	0.54	0.42	51	Metal Loss	TBit	SK	Inspection Side
1389	67	62.80	222.32	0.84	0.50	51	Metal Loss	TBit	SK	Inspection Side
1390	67	45.04	58.50	0.84	0.16	51	Metal Loss	TBit	SK	Inspection Side
1391	67	1.61	53.78	1.06	2.10	51	Metal Loss	TBit	SK	Non Inspection Side
1392	67	30.98	72.32	1.06	0.76	51	Metal Loss	TBit	SK	Inspection Side
1393	67	61.50	205.55	1.66	0.45	51	Metal Loss	TBit	SK	Inspection Side
1394	67	44.88	87.32	1.71	0.60	51	Metal Loss	TBit	SK	Inspection Side
1395	67	11.65	115.12	0.29	0.16	52	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1396	67	15.20	120.16	0.52	0.36	52	Metal Loss	TBit	SK	Inspection Side
1397	67	44.57	174.84	0.56	0.26	52	Metal Loss	TBit	SK	Inspection Side
1398	67	5.55	67.95	0.62	0.41	52	Metal Loss	TBit	SK	Inspection Side
1399	67	63.27	152.20	0.87	0.40	52	Metal Loss	TBit	SK	Inspection Side
1400	67	44.49	25.67	1.01	0.89	52	Metal Loss	TBit	SK	Inspection Side
1401	67	8.23	174.17	1.08	0.46	52	Metal Loss	TBit	SK	Inspection Side
1402	67	63.62	136.34	1.17	0.31	52	Metal Loss	TBit	SK	Inspection Side
1403	67	49.37	120.47	1.21	1.96	52	Metal Loss	TBit	SK	Non Inspection Side
1404	67	30.71	114.69	1.37	0.51	52	Metal Loss	TBit	SK	Inspection Side
1405	67	4.92	93.19	0.59	0.55	53	Metal Loss	TBit	SK	Inspection Side
1406	67	32.32	105.08	0.75	0.45	53	Metal Loss	TBit	SK	Inspection Side
1407	67	50.28	130.47	0.95	0.75	53	Metal Loss	TBit	SK	Non Inspection Side
1408	67	60.08	136.46	1.03	0.25	53	Metal Loss	TBit	SK	Inspection Side
1409	67	18.19	95.00	1.19	0.88	53	Metal Loss	TBit	SK	Non Inspection Side
1410	67	58.50	112.40	1.48	0.50	53	Metal Loss	TBit	SK	Inspection Side
1411	67	36.30	131.46	0.68	0.36	54	Metal Loss	TBit	SK	Inspection Side
1412	67	4.25	149.92	0.86	2.87	54	Metal Loss	TBit	SK	Non Inspection Side
1413	67	45.51	82.83	1.05	0.30	54	Metal Loss	TBit	SK	Inspection Side
1414	67	18.15	96.61	1.31	0.90	54	Metal Loss	TBit	SK	Non Inspection Side
1415	67	47.01	104.80	1.32	0.54	54	Metal Loss	TBit	SK	Non Inspection Side
1416	67	57.64	102.83	0.21	0.31	55	Metal Loss	TBit	SK	Inspection Side
1417	67	11.65	177.17	0.77	0.39	55	Metal Loss	TBit	SK	Inspection Side
1418	67	31.54	14.53	0.81	0.39	55	Metal Loss	TBit	SK	Inspection Side
1419	67	66.10	182.20	1.06	0.55	55	Metal Loss	TBit	SK	Inspection Side
1420	67	44.37	99.72	1.16	0.31	55	Metal Loss	TBit	SK	Inspection Side
1421	67	53.82	121.42	1.24	0.49	55	Metal Loss	TBit	SK	Inspection Side
1422	67	60.51	194.06	1.33	0.83	56	Metal Loss	TBit	SK	Inspection Side
1423	67	61.10	57.36	3.34	0.93	56	Metal Loss	TBit	SK	Inspection Side
1424	67	14.49	14.49	3.76	2.98	56	Metal Loss	TBit	SK	Non Inspection Side
1425	67	54.69	114.49	0.98	0.23	57	Metal Loss	TBit	SK	Inspection Side
1426	67	57.48	32.87	5.30	0.61	57	Metal Loss	TBit	SK	Inspection Side
1427	67	54.92	122.68	0.65	0.35	58	Metal Loss	TBit	SK	Inspection Side
1428	67	32.09	77.13	0.86	0.38	58	Metal Loss	TBit	SK	Inspection Side
1429	67	56.42	98.70	0.92	0.44	58	Metal Loss	TBit	SK	Inspection Side
1430	67	64.02	80.35	2.05	0.63	58	Metal Loss	TBit	SK	Inspection Side
1431	67	46.61	19.80	1.19	0.80	59	Metal Loss	TBit	SK	Non Inspection Side
1432	67	43.66	10.08	2.11	0.67	59	Metal Loss	TBit	SK	Inspection Side
1433	67	45.59	77.99	0.90	0.29	60	Metal Loss	TBit	SK	Inspection Side
1434	67	45.79	28.23	0.99	0.38	60	Metal Loss	TBit	SK	Inspection Side
1435	67	39.49	90.20	0.92	0.57	61	Metal Loss	TBit	SK	Inspection Side
1436	67	63.90	198.90	0.70	0.42	62	Metal Loss	TBit	SK	Inspection Side
1437	67	55.98	186.81	0.82	0.45	62	Metal Loss	TBit	SK	Inspection Side
1438	67	60.51	82.40	1.37	1.30	62	Metal Loss	TBit	SK	Non Inspection Side
1439	67	18.15	113.94	0.93	0.28	63	Metal Loss	TBit	SK	Inspection Side
1440	67	64.49	70.59	1.36	0.34	63	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1441	67	61.10	156.38	0.63	0.32	64	Metal Loss	TBit	SK	Inspection Side
1442	67	46.10	92.24	1.02	0.65	64	Metal Loss	TBit	SK	Inspection Side
1443	67	3.43	50.98	1.23	0.43	64	Metal Loss	TBit	SK	Inspection Side
1444	67	54.76	47.13	3.03	2.23	64	Metal Loss	TBit	SK	Non Inspection Side
1445	67	65.98	62.09	2.11	0.60	65	Metal Loss	TBit	SK	Inspection Side
1446	67	33.19	80.43	0.93	0.46	67	Metal Loss	TBit	SK	Inspection Side
1447	67	45.35	62.01	0.93	0.40	68	Metal Loss	TBit	SK	Inspection Side
1448	67	33.19	83.11	0.76	0.36	69	Metal Loss	TBit	SK	Inspection Side
1449	67	30.98	58.23	1.32	1.03	69	Metal Loss	TBit	SK	Non Inspection Side
1450	67	44.92	172.99	1.84	0.51	69	Metal Loss	TBit	SK	Inspection Side
1451	67	30.87	104.84	1.86	0.57	69	Metal Loss	TBit	SK	Non Inspection Side
1452	67	44.49	113.19	1.05	0.44	71	Metal Loss	TBit	SK	Inspection Side
1453	67	4.96	49.96	0.60	0.33	72	Metal Loss	TBit	SK	Inspection Side
1454	67	62.72	80.71	1.84	0.58	73	Metal Loss	TBit	SK	Inspection Side
1455	67	59.33	35.71	2.10	0.60	73	Metal Loss	TBit	SK	Inspection Side
1456	67	66.89	202.17	0.85	0.43	74	Metal Loss	TBit	SK	Inspection Side
1457	67	59.41	105.71	1.47	0.27	74	Metal Loss	TBit	SK	Inspection Side
1458	67	63.19	106.42	1.57	0.62	74	Metal Loss	TBit	SK	Inspection Side
1459	67	46.93	82.32	1.49	1.58	77	Metal Loss	TBit	SK	Non Inspection Side
1460	67	31.42	20.91	1.13	0.51	79	Metal Loss	TBit	SK	Inspection Side
1461	67	46.97	63.70	1.05	0.40	82	Metal Loss	TBit	SK	Inspection Side
1462	67	3.74	48.19	1.18	0.89	87	Metal Loss	TBit	SK	Inspection Side
1463	67	33.46	123.35	0.79	0.36	91	Metal Loss	TBit	SK	Inspection Side
1464	67	44.80	96.61	1.07	0.56	97	Metal Loss	TBit	SK	Inspection Side
1465	67	63.86	66.06	1.86	0.72	97	Metal Loss	TBit	SK	Inspection Side
1466	67	9.33	188.43	1.58	0.59	98	Metal Loss	TBit	SK	Inspection Side
1467	68	33.54	53.98	0.89	0.72	49	Metal Loss	TBit	SK / CA	Non Inspection Side
1468	68	35.94	54.17	0.71	0.35	50	Metal Loss	TBit	SK / CA	Inspection Side
1469	68	37.64	11.85	0.71	0.55	50	Metal Loss	TBit	SK	Inspection Side
1470	68	52.48	27.91	0.59	0.25	51	Metal Loss	TBit	SK	Inspection Side
1471	68	28.82	24.53	0.78	0.43	51	Metal Loss	TBit	SK	Inspection Side
1472	68	60.16	20.83	0.61	0.38	52	Metal Loss	TBit	SK	Inspection Side
1473	68	58.98	28.58	0.80	0.37	53	Metal Loss	TBit	SK	Inspection Side
1474	68	11.73	9.80	0.68	0.37	54	Metal Loss	TBit	SK	Inspection Side
1475	68	41.50	11.34	0.67	0.35	55	Metal Loss	TBit	SK	Inspection Side
1476	68	60.16	41.85	0.69	0.61	57	Metal Loss	TBit	SK	Inspection Side
1477	68	57.17	39.33	0.79	0.51	57	Metal Loss	TBit	SK	Inspection Side
1478	68	16.38	18.54	0.84	0.34	57	Metal Loss	TBit	SK	Inspection Side
1479	68	61.57	21.18	1.14	0.51	58	Metal Loss	TBit	SK	Non Inspection Side
1480	68	31.93	23.11	1.07	0.67	60	Metal Loss	TBit	SK	Non Inspection Side
1481	68	61.57	40.31	1.12	0.36	63	Metal Loss	TBit	SK	Inspection Side
1482	68	60.75	18.19	1.21	0.58	66	Metal Loss	TBit	SK	Inspection Side
1483	68	25.20	42.40	1.03	0.32	67	Metal Loss	TBit	SK / CA	Inspection Side
1484	68	60.75	32.99	1.83	0.87	69	Metal Loss	TBit	SK	Inspection Side
1485	68	61.69	42.56	0.92	0.37	70	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1486	68	31.89	13.43	0.80	0.35	73	Metal Loss	TBit	SK	Inspection Side
1487	68	15.51	18.82	0.98	0.43	76	Metal Loss	TBit	SK	Inspection Side
1488	69	39.45	64.29	1.01	0.37	49	Metal Loss	TBit	SK / CA	Inspection Side
1489	69	18.94	64.37	0.64	0.36	50	Metal Loss	TBit	SK / CA	Non Inspection Side
1490	69	18.31	40.20	0.70	0.48	50	Metal Loss	TBit	SK	Inspection Side
1491	69	60.35	49.80	1.06	1.75	50	Metal Loss	TBit	SK	Non Inspection Side
1492	69	46.85	61.50	0.90	0.33	51	Metal Loss	TBit	SK / CA	Inspection Side
1493	69	19.76	47.60	0.91	0.81	51	Metal Loss	TBit	SK	Inspection Side
1494	69	17.56	65.91	1.21	2.49	51	Metal Loss	TBit	SK / CA	Non Inspection Side
1495	69	31.57	13.70	1.23	0.90	51	Metal Loss	TBit	SK	Non Inspection Side
1496	69	40.04	61.81	1.64	0.40	51	Metal Loss	TBit	SK / CA	Inspection Side
1497	69	20.67	50.67	0.58	0.41	52	Metal Loss	TBit	SK / CA	Inspection Side
1498	69	31.73	64.17	1.02	0.84	52	Metal Loss	TBit	SK / CA	Inspection Side
1499	69	16.57	28.78	1.12	0.45	53	Metal Loss	TBit	SK	Non Inspection Side
1500	69	55.94	53.46	0.76	0.48	54	Metal Loss	TBit	SK	Inspection Side
1501	69	55.63	14.29	0.93	0.37	54	Metal Loss	TBit	SK	Inspection Side
1502	69	40.35	70.08	1.12	0.74	56	Metal Loss	TBit	SK / CA	Inspection Side
1503	69	25.28	14.96	0.61	0.33	57	Metal Loss	TBit	SK	Inspection Side
1504	69	17.87	38.54	0.67	0.31	58	Metal Loss	TBit	SK	Inspection Side
1505	69	56.57	59.41	0.86	0.37	58	Metal Loss	TBit	SK	Inspection Side
1506	69	22.28	26.22	0.60	0.31	60	Metal Loss	TBit	SK	Inspection Side
1507	69	42.56	70.04	0.79	0.40	62	Metal Loss	TBit	SK / CA	Inspection Side
1508	69	10.16	63.15	0.99	1.63	62	Metal Loss	TBit	SK / CA	Non Inspection Side
1509	69	61.46	49.53	0.93	0.30	68	Metal Loss	TBit	SK	Inspection Side
1510	69	12.48	57.60	1.01	0.54	70	Metal Loss	TBit	SK / CA	Inspection Side
1511	69	56.89	53.27	0.70	0.42	72	Metal Loss	TBit	SK	Inspection Side
1512	69	29.41	46.97	1.08	0.47	72	Metal Loss	TBit	SK	Inspection Side
1513	69	15.51	32.56	1.74	0.57	78	Metal Loss	TBit	SK	Non Inspection Side
1514	70	42.83	61.81	0.79	0.79	49	Metal Loss	Visual	SK	Inspection Side
1515	70	57.20	67.44	0.79	0.79	49	Metal Loss	Visual	SK	Inspection Side
1516	70	53.78	180.79	0.79	0.79	49	Metal Loss	Visual	SK	Non Inspection Side
1517	70	26.65	225.00	0.79	0.79	49	Metal Loss	Visual	SK	Inspection Side
1518	70	35.94	130.55	0.79	0.79	50	Metal Loss	Visual	SK	Inspection Side
1519	70	51.57	68.94	1.11	0.52	50	Metal Loss	Visual	SK	Inspection Side
1520	70	57.64	99.49	0.79	0.79	51	Metal Loss	Visual	SK	Inspection Side
1521	70	59.45	100.75	0.79	0.79	51	Metal Loss	Visual	SK	Inspection Side
1522	70	54.53	140.04	0.79	0.79	51	Metal Loss	Visual	SK	Non Inspection Side
1523	70	39.76	166.73	0.79	0.79	51	Metal Loss	Visual	SK	Inspection Side
1524	70	26.34	224.06	0.79	0.79	51	Metal Loss	Visual	SK	Inspection Side
1525	70	57.95	129.09	0.79	0.79	52	Metal Loss	Visual	SK	Inspection Side
1526	70	9.92	161.34	0.79	0.79	52	Metal Loss	Visual	SK	Non Inspection Side
1527	70	56.54	67.24	0.79	0.79	53	Metal Loss	Visual	SK	Inspection Side
1528	70	43.78	164.61	0.79	0.79	54	Metal Loss	Visual	SK	Inspection Side
1529	70	53.78	223.35	0.79	0.79	54	Metal Loss	Visual	SK	Non Inspection Side
1530	70	39.76	14.57	0.79	0.79	56	Metal Loss	Visual	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1531	70	38.46	15.63	0.79	0.79	62	Metal Loss	Visual	SK	Inspection Side
1532	70	21.89	106.65	0.44	0.32	49	Metal Loss	TBit	SK	Inspection Side
1533	70	27.56	81.46	0.72	0.49	49	Metal Loss	TBit	SK	Inspection Side
1534	70	15.98	78.70	1.39	0.27	49	Metal Loss	TBit	SK	Inspection Side
1535	70	60.94	47.72	1.80	0.69	49	Metal Loss	TBit	SK	Inspection Side
1536	70	30.24	48.39	1.07	0.47	50	Metal Loss	TBit	SK	Inspection Side
1537	70	28.74	10.12	1.08	0.42	50	Metal Loss	TBit	SK	Inspection Side
1538	70	59.61	138.46	1.28	0.46	50	Metal Loss	TBit	SK	Inspection Side
1539	70	25.35	34.25	0.50	0.38	51	Metal Loss	TBit	SK	Inspection Side
1540	70	15.67	58.58	0.64	0.39	51	Metal Loss	TBit	SK	Inspection Side
1541	70	16.54	112.40	0.86	0.35	51	Metal Loss	TBit	SK	Inspection Side
1542	70	15.91	126.93	1.25	0.29	51	Metal Loss	TBit	SK	Inspection Side
1543	70	22.32	49.37	0.61	0.44	52	Metal Loss	TBit	SK	Inspection Side
1544	70	61.30	110.00	1.10	0.42	52	Metal Loss	TBit	SK	Inspection Side
1545	70	32.40	18.15	1.19	0.53	52	Metal Loss	TBit	SK	Non Inspection Side
1546	70	60.55	166.65	0.68	0.28	53	Metal Loss	TBit	SK	Inspection Side
1547	70	61.77	152.24	0.92	0.39	53	Metal Loss	TBit	SK	Inspection Side
1548	70	54.72	140.08	1.20	0.55	53	Metal Loss	TBit	SK	Inspection Side
1549	70	30.83	68.86	0.75	0.56	54	Metal Loss	TBit	SK	Inspection Side
1550	70	32.09	131.26	0.92	0.34	54	Metal Loss	TBit	SK	Inspection Side
1551	70	17.44	34.25	1.03	0.67	54	Metal Loss	TBit	SK	Inspection Side
1552	70	59.84	42.64	0.78	0.36	55	Metal Loss	TBit	SK	Inspection Side
1553	70	17.24	71.61	0.90	0.74	57	Metal Loss	TBit	SK	Inspection Side
1554	70	28.66	92.91	0.66	0.38	58	Metal Loss	TBit	SK	Inspection Side
1555	70	58.98	12.24	0.85	0.55	58	Metal Loss	TBit	SK	Inspection Side
1556	70	16.26	115.94	1.38	0.74	58	Metal Loss	TBit	SK	Inspection Side
1557	70	16.69	10.55	0.48	0.25	60	Metal Loss	TBit	SK	Inspection Side
1558	70	59.61	164.25	0.71	0.30	61	Metal Loss	TBit	SK	Inspection Side
1559	70	61.73	141.93	1.28	0.67	61	Metal Loss	TBit	SK	Non Inspection Side
1560	70	17.36	67.40	0.98	0.40	68	Metal Loss	TBit	SK	Inspection Side
1561	70	16.26	77.09	1.00	0.43	68	Metal Loss	TBit	SK	Inspection Side
1562	70	29.49	160.87	0.44	0.35	69	Metal Loss	TBit	SK	Inspection Side
1563	70	15.87	74.96	1.12	0.59	71	Metal Loss	TBit	SK	Inspection Side
1564	70	32.40	90.67	1.24	0.30	71	Metal Loss	TBit	SK	Inspection Side
1565	70	60.55	25.94	0.91	0.36	73	Metal Loss	TBit	SK	Inspection Side
1566	70	62.01	76.42	0.95	0.48	80	Metal Loss	TBit	SK	Inspection Side
1567	70	15.94	88.78	1.33	0.39	80	Metal Loss	TBit	SK	Inspection Side
1568	70	59.45	32.17	0.91	0.46	81	Metal Loss	TBit	SK	Inspection Side
1569	70	59.41	151.77	0.69	0.44	84	Metal Loss	TBit	SK	Inspection Side
1570	70	30.35	98.86	0.68	0.41	86	Metal Loss	TBit	SK	Inspection Side
1571	70	30.35	97.64	0.87	0.63	86	Metal Loss	TBit	SK	Inspection Side
1572	70	16.89	49.65	0.87	0.42	87	Metal Loss	TBit	SK	Inspection Side
1573	70	15.79	128.11	0.92	0.31	90	Metal Loss	TBit	SK	Inspection Side
1574	70	32.44	36.50	1.12	0.45	97	Metal Loss	TBit	SK	Inspection Side
1575	71	18.46	180.63	0.79	0.79	49	Metal Loss	Visual	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1576	71	8.07	188.74	0.34	0.30	49	Metal Loss	TBit	SK	Inspection Side
1577	71	24.61	231.54	0.59	0.32	49	Metal Loss	TBit	SK	Inspection Side
1578	71	51.42	24.69	0.59	0.33	49	Metal Loss	TBit	SK	Inspection Side
1579	71	22.32	28.74	0.66	0.39	49	Metal Loss	TBit	SK	Inspection Side
1580	71	46.89	63.43	0.88	0.45	49	Metal Loss	TBit	SK	Inspection Side
1581	71	58.78	173.78	0.97	0.37	49	Metal Loss	TBit	SK	Inspection Side
1582	71	31.69	175.91	1.14	0.39	49	Metal Loss	TBit	SK	Inspection Side
1583	71	16.69	158.27	1.26	0.50	49	Metal Loss	TBit	SK	Inspection Side
1584	71	20.12	127.95	0.16	0.41	50	Metal Loss	TBit	SK	Inspection Side
1585	71	47.68	200.24	0.44	0.17	50	Metal Loss	TBit	SK	Inspection Side
1586	71	56.10	143.94	0.65	0.43	50	Metal Loss	TBit	SK	Inspection Side
1587	71	59.80	97.72	0.66	0.29	50	Metal Loss	TBit	SK	Inspection Side
1588	71	21.73	81.26	0.81	0.73	50	Metal Loss	TBit	SK	Inspection Side
1589	71	5.31	223.58	1.01	0.32	50	Metal Loss	TBit	SK	Inspection Side
1590	71	49.29	224.65	1.10	0.63	50	Metal Loss	TBit	SK	Inspection Side
1591	71	51.42	80.04	1.28	0.47	50	Metal Loss	TBit	SK	Inspection Side
1592	71	51.34	163.27	2.36	0.56	50	Metal Loss	TBit	SK	Inspection Side
1593	71	22.32	209.96	0.36	0.25	51	Metal Loss	TBit	SK	Inspection Side
1594	71	50.12	75.51	0.41	0.31	51	Metal Loss	TBit	SK	Inspection Side
1595	71	4.92	215.94	0.61	0.35	51	Metal Loss	TBit	SK	Inspection Side
1596	71	51.42	17.76	0.63	0.33	51	Metal Loss	TBit	SK	Inspection Side
1597	71	24.76	148.78	0.63	0.40	51	Metal Loss	TBit	SK	Inspection Side
1598	71	25.98	52.87	0.65	0.39	51	Metal Loss	TBit	SK	Inspection Side
1599	71	28.98	161.30	0.80	0.58	51	Metal Loss	TBit	SK	Inspection Side
1600	71	24.61	150.67	0.91	0.84	51	Metal Loss	TBit	SK	Inspection Side
1601	71	24.76	153.54	1.09	0.90	51	Metal Loss	TBit	SK	Inspection Side
1602	71	51.65	205.59	0.40	0.17	52	Metal Loss	TBit	SK	Inspection Side
1603	71	11.26	25.75	0.51	0.45	52	Metal Loss	TBit	SK	Inspection Side
1604	71	8.50	123.86	0.53	0.38	52	Metal Loss	TBit	SK	Inspection Side
1605	71	26.81	157.36	0.74	0.66	52	Metal Loss	TBit	SK	Inspection Side
1606	71	15.71	208.74	0.98	0.21	52	Metal Loss	TBit	SK	Inspection Side
1607	71	46.30	58.62	1.00	0.52	52	Metal Loss	TBit	SK	Inspection Side
1608	71	47.09	60.71	1.54	0.54	52	Metal Loss	TBit	SK	Inspection Side
1609	71	26.93	49.57	0.46	0.39	53	Metal Loss	TBit	SK	Inspection Side
1610	71	24.17	227.60	0.52	0.38	53	Metal Loss	TBit	SK	Inspection Side
1611	71	55.31	17.76	0.61	0.44	53	Metal Loss	TBit	SK	Inspection Side
1612	71	50.08	91.97	0.63	0.41	53	Metal Loss	TBit	SK	Inspection Side
1613	71	42.32	180.71	0.68	0.48	53	Metal Loss	TBit	SK	Inspection Side
1614	71	26.02	40.00	0.71	0.46	53	Metal Loss	TBit	SK	Inspection Side
1615	71	17.83	79.25	0.72	0.57	53	Metal Loss	TBit	SK	Inspection Side
1616	71	20.39	127.99	0.90	0.53	53	Metal Loss	TBit	SK	Inspection Side
1617	71	59.57	221.42	0.91	0.34	53	Metal Loss	TBit	SK	Inspection Side
1618	71	31.61	180.28	0.97	0.23	53	Metal Loss	TBit	SK	Inspection Side
1619	71	53.03	236.42	1.01	0.39	53	Metal Loss	TBit	SK	Inspection Side
1620	71	45.83	86.69	1.04	0.43	53	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1621	71	15.20	237.01	1.07	0.66	53	Metal Loss	TBit	SK	Inspection Side
1622	71	15.20	218.07	1.15	0.22	53	Metal Loss	TBit	SK	Inspection Side
1623	71	15.28	14.21	1.47	0.29	53	Metal Loss	TBit	SK	Inspection Side
1624	71	54.25	206.34	1.59	0.72	53	Metal Loss	TBit	SK	Inspection Side
1625	71	30.67	220.16	0.55	0.31	54	Metal Loss	TBit	SK	Inspection Side
1626	71	30.67	163.66	0.60	0.32	54	Metal Loss	TBit	SK	Inspection Side
1627	71	27.64	235.83	0.63	0.29	54	Metal Loss	TBit	SK	Inspection Side
1628	71	9.02	140.94	0.73	0.42	54	Metal Loss	TBit	SK	Inspection Side
1629	71	18.23	107.05	0.79	0.50	54	Metal Loss	TBit	SK	Inspection Side
1630	71	51.30	238.90	0.82	0.39	54	Metal Loss	TBit	SK	Inspection Side
1631	71	60.98	20.98	1.20	1.54	54	Metal Loss	TBit	SK	Non Inspection Side
1632	71	61.77	228.58	1.29	0.59	54	Metal Loss	TBit	SK	Non Inspection Side
1633	71	59.21	45.28	1.40	0.48	54	Metal Loss	TBit	SK	Inspection Side
1634	71	45.71	80.20	1.94	0.51	54	Metal Loss	TBit	SK	Non Inspection Side
1635	71	53.90	14.88	0.31	0.20	55	Metal Loss	TBit	SK	Inspection Side
1636	71	15.94	212.44	0.81	0.57	55	Metal Loss	TBit	SK	Inspection Side
1637	71	16.69	57.60	1.14	0.28	55	Metal Loss	TBit	SK	Inspection Side
1638	71	59.21	27.91	0.73	0.38	56	Metal Loss	TBit	SK	Inspection Side
1639	71	52.99	160.71	0.80	0.55	56	Metal Loss	TBit	SK	Inspection Side
1640	71	57.72	14.02	0.88	0.41	56	Metal Loss	TBit	SK	Inspection Side
1641	71	61.85	230.51	1.14	0.25	56	Metal Loss	TBit	SK	Non Inspection Side
1642	71	22.72	163.82	1.26	0.41	56	Metal Loss	TBit	SK	Inspection Side
1643	71	25.98	10.12	1.27	0.61	56	Metal Loss	TBit	SK	Inspection Side
1644	71	61.38	177.36	1.35	0.77	56	Metal Loss	TBit	SK	Non Inspection Side
1645	71	49.88	125.12	2.11	0.51	56	Metal Loss	TBit	SK	Inspection Side
1646	71	46.14	70.91	0.84	0.46	57	Metal Loss	TBit	SK	Inspection Side
1647	71	50.24	193.74	1.01	0.55	57	Metal Loss	TBit	SK	Inspection Side
1648	71	61.54	106.85	1.18	1.69	57	Metal Loss	TBit	SK	Non Inspection Side
1649	71	22.52	206.30	1.30	0.48	57	Metal Loss	TBit	SK	Inspection Side
1650	71	10.04	239.65	1.38	0.41	57	Metal Loss	TBit	SK	Inspection Side
1651	71	45.75	46.97	1.98	0.65	57	Metal Loss	TBit	SK	Non Inspection Side
1652	71	45.87	61.34	2.27	0.41	57	Metal Loss	TBit	SK	Non Inspection Side
1653	71	18.62	232.91	0.51	0.45	58	Metal Loss	TBit	SK	Inspection Side
1654	71	18.54	213.50	0.60	0.36	58	Metal Loss	TBit	SK	Inspection Side
1655	71	51.61	197.20	0.61	0.42	58	Metal Loss	TBit	SK	Inspection Side
1656	71	11.42	32.40	0.65	0.29	58	Metal Loss	TBit	SK	Inspection Side
1657	71	16.57	29.96	0.79	0.34	58	Metal Loss	TBit	SK	Inspection Side
1658	71	20.39	160.35	0.89	0.58	58	Metal Loss	TBit	SK	Inspection Side
1659	71	57.72	65.51	1.16	0.44	58	Metal Loss	TBit	SK	Inspection Side
1660	71	16.69	88.03	1.25	0.65	58	Metal Loss	TBit	SK	Inspection Side
1661	71	46.85	212.99	0.71	0.50	59	Metal Loss	TBit	SK	Inspection Side
1662	71	46.57	34.69	0.86	0.34	60	Metal Loss	TBit	SK	Inspection Side
1663	71	15.63	42.20	0.93	0.63	60	Metal Loss	TBit	SK	Inspection Side
1664	71	13.27	240.98	1.31	0.56	60	Metal Loss	TBit	SK	Inspection Side
1665	71	59.84	94.53	0.68	0.48	61	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1666	71	31.61	216.69	0.93	0.24	61	Metal Loss	TBit	SK	Inspection Side
1667	71	17.80	45.83	0.94	0.53	61	Metal Loss	TBit	SK	Inspection Side
1668	71	15.94	68.66	1.25	0.82	61	Metal Loss	TBit	SK	Inspection Side
1669	71	41.50	187.17	0.57	0.41	62	Metal Loss	TBit	SK	Inspection Side
1670	71	25.67	205.51	0.69	0.44	62	Metal Loss	TBit	SK	Inspection Side
1671	71	57.68	215.43	0.72	0.59	62	Metal Loss	TBit	SK	Inspection Side
1672	71	15.51	230.63	0.81	0.31	62	Metal Loss	TBit	SK	Inspection Side
1673	71	58.94	173.11	0.85	0.35	62	Metal Loss	TBit	SK	Inspection Side
1674	71	31.10	63.03	0.89	0.49	62	Metal Loss	TBit	SK	Inspection Side
1675	71	23.98	234.33	1.09	0.45	62	Metal Loss	TBit	SK	Inspection Side
1676	71	53.90	19.57	1.17	0.50	62	Metal Loss	TBit	SK	Inspection Side
1677	71	15.51	81.93	1.16	0.63	63	Metal Loss	TBit	SK	Inspection Side
1678	71	21.10	91.57	1.42	0.92	63	Metal Loss	TBit	SK	Inspection Side
1679	71	15.91	161.93	0.89	0.73	64	Metal Loss	TBit	SK	Inspection Side
1680	71	52.68	218.70	0.97	0.46	64	Metal Loss	TBit	SK	Inspection Side
1681	71	46.14	97.72	1.08	0.36	64	Metal Loss	TBit	SK	Inspection Side
1682	71	18.19	192.52	1.22	0.41	64	Metal Loss	TBit	SK	Inspection Side
1683	71	22.91	142.13	1.32	0.57	65	Metal Loss	TBit	SK	Inspection Side
1684	71	54.72	144.06	0.57	0.44	66	Metal Loss	TBit	SK	Inspection Side
1685	71	17.32	92.28	0.91	0.39	66	Metal Loss	TBit	SK	Inspection Side
1686	71	15.91	175.71	1.12	0.37	66	Metal Loss	TBit	SK	Inspection Side
1687	71	23.58	211.85	0.86	0.44	67	Metal Loss	TBit	SK	Inspection Side
1688	71	33.94	178.11	0.93	0.45	67	Metal Loss	TBit	SK	Inspection Side
1689	71	22.20	106.46	0.94	0.49	67	Metal Loss	TBit	SK	Inspection Side
1690	71	41.18	190.20	0.80	0.34	68	Metal Loss	TBit	SK	Inspection Side
1691	71	57.56	66.93	0.88	0.47	69	Metal Loss	TBit	SK	Inspection Side
1692	71	58.19	222.95	1.42	0.79	69	Metal Loss	TBit	SK	Inspection Side
1693	71	17.17	144.33	0.77	0.42	70	Metal Loss	TBit	SK	Inspection Side
1694	71	23.43	192.48	1.01	0.52	70	Metal Loss	TBit	SK	Inspection Side
1695	71	16.14	101.61	1.14	0.33	70	Metal Loss	TBit	SK	Inspection Side
1696	71	58.70	234.21	1.29	0.72	70	Metal Loss	TBit	SK	Inspection Side
1697	71	16.10	44.61	0.90	0.36	71	Metal Loss	TBit	SK	Inspection Side
1698	71	61.14	223.62	0.44	0.32	72	Metal Loss	TBit	SK	Inspection Side
1699	71	54.41	153.23	0.73	0.38	72	Metal Loss	TBit	SK	Inspection Side
1700	71	31.69	70.35	1.15	0.80	72	Metal Loss	TBit	SK	Inspection Side
1701	71	60.71	52.09	1.19	0.82	72	Metal Loss	TBit	SK	Inspection Side
1702	71	15.91	95.98	1.20	0.62	72	Metal Loss	TBit	SK	Inspection Side
1703	71	57.09	220.24	0.71	0.49	73	Metal Loss	TBit	SK	Inspection Side
1704	71	49.53	11.42	0.67	0.52	74	Metal Loss	TBit	SK	Inspection Side
1705	71	30.79	121.65	1.58	0.74	76	Metal Loss	TBit	SK	Inspection Side
1706	71	52.68	227.60	2.33	0.73	78	Metal Loss	TBit	SK	Inspection Side
1707	71	59.61	159.21	0.64	0.35	79	Metal Loss	TBit	SK	Inspection Side
1708	71	59.80	101.89	1.13	0.44	79	Metal Loss	TBit	SK	Inspection Side
1709	71	45.91	76.97	1.18	1.14	79	Metal Loss	TBit	SK	Inspection Side
1710	71	17.20	103.15	1.11	0.70	86	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1711	71	58.19	220.00	0.71	0.42	93	Metal Loss	TBit	SK	Inspection Side
1712	71	15.20	107.13	1.20	0.31	93	Metal Loss	TBit	SK	Inspection Side
1713	71	55.16	227.36	1.29	0.69	94	Metal Loss	TBit	SK	Inspection Side
1714	71	54.17	56.85	0.86	0.40	95	Metal Loss	TBit	SK	Inspection Side
1715	71	31.69	85.35	1.15	0.92	96	Metal Loss	TBit	SK	Inspection Side
1716	71	59.80	99.65	1.00	0.46	97	Metal Loss	TBit	SK	Inspection Side
1717	71	59.49	201.26	1.31	0.67	97	Metal Loss	TBit	SK	Inspection Side
1718	71	15.28	44.92	1.46	0.92	97	Metal Loss	TBit	SK	Inspection Side
1719	71	18.19	36.69	1.21	0.52	98	Metal Loss	TBit	SK	Inspection Side
1720	72	52.56	111.65	0.24	0.34	49	Metal Loss	TBit	SK	Inspection Side
1721	72	60.59	145.04	0.42	0.34	49	Metal Loss	TBit	SK	Inspection Side
1722	72	51.46	36.42	0.54	0.27	49	Metal Loss	TBit	SK	Inspection Side
1723	72	63.23	31.65	0.62	0.44	49	Metal Loss	TBit	SK	Inspection Side
1724	72	18.94	42.24	0.73	0.54	49	Metal Loss	TBit	SK	Inspection Side
1725	72	7.32	182.64	0.75	0.44	49	Metal Loss	TBit	SK	Inspection Side
1726	72	61.73	138.94	0.81	0.38	49	Metal Loss	TBit	SK	Inspection Side
1727	72	31.85	141.42	0.88	0.33	49	Metal Loss	TBit	SK	Inspection Side
1728	72	54.09	183.62	0.94	0.42	49	Metal Loss	TBit	SK	Inspection Side
1729	72	16.73	177.01	0.98	0.28	49	Metal Loss	TBit	SK	Inspection Side
1730	72	58.90	37.28	1.02	0.76	49	Metal Loss	TBit	SK	Inspection Side
1731	72	48.86	167.99	1.87	0.51	49	Metal Loss	TBit	SK	Inspection Side
1732	72	25.31	104.96	0.14	0.34	50	Metal Loss	TBit	SK	Inspection Side
1733	72	47.56	96.46	0.27	0.24	50	Metal Loss	TBit	SK	Inspection Side
1734	72	10.91	217.76	0.85	0.35	50	Metal Loss	TBit	SK	Inspection Side
1735	72	59.96	201.57	0.88	0.29	50	Metal Loss	TBit	SK	Inspection Side
1736	72	36.34	45.12	0.50	0.29	51	Metal Loss	TBit	SK	Inspection Side
1737	72	59.57	168.03	0.86	0.37	51	Metal Loss	TBit	SK	Inspection Side
1738	72	58.11	104.57	1.39	0.47	51	Metal Loss	TBit	SK	Inspection Side
1739	72	52.56	97.24	2.10	1.66	51	Metal Loss	TBit	SK	Inspection Side
1740	72	49.65	181.26	0.51	0.41	52	Metal Loss	TBit	SK	Inspection Side
1741	72	58.66	102.68	0.70	0.22	52	Metal Loss	TBit	SK	Inspection Side
1742	72	56.97	161.61	0.75	0.51	52	Metal Loss	TBit	SK	Inspection Side
1743	72	56.50	37.32	0.80	0.61	52	Metal Loss	TBit	SK	Inspection Side
1744	72	47.68	139.76	1.30	0.86	52	Metal Loss	TBit	SK	Non Inspection Side
1745	72	50.71	38.23	1.39	0.74	52	Metal Loss	TBit	SK	Inspection Side
1746	72	61.46	107.76	1.60	0.61	52	Metal Loss	TBit	SK	Inspection Side
1747	72	20.87	127.24	1.78	0.51	52	Metal Loss	TBit	SK	Non Inspection Side
1748	72	48.62	48.03	3.09	1.94	52	Metal Loss	TBit	SK	Inspection Side
1749	72	51.46	157.36	0.26	0.30	53	Metal Loss	TBit	SK	Inspection Side
1750	72	54.69	204.84	0.52	0.39	53	Metal Loss	TBit	SK	Inspection Side
1751	72	58.39	152.01	0.56	0.53	53	Metal Loss	TBit	SK	Inspection Side
1752	72	7.60	180.83	0.92	0.36	53	Metal Loss	TBit	SK	Inspection Side
1753	72	61.65	100.83	0.96	0.30	53	Metal Loss	TBit	SK	Inspection Side
1754	72	59.06	171.38	1.49	0.58	53	Metal Loss	TBit	SK	Inspection Side
1755	72	47.05	32.24	1.50	0.55	53	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1756	72	46.50	106.06	1.74	0.50	53	Metal Loss	TBit	SK	Inspection Side
1757	72	51.02	105.08	2.01	0.57	53	Metal Loss	TBit	SK	Inspection Side
1758	72	19.49	72.68	0.37	2.46	54	Metal Loss	TBit	SK	Non Inspection Side
1759	72	51.06	36.73	0.39	0.36	54	Metal Loss	TBit	SK	Inspection Side
1760	72	57.05	232.05	0.47	0.47	54	Metal Loss	TBit	SK	Inspection Side
1761	72	55.98	204.69	0.48	0.37	54	Metal Loss	TBit	SK	Inspection Side
1762	72	25.39	237.83	0.64	0.39	54	Metal Loss	TBit	SK	Inspection Side
1763	72	8.70	19.57	0.77	0.44	54	Metal Loss	TBit	SK	Inspection Side
1764	72	24.72	9.45	0.90	0.34	54	Metal Loss	TBit	SK	Inspection Side
1765	72	60.00	112.05	0.97	0.70	54	Metal Loss	TBit	SK	Inspection Side
1766	72	13.86	12.95	1.05	0.53	54	Metal Loss	TBit	SK	Inspection Side
1767	72	15.55	97.28	1.21	1.35	54	Metal Loss	TBit	SK	Inspection Side
1768	72	7.13	178.66	0.48	0.31	55	Metal Loss	TBit	SK	Inspection Side
1769	72	66.26	193.70	0.54	0.35	55	Metal Loss	TBit	SK	Inspection Side
1770	72	56.54	149.25	0.81	0.45	55	Metal Loss	TBit	SK	Inspection Side
1771	72	24.13	129.25	0.87	0.45	55	Metal Loss	TBit	SK	Inspection Side
1772	72	27.01	11.85	1.04	0.37	55	Metal Loss	TBit	SK	Inspection Side
1773	72	58.74	168.31	1.16	0.36	55	Metal Loss	TBit	SK	Inspection Side
1774	72	55.16	128.90	1.25	0.43	55	Metal Loss	TBit	SK	Inspection Side
1775	72	24.84	131.06	1.38	0.67	55	Metal Loss	TBit	SK	Inspection Side
1776	72	23.39	233.90	0.89	0.50	56	Metal Loss	TBit	SK	Inspection Side
1777	72	59.61	187.68	1.02	0.46	56	Metal Loss	TBit	SK	Inspection Side
1778	72	54.84	108.03	1.49	0.49	56	Metal Loss	TBit	SK	Inspection Side
1779	72	60.24	36.73	1.51	0.67	56	Metal Loss	TBit	SK	Non Inspection Side
1780	72	51.69	45.47	1.94	1.07	56	Metal Loss	TBit	SK	Inspection Side
1781	72	57.64	214.06	0.27	0.38	57	Metal Loss	TBit	SK	Inspection Side
1782	72	59.33	185.87	0.93	0.59	57	Metal Loss	TBit	SK	Inspection Side
1783	72	60.51	132.80	1.02	0.32	57	Metal Loss	TBit	SK	Inspection Side
1784	72	50.67	159.21	1.23	0.69	57	Metal Loss	TBit	SK	Inspection Side
1785	72	47.95	130.59	1.64	0.29	57	Metal Loss	TBit	SK	Inspection Side
1786	72	47.44	46.26	2.23	0.63	57	Metal Loss	TBit	SK	Inspection Side
1787	72	47.09	146.26	3.10	0.83	57	Metal Loss	TBit	SK	Inspection Side
1788	72	52.83	179.84	0.49	0.41	58	Metal Loss	TBit	SK	Inspection Side
1789	72	18.90	176.57	0.70	0.41	58	Metal Loss	TBit	SK	Inspection Side
1790	72	32.44	190.63	0.74	0.33	58	Metal Loss	TBit	SK	Inspection Side
1791	72	17.56	93.54	0.83	0.41	58	Metal Loss	TBit	SK	Inspection Side
1792	72	62.13	93.31	0.86	0.36	58	Metal Loss	TBit	SK	Inspection Side
1793	72	54.88	177.87	0.89	0.44	58	Metal Loss	TBit	SK	Inspection Side
1794	72	43.31	47.09	1.65	1.91	58	Metal Loss	TBit	SK	Inspection Side
1795	72	46.26	199.76	1.67	0.49	58	Metal Loss	TBit	SK	Inspection Side
1796	72	50.75	143.39	2.94	1.18	58	Metal Loss	TBit	SK	Inspection Side
1797	72	23.23	132.76	0.58	0.40	59	Metal Loss	TBit	SK	Non Inspection Side
1798	72	24.06	205.28	0.84	0.39	59	Metal Loss	TBit	SK	Inspection Side
1799	72	23.23	102.95	0.91	0.45	59	Metal Loss	TBit	SK	Inspection Side
1800	72	16.97	159.53	0.96	0.29	59	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1801	72	59.33	165.39	0.98	0.59	59	Metal Loss	TBit	SK	Inspection Side
1802	72	55.35	181.81	1.65	0.64	59	Metal Loss	TBit	SK	Inspection Side
1803	72	50.16	96.06	2.08	0.75	59	Metal Loss	TBit	SK	Inspection Side
1804	72	52.09	101.06	2.19	1.65	59	Metal Loss	TBit	SK	Inspection Side
1805	72	5.39	183.15	0.48	0.36	60	Metal Loss	TBit	SK	Inspection Side
1806	72	20.91	104.33	0.55	0.25	60	Metal Loss	TBit	SK	Inspection Side
1807	72	37.24	107.09	0.91	0.38	60	Metal Loss	TBit	SK	Inspection Side
1808	72	57.01	37.05	1.15	0.61	60	Metal Loss	TBit	SK	Inspection Side
1809	72	45.94	173.62	0.96	0.80	61	Metal Loss	TBit	SK	Inspection Side
1810	72	56.34	40.43	1.01	0.58	61	Metal Loss	TBit	SK	Inspection Side
1811	72	18.11	166.85	1.30	0.30	61	Metal Loss	TBit	SK	Inspection Side
1812	72	56.97	157.13	1.66	0.62	61	Metal Loss	TBit	SK	Inspection Side
1813	72	31.30	154.84	0.85	0.39	62	Metal Loss	TBit	SK	Inspection Side
1814	72	59.96	177.68	1.04	0.37	62	Metal Loss	TBit	SK	Inspection Side
1815	72	60.63	161.97	1.17	1.22	62	Metal Loss	TBit	SK	Inspection Side
1816	72	18.46	154.76	1.53	0.55	62	Metal Loss	TBit	SK	Inspection Side
1817	72	60.55	93.11	2.71	0.57	62	Metal Loss	TBit	SK	Inspection Side
1818	72	52.56	177.60	0.74	0.41	63	Metal Loss	TBit	SK	Inspection Side
1819	72	15.59	96.65	0.89	0.28	63	Metal Loss	TBit	SK	Inspection Side
1820	72	57.20	172.68	0.61	0.39	64	Metal Loss	TBit	SK	Inspection Side
1821	72	47.05	111.93	1.19	0.36	64	Metal Loss	TBit	SK	Inspection Side
1822	72	42.20	38.58	4.13	1.44	64	Metal Loss	TBit	SK	Inspection Side
1823	72	63.58	191.42	0.66	0.37	65	Metal Loss	TBit	SK	Inspection Side
1824	72	14.21	181.06	1.35	0.41	65	Metal Loss	TBit	SK	Inspection Side
1825	72	60.20	166.73	0.46	0.32	66	Metal Loss	TBit	SK	Inspection Side
1826	72	53.43	93.78	0.68	0.55	66	Metal Loss	TBit	SK	Inspection Side
1827	72	16.10	18.70	1.02	0.35	66	Metal Loss	TBit	SK	Inspection Side
1828	72	43.90	35.67	0.79	0.46	67	Metal Loss	TBit	SK	Inspection Side
1829	72	25.71	190.35	1.12	0.47	67	Metal Loss	TBit	SK	Inspection Side
1830	72	20.75	126.42	1.53	0.45	67	Metal Loss	TBit	SK	Non Inspection Side
1831	72	19.17	212.05	0.57	0.33	68	Metal Loss	TBit	SK	Inspection Side
1832	72	20.28	165.39	0.67	0.37	68	Metal Loss	TBit	SK	Inspection Side
1833	72	20.91	95.91	1.00	0.42	68	Metal Loss	TBit	SK	Non Inspection Side
1834	72	13.78	177.01	1.53	0.46	69	Metal Loss	TBit	SK	Inspection Side
1835	72	47.76	134.72	2.92	0.35	69	Metal Loss	TBit	SK	Inspection Side
1836	72	59.80	174.06	0.83	0.42	70	Metal Loss	TBit	SK	Inspection Side
1837	72	58.86	174.33	1.13	0.35	70	Metal Loss	TBit	SK	Inspection Side
1838	72	52.09	93.46	1.32	1.00	70	Metal Loss	TBit	SK	Inspection Side
1839	72	20.67	125.39	1.33	0.74	70	Metal Loss	TBit	SK	Non Inspection Side
1840	72	61.93	214.45	1.00	0.52	71	Metal Loss	TBit	SK	Inspection Side
1841	72	58.19	108.23	1.31	0.57	71	Metal Loss	TBit	SK	Inspection Side
1842	72	16.30	155.04	1.19	1.24	72	Metal Loss	TBit	SK	Non Inspection Side
1843	72	45.51	178.62	1.22	0.49	73	Metal Loss	TBit	SK	Non Inspection Side
1844	72	31.97	147.24	1.11	2.15	74	Metal Loss	TBit	SK	Non Inspection Side
1845	72	37.13	95.67	1.18	1.57	74	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1846	72	47.83	143.11	1.24	0.77	77	Metal Loss	TBit	SK	Inspection Side
1847	72	15.47	165.55	1.33	0.53	77	Metal Loss	TBit	SK	Inspection Side
1848	72	17.01	160.87	1.13	0.43	78	Metal Loss	TBit	SK	Inspection Side
1849	72	45.59	112.95	1.36	0.53	78	Metal Loss	TBit	SK	Inspection Side
1850	72	46.38	40.59	1.23	0.70	79	Metal Loss	TBit	SK	Inspection Side
1851	72	47.83	149.84	2.85	0.77	79	Metal Loss	TBit	SK	Inspection Side
1852	72	16.65	162.56	0.94	0.37	80	Metal Loss	TBit	SK	Inspection Side
1853	72	19.17	109.17	1.11	0.57	80	Metal Loss	TBit	SK	Inspection Side
1854	72	52.56	117.40	1.12	0.46	80	Metal Loss	TBit	SK	Inspection Side
1855	72	49.49	118.19	3.39	0.66	83	Metal Loss	TBit	SK	Inspection Side
1856	72	56.38	158.90	0.97	0.57	85	Metal Loss	TBit	SK	Inspection Side
1857	72	52.83	142.64	1.72	0.26	85	Metal Loss	TBit	SK	Inspection Side
1858	72	14.17	181.54	0.45	0.48	87	Metal Loss	TBit	SK	Inspection Side
1859	72	61.14	182.72	1.08	0.48	89	Metal Loss	TBit	SK	Inspection Side
1860	72	45.55	144.80	1.14	0.52	89	Metal Loss	TBit	SK	Inspection Side
1861	72	55.47	149.76	2.07	0.73	91	Metal Loss	TBit	SK	Inspection Side
1862	72	46.50	38.74	1.67	1.10	95	Metal Loss	TBit	SK	Non Inspection Side
1863	72	59.69	197.24	0.85	0.60	97	Metal Loss	TBit	SK	Inspection Side
1864	72	56.46	37.05	1.18	0.55	97	Metal Loss	TBit	SK	Inspection Side
1865	72	21.26	105.71	1.58	0.39	97	Metal Loss	TBit	SK	Inspection Side
1866	72	59.69	34.53	2.19	0.29	97	Metal Loss	TBit	SK	Inspection Side
1867	72	52.56	136.65	2.08	0.66	98	Metal Loss	TBit	SK	Inspection Side
1868	73	49.06	12.99	0.41	0.32	49	Metal Loss	TBit	SK	Inspection Side
1869	73	20.08	113.31	0.52	0.55	49	Metal Loss	TBit	SK	Inspection Side
1870	73	26.42	54.21	0.58	0.42	49	Metal Loss	TBit	SK	Inspection Side
1871	73	27.24	73.43	0.71	0.28	49	Metal Loss	TBit	SK	Inspection Side
1872	73	53.82	158.46	0.83	0.49	49	Metal Loss	TBit	SK	Inspection Side
1873	73	25.31	17.72	0.96	0.55	49	Metal Loss	TBit	SK	Inspection Side
1874	73	44.02	26.42	0.99	0.40	49	Metal Loss	TBit	SK	Inspection Side
1875	73	30.71	54.61	1.81	0.37	49	Metal Loss	TBit	SK	Inspection Side
1876	73	30.71	47.40	2.49	0.43	49	Metal Loss	TBit	SK	Inspection Side
1877	73	61.26	244.72	0.47	3.43	50	Metal Loss	TBit	SK	Non Inspection Side
1878	73	62.60	234.29	0.49	0.45	50	Metal Loss	TBit	SK	Inspection Side
1879	73	59.61	122.56	0.58	0.23	50	Metal Loss	TBit	SK	Inspection Side
1880	73	29.65	180.20	0.76	0.51	50	Metal Loss	TBit	SK	Inspection Side
1881	73	34.84	13.74	0.80	0.32	50	Metal Loss	TBit	SK	Inspection Side
1882	73	10.63	134.72	0.87	0.50	50	Metal Loss	TBit	SK	Inspection Side
1883	73	34.45	12.20	1.09	0.55	50	Metal Loss	TBit	SK	Inspection Side
1884	73	30.75	18.70	1.09	0.45	50	Metal Loss	TBit	SK	Inspection Side
1885	73	18.50	46.42	1.16	0.47	50	Metal Loss	TBit	SK	Inspection Side
1886	73	32.44	20.08	1.17	0.56	50	Metal Loss	TBit	SK	Inspection Side
1887	73	10.20	72.40	0.58	0.35	51	Metal Loss	TBit	SK	Inspection Side
1888	73	24.13	11.61	0.62	0.37	51	Metal Loss	TBit	SK	Inspection Side
1889	73	61.30	186.30	0.78	0.33	51	Metal Loss	TBit	SK	Inspection Side
1890	73	55.24	12.13	0.90	0.81	51	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1891	73	15.75	92.24	1.77	0.46	51	Metal Loss	TBit	SK	Inspection Side
1892	73	15.94	6.46	0.46	0.42	52	Metal Loss	TBit	SK	Inspection Side
1893	73	20.00	124.72	0.66	0.32	52	Metal Loss	TBit	SK	Inspection Side
1894	73	58.39	125.51	0.76	0.39	52	Metal Loss	TBit	SK	Inspection Side
1895	73	27.99	56.57	0.80	0.73	52	Metal Loss	TBit	SK	Inspection Side
1896	73	18.94	105.67	0.82	0.27	52	Metal Loss	TBit	SK	Inspection Side
1897	73	21.02	109.53	1.03	0.77	52	Metal Loss	TBit	SK	Inspection Side
1898	73	49.33	11.77	1.05	0.61	52	Metal Loss	TBit	SK	Inspection Side
1899	73	61.77	62.83	1.20	0.90	52	Metal Loss	TBit	SK	Non Inspection Side
1900	73	59.61	138.70	0.68	0.39	53	Metal Loss	TBit	SK	Inspection Side
1901	73	15.28	67.76	0.79	0.12	53	Metal Loss	TBit	SK	Inspection Side
1902	73	57.20	167.72	0.91	0.52	53	Metal Loss	TBit	SK	Inspection Side
1903	73	25.98	111.77	2.24	0.51	53	Metal Loss	TBit	SK	Inspection Side
1904	73	14.21	10.24	0.50	0.38	54	Metal Loss	TBit	SK	Inspection Side
1905	73	59.65	161.93	0.68	0.29	54	Metal Loss	TBit	SK	Inspection Side
1906	73	53.70	140.31	0.84	0.39	54	Metal Loss	TBit	SK	Inspection Side
1907	73	22.36	152.44	1.45	0.44	54	Metal Loss	TBit	SK	Inspection Side
1908	73	49.41	37.20	1.28	0.44	55	Metal Loss	TBit	SK	Inspection Side
1909	73	27.01	57.80	0.61	0.55	56	Metal Loss	TBit	SK	Inspection Side
1910	73	57.99	137.09	0.68	0.43	56	Metal Loss	TBit	SK	Inspection Side
1911	73	61.89	22.24	0.76	0.34	56	Metal Loss	TBit	SK	Inspection Side
1912	73	20.63	166.42	0.80	0.44	56	Metal Loss	TBit	SK	Inspection Side
1913	73	26.14	166.73	0.98	0.53	56	Metal Loss	TBit	SK	Inspection Side
1914	73	26.61	45.24	0.92	0.50	57	Metal Loss	TBit	SK	Inspection Side
1915	73	31.65	184.06	1.10	0.76	57	Metal Loss	TBit	SK	Inspection Side
1916	73	29.92	52.09	3.19	0.46	57	Metal Loss	TBit	SK	Inspection Side
1917	73	11.18	5.71	0.96	0.49	58	Metal Loss	TBit	SK	Inspection Side
1918	73	22.05	52.52	1.03	0.79	58	Metal Loss	TBit	SK	Inspection Side
1919	73	15.94	106.02	2.19	0.25	58	Metal Loss	TBit	SK	Inspection Side
1920	73	53.50	35.28	0.58	0.39	59	Metal Loss	TBit	SK	Inspection Side
1921	73	59.41	87.05	0.80	0.31	60	Metal Loss	TBit	SK	Inspection Side
1922	73	20.51	51.93	0.84	0.25	60	Metal Loss	TBit	SK	Inspection Side
1923	73	24.29	49.37	0.73	0.31	61	Metal Loss	TBit	SK	Inspection Side
1924	73	15.28	69.84	0.83	0.12	61	Metal Loss	TBit	SK	Inspection Side
1925	73	31.89	185.79	1.08	0.63	61	Metal Loss	TBit	SK	Inspection Side
1926	73	24.80	91.22	1.16	0.76	61	Metal Loss	TBit	SK	Inspection Side
1927	73	15.67	145.55	1.60	1.07	61	Metal Loss	TBit	SK	Non Inspection Side
1928	73	28.94	61.81	2.43	0.78	61	Metal Loss	TBit	SK	Inspection Side
1929	73	20.31	55.83	0.95	0.44	62	Metal Loss	TBit	SK	Inspection Side
1930	73	7.60	81.10	1.06	0.58	62	Metal Loss	TBit	SK	Inspection Side
1931	73	17.83	53.27	2.00	0.64	62	Metal Loss	TBit	SK	Inspection Side
1932	73	27.80	103.43	2.36	1.75	62	Metal Loss	TBit	SK	Inspection Side
1933	73	12.32	22.13	0.81	0.43	63	Metal Loss	TBit	SK	Inspection Side
1934	73	61.73	78.31	1.28	0.65	64	Metal Loss	TBit	SK	Inspection Side
1935	73	17.48	81.73	1.76	0.54	64	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1936	73	16.93	20.98	0.49	0.38	65	Metal Loss	TBit	SK	Inspection Side
1937	73	18.82	88.46	0.75	0.42	65	Metal Loss	TBit	SK	Inspection Side
1938	73	61.73	52.01	1.30	1.61	65	Metal Loss	TBit	SK	Non Inspection Side
1939	73	20.98	45.71	0.92	0.62	66	Metal Loss	TBit	SK	Inspection Side
1940	73	19.09	43.11	1.36	0.44	67	Metal Loss	TBit	SK	Inspection Side
1941	73	24.29	13.74	0.91	0.44	68	Metal Loss	TBit	SK	Inspection Side
1942	73	61.34	54.92	1.03	0.75	68	Metal Loss	TBit	SK	Inspection Side
1943	73	21.73	101.22	0.88	0.35	69	Metal Loss	TBit	SK	Inspection Side
1944	73	22.36	73.66	0.90	0.57	70	Metal Loss	TBit	SK	Inspection Side
1945	73	15.59	78.11	1.45	0.21	70	Metal Loss	TBit	SK	Inspection Side
1946	73	29.65	92.99	1.39	0.43	71	Metal Loss	TBit	SK	Inspection Side
1947	73	24.92	51.85	0.89	0.32	73	Metal Loss	TBit	SK	Inspection Side
1948	73	24.02	106.54	1.08	0.56	73	Metal Loss	TBit	SK	Inspection Side
1949	73	15.91	171.02	2.07	1.22	73	Metal Loss	TBit	SK	Non Inspection Side
1950	73	14.61	23.31	2.14	0.48	76	Metal Loss	TBit	SK	Inspection Side
1951	73	31.30	56.18	2.56	0.32	76	Metal Loss	TBit	SK	Inspection Side
1952	73	17.91	60.39	0.82	0.25	78	Metal Loss	TBit	SK	Inspection Side
1953	73	21.73	58.39	0.97	0.47	79	Metal Loss	TBit	SK	Inspection Side
1954	73	29.92	57.40	1.99	0.95	82	Metal Loss	TBit	SK	Inspection Side
1955	73	20.39	62.44	2.07	0.93	82	Metal Loss	TBit	SK	Inspection Side
1956	73	31.89	50.35	1.42	0.75	84	Metal Loss	TBit	SK	Inspection Side
1957	73	24.33	57.09	1.48	0.70	94	Metal Loss	TBit	SK	Inspection Side
1958	73	61.69	56.65	0.99	0.72	95	Metal Loss	TBit	SK	Inspection Side
1959	73	21.46	106.18	1.15	0.53	95	Metal Loss	TBit	SK	Inspection Side
1960	73	31.30	51.10	0.76	0.23	97	Metal Loss	TBit	SK	Inspection Side
1961	73	25.51	55.51	0.91	0.45	97	Metal Loss	TBit	SK	Inspection Side
1962	73	16.34	12.68	0.96	0.85	97	Metal Loss	TBit	SK	Inspection Side
1963	73	60.98	43.15	1.07	0.43	97	Metal Loss	TBit	SK	Inspection Side
1964	73	15.59	141.02	1.44	0.85	97	Metal Loss	TBit	SK	Inspection Side
1965	73	60.31	48.11	1.53	0.93	97	Metal Loss	TBit	SK	Inspection Side
1966	73	18.50	104.25	1.76	0.75	97	Metal Loss	TBit	SK	Inspection Side
1967	73	17.91	84.92	1.86	0.35	97	Metal Loss	TBit	SK	Inspection Side
1968	74	19.37	144.37	0.51	0.39	49	Metal Loss	TBit	SK	Inspection Side
1969	74	48.43	83.15	0.56	0.40	49	Metal Loss	TBit	SK	Inspection Side
1970	74	21.61	28.27	0.70	0.54	49	Metal Loss	TBit	SK	Inspection Side
1971	74	26.69	193.07	0.82	0.72	49	Metal Loss	TBit	SK	Inspection Side
1972	74	31.46	166.26	0.87	1.85	49	Metal Loss	TBit	SK	Non Inspection Side
1973	74	17.24	31.42	0.99	0.99	49	Metal Loss	TBit	SK	Non Inspection Side
1974	74	15.98	124.02	1.37	0.25	49	Metal Loss	TBit	SK	Inspection Side
1975	74	25.59	103.07	2.39	0.47	49	Metal Loss	TBit	SK	Inspection Side
1976	74	57.17	173.58	0.47	0.42	50	Metal Loss	TBit	SK	Inspection Side
1977	74	20.55	184.69	0.51	0.55	50	Metal Loss	TBit	SK	Inspection Side
1978	74	23.19	175.35	0.59	0.41	50	Metal Loss	TBit	SK	Inspection Side
1979	74	22.36	223.23	0.81	0.69	50	Metal Loss	TBit	SK	Inspection Side
1980	74	28.07	69.06	0.87	0.31	50	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
1981	74	60.55	209.06	0.88	0.29	50	Metal Loss	TBit	SK	Inspection Side
1982	74	43.74	123.78	0.91	0.36	50	Metal Loss	TBit	SK	Inspection Side
1983	74	60.43	106.50	1.01	0.65	50	Metal Loss	TBit	SK	Inspection Side
1984	74	66.65	238.54	1.15	2.57	50	Metal Loss	TBit	SK	Non Inspection Side
1985	74	45.24	88.94	1.25	0.62	50	Metal Loss	TBit	SK	Inspection Side
1986	74	32.17	177.87	1.54	0.62	50	Metal Loss	TBit	SK	Non Inspection Side
1987	74	16.42	108.94	2.40	0.50	50	Metal Loss	TBit	SK	Inspection Side
1988	74	55.67	139.25	0.77	0.53	51	Metal Loss	TBit	SK	Inspection Side
1989	74	38.23	163.43	0.79	0.48	51	Metal Loss	TBit	SK	Inspection Side
1990	74	59.72	166.06	0.81	0.42	51	Metal Loss	TBit	SK	Inspection Side
1991	74	24.06	173.86	1.02	0.45	51	Metal Loss	TBit	SK	Inspection Side
1992	74	19.37	71.81	1.42	0.82	51	Metal Loss	TBit	SK	Inspection Side
1993	74	58.03	150.94	0.41	0.64	52	Metal Loss	TBit	SK	Non Inspection Side
1994	74	42.64	200.04	0.68	0.27	52	Metal Loss	TBit	SK	Inspection Side
1995	74	52.99	136.93	0.88	0.33	52	Metal Loss	TBit	SK	Inspection Side
1996	74	59.53	141.26	0.88	0.51	52	Metal Loss	TBit	SK	Inspection Side
1997	74	20.87	72.01	0.93	0.33	52	Metal Loss	TBit	SK	Inspection Side
1998	74	29.17	223.82	0.96	2.88	52	Metal Loss	TBit	SK	Non Inspection Side
1999	74	11.69	84.84	1.07	0.47	52	Metal Loss	TBit	SK	Inspection Side
2000	74	57.40	216.02	1.17	0.59	52	Metal Loss	TBit	SK	Non Inspection Side
2001	74	44.92	213.11	1.26	0.75	52	Metal Loss	TBit	SK	Inspection Side
2002	74	60.35	205.24	1.30	1.27	52	Metal Loss	TBit	SK	Non Inspection Side
2003	74	32.28	189.65	1.33	0.97	52	Metal Loss	TBit	SK	Non Inspection Side
2004	74	28.58	135.47	1.49	0.57	52	Metal Loss	TBit	SK	Inspection Side
2005	74	40.24	76.14	1.95	1.58	52	Metal Loss	TBit	SK	Inspection Side
2006	74	52.17	139.72	2.15	0.53	52	Metal Loss	TBit	SK	Inspection Side
2007	74	59.25	93.98	0.52	0.25	53	Metal Loss	TBit	SK	Inspection Side
2008	74	23.07	37.44	0.56	0.36	53	Metal Loss	TBit	SK	Inspection Side
2009	74	58.27	167.80	0.64	0.37	53	Metal Loss	TBit	SK	Non Inspection Side
2010	74	59.76	209.13	0.79	0.69	53	Metal Loss	TBit	SK	Non Inspection Side
2011	74	48.27	134.96	1.17	0.43	53	Metal Loss	TBit	SK	Inspection Side
2012	74	23.58	138.39	2.09	0.49	53	Metal Loss	TBit	SK	Inspection Side
2013	74	22.36	85.20	2.26	0.33	53	Metal Loss	TBit	SK	Inspection Side
2014	74	62.76	216.18	0.82	0.57	54	Metal Loss	TBit	SK	Inspection Side
2015	74	41.26	204.37	1.25	0.56	54	Metal Loss	TBit	SK	Inspection Side
2016	74	20.12	134.80	0.53	0.32	55	Metal Loss	TBit	SK	Inspection Side
2017	74	40.08	113.54	0.58	0.40	55	Metal Loss	TBit	SK	Inspection Side
2018	74	13.90	76.81	0.93	0.48	55	Metal Loss	TBit	SK	Inspection Side
2019	74	60.39	193.54	1.23	0.51	55	Metal Loss	TBit	SK	Non Inspection Side
2020	74	29.49	82.09	3.74	0.62	55	Metal Loss	TBit	SK	Inspection Side
2021	74	17.40	34.41	0.84	0.52	56	Metal Loss	TBit	SK	Inspection Side
2022	74	36.38	34.53	1.07	0.74	56	Metal Loss	TBit	SK	Inspection Side
2023	74	59.72	139.13	1.08	0.48	56	Metal Loss	TBit	SK	Inspection Side
2024	74	47.91	37.72	1.11	0.39	56	Metal Loss	TBit	SK	Inspection Side
2025	74	43.90	199.88	1.24	0.78	56	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2026	74	32.17	144.76	1.53	0.35	56	Metal Loss	TBit	SK	Non Inspection Side
2027	74	57.44	118.43	2.00	0.55	56	Metal Loss	TBit	SK	Inspection Side
2028	74	57.13	117.24	0.81	0.41	57	Metal Loss	TBit	SK	Inspection Side
2029	74	55.67	38.98	0.86	0.38	57	Metal Loss	TBit	SK	Inspection Side
2030	74	60.43	102.56	1.11	0.78	57	Metal Loss	TBit	SK	Inspection Side
2031	74	17.56	168.62	1.20	0.73	57	Metal Loss	TBit	SK	Inspection Side
2032	74	49.33	138.54	1.47	0.43	57	Metal Loss	TBit	SK	Inspection Side
2033	74	15.98	146.65	1.57	0.56	57	Metal Loss	TBit	SK	Non Inspection Side
2034	74	37.95	43.43	2.11	0.31	57	Metal Loss	TBit	SK	Inspection Side
2035	74	10.12	71.50	0.43	0.33	58	Metal Loss	TBit	SK	Inspection Side
2036	74	47.95	85.71	0.67	0.37	58	Metal Loss	TBit	SK	Inspection Side
2037	74	30.28	209.57	0.71	0.41	58	Metal Loss	TBit	SK	Inspection Side
2038	74	35.35	199.76	0.73	0.32	58	Metal Loss	TBit	SK	Inspection Side
2039	74	30.00	202.80	0.58	0.35	59	Metal Loss	TBit	SK	Inspection Side
2040	74	59.65	196.65	0.97	0.31	59	Metal Loss	TBit	SK	Inspection Side
2041	74	65.83	219.25	0.85	0.31	60	Metal Loss	TBit	SK	Inspection Side
2042	74	32.28	197.09	1.03	0.35	60	Metal Loss	TBit	SK	Inspection Side
2043	74	43.98	165.35	1.16	1.14	60	Metal Loss	TBit	SK	Inspection Side
2044	74	60.35	145.35	1.29	1.22	60	Metal Loss	TBit	SK	Non Inspection Side
2045	74	16.97	186.54	1.59	0.40	60	Metal Loss	TBit	SK	Inspection Side
2046	74	17.83	167.52	0.63	0.32	61	Metal Loss	TBit	SK	Inspection Side
2047	74	16.69	207.01	0.86	0.56	61	Metal Loss	TBit	SK	Inspection Side
2048	74	48.27	167.52	0.89	0.42	61	Metal Loss	TBit	SK	Inspection Side
2049	74	60.31	101.30	1.35	0.45	61	Metal Loss	TBit	SK	Non Inspection Side
2050	74	32.17	169.02	1.56	0.98	61	Metal Loss	TBit	SK	Non Inspection Side
2051	74	58.39	145.83	0.89	0.66	62	Metal Loss	TBit	SK	Inspection Side
2052	74	26.69	56.50	2.42	0.32	62	Metal Loss	TBit	SK	Inspection Side
2053	74	57.24	166.46	0.64	0.35	63	Metal Loss	TBit	SK	Inspection Side
2054	74	57.01	141.93	0.70	0.34	63	Metal Loss	TBit	SK	Inspection Side
2055	74	43.86	154.06	1.15	1.07	63	Metal Loss	TBit	SK	Non Inspection Side
2056	74	32.36	158.15	1.17	0.55	63	Metal Loss	TBit	SK	Inspection Side
2057	74	60.24	162.36	1.50	0.83	64	Metal Loss	TBit	SK	Non Inspection Side
2058	74	26.46	180.00	2.25	0.59	64	Metal Loss	TBit	SK	Inspection Side
2059	74	46.57	106.14	0.79	0.53	65	Metal Loss	TBit	SK	Inspection Side
2060	74	45.55	92.24	1.03	0.50	66	Metal Loss	TBit	SK	Inspection Side
2061	74	59.02	136.73	1.21	0.32	66	Metal Loss	TBit	SK	Inspection Side
2062	74	43.90	208.31	1.23	1.86	66	Metal Loss	TBit	SK	Non Inspection Side
2063	74	18.90	177.32	1.43	0.61	66	Metal Loss	TBit	SK	Inspection Side
2064	74	9.65	109.76	1.07	0.31	67	Metal Loss	TBit	SK	Inspection Side
2065	74	31.34	82.05	2.48	1.81	68	Metal Loss	TBit	SK	Non Inspection Side
2066	74	26.50	36.93	0.91	0.51	69	Metal Loss	TBit	SK	Inspection Side
2067	74	51.50	39.76	0.96	0.80	69	Metal Loss	TBit	SK	Inspection Side
2068	74	58.23	85.71	1.17	0.45	70	Metal Loss	TBit	SK	Inspection Side
2069	74	60.28	165.43	1.48	0.60	70	Metal Loss	TBit	SK	Non Inspection Side
2070	74	46.06	199.84	0.90	0.47	72	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2071	74	20.12	156.54	1.19	0.54	73	Metal Loss	TBit	SK	Inspection Side
2072	74	31.69	126.85	2.44	0.96	73	Metal Loss	TBit	SK	Non Inspection Side
2073	74	57.05	93.43	0.83	0.31	74	Metal Loss	TBit	SK	Inspection Side
2074	74	19.06	62.83	1.95	0.36	74	Metal Loss	TBit	SK	Inspection Side
2075	74	50.55	213.27	1.03	0.71	75	Metal Loss	TBit	SK	Inspection Side
2076	74	60.08	88.23	0.93	0.55	76	Metal Loss	TBit	SK	Inspection Side
2077	74	16.30	163.03	1.15	0.75	76	Metal Loss	TBit	SK	Inspection Side
2078	74	12.36	35.94	1.16	0.67	76	Metal Loss	TBit	SK	Inspection Side
2079	74	15.87	165.24	1.27	0.62	76	Metal Loss	TBit	SK	Non Inspection Side
2080	74	38.11	200.87	1.26	0.58	77	Metal Loss	TBit	SK	Inspection Side
2081	74	44.57	114.49	0.76	0.33	79	Metal Loss	TBit	SK	Inspection Side
2082	74	60.35	195.08	1.26	0.56	80	Metal Loss	TBit	SK	Inspection Side
2083	74	24.29	63.54	2.53	0.48	88	Metal Loss	TBit	SK	Inspection Side
2084	74	60.20	126.14	1.62	0.61	92	Metal Loss	TBit	SK	Non Inspection Side
2085	74	60.43	187.17	1.18	0.33	94	Metal Loss	TBit	SK	Inspection Side
2086	74	58.39	125.94	0.84	0.52	97	Metal Loss	TBit	SK	Inspection Side
2087	74	23.50	154.84	2.93	0.75	97	Metal Loss	TBit	SK	Inspection Side
2088	74	47.80	216.34	1.13	0.76	98	Metal Loss	TBit	SK	Inspection Side
2089	75	35.83	19.02	0.66	0.31	58	Metal Loss	TBit	SK	Inspection Side
2090	75	55.63	26.69	1.38	0.42	68	Metal Loss	TBit	SK / CA	Inspection Side
2091	75	61.26	10.87	0.64	0.96	72	Metal Loss	TBit	SK	Inspection Side
2092	76	18.31	32.52	0.55	0.30	49	Metal Loss	TBit	SK	Inspection Side
2093	76	18.46	78.62	0.57	0.50	49	Metal Loss	TBit	SK	Inspection Side
2094	76	53.15	145.35	1.01	0.90	49	Metal Loss	TBit	SK / CA	Inspection Side
2095	76	32.72	11.77	1.12	0.63	49	Metal Loss	TBit	SK	Inspection Side
2096	76	17.99	54.61	1.15	0.52	49	Metal Loss	TBit	SK	Inspection Side
2097	76	23.07	56.89	0.45	0.22	50	Metal Loss	TBit	SK	Inspection Side
2098	76	27.17	10.00	0.47	0.15	50	Metal Loss	TBit	SK	Inspection Side
2099	76	48.54	10.04	0.57	0.50	50	Metal Loss	TBit	SK	Inspection Side
2100	76	21.85	89.84	0.58	0.30	50	Metal Loss	TBit	SK	Inspection Side
2101	76	21.06	91.69	0.65	0.38	50	Metal Loss	TBit	SK	Inspection Side
2102	76	47.72	17.72	0.65	0.38	50	Metal Loss	TBit	SK	Inspection Side
2103	76	29.21	53.86	0.75	0.54	50	Metal Loss	TBit	SK	Inspection Side
2104	76	55.63	64.13	0.57	0.41	51	Metal Loss	TBit	SK	Inspection Side
2105	76	24.49	18.07	0.84	0.63	51	Metal Loss	TBit	SK	Inspection Side
2106	76	48.43	28.82	1.18	0.57	51	Metal Loss	TBit	SK	Inspection Side
2107	76	17.76	24.21	0.33	0.28	52	Metal Loss	TBit	SK	Inspection Side
2108	76	22.76	119.21	0.40	0.47	52	Metal Loss	TBit	SK	Inspection Side
2109	76	27.60	20.51	0.44	0.16	52	Metal Loss	TBit	SK	Inspection Side
2110	76	18.90	30.39	0.56	0.56	52	Metal Loss	TBit	SK	Inspection Side
2111	76	24.65	54.61	0.57	0.21	52	Metal Loss	TBit	SK	Inspection Side
2112	76	52.36	13.82	0.85	0.23	52	Metal Loss	TBit	SK	Inspection Side
2113	76	8.39	36.46	0.94	0.76	52	Metal Loss	TBit	SK	Inspection Side
2114	76	19.69	50.20	0.24	0.15	53	Metal Loss	TBit	SK	Inspection Side
2115	76	26.61	12.28	1.17	0.62	53	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2116	76	48.78	78.70	1.36	0.29	53	Metal Loss	TBit	SK	Non Inspection Side
2117	76	11.02	9.69	0.61	0.44	54	Metal Loss	TBit	SK	Inspection Side
2118	76	56.65	56.46	0.79	0.46	54	Metal Loss	TBit	SK	Inspection Side
2119	76	62.05	28.07	0.85	0.90	54	Metal Loss	TBit	SK	Inspection Side
2120	76	19.02	17.72	0.12	0.42	55	Metal Loss	TBit	SK	Inspection Side
2121	76	50.24	16.42	0.55	0.27	55	Metal Loss	TBit	SK	Inspection Side
2122	76	25.91	32.95	0.65	0.35	55	Metal Loss	TBit	SK	Inspection Side
2123	76	24.65	43.70	0.71	0.41	55	Metal Loss	TBit	SK	Inspection Side
2124	76	59.96	38.35	1.18	0.66	55	Metal Loss	TBit	SK	Inspection Side
2125	76	20.00	44.33	0.31	0.21	56	Metal Loss	TBit	SK	Inspection Side
2126	76	57.80	31.14	0.43	0.23	56	Metal Loss	TBit	SK	Inspection Side
2127	76	20.16	12.80	0.75	0.68	56	Metal Loss	TBit	SK	Inspection Side
2128	76	20.87	72.99	0.93	0.53	56	Metal Loss	TBit	SK	Inspection Side
2129	76	39.92	85.91	1.02	0.47	56	Metal Loss	TBit	SK	Inspection Side
2130	76	8.07	14.53	1.09	0.42	56	Metal Loss	TBit	SK	Inspection Side
2131	76	24.49	38.66	0.64	0.27	57	Metal Loss	TBit	SK	Inspection Side
2132	76	56.22	17.76	0.84	0.45	58	Metal Loss	TBit	SK	Inspection Side
2133	76	25.67	26.10	0.50	0.37	59	Metal Loss	TBit	SK	Inspection Side
2134	76	25.35	11.06	0.54	0.56	59	Metal Loss	TBit	SK	Inspection Side
2135	76	21.18	35.83	0.64	0.38	59	Metal Loss	TBit	SK	Inspection Side
2136	76	16.06	74.69	1.09	0.31	59	Metal Loss	TBit	SK	Inspection Side
2137	76	24.06	72.40	0.42	0.46	60	Metal Loss	TBit	SK	Inspection Side
2138	76	21.69	19.49	0.45	0.27	60	Metal Loss	TBit	SK	Inspection Side
2139	76	18.66	34.37	0.43	0.22	61	Metal Loss	TBit	SK	Inspection Side
2140	76	22.80	79.92	0.60	0.51	61	Metal Loss	TBit	SK	Inspection Side
2141	76	21.85	76.18	0.83	0.47	63	Metal Loss	TBit	SK	Inspection Side
2142	76	19.49	15.98	0.54	0.48	64	Metal Loss	TBit	SK	Inspection Side
2143	76	53.03	12.09	0.84	0.47	64	Metal Loss	TBit	SK	Inspection Side
2144	76	26.50	105.98	0.58	0.69	65	Metal Loss	TBit	SK	Non Inspection Side
2145	76	56.54	31.26	0.58	0.36	65	Metal Loss	TBit	SK	Inspection Side
2146	76	56.89	36.38	0.94	0.44	65	Metal Loss	TBit	SK	Inspection Side
2147	76	56.42	11.81	0.54	0.43	66	Metal Loss	TBit	SK	Inspection Side
2148	76	18.90	43.82	0.75	0.50	66	Metal Loss	TBit	SK	Inspection Side
2149	76	23.86	12.44	0.63	0.36	67	Metal Loss	TBit	SK	Inspection Side
2150	76	61.61	36.89	0.90	0.37	67	Metal Loss	TBit	SK	Inspection Side
2151	76	21.89	95.98	1.08	0.62	71	Metal Loss	TBit	SK	Inspection Side
2152	76	53.35	33.19	0.64	0.44	73	Metal Loss	TBit	SK	Inspection Side
2153	76	27.40	26.14	0.72	0.42	75	Metal Loss	TBit	SK	Inspection Side
2154	76	18.31	18.50	1.05	0.58	75	Metal Loss	TBit	SK	Inspection Side
2155	76	27.24	27.09	0.58	0.45	76	Metal Loss	TBit	SK	Inspection Side
2156	76	20.87	29.84	1.59	0.46	82	Metal Loss	TBit	SK	Inspection Side
2157	76	22.80	24.57	0.49	0.48	83	Metal Loss	TBit	SK	Inspection Side
2158	76	62.05	54.76	1.03	0.42	88	Metal Loss	TBit	SK	Inspection Side
2159	76	22.48	60.59	0.25	0.43	91	Metal Loss	TBit	SK	Inspection Side
2160	76	16.26	91.81	0.88	0.53	94	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2161	76	17.99	36.65	1.03	0.76	97	Metal Loss	TBit	SK	Inspection Side
2162	76	16.30	62.36	1.04	0.42	97	Metal Loss	TBit	SK	Inspection Side
2163	77	53.58	9.80	0.38	0.45	49	Metal Loss	TBit	SK	Non Inspection Side
2164	77	42.13	147.13	0.57	0.47	49	Metal Loss	TBit	SK	Inspection Side
2165	77	58.50	211.69	0.80	0.48	49	Metal Loss	TBit	SK	Inspection Side
2166	77	59.41	126.26	0.87	0.23	49	Metal Loss	TBit	SK	Inspection Side
2167	77	12.48	138.07	0.88	0.72	49	Metal Loss	TBit	SK	Inspection Side
2168	77	17.36	76.30	0.93	0.25	49	Metal Loss	TBit	SK	Inspection Side
2169	77	53.54	6.46	1.00	0.44	49	Metal Loss	TBit	SK	Inspection Side
2170	77	44.57	119.25	1.15	0.91	49	Metal Loss	TBit	SK	Inspection Side
2171	77	58.74	184.84	1.18	0.70	49	Metal Loss	TBit	SK	Inspection Side
2172	77	54.41	45.04	1.19	0.49	49	Metal Loss	TBit	SK	Inspection Side
2173	77	53.98	162.83	1.19	0.50	49	Metal Loss	TBit	SK	Inspection Side
2174	77	31.38	41.69	1.60	0.94	49	Metal Loss	TBit	SK	Non Inspection Side
2175	77	54.49	61.34	1.77	0.60	49	Metal Loss	TBit	SK	Inspection Side
2176	77	46.02	10.24	0.53	0.36	50	Metal Loss	TBit	SK	Inspection Side
2177	77	41.73	11.54	0.54	0.38	50	Metal Loss	TBit	SK	Inspection Side
2178	77	54.33	166.02	0.66	0.46	50	Metal Loss	TBit	SK	Inspection Side
2179	77	13.07	193.58	0.69	0.37	50	Metal Loss	TBit	SK	Inspection Side
2180	77	42.13	158.39	0.99	0.56	50	Metal Loss	TBit	SK	Inspection Side
2181	77	63.58	65.94	1.40	0.43	50	Metal Loss	TBit	SK	Inspection Side
2182	77	16.46	139.61	1.83	0.31	50	Metal Loss	TBit	SK	Inspection Side
2183	77	8.90	63.15	1.91	0.73	50	Metal Loss	TBit	SK	Inspection Side
2184	77	57.20	173.50	2.60	0.45	50	Metal Loss	TBit	SK	Inspection Side
2185	77	59.84	104.45	0.41	0.45	51	Metal Loss	TBit	SK	Inspection Side
2186	77	6.77	210.59	0.59	0.24	51	Metal Loss	TBit	SK	Inspection Side
2187	77	6.89	163.07	0.63	0.41	51	Metal Loss	TBit	SK	Inspection Side
2188	77	13.35	237.44	0.76	0.38	51	Metal Loss	TBit	SK	Inspection Side
2189	77	47.13	132.68	0.85	0.40	51	Metal Loss	TBit	SK	Inspection Side
2190	77	42.91	156.18	0.98	0.53	51	Metal Loss	TBit	SK	Inspection Side
2191	77	55.59	132.80	1.06	0.46	51	Metal Loss	TBit	SK	Inspection Side
2192	77	46.46	16.46	1.07	0.28	51	Metal Loss	TBit	SK	Inspection Side
2193	77	49.76	42.17	1.18	0.50	51	Metal Loss	TBit	SK	Inspection Side
2194	77	4.57	124.09	1.25	0.55	51	Metal Loss	TBit	SK	Inspection Side
2195	77	57.68	66.42	1.79	1.74	51	Metal Loss	TBit	SK	Non Inspection Side
2196	77	50.83	187.40	1.91	0.65	51	Metal Loss	TBit	SK	Inspection Side
2197	77	28.82	107.24	0.48	0.43	52	Metal Loss	TBit	SK	Inspection Side
2198	77	11.10	158.11	0.53	0.37	52	Metal Loss	TBit	SK	Inspection Side
2199	77	60.04	12.76	0.59	0.50	52	Metal Loss	TBit	SK	Inspection Side
2200	77	54.69	188.07	0.72	0.39	52	Metal Loss	TBit	SK	Inspection Side
2201	77	50.47	86.69	0.90	0.46	52	Metal Loss	TBit	SK	Inspection Side
2202	77	56.22	29.37	0.98	0.71	52	Metal Loss	TBit	SK	Inspection Side
2203	77	53.58	13.15	1.05	0.51	52	Metal Loss	TBit	SK	Inspection Side
2204	77	44.53	83.35	1.12	0.55	52	Metal Loss	TBit	SK	Inspection Side
2205	77	5.00	151.57	1.51	0.48	52	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2206	77	55.59	167.99	1.71	0.49	52	Metal Loss	TBit	SK	Inspection Side
2207	77	32.64	55.35	0.58	0.54	53	Metal Loss	TBit	SK	Inspection Side
2208	77	7.72	31.69	0.79	0.40	53	Metal Loss	TBit	SK	Inspection Side
2209	77	57.68	31.38	0.98	0.69	53	Metal Loss	TBit	SK	Inspection Side
2210	77	17.36	193.54	1.07	0.33	53	Metal Loss	TBit	SK	Inspection Side
2211	77	31.14	53.62	1.08	0.26	53	Metal Loss	TBit	SK	Inspection Side
2212	77	45.91	159.96	1.09	0.67	53	Metal Loss	TBit	SK	Inspection Side
2213	77	43.11	70.94	1.30	0.45	53	Metal Loss	TBit	SK	Inspection Side
2214	77	60.55	100.24	1.58	0.29	53	Metal Loss	TBit	SK	Inspection Side
2215	77	45.91	190.55	0.57	0.32	54	Metal Loss	TBit	SK	Inspection Side
2216	77	46.69	188.82	0.67	0.43	54	Metal Loss	TBit	SK	Inspection Side
2217	77	58.62	161.97	0.74	0.31	54	Metal Loss	TBit	SK	Inspection Side
2218	77	31.97	46.18	0.84	0.68	54	Metal Loss	TBit	SK	Non Inspection Side
2219	77	17.56	7.83	1.01	0.82	54	Metal Loss	TBit	SK	Inspection Side
2220	77	18.27	123.11	1.17	1.02	54	Metal Loss	TBit	SK	Inspection Side
2221	77	44.72	54.65	1.23	0.75	54	Metal Loss	TBit	SK	Inspection Side
2222	77	44.41	103.15	1.30	0.77	54	Metal Loss	TBit	SK	Non Inspection Side
2223	77	43.94	134.84	1.30	0.47	54	Metal Loss	TBit	SK	Inspection Side
2224	77	41.81	164.49	1.50	0.35	54	Metal Loss	TBit	SK	Inspection Side
2225	77	58.07	166.85	1.56	0.50	54	Metal Loss	TBit	SK	Inspection Side
2226	77	50.51	141.18	2.13	0.59	54	Metal Loss	TBit	SK	Inspection Side
2227	77	58.19	11.93	0.51	0.37	55	Metal Loss	TBit	SK	Inspection Side
2228	77	51.69	32.48	0.61	0.36	55	Metal Loss	TBit	SK	Inspection Side
2229	77	39.45	148.74	0.85	0.55	55	Metal Loss	TBit	SK	Inspection Side
2230	77	60.12	156.57	0.96	0.48	55	Metal Loss	TBit	SK	Inspection Side
2231	77	44.33	187.60	1.04	0.65	55	Metal Loss	TBit	SK	Inspection Side
2232	77	45.55	143.90	0.55	0.55	56	Metal Loss	TBit	SK	Inspection Side
2233	77	61.30	103.98	0.62	0.33	56	Metal Loss	TBit	SK	Inspection Side
2234	77	5.67	197.76	0.77	0.48	56	Metal Loss	TBit	SK	Inspection Side
2235	77	52.64	99.45	0.80	0.38	56	Metal Loss	TBit	SK	Inspection Side
2236	77	46.26	73.78	1.04	0.49	56	Metal Loss	TBit	SK	Inspection Side
2237	77	60.28	208.39	1.04	0.83	56	Metal Loss	TBit	SK	Inspection Side
2238	77	44.33	185.98	1.28	0.53	56	Metal Loss	TBit	SK	Non Inspection Side
2239	77	42.64	120.39	1.73	0.40	56	Metal Loss	TBit	SK	Inspection Side
2240	77	42.48	197.48	0.79	0.49	57	Metal Loss	TBit	SK	Inspection Side
2241	77	53.43	29.29	1.52	0.53	57	Metal Loss	TBit	SK	Inspection Side
2242	77	44.57	55.04	1.85	0.67	57	Metal Loss	TBit	SK	Inspection Side
2243	77	19.53	54.96	0.63	0.48	58	Metal Loss	TBit	SK	Inspection Side
2244	77	39.69	5.79	0.64	0.42	58	Metal Loss	TBit	SK	Inspection Side
2245	77	58.19	192.76	0.79	0.29	58	Metal Loss	TBit	SK	Non Inspection Side
2246	77	15.20	217.17	1.05	0.73	58	Metal Loss	TBit	SK	Inspection Side
2247	77	60.67	153.86	1.14	0.29	58	Metal Loss	TBit	SK	Inspection Side
2248	77	16.89	81.50	1.48	0.33	58	Metal Loss	TBit	SK	Inspection Side
2249	77	44.45	176.50	1.59	0.80	58	Metal Loss	TBit	SK	Non Inspection Side
2250	77	34.25	91.77	0.64	0.39	59	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2251	77	45.55	151.02	0.65	0.26	59	Metal Loss	TBit	SK	Inspection Side
2252	77	59.49	18.27	0.82	0.33	59	Metal Loss	TBit	SK	Inspection Side
2253	77	47.80	168.46	0.95	0.29	59	Metal Loss	TBit	SK	Inspection Side
2254	77	44.61	192.68	1.23	0.60	59	Metal Loss	TBit	SK	Inspection Side
2255	77	17.05	9.92	1.56	2.59	59	Metal Loss	TBit	SK	Non Inspection Side
2256	77	62.09	219.29	0.51	0.32	60	Metal Loss	TBit	SK	Inspection Side
2257	77	62.13	170.20	0.57	0.35	60	Metal Loss	TBit	SK	Inspection Side
2258	77	16.18	47.24	0.89	0.37	60	Metal Loss	TBit	SK	Inspection Side
2259	77	55.59	18.54	0.94	0.40	60	Metal Loss	TBit	SK	Inspection Side
2260	77	45.12	93.15	0.98	0.36	60	Metal Loss	TBit	SK	Inspection Side
2261	77	55.67	16.89	1.08	0.35	60	Metal Loss	TBit	SK	Inspection Side
2262	77	13.86	29.33	1.30	0.39	60	Metal Loss	TBit	SK	Inspection Side
2263	77	45.67	211.34	0.55	0.39	61	Metal Loss	TBit	SK	Inspection Side
2264	77	60.47	117.09	0.63	0.48	61	Metal Loss	TBit	SK	Inspection Side
2265	77	57.72	16.54	0.91	0.42	61	Metal Loss	TBit	SK	Non Inspection Side
2266	77	45.67	153.11	1.31	0.62	61	Metal Loss	TBit	SK	Inspection Side
2267	77	59.49	34.88	0.59	0.46	62	Metal Loss	TBit	SK	Inspection Side
2268	77	38.31	17.28	0.74	0.38	62	Metal Loss	TBit	SK	Inspection Side
2269	77	50.31	191.02	0.76	0.41	62	Metal Loss	TBit	SK	Inspection Side
2270	77	55.59	15.35	0.93	0.32	62	Metal Loss	TBit	SK	Inspection Side
2271	77	13.86	178.74	0.95	0.71	62	Metal Loss	TBit	SK	Inspection Side
2272	77	31.06	140.63	0.99	0.31	62	Metal Loss	TBit	SK	Inspection Side
2273	77	48.98	134.25	0.96	0.65	63	Metal Loss	TBit	SK	Inspection Side
2274	77	58.98	34.25	1.08	0.65	63	Metal Loss	TBit	SK	Inspection Side
2275	77	54.09	16.46	1.09	1.16	63	Metal Loss	TBit	SK	Non Inspection Side
2276	77	6.46	174.21	1.27	0.67	63	Metal Loss	TBit	SK	Inspection Side
2277	77	59.80	109.37	1.45	1.26	63	Metal Loss	TBit	SK	Non Inspection Side
2278	77	8.39	172.28	0.65	0.43	64	Metal Loss	TBit	SK	Inspection Side
2279	77	60.59	175.59	1.41	0.61	64	Metal Loss	TBit	SK	Non Inspection Side
2280	77	45.35	15.55	1.62	0.38	64	Metal Loss	TBit	SK	Inspection Side
2281	77	58.70	57.99	2.73	1.28	64	Metal Loss	TBit	SK	Non Inspection Side
2282	77	17.87	201.85	1.13	0.53	65	Metal Loss	TBit	SK	Inspection Side
2283	77	17.99	193.62	1.66	0.33	65	Metal Loss	TBit	SK	Inspection Side
2284	77	8.62	179.29	1.86	0.59	65	Metal Loss	TBit	SK	Inspection Side
2285	77	40.04	21.18	1.00	0.34	66	Metal Loss	TBit	SK	Inspection Side
2286	77	18.19	222.36	1.27	0.51	66	Metal Loss	TBit	SK	Inspection Side
2287	77	50.87	7.68	0.63	0.39	67	Metal Loss	TBit	SK	Inspection Side
2288	77	47.68	30.94	1.24	0.43	67	Metal Loss	TBit	SK	Inspection Side
2289	77	60.20	49.29	0.58	0.32	68	Metal Loss	TBit	SK	Inspection Side
2290	77	44.80	223.39	0.84	0.32	68	Metal Loss	TBit	SK	Inspection Side
2291	77	8.62	176.18	1.36	0.61	68	Metal Loss	TBit	SK	Inspection Side
2292	77	54.53	12.13	0.84	0.38	69	Metal Loss	TBit	SK	Inspection Side
2293	77	60.31	100.16	1.04	0.57	69	Metal Loss	TBit	SK	Inspection Side
2294	77	46.81	158.54	0.73	0.34	70	Metal Loss	TBit	SK	Inspection Side
2295	77	60.94	104.76	0.74	0.33	70	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2296	77	55.39	77.32	0.96	0.46	70	Metal Loss	TBit	SK	Inspection Side
2297	77	47.76	65.28	1.07	0.36	71	Metal Loss	TBit	SK	Inspection Side
2298	77	8.62	76.73	1.39	0.56	71	Metal Loss	TBit	SK	Inspection Side
2299	77	44.45	19.96	1.64	0.83	74	Metal Loss	TBit	SK	Inspection Side
2300	77	14.96	175.16	1.49	0.55	75	Metal Loss	TBit	SK	Inspection Side
2301	77	57.01	222.80	0.79	0.34	77	Metal Loss	TBit	SK	Inspection Side
2302	77	58.70	72.40	1.25	2.07	78	Metal Loss	TBit	SK	Non Inspection Side
2303	77	10.67	133.90	1.01	0.64	80	Metal Loss	TBit	SK	Inspection Side
2304	77	8.98	161.06	0.72	0.55	81	Metal Loss	TBit	SK	Inspection Side
2305	77	46.69	205.24	1.34	0.34	81	Metal Loss	TBit	SK	Inspection Side
2306	77	56.81	108.90	1.35	0.41	82	Metal Loss	TBit	SK	Inspection Side
2307	77	27.52	12.09	0.84	0.41	83	Metal Loss	TBit	SK	Inspection Side
2308	77	60.67	71.85	1.05	0.70	83	Metal Loss	TBit	SK	Inspection Side
2309	77	18.03	74.92	1.58	0.68	83	Metal Loss	TBit	SK	Inspection Side
2310	77	56.46	34.53	0.90	0.70	88	Metal Loss	TBit	SK	Inspection Side
2311	77	33.78	15.39	1.05	0.31	89	Metal Loss	TBit	SK	Inspection Side
2312	77	60.75	155.98	1.26	0.37	90	Metal Loss	TBit	SK	Inspection Side
2313	77	45.04	190.91	1.12	0.45	91	Metal Loss	TBit	SK	Inspection Side
2314	77	58.11	90.51	1.24	0.45	93	Metal Loss	TBit	SK	Inspection Side
2315	77	43.31	162.05	0.93	0.44	96	Metal Loss	TBit	SK	Inspection Side
2316	77	17.68	162.20	1.12	0.35	97	Metal Loss	TBit	SK	Inspection Side
2317	77	11.65	136.77	1.49	0.64	97	Metal Loss	TBit	SK	Inspection Side
2318	77	17.24	168.15	1.20	0.67	98	Metal Loss	TBit	SK	Inspection Side
2319	77	55.08	10.12	1.58	0.63	98	Metal Loss	TBit	SK	Inspection Side
2320	77	56.61	189.84	1.66	0.70	98	Metal Loss	TBit	SK	Inspection Side
2321	78	55.75	94.25	0.12	0.21	49	Metal Loss	TBit	SK	Inspection Side
2322	78	48.70	172.99	0.33	0.37	49	Metal Loss	TBit	SK	Inspection Side
2323	78	63.86	78.27	0.34	0.33	49	Metal Loss	TBit	SK	Inspection Side
2324	78	10.55	101.89	0.48	0.41	49	Metal Loss	TBit	SK	Inspection Side
2325	78	42.09	27.32	0.56	0.50	49	Metal Loss	TBit	SK	Inspection Side
2326	78	51.57	26.46	0.63	0.42	49	Metal Loss	TBit	SK	Inspection Side
2327	78	26.22	5.47	0.63	0.42	49	Metal Loss	TBit	SK	Inspection Side
2328	78	56.69	28.43	0.64	0.34	49	Metal Loss	TBit	SK	Inspection Side
2329	78	38.90	8.98	0.66	0.42	49	Metal Loss	TBit	SK	Inspection Side
2330	78	55.71	209.53	0.74	0.45	49	Metal Loss	TBit	SK	Inspection Side
2331	78	58.39	12.40	0.80	0.52	49	Metal Loss	TBit	SK	Inspection Side
2332	78	65.91	42.80	0.93	0.41	49	Metal Loss	TBit	SK	Inspection Side
2333	78	16.46	16.65	1.02	0.94	49	Metal Loss	TBit	SK	Inspection Side
2334	78	54.37	11.93	1.03	0.51	49	Metal Loss	TBit	SK	Inspection Side
2335	78	46.85	82.76	1.08	0.34	49	Metal Loss	TBit	SK	Inspection Side
2336	78	19.96	65.31	1.15	0.45	49	Metal Loss	TBit	SK	Inspection Side
2337	78	7.52	87.56	1.26	0.44	49	Metal Loss	TBit	SK	Inspection Side
2338	78	57.44	85.16	1.39	0.49	49	Metal Loss	TBit	SK	Inspection Side
2339	78	15.94	10.71	1.88	0.44	49	Metal Loss	TBit	SK	Inspection Side
2340	78	11.50	14.06	2.14	0.51	49	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2341	78	64.72	84.61	2.18	0.86	49	Metal Loss	TBit	SK	Inspection Side
2342	78	12.64	66.42	0.31	0.13	50	Metal Loss	TBit	SK	Inspection Side
2343	78	12.05	67.95	0.45	0.34	50	Metal Loss	TBit	SK	Inspection Side
2344	78	58.39	132.60	0.62	0.20	50	Metal Loss	TBit	SK	Inspection Side
2345	78	13.74	20.75	0.74	0.31	50	Metal Loss	TBit	SK	Inspection Side
2346	78	45.71	173.15	0.81	0.32	50	Metal Loss	TBit	SK	Inspection Side
2347	78	50.51	139.33	0.93	0.68	50	Metal Loss	TBit	SK	Inspection Side
2348	78	52.09	123.78	0.94	0.42	50	Metal Loss	TBit	SK	Inspection Side
2349	78	17.99	153.46	0.94	0.36	50	Metal Loss	TBit	SK	Inspection Side
2350	78	62.44	15.00	1.01	0.84	50	Metal Loss	TBit	SK	Inspection Side
2351	78	55.04	144.29	1.05	0.65	50	Metal Loss	TBit	SK	Inspection Side
2352	78	14.80	18.39	1.06	0.50	50	Metal Loss	TBit	SK	Inspection Side
2353	78	59.17	210.91	1.13	1.21	50	Metal Loss	TBit	SK	Non Inspection Side
2354	78	16.89	222.20	1.27	0.25	50	Metal Loss	TBit	SK	Inspection Side
2355	78	63.27	22.20	0.33	0.55	51	Metal Loss	TBit	SK	Inspection Side
2356	78	22.60	123.19	0.43	0.35	51	Metal Loss	TBit	SK	Inspection Side
2357	78	54.49	130.87	0.46	0.37	51	Metal Loss	TBit	SK	Inspection Side
2358	78	29.53	61.69	0.55	0.32	51	Metal Loss	TBit	SK	Inspection Side
2359	78	15.75	41.89	0.65	0.72	51	Metal Loss	TBit	SK	Inspection Side
2360	78	16.81	128.43	0.74	0.27	51	Metal Loss	TBit	SK	Inspection Side
2361	78	8.31	158.54	0.83	0.39	51	Metal Loss	TBit	SK	Inspection Side
2362	78	59.29	200.35	1.01	0.27	51	Metal Loss	TBit	SK	Inspection Side
2363	78	29.92	12.72	1.07	0.35	51	Metal Loss	TBit	SK	Inspection Side
2364	78	9.45	224.29	1.15	0.34	51	Metal Loss	TBit	SK	Inspection Side
2365	78	24.29	155.51	1.18	0.50	51	Metal Loss	TBit	SK	Inspection Side
2366	78	19.65	72.56	0.15	0.51	52	Metal Loss	TBit	SK	Inspection Side
2367	78	5.00	72.60	0.61	0.77	52	Metal Loss	TBit	SK	Inspection Side
2368	78	60.00	160.39	0.66	0.40	52	Metal Loss	TBit	SK	Inspection Side
2369	78	42.17	166.38	0.69	0.48	52	Metal Loss	TBit	SK	Inspection Side
2370	78	55.00	173.74	0.72	0.34	52	Metal Loss	TBit	SK	Inspection Side
2371	78	56.69	12.40	0.76	0.41	52	Metal Loss	TBit	SK	Inspection Side
2372	78	24.61	38.70	0.81	0.41	52	Metal Loss	TBit	SK	Inspection Side
2373	78	15.20	65.59	0.86	0.60	52	Metal Loss	TBit	SK	Inspection Side
2374	78	32.56	74.80	0.87	0.53	52	Metal Loss	TBit	SK	Inspection Side
2375	78	30.39	150.75	0.90	0.32	52	Metal Loss	TBit	SK	Inspection Side
2376	78	14.09	77.95	1.26	0.82	52	Metal Loss	TBit	SK	Inspection Side
2377	78	10.83	98.31	0.40	0.29	53	Metal Loss	TBit	SK	Inspection Side
2378	78	24.88	24.49	0.78	0.43	53	Metal Loss	TBit	SK	Inspection Side
2379	78	11.93	69.21	0.80	0.31	53	Metal Loss	TBit	SK	Inspection Side
2380	78	45.51	146.93	1.01	0.51	53	Metal Loss	TBit	SK	Inspection Side
2381	78	22.60	139.45	1.02	0.51	53	Metal Loss	TBit	SK	Inspection Side
2382	78	31.89	33.78	1.06	0.94	53	Metal Loss	TBit	SK	Inspection Side
2383	78	16.42	68.27	1.19	0.57	53	Metal Loss	TBit	SK	Inspection Side
2384	78	60.71	55.39	1.19	0.39	53	Metal Loss	TBit	SK	Inspection Side
2385	78	26.97	19.21	1.63	0.46	53	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2386	78	6.30	206.38	0.60	0.39	54	Metal Loss	TBit	SK	Inspection Side
2387	78	6.06	80.39	0.65	0.20	54	Metal Loss	TBit	SK	Inspection Side
2388	78	11.85	82.83	0.72	0.37	54	Metal Loss	TBit	SK	Inspection Side
2389	78	29.06	11.77	0.73	0.39	54	Metal Loss	TBit	SK	Inspection Side
2390	78	46.69	175.24	0.74	0.31	54	Metal Loss	TBit	SK	Inspection Side
2391	78	31.06	25.20	0.84	0.28	54	Metal Loss	TBit	SK	Inspection Side
2392	78	11.34	24.96	0.86	2.35	54	Metal Loss	TBit	SK	Inspection Side
2393	78	24.45	16.57	0.93	0.29	54	Metal Loss	TBit	SK	Inspection Side
2394	78	22.83	172.99	0.96	0.55	54	Metal Loss	TBit	SK	Inspection Side
2395	78	16.30	16.57	1.19	0.87	54	Metal Loss	TBit	SK	Inspection Side
2396	78	24.25	46.30	1.21	0.42	54	Metal Loss	TBit	SK	Inspection Side
2397	78	64.69	50.55	1.67	0.64	54	Metal Loss	TBit	SK	Inspection Side
2398	78	62.80	24.57	1.94	0.46	54	Metal Loss	TBit	SK	Inspection Side
2399	78	18.62	149.84	2.13	0.70	54	Metal Loss	TBit	SK	Inspection Side
2400	78	20.94	54.92	3.59	0.89	54	Metal Loss	TBit	SK	Inspection Side
2401	78	15.31	130.28	0.58	0.33	55	Metal Loss	TBit	SK	Inspection Side
2402	78	10.16	100.39	0.65	0.66	55	Metal Loss	TBit	SK	Inspection Side
2403	78	23.23	77.24	0.74	0.48	55	Metal Loss	TBit	SK	Inspection Side
2404	78	46.61	154.96	0.85	0.39	55	Metal Loss	TBit	SK	Inspection Side
2405	78	53.50	176.77	1.00	0.53	55	Metal Loss	TBit	SK	Inspection Side
2406	78	41.10	22.91	1.19	0.38	55	Metal Loss	TBit	SK	Inspection Side
2407	78	30.67	10.67	1.29	0.42	55	Metal Loss	TBit	SK	Inspection Side
2408	78	22.64	48.19	1.44	0.43	55	Metal Loss	TBit	SK	Inspection Side
2409	78	13.98	136.85	1.50	0.61	55	Metal Loss	TBit	SK	Inspection Side
2410	78	18.03	145.67	2.11	0.96	55	Metal Loss	TBit	SK	Inspection Side
2411	78	9.13	121.65	2.17	0.69	55	Metal Loss	TBit	SK	Inspection Side
2412	78	57.72	128.35	0.52	0.28	56	Metal Loss	TBit	SK	Inspection Side
2413	78	56.02	232.09	0.53	0.45	56	Metal Loss	TBit	SK	Inspection Side
2414	78	40.35	155.28	0.64	0.47	56	Metal Loss	TBit	SK	Inspection Side
2415	78	46.34	25.20	0.65	0.24	56	Metal Loss	TBit	SK	Inspection Side
2416	78	17.80	75.12	0.68	0.49	56	Metal Loss	TBit	SK	Inspection Side
2417	78	10.04	212.60	0.78	0.44	56	Metal Loss	TBit	SK	Inspection Side
2418	78	60.39	175.79	0.89	0.39	56	Metal Loss	TBit	SK	Inspection Side
2419	78	19.02	201.10	0.89	0.33	56	Metal Loss	TBit	SK	Inspection Side
2420	78	45.04	150.98	0.99	0.88	56	Metal Loss	TBit	SK	Inspection Side
2421	78	17.68	148.54	1.08	0.36	56	Metal Loss	TBit	SK	Inspection Side
2422	78	18.23	97.95	1.10	0.76	56	Metal Loss	TBit	SK	Inspection Side
2423	78	63.86	58.78	1.13	0.41	56	Metal Loss	TBit	SK	Inspection Side
2424	78	31.81	151.14	1.22	0.40	56	Metal Loss	TBit	SK	Inspection Side
2425	78	46.42	168.03	0.69	0.39	57	Metal Loss	TBit	SK	Inspection Side
2426	78	7.44	99.33	0.90	0.43	57	Metal Loss	TBit	SK	Inspection Side
2427	78	14.06	18.98	0.95	0.48	57	Metal Loss	TBit	SK	Inspection Side
2428	78	52.20	57.87	1.05	0.33	57	Metal Loss	TBit	SK	Inspection Side
2429	78	21.42	120.16	1.38	0.38	57	Metal Loss	TBit	SK	Inspection Side
2430	78	8.54	78.90	1.49	0.34	57	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2431	78	12.44	93.07	2.55	0.55	57	Metal Loss	TBit	SK	Inspection Side
2432	78	22.99	45.55	0.61	0.35	58	Metal Loss	TBit	SK	Inspection Side
2433	78	59.69	233.19	0.66	0.25	58	Metal Loss	TBit	SK	Inspection Side
2434	78	10.04	99.84	0.70	0.32	58	Metal Loss	TBit	SK	Inspection Side
2435	78	17.68	35.63	0.83	0.68	58	Metal Loss	TBit	SK	Inspection Side
2436	78	55.83	211.42	0.98	0.49	58	Metal Loss	TBit	SK	Inspection Side
2437	78	53.39	39.69	1.02	0.78	58	Metal Loss	TBit	SK	Inspection Side
2438	78	31.93	71.34	1.14	0.68	58	Metal Loss	TBit	SK	Inspection Side
2439	78	31.81	115.59	1.21	0.22	58	Metal Loss	TBit	SK	Inspection Side
2440	78	61.46	59.92	1.36	0.42	58	Metal Loss	TBit	SK	Inspection Side
2441	78	14.29	84.61	0.36	0.37	59	Metal Loss	TBit	SK	Inspection Side
2442	78	23.94	29.21	0.53	0.32	59	Metal Loss	TBit	SK	Inspection Side
2443	78	60.59	182.13	0.55	0.41	59	Metal Loss	TBit	SK	Inspection Side
2444	78	42.60	15.71	0.81	0.48	59	Metal Loss	TBit	SK	Inspection Side
2445	78	54.21	125.83	0.89	0.45	59	Metal Loss	TBit	SK	Inspection Side
2446	78	28.78	16.97	0.98	0.56	59	Metal Loss	TBit	SK	Inspection Side
2447	78	50.24	81.30	0.98	0.41	59	Metal Loss	TBit	SK	Inspection Side
2448	78	11.54	98.03	1.34	0.50	59	Metal Loss	TBit	SK	Inspection Side
2449	78	63.39	52.05	1.54	0.67	59	Metal Loss	TBit	SK	Inspection Side
2450	78	17.80	114.61	2.14	0.70	59	Metal Loss	TBit	SK	Inspection Side
2451	78	23.90	50.28	0.56	0.46	60	Metal Loss	TBit	SK	Inspection Side
2452	78	64.41	45.20	0.88	0.50	60	Metal Loss	TBit	SK	Inspection Side
2453	78	20.08	222.87	0.90	0.41	60	Metal Loss	TBit	SK	Inspection Side
2454	78	16.61	215.31	0.96	0.31	60	Metal Loss	TBit	SK	Inspection Side
2455	78	18.19	93.90	1.09	0.35	60	Metal Loss	TBit	SK	Inspection Side
2456	78	25.12	40.79	1.11	0.34	60	Metal Loss	TBit	SK	Inspection Side
2457	78	8.27	99.84	0.50	0.32	61	Metal Loss	TBit	SK	Inspection Side
2458	78	44.61	198.19	1.02	0.28	61	Metal Loss	TBit	SK	Inspection Side
2459	78	45.31	142.44	1.05	0.51	61	Metal Loss	TBit	SK	Inspection Side
2460	78	20.94	39.02	1.10	0.66	61	Metal Loss	TBit	SK	Inspection Side
2461	78	10.35	182.48	1.15	0.49	61	Metal Loss	TBit	SK	Inspection Side
2462	78	44.09	156.89	1.27	0.66	61	Metal Loss	TBit	SK	Inspection Side
2463	78	9.88	67.52	0.68	0.39	62	Metal Loss	TBit	SK	Inspection Side
2464	78	32.09	41.57	0.70	0.32	62	Metal Loss	TBit	SK	Inspection Side
2465	78	15.08	18.54	0.73	0.53	62	Metal Loss	TBit	SK	Inspection Side
2466	78	27.52	52.13	0.99	0.49	62	Metal Loss	TBit	SK	Inspection Side
2467	78	17.13	179.92	1.00	0.34	62	Metal Loss	TBit	SK	Inspection Side
2468	78	45.51	158.11	1.04	0.50	62	Metal Loss	TBit	SK	Inspection Side
2469	78	53.86	66.46	0.75	0.34	63	Metal Loss	TBit	SK	Inspection Side
2470	78	55.67	187.28	0.87	0.49	63	Metal Loss	TBit	SK	Inspection Side
2471	78	21.30	192.56	1.01	0.52	63	Metal Loss	TBit	SK	Inspection Side
2472	78	46.10	232.72	1.01	0.39	63	Metal Loss	TBit	SK	Inspection Side
2473	78	31.22	121.38	1.11	0.28	63	Metal Loss	TBit	SK	Inspection Side
2474	78	20.91	137.60	0.66	0.33	64	Metal Loss	TBit	SK	Inspection Side
2475	78	23.70	50.55	0.77	0.62	64	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2476	78	31.85	27.32	1.11	0.33	64	Metal Loss	TBit	SK	Inspection Side
2477	78	17.36	133.70	0.93	0.69	65	Metal Loss	TBit	SK	Inspection Side
2478	78	31.65	22.17	1.05	0.78	65	Metal Loss	TBit	SK	Inspection Side
2479	78	17.05	77.56	1.15	0.32	65	Metal Loss	TBit	SK	Inspection Side
2480	78	44.72	203.27	0.92	0.41	66	Metal Loss	TBit	SK	Inspection Side
2481	78	14.41	72.83	1.07	0.39	66	Metal Loss	TBit	SK	Inspection Side
2482	78	46.30	159.96	1.62	0.62	66	Metal Loss	TBit	SK	Inspection Side
2483	78	18.03	131.46	0.71	0.50	67	Metal Loss	TBit	SK	Inspection Side
2484	78	22.40	134.61	0.85	0.39	67	Metal Loss	TBit	SK	Inspection Side
2485	78	55.98	155.91	0.91	0.49	67	Metal Loss	TBit	SK	Inspection Side
2486	78	7.40	74.29	0.97	0.29	67	Metal Loss	TBit	SK	Inspection Side
2487	78	59.09	199.21	1.01	0.54	67	Metal Loss	TBit	SK	Inspection Side
2488	78	18.74	24.84	1.11	0.44	67	Metal Loss	TBit	SK	Inspection Side
2489	78	23.94	21.30	0.74	0.39	68	Metal Loss	TBit	SK	Inspection Side
2490	78	16.26	133.98	0.88	0.54	68	Metal Loss	TBit	SK	Inspection Side
2491	78	16.22	148.90	1.11	0.90	68	Metal Loss	TBit	SK	Inspection Side
2492	78	56.38	129.02	0.51	0.30	69	Metal Loss	TBit	SK	Inspection Side
2493	78	24.57	39.17	0.77	0.42	69	Metal Loss	TBit	SK	Inspection Side
2494	78	44.06	225.55	1.22	0.50	69	Metal Loss	TBit	SK	Inspection Side
2495	78	61.93	30.67	2.00	0.68	69	Metal Loss	TBit	SK	Inspection Side
2496	78	13.31	75.83	0.67	0.33	70	Metal Loss	TBit	SK	Inspection Side
2497	78	29.17	21.42	0.72	0.44	70	Metal Loss	TBit	SK	Inspection Side
2498	78	12.83	79.29	0.73	0.46	70	Metal Loss	TBit	SK	Inspection Side
2499	78	42.40	28.66	0.74	0.44	70	Metal Loss	TBit	SK	Inspection Side
2500	78	15.71	228.03	1.22	1.32	70	Metal Loss	TBit	SK	Inspection Side
2501	78	39.41	13.11	1.97	0.62	70	Metal Loss	TBit	SK	Inspection Side
2502	78	51.42	56.10	1.11	0.42	71	Metal Loss	TBit	SK	Inspection Side
2503	78	18.07	118.58	1.63	0.31	71	Metal Loss	TBit	SK	Inspection Side
2504	78	56.73	158.70	0.87	0.37	72	Metal Loss	TBit	SK	Inspection Side
2505	78	59.61	150.55	1.22	0.31	72	Metal Loss	TBit	SK	Inspection Side
2506	78	66.18	74.41	0.49	0.32	73	Metal Loss	TBit	SK	Inspection Side
2507	78	19.61	211.18	0.98	0.46	73	Metal Loss	TBit	SK	Inspection Side
2508	78	17.13	212.01	0.90	0.52	74	Metal Loss	TBit	SK	Inspection Side
2509	78	62.52	34.76	1.02	0.72	74	Metal Loss	TBit	SK	Inspection Side
2510	78	63.19	9.49	1.77	0.74	74	Metal Loss	TBit	SK	Inspection Side
2511	78	62.52	45.12	1.88	0.64	74	Metal Loss	TBit	SK	Inspection Side
2512	78	13.43	77.32	0.74	0.39	75	Metal Loss	TBit	SK	Inspection Side
2513	78	8.90	57.17	1.28	0.74	75	Metal Loss	TBit	SK	Inspection Side
2514	78	8.82	97.28	0.67	0.47	77	Metal Loss	TBit	SK	Inspection Side
2515	78	11.22	134.49	0.94	0.54	77	Metal Loss	TBit	SK	Inspection Side
2516	78	30.04	32.60	0.95	0.49	77	Metal Loss	TBit	SK	Inspection Side
2517	78	26.46	16.18	1.01	0.51	78	Metal Loss	TBit	SK	Inspection Side
2518	78	45.39	153.31	1.08	0.35	79	Metal Loss	TBit	SK	Inspection Side
2519	78	58.54	155.24	1.26	0.61	79	Metal Loss	TBit	SK	Inspection Side
2520	78	58.54	193.11	1.38	0.71	79	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2521	78	20.31	172.76	0.81	0.42	80	Metal Loss	TBit	SK	Inspection Side
2522	78	18.62	126.18	0.93	0.33	80	Metal Loss	TBit	SK	Inspection Side
2523	78	44.09	153.11	1.31	0.41	80	Metal Loss	TBit	SK	Inspection Side
2524	78	9.92	85.91	0.69	0.32	81	Metal Loss	TBit	SK	Inspection Side
2525	78	60.51	220.98	1.27	0.47	81	Metal Loss	TBit	SK	Inspection Side
2526	78	4.41	84.06	1.64	0.43	81	Metal Loss	TBit	SK	Inspection Side
2527	78	56.73	175.28	0.92	0.44	83	Metal Loss	TBit	SK	Inspection Side
2528	78	18.11	145.08	1.53	0.62	84	Metal Loss	TBit	SK	Inspection Side
2529	78	31.26	17.91	1.01	0.48	87	Metal Loss	TBit	SK	Inspection Side
2530	78	17.28	117.32	1.27	0.43	87	Metal Loss	TBit	SK	Inspection Side
2531	78	44.80	136.54	0.95	0.33	89	Metal Loss	TBit	SK	Inspection Side
2532	79	65.47	227.80	0.39	0.39	49	Metal Loss	TBit	SK	Inspection Side
2533	79	10.79	147.99	0.72	0.37	49	Metal Loss	TBit	SK	Inspection Side
2534	79	40.87	225.83	0.83	0.35	49	Metal Loss	TBit	SK	Inspection Side
2535	79	3.39	121.61	0.88	0.30	49	Metal Loss	TBit	SK	Inspection Side
2536	79	62.48	154.96	0.99	1.26	49	Metal Loss	TBit	SK	Inspection Side
2537	79	33.39	239.25	1.06	0.47	49	Metal Loss	TBit	SK	Inspection Side
2538	79	60.20	102.44	1.48	0.30	49	Metal Loss	TBit	SK	Inspection Side
2539	79	57.40	223.27	0.46	0.37	50	Metal Loss	TBit	SK	Inspection Side
2540	79	44.41	72.60	0.68	0.30	50	Metal Loss	TBit	SK	Inspection Side
2541	79	39.09	196.30	0.84	0.40	50	Metal Loss	TBit	SK	Inspection Side
2542	79	64.41	86.10	0.93	0.18	50	Metal Loss	TBit	SK	Inspection Side
2543	79	37.60	103.31	1.01	0.49	50	Metal Loss	TBit	SK	Inspection Side
2544	79	6.26	184.06	1.12	1.24	50	Metal Loss	TBit	SK	Inspection Side
2545	79	45.87	228.11	1.20	0.44	50	Metal Loss	TBit	SK	Inspection Side
2546	79	62.52	213.54	0.92	0.54	52	Metal Loss	TBit	SK	Inspection Side
2547	79	32.99	99.49	0.99	0.75	52	Metal Loss	TBit	SK	Inspection Side
2548	79	63.07	107.48	1.53	0.66	52	Metal Loss	TBit	SK	Inspection Side
2549	79	45.08	214.84	0.74	0.42	53	Metal Loss	TBit	SK	Inspection Side
2550	79	47.28	186.77	0.86	0.37	53	Metal Loss	TBit	SK	Inspection Side
2551	79	22.01	97.28	0.97	0.28	53	Metal Loss	TBit	SK	Inspection Side
2552	79	18.23	197.28	1.05	0.23	53	Metal Loss	TBit	SK	Inspection Side
2553	79	30.79	104.37	1.15	0.65	53	Metal Loss	TBit	SK	Inspection Side
2554	79	65.71	138.62	0.89	0.49	54	Metal Loss	TBit	SK	Inspection Side
2555	79	57.40	235.24	1.45	0.64	54	Metal Loss	TBit	SK	Inspection Side
2556	79	3.31	184.25	2.57	0.29	54	Metal Loss	TBit	SK	Inspection Side
2557	79	7.17	117.68	0.93	0.39	55	Metal Loss	TBit	SK	Inspection Side
2558	79	43.98	86.85	1.16	0.69	55	Metal Loss	TBit	SK	Inspection Side
2559	79	59.17	35.83	1.34	0.40	55	Metal Loss	TBit	SK	Inspection Side
2560	79	56.61	40.94	1.04	0.57	56	Metal Loss	TBit	SK	Inspection Side
2561	79	6.26	132.52	1.52	0.45	56	Metal Loss	TBit	SK	Inspection Side
2562	79	45.08	127.52	1.63	0.47	56	Metal Loss	TBit	SK	Inspection Side
2563	79	18.54	97.20	0.58	0.31	57	Metal Loss	TBit	SK	Inspection Side
2564	79	35.75	139.45	0.73	0.30	57	Metal Loss	TBit	SK	Inspection Side
2565	79	9.57	186.93	1.12	0.96	57	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2566	79	61.89	226.38	0.74	0.63	58	Metal Loss	TBit	SK	Inspection Side
2567	79	15.55	96.18	0.99	0.72	58	Metal Loss	TBit	SK	Inspection Side
2568	79	18.11	208.15	1.04	0.93	58	Metal Loss	TBit	SK	Inspection Side
2569	79	40.28	97.99	1.14	0.43	58	Metal Loss	TBit	SK	Inspection Side
2570	79	62.48	82.68	1.25	0.39	58	Metal Loss	TBit	SK	Inspection Side
2571	79	57.48	194.17	1.30	0.32	58	Metal Loss	TBit	SK	Inspection Side
2572	79	20.43	96.69	1.74	0.28	58	Metal Loss	TBit	SK	Inspection Side
2573	79	17.95	217.13	1.62	0.91	59	Metal Loss	TBit	SK	Inspection Side
2574	79	54.69	61.89	1.85	0.33	59	Metal Loss	TBit	SK	Inspection Side
2575	79	64.49	82.80	0.78	0.47	60	Metal Loss	TBit	SK	Inspection Side
2576	79	10.20	172.44	0.82	0.44	60	Metal Loss	TBit	SK	Inspection Side
2577	79	46.65	24.69	0.97	0.34	61	Metal Loss	TBit	SK	Inspection Side
2578	79	7.01	151.61	1.01	0.55	61	Metal Loss	TBit	SK	Inspection Side
2579	79	60.12	222.72	0.67	0.44	62	Metal Loss	TBit	SK	Inspection Side
2580	79	3.66	211.54	1.25	0.95	62	Metal Loss	TBit	SK	Inspection Side
2581	79	57.87	99.17	1.03	0.52	63	Metal Loss	TBit	SK	Inspection Side
2582	79	60.20	208.54	1.65	1.00	63	Metal Loss	TBit	SK	Inspection Side
2583	79	64.17	158.50	1.91	0.63	63	Metal Loss	TBit	SK	Inspection Side
2584	79	9.57	154.17	0.92	0.28	64	Metal Loss	TBit	SK	Inspection Side
2585	79	44.29	91.10	1.14	0.52	64	Metal Loss	TBit	SK	Inspection Side
2586	79	66.69	165.47	1.38	0.71	65	Metal Loss	TBit	SK	Inspection Side
2587	79	5.94	220.59	1.39	0.53	65	Metal Loss	TBit	SK	Inspection Side
2588	79	64.65	219.65	0.84	0.51	66	Metal Loss	TBit	SK	Inspection Side
2589	79	11.69	167.13	0.86	0.32	66	Metal Loss	TBit	SK	Inspection Side
2590	79	6.18	164.76	0.92	0.38	66	Metal Loss	TBit	SK	Inspection Side
2591	79	7.32	182.72	1.13	1.05	66	Metal Loss	TBit	SK	Inspection Side
2592	79	64.69	174.45	1.38	0.78	66	Metal Loss	TBit	SK	Inspection Side
2593	79	60.67	157.76	1.13	0.39	74	Metal Loss	TBit	SK	Inspection Side
2594	79	41.97	88.19	1.17	0.56	75	Metal Loss	TBit	SK	Inspection Side
2595	79	60.91	192.32	1.43	0.49	77	Metal Loss	TBit	SK	Inspection Side
2596	79	9.02	171.10	0.96	0.48	78	Metal Loss	TBit	SK	Inspection Side
2597	79	9.88	164.53	1.54	0.35	82	Metal Loss	TBit	SK	Inspection Side
2598	79	5.91	194.72	0.96	0.42	83	Metal Loss	TBit	SK	Inspection Side
2599	79	64.76	179.84	1.38	0.88	85	Metal Loss	TBit	SK	Inspection Side
2600	79	61.26	166.65	1.24	0.31	97	Metal Loss	TBit	SK	Inspection Side
2601	79	4.33	100.55	1.93	0.47	98	Metal Loss	TBit	SK	Inspection Side
2602	80	44.65	76.42	0.93	0.42	49	Metal Loss	TBit	SK	Inspection Side
2603	80	61.81	76.10	1.08	0.74	49	Metal Loss	TBit	SK	Non Inspection Side
2604	80	41.14	120.12	1.15	0.80	49	Metal Loss	TBit	SK	Inspection Side
2605	80	64.06	179.84	1.19	0.49	49	Metal Loss	TBit	SK	Inspection Side
2606	80	60.83	82.52	1.22	0.74	49	Metal Loss	TBit	SK	Inspection Side
2607	80	44.25	103.90	1.25	0.82	49	Metal Loss	TBit	SK	Inspection Side
2608	80	42.83	168.78	1.91	0.48	49	Metal Loss	TBit	SK	Inspection Side
2609	80	39.29	201.22	0.59	0.40	50	Metal Loss	TBit	SK	Inspection Side
2610	80	45.63	180.98	0.87	0.16	50	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2611	80	15.20	32.36	1.30	0.30	50	Metal Loss	TBit	SK	Inspection Side
2612	80	5.98	203.98	1.31	0.83	50	Metal Loss	TBit	SK	Inspection Side
2613	80	10.75	183.23	1.33	0.68	50	Metal Loss	TBit	SK	Inspection Side
2614	80	50.35	122.83	0.47	0.34	51	Metal Loss	TBit	SK	Inspection Side
2615	80	45.08	97.91	0.71	0.30	51	Metal Loss	TBit	SK	Inspection Side
2616	80	17.91	178.62	0.91	0.20	51	Metal Loss	TBit	SK	Inspection Side
2617	80	57.64	68.43	1.04	0.44	51	Metal Loss	TBit	SK	Inspection Side
2618	80	7.24	190.98	1.26	0.67	51	Metal Loss	TBit	SK	Inspection Side
2619	80	10.98	159.02	2.10	0.90	51	Metal Loss	TBit	SK	Inspection Side
2620	80	4.69	132.95	1.06	0.38	52	Metal Loss	TBit	SK	Inspection Side
2621	80	60.94	197.64	1.12	0.70	52	Metal Loss	TBit	SK	Inspection Side
2622	80	48.86	124.13	0.97	0.47	53	Metal Loss	TBit	SK	Inspection Side
2623	80	58.94	31.93	1.07	0.25	53	Metal Loss	TBit	SK	Inspection Side
2624	80	43.46	220.00	1.52	0.46	53	Metal Loss	TBit	SK	Inspection Side
2625	80	12.56	194.37	0.47	0.38	54	Metal Loss	TBit	SK	Inspection Side
2626	80	38.62	144.21	0.66	0.40	54	Metal Loss	TBit	SK	Inspection Side
2627	80	50.24	216.97	0.77	0.47	54	Metal Loss	TBit	SK	Inspection Side
2628	80	44.84	194.92	0.80	0.29	54	Metal Loss	TBit	SK	Inspection Side
2629	80	63.78	28.27	1.10	0.32	54	Metal Loss	TBit	SK	Inspection Side
2630	80	16.85	27.87	1.47	1.01	54	Metal Loss	TBit	SK	Inspection Side
2631	80	15.16	135.98	1.92	0.26	54	Metal Loss	TBit	SK	Inspection Side
2632	80	9.65	219.02	0.56	0.39	55	Metal Loss	TBit	SK	Inspection Side
2633	80	9.37	223.35	0.65	0.40	55	Metal Loss	TBit	SK	Inspection Side
2634	80	10.55	69.49	0.81	0.31	55	Metal Loss	TBit	SK	Inspection Side
2635	80	40.47	16.10	1.09	0.46	55	Metal Loss	TBit	SK	Inspection Side
2636	80	15.87	132.48	1.89	0.24	55	Metal Loss	TBit	SK	Inspection Side
2637	80	42.17	124.41	0.76	0.41	56	Metal Loss	TBit	SK	Inspection Side
2638	80	11.46	133.39	1.02	0.20	56	Metal Loss	TBit	SK	Inspection Side
2639	80	65.71	17.28	1.03	0.28	56	Metal Loss	TBit	SK	Inspection Side
2640	80	16.06	217.40	1.71	0.66	56	Metal Loss	TBit	SK	Inspection Side
2641	80	65.39	82.80	1.33	0.39	57	Metal Loss	TBit	SK	Inspection Side
2642	80	39.76	146.73	0.88	0.40	58	Metal Loss	TBit	SK	Inspection Side
2643	80	63.90	19.09	1.07	0.26	58	Metal Loss	TBit	SK	Inspection Side
2644	80	10.87	36.10	1.37	0.50	58	Metal Loss	TBit	SK	Inspection Side
2645	80	55.91	22.68	2.03	0.26	58	Metal Loss	TBit	SK	Inspection Side
2646	80	10.79	32.09	0.64	0.56	59	Metal Loss	TBit	SK	Inspection Side
2647	80	55.94	179.09	0.80	0.33	59	Metal Loss	TBit	SK	Inspection Side
2648	80	61.77	165.35	0.83	0.33	59	Metal Loss	TBit	SK	Inspection Side
2649	80	46.42	142.36	0.97	0.24	59	Metal Loss	TBit	SK	Inspection Side
2650	80	6.97	107.32	1.90	0.50	59	Metal Loss	TBit	SK	Inspection Side
2651	80	13.15	135.87	1.54	0.41	60	Metal Loss	TBit	SK	Inspection Side
2652	80	11.57	73.31	2.84	0.75	60	Metal Loss	TBit	SK	Inspection Side
2653	80	31.85	162.91	1.09	0.35	61	Metal Loss	TBit	SK	Inspection Side
2654	80	31.26	188.86	1.09	0.31	61	Metal Loss	TBit	SK	Inspection Side
2655	80	12.72	12.48	1.20	1.16	61	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2656	80	39.29	59.21	2.15	0.65	61	Metal Loss	TBit	SK	Inspection Side
2657	80	10.79	146.14	2.17	0.30	61	Metal Loss	TBit	SK	Inspection Side
2658	80	58.90	116.30	0.79	0.42	62	Metal Loss	TBit	SK	Inspection Side
2659	80	45.67	176.69	0.89	0.33	62	Metal Loss	TBit	SK	Inspection Side
2660	80	46.42	179.21	1.08	0.40	62	Metal Loss	TBit	SK	Inspection Side
2661	80	64.61	13.94	1.08	0.32	62	Metal Loss	TBit	SK	Inspection Side
2662	80	13.07	50.98	0.89	0.31	63	Metal Loss	TBit	SK	Inspection Side
2663	80	6.77	132.83	1.02	0.41	63	Metal Loss	TBit	SK	Inspection Side
2664	80	10.28	36.38	0.92	0.52	64	Metal Loss	TBit	SK	Inspection Side
2665	80	14.57	36.18	1.00	0.44	64	Metal Loss	TBit	SK	Inspection Side
2666	80	5.28	153.23	1.01	0.32	64	Metal Loss	TBit	SK	Inspection Side
2667	80	31.97	68.70	1.03	0.80	64	Metal Loss	TBit	SK	Inspection Side
2668	80	62.87	40.00	1.33	0.29	64	Metal Loss	TBit	SK	Inspection Side
2669	80	10.00	65.71	0.95	0.26	65	Metal Loss	TBit	SK	Inspection Side
2670	80	60.75	89.13	2.47	0.37	65	Metal Loss	TBit	SK	Inspection Side
2671	80	60.43	65.47	0.88	0.52	66	Metal Loss	TBit	SK	Non Inspection Side
2672	80	10.28	31.54	0.83	0.31	67	Metal Loss	TBit	SK	Inspection Side
2673	80	18.35	159.13	0.85	0.57	67	Metal Loss	TBit	SK	Inspection Side
2674	80	12.01	21.42	0.86	0.33	67	Metal Loss	TBit	SK	Inspection Side
2675	80	47.05	84.41	1.52	0.45	67	Metal Loss	TBit	SK	Inspection Side
2676	80	63.54	20.63	0.96	0.39	69	Metal Loss	TBit	SK	Non Inspection Side
2677	80	45.20	44.92	1.02	0.47	70	Metal Loss	TBit	SK	Inspection Side
2678	80	6.77	138.98	1.11	0.39	70	Metal Loss	TBit	SK	Inspection Side
2679	80	9.09	144.53	1.26	0.24	70	Metal Loss	TBit	SK	Inspection Side
2680	80	11.10	67.80	0.79	0.22	71	Metal Loss	TBit	SK	Inspection Side
2681	80	46.34	184.53	1.03	0.43	71	Metal Loss	TBit	SK	Inspection Side
2682	80	35.35	57.40	0.70	0.45	72	Metal Loss	TBit	SK	Inspection Side
2683	80	11.50	151.02	0.83	0.48	72	Metal Loss	TBit	SK	Inspection Side
2684	80	32.05	70.59	0.92	0.35	72	Metal Loss	TBit	SK	Inspection Side
2685	80	60.51	28.54	1.11	0.35	72	Metal Loss	TBit	SK	Inspection Side
2686	80	6.10	94.45	1.22	0.52	72	Metal Loss	TBit	SK	Inspection Side
2687	80	45.83	223.15	0.95	0.53	74	Metal Loss	TBit	SK	Inspection Side
2688	80	63.58	136.81	0.69	0.31	77	Metal Loss	TBit	SK	Inspection Side
2689	80	15.98	27.91	0.94	0.64	77	Metal Loss	TBit	SK	Inspection Side
2690	80	13.03	90.28	1.67	0.27	77	Metal Loss	TBit	SK	Inspection Side
2691	80	11.18	9.72	1.13	0.37	79	Metal Loss	TBit	SK	Inspection Side
2692	80	45.55	195.08	0.95	0.37	81	Metal Loss	TBit	SK	Inspection Side
2693	80	4.37	54.49	1.05	0.57	81	Metal Loss	TBit	SK	Inspection Side
2694	80	46.85	116.46	0.91	0.31	82	Metal Loss	TBit	SK	Inspection Side
2695	80	13.03	63.39	1.55	0.93	82	Metal Loss	TBit	SK	Inspection Side
2696	80	8.78	28.23	1.07	0.51	83	Metal Loss	TBit	SK	Inspection Side
2697	80	64.21	37.56	1.31	0.78	83	Metal Loss	TBit	SK	Inspection Side
2698	80	17.87	195.24	1.94	0.55	83	Metal Loss	TBit	SK	Inspection Side
2699	80	32.48	150.71	1.01	0.41	85	Metal Loss	TBit	SK	Inspection Side
2700	80	46.22	191.65	1.03	0.50	85	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2701	80	47.17	180.87	1.18	0.32	86	Metal Loss	TBit	SK	Inspection Side
2702	80	46.57	73.19	1.12	0.47	87	Metal Loss	TBit	SK	Inspection Side
2703	80	18.19	185.63	1.32	0.32	87	Metal Loss	TBit	SK	Inspection Side
2704	80	18.15	185.63	0.82	0.31	91	Metal Loss	TBit	SK	Inspection Side
2705	80	43.66	176.38	0.96	0.41	92	Metal Loss	TBit	SK	Inspection Side
2706	80	54.72	188.43	1.12	0.70	94	Metal Loss	TBit	SK	Inspection Side
2707	80	53.94	197.20	1.07	0.32	95	Metal Loss	TBit	SK	Inspection Side
2708	80	42.05	64.37	1.05	0.52	96	Metal Loss	TBit	SK	Inspection Side
2709	80	42.95	198.23	0.90	0.40	97	Metal Loss	TBit	SK	Inspection Side
2710	80	57.24	25.98	1.03	0.42	97	Metal Loss	TBit	SK	Inspection Side
2711	80	58.90	106.14	1.11	0.52	97	Metal Loss	TBit	SK	Inspection Side
2712	80	12.56	30.12	1.51	0.47	97	Metal Loss	TBit	SK	Inspection Side
2713	80	12.36	119.57	1.56	0.42	97	Metal Loss	TBit	SK	Inspection Side
2714	80	9.06	24.57	1.57	0.44	97	Metal Loss	TBit	SK	Inspection Side
2715	80	16.18	35.16	1.78	0.98	97	Metal Loss	TBit	SK	Inspection Side
2716	80	13.19	112.83	2.85	0.56	97	Metal Loss	TBit	SK	Inspection Side
2717	81	8.82	131.46	1.06	0.67	49	Metal Loss	TBit	SK / CA	Inspection Side
2718	81	31.26	61.46	1.45	0.95	49	Metal Loss	TBit	SK	Inspection Side
2719	81	6.57	26.34	0.25	0.36	50	Metal Loss	TBit	SK	Inspection Side
2720	81	9.41	131.42	0.39	0.76	51	Metal Loss	TBit	SK / CA	Inspection Side
2721	81	57.99	109.76	0.68	0.39	51	Metal Loss	TBit	SK	Inspection Side
2722	81	32.72	151.18	0.70	0.32	51	Metal Loss	TBit	SK / CA	Inspection Side
2723	81	17.56	123.35	0.82	0.46	51	Metal Loss	TBit	SK	Inspection Side
2724	81	45.79	144.80	1.00	0.59	51	Metal Loss	TBit	SK / CA	Inspection Side
2725	81	37.24	90.12	0.99	0.43	52	Metal Loss	TBit	SK	Inspection Side
2726	81	52.20	47.87	0.99	0.50	52	Metal Loss	TBit	SK	Inspection Side
2727	81	12.95	142.52	0.73	0.52	53	Metal Loss	TBit	SK / CA	Inspection Side
2728	81	19.06	140.71	0.75	0.51	53	Metal Loss	TBit	SK / CA	Inspection Side
2729	81	55.08	25.39	1.11	0.70	53	Metal Loss	TBit	SK	Inspection Side
2730	81	51.34	126.14	0.74	0.33	54	Metal Loss	TBit	SK	Inspection Side
2731	81	56.02	65.08	1.31	0.37	54	Metal Loss	TBit	SK	Inspection Side
2732	81	17.72	127.01	1.68	0.85	55	Metal Loss	TBit	SK	Inspection Side
2733	81	10.67	121.34	0.54	0.35	58	Metal Loss	TBit	SK	Inspection Side
2734	81	59.65	43.50	1.60	0.27	58	Metal Loss	TBit	SK	Inspection Side
2735	81	59.96	18.15	1.33	0.65	59	Metal Loss	TBit	SK	Inspection Side
2736	81	10.83	141.61	1.39	1.33	59	Metal Loss	TBit	SK / CA	Inspection Side
2737	81	23.31	126.02	1.95	0.76	59	Metal Loss	TBit	SK	Inspection Side
2738	81	56.69	16.57	1.16	0.53	61	Metal Loss	TBit	SK	Inspection Side
2739	81	55.47	113.15	1.21	0.54	63	Metal Loss	TBit	SK	Inspection Side
2740	81	21.02	146.38	0.69	0.46	64	Metal Loss	TBit	SK / CA	Inspection Side
2741	81	52.52	104.72	1.47	0.53	65	Metal Loss	TBit	SK	Inspection Side
2742	81	15.94	141.30	0.86	0.42	67	Metal Loss	TBit	SK / CA	Inspection Side
2743	81	50.20	142.05	0.64	0.46	70	Metal Loss	TBit	SK	Inspection Side
2744	81	57.13	15.98	1.15	0.44	73	Metal Loss	TBit	SK	Inspection Side
2745	81	58.82	116.57	1.22	1.11	78	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2746	81	15.63	130.71	1.36	0.62	79	Metal Loss	TBit	SK	Non Inspection Side
2747	81	58.94	50.63	1.67	0.54	81	Metal Loss	TBit	SK	Inspection Side
2748	81	57.13	99.41	1.67	0.44	86	Metal Loss	TBit	SK	Inspection Side
2749	81	56.89	100.08	1.65	0.47	88	Metal Loss	TBit	SK	Inspection Side
2750	81	19.02	135.55	0.87	0.37	97	Metal Loss	TBit	SK / CA	Inspection Side
2751	82	54.45	66.54	0.47	0.21	49	Metal Loss	TBit	SK	Inspection Side
2752	82	19.88	79.72	0.48	0.44	49	Metal Loss	TBit	SK / CA	Inspection Side
2753	82	55.43	96.34	0.58	0.38	49	Metal Loss	TBit	SK / CA	Inspection Side
2754	82	40.75	88.07	0.66	0.46	49	Metal Loss	TBit	SK / CA	Inspection Side
2755	82	7.64	56.10	0.86	0.46	49	Metal Loss	TBit	SK	Inspection Side
2756	82	30.87	10.55	0.86	0.44	49	Metal Loss	TBit	SK	Inspection Side
2757	82	35.63	24.41	1.43	0.51	49	Metal Loss	TBit	SK	Inspection Side
2758	82	18.15	29.41	0.61	0.25	50	Metal Loss	TBit	SK	Inspection Side
2759	82	46.65	50.24	0.83	0.64	50	Metal Loss	TBit	SK	Inspection Side
2760	82	12.01	63.82	0.38	0.36	51	Metal Loss	TBit	SK	Inspection Side
2761	82	9.69	64.53	0.43	0.39	51	Metal Loss	TBit	SK / CA	Inspection Side
2762	82	33.27	30.98	0.91	0.49	51	Metal Loss	TBit	SK	Inspection Side
2763	82	27.24	36.85	1.34	0.28	51	Metal Loss	TBit	SK	Inspection Side
2764	82	18.98	35.35	0.53	0.33	52	Metal Loss	TBit	SK	Inspection Side
2765	82	58.58	53.82	0.54	0.41	52	Metal Loss	TBit	SK	Inspection Side
2766	82	24.09	87.36	0.71	0.35	52	Metal Loss	TBit	SK / CA	Inspection Side
2767	82	16.10	27.68	1.13	0.26	52	Metal Loss	TBit	SK	Non Inspection Side
2768	82	45.63	51.69	1.48	0.64	52	Metal Loss	TBit	SK	Non Inspection Side
2769	82	15.83	34.06	0.29	0.26	53	Metal Loss	TBit	SK	Inspection Side
2770	82	11.22	43.46	0.55	0.35	53	Metal Loss	TBit	SK	Inspection Side
2771	82	7.17	63.86	0.56	0.42	53	Metal Loss	TBit	SK / CA	Inspection Side
2772	82	23.50	79.65	0.63	0.45	53	Metal Loss	TBit	SK / CA	Inspection Side
2773	82	55.16	87.72	0.69	0.44	53	Metal Loss	TBit	SK / CA	Inspection Side
2774	82	46.93	81.57	0.70	0.40	53	Metal Loss	TBit	SK	Inspection Side
2775	82	25.12	36.54	0.80	0.40	53	Metal Loss	TBit	SK	Inspection Side
2776	82	28.35	83.70	0.80	0.33	53	Metal Loss	TBit	SK / CA	Inspection Side
2777	82	18.50	40.04	0.18	0.43	55	Metal Loss	TBit	SK	Inspection Side
2778	82	20.28	52.09	0.62	0.41	55	Metal Loss	TBit	SK	Inspection Side
2779	82	16.93	50.59	1.14	0.77	55	Metal Loss	TBit	SK	Inspection Side
2780	82	15.12	28.54	1.32	0.75	55	Metal Loss	TBit	SK	Inspection Side
2781	82	7.01	54.02	0.48	0.35	56	Metal Loss	TBit	SK	Inspection Side
2782	82	15.79	38.58	0.77	0.19	56	Metal Loss	TBit	SK	Inspection Side
2783	82	54.37	10.75	0.52	0.34	57	Metal Loss	TBit	SK	Inspection Side
2784	82	49.76	73.35	0.61	0.48	58	Metal Loss	TBit	SK	Inspection Side
2785	82	26.10	36.22	0.62	0.39	58	Metal Loss	TBit	SK	Inspection Side
2786	82	18.39	56.30	1.02	0.40	58	Metal Loss	TBit	SK	Inspection Side
2787	82	19.88	49.69	0.53	0.39	59	Metal Loss	TBit	SK	Inspection Side
2788	82	15.43	38.94	1.41	0.85	60	Metal Loss	TBit	SK	Non Inspection Side
2789	82	46.18	62.40	0.57	0.44	62	Metal Loss	TBit	SK	Inspection Side
2790	82	31.22	37.32	0.81	0.35	64	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2791	82	59.96	50.16	1.25	0.65	65	Metal Loss	TBit	SK	Inspection Side
2792	82	14.96	74.37	0.81	0.61	66	Metal Loss	TBit	SK / CA	Inspection Side
2793	82	36.54	26.10	0.80	0.44	67	Metal Loss	TBit	SK	Inspection Side
2794	82	15.51	42.76	0.84	0.33	67	Metal Loss	TBit	SK	Inspection Side
2795	82	45.43	48.78	1.05	0.47	69	Metal Loss	TBit	SK	Inspection Side
2796	82	21.73	36.26	0.94	0.42	70	Metal Loss	TBit	SK	Inspection Side
2797	82	61.81	68.98	1.63	0.60	70	Metal Loss	TBit	SK	Non Inspection Side
2798	82	59.33	59.25	1.31	0.37	72	Metal Loss	TBit	SK	Inspection Side
2799	82	16.81	37.44	0.83	0.38	75	Metal Loss	TBit	SK	Inspection Side
2800	82	53.98	11.22	0.91	0.39	84	Metal Loss	TBit	SK	Inspection Side
2801	82	58.15	32.64	0.95	0.52	92	Metal Loss	TBit	SK	Inspection Side
2802	82	17.68	37.32	0.99	0.35	93	Metal Loss	TBit	SK	Inspection Side
2803	82	60.79	27.87	1.24	0.79	96	Metal Loss	TBit	SK	Inspection Side
2804	83	57.13	167.95	0.38	0.21	49	Metal Loss	TBit	SK	Inspection Side
2805	83	62.36	77.44	1.27	0.55	49	Metal Loss	TBit	SK	Inspection Side
2806	83	13.43	240.04	0.26	0.30	50	Metal Loss	TBit	SK	Inspection Side
2807	83	55.28	177.95	0.57	0.38	50	Metal Loss	TBit	SK	Inspection Side
2808	83	19.29	136.10	0.72	0.35	50	Metal Loss	TBit	SK	Inspection Side
2809	83	50.28	35.91	0.92	0.41	50	Metal Loss	TBit	SK	Inspection Side
2810	83	49.72	149.33	0.93	0.47	50	Metal Loss	TBit	SK	Inspection Side
2811	83	32.56	42.48	1.01	1.47	50	Metal Loss	TBit	SK	Non Inspection Side
2812	83	55.91	53.58	0.38	0.28	51	Metal Loss	TBit	SK	Inspection Side
2813	83	55.79	87.56	0.42	0.36	51	Metal Loss	TBit	SK	Inspection Side
2814	83	58.39	73.94	0.58	0.46	51	Metal Loss	TBit	SK	Inspection Side
2815	83	55.87	16.77	0.69	0.41	51	Metal Loss	TBit	SK	Inspection Side
2816	83	61.81	175.08	1.28	0.55	51	Metal Loss	TBit	SK	Non Inspection Side
2817	83	52.24	88.86	0.49	0.39	52	Metal Loss	TBit	SK	Inspection Side
2818	83	62.36	165.63	0.72	0.47	52	Metal Loss	TBit	SK	Inspection Side
2819	83	50.91	159.72	0.79	0.36	52	Metal Loss	TBit	SK	Inspection Side
2820	83	61.54	209.92	0.80	0.28	52	Metal Loss	TBit	SK	Inspection Side
2821	83	33.35	112.01	1.01	0.32	52	Metal Loss	TBit	SK	Inspection Side
2822	83	61.93	207.05	1.05	0.56	52	Metal Loss	TBit	SK	Non Inspection Side
2823	83	45.35	106.50	1.24	1.15	52	Metal Loss	TBit	SK	Non Inspection Side
2824	83	56.77	189.06	1.29	0.41	52	Metal Loss	TBit	SK	Inspection Side
2825	83	61.61	124.53	1.69	0.54	52	Metal Loss	TBit	SK	Non Inspection Side
2826	83	59.37	99.72	2.24	0.66	52	Metal Loss	TBit	SK	Inspection Side
2827	83	31.54	130.91	0.96	0.40	53	Metal Loss	TBit	SK	Inspection Side
2828	83	16.89	108.54	1.34	0.37	53	Metal Loss	TBit	SK	Non Inspection Side
2829	83	7.52	187.80	1.90	0.45	53	Metal Loss	TBit	SK	Inspection Side
2830	83	61.30	52.95	0.76	0.43	54	Metal Loss	TBit	SK	Inspection Side
2831	83	9.02	164.29	0.95	0.20	54	Metal Loss	TBit	SK	Inspection Side
2832	83	23.82	142.52	1.12	0.67	54	Metal Loss	TBit	SK	Inspection Side
2833	83	62.80	91.14	0.55	0.41	55	Metal Loss	TBit	SK	Inspection Side
2834	83	59.49	91.26	0.91	0.33	55	Metal Loss	TBit	SK	Inspection Side
2835	83	57.28	60.98	1.20	0.68	55	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2836	83	18.27	237.91	1.35	0.89	55	Metal Loss	TBit	SK	Non Inspection Side
2837	83	55.00	18.19	0.79	0.39	56	Metal Loss	TBit	SK	Inspection Side
2838	83	18.31	182.36	1.18	0.35	56	Metal Loss	TBit	SK	Inspection Side
2839	83	5.98	173.31	0.53	0.33	58	Metal Loss	TBit	SK	Inspection Side
2840	83	18.19	149.02	0.73	0.73	58	Metal Loss	TBit	SK	Inspection Side
2841	83	54.69	196.93	0.78	0.55	58	Metal Loss	TBit	SK	Inspection Side
2842	83	60.31	121.81	0.88	0.28	58	Metal Loss	TBit	SK	Inspection Side
2843	83	58.78	212.13	0.98	0.45	58	Metal Loss	TBit	SK	Inspection Side
2844	83	61.81	171.81	1.13	0.44	59	Metal Loss	TBit	SK	Inspection Side
2845	83	61.77	127.91	1.39	0.92	59	Metal Loss	TBit	SK	Non Inspection Side
2846	83	29.06	135.12	0.83	0.45	60	Metal Loss	TBit	SK	Inspection Side
2847	83	54.69	195.00	0.63	0.47	61	Metal Loss	TBit	SK	Inspection Side
2848	83	60.47	37.05	0.64	0.62	61	Metal Loss	TBit	SK	Non Inspection Side
2849	83	61.65	107.87	1.64	0.92	62	Metal Loss	TBit	SK	Non Inspection Side
2850	83	16.57	191.50	1.15	0.94	63	Metal Loss	TBit	SK	Inspection Side
2851	83	52.72	73.90	1.28	0.63	63	Metal Loss	TBit	SK	Inspection Side
2852	83	59.69	161.65	0.63	0.31	64	Metal Loss	TBit	SK	Inspection Side
2853	83	57.01	77.76	0.63	0.46	64	Metal Loss	TBit	SK	Inspection Side
2854	83	55.59	135.79	0.64	0.47	64	Metal Loss	TBit	SK	Inspection Side
2855	83	49.61	40.98	0.64	0.47	64	Metal Loss	TBit	SK	Inspection Side
2856	83	45.20	190.63	0.87	0.81	64	Metal Loss	TBit	SK	Inspection Side
2857	83	18.19	177.60	1.54	1.52	64	Metal Loss	TBit	SK	Non Inspection Side
2858	83	55.20	180.35	1.60	0.55	64	Metal Loss	TBit	SK	Inspection Side
2859	83	18.35	145.79	1.80	1.64	64	Metal Loss	TBit	SK	Non Inspection Side
2860	83	45.75	81.46	2.00	0.50	64	Metal Loss	TBit	SK	Non Inspection Side
2861	83	60.39	83.54	0.69	0.45	65	Metal Loss	TBit	SK	Inspection Side
2862	83	50.39	172.68	0.83	0.38	67	Metal Loss	TBit	SK	Inspection Side
2863	83	50.59	166.34	0.86	0.40	69	Metal Loss	TBit	SK	Inspection Side
2864	83	53.90	201.22	0.91	0.58	71	Metal Loss	TBit	SK	Inspection Side
2865	83	27.72	127.48	1.02	0.70	71	Metal Loss	TBit	SK	Inspection Side
2866	83	16.69	105.94	1.13	0.60	71	Metal Loss	TBit	SK	Inspection Side
2867	83	58.90	198.19	0.77	0.42	73	Metal Loss	TBit	SK	Inspection Side
2868	83	59.61	199.45	1.24	0.42	73	Metal Loss	TBit	SK	Inspection Side
2869	83	17.32	115.79	1.78	2.61	74	Metal Loss	TBit	SK	Non Inspection Side
2870	83	9.61	190.75	0.71	0.55	75	Metal Loss	TBit	SK	Inspection Side
2871	83	53.62	177.20	0.82	0.43	75	Metal Loss	TBit	SK	Inspection Side
2872	83	61.81	79.13	1.33	0.77	75	Metal Loss	TBit	SK	Inspection Side
2873	83	61.42	211.26	0.91	0.73	76	Metal Loss	TBit	SK	Inspection Side
2874	83	60.87	175.43	0.91	0.32	77	Metal Loss	TBit	SK	Inspection Side
2875	83	6.57	181.69	0.99	0.41	77	Metal Loss	TBit	SK	Inspection Side
2876	83	59.49	105.39	1.21	0.61	81	Metal Loss	TBit	SK	Inspection Side
2877	83	14.69	177.87	0.68	0.47	83	Metal Loss	TBit	SK	Inspection Side
2878	83	16.18	201.81	0.87	0.47	83	Metal Loss	TBit	SK	Inspection Side
2879	83	61.81	113.94	0.99	0.31	84	Metal Loss	TBit	SK	Inspection Side
2880	83	61.81	177.87	1.30	0.62	84	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2881	83	61.97	204.57	1.01	0.78	91	Metal Loss	TBit	SK	Inspection Side
2882	83	61.89	182.64	1.13	0.40	97	Metal Loss	TBit	SK	Inspection Side
2883	84	62.09	182.64	0.60	0.47	49	Metal Loss	TBit	SK	Inspection Side
2884	84	55.00	90.31	2.00	0.51	49	Metal Loss	TBit	SK	Inspection Side
2885	84	17.13	33.74	2.93	1.35	49	Metal Loss	TBit	SK	Inspection Side
2886	84	61.30	49.25	0.38	0.40	50	Metal Loss	TBit	SK	Inspection Side
2887	84	60.20	26.14	0.43	0.45	50	Metal Loss	TBit	SK	Inspection Side
2888	84	58.27	184.65	0.55	0.32	50	Metal Loss	TBit	SK	Inspection Side
2889	84	57.13	88.62	0.67	0.31	50	Metal Loss	TBit	SK	Inspection Side
2890	84	6.81	176.97	0.79	0.37	50	Metal Loss	TBit	SK	Inspection Side
2891	84	23.07	160.16	0.85	0.49	50	Metal Loss	TBit	SK	Inspection Side
2892	84	31.73	205.47	1.30	0.80	50	Metal Loss	TBit	SK	Non Inspection Side
2893	84	61.26	137.13	0.68	0.42	51	Metal Loss	TBit	SK	Inspection Side
2894	84	36.34	40.59	0.75	0.40	51	Metal Loss	TBit	SK	Inspection Side
2895	84	39.29	59.29	0.78	0.42	51	Metal Loss	TBit	SK	Inspection Side
2896	84	43.86	54.69	0.81	0.39	51	Metal Loss	TBit	SK	Inspection Side
2897	84	60.79	56.65	0.94	0.44	51	Metal Loss	TBit	SK	Inspection Side
2898	84	63.19	36.69	1.05	0.46	51	Metal Loss	TBit	SK	Inspection Side
2899	84	58.50	26.54	0.76	0.47	52	Metal Loss	TBit	SK	Inspection Side
2900	84	60.31	189.02	0.77	0.55	52	Metal Loss	TBit	SK	Non Inspection Side
2901	84	55.28	145.04	0.92	0.43	52	Metal Loss	TBit	SK	Inspection Side
2902	84	31.18	81.57	0.97	0.29	52	Metal Loss	TBit	SK	Inspection Side
2903	84	28.74	172.13	1.10	0.53	52	Metal Loss	TBit	SK	Non Inspection Side
2904	84	57.28	53.58	1.13	0.43	52	Metal Loss	TBit	SK	Inspection Side
2905	84	31.54	103.50	1.15	0.62	52	Metal Loss	TBit	SK	Inspection Side
2906	84	28.94	212.80	1.95	0.47	52	Metal Loss	TBit	SK	Inspection Side
2907	84	27.01	147.05	2.35	0.43	52	Metal Loss	TBit	SK	Inspection Side
2908	84	29.41	190.87	2.43	0.42	52	Metal Loss	TBit	SK	Inspection Side
2909	84	56.06	64.49	0.43	0.33	53	Metal Loss	TBit	SK	Inspection Side
2910	84	60.20	115.47	0.54	0.33	53	Metal Loss	TBit	SK	Inspection Side
2911	84	57.13	145.43	0.59	0.40	53	Metal Loss	TBit	SK	Inspection Side
2912	84	30.71	88.94	0.69	0.52	53	Metal Loss	TBit	SK	Non Inspection Side
2913	84	29.61	105.79	0.95	0.39	53	Metal Loss	TBit	SK	Inspection Side
2914	84	32.64	176.97	1.33	0.80	53	Metal Loss	TBit	SK	Inspection Side
2915	84	24.65	154.96	1.39	0.53	53	Metal Loss	TBit	SK	Inspection Side
2916	84	59.09	56.26	1.50	0.34	53	Metal Loss	TBit	SK	Inspection Side
2917	84	52.05	133.74	0.99	0.51	54	Metal Loss	TBit	SK	Inspection Side
2918	84	30.67	224.49	1.08	0.25	54	Metal Loss	TBit	SK	Inspection Side
2919	84	29.76	159.57	1.18	0.94	54	Metal Loss	TBit	SK	Inspection Side
2920	84	30.12	198.23	1.26	0.74	54	Metal Loss	TBit	SK	Inspection Side
2921	84	57.68	37.99	0.31	0.31	55	Metal Loss	TBit	SK	Inspection Side
2922	84	57.44	29.65	0.47	0.33	55	Metal Loss	TBit	SK	Inspection Side
2923	84	59.37	36.73	0.59	0.38	55	Metal Loss	TBit	SK	Inspection Side
2924	84	28.46	104.96	0.61	0.36	55	Metal Loss	TBit	SK	Inspection Side
2925	84	59.21	38.39	1.05	0.37	55	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2926	84	17.60	209.65	1.23	0.76	55	Metal Loss	TBit	SK	Inspection Side
2927	84	16.34	50.16	1.34	0.91	55	Metal Loss	TBit	SK	Non Inspection Side
2928	84	61.10	49.25	1.34	0.47	56	Metal Loss	TBit	SK	Inspection Side
2929	84	55.28	69.49	0.91	0.32	57	Metal Loss	TBit	SK	Inspection Side
2930	84	27.32	102.36	1.06	0.53	57	Metal Loss	TBit	SK	Inspection Side
2931	84	26.46	206.18	0.92	0.54	58	Metal Loss	TBit	SK	Inspection Side
2932	84	31.69	172.09	1.11	0.38	58	Metal Loss	TBit	SK	Inspection Side
2933	84	30.67	205.79	1.14	0.36	58	Metal Loss	TBit	SK	Non Inspection Side
2934	84	32.24	154.33	1.31	0.91	58	Metal Loss	TBit	SK	Inspection Side
2935	84	28.15	219.72	1.46	0.74	58	Metal Loss	TBit	SK	Inspection Side
2936	84	15.91	12.91	0.34	0.38	59	Metal Loss	TBit	SK	Inspection Side
2937	84	60.63	22.24	0.54	0.43	59	Metal Loss	TBit	SK	Inspection Side
2938	84	30.63	36.69	3.61	0.78	59	Metal Loss	TBit	SK	Inspection Side
2939	84	28.11	106.77	0.51	0.30	60	Metal Loss	TBit	SK	Inspection Side
2940	84	56.22	145.31	0.51	0.33	61	Metal Loss	TBit	SK	Inspection Side
2941	84	60.91	76.50	0.66	0.44	61	Metal Loss	TBit	SK	Inspection Side
2942	84	57.80	217.48	0.52	0.45	62	Metal Loss	TBit	SK	Inspection Side
2943	84	53.74	54.21	0.78	0.39	62	Metal Loss	TBit	SK	Inspection Side
2944	84	19.45	145.43	1.35	0.55	63	Metal Loss	TBit	SK	Inspection Side
2945	84	31.30	159.61	1.03	0.52	64	Metal Loss	TBit	SK	Inspection Side
2946	84	59.29	54.06	0.78	0.36	65	Metal Loss	TBit	SK	Inspection Side
2947	84	25.20	181.77	0.89	0.45	65	Metal Loss	TBit	SK	Inspection Side
2948	84	31.61	11.38	1.19	0.50	65	Metal Loss	TBit	SK	Non Inspection Side
2949	84	60.16	26.69	0.62	0.37	66	Metal Loss	TBit	SK	Inspection Side
2950	84	57.13	23.98	0.75	0.35	66	Metal Loss	TBit	SK	Inspection Side
2951	84	16.93	219.21	0.77	0.46	67	Metal Loss	TBit	SK	Inspection Side
2952	84	57.52	53.74	0.81	0.32	67	Metal Loss	TBit	SK	Inspection Side
2953	84	30.35	152.80	0.99	0.58	67	Metal Loss	TBit	SK	Inspection Side
2954	84	55.91	63.31	0.49	0.31	68	Metal Loss	TBit	SK	Inspection Side
2955	84	20.31	10.87	0.47	0.39	69	Metal Loss	TBit	SK	Inspection Side
2956	84	26.73	175.39	0.90	0.44	71	Metal Loss	TBit	SK	Inspection Side
2957	84	28.70	215.87	0.87	0.38	78	Metal Loss	TBit	SK	Inspection Side
2958	84	30.55	144.57	1.58	0.31	85	Metal Loss	TBit	SK	Inspection Side
2959	84	62.24	182.72	0.95	0.38	86	Metal Loss	TBit	SK	Inspection Side
2960	84	29.61	91.97	1.20	0.66	96	Metal Loss	TBit	SK	Inspection Side
2961	84	16.22	48.43	1.08	0.44	97	Metal Loss	TBit	SK	Inspection Side
2962	84	29.02	50.12	1.74	0.63	98	Metal Loss	TBit	SK	Inspection Side
2963	85	22.56	22.83	0.64	0.50	49	Metal Loss	TBit	SK	Inspection Side
2964	85	59.33	135.75	0.68	0.30	49	Metal Loss	TBit	SK	Inspection Side
2965	85	61.30	33.82	0.82	0.62	49	Metal Loss	TBit	SK	Inspection Side
2966	85	47.83	70.24	0.84	0.40	49	Metal Loss	TBit	SK	Inspection Side
2967	85	51.81	41.02	0.99	0.46	49	Metal Loss	TBit	SK	Inspection Side
2968	85	56.61	143.70	1.12	0.47	49	Metal Loss	TBit	SK	Inspection Side
2969	85	7.95	48.54	1.32	0.70	49	Metal Loss	TBit	SK	Inspection Side
2970	85	22.24	74.80	1.38	0.73	49	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
2971	85	22.91	13.15	1.69	0.74	49	Metal Loss	TBit	SK	Inspection Side
2972	85	36.97	112.56	0.31	0.32	50	Metal Loss	TBit	SK	Inspection Side
2973	85	11.14	116.06	0.37	0.37	50	Metal Loss	TBit	SK	Inspection Side
2974	85	48.07	65.98	0.49	0.40	50	Metal Loss	TBit	SK	Inspection Side
2975	85	58.70	23.07	0.50	0.46	50	Metal Loss	TBit	SK	Inspection Side
2976	85	10.04	42.95	0.73	0.43	50	Metal Loss	TBit	SK	Inspection Side
2977	85	23.07	154.25	0.80	0.56	50	Metal Loss	TBit	SK	Inspection Side
2978	85	26.57	122.60	0.81	0.40	50	Metal Loss	TBit	SK	Inspection Side
2979	85	61.69	134.02	1.02	0.22	50	Metal Loss	TBit	SK	Inspection Side
2980	85	8.94	77.64	2.05	0.40	50	Metal Loss	TBit	SK	Inspection Side
2981	85	6.46	75.24	0.40	0.36	51	Metal Loss	TBit	SK	Inspection Side
2982	85	5.87	30.71	0.40	0.32	51	Metal Loss	TBit	SK	Inspection Side
2983	85	22.24	72.20	0.58	0.46	51	Metal Loss	TBit	SK	Inspection Side
2984	85	56.73	29.02	0.60	0.53	51	Metal Loss	TBit	SK	Inspection Side
2985	85	50.47	67.68	0.65	0.37	51	Metal Loss	TBit	SK	Inspection Side
2986	85	62.17	13.39	0.84	0.42	51	Metal Loss	TBit	SK	Inspection Side
2987	85	58.70	16.54	0.96	0.63	51	Metal Loss	TBit	SK	Inspection Side
2988	85	62.28	42.48	1.11	0.19	51	Metal Loss	TBit	SK	Inspection Side
2989	85	19.29	136.22	1.12	0.40	51	Metal Loss	TBit	SK	Inspection Side
2990	85	60.24	43.94	1.23	0.31	51	Metal Loss	TBit	SK	Inspection Side
2991	85	16.97	118.27	1.51	1.39	51	Metal Loss	TBit	SK	Inspection Side
2992	85	7.32	108.31	0.46	0.38	52	Metal Loss	TBit	SK	Inspection Side
2993	85	43.98	68.46	0.63	0.33	52	Metal Loss	TBit	SK	Inspection Side
2994	85	22.44	114.88	0.66	0.36	52	Metal Loss	TBit	SK	Inspection Side
2995	85	17.76	94.49	0.81	0.15	52	Metal Loss	TBit	SK	Inspection Side
2996	85	4.33	113.70	0.90	0.45	52	Metal Loss	TBit	SK	Inspection Side
2997	85	22.36	99.41	1.06	0.75	52	Metal Loss	TBit	SK	Inspection Side
2998	85	45.79	25.87	1.11	0.31	52	Metal Loss	TBit	SK	Inspection Side
2999	85	62.24	127.99	1.26	0.86	52	Metal Loss	TBit	SK	Inspection Side
3000	85	18.39	218.78	1.33	0.56	52	Metal Loss	TBit	SK	Inspection Side
3001	85	20.28	163.11	0.53	0.38	53	Metal Loss	TBit	SK	Inspection Side
3002	85	21.89	195.94	0.66	0.38	53	Metal Loss	TBit	SK	Inspection Side
3003	85	59.09	188.86	0.69	0.28	53	Metal Loss	TBit	SK	Inspection Side
3004	85	46.97	69.17	0.73	0.46	53	Metal Loss	TBit	SK	Inspection Side
3005	85	46.54	45.24	0.75	0.45	53	Metal Loss	TBit	SK	Inspection Side
3006	85	26.06	30.67	0.83	0.34	53	Metal Loss	TBit	SK	Inspection Side
3007	85	45.71	48.74	1.11	0.67	53	Metal Loss	TBit	SK	Inspection Side
3008	85	19.06	12.01	1.16	0.29	53	Metal Loss	TBit	SK	Non Inspection Side
3009	85	45.79	64.72	1.20	0.27	53	Metal Loss	TBit	SK	Inspection Side
3010	85	45.24	71.61	0.34	0.34	54	Metal Loss	TBit	SK	Inspection Side
3011	85	59.88	34.88	0.51	0.30	54	Metal Loss	TBit	SK	Inspection Side
3012	85	59.57	30.91	0.63	0.25	54	Metal Loss	TBit	SK	Inspection Side
3013	85	58.19	20.20	0.96	0.35	54	Metal Loss	TBit	SK	Inspection Side
3014	85	6.54	70.04	0.99	0.47	54	Metal Loss	TBit	SK	Inspection Side
3015	85	20.94	154.49	1.19	0.60	54	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3016	85	32.09	98.66	1.22	0.94	54	Metal Loss	TBit	SK	Non Inspection Side
3017	85	62.60	64.17	1.33	0.47	54	Metal Loss	TBit	SK	Inspection Side
3018	85	6.85	93.35	1.48	0.46	54	Metal Loss	TBit	SK	Inspection Side
3019	85	37.17	121.73	1.16	0.41	55	Metal Loss	TBit	SK	Inspection Side
3020	85	23.39	81.26	1.19	0.78	55	Metal Loss	TBit	SK	Inspection Side
3021	85	47.01	111.50	1.29	0.30	55	Metal Loss	TBit	SK	Inspection Side
3022	85	20.67	151.18	0.55	0.52	56	Metal Loss	TBit	SK	Inspection Side
3023	85	60.71	217.60	0.63	0.31	56	Metal Loss	TBit	SK	Inspection Side
3024	85	19.57	108.98	0.73	0.30	56	Metal Loss	TBit	SK	Inspection Side
3025	85	32.56	124.02	1.11	0.33	56	Metal Loss	TBit	SK	Inspection Side
3026	85	48.43	120.39	1.24	0.63	56	Metal Loss	TBit	SK	Inspection Side
3027	85	60.79	190.83	1.34	0.71	56	Metal Loss	TBit	SK	Inspection Side
3028	85	7.91	64.09	1.38	0.43	56	Metal Loss	TBit	SK	Inspection Side
3029	85	9.02	118.54	1.46	0.46	56	Metal Loss	TBit	SK	Inspection Side
3030	85	18.19	216.57	0.63	0.51	57	Metal Loss	TBit	SK	Inspection Side
3031	85	7.13	123.43	0.73	0.36	57	Metal Loss	TBit	SK	Inspection Side
3032	85	8.74	157.01	0.85	0.46	57	Metal Loss	TBit	SK	Inspection Side
3033	85	8.74	65.75	0.91	0.43	57	Metal Loss	TBit	SK	Inspection Side
3034	85	8.74	87.17	1.04	0.42	57	Metal Loss	TBit	SK	Inspection Side
3035	85	45.67	27.40	1.06	0.28	57	Metal Loss	TBit	SK	Inspection Side
3036	85	61.69	182.68	1.09	1.56	57	Metal Loss	TBit	SK	Non Inspection Side
3037	85	59.57	158.98	1.48	0.39	57	Metal Loss	TBit	SK	Inspection Side
3038	85	23.15	83.07	1.71	0.70	57	Metal Loss	TBit	SK	Inspection Side
3039	85	25.79	24.29	0.42	0.30	58	Metal Loss	TBit	SK	Inspection Side
3040	85	23.35	99.41	0.70	0.70	58	Metal Loss	TBit	SK	Inspection Side
3041	85	60.67	23.86	0.81	0.71	58	Metal Loss	TBit	SK	Inspection Side
3042	85	60.39	8.66	0.86	0.30	58	Metal Loss	TBit	SK	Inspection Side
3043	85	59.69	40.71	0.91	0.32	58	Metal Loss	TBit	SK	Inspection Side
3044	85	45.39	72.83	0.93	0.49	58	Metal Loss	TBit	SK	Inspection Side
3045	85	22.68	102.95	1.15	0.50	58	Metal Loss	TBit	SK	Inspection Side
3046	85	5.83	82.48	1.17	0.49	58	Metal Loss	TBit	SK	Inspection Side
3047	85	21.18	171.10	1.01	0.50	59	Metal Loss	TBit	SK	Inspection Side
3048	85	56.50	32.83	0.79	0.47	60	Metal Loss	TBit	SK	Inspection Side
3049	85	58.70	192.28	0.85	0.42	60	Metal Loss	TBit	SK	Inspection Side
3050	85	50.04	66.18	0.98	0.41	60	Metal Loss	TBit	SK	Inspection Side
3051	85	32.56	158.46	1.11	0.29	60	Metal Loss	TBit	SK	Inspection Side
3052	85	20.55	74.29	1.30	0.44	60	Metal Loss	TBit	SK	Inspection Side
3053	85	21.46	42.56	1.51	0.33	60	Metal Loss	TBit	SK	Inspection Side
3054	85	18.19	95.47	0.74	0.67	61	Metal Loss	TBit	SK	Inspection Side
3055	85	20.63	12.91	0.85	0.89	61	Metal Loss	TBit	SK	Inspection Side
3056	85	62.20	30.75	0.86	0.31	61	Metal Loss	TBit	SK	Inspection Side
3057	85	61.77	36.57	0.86	0.29	61	Metal Loss	TBit	SK	Inspection Side
3058	85	28.70	13.46	0.93	0.39	61	Metal Loss	TBit	SK	Inspection Side
3059	85	18.86	24.37	0.94	0.34	61	Metal Loss	TBit	SK	Inspection Side
3060	85	55.20	67.24	0.49	0.31	62	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3061	85	50.28	162.56	0.75	0.67	62	Metal Loss	TBit	SK	Inspection Side
3062	85	62.17	211.22	0.89	0.29	62	Metal Loss	TBit	SK	Inspection Side
3063	85	59.41	193.54	0.93	0.37	63	Metal Loss	TBit	SK	Inspection Side
3064	85	19.57	94.13	0.98	0.44	63	Metal Loss	TBit	SK	Inspection Side
3065	85	60.87	167.72	1.11	0.43	63	Metal Loss	TBit	SK	Inspection Side
3066	85	36.61	237.99	1.30	0.37	63	Metal Loss	TBit	SK	Inspection Side
3067	85	50.47	189.06	1.36	0.67	63	Metal Loss	TBit	SK	Inspection Side
3068	85	19.29	151.85	0.86	0.36	64	Metal Loss	TBit	SK	Inspection Side
3069	85	45.71	41.93	0.95	0.28	64	Metal Loss	TBit	SK	Inspection Side
3070	85	18.70	153.82	1.06	0.33	64	Metal Loss	TBit	SK	Inspection Side
3071	85	31.30	117.17	1.10	0.54	64	Metal Loss	TBit	SK	Inspection Side
3072	85	9.45	92.99	1.21	0.35	64	Metal Loss	TBit	SK	Inspection Side
3073	85	17.60	90.20	1.24	0.80	64	Metal Loss	TBit	SK	Inspection Side
3074	85	32.44	22.32	1.35	0.30	64	Metal Loss	TBit	SK	Inspection Side
3075	85	23.46	32.44	0.61	0.44	65	Metal Loss	TBit	SK	Inspection Side
3076	85	62.36	209.49	1.01	0.40	65	Metal Loss	TBit	SK	Inspection Side
3077	85	60.24	18.35	1.35	0.36	65	Metal Loss	TBit	SK	Inspection Side
3078	85	58.07	193.78	0.62	0.28	66	Metal Loss	TBit	SK	Non Inspection Side
3079	85	18.46	22.20	1.01	0.29	66	Metal Loss	TBit	SK	Inspection Side
3080	85	62.20	52.68	1.12	0.33	66	Metal Loss	TBit	SK	Inspection Side
3081	85	30.51	71.93	1.27	0.77	66	Metal Loss	TBit	SK	Inspection Side
3082	85	61.46	62.36	0.99	0.73	67	Metal Loss	TBit	SK	Inspection Side
3083	85	62.20	132.83	1.16	0.30	67	Metal Loss	TBit	SK	Inspection Side
3084	85	16.97	196.50	1.27	0.60	67	Metal Loss	TBit	SK	Inspection Side
3085	85	8.82	171.14	0.61	0.46	68	Metal Loss	TBit	SK	Inspection Side
3086	85	62.24	111.22	1.19	0.73	68	Metal Loss	TBit	SK	Inspection Side
3087	85	29.84	21.57	0.90	0.39	69	Metal Loss	TBit	SK	Inspection Side
3088	85	58.70	147.99	0.94	0.47	69	Metal Loss	TBit	SK	Non Inspection Side
3089	85	59.61	29.02	1.16	0.69	69	Metal Loss	TBit	SK	Inspection Side
3090	85	18.03	223.90	0.63	0.44	70	Metal Loss	TBit	SK	Inspection Side
3091	85	7.24	87.60	1.00	0.41	70	Metal Loss	TBit	SK	Inspection Side
3092	85	32.17	26.89	1.13	0.45	71	Metal Loss	TBit	SK	Inspection Side
3093	85	45.75	53.66	1.25	0.49	71	Metal Loss	TBit	SK	Inspection Side
3094	85	59.17	42.72	1.61	0.51	72	Metal Loss	TBit	SK	Inspection Side
3095	85	17.68	104.37	1.11	0.31	73	Metal Loss	TBit	SK	Inspection Side
3096	85	32.48	92.72	1.27	0.31	73	Metal Loss	TBit	SK	Inspection Side
3097	85	55.08	128.70	1.81	0.93	73	Metal Loss	TBit	SK	Inspection Side
3098	85	22.44	94.72	1.10	0.34	74	Metal Loss	TBit	SK	Inspection Side
3099	85	32.48	183.94	1.29	0.34	74	Metal Loss	TBit	SK	Inspection Side
3100	85	9.45	111.10	0.64	0.40	75	Metal Loss	TBit	SK	Inspection Side
3101	85	57.68	175.98	0.68	0.38	75	Metal Loss	TBit	SK	Inspection Side
3102	85	19.25	13.19	1.74	0.77	75	Metal Loss	TBit	SK	Inspection Side
3103	85	19.57	189.45	0.89	0.38	76	Metal Loss	TBit	SK	Inspection Side
3104	85	45.63	125.55	1.01	0.50	76	Metal Loss	TBit	SK	Inspection Side
3105	85	17.36	132.52	1.01	0.32	78	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3106	85	62.28	28.07	1.16	0.44	78	Metal Loss	TBit	SK	Inspection Side
3107	85	20.28	166.38	0.56	0.30	79	Metal Loss	TBit	SK	Inspection Side
3108	85	17.28	143.15	0.92	0.35	79	Metal Loss	TBit	SK	Inspection Side
3109	85	25.75	71.14	1.10	0.60	79	Metal Loss	TBit	SK	Inspection Side
3110	85	31.30	18.78	1.14	0.30	80	Metal Loss	TBit	SK	Inspection Side
3111	85	60.20	188.11	1.15	0.74	80	Metal Loss	TBit	SK	Inspection Side
3112	85	59.09	145.43	0.98	0.33	82	Metal Loss	TBit	SK	Inspection Side
3113	85	18.66	99.21	0.68	0.38	85	Metal Loss	TBit	SK	Inspection Side
3114	85	59.61	11.93	2.23	0.55	87	Metal Loss	TBit	SK	Inspection Side
3115	85	18.03	177.40	1.03	0.34	88	Metal Loss	TBit	SK	Inspection Side
3116	85	45.75	40.55	1.23	0.32	88	Metal Loss	TBit	SK	Inspection Side
3117	85	59.61	39.02	0.69	0.39	89	Metal Loss	TBit	SK	Inspection Side
3118	85	59.69	59.37	1.46	0.45	89	Metal Loss	TBit	SK	Inspection Side
3119	85	17.17	69.13	1.16	0.37	92	Metal Loss	TBit	SK	Inspection Side
3120	85	22.28	90.94	0.88	0.37	96	Metal Loss	TBit	SK	Inspection Side
3121	85	18.07	79.37	0.97	0.39	97	Metal Loss	TBit	SK	Inspection Side
3122	85	17.87	107.95	1.18	0.41	97	Metal Loss	TBit	SK	Inspection Side
3123	85	19.69	128.70	1.21	0.43	97	Metal Loss	TBit	SK	Inspection Side
3124	85	21.97	16.50	1.22	0.44	97	Metal Loss	TBit	SK	Inspection Side
3125	85	23.07	41.26	1.38	0.56	97	Metal Loss	TBit	SK	Inspection Side
3126	85	18.39	76.57	1.64	0.40	97	Metal Loss	TBit	SK	Inspection Side
3127	85	16.10	27.09	1.40	0.79	98	Metal Loss	TBit	SK	Inspection Side
3128	86	24.21	144.49	0.43	0.37	49	Metal Loss	TBit	SK	Inspection Side
3129	86	28.78	66.65	0.53	0.44	49	Metal Loss	TBit	SK	Inspection Side
3130	86	60.71	134.02	0.57	0.41	49	Metal Loss	TBit	SK	Inspection Side
3131	86	57.68	78.11	0.66	0.46	49	Metal Loss	TBit	SK	Inspection Side
3132	86	29.61	197.05	0.68	0.50	49	Metal Loss	TBit	SK	Inspection Side
3133	86	62.60	41.97	0.81	0.42	49	Metal Loss	TBit	SK	Inspection Side
3134	86	30.24	138.19	0.90	1.03	49	Metal Loss	TBit	SK	Inspection Side
3135	86	18.11	113.86	1.01	0.82	49	Metal Loss	TBit	SK	Inspection Side
3136	86	30.67	14.41	0.66	0.35	50	Metal Loss	TBit	SK	Inspection Side
3137	86	31.50	44.65	1.02	0.63	50	Metal Loss	TBit	SK	Inspection Side
3138	86	27.68	33.82	1.09	0.53	50	Metal Loss	TBit	SK	Inspection Side
3139	86	35.67	135.20	0.62	0.48	51	Metal Loss	TBit	SK	Inspection Side
3140	86	28.43	140.67	0.82	0.35	51	Metal Loss	TBit	SK	Inspection Side
3141	86	30.98	76.97	0.83	0.75	51	Metal Loss	TBit	SK	Inspection Side
3142	86	55.12	187.20	0.91	0.67	51	Metal Loss	TBit	SK	Non Inspection Side
3143	86	61.69	184.72	1.00	0.29	51	Metal Loss	TBit	SK	Inspection Side
3144	86	17.09	64.41	1.13	0.32	51	Metal Loss	TBit	SK	Inspection Side
3145	86	29.92	153.94	1.36	0.41	51	Metal Loss	TBit	SK	Inspection Side
3146	86	57.20	99.37	1.60	0.31	51	Metal Loss	TBit	SK	Inspection Side
3147	86	25.51	120.63	0.48	0.44	52	Metal Loss	TBit	SK	Inspection Side
3148	86	21.61	118.54	0.66	0.54	52	Metal Loss	TBit	SK	Inspection Side
3149	86	15.83	39.69	0.92	0.38	52	Metal Loss	TBit	SK	Inspection Side
3150	86	32.24	152.64	1.25	0.27	52	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3151	86	22.17	36.61	2.11	0.60	52	Metal Loss	TBit	SK	Inspection Side
3152	86	55.71	78.35	0.70	0.42	53	Metal Loss	TBit	SK	Inspection Side
3153	86	30.12	183.70	0.86	0.43	53	Metal Loss	TBit	SK	Inspection Side
3154	86	51.54	203.35	0.97	0.41	53	Metal Loss	TBit	SK	Inspection Side
3155	86	15.79	80.08	1.14	0.29	53	Metal Loss	TBit	SK	Inspection Side
3156	86	25.71	189.96	0.27	0.47	54	Metal Loss	TBit	SK	Inspection Side
3157	86	56.57	194.33	0.49	0.43	54	Metal Loss	TBit	SK	Inspection Side
3158	86	30.24	106.30	0.64	0.27	54	Metal Loss	TBit	SK	Inspection Side
3159	86	32.20	33.90	1.21	0.82	54	Metal Loss	TBit	SK	Inspection Side
3160	86	29.88	81.02	1.53	0.36	54	Metal Loss	TBit	SK	Inspection Side
3161	86	30.24	94.09	1.05	0.62	55	Metal Loss	TBit	SK	Inspection Side
3162	86	40.75	167.40	1.31	0.40	55	Metal Loss	TBit	SK	Inspection Side
3163	86	25.20	127.83	1.17	0.42	56	Metal Loss	TBit	SK	Inspection Side
3164	86	15.83	99.09	1.38	0.38	56	Metal Loss	TBit	SK	Inspection Side
3165	86	27.05	44.96	0.57	0.37	57	Metal Loss	TBit	SK	Inspection Side
3166	86	48.66	203.58	0.60	0.30	58	Metal Loss	TBit	SK	Inspection Side
3167	86	25.47	112.99	0.77	0.32	58	Metal Loss	TBit	SK	Inspection Side
3168	86	15.79	48.78	1.26	0.40	58	Metal Loss	TBit	SK	Inspection Side
3169	86	30.24	164.21	0.73	0.26	59	Metal Loss	TBit	SK	Inspection Side
3170	86	28.27	186.18	0.88	0.33	59	Metal Loss	TBit	SK	Inspection Side
3171	86	29.41	163.07	1.29	0.85	59	Metal Loss	TBit	SK	Inspection Side
3172	86	15.75	202.99	0.50	0.39	60	Metal Loss	TBit	SK	Inspection Side
3173	86	25.47	184.37	0.66	0.38	60	Metal Loss	TBit	SK	Inspection Side
3174	86	28.07	113.90	0.67	0.34	60	Metal Loss	TBit	SK	Inspection Side
3175	86	27.09	110.55	0.72	0.35	60	Metal Loss	TBit	SK	Inspection Side
3176	86	32.20	89.25	1.05	0.47	60	Metal Loss	TBit	SK	Inspection Side
3177	86	31.10	15.87	0.70	0.37	61	Metal Loss	TBit	SK	Inspection Side
3178	86	25.98	12.91	1.50	0.53	61	Metal Loss	TBit	SK	Inspection Side
3179	86	30.24	99.45	0.71	0.27	62	Metal Loss	TBit	SK	Inspection Side
3180	86	15.79	44.25	1.29	0.34	62	Metal Loss	TBit	SK	Inspection Side
3181	86	29.61	167.28	0.71	0.31	63	Metal Loss	TBit	SK	Inspection Side
3182	86	22.60	120.63	0.76	0.45	63	Metal Loss	TBit	SK	Inspection Side
3183	86	31.89	63.94	0.86	0.29	63	Metal Loss	TBit	SK	Inspection Side
3184	86	30.24	100.63	0.71	0.30	65	Metal Loss	TBit	SK	Inspection Side
3185	86	46.38	200.39	1.32	0.31	65	Metal Loss	TBit	SK	Inspection Side
3186	86	38.07	141.54	0.36	0.38	68	Metal Loss	TBit	SK	Inspection Side
3187	86	32.17	102.40	1.11	0.47	72	Metal Loss	TBit	SK	Inspection Side
3188	86	15.79	57.44	1.32	0.89	89	Metal Loss	TBit	SK	Inspection Side
3189	86	25.00	160.51	2.03	0.63	89	Metal Loss	TBit	SK	Inspection Side
3190	86	25.00	158.94	0.79	0.49	97	Metal Loss	TBit	SK	Inspection Side
3191	86	26.89	188.90	0.94	0.68	97	Metal Loss	TBit	SK	Inspection Side
3192	86	30.24	26.73	1.32	0.67	98	Metal Loss	TBit	SK	Inspection Side
3193	87	33.31	115.63	1.02	0.79	49	Metal Loss	TBit	SK	Inspection Side
3194	87	47.80	140.20	0.43	0.34	50	Metal Loss	TBit	SK / CA	Inspection Side
3195	87	56.73	43.74	0.59	0.70	50	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3196	87	59.92	13.19	0.67	0.41	50	Metal Loss	TBit	SK	Non Inspection Side
3197	87	45.87	7.40	0.53	0.45	51	Metal Loss	TBit	SK	Inspection Side
3198	87	30.94	55.43	0.63	0.22	51	Metal Loss	TBit	SK	Inspection Side
3199	87	50.59	142.32	0.69	0.50	51	Metal Loss	TBit	SK / CA	Inspection Side
3200	87	32.20	84.41	1.19	0.21	51	Metal Loss	TBit	SK	Inspection Side
3201	87	32.09	45.28	1.45	0.29	51	Metal Loss	TBit	SK	Inspection Side
3202	87	26.85	72.40	0.87	0.47	52	Metal Loss	TBit	SK	Inspection Side
3203	87	30.08	64.61	0.95	0.77	52	Metal Loss	TBit	SK	Inspection Side
3204	87	5.43	35.04	0.46	0.32	53	Metal Loss	TBit	SK	Inspection Side
3205	87	19.53	156.02	0.71	0.45	53	Metal Loss	TBit	SK / CA	Inspection Side
3206	87	47.76	42.56	0.76	0.51	53	Metal Loss	TBit	SK	Inspection Side
3207	87	29.88	14.17	0.80	0.43	53	Metal Loss	TBit	SK	Non Inspection Side
3208	87	52.64	45.39	0.57	0.38	54	Metal Loss	TBit	SK	Inspection Side
3209	87	49.92	68.78	0.66	0.54	54	Metal Loss	TBit	SK	Inspection Side
3210	87	30.43	135.00	0.74	0.41	54	Metal Loss	TBit	SK	Inspection Side
3211	87	29.25	35.47	0.88	0.50	54	Metal Loss	TBit	SK	Inspection Side
3212	87	32.13	61.18	1.09	0.64	54	Metal Loss	TBit	SK	Inspection Side
3213	87	32.05	89.88	1.14	0.27	54	Metal Loss	TBit	SK	Inspection Side
3214	87	60.83	35.51	1.26	0.48	54	Metal Loss	TBit	SK	Inspection Side
3215	87	48.11	71.14	1.26	0.72	54	Metal Loss	TBit	SK	Inspection Side
3216	87	60.83	46.14	1.77	0.96	54	Metal Loss	TBit	SK	Inspection Side
3217	87	25.87	114.49	0.78	0.51	55	Metal Loss	TBit	SK	Inspection Side
3218	87	27.91	148.58	0.54	0.35	56	Metal Loss	TBit	SK / CA	Inspection Side
3219	87	29.13	53.94	0.54	0.32	57	Metal Loss	TBit	SK	Inspection Side
3220	87	19.41	157.83	0.92	0.49	57	Metal Loss	TBit	SK / CA	Inspection Side
3221	87	32.13	84.57	1.10	0.40	57	Metal Loss	TBit	SK	Inspection Side
3222	87	31.65	134.80	0.94	0.39	58	Metal Loss	TBit	SK	Inspection Side
3223	87	39.21	71.85	0.61	0.54	59	Metal Loss	TBit	SK	Inspection Side
3224	87	54.61	47.28	0.83	0.50	59	Metal Loss	TBit	SK	Non Inspection Side
3225	87	53.58	64.88	0.71	0.63	60	Metal Loss	TBit	SK	Non Inspection Side
3226	87	59.92	135.75	0.60	0.31	61	Metal Loss	TBit	SK / CA	Inspection Side
3227	87	28.23	51.54	1.00	0.42	61	Metal Loss	TBit	SK	Inspection Side
3228	87	30.67	86.46	2.11	0.73	61	Metal Loss	TBit	SK	Inspection Side
3229	87	49.21	12.20	0.94	0.54	62	Metal Loss	TBit	SK	Inspection Side
3230	87	29.13	89.84	0.77	0.36	65	Metal Loss	TBit	SK	Inspection Side
3231	87	18.23	154.72	0.42	0.35	66	Metal Loss	TBit	SK / CA	Inspection Side
3232	87	30.08	105.08	0.86	0.36	68	Metal Loss	TBit	SK	Inspection Side
3233	87	53.90	43.43	1.12	0.39	68	Metal Loss	TBit	SK	Inspection Side
3234	87	27.56	133.46	0.67	0.49	69	Metal Loss	TBit	SK	Inspection Side
3235	87	26.85	85.51	0.88	0.39	69	Metal Loss	TBit	SK	Inspection Side
3236	87	32.28	116.06	1.04	0.64	70	Metal Loss	TBit	SK	Inspection Side
3237	87	38.78	71.14	1.24	0.57	70	Metal Loss	TBit	SK	Inspection Side
3238	87	29.76	56.02	1.28	0.49	76	Metal Loss	TBit	SK	Inspection Side
3239	87	29.65	73.35	0.99	0.37	88	Metal Loss	TBit	SK	Inspection Side
3240	87	53.82	50.75	1.28	0.42	95	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3241	87	29.84	31.93	1.03	0.62	97	Metal Loss	TBit	SK	Inspection Side
3242	87	30.98	94.57	1.39	0.86	97	Metal Loss	TBit	SK	Inspection Side
3243	87	50.04	17.44	0.56	1.46	98	Metal Loss	TBit	SK	Inspection Side
3244	88	30.79	48.66	0.96	0.36	56	Metal Loss	TBit	SK	Inspection Side
3245	88	19.69	60.20	0.91	0.30	57	Metal Loss	TBit	SK	Inspection Side
3246	88	16.42	52.80	1.09	0.41	57	Metal Loss	TBit	SK	Inspection Side
3247	88	25.20	43.39	0.94	0.46	70	Metal Loss	TBit	SK	Inspection Side
3248	89	13.27	148.46	0.24	0.31	49	Metal Loss	TBit	SK	Non Inspection Side
3249	89	52.87	169.80	0.39	0.31	49	Metal Loss	TBit	SK	Inspection Side
3250	89	3.94	107.36	0.61	0.54	49	Metal Loss	TBit	SK	Inspection Side
3251	89	60.51	152.32	0.66	0.42	49	Metal Loss	TBit	SK	Inspection Side
3252	89	60.51	155.43	0.67	0.33	49	Metal Loss	TBit	SK	Inspection Side
3253	89	11.54	167.17	0.72	0.45	49	Metal Loss	TBit	SK	Inspection Side
3254	89	54.92	202.87	0.78	0.42	49	Metal Loss	TBit	SK	Inspection Side
3255	89	44.72	79.33	0.90	0.65	49	Metal Loss	TBit	SK	Non Inspection Side
3256	89	35.31	199.33	0.95	0.80	49	Metal Loss	TBit	SK	Inspection Side
3257	89	56.61	202.60	0.95	0.38	49	Metal Loss	TBit	SK	Inspection Side
3258	89	24.09	202.99	0.98	0.32	49	Metal Loss	TBit	SK	Inspection Side
3259	89	42.01	97.28	1.01	0.39	49	Metal Loss	TBit	SK	Inspection Side
3260	89	65.91	157.44	1.05	0.46	49	Metal Loss	TBit	SK	Inspection Side
3261	89	38.23	236.22	1.09	0.62	49	Metal Loss	TBit	SK	Inspection Side
3262	89	19.88	28.82	1.32	0.29	49	Metal Loss	TBit	SK	Inspection Side
3263	89	41.73	189.61	1.32	0.65	49	Metal Loss	TBit	SK	Inspection Side
3264	89	17.20	171.93	1.48	0.30	49	Metal Loss	TBit	SK	Inspection Side
3265	89	65.47	138.94	0.53	0.30	50	Metal Loss	TBit	SK	Non Inspection Side
3266	89	50.51	180.43	0.54	0.44	50	Metal Loss	TBit	SK	Inspection Side
3267	89	36.89	205.08	0.77	0.50	50	Metal Loss	TBit	SK	Inspection Side
3268	89	61.14	24.92	0.80	0.43	50	Metal Loss	TBit	SK	Inspection Side
3269	89	38.62	236.26	0.85	0.56	50	Metal Loss	TBit	SK	Inspection Side
3270	89	60.12	93.43	0.85	0.38	50	Metal Loss	TBit	SK	Inspection Side
3271	89	14.76	175.04	0.92	0.66	50	Metal Loss	TBit	SK	Non Inspection Side
3272	89	13.66	182.28	0.97	1.85	50	Metal Loss	TBit	SK	Non Inspection Side
3273	89	17.72	92.17	1.10	0.54	50	Metal Loss	TBit	SK	Non Inspection Side
3274	89	36.50	204.13	1.12	0.47	50	Metal Loss	TBit	SK	Inspection Side
3275	89	7.72	53.90	1.14	0.38	50	Metal Loss	TBit	SK	Inspection Side
3276	89	59.33	116.34	1.38	0.81	50	Metal Loss	TBit	SK	Inspection Side
3277	89	6.73	24.21	1.67	0.61	50	Metal Loss	TBit	SK	Inspection Side
3278	89	53.78	17.13	2.12	1.60	50	Metal Loss	TBit	SK	Non Inspection Side
3279	89	32.87	214.76	0.12	0.21	51	Metal Loss	TBit	SK	Inspection Side
3280	89	18.98	64.37	0.56	0.56	51	Metal Loss	TBit	SK	Inspection Side
3281	89	19.17	114.17	0.57	0.42	51	Metal Loss	TBit	SK	Inspection Side
3282	89	7.83	15.59	0.64	0.30	51	Metal Loss	TBit	SK	Inspection Side
3283	89	3.98	25.47	0.65	0.44	51	Metal Loss	TBit	SK	Inspection Side
3284	89	43.35	176.97	0.89	1.14	51	Metal Loss	TBit	SK	Inspection Side
3285	89	43.23	137.76	0.92	0.77	51	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3286	89	3.43	17.80	0.96	0.45	51	Metal Loss	TBit	SK	Inspection Side
3287	89	61.50	204.72	1.05	0.50	51	Metal Loss	TBit	SK	Inspection Side
3288	89	52.52	66.89	1.14	0.30	51	Metal Loss	TBit	SK	Inspection Side
3289	89	17.80	86.46	1.18	0.31	51	Metal Loss	TBit	SK	Inspection Side
3290	89	44.61	115.39	1.25	0.35	51	Metal Loss	TBit	SK	Inspection Side
3291	89	1.34	26.77	1.29	1.39	51	Metal Loss	TBit	SK	Non Inspection Side
3292	89	52.52	173.03	1.42	0.65	51	Metal Loss	TBit	SK	Inspection Side
3293	89	60.39	11.54	1.45	0.69	51	Metal Loss	TBit	SK	Inspection Side
3294	89	69.72	21.38	1.49	1.73	51	Metal Loss	TBit	SK	Non Inspection Side
3295	89	30.00	169.72	1.77	0.53	51	Metal Loss	TBit	SK	Non Inspection Side
3296	89	66.89	110.04	2.21	0.50	51	Metal Loss	TBit	SK	Inspection Side
3297	89	51.73	191.18	0.27	0.30	52	Metal Loss	TBit	SK	Inspection Side
3298	89	37.48	13.03	0.60	0.61	52	Metal Loss	TBit	SK	Non Inspection Side
3299	89	53.31	229.06	0.87	0.70	52	Metal Loss	TBit	SK	Inspection Side
3300	89	34.96	199.65	0.88	0.47	52	Metal Loss	TBit	SK	Inspection Side
3301	89	38.86	192.13	1.25	0.72	52	Metal Loss	TBit	SK	Inspection Side
3302	89	43.43	180.24	1.69	0.63	52	Metal Loss	TBit	SK	Inspection Side
3303	89	34.06	181.93	1.90	0.57	52	Metal Loss	TBit	SK	Inspection Side
3304	89	32.68	194.25	2.21	0.52	52	Metal Loss	TBit	SK	Inspection Side
3305	89	21.10	168.19	0.44	0.41	53	Metal Loss	TBit	SK	Inspection Side
3306	89	16.89	33.03	0.57	0.48	53	Metal Loss	TBit	SK	Inspection Side
3307	89	55.35	90.20	0.58	0.49	53	Metal Loss	TBit	SK	Inspection Side
3308	89	5.24	216.10	0.65	0.40	53	Metal Loss	TBit	SK	Inspection Side
3309	89	39.76	87.24	0.71	0.47	53	Metal Loss	TBit	SK	Inspection Side
3310	89	46.65	32.36	0.75	0.37	53	Metal Loss	TBit	SK	Inspection Side
3311	89	45.31	126.69	0.77	0.35	53	Metal Loss	TBit	SK	Inspection Side
3312	89	32.44	116.69	0.79	0.31	53	Metal Loss	TBit	SK	Inspection Side
3313	89	50.59	196.30	0.85	0.42	53	Metal Loss	TBit	SK	Inspection Side
3314	89	31.10	12.20	0.92	1.59	53	Metal Loss	TBit	SK	Non Inspection Side
3315	89	31.93	82.40	0.95	0.54	53	Metal Loss	TBit	SK	Inspection Side
3316	89	43.50	27.87	1.13	0.41	53	Metal Loss	TBit	SK	Inspection Side
3317	89	30.20	178.46	1.32	0.57	53	Metal Loss	TBit	SK	Inspection Side
3318	89	4.33	215.47	1.35	1.56	53	Metal Loss	TBit	SK	Inspection Side
3319	89	3.66	63.74	1.52	0.48	53	Metal Loss	TBit	SK	Inspection Side
3320	89	29.84	69.13	0.43	0.42	54	Metal Loss	TBit	SK	Inspection Side
3321	89	19.49	141.10	0.53	0.39	54	Metal Loss	TBit	SK	Inspection Side
3322	89	62.80	153.15	0.54	0.80	54	Metal Loss	TBit	SK	Non Inspection Side
3323	89	58.50	100.83	0.54	0.35	54	Metal Loss	TBit	SK	Inspection Side
3324	89	58.43	153.62	0.60	0.49	54	Metal Loss	TBit	SK	Inspection Side
3325	89	44.02	139.57	0.80	0.61	54	Metal Loss	TBit	SK	Inspection Side
3326	89	26.89	205.51	1.05	0.50	54	Metal Loss	TBit	SK	Inspection Side
3327	89	54.13	97.13	1.13	0.44	54	Metal Loss	TBit	SK	Non Inspection Side
3328	89	58.58	142.20	1.19	0.74	54	Metal Loss	TBit	SK	Inspection Side
3329	89	2.83	20.39	1.28	0.78	54	Metal Loss	TBit	SK	Inspection Side
3330	89	55.20	156.81	1.32	0.46	54	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3331	89	55.98	155.04	1.35	0.76	54	Metal Loss	TBit	SK	Inspection Side
3332	89	39.96	209.61	0.44	0.33	55	Metal Loss	TBit	SK	Inspection Side
3333	89	24.09	155.43	0.60	0.37	55	Metal Loss	TBit	SK	Inspection Side
3334	89	10.43	132.44	0.60	0.51	55	Metal Loss	TBit	SK	Inspection Side
3335	89	54.61	181.93	0.65	0.52	55	Metal Loss	TBit	SK	Inspection Side
3336	89	34.33	201.02	0.83	0.47	55	Metal Loss	TBit	SK	Inspection Side
3337	89	8.94	154.92	0.90	3.35	55	Metal Loss	TBit	SK	Non Inspection Side
3338	89	24.84	218.46	0.94	0.37	55	Metal Loss	TBit	SK	Inspection Side
3339	89	16.73	173.07	1.19	0.54	55	Metal Loss	TBit	SK	Inspection Side
3340	89	15.94	168.98	1.46	0.77	55	Metal Loss	TBit	SK	Inspection Side
3341	89	57.95	9.33	0.74	0.41	56	Metal Loss	TBit	SK	Non Inspection Side
3342	89	11.14	205.71	0.79	2.71	56	Metal Loss	TBit	SK	Non Inspection Side
3343	89	60.47	217.68	0.80	0.52	56	Metal Loss	TBit	SK	Inspection Side
3344	89	14.33	150.04	0.88	0.41	56	Metal Loss	TBit	SK	Inspection Side
3345	89	45.08	218.15	0.88	0.29	56	Metal Loss	TBit	SK	Inspection Side
3346	89	42.32	116.26	1.03	0.52	56	Metal Loss	TBit	SK	Inspection Side
3347	89	14.33	176.38	1.07	0.78	56	Metal Loss	TBit	SK	Inspection Side
3348	89	6.93	38.39	1.11	0.45	56	Metal Loss	TBit	SK	Inspection Side
3349	89	45.43	153.58	1.22	0.41	56	Metal Loss	TBit	SK	Inspection Side
3350	89	60.91	55.91	1.24	0.78	56	Metal Loss	TBit	SK	Inspection Side
3351	89	21.69	175.43	1.30	0.85	56	Metal Loss	TBit	SK	Inspection Side
3352	89	38.66	72.24	1.35	0.31	56	Metal Loss	TBit	SK	Non Inspection Side
3353	89	43.70	77.24	1.51	0.69	56	Metal Loss	TBit	SK	Inspection Side
3354	89	30.83	85.55	1.69	1.11	56	Metal Loss	TBit	SK	Inspection Side
3355	89	37.24	12.40	0.48	0.36	57	Metal Loss	TBit	SK	Inspection Side
3356	89	38.70	140.08	0.70	0.44	57	Metal Loss	TBit	SK	Inspection Side
3357	89	3.03	83.90	0.86	0.46	57	Metal Loss	TBit	SK	Inspection Side
3358	89	63.19	8.39	0.95	0.35	57	Metal Loss	TBit	SK	Inspection Side
3359	89	21.38	210.79	1.00	0.31	57	Metal Loss	TBit	SK	Inspection Side
3360	89	39.53	196.93	1.12	0.66	57	Metal Loss	TBit	SK	Inspection Side
3361	89	11.73	87.60	1.14	0.48	57	Metal Loss	TBit	SK	Inspection Side
3362	89	32.05	192.13	1.25	0.32	57	Metal Loss	TBit	SK	Inspection Side
3363	89	46.50	147.99	2.37	0.46	57	Metal Loss	TBit	SK	Non Inspection Side
3364	89	38.19	5.00	0.45	0.39	58	Metal Loss	TBit	SK	Inspection Side
3365	89	58.43	208.58	0.77	0.51	58	Metal Loss	TBit	SK	Inspection Side
3366	89	46.30	219.57	0.99	0.65	58	Metal Loss	TBit	SK	Inspection Side
3367	89	36.34	204.29	1.17	0.50	58	Metal Loss	TBit	SK	Inspection Side
3368	89	61.61	84.65	1.28	0.65	58	Metal Loss	TBit	SK	Inspection Side
3369	89	53.46	221.26	1.48	0.89	58	Metal Loss	TBit	SK	Non Inspection Side
3370	89	32.32	194.45	1.85	0.33	58	Metal Loss	TBit	SK	Inspection Side
3371	89	38.03	105.43	2.05	0.47	58	Metal Loss	TBit	SK	Inspection Side
3372	89	55.59	121.61	0.65	0.42	59	Metal Loss	TBit	SK	Inspection Side
3373	89	19.21	139.45	0.67	0.41	59	Metal Loss	TBit	SK	Inspection Side
3374	89	64.88	121.93	0.68	0.40	59	Metal Loss	TBit	SK	Inspection Side
3375	89	17.99	172.48	0.77	0.46	59	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3376	89	3.43	97.13	0.99	0.44	59	Metal Loss	TBit	SK	Inspection Side
3377	89	6.06	224.61	1.00	0.46	59	Metal Loss	TBit	SK	Inspection Side
3378	89	31.26	144.45	1.07	0.78	59	Metal Loss	TBit	SK	Non Inspection Side
3379	89	54.02	59.80	2.57	0.55	59	Metal Loss	TBit	SK	Inspection Side
3380	89	4.96	83.70	0.51	0.28	60	Metal Loss	TBit	SK	Non Inspection Side
3381	89	8.94	62.91	0.52	0.40	60	Metal Loss	TBit	SK	Inspection Side
3382	89	40.39	12.72	0.56	0.51	60	Metal Loss	TBit	SK	Inspection Side
3383	89	16.61	9.21	0.70	0.42	60	Metal Loss	TBit	SK	Inspection Side
3384	89	41.02	198.31	0.75	0.40	60	Metal Loss	TBit	SK	Inspection Side
3385	89	14.57	25.63	0.77	0.36	60	Metal Loss	TBit	SK	Non Inspection Side
3386	89	4.84	60.71	1.47	0.67	60	Metal Loss	TBit	SK	Inspection Side
3387	89	39.96	182.32	1.58	0.36	60	Metal Loss	TBit	SK	Inspection Side
3388	89	20.67	129.45	0.46	0.37	61	Metal Loss	TBit	SK	Inspection Side
3389	89	15.83	171.50	0.58	0.30	61	Metal Loss	TBit	SK	Inspection Side
3390	89	62.68	119.76	2.00	0.93	61	Metal Loss	TBit	SK	Inspection Side
3391	89	6.81	132.28	0.54	0.40	62	Metal Loss	TBit	SK	Inspection Side
3392	89	33.74	210.24	0.89	0.48	62	Metal Loss	TBit	SK	Inspection Side
3393	89	32.60	157.17	0.97	0.31	62	Metal Loss	TBit	SK	Inspection Side
3394	89	17.76	68.07	1.00	0.23	62	Metal Loss	TBit	SK	Inspection Side
3395	89	18.23	209.02	1.22	0.47	62	Metal Loss	TBit	SK	Inspection Side
3396	89	30.20	16.89	1.38	0.46	62	Metal Loss	TBit	SK	Inspection Side
3397	89	4.25	235.94	0.53	0.40	63	Metal Loss	TBit	SK	Inspection Side
3398	89	34.41	200.83	0.74	0.61	63	Metal Loss	TBit	SK	Inspection Side
3399	89	40.04	150.87	1.88	0.64	63	Metal Loss	TBit	SK	Inspection Side
3400	89	28.27	211.02	0.46	0.32	64	Metal Loss	TBit	SK	Inspection Side
3401	89	13.94	81.54	0.72	0.44	64	Metal Loss	TBit	SK	Inspection Side
3402	89	61.26	24.33	0.96	0.43	64	Metal Loss	TBit	SK	Inspection Side
3403	89	53.39	103.70	1.30	0.61	64	Metal Loss	TBit	SK	Inspection Side
3404	89	57.09	112.28	1.37	0.26	64	Metal Loss	TBit	SK	Inspection Side
3405	89	10.75	28.78	1.13	0.51	65	Metal Loss	TBit	SK	Inspection Side
3406	89	10.28	230.63	0.97	0.33	66	Metal Loss	TBit	SK	Inspection Side
3407	89	30.94	153.35	1.95	0.66	66	Metal Loss	TBit	SK	Non Inspection Side
3408	89	41.57	182.72	2.12	0.41	66	Metal Loss	TBit	SK	Inspection Side
3409	89	28.78	211.38	0.48	0.32	67	Metal Loss	TBit	SK	Inspection Side
3410	89	42.56	217.24	0.57	0.37	67	Metal Loss	TBit	SK	Inspection Side
3411	89	60.98	57.91	1.09	0.18	67	Metal Loss	TBit	SK	Inspection Side
3412	89	46.61	77.05	2.16	0.77	67	Metal Loss	TBit	SK	Non Inspection Side
3413	89	50.12	239.29	0.62	0.39	68	Metal Loss	TBit	SK	Inspection Side
3414	89	13.78	178.03	1.24	0.79	68	Metal Loss	TBit	SK	Non Inspection Side
3415	89	45.31	217.05	0.71	0.36	69	Metal Loss	TBit	SK	Inspection Side
3416	89	67.17	198.15	1.02	0.65	69	Metal Loss	TBit	SK	Inspection Side
3417	89	47.09	209.92	1.24	0.34	69	Metal Loss	TBit	SK	Inspection Side
3418	89	38.50	218.54	0.51	0.34	70	Metal Loss	TBit	SK	Inspection Side
3419	89	37.91	217.01	0.86	0.57	70	Metal Loss	TBit	SK	Inspection Side
3420	89	35.63	151.50	0.91	0.59	70	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3421	89	39.96	78.98	0.86	0.60	71	Metal Loss	TBit	SK	Inspection Side
3422	89	39.53	92.44	0.83	0.38	72	Metal Loss	TBit	SK	Inspection Side
3423	89	61.10	27.64	1.22	0.60	72	Metal Loss	TBit	SK	Inspection Side
3424	89	3.66	106.02	0.70	0.40	74	Metal Loss	TBit	SK	Inspection Side
3425	89	39.41	192.32	1.67	0.46	74	Metal Loss	TBit	SK	Inspection Side
3426	89	46.77	115.12	1.88	0.65	74	Metal Loss	TBit	SK	Inspection Side
3427	89	61.61	91.42	1.35	0.58	75	Metal Loss	TBit	SK	Inspection Side
3428	89	46.97	115.08	1.47	0.60	75	Metal Loss	TBit	SK	Inspection Side
3429	89	67.80	103.07	1.83	0.42	75	Metal Loss	TBit	SK	Inspection Side
3430	89	45.08	215.94	0.78	0.47	76	Metal Loss	TBit	SK	Inspection Side
3431	89	66.50	14.65	2.38	0.47	76	Metal Loss	TBit	SK	Inspection Side
3432	89	36.81	26.61	0.72	0.39	77	Metal Loss	TBit	SK	Inspection Side
3433	89	33.82	210.47	0.94	0.48	77	Metal Loss	TBit	SK	Inspection Side
3434	89	47.01	212.91	1.05	0.30	77	Metal Loss	TBit	SK	Inspection Side
3435	89	45.94	150.59	1.00	0.66	79	Metal Loss	TBit	SK	Inspection Side
3436	89	66.30	106.22	1.33	1.63	80	Metal Loss	TBit	SK	Non Inspection Side
3437	89	57.28	91.77	0.96	0.54	82	Metal Loss	TBit	SK	Inspection Side
3438	89	53.11	106.22	0.71	0.28	83	Metal Loss	TBit	SK	Inspection Side
3439	89	61.81	217.60	0.79	0.36	83	Metal Loss	TBit	SK	Inspection Side
3440	89	14.33	169.45	1.02	0.46	86	Metal Loss	TBit	SK	Inspection Side
3441	89	35.51	225.63	1.31	0.55	86	Metal Loss	TBit	SK	Inspection Side
3442	89	30.43	177.64	0.73	0.27	88	Metal Loss	TBit	SK	Inspection Side
3443	89	61.77	113.43	1.74	0.35	90	Metal Loss	TBit	SK	Inspection Side
3444	89	60.79	68.98	1.14	0.30	91	Metal Loss	TBit	SK	Inspection Side
3445	89	54.09	11.93	1.52	0.98	94	Metal Loss	TBit	SK	Inspection Side
3446	89	60.12	208.43	0.77	0.44	96	Metal Loss	TBit	SK	Inspection Side
3447	89	56.89	106.06	1.76	0.51	96	Metal Loss	TBit	SK	Inspection Side
3448	89	57.72	121.30	0.66	0.37	97	Metal Loss	TBit	SK	Inspection Side
3449	89	39.92	202.09	0.66	0.46	97	Metal Loss	TBit	SK	Inspection Side
3450	89	43.54	177.36	0.94	0.35	97	Metal Loss	TBit	SK	Inspection Side
3451	89	63.11	102.60	1.53	0.45	97	Metal Loss	TBit	SK	Inspection Side
3452	89	60.08	153.54	0.74	0.42	98	Metal Loss	TBit	SK	Inspection Side
3453	89	44.76	195.43	1.16	0.66	98	Metal Loss	TBit	SK	Inspection Side
3454	89	61.61	147.01	1.20	0.68	98	Metal Loss	TBit	SK	Inspection Side
3455	89	42.72	196.93	1.29	0.73	98	Metal Loss	TBit	SK	Inspection Side
3456	90	58.31	103.19	0.33	0.23	49	Metal Loss	TBit	SK	Inspection Side
3457	90	41.22	99.69	0.38	0.19	49	Metal Loss	TBit	SK	Inspection Side
3458	90	12.60	85.83	0.50	0.26	49	Metal Loss	TBit	SK	Inspection Side
3459	90	55.04	37.13	0.55	0.49	49	Metal Loss	TBit	SK	Inspection Side
3460	90	22.68	31.69	0.56	0.35	49	Metal Loss	TBit	SK	Inspection Side
3461	90	34.06	67.87	0.59	0.35	49	Metal Loss	TBit	SK	Inspection Side
3462	90	55.20	150.43	0.85	0.30	49	Metal Loss	TBit	SK	Inspection Side
3463	90	53.31	35.47	0.86	0.44	49	Metal Loss	TBit	SK	Inspection Side
3464	90	56.54	12.99	0.87	0.37	49	Metal Loss	TBit	SK	Inspection Side
3465	90	43.35	26.30	0.91	0.75	49	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3466	90	42.24	37.68	0.97	0.40	49	Metal Loss	TBit	SK	Inspection Side
3467	90	63.31	97.60	1.06	0.17	49	Metal Loss	TBit	SK	Inspection Side
3468	90	29.45	237.83	1.06	0.39	49	Metal Loss	TBit	SK	Inspection Side
3469	90	54.57	32.87	1.06	0.20	49	Metal Loss	TBit	SK	Inspection Side
3470	90	33.86	82.99	1.09	0.36	49	Metal Loss	TBit	SK	Inspection Side
3471	90	45.12	162.52	1.16	0.35	49	Metal Loss	TBit	SK	Non Inspection Side
3472	90	38.39	86.26	1.24	0.44	49	Metal Loss	TBit	SK	Inspection Side
3473	90	7.20	76.26	1.29	0.77	49	Metal Loss	TBit	SK	Inspection Side
3474	90	4.49	38.66	1.34	0.53	49	Metal Loss	TBit	SK	Inspection Side
3475	90	16.14	27.01	1.47	0.29	49	Metal Loss	TBit	SK	Inspection Side
3476	90	50.83	191.65	1.63	0.33	49	Metal Loss	TBit	SK	Inspection Side
3477	90	4.33	191.57	1.71	1.15	49	Metal Loss	TBit	SK	Inspection Side
3478	90	3.90	120.12	1.74	1.23	49	Metal Loss	TBit	SK	Inspection Side
3479	90	11.10	94.69	2.33	0.68	49	Metal Loss	TBit	SK	Inspection Side
3480	90	60.04	107.91	2.94	0.44	49	Metal Loss	TBit	SK	Inspection Side
3481	90	36.30	94.13	0.39	0.24	50	Metal Loss	TBit	SK	Inspection Side
3482	90	35.04	33.35	0.49	0.36	50	Metal Loss	TBit	SK	Inspection Side
3483	90	43.58	93.03	0.52	0.34	50	Metal Loss	TBit	SK	Inspection Side
3484	90	51.30	160.04	0.63	0.38	50	Metal Loss	TBit	SK	Inspection Side
3485	90	54.21	43.66	0.64	0.38	50	Metal Loss	TBit	SK	Inspection Side
3486	90	45.16	12.76	0.66	0.29	50	Metal Loss	TBit	SK	Inspection Side
3487	90	13.90	147.20	0.74	0.38	50	Metal Loss	TBit	SK	Inspection Side
3488	90	52.44	33.62	0.79	1.72	50	Metal Loss	TBit	SK	Non Inspection Side
3489	90	35.31	34.41	0.90	0.66	50	Metal Loss	TBit	SK	Inspection Side
3490	90	32.64	98.54	1.05	0.39	50	Metal Loss	TBit	SK	Inspection Side
3491	90	39.37	32.91	1.11	0.50	50	Metal Loss	TBit	SK	Inspection Side
3492	90	30.94	168.54	1.13	0.40	50	Metal Loss	TBit	SK	Inspection Side
3493	90	17.72	10.55	1.24	0.35	50	Metal Loss	TBit	SK	Inspection Side
3494	90	57.80	44.53	1.28	0.51	50	Metal Loss	TBit	SK	Inspection Side
3495	90	36.46	44.92	1.50	0.41	50	Metal Loss	TBit	SK	Inspection Side
3496	90	36.57	50.00	1.82	0.73	50	Metal Loss	TBit	SK	Inspection Side
3497	90	5.12	208.19	1.86	0.45	50	Metal Loss	TBit	SK	Non Inspection Side
3498	90	53.94	26.38	1.98	0.46	50	Metal Loss	TBit	SK	Inspection Side
3499	90	55.87	104.02	2.05	0.41	50	Metal Loss	TBit	SK	Inspection Side
3500	90	64.88	26.22	2.09	0.40	50	Metal Loss	TBit	SK	Inspection Side
3501	90	38.03	55.31	0.57	0.30	51	Metal Loss	TBit	SK	Inspection Side
3502	90	38.58	40.31	0.64	0.44	51	Metal Loss	TBit	SK	Inspection Side
3503	90	40.43	72.20	0.71	0.40	51	Metal Loss	TBit	SK	Inspection Side
3504	90	28.19	26.57	0.78	0.40	51	Metal Loss	TBit	SK	Inspection Side
3505	90	11.10	137.95	0.90	0.85	51	Metal Loss	TBit	SK	Inspection Side
3506	90	49.72	34.96	0.91	1.01	51	Metal Loss	TBit	SK	Inspection Side
3507	90	31.97	179.61	1.00	0.26	51	Metal Loss	TBit	SK	Inspection Side
3508	90	67.52	142.32	1.01	0.88	51	Metal Loss	TBit	SK	Inspection Side
3509	90	30.79	212.48	1.02	0.36	51	Metal Loss	TBit	SK	Inspection Side
3510	90	9.29	187.17	1.05	0.31	51	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3511	90	64.57	52.87	1.21	0.39	51	Metal Loss	TBit	SK	Inspection Side
3512	90	43.74	196.02	1.24	0.31	51	Metal Loss	TBit	SK	Inspection Side
3513	90	27.09	22.52	1.27	0.47	51	Metal Loss	TBit	SK	Inspection Side
3514	90	61.06	97.28	1.27	0.29	51	Metal Loss	TBit	SK	Inspection Side
3515	90	21.57	36.02	1.38	0.52	51	Metal Loss	TBit	SK	Inspection Side
3516	90	8.70	59.69	0.54	0.34	52	Metal Loss	TBit	SK	Inspection Side
3517	90	9.57	25.00	0.68	0.32	52	Metal Loss	TBit	SK	Inspection Side
3518	90	34.61	44.69	0.84	0.33	52	Metal Loss	TBit	SK	Inspection Side
3519	90	49.49	44.92	0.96	0.38	52	Metal Loss	TBit	SK	Inspection Side
3520	90	13.78	155.94	0.98	0.31	52	Metal Loss	TBit	SK	Inspection Side
3521	90	44.21	18.82	0.99	0.51	52	Metal Loss	TBit	SK	Inspection Side
3522	90	45.47	34.76	1.08	0.36	52	Metal Loss	TBit	SK	Inspection Side
3523	90	61.61	183.43	1.32	0.60	52	Metal Loss	TBit	SK	Inspection Side
3524	90	57.28	50.47	1.35	0.38	52	Metal Loss	TBit	SK	Inspection Side
3525	90	45.00	147.32	1.75	0.43	52	Metal Loss	TBit	SK	Inspection Side
3526	90	58.50	19.92	2.38	0.28	52	Metal Loss	TBit	SK	Inspection Side
3527	90	21.10	112.56	0.78	0.45	53	Metal Loss	TBit	SK	Inspection Side
3528	90	58.15	74.13	0.99	0.64	53	Metal Loss	TBit	SK	Inspection Side
3529	90	34.06	40.83	1.18	0.41	53	Metal Loss	TBit	SK	Inspection Side
3530	90	42.01	33.43	1.21	0.47	53	Metal Loss	TBit	SK	Inspection Side
3531	90	17.95	161.50	1.63	0.48	53	Metal Loss	TBit	SK	Inspection Side
3532	90	46.57	196.57	1.86	1.39	53	Metal Loss	TBit	SK	Inspection Side
3533	90	31.46	25.28	2.03	0.55	53	Metal Loss	TBit	SK	Inspection Side
3534	90	59.13	63.94	2.24	0.43	53	Metal Loss	TBit	SK	Inspection Side
3535	90	3.23	32.28	2.29	0.32	53	Metal Loss	TBit	SK	Inspection Side
3536	90	46.22	72.83	3.01	1.13	53	Metal Loss	TBit	SK	Non Inspection Side
3537	90	17.91	34.13	0.46	0.38	54	Metal Loss	TBit	SK	Inspection Side
3538	90	57.52	38.86	0.59	0.38	54	Metal Loss	TBit	SK	Inspection Side
3539	90	57.60	40.59	0.64	0.48	54	Metal Loss	TBit	SK	Inspection Side
3540	90	12.20	59.72	0.73	0.34	54	Metal Loss	TBit	SK	Inspection Side
3541	90	60.83	98.82	0.94	0.27	54	Metal Loss	TBit	SK	Inspection Side
3542	90	57.01	113.66	0.95	0.37	54	Metal Loss	TBit	SK	Inspection Side
3543	90	57.87	117.24	0.96	0.52	54	Metal Loss	TBit	SK	Inspection Side
3544	90	52.28	34.41	0.99	0.77	54	Metal Loss	TBit	SK	Inspection Side
3545	90	34.06	40.83	1.10	0.45	54	Metal Loss	TBit	SK	Inspection Side
3546	90	30.94	158.66	1.17	0.50	54	Metal Loss	TBit	SK	Inspection Side
3547	90	58.82	95.51	1.19	0.13	54	Metal Loss	TBit	SK	Inspection Side
3548	90	43.62	42.99	1.26	0.57	54	Metal Loss	TBit	SK	Inspection Side
3549	90	61.42	216.93	1.36	0.63	54	Metal Loss	TBit	SK	Inspection Side
3550	90	37.40	111.73	1.82	0.77	54	Metal Loss	TBit	SK	Inspection Side
3551	90	3.66	134.25	1.93	0.38	54	Metal Loss	TBit	SK	Inspection Side
3552	90	45.43	79.96	1.94	0.48	54	Metal Loss	TBit	SK	Inspection Side
3553	90	31.34	40.83	0.57	0.48	55	Metal Loss	TBit	SK	Inspection Side
3554	90	49.96	98.58	0.75	0.42	55	Metal Loss	TBit	SK	Inspection Side
3555	90	31.26	97.44	1.05	0.41	55	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3556	90	46.50	216.93	1.08	0.68	55	Metal Loss	TBit	SK	Inspection Side
3557	90	46.38	192.28	1.09	0.21	55	Metal Loss	TBit	SK	Inspection Side
3558	90	54.29	189.84	1.23	0.63	55	Metal Loss	TBit	SK	Inspection Side
3559	90	5.71	98.74	1.24	0.49	55	Metal Loss	TBit	SK	Inspection Side
3560	90	66.61	137.20	1.32	0.38	55	Metal Loss	TBit	SK	Inspection Side
3561	90	52.32	76.10	1.34	0.66	55	Metal Loss	TBit	SK	Inspection Side
3562	90	57.05	37.91	1.37	0.49	55	Metal Loss	TBit	SK	Inspection Side
3563	90	56.18	44.61	1.64	0.89	55	Metal Loss	TBit	SK	Non Inspection Side
3564	90	9.02	29.96	1.72	0.44	55	Metal Loss	TBit	SK	Inspection Side
3565	90	42.91	19.96	0.51	0.40	56	Metal Loss	TBit	SK	Inspection Side
3566	90	58.07	60.00	0.72	0.49	56	Metal Loss	TBit	SK	Inspection Side
3567	90	11.02	233.54	0.74	0.37	56	Metal Loss	TBit	SK	Inspection Side
3568	90	44.49	40.24	0.84	0.50	56	Metal Loss	TBit	SK	Inspection Side
3569	90	38.19	90.00	0.84	0.43	56	Metal Loss	TBit	SK	Inspection Side
3570	90	13.98	217.64	1.03	0.53	56	Metal Loss	TBit	SK	Inspection Side
3571	90	5.71	108.54	1.07	0.54	56	Metal Loss	TBit	SK	Inspection Side
3572	90	50.63	100.28	1.09	0.43	56	Metal Loss	TBit	SK	Inspection Side
3573	90	37.20	224.53	1.27	0.43	56	Metal Loss	TBit	SK	Inspection Side
3574	90	30.75	35.94	1.38	1.33	56	Metal Loss	TBit	SK	Inspection Side
3575	90	45.00	197.24	2.20	0.31	56	Metal Loss	TBit	SK	Inspection Side
3576	90	23.27	24.92	0.51	0.37	57	Metal Loss	TBit	SK	Inspection Side
3577	90	53.70	37.32	0.72	0.47	57	Metal Loss	TBit	SK	Inspection Side
3578	90	48.62	81.38	0.89	0.37	57	Metal Loss	TBit	SK	Inspection Side
3579	90	45.00	191.85	0.94	0.80	57	Metal Loss	TBit	SK	Inspection Side
3580	90	52.64	29.02	1.03	0.34	57	Metal Loss	TBit	SK	Inspection Side
3581	90	38.90	174.02	1.13	0.32	57	Metal Loss	TBit	SK	Inspection Side
3582	90	32.68	67.60	1.27	0.42	57	Metal Loss	TBit	SK	Inspection Side
3583	90	65.79	146.38	1.34	0.45	57	Metal Loss	TBit	SK	Inspection Side
3584	90	32.91	30.94	1.58	0.39	57	Metal Loss	TBit	SK	Inspection Side
3585	90	2.87	14.88	1.82	0.48	57	Metal Loss	TBit	SK	Inspection Side
3586	90	17.20	24.57	2.11	0.30	57	Metal Loss	TBit	SK	Inspection Side
3587	90	46.93	78.46	0.50	0.52	58	Metal Loss	TBit	SK	Inspection Side
3588	90	38.23	80.87	0.63	0.29	58	Metal Loss	TBit	SK	Inspection Side
3589	90	16.14	208.74	0.76	0.35	58	Metal Loss	TBit	SK	Inspection Side
3590	90	31.30	40.87	0.77	0.35	58	Metal Loss	TBit	SK	Inspection Side
3591	90	17.48	205.16	0.78	0.58	58	Metal Loss	TBit	SK	Inspection Side
3592	90	44.41	87.68	0.78	0.45	58	Metal Loss	TBit	SK	Inspection Side
3593	90	55.16	49.13	0.88	0.45	58	Metal Loss	TBit	SK	Inspection Side
3594	90	59.09	156.30	0.88	0.51	58	Metal Loss	TBit	SK	Inspection Side
3595	90	27.13	12.20	1.23	0.36	58	Metal Loss	TBit	SK	Inspection Side
3596	90	57.76	64.65	1.28	0.54	58	Metal Loss	TBit	SK	Inspection Side
3597	90	12.95	188.94	1.38	0.51	58	Metal Loss	TBit	SK	Inspection Side
3598	90	4.57	11.42	1.46	0.19	58	Metal Loss	TBit	SK	Inspection Side
3599	90	54.88	44.49	2.05	0.72	58	Metal Loss	TBit	SK	Inspection Side
3600	90	13.07	118.82	0.39	0.22	59	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3601	90	52.24	88.98	0.59	0.34	59	Metal Loss	TBit	SK	Inspection Side
3602	90	45.16	33.94	0.60	0.32	59	Metal Loss	TBit	SK	Inspection Side
3603	90	16.30	198.66	0.63	0.46	59	Metal Loss	TBit	SK	Inspection Side
3604	90	50.12	78.66	0.63	0.41	59	Metal Loss	TBit	SK	Inspection Side
3605	90	44.45	98.98	0.74	0.38	59	Metal Loss	TBit	SK	Inspection Side
3606	90	60.59	62.32	0.77	0.42	59	Metal Loss	TBit	SK	Inspection Side
3607	90	53.66	45.08	0.79	0.75	59	Metal Loss	TBit	SK	Inspection Side
3608	90	10.59	108.35	0.79	0.40	59	Metal Loss	TBit	SK	Inspection Side
3609	90	62.99	192.64	1.03	0.43	59	Metal Loss	TBit	SK	Inspection Side
3610	90	4.88	209.09	1.12	0.52	59	Metal Loss	TBit	SK	Inspection Side
3611	90	61.61	58.23	1.14	1.03	59	Metal Loss	TBit	SK	Inspection Side
3612	90	11.85	8.54	1.22	0.54	59	Metal Loss	TBit	SK	Inspection Side
3613	90	14.61	54.61	2.10	0.44	59	Metal Loss	TBit	SK	Inspection Side
3614	90	38.58	40.43	0.70	0.51	60	Metal Loss	TBit	SK	Inspection Side
3615	90	39.69	81.54	0.71	0.68	60	Metal Loss	TBit	SK	Inspection Side
3616	90	44.76	228.11	0.88	0.36	60	Metal Loss	TBit	SK	Inspection Side
3617	90	36.50	105.08	0.90	0.77	60	Metal Loss	TBit	SK	Inspection Side
3618	90	18.43	199.09	0.96	0.36	60	Metal Loss	TBit	SK	Inspection Side
3619	90	50.67	38.50	0.96	0.53	60	Metal Loss	TBit	SK	Inspection Side
3620	90	56.18	35.59	2.02	0.97	60	Metal Loss	TBit	SK	Inspection Side
3621	90	9.76	164.02	2.30	0.41	60	Metal Loss	TBit	SK	Inspection Side
3622	90	53.90	92.56	0.24	0.18	61	Metal Loss	TBit	SK	Inspection Side
3623	90	31.77	206.69	1.02	0.37	61	Metal Loss	TBit	SK	Inspection Side
3624	90	59.88	34.13	1.07	0.38	61	Metal Loss	TBit	SK	Inspection Side
3625	90	46.69	212.99	1.12	0.27	61	Metal Loss	TBit	SK	Inspection Side
3626	90	40.08	66.54	1.15	0.45	61	Metal Loss	TBit	SK	Inspection Side
3627	90	5.20	54.21	1.42	0.35	61	Metal Loss	TBit	SK	Inspection Side
3628	90	14.02	211.73	1.56	0.56	61	Metal Loss	TBit	SK	Inspection Side
3629	90	37.87	210.16	1.84	0.38	61	Metal Loss	TBit	SK	Inspection Side
3630	90	5.59	126.10	1.97	0.30	61	Metal Loss	TBit	SK	Inspection Side
3631	90	63.43	20.63	1.97	0.93	61	Metal Loss	TBit	SK	Inspection Side
3632	90	44.06	84.29	0.89	0.34	62	Metal Loss	TBit	SK	Inspection Side
3633	90	52.44	112.83	0.95	0.53	62	Metal Loss	TBit	SK	Inspection Side
3634	90	2.09	100.51	1.03	0.47	62	Metal Loss	TBit	SK	Inspection Side
3635	90	30.79	95.75	1.04	0.23	62	Metal Loss	TBit	SK	Inspection Side
3636	90	52.91	42.68	1.22	0.63	62	Metal Loss	TBit	SK	Inspection Side
3637	90	3.23	203.43	1.32	0.34	62	Metal Loss	TBit	SK	Inspection Side
3638	90	59.57	17.52	1.43	0.32	62	Metal Loss	TBit	SK	Inspection Side
3639	90	33.27	80.79	1.61	0.52	62	Metal Loss	TBit	SK	Inspection Side
3640	90	62.09	15.71	2.08	0.34	62	Metal Loss	TBit	SK	Inspection Side
3641	90	9.92	61.77	2.21	0.67	62	Metal Loss	TBit	SK	Inspection Side
3642	90	4.02	17.44	2.60	0.30	62	Metal Loss	TBit	SK	Inspection Side
3643	90	9.41	225.51	0.84	0.41	63	Metal Loss	TBit	SK	Inspection Side
3644	90	52.99	50.98	0.94	1.43	63	Metal Loss	TBit	SK	Inspection Side
3645	90	42.99	159.17	0.95	0.33	63	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3646	90	40.91	97.76	0.98	0.39	63	Metal Loss	TBit	SK	Inspection Side
3647	90	31.38	164.96	1.08	0.28	63	Metal Loss	TBit	SK	Inspection Side
3648	90	3.66	88.43	1.31	0.36	63	Metal Loss	TBit	SK	Inspection Side
3649	90	44.76	80.16	2.00	0.95	63	Metal Loss	TBit	SK	Inspection Side
3650	90	7.91	66.14	2.15	0.80	63	Metal Loss	TBit	SK	Inspection Side
3651	90	63.39	46.73	2.55	0.51	63	Metal Loss	TBit	SK	Inspection Side
3652	90	39.84	81.50	0.12	0.35	64	Metal Loss	TBit	SK	Inspection Side
3653	90	61.30	189.09	0.84	0.38	64	Metal Loss	TBit	SK	Non Inspection Side
3654	90	38.62	26.34	0.97	0.61	64	Metal Loss	TBit	SK	Inspection Side
3655	90	40.87	44.53	1.17	0.49	64	Metal Loss	TBit	SK	Inspection Side
3656	90	35.04	26.81	1.43	0.45	64	Metal Loss	TBit	SK	Inspection Side
3657	90	44.13	41.18	1.82	0.67	64	Metal Loss	TBit	SK	Inspection Side
3658	90	32.20	187.52	1.05	0.36	65	Metal Loss	TBit	SK	Inspection Side
3659	90	12.99	191.42	1.12	0.34	65	Metal Loss	TBit	SK	Inspection Side
3660	90	8.39	87.87	0.80	0.58	66	Metal Loss	TBit	SK	Inspection Side
3661	90	7.48	19.13	1.19	1.07	66	Metal Loss	TBit	SK	Inspection Side
3662	90	39.76	84.80	1.23	0.49	66	Metal Loss	TBit	SK	Inspection Side
3663	90	35.47	47.24	1.23	0.72	66	Metal Loss	TBit	SK	Inspection Side
3664	90	60.51	11.89	1.39	1.01	66	Metal Loss	TBit	SK	Non Inspection Side
3665	90	5.94	52.09	1.55	0.79	66	Metal Loss	TBit	SK	Inspection Side
3666	90	62.80	60.43	1.57	0.36	66	Metal Loss	TBit	SK	Inspection Side
3667	90	15.00	23.46	4.00	0.61	66	Metal Loss	TBit	SK	Inspection Side
3668	90	33.27	49.69	0.97	0.36	67	Metal Loss	TBit	SK	Inspection Side
3669	90	13.43	42.52	0.99	0.37	67	Metal Loss	TBit	SK	Inspection Side
3670	90	17.20	220.71	1.30	0.65	67	Metal Loss	TBit	SK	Inspection Side
3671	90	9.09	214.49	1.75	0.53	67	Metal Loss	TBit	SK	Inspection Side
3672	90	35.59	34.96	2.12	0.67	67	Metal Loss	TBit	SK	Inspection Side
3673	90	46.73	68.62	0.43	0.42	68	Metal Loss	TBit	SK	Inspection Side
3674	90	60.00	8.54	0.52	0.36	68	Metal Loss	TBit	SK	Inspection Side
3675	90	55.87	110.71	0.60	0.32	68	Metal Loss	TBit	SK	Inspection Side
3676	90	56.65	47.52	0.91	0.33	68	Metal Loss	TBit	SK	Inspection Side
3677	90	10.79	37.52	1.08	0.31	68	Metal Loss	TBit	SK	Inspection Side
3678	90	15.98	58.70	1.23	0.72	68	Metal Loss	TBit	SK	Inspection Side
3679	90	66.10	94.09	1.32	1.60	68	Metal Loss	TBit	SK	Inspection Side
3680	90	30.87	36.57	1.61	0.55	68	Metal Loss	TBit	SK	Non Inspection Side
3681	90	40.08	81.54	0.27	0.34	69	Metal Loss	TBit	SK	Inspection Side
3682	90	53.94	51.46	0.57	0.71	69	Metal Loss	TBit	SK	Inspection Side
3683	90	43.78	219.49	0.90	0.40	69	Metal Loss	TBit	SK	Inspection Side
3684	90	44.53	25.08	0.62	0.39	70	Metal Loss	TBit	SK	Inspection Side
3685	90	45.59	165.51	1.21	0.42	70	Metal Loss	TBit	SK	Inspection Side
3686	90	31.81	42.01	1.39	0.55	70	Metal Loss	TBit	SK	Inspection Side
3687	90	57.68	43.90	1.63	0.61	70	Metal Loss	TBit	SK	Inspection Side
3688	90	45.08	130.87	2.28	0.38	70	Metal Loss	TBit	SK	Inspection Side
3689	90	45.12	211.02	0.81	0.70	71	Metal Loss	TBit	SK	Inspection Side
3690	90	54.72	241.34	1.90	1.01	71	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3691	90	46.73	151.85	1.97	0.49	71	Metal Loss	TBit	SK	Non Inspection Side
3692	90	36.73	47.13	0.32	0.44	72	Metal Loss	TBit	SK	Inspection Side
3693	90	46.65	46.77	0.58	0.39	72	Metal Loss	TBit	SK	Inspection Side
3694	90	59.02	93.54	0.81	0.67	72	Metal Loss	TBit	SK	Non Inspection Side
3695	90	30.63	28.19	1.12	0.50	72	Metal Loss	TBit	SK	Inspection Side
3696	90	25.98	65.16	1.14	0.73	72	Metal Loss	TBit	SK	Inspection Side
3697	90	15.91	167.60	1.89	0.43	72	Metal Loss	TBit	SK	Inspection Side
3698	90	54.76	54.06	0.78	0.35	73	Metal Loss	TBit	SK	Inspection Side
3699	90	38.78	43.23	1.11	0.61	73	Metal Loss	TBit	SK	Inspection Side
3700	90	55.47	20.71	1.73	0.29	73	Metal Loss	TBit	SK	Inspection Side
3701	90	34.88	186.97	0.86	0.44	74	Metal Loss	TBit	SK	Inspection Side
3702	90	45.12	163.90	1.04	0.51	74	Metal Loss	TBit	SK	Inspection Side
3703	90	8.70	87.87	0.83	0.59	75	Metal Loss	TBit	SK	Inspection Side
3704	90	63.19	40.75	1.09	0.50	75	Metal Loss	TBit	SK	Inspection Side
3705	90	55.79	99.72	3.23	0.49	75	Metal Loss	TBit	SK	Inspection Side
3706	90	32.87	47.56	0.71	0.67	76	Metal Loss	TBit	SK	Inspection Side
3707	90	44.65	69.45	0.74	0.41	76	Metal Loss	TBit	SK	Inspection Side
3708	90	7.64	36.26	1.09	0.39	76	Metal Loss	TBit	SK	Inspection Side
3709	90	9.57	13.46	1.21	0.52	77	Metal Loss	TBit	SK	Inspection Side
3710	90	59.13	40.16	2.24	0.67	77	Metal Loss	TBit	SK	Inspection Side
3711	90	5.71	23.66	2.30	0.64	77	Metal Loss	TBit	SK	Inspection Side
3712	90	53.94	52.36	2.79	1.63	77	Metal Loss	TBit	SK	Non Inspection Side
3713	90	9.21	120.20	1.98	0.33	78	Metal Loss	TBit	SK	Inspection Side
3714	90	17.17	201.26	0.91	0.40	79	Metal Loss	TBit	SK	Inspection Side
3715	90	38.58	43.31	1.18	0.56	79	Metal Loss	TBit	SK	Inspection Side
3716	90	4.21	21.34	1.53	0.82	79	Metal Loss	TBit	SK	Inspection Side
3717	90	10.51	26.93	2.22	0.81	79	Metal Loss	TBit	SK	Inspection Side
3718	90	17.48	32.32	1.49	0.30	80	Metal Loss	TBit	SK	Inspection Side
3719	90	36.65	14.80	2.22	0.48	80	Metal Loss	TBit	SK	Inspection Side
3720	90	10.20	22.68	1.15	0.42	81	Metal Loss	TBit	SK	Inspection Side
3721	90	4.88	61.10	1.70	0.55	81	Metal Loss	TBit	SK	Inspection Side
3722	90	2.56	71.34	3.06	0.56	81	Metal Loss	TBit	SK	Inspection Side
3723	90	37.40	37.32	1.02	0.60	82	Metal Loss	TBit	SK	Inspection Side
3724	90	45.08	155.08	1.22	0.34	83	Metal Loss	TBit	SK	Inspection Side
3725	90	53.62	147.83	1.17	0.35	84	Metal Loss	TBit	SK	Inspection Side
3726	90	56.38	93.07	3.18	0.89	84	Metal Loss	TBit	SK	Inspection Side
3727	90	17.36	36.93	2.48	0.35	85	Metal Loss	TBit	SK	Inspection Side
3728	90	7.20	68.98	1.38	0.32	86	Metal Loss	TBit	SK	Inspection Side
3729	90	53.78	46.65	0.74	0.37	87	Metal Loss	TBit	SK	Inspection Side
3730	90	7.60	48.50	1.13	0.30	89	Metal Loss	TBit	SK	Inspection Side
3731	90	63.31	104.02	1.29	0.41	89	Metal Loss	TBit	SK	Inspection Side
3732	90	15.59	34.72	2.52	0.64	89	Metal Loss	TBit	SK	Inspection Side
3733	90	61.57	33.46	1.62	0.22	90	Metal Loss	TBit	SK	Inspection Side
3734	90	44.84	14.06	0.85	0.46	95	Metal Loss	TBit	SK	Inspection Side
3735	90	54.61	103.62	4.14	0.66	96	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3736	90	6.26	87.68	0.76	0.47	97	Metal Loss	TBit	SK	Inspection Side
3737	90	17.17	205.16	0.78	0.36	97	Metal Loss	TBit	SK	Inspection Side
3738	90	3.31	202.44	0.83	0.42	97	Metal Loss	TBit	SK	Inspection Side
3739	90	64.61	189.72	0.90	0.42	97	Metal Loss	TBit	SK	Inspection Side
3740	90	42.01	35.51	1.06	0.58	97	Metal Loss	TBit	SK	Inspection Side
3741	90	45.00	182.80	1.07	0.84	97	Metal Loss	TBit	SK	Inspection Side
3742	90	41.81	47.87	1.17	0.60	97	Metal Loss	TBit	SK	Inspection Side
3743	90	6.69	200.59	1.18	0.52	97	Metal Loss	TBit	SK	Inspection Side
3744	90	10.51	32.05	1.22	0.24	97	Metal Loss	TBit	SK	Inspection Side
3745	90	45.00	84.69	1.26	0.47	97	Metal Loss	TBit	SK	Inspection Side
3746	90	31.81	38.15	1.33	0.87	97	Metal Loss	TBit	SK	Inspection Side
3747	90	9.92	40.43	1.52	0.81	97	Metal Loss	TBit	SK	Inspection Side
3748	90	10.71	19.06	2.01	0.46	97	Metal Loss	TBit	SK	Inspection Side
3749	90	54.13	50.24	3.11	0.39	97	Metal Loss	TBit	SK	Inspection Side
3750	90	61.26	31.30	3.19	1.00	97	Metal Loss	TBit	SK	Inspection Side
3751	90	63.58	116.10	1.13	0.42	98	Metal Loss	TBit	SK	Inspection Side
3752	90	11.02	33.86	1.17	0.42	98	Metal Loss	TBit	SK	Inspection Side
3753	90	17.99	218.31	1.19	0.82	98	Metal Loss	TBit	SK	Inspection Side
3754	90	63.98	106.42	2.58	0.86	98	Metal Loss	TBit	SK	Inspection Side
3755	91	60.87	97.44	0.38	0.41	49	Metal Loss	TBit	SK	Inspection Side
3756	91	46.14	63.86	0.63	0.36	49	Metal Loss	TBit	SK	Inspection Side
3757	91	22.72	195.75	0.74	0.36	49	Metal Loss	TBit	SK	Inspection Side
3758	91	16.54	61.10	1.00	0.53	49	Metal Loss	TBit	SK	Inspection Side
3759	91	56.97	107.91	1.00	0.40	49	Metal Loss	TBit	SK	Inspection Side
3760	91	58.35	104.84	1.86	0.72	49	Metal Loss	TBit	SK	Inspection Side
3761	91	24.84	162.20	0.77	0.46	50	Metal Loss	TBit	SK	Inspection Side
3762	91	29.84	92.91	0.88	0.66	50	Metal Loss	TBit	SK	Inspection Side
3763	91	26.65	105.79	1.09	0.59	50	Metal Loss	TBit	SK	Inspection Side
3764	91	15.94	129.02	1.42	0.77	50	Metal Loss	TBit	SK	Non Inspection Side
3765	91	43.23	74.33	0.17	0.47	51	Metal Loss	TBit	SK	Inspection Side
3766	91	18.15	16.73	0.58	0.43	51	Metal Loss	TBit	SK	Inspection Side
3767	91	24.06	192.68	0.61	0.33	51	Metal Loss	TBit	SK	Inspection Side
3768	91	30.28	193.15	1.19	1.49	51	Metal Loss	TBit	SK	Non Inspection Side
3769	91	15.83	107.36	1.19	1.53	51	Metal Loss	TBit	SK	Non Inspection Side
3770	91	37.44	77.68	0.44	0.38	52	Metal Loss	TBit	SK	Inspection Side
3771	91	20.16	13.19	0.56	0.33	52	Metal Loss	TBit	SK	Inspection Side
3772	91	37.36	65.98	0.68	0.37	52	Metal Loss	TBit	SK	Inspection Side
3773	91	27.24	94.45	0.79	0.55	52	Metal Loss	TBit	SK	Inspection Side
3774	91	34.45	70.31	0.81	0.53	52	Metal Loss	TBit	SK	Inspection Side
3775	91	31.54	84.33	1.07	0.39	52	Metal Loss	TBit	SK	Inspection Side
3776	91	31.38	138.31	1.16	0.90	52	Metal Loss	TBit	SK	Inspection Side
3777	91	7.48	83.07	0.54	0.37	54	Metal Loss	TBit	SK	Inspection Side
3778	91	12.80	17.72	0.67	0.29	54	Metal Loss	TBit	SK	Non Inspection Side
3779	91	19.61	121.10	1.11	0.49	54	Metal Loss	TBit	SK	Inspection Side
3780	91	18.50	24.76	1.40	1.80	54	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3781	91	36.73	110.24	0.61	0.40	55	Metal Loss	TBit	SK	Inspection Side
3782	91	5.98	234.17	0.65	0.44	55	Metal Loss	TBit	SK	Inspection Side
3783	91	28.78	84.65	1.04	0.38	55	Metal Loss	TBit	SK	Inspection Side
3784	91	29.29	77.95	1.30	0.67	55	Metal Loss	TBit	SK	Inspection Side
3785	91	55.55	76.46	1.47	0.46	55	Metal Loss	TBit	SK	Inspection Side
3786	91	14.69	17.17	0.59	0.44	56	Metal Loss	TBit	SK	Inspection Side
3787	91	17.40	12.20	0.62	0.38	56	Metal Loss	TBit	SK	Inspection Side
3788	91	29.25	139.69	0.81	0.29	56	Metal Loss	TBit	SK	Inspection Side
3789	91	30.31	147.01	0.90	0.75	56	Metal Loss	TBit	SK	Inspection Side
3790	91	10.31	19.33	1.27	1.46	56	Metal Loss	TBit	SK	Inspection Side
3791	91	16.50	69.37	1.33	0.68	56	Metal Loss	TBit	SK	Inspection Side
3792	91	34.92	208.11	0.62	0.60	57	Metal Loss	TBit	SK	Inspection Side
3793	91	14.72	146.42	0.64	0.36	57	Metal Loss	TBit	SK	Inspection Side
3794	91	24.96	150.71	0.78	0.54	57	Metal Loss	TBit	SK	Inspection Side
3795	91	30.31	76.18	1.15	0.68	57	Metal Loss	TBit	SK	Inspection Side
3796	91	27.76	208.11	0.59	0.69	58	Metal Loss	TBit	SK	Inspection Side
3797	91	58.15	125.59	1.31	0.60	58	Metal Loss	TBit	SK	Inspection Side
3798	91	8.74	146.50	0.41	0.36	59	Metal Loss	TBit	SK	Inspection Side
3799	91	8.78	160.83	0.81	0.33	59	Metal Loss	TBit	SK	Inspection Side
3800	91	53.46	116.22	1.13	0.33	59	Metal Loss	TBit	SK	Inspection Side
3801	91	25.98	74.33	0.67	0.39	60	Metal Loss	TBit	SK	Inspection Side
3802	91	30.08	84.84	0.82	0.32	60	Metal Loss	TBit	SK	Inspection Side
3803	91	57.36	125.98	1.30	0.59	60	Metal Loss	TBit	SK	Inspection Side
3804	91	23.39	61.61	1.06	0.37	61	Metal Loss	TBit	SK	Inspection Side
3805	91	20.59	143.74	1.31	0.66	61	Metal Loss	TBit	SK	Inspection Side
3806	91	8.94	220.55	0.78	0.40	62	Metal Loss	TBit	SK	Inspection Side
3807	91	15.63	225.87	0.79	0.42	62	Metal Loss	TBit	SK	Inspection Side
3808	91	38.86	74.17	0.82	0.53	63	Metal Loss	TBit	SK	Inspection Side
3809	91	44.84	74.84	0.92	0.43	63	Metal Loss	TBit	SK	Inspection Side
3810	91	52.17	73.62	0.59	0.39	64	Metal Loss	TBit	SK	Inspection Side
3811	91	27.68	86.38	0.83	0.36	64	Metal Loss	TBit	SK	Inspection Side
3812	91	17.72	15.51	0.84	0.31	64	Metal Loss	TBit	SK	Inspection Side
3813	91	45.24	62.95	0.50	0.45	65	Metal Loss	TBit	SK	Inspection Side
3814	91	22.72	158.15	0.81	0.70	65	Metal Loss	TBit	SK	Inspection Side
3815	91	9.49	75.83	0.35	0.31	66	Metal Loss	TBit	SK	Inspection Side
3816	91	29.49	136.81	0.93	0.63	66	Metal Loss	TBit	SK	Inspection Side
3817	91	57.83	212.91	1.00	0.41	67	Metal Loss	TBit	SK	Inspection Side
3818	91	19.84	66.06	1.01	0.41	67	Metal Loss	TBit	SK	Inspection Side
3819	91	58.07	101.10	0.71	0.39	69	Metal Loss	TBit	SK	Inspection Side
3820	91	57.95	101.50	0.82	0.33	70	Metal Loss	TBit	SK	Inspection Side
3821	91	27.36	122.64	0.61	0.32	71	Metal Loss	TBit	SK	Inspection Side
3822	91	33.39	64.88	0.81	0.36	71	Metal Loss	TBit	SK	Inspection Side
3823	91	57.32	213.23	1.07	0.46	71	Metal Loss	TBit	SK	Inspection Side
3824	91	15.98	133.35	1.16	0.41	72	Metal Loss	TBit	SK	Inspection Side
3825	91	26.69	94.53	1.02	0.51	77	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3826	91	32.24	207.40	1.15	0.44	80	Metal Loss	TBit	SK	Inspection Side
3827	91	32.28	93.03	1.21	0.72	93	Metal Loss	TBit	SK	Inspection Side
3828	91	10.20	17.76	1.11	0.85	97	Metal Loss	TBit	SK	Inspection Side
3829	92	12.68	163.54	0.50	0.30	49	Metal Loss	TBit	SK	Inspection Side
3830	92	49.13	237.99	0.63	0.61	49	Metal Loss	TBit	SK	Inspection Side
3831	92	10.39	106.65	0.77	0.31	49	Metal Loss	TBit	SK	Inspection Side
3832	92	37.28	130.00	0.77	0.53	49	Metal Loss	TBit	SK	Inspection Side
3833	92	18.31	124.96	0.95	0.90	49	Metal Loss	TBit	SK	Inspection Side
3834	92	56.42	91.85	0.97	0.41	49	Metal Loss	TBit	SK	Inspection Side
3835	92	63.58	137.83	2.41	0.44	49	Metal Loss	TBit	SK	Inspection Side
3836	92	42.28	159.33	0.69	0.42	50	Metal Loss	TBit	SK	Inspection Side
3837	92	55.39	207.87	0.73	0.61	50	Metal Loss	TBit	SK	Inspection Side
3838	92	44.96	131.38	0.85	0.37	50	Metal Loss	TBit	SK	Inspection Side
3839	92	42.76	44.25	0.87	0.55	50	Metal Loss	TBit	SK	Inspection Side
3840	92	32.95	177.87	1.11	1.71	50	Metal Loss	TBit	SK	Non Inspection Side
3841	92	53.62	148.07	0.55	0.43	51	Metal Loss	TBit	SK	Inspection Side
3842	92	25.51	151.54	0.59	0.31	51	Metal Loss	TBit	SK	Inspection Side
3843	92	42.56	66.14	0.72	0.48	51	Metal Loss	TBit	SK	Inspection Side
3844	92	32.64	118.54	0.76	0.51	51	Metal Loss	TBit	SK	Inspection Side
3845	92	5.59	112.95	0.81	0.51	51	Metal Loss	TBit	SK	Inspection Side
3846	92	35.67	162.20	1.05	0.92	51	Metal Loss	TBit	SK	Inspection Side
3847	92	44.09	205.55	1.15	0.32	51	Metal Loss	TBit	SK	Inspection Side
3848	92	54.29	105.98	1.50	0.44	51	Metal Loss	TBit	SK	Inspection Side
3849	92	32.64	113.15	1.58	0.37	51	Metal Loss	TBit	SK	Inspection Side
3850	92	30.87	159.69	1.66	0.86	51	Metal Loss	TBit	SK	Non Inspection Side
3851	92	50.16	238.74	0.45	0.36	52	Metal Loss	TBit	SK	Inspection Side
3852	92	44.76	121.46	1.00	0.67	52	Metal Loss	TBit	SK	Inspection Side
3853	92	41.38	195.83	1.03	3.11	52	Metal Loss	TBit	SK	Non Inspection Side
3854	92	10.67	234.45	1.28	0.70	52	Metal Loss	TBit	SK	Inspection Side
3855	92	58.98	40.79	1.77	0.29	52	Metal Loss	TBit	SK	Inspection Side
3856	92	18.31	143.62	0.64	0.61	53	Metal Loss	TBit	SK	Non Inspection Side
3857	92	9.29	180.98	0.83	0.39	53	Metal Loss	TBit	SK	Inspection Side
3858	92	31.42	101.89	0.88	0.66	53	Metal Loss	TBit	SK	Inspection Side
3859	92	41.77	67.76	0.99	0.38	53	Metal Loss	TBit	SK	Inspection Side
3860	92	47.01	217.91	1.46	0.69	53	Metal Loss	TBit	SK	Non Inspection Side
3861	92	10.08	217.44	1.51	0.41	53	Metal Loss	TBit	SK	Inspection Side
3862	92	25.67	75.55	0.52	0.37	54	Metal Loss	TBit	SK	Inspection Side
3863	92	35.39	190.04	1.78	0.51	54	Metal Loss	TBit	SK	Inspection Side
3864	92	41.69	240.04	0.40	0.34	55	Metal Loss	TBit	SK	Inspection Side
3865	92	31.10	186.77	1.12	0.82	55	Metal Loss	TBit	SK	Inspection Side
3866	92	27.80	65.39	1.18	0.61	55	Metal Loss	TBit	SK	Inspection Side
3867	92	42.60	228.90	0.69	0.52	56	Metal Loss	TBit	SK	Inspection Side
3868	92	46.38	84.33	1.04	0.20	56	Metal Loss	TBit	SK	Inspection Side
3869	92	43.15	118.23	1.24	0.32	56	Metal Loss	TBit	SK	Inspection Side
3870	92	46.77	45.75	1.96	0.49	56	Metal Loss	TBit	SK	Non Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3871	92	5.20	130.39	0.58	0.64	57	Metal Loss	TBit	SK	Inspection Side
3872	92	63.90	132.64	0.79	0.33	57	Metal Loss	TBit	SK	Inspection Side
3873	92	39.17	156.77	0.87	0.81	57	Metal Loss	TBit	SK	Inspection Side
3874	92	3.86	166.26	0.99	0.56	57	Metal Loss	TBit	SK	Inspection Side
3875	92	4.41	121.73	1.12	0.46	57	Metal Loss	TBit	SK	Inspection Side
3876	92	46.34	135.79	1.17	0.32	57	Metal Loss	TBit	SK	Non Inspection Side
3877	92	18.27	105.08	1.36	0.83	57	Metal Loss	TBit	SK	Non Inspection Side
3878	92	66.38	42.87	1.57	0.67	57	Metal Loss	TBit	SK	Inspection Side
3879	92	46.85	130.12	1.78	0.53	57	Metal Loss	TBit	SK	Non Inspection Side
3880	92	63.86	91.54	0.62	0.37	59	Metal Loss	TBit	SK	Inspection Side
3881	92	53.43	208.31	0.92	0.61	59	Metal Loss	TBit	SK	Inspection Side
3882	92	45.55	106.69	1.13	0.38	59	Metal Loss	TBit	SK	Inspection Side
3883	92	65.47	108.58	0.80	0.39	60	Metal Loss	TBit	SK	Inspection Side
3884	92	30.75	152.52	1.46	1.20	60	Metal Loss	TBit	SK	Inspection Side
3885	92	31.10	64.09	1.48	0.79	60	Metal Loss	TBit	SK	Non Inspection Side
3886	92	46.81	63.50	1.88	0.59	60	Metal Loss	TBit	SK	Non Inspection Side
3887	92	4.53	53.90	0.68	0.38	61	Metal Loss	TBit	SK	Inspection Side
3888	92	5.20	140.67	0.75	0.54	61	Metal Loss	TBit	SK	Inspection Side
3889	92	6.14	213.31	0.92	0.69	61	Metal Loss	TBit	SK	Inspection Side
3890	92	54.29	98.03	1.05	0.30	61	Metal Loss	TBit	SK	Inspection Side
3891	92	65.91	62.91	1.26	0.84	61	Metal Loss	TBit	SK	Inspection Side
3892	92	6.50	131.18	0.41	0.44	62	Metal Loss	TBit	SK	Inspection Side
3893	92	6.38	144.96	0.90	0.58	62	Metal Loss	TBit	SK	Inspection Side
3894	92	46.85	128.31	1.79	0.61	62	Metal Loss	TBit	SK	Non Inspection Side
3895	92	43.86	217.48	0.74	0.42	63	Metal Loss	TBit	SK	Inspection Side
3896	92	45.12	94.92	0.87	0.30	63	Metal Loss	TBit	SK	Inspection Side
3897	92	38.98	112.48	0.90	0.43	63	Metal Loss	TBit	SK	Inspection Side
3898	92	57.64	190.31	0.99	0.44	63	Metal Loss	TBit	SK	Inspection Side
3899	92	46.97	35.16	1.14	0.77	63	Metal Loss	TBit	SK	Inspection Side
3900	92	6.02	70.98	1.18	0.64	63	Metal Loss	TBit	SK	Inspection Side
3901	92	61.89	56.65	1.39	0.31	63	Metal Loss	TBit	SK	Inspection Side
3902	92	66.69	30.98	1.42	0.81	63	Metal Loss	TBit	SK	Inspection Side
3903	92	44.80	67.95	1.04	0.42	64	Metal Loss	TBit	SK	Inspection Side
3904	92	44.57	81.10	1.19	1.06	64	Metal Loss	TBit	SK	Inspection Side
3905	92	60.00	38.11	2.08	0.46	65	Metal Loss	TBit	SK	Inspection Side
3906	92	35.39	212.01	0.33	0.65	68	Metal Loss	TBit	SK	Inspection Side
3907	92	54.21	20.16	1.02	0.36	68	Metal Loss	TBit	SK	Inspection Side
3908	92	2.40	23.11	1.17	0.50	68	Metal Loss	TBit	SK	Inspection Side
3909	92	35.47	212.01	1.00	0.66	69	Metal Loss	TBit	SK	Inspection Side
3910	92	30.71	38.15	1.41	0.62	69	Metal Loss	TBit	SK	Inspection Side
3911	92	46.18	203.54	1.16	0.63	70	Metal Loss	TBit	SK	Inspection Side
3912	92	53.58	196.18	1.70	0.48	70	Metal Loss	TBit	SK	Non Inspection Side
3913	92	46.89	149.41	1.70	1.50	70	Metal Loss	TBit	SK	Non Inspection Side
3914	92	64.17	195.16	1.12	0.69	71	Metal Loss	TBit	SK	Inspection Side
3915	92	35.55	159.06	1.33	0.79	71	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3916	92	30.59	162.99	1.18	0.69	72	Metal Loss	TBit	SK	Inspection Side
3917	92	43.90	145.63	0.96	0.32	74	Metal Loss	TBit	SK	Inspection Side
3918	92	46.65	215.75	1.02	0.45	74	Metal Loss	TBit	SK	Inspection Side
3919	92	46.18	117.91	1.17	0.88	74	Metal Loss	TBit	SK	Non Inspection Side
3920	92	36.61	156.06	1.38	0.66	77	Metal Loss	TBit	SK	Inspection Side
3921	92	60.12	38.15	0.92	0.30	79	Metal Loss	TBit	SK	Inspection Side
3922	92	30.63	135.71	1.24	0.31	79	Metal Loss	TBit	SK	Inspection Side
3923	92	46.26	213.74	0.92	0.40	80	Metal Loss	TBit	SK	Inspection Side
3924	92	31.10	157.05	0.96	0.37	80	Metal Loss	TBit	SK	Inspection Side
3925	92	40.00	152.32	1.37	0.67	82	Metal Loss	TBit	SK	Inspection Side
3926	92	18.27	162.76	0.95	0.42	95	Metal Loss	TBit	SK	Inspection Side
3927	92	46.14	86.02	1.01	0.36	97	Metal Loss	TBit	SK	Inspection Side
3928	92	60.12	105.31	1.03	0.42	97	Metal Loss	TBit	SK	Inspection Side
3929	92	31.18	44.84	1.15	0.86	97	Metal Loss	TBit	SK	Inspection Side
3930	92	45.08	47.76	1.28	0.61	97	Metal Loss	TBit	SK	Inspection Side
3931	92	62.80	216.61	0.99	0.45	98	Metal Loss	TBit	SK	Inspection Side
3932	92	59.02	70.04	1.82	0.35	98	Metal Loss	TBit	SK	Inspection Side
3933	93	60.28	80.87	0.56	0.32	51	Metal Loss	TBit	SK	Inspection Side
3934	93	60.51	17.48	1.02	0.45	51	Metal Loss	TBit	SK	Inspection Side
3935	93	39.02	82.68	0.67	0.43	53	Metal Loss	TBit	SK / CA	Inspection Side
3936	93	17.28	33.07	0.71	0.30	54	Metal Loss	TBit	SK	Inspection Side
3937	93	17.20	36.10	1.10	0.39	55	Metal Loss	TBit	SK	Inspection Side
3938	93	18.98	31.97	1.46	0.43	56	Metal Loss	TBit	SK	Inspection Side
3939	93	45.31	61.89	0.66	0.44	57	Metal Loss	TBit	SK	Inspection Side
3940	93	16.18	21.50	0.96	0.42	57	Metal Loss	TBit	SK	Inspection Side
3941	93	46.46	18.39	1.02	0.57	57	Metal Loss	TBit	SK	Inspection Side
3942	93	58.82	66.77	0.49	0.32	58	Metal Loss	TBit	SK	Inspection Side
3943	93	22.01	32.13	1.26	0.52	58	Metal Loss	TBit	SK	Inspection Side
3944	93	54.13	74.65	0.68	0.31	59	Metal Loss	TBit	SK	Inspection Side
3945	93	29.21	72.52	0.73	0.34	60	Metal Loss	TBit	SK / CA	Inspection Side
3946	93	60.83	55.12	0.82	0.39	61	Metal Loss	TBit	SK	Inspection Side
3947	93	61.14	26.18	0.83	0.47	64	Metal Loss	TBit	SK	Inspection Side
3948	93	16.06	47.76	1.00	0.94	65	Metal Loss	TBit	SK	Inspection Side
3949	93	30.87	74.17	0.49	0.41	67	Metal Loss	TBit	SK / CA	Inspection Side
3950	93	61.54	64.72	1.04	0.68	72	Metal Loss	TBit	SK	Inspection Side
3951	93	16.89	40.51	1.23	0.41	77	Metal Loss	TBit	SK	Inspection Side
3952	93	17.48	15.31	0.96	0.42	95	Metal Loss	TBit	SK	Inspection Side
3953	93	60.04	39.53	1.08	0.47	97	Metal Loss	TBit	SK	Inspection Side
3954	93	17.44	26.85	1.51	0.40	98	Metal Loss	TBit	SK	Inspection Side
3955	94	19.21	60.28	0.84	0.84	49	Metal Loss	TBit	SK	Inspection Side
3956	94	33.19	125.08	0.96	0.48	49	Metal Loss	TBit	SK / CA	Inspection Side
3957	94	37.40	91.97	1.58	0.81	49	Metal Loss	TBit	SK	Inspection Side
3958	94	46.46	129.25	0.77	0.54	50	Metal Loss	TBit	SK / CA	Inspection Side
3959	94	37.20	123.86	0.81	0.52	50	Metal Loss	TBit	SK / CA	Inspection Side
3960	94	45.20	15.24	1.15	0.27	50	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
3961	94	57.24	46.10	1.51	0.73	50	Metal Loss	TBit	SK	Inspection Side
3962	94	23.15	112.56	0.62	0.40	51	Metal Loss	TBit	SK / CA	Inspection Side
3963	94	17.20	12.44	1.20	0.52	51	Metal Loss	TBit	SK	Non Inspection Side
3964	94	58.23	12.05	1.24	0.44	51	Metal Loss	TBit	SK	Inspection Side
3965	94	26.81	70.98	1.56	0.78	51	Metal Loss	TBit	SK	Inspection Side
3966	94	23.70	111.38	0.59	0.39	52	Metal Loss	TBit	SK / CA	Inspection Side
3967	94	17.80	37.36	0.72	0.29	52	Metal Loss	TBit	SK	Inspection Side
3968	94	22.83	51.85	1.41	0.67	52	Metal Loss	TBit	SK	Inspection Side
3969	94	33.07	119.06	1.43	0.39	52	Metal Loss	TBit	SK / CA	Inspection Side
3970	94	25.59	112.95	0.67	0.51	53	Metal Loss	TBit	SK / CA	Inspection Side
3971	94	35.98	120.71	0.67	0.32	53	Metal Loss	TBit	SK / CA	Inspection Side
3972	94	61.06	42.09	1.83	0.56	53	Metal Loss	TBit	SK	Non Inspection Side
3973	94	18.82	63.90	0.89	0.60	54	Metal Loss	TBit	SK	Inspection Side
3974	94	59.06	106.30	0.76	0.53	55	Metal Loss	TBit	SK	Inspection Side
3975	94	18.31	83.15	1.21	0.89	55	Metal Loss	TBit	SK	Inspection Side
3976	94	40.98	130.59	1.47	0.43	56	Metal Loss	TBit	SK / CA	Inspection Side
3977	94	44.92	96.02	1.29	0.81	57	Metal Loss	TBit	SK	Non Inspection Side
3978	94	10.28	109.29	0.75	0.47	58	Metal Loss	TBit	SK / CA	Inspection Side
3979	94	30.91	71.42	0.83	0.31	58	Metal Loss	TBit	SK	Inspection Side
3980	94	21.73	95.39	1.44	0.74	58	Metal Loss	TBit	SK	Inspection Side
3981	94	15.43	53.46	0.98	0.52	59	Metal Loss	TBit	SK	Inspection Side
3982	94	45.08	10.39	1.61	0.98	59	Metal Loss	TBit	SK	Non Inspection Side
3983	94	60.16	47.28	0.91	0.24	60	Metal Loss	TBit	SK	Inspection Side
3984	94	47.24	95.51	1.14	0.41	60	Metal Loss	TBit	SK	Inspection Side
3985	94	44.84	114.84	1.17	0.87	60	Metal Loss	TBit	SK	Non Inspection Side
3986	94	40.12	129.25	1.31	0.80	60	Metal Loss	TBit	SK / CA	Inspection Side
3987	94	16.46	93.19	0.75	0.61	62	Metal Loss	TBit	SK	Inspection Side
3988	94	14.02	111.38	0.99	0.31	62	Metal Loss	TBit	SK / CA	Inspection Side
3989	94	20.43	109.72	1.05	0.71	63	Metal Loss	TBit	SK / CA	Inspection Side
3990	94	57.91	105.98	1.02	0.56	64	Metal Loss	TBit	SK	Inspection Side
3991	94	44.76	105.39	1.00	0.66	66	Metal Loss	TBit	SK	Inspection Side
3992	94	19.02	77.48	1.30	0.58	66	Metal Loss	TBit	SK	Inspection Side
3993	94	44.96	109.17	1.16	0.47	67	Metal Loss	TBit	SK	Inspection Side
3994	94	45.04	37.64	1.19	0.69	67	Metal Loss	TBit	SK	Inspection Side
3995	94	59.92	58.31	1.29	0.80	69	Metal Loss	TBit	SK	Inspection Side
3996	94	17.32	66.38	0.69	0.35	70	Metal Loss	TBit	SK	Inspection Side
3997	94	32.01	63.11	1.54	1.20	73	Metal Loss	TBit	SK	Non Inspection Side
3998	94	45.16	99.61	1.78	0.73	74	Metal Loss	TBit	SK	Non Inspection Side
3999	94	13.70	103.66	1.34	0.56	75	Metal Loss	TBit	SK / CA	Inspection Side
4000	94	15.67	97.56	1.26	0.66	80	Metal Loss	TBit	SK / CA	Inspection Side
4001	94	32.13	54.65	1.27	0.33	89	Metal Loss	TBit	SK	Inspection Side
4002	94	59.92	27.76	1.08	0.37	97	Metal Loss	TBit	SK	Inspection Side
4003	94	61.22	101.93	1.17	0.81	97	Metal Loss	TBit	SK	Inspection Side
4004	94	42.44	125.35	1.23	0.83	97	Metal Loss	TBit	SK / CA	Inspection Side
4005	95	9.49	170.24	0.72	0.37	49	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4006	95	13.86	13.78	0.74	0.44	49	Metal Loss	TBit	SK	Inspection Side
4007	95	10.71	237.32	0.77	0.36	49	Metal Loss	TBit	SK	Inspection Side
4008	95	53.82	51.73	1.44	0.60	49	Metal Loss	TBit	SK	Inspection Side
4009	95	51.50	222.83	0.52	0.39	50	Metal Loss	TBit	SK	Inspection Side
4010	95	38.43	114.72	0.65	0.51	50	Metal Loss	TBit	SK	Inspection Side
4011	95	52.83	234.06	1.12	0.55	50	Metal Loss	TBit	SK	Inspection Side
4012	95	29.02	183.07	1.14	0.90	50	Metal Loss	TBit	SK	Inspection Side
4013	95	9.02	143.62	1.75	0.84	50	Metal Loss	TBit	SK	Inspection Side
4014	95	15.91	172.64	0.49	0.41	51	Metal Loss	TBit	SK	Inspection Side
4015	95	30.12	154.33	0.57	0.33	51	Metal Loss	TBit	SK	Inspection Side
4016	95	43.39	199.25	0.68	0.31	51	Metal Loss	TBit	SK	Inspection Side
4017	95	56.81	185.98	0.74	0.59	51	Metal Loss	TBit	SK	Inspection Side
4018	95	50.43	48.43	0.82	0.36	51	Metal Loss	TBit	SK	Inspection Side
4019	95	44.41	205.35	0.90	0.59	51	Metal Loss	TBit	SK	Inspection Side
4020	95	50.79	216.42	0.90	0.30	51	Metal Loss	TBit	SK	Inspection Side
4021	95	52.40	199.92	0.98	0.29	51	Metal Loss	TBit	SK	Inspection Side
4022	95	8.90	232.64	1.18	0.41	51	Metal Loss	TBit	SK	Inspection Side
4023	95	53.07	221.89	1.85	0.61	51	Metal Loss	TBit	SK	Inspection Side
4024	95	25.59	100.51	3.02	0.65	51	Metal Loss	TBit	SK	Inspection Side
4025	95	40.31	175.55	0.65	0.43	52	Metal Loss	TBit	SK	Inspection Side
4026	95	12.32	231.42	0.87	0.30	52	Metal Loss	TBit	SK	Non Inspection Side
4027	95	53.50	230.47	1.56	0.82	52	Metal Loss	TBit	SK	Non Inspection Side
4028	95	23.66	79.61	1.91	0.60	52	Metal Loss	TBit	SK	Inspection Side
4029	95	7.95	155.83	0.50	0.36	53	Metal Loss	TBit	SK	Inspection Side
4030	95	5.08	158.19	0.59	0.46	53	Metal Loss	TBit	SK	Inspection Side
4031	95	53.43	183.54	0.80	0.43	53	Metal Loss	TBit	SK	Inspection Side
4032	95	60.51	62.32	1.04	0.58	53	Metal Loss	TBit	SK	Inspection Side
4033	95	23.19	40.12	1.07	0.54	53	Metal Loss	TBit	SK	Inspection Side
4034	95	56.18	112.72	1.42	0.76	53	Metal Loss	TBit	SK	Inspection Side
4035	95	26.57	178.35	0.62	0.34	54	Metal Loss	TBit	SK	Inspection Side
4036	95	40.55	167.83	0.80	0.28	54	Metal Loss	TBit	SK	Inspection Side
4037	95	57.91	233.58	0.81	0.32	54	Metal Loss	TBit	SK	Inspection Side
4038	95	52.72	77.17	0.97	0.53	54	Metal Loss	TBit	SK	Inspection Side
4039	95	53.66	220.87	0.61	0.47	55	Metal Loss	TBit	SK	Inspection Side
4040	95	51.06	200.79	0.72	0.43	55	Metal Loss	TBit	SK	Inspection Side
4041	95	27.13	174.80	0.73	0.38	55	Metal Loss	TBit	SK	Inspection Side
4042	95	42.72	163.54	0.71	0.47	56	Metal Loss	TBit	SK	Inspection Side
4043	95	18.19	12.52	0.81	0.50	56	Metal Loss	TBit	SK	Inspection Side
4044	95	19.25	175.94	1.31	0.69	56	Metal Loss	TBit	SK	Inspection Side
4045	95	51.02	39.65	1.64	0.65	56	Metal Loss	TBit	SK	Inspection Side
4046	95	52.72	238.03	0.48	0.33	57	Metal Loss	TBit	SK	Non Inspection Side
4047	95	44.41	193.98	0.83	0.32	57	Metal Loss	TBit	SK	Inspection Side
4048	95	17.80	167.01	0.93	0.51	57	Metal Loss	TBit	SK	Inspection Side
4049	95	17.56	236.18	2.03	0.37	57	Metal Loss	TBit	SK	Inspection Side
4050	95	51.42	179.80	0.44	0.35	58	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4051	95	37.99	163.35	0.65	0.35	58	Metal Loss	TBit	SK	Inspection Side
4052	95	52.95	201.26	0.68	0.31	58	Metal Loss	TBit	SK	Inspection Side
4053	95	55.59	170.47	0.79	0.32	58	Metal Loss	TBit	SK	Inspection Side
4054	95	30.67	183.27	1.02	1.20	58	Metal Loss	TBit	SK	Non Inspection Side
4055	95	61.38	198.62	1.12	0.85	58	Metal Loss	TBit	SK	Non Inspection Side
4056	95	43.27	187.48	0.74	0.43	59	Metal Loss	TBit	SK	Inspection Side
4057	95	31.85	165.39	0.88	0.46	59	Metal Loss	TBit	SK	Inspection Side
4058	95	47.80	228.15	1.15	0.60	59	Metal Loss	TBit	SK	Inspection Side
4059	95	57.95	194.06	1.21	0.39	59	Metal Loss	TBit	SK	Inspection Side
4060	95	6.50	220.04	2.09	0.66	59	Metal Loss	TBit	SK	Inspection Side
4061	95	7.17	162.40	0.63	0.42	60	Metal Loss	TBit	SK	Inspection Side
4062	95	60.39	216.50	0.81	0.49	60	Metal Loss	TBit	SK	Inspection Side
4063	95	41.69	198.07	0.85	0.38	60	Metal Loss	TBit	SK	Inspection Side
4064	95	53.94	39.41	0.86	0.66	60	Metal Loss	TBit	SK	Inspection Side
4065	95	55.20	226.38	0.95	0.57	60	Metal Loss	TBit	SK	Inspection Side
4066	95	17.09	150.08	1.90	0.59	60	Metal Loss	TBit	SK	Inspection Side
4067	95	47.76	112.40	0.60	0.46	61	Metal Loss	TBit	SK	Inspection Side
4068	95	56.73	168.82	0.73	0.36	61	Metal Loss	TBit	SK	Inspection Side
4069	95	20.98	74.96	1.15	0.53	61	Metal Loss	TBit	SK	Inspection Side
4070	95	16.26	73.78	2.22	0.41	61	Metal Loss	TBit	SK	Non Inspection Side
4071	95	7.99	234.17	0.75	0.41	62	Metal Loss	TBit	SK	Inspection Side
4072	95	60.55	90.35	1.05	0.41	62	Metal Loss	TBit	SK	Inspection Side
4073	95	47.20	215.91	1.06	0.49	62	Metal Loss	TBit	SK	Non Inspection Side
4074	95	47.76	162.72	0.82	0.40	63	Metal Loss	TBit	SK	Inspection Side
4075	95	23.43	63.78	0.91	0.36	63	Metal Loss	TBit	SK	Inspection Side
4076	95	56.38	167.87	0.70	0.38	64	Metal Loss	TBit	SK	Inspection Side
4077	95	58.94	42.17	0.71	0.30	64	Metal Loss	TBit	SK	Inspection Side
4078	95	35.39	178.98	0.87	0.42	64	Metal Loss	TBit	SK	Inspection Side
4079	95	16.06	59.88	1.13	0.53	64	Metal Loss	TBit	SK	Inspection Side
4080	95	19.29	175.94	1.25	0.70	64	Metal Loss	TBit	SK	Inspection Side
4081	95	28.27	45.71	1.29	0.42	64	Metal Loss	TBit	SK	Inspection Side
4082	95	19.80	64.53	1.07	0.40	65	Metal Loss	TBit	SK	Inspection Side
4083	95	47.20	219.02	1.09	0.45	65	Metal Loss	TBit	SK	Inspection Side
4084	95	45.47	15.35	1.15	0.52	65	Metal Loss	TBit	SK	Inspection Side
4085	95	44.49	96.65	1.24	0.71	65	Metal Loss	TBit	SK	Inspection Side
4086	95	54.13	213.94	0.91	0.56	66	Metal Loss	TBit	SK	Inspection Side
4087	95	27.60	44.06	1.02	0.40	66	Metal Loss	TBit	SK	Inspection Side
4088	95	10.71	148.31	0.47	0.37	67	Metal Loss	TBit	SK	Inspection Side
4089	95	16.50	141.97	1.01	0.60	68	Metal Loss	TBit	SK	Inspection Side
4090	95	14.09	12.52	1.40	1.16	68	Metal Loss	TBit	SK	Inspection Side
4091	95	19.29	100.28	0.73	0.50	69	Metal Loss	TBit	SK	Inspection Side
4092	95	56.73	100.98	1.00	0.42	69	Metal Loss	TBit	SK	Inspection Side
4093	95	36.42	170.98	1.03	0.34	69	Metal Loss	TBit	SK	Inspection Side
4094	95	36.18	167.80	1.66	0.85	69	Metal Loss	TBit	SK	Non Inspection Side
4095	95	18.66	96.10	0.86	0.35	70	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4096	95	18.98	40.98	1.12	0.37	70	Metal Loss	TBit	SK	Inspection Side
4097	95	11.57	166.14	0.70	0.36	71	Metal Loss	TBit	SK	Inspection Side
4098	95	17.40	178.98	0.77	0.47	72	Metal Loss	TBit	SK	Inspection Side
4099	95	18.98	151.26	0.85	0.43	72	Metal Loss	TBit	SK	Inspection Side
4100	95	15.94	101.54	1.65	0.51	72	Metal Loss	TBit	SK	Non Inspection Side
4101	95	60.20	86.85	1.06	0.40	73	Metal Loss	TBit	SK	Inspection Side
4102	95	57.95	175.59	0.78	0.40	75	Metal Loss	TBit	SK	Inspection Side
4103	95	21.97	161.54	0.80	0.31	75	Metal Loss	TBit	SK	Inspection Side
4104	95	29.02	39.02	0.96	0.37	76	Metal Loss	TBit	SK	Inspection Side
4105	95	15.79	12.72	1.32	1.22	76	Metal Loss	TBit	SK	Inspection Side
4106	95	31.93	180.87	1.53	0.73	77	Metal Loss	TBit	SK	Inspection Side
4107	95	52.40	186.57	1.13	0.58	78	Metal Loss	TBit	SK	Inspection Side
4108	95	15.79	71.85	1.28	0.43	78	Metal Loss	TBit	SK	Inspection Side
4109	95	31.89	180.94	1.41	0.70	78	Metal Loss	TBit	SK	Inspection Side
4110	95	11.93	237.64	1.69	0.42	78	Metal Loss	TBit	SK	Inspection Side
4111	95	30.24	44.25	0.86	0.40	79	Metal Loss	TBit	SK	Inspection Side
4112	95	47.32	213.27	1.16	1.56	79	Metal Loss	TBit	SK	Non Inspection Side
4113	95	56.18	179.09	0.87	0.38	80	Metal Loss	TBit	SK	Inspection Side
4114	95	21.57	100.43	0.61	0.34	84	Metal Loss	TBit	SK	Inspection Side
4115	95	15.24	11.57	1.53	0.82	85	Metal Loss	TBit	SK	Inspection Side
4116	95	20.91	153.46	0.98	0.51	90	Metal Loss	TBit	SK	Inspection Side
4117	95	61.14	96.38	0.91	0.42	95	Metal Loss	TBit	SK	Inspection Side
4118	95	11.93	237.56	1.56	0.39	96	Metal Loss	TBit	SK	Inspection Side
4119	95	53.07	101.18	1.16	0.45	97	Metal Loss	TBit	SK	Inspection Side
4120	95	52.13	181.06	1.22	0.99	97	Metal Loss	TBit	SK	Inspection Side
4121	95	47.01	225.04	1.35	0.86	98	Metal Loss	TBit	SK	Inspection Side
4122	95	42.09	223.58	1.63	0.71	98	Metal Loss	TBit	SK	Inspection Side
4123	95	45.43	213.03	1.74	0.76	98	Metal Loss	TBit	SK	Inspection Side
4124	96	17.91	193.94	0.44	0.28	49	Metal Loss	TBit	SK	Inspection Side
4125	96	21.57	198.50	0.73	0.33	49	Metal Loss	TBit	SK	Inspection Side
4126	96	22.80	198.78	0.82	0.35	49	Metal Loss	TBit	SK	Inspection Side
4127	96	54.69	171.30	0.91	0.28	49	Metal Loss	TBit	SK	Inspection Side
4128	96	46.89	105.47	0.97	0.52	49	Metal Loss	TBit	SK	Inspection Side
4129	96	19.25	177.20	1.08	0.60	49	Metal Loss	TBit	SK	Inspection Side
4130	96	23.07	234.29	1.36	0.57	49	Metal Loss	TBit	SK	Inspection Side
4131	96	46.50	122.20	1.38	0.22	49	Metal Loss	TBit	SK	Inspection Side
4132	96	35.00	24.69	0.82	0.28	50	Metal Loss	TBit	SK	Inspection Side
4133	96	19.13	200.12	0.93	0.42	50	Metal Loss	TBit	SK	Inspection Side
4134	96	34.21	30.94	1.00	0.41	50	Metal Loss	TBit	SK	Inspection Side
4135	96	23.66	200.43	1.03	0.49	50	Metal Loss	TBit	SK	Inspection Side
4136	96	23.07	230.28	1.14	0.26	50	Metal Loss	TBit	SK	Inspection Side
4137	96	31.65	108.66	1.14	0.27	50	Metal Loss	TBit	SK	Inspection Side
4138	96	44.53	174.06	1.16	0.63	50	Metal Loss	TBit	SK	Inspection Side
4139	96	31.61	81.14	1.28	0.27	50	Metal Loss	TBit	SK	Inspection Side
4140	96	24.49	224.49	1.41	0.73	50	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4141	96	17.80	190.59	1.48	0.39	50	Metal Loss	TBit	SK	Inspection Side
4142	96	34.41	59.65	1.81	0.90	50	Metal Loss	TBit	SK	Inspection Side
4143	96	37.40	179.09	0.83	0.47	51	Metal Loss	TBit	SK	Inspection Side
4144	96	62.80	220.75	0.86	0.38	51	Metal Loss	TBit	SK	Non Inspection Side
4145	96	33.70	180.39	0.93	0.40	51	Metal Loss	TBit	SK	Inspection Side
4146	96	17.36	218.23	1.13	0.59	51	Metal Loss	TBit	SK	Inspection Side
4147	96	39.09	22.05	1.23	0.67	51	Metal Loss	TBit	SK	Inspection Side
4148	96	33.43	13.50	1.41	0.37	51	Metal Loss	TBit	SK	Inspection Side
4149	96	31.89	222.95	0.66	0.44	52	Metal Loss	TBit	SK	Inspection Side
4150	96	42.01	23.94	0.68	0.31	52	Metal Loss	TBit	SK	Inspection Side
4151	96	8.62	20.79	0.82	0.49	52	Metal Loss	TBit	SK	Inspection Side
4152	96	20.24	197.83	0.82	0.37	52	Metal Loss	TBit	SK	Inspection Side
4153	96	45.79	66.77	0.96	0.35	52	Metal Loss	TBit	SK	Inspection Side
4154	96	15.59	186.18	1.07	0.46	52	Metal Loss	TBit	SK	Inspection Side
4155	96	22.09	200.08	1.09	0.41	52	Metal Loss	TBit	SK	Inspection Side
4156	96	58.78	220.04	1.67	0.56	52	Metal Loss	TBit	SK	Inspection Side
4157	96	17.32	215.63	0.84	0.28	53	Metal Loss	TBit	SK	Inspection Side
4158	96	9.21	10.71	0.84	0.47	53	Metal Loss	TBit	SK	Inspection Side
4159	96	33.70	116.46	0.92	0.34	53	Metal Loss	TBit	SK	Inspection Side
4160	96	44.45	166.85	0.93	0.24	53	Metal Loss	TBit	SK	Inspection Side
4161	96	46.14	23.39	1.03	0.19	53	Metal Loss	TBit	SK	Inspection Side
4162	96	20.47	197.24	1.24	0.53	53	Metal Loss	TBit	SK	Inspection Side
4163	96	21.42	181.30	1.36	0.40	53	Metal Loss	TBit	SK	Inspection Side
4164	96	45.12	118.03	1.55	0.31	53	Metal Loss	TBit	SK	Inspection Side
4165	96	26.89	204.65	0.78	0.30	54	Metal Loss	TBit	SK	Inspection Side
4166	96	45.35	41.46	1.11	0.25	54	Metal Loss	TBit	SK	Inspection Side
4167	96	55.47	107.64	3.03	0.41	54	Metal Loss	TBit	SK	Inspection Side
4168	96	22.01	219.49	0.88	0.77	55	Metal Loss	TBit	SK	Inspection Side
4169	96	25.16	207.44	1.07	0.30	55	Metal Loss	TBit	SK	Inspection Side
4170	96	14.33	223.78	1.09	0.41	55	Metal Loss	TBit	SK	Inspection Side
4171	96	19.80	213.27	0.87	0.31	56	Metal Loss	TBit	SK	Inspection Side
4172	96	31.06	113.90	1.57	0.37	56	Metal Loss	TBit	SK	Inspection Side
4173	96	9.92	200.12	0.47	0.47	57	Metal Loss	TBit	SK	Inspection Side
4174	96	27.87	237.17	0.79	0.44	57	Metal Loss	TBit	SK	Inspection Side
4175	96	34.61	72.05	0.94	0.34	57	Metal Loss	TBit	SK	Inspection Side
4176	96	32.87	106.65	1.00	0.32	57	Metal Loss	TBit	SK	Inspection Side
4177	96	17.52	195.67	1.27	0.33	57	Metal Loss	TBit	SK	Inspection Side
4178	96	36.61	65.24	0.64	0.44	58	Metal Loss	TBit	SK	Inspection Side
4179	96	33.07	217.40	1.21	0.39	58	Metal Loss	TBit	SK	Inspection Side
4180	96	42.40	10.67	1.27	0.43	58	Metal Loss	TBit	SK	Inspection Side
4181	96	26.30	238.66	1.41	0.71	59	Metal Loss	TBit	SK	Inspection Side
4182	96	31.06	117.76	1.59	0.52	59	Metal Loss	TBit	SK	Inspection Side
4183	96	23.35	200.55	0.64	0.32	60	Metal Loss	TBit	SK	Inspection Side
4184	96	15.83	195.16	0.82	0.36	60	Metal Loss	TBit	SK	Inspection Side
4185	96	57.28	227.91	0.89	0.40	60	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4186	96	34.25	49.84	0.93	0.28	60	Metal Loss	TBit	SK	Inspection Side
4187	96	44.53	18.66	0.94	0.39	60	Metal Loss	TBit	SK	Inspection Side
4188	96	29.84	186.50	1.56	0.45	61	Metal Loss	TBit	SK	Inspection Side
4189	96	38.62	151.26	0.79	0.31	62	Metal Loss	TBit	SK	Inspection Side
4190	96	15.83	198.35	0.79	0.64	62	Metal Loss	TBit	SK	Inspection Side
4191	96	23.78	203.07	1.04	0.37	62	Metal Loss	TBit	SK	Inspection Side
4192	96	20.94	198.46	0.95	0.45	63	Metal Loss	TBit	SK	Inspection Side
4193	96	30.98	150.43	1.44	0.67	63	Metal Loss	TBit	SK	Inspection Side
4194	96	25.20	203.46	0.96	0.40	64	Metal Loss	TBit	SK	Inspection Side
4195	96	33.31	18.74	1.00	0.36	64	Metal Loss	TBit	SK	Inspection Side
4196	96	32.28	97.05	1.09	1.32	64	Metal Loss	TBit	SK	Inspection Side
4197	96	45.35	101.34	1.19	1.31	64	Metal Loss	TBit	SK	Inspection Side
4198	96	34.25	135.12	1.23	0.39	65	Metal Loss	TBit	SK	Inspection Side
4199	96	46.10	103.86	1.11	0.29	66	Metal Loss	TBit	SK	Inspection Side
4200	96	20.39	197.24	0.46	0.42	67	Metal Loss	TBit	SK	Inspection Side
4201	96	35.16	52.48	0.89	0.36	67	Metal Loss	TBit	SK	Inspection Side
4202	96	63.62	59.29	2.35	1.18	67	Metal Loss	TBit	SK	Inspection Side
4203	96	30.39	179.49	1.21	0.46	69	Metal Loss	TBit	SK	Inspection Side
4204	96	31.06	101.85	1.58	0.65	69	Metal Loss	TBit	SK	Inspection Side
4205	96	42.95	231.69	1.23	0.38	70	Metal Loss	TBit	SK	Inspection Side
4206	96	24.49	206.06	0.93	0.38	72	Metal Loss	TBit	SK	Inspection Side
4207	96	21.10	179.21	1.20	0.44	72	Metal Loss	TBit	SK	Inspection Side
4208	96	22.44	196.30	0.94	0.42	73	Metal Loss	TBit	SK	Inspection Side
4209	96	44.53	58.82	1.05	0.34	78	Metal Loss	TBit	SK	Inspection Side
4210	96	32.64	221.85	1.08	0.44	79	Metal Loss	TBit	SK	Inspection Side
4211	96	30.91	113.94	1.00	0.43	84	Metal Loss	TBit	SK	Inspection Side
4212	96	16.57	220.94	1.22	0.88	85	Metal Loss	TBit	SK	Inspection Side
4213	96	32.99	105.08	0.92	0.38	86	Metal Loss	TBit	SK	Inspection Side
4214	96	17.24	201.69	1.58	0.41	88	Metal Loss	TBit	SK	Inspection Side
4215	97	36.14	25.08	0.51	0.36	49	Metal Loss	TBit	SK	Inspection Side
4216	97	22.91	142.68	0.54	0.33	49	Metal Loss	TBit	SK	Inspection Side
4217	97	47.95	27.95	0.66	0.51	49	Metal Loss	TBit	SK	Inspection Side
4218	97	17.44	15.55	0.69	0.22	49	Metal Loss	TBit	SK	Inspection Side
4219	97	59.17	61.61	0.77	0.84	49	Metal Loss	TBit	SK	Inspection Side
4220	97	45.16	46.65	0.91	0.28	49	Metal Loss	TBit	SK	Inspection Side
4221	97	45.51	15.00	1.08	0.54	49	Metal Loss	TBit	SK	Inspection Side
4222	97	36.26	18.27	1.17	0.66	49	Metal Loss	TBit	SK	Inspection Side
4223	97	16.22	191.57	1.19	0.18	49	Metal Loss	TBit	SK	Inspection Side
4224	97	45.00	78.19	1.25	0.77	49	Metal Loss	TBit	SK	Inspection Side
4225	97	21.54	196.46	1.74	0.94	49	Metal Loss	TBit	SK	Inspection Side
4226	97	59.02	37.13	0.68	0.49	50	Metal Loss	TBit	SK	Inspection Side
4227	97	16.81	71.14	0.87	0.30	50	Metal Loss	TBit	SK	Inspection Side
4228	97	24.02	172.76	1.01	0.32	50	Metal Loss	TBit	SK	Inspection Side
4229	97	20.00	72.52	1.28	0.53	50	Metal Loss	TBit	SK	Inspection Side
4230	97	56.73	42.99	1.55	0.51	50	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4231	97	63.78	219.25	0.61	0.34	51	Metal Loss	TBit	SK	Inspection Side
4232	97	21.93	209.53	0.94	0.36	51	Metal Loss	TBit	SK	Inspection Side
4233	97	19.21	24.29	1.13	0.49	51	Metal Loss	TBit	SK	Inspection Side
4234	97	18.19	221.18	1.29	0.33	52	Metal Loss	TBit	SK	Inspection Side
4235	97	10.12	17.68	1.33	0.33	52	Metal Loss	TBit	SK	Inspection Side
4236	97	30.04	43.90	1.77	0.71	52	Metal Loss	TBit	SK	Inspection Side
4237	97	13.62	21.77	0.40	0.41	53	Metal Loss	TBit	SK	Inspection Side
4238	97	47.01	42.99	0.70	0.40	53	Metal Loss	TBit	SK	Inspection Side
4239	97	14.69	10.08	0.91	0.38	53	Metal Loss	TBit	SK	Inspection Side
4240	97	36.14	19.96	0.91	0.44	53	Metal Loss	TBit	SK	Inspection Side
4241	97	19.21	203.43	0.85	0.70	54	Metal Loss	TBit	SK	Inspection Side
4242	97	19.09	188.78	0.86	0.49	54	Metal Loss	TBit	SK	Inspection Side
4243	97	19.21	192.36	1.00	0.43	54	Metal Loss	TBit	SK	Inspection Side
4244	97	30.91	40.55	1.03	0.37	54	Metal Loss	TBit	SK	Inspection Side
4245	97	53.86	30.94	1.19	0.86	54	Metal Loss	TBit	SK	Inspection Side
4246	97	28.11	26.22	0.57	0.38	55	Metal Loss	TBit	SK	Inspection Side
4247	97	51.54	20.63	0.62	0.39	55	Metal Loss	TBit	SK	Inspection Side
4248	97	59.13	198.78	0.94	0.53	55	Metal Loss	TBit	SK	Inspection Side
4249	97	16.73	103.94	1.09	0.30	55	Metal Loss	TBit	SK	Inspection Side
4250	97	19.72	16.54	1.31	0.42	55	Metal Loss	TBit	SK	Inspection Side
4251	97	56.85	37.95	0.47	0.31	56	Metal Loss	TBit	SK	Inspection Side
4252	97	8.23	14.49	0.72	0.37	56	Metal Loss	TBit	SK	Inspection Side
4253	97	17.20	215.39	1.01	0.58	57	Metal Loss	TBit	SK	Inspection Side
4254	97	18.43	87.36	1.40	0.73	57	Metal Loss	TBit	SK	Inspection Side
4255	97	62.72	41.73	0.48	0.35	58	Metal Loss	TBit	SK	Inspection Side
4256	97	67.72	221.02	0.76	0.36	59	Metal Loss	TBit	SK	Inspection Side
4257	97	32.40	106.65	1.12	0.52	59	Metal Loss	TBit	SK	Inspection Side
4258	97	34.76	21.81	0.72	0.45	62	Metal Loss	TBit	SK	Inspection Side
4259	97	22.52	94.80	1.05	0.41	62	Metal Loss	TBit	SK	Inspection Side
4260	97	17.87	163.74	1.05	0.23	62	Metal Loss	TBit	SK	Inspection Side
4261	97	32.32	41.77	1.33	0.61	62	Metal Loss	TBit	SK	Non Inspection Side
4262	97	16.06	141.97	1.63	1.04	62	Metal Loss	TBit	SK	Inspection Side
4263	97	20.00	96.69	1.00	0.39	64	Metal Loss	TBit	SK	Inspection Side
4264	97	17.87	18.70	1.10	0.60	64	Metal Loss	TBit	SK	Inspection Side
4265	97	24.80	28.50	1.23	1.10	64	Metal Loss	TBit	SK	Inspection Side
4266	97	11.89	27.36	0.67	0.46	66	Metal Loss	TBit	SK	Inspection Side
4267	97	11.93	153.43	0.77	0.39	66	Metal Loss	TBit	SK	Inspection Side
4268	97	19.53	56.02	0.97	0.31	66	Metal Loss	TBit	SK	Inspection Side
4269	97	21.61	202.40	1.37	0.52	66	Metal Loss	TBit	SK	Inspection Side
4270	97	17.87	12.17	0.64	0.32	67	Metal Loss	TBit	SK	Inspection Side
4271	97	54.33	55.00	0.40	0.33	68	Metal Loss	TBit	SK	Inspection Side
4272	97	58.15	43.15	0.88	0.42	68	Metal Loss	TBit	SK	Inspection Side
4273	97	31.42	11.26	1.16	0.52	69	Metal Loss	TBit	SK	Inspection Side
4274	97	15.94	56.73	1.17	0.34	69	Metal Loss	TBit	SK	Inspection Side
4275	97	58.03	161.50	0.86	0.33	70	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4276	97	16.30	101.97	1.18	0.45	70	Metal Loss	TBit	SK	Inspection Side
4277	97	17.64	57.95	1.64	0.47	71	Metal Loss	TBit	SK	Inspection Side
4278	97	16.54	165.47	1.27	0.56	72	Metal Loss	TBit	SK	Inspection Side
4279	97	57.83	189.37	1.30	0.59	72	Metal Loss	TBit	SK	Inspection Side
4280	97	55.43	49.96	0.56	1.00	73	Metal Loss	TBit	SK	Inspection Side
4281	97	44.92	17.83	1.03	0.33	77	Metal Loss	TBit	SK	Inspection Side
4282	97	19.02	98.31	0.96	0.51	81	Metal Loss	TBit	SK	Inspection Side
4283	97	32.32	56.89	1.31	0.36	81	Metal Loss	TBit	SK	Inspection Side
4284	97	32.28	20.16	1.36	0.33	82	Metal Loss	TBit	SK	Inspection Side
4285	97	16.30	66.77	1.04	0.40	85	Metal Loss	TBit	SK	Inspection Side
4286	97	55.98	49.88	0.37	1.18	87	Metal Loss	TBit	SK	Inspection Side
4287	97	22.91	32.20	1.79	0.66	91	Metal Loss	TBit	SK	Inspection Side
4288	97	29.13	42.09	1.76	1.11	97	Metal Loss	TBit	SK	Inspection Side
4289	97	21.38	204.29	1.38	0.57	98	Metal Loss	TBit	SK	Inspection Side
4290	98	54.96	63.90	0.61	0.44	49	Metal Loss	TBit	SK	Inspection Side
4291	98	5.12	27.32	0.67	0.55	49	Metal Loss	TBit	SK	Inspection Side
4292	98	15.16	66.61	0.72	0.24	49	Metal Loss	TBit	SK	Inspection Side
4293	98	13.46	163.78	0.84	0.43	49	Metal Loss	TBit	SK	Inspection Side
4294	98	45.39	67.36	0.89	0.23	49	Metal Loss	TBit	SK	Inspection Side
4295	98	19.06	172.24	1.06	0.44	49	Metal Loss	TBit	SK / CA	Inspection Side
4296	98	17.36	42.20	1.23	0.32	49	Metal Loss	TBit	SK	Inspection Side
4297	98	7.80	27.52	0.49	0.40	50	Metal Loss	TBit	SK	Inspection Side
4298	98	22.87	75.63	0.81	0.31	50	Metal Loss	TBit	SK	Inspection Side
4299	98	10.12	17.32	0.82	0.47	50	Metal Loss	TBit	SK	Inspection Side
4300	98	34.41	17.32	0.82	0.29	50	Metal Loss	TBit	SK	Inspection Side
4301	98	31.54	149.69	1.06	0.43	50	Metal Loss	TBit	SK	Inspection Side
4302	98	12.91	180.24	1.22	0.49	50	Metal Loss	TBit	SK / CA	Inspection Side
4303	98	60.43	115.59	1.42	0.71	50	Metal Loss	TBit	SK	Inspection Side
4304	98	45.28	157.48	1.44	2.09	50	Metal Loss	TBit	SK / CA	Non Inspection Side
4305	98	57.95	124.13	0.72	0.48	51	Metal Loss	TBit	SK	Inspection Side
4306	98	11.65	12.28	0.73	0.36	51	Metal Loss	TBit	SK	Inspection Side
4307	98	15.12	52.91	1.09	0.60	51	Metal Loss	TBit	SK	Inspection Side
4308	98	11.89	170.39	1.16	0.46	51	Metal Loss	TBit	SK	Inspection Side
4309	98	46.14	22.24	1.49	0.51	51	Metal Loss	TBit	SK	Inspection Side
4310	98	38.98	125.79	0.65	0.40	52	Metal Loss	TBit	SK	Inspection Side
4311	98	15.16	69.41	0.76	0.23	52	Metal Loss	TBit	SK	Inspection Side
4312	98	18.58	40.67	0.84	0.34	52	Metal Loss	TBit	SK	Inspection Side
4313	98	21.42	76.77	0.93	0.61	52	Metal Loss	TBit	SK	Inspection Side
4314	98	15.43	97.68	1.69	0.83	52	Metal Loss	TBit	SK	Non Inspection Side
4315	98	21.61	66.85	0.41	0.35	53	Metal Loss	TBit	SK	Inspection Side
4316	98	20.16	97.52	0.73	0.52	53	Metal Loss	TBit	SK	Inspection Side
4317	98	31.77	43.54	1.06	1.31	53	Metal Loss	TBit	SK	Non Inspection Side
4318	98	16.85	27.64	0.67	0.48	54	Metal Loss	TBit	SK	Inspection Side
4319	98	21.61	126.85	0.73	0.38	54	Metal Loss	TBit	SK	Inspection Side
4320	98	15.08	52.09	0.78	0.38	54	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4321	98	44.84	130.43	1.05	0.27	54	Metal Loss	TBit	SK	Inspection Side
4322	98	51.26	32.48	1.24	0.80	54	Metal Loss	TBit	SK	Inspection Side
4323	98	21.46	154.02	0.58	0.32	55	Metal Loss	TBit	SK	Inspection Side
4324	98	50.55	144.25	0.68	0.31	55	Metal Loss	TBit	SK / CA	Inspection Side
4325	98	15.16	54.29	1.17	0.55	55	Metal Loss	TBit	SK	Inspection Side
4326	98	23.78	76.77	1.75	0.85	55	Metal Loss	TBit	SK	Inspection Side
4327	98	39.84	17.95	0.72	0.48	56	Metal Loss	TBit	SK	Inspection Side
4328	98	56.65	28.11	0.93	0.43	56	Metal Loss	TBit	SK	Inspection Side
4329	98	31.73	40.98	1.16	0.74	56	Metal Loss	TBit	SK	Non Inspection Side
4330	98	22.95	35.16	1.17	0.84	56	Metal Loss	TBit	SK	Inspection Side
4331	98	60.47	114.21	1.38	0.75	56	Metal Loss	TBit	SK	Non Inspection Side
4332	98	20.12	102.52	0.64	0.47	57	Metal Loss	TBit	SK	Inspection Side
4333	98	45.35	120.91	1.34	1.00	57	Metal Loss	TBit	SK	Non Inspection Side
4334	98	7.48	20.47	0.87	0.42	58	Metal Loss	TBit	SK	Inspection Side
4335	98	21.73	89.06	0.89	0.53	58	Metal Loss	TBit	SK	Inspection Side
4336	98	15.47	182.20	0.67	0.46	59	Metal Loss	TBit	SK / CA	Inspection Side
4337	98	7.01	162.36	0.84	0.44	59	Metal Loss	TBit	SK	Inspection Side
4338	98	56.34	83.86	0.85	0.57	59	Metal Loss	TBit	SK	Inspection Side
4339	98	17.83	22.32	1.07	0.49	59	Metal Loss	TBit	SK	Inspection Side
4340	98	44.96	23.78	1.29	0.25	60	Metal Loss	TBit	SK	Inspection Side
4341	98	51.69	35.20	1.88	0.62	60	Metal Loss	TBit	SK	Inspection Side
4342	98	61.34	87.36	1.28	0.42	61	Metal Loss	TBit	SK	Non Inspection Side
4343	98	60.24	46.30	0.56	0.45	63	Metal Loss	TBit	SK	Inspection Side
4344	98	41.30	156.34	0.61	0.48	63	Metal Loss	TBit	SK / CA	Inspection Side
4345	98	15.12	42.44	1.09	0.37	63	Metal Loss	TBit	SK	Inspection Side
4346	98	20.12	153.15	1.26	0.44	63	Metal Loss	TBit	SK	Inspection Side
4347	98	57.05	46.38	0.75	0.53	64	Metal Loss	TBit	SK	Inspection Side
4348	98	61.06	121.06	1.95	0.54	67	Metal Loss	TBit	SK	Non Inspection Side
4349	98	61.06	128.31	0.91	0.43	68	Metal Loss	TBit	SK / CA	Inspection Side
4350	98	22.44	49.13	1.18	0.58	68	Metal Loss	TBit	SK	Inspection Side
4351	98	45.71	34.80	0.75	0.51	69	Metal Loss	TBit	SK	Inspection Side
4352	98	14.13	180.31	0.84	0.40	70	Metal Loss	TBit	SK / CA	Inspection Side
4353	98	31.97	105.04	0.70	0.37	71	Metal Loss	TBit	SK	Inspection Side
4354	98	61.26	98.50	1.54	0.78	71	Metal Loss	TBit	SK	Non Inspection Side
4355	98	45.79	129.25	0.95	0.34	72	Metal Loss	TBit	SK	Inspection Side
4356	98	60.20	121.38	0.83	1.57	73	Metal Loss	TBit	SK	Non Inspection Side
4357	98	20.55	89.17	0.43	0.31	74	Metal Loss	TBit	SK	Inspection Side
4358	98	50.59	63.82	1.36	0.67	74	Metal Loss	TBit	SK	Inspection Side
4359	98	61.26	111.81	1.53	0.47	74	Metal Loss	TBit	SK	Inspection Side
4360	98	36.57	27.95	0.95	0.88	76	Metal Loss	TBit	SK	Inspection Side
4361	98	31.73	111.61	1.03	0.98	76	Metal Loss	TBit	SK	Inspection Side
4362	98	19.45	104.02	0.48	0.32	77	Metal Loss	TBit	SK	Inspection Side
4363	98	60.20	124.88	0.90	0.36	79	Metal Loss	TBit	SK	Inspection Side
4364	98	22.32	87.32	0.93	0.80	88	Metal Loss	TBit	SK	Inspection Side
4365	98	60.94	56.30	0.95	0.48	97	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4366	98	15.75	35.24	1.14	0.78	97	Metal Loss	TBit	SK	Inspection Side
4367	98	18.74	35.47	1.44	0.74	97	Metal Loss	TBit	SK	Inspection Side
4368	98	46.97	17.48	1.69	0.50	97	Metal Loss	TBit	SK	Inspection Side
4369	98	18.43	37.52	0.93	0.55	98	Metal Loss	TBit	SK	Inspection Side
4370	98	59.37	74.29	1.93	1.01	98	Metal Loss	TBit	SK	Inspection Side
4371	99	21.54	29.57	0.88	0.47	50	Metal Loss	TBit	SK	Inspection Side
4372	99	29.13	17.80	0.91	0.51	50	Metal Loss	TBit	SK	Inspection Side
4373	99	47.48	20.00	1.01	0.61	50	Metal Loss	TBit	SK	Inspection Side
4374	99	46.10	22.24	1.05	0.70	50	Metal Loss	TBit	SK	Inspection Side
4375	99	16.22	48.27	0.93	0.87	51	Metal Loss	TBit	SK	Inspection Side
4376	99	17.13	27.24	1.08	0.64	51	Metal Loss	TBit	SK	Inspection Side
4377	99	41.50	8.66	1.20	0.71	51	Metal Loss	TBit	SK	Inspection Side
4378	99	16.73	29.96	0.73	0.56	53	Metal Loss	TBit	SK	Inspection Side
4379	99	22.20	18.23	0.87	0.65	53	Metal Loss	TBit	SK	Inspection Side
4380	99	59.49	26.06	0.70	0.36	55	Metal Loss	TBit	SK / CA	Inspection Side
4381	99	15.75	30.16	1.17	0.74	57	Metal Loss	TBit	SK	Inspection Side
4382	99	54.41	14.49	0.85	0.66	60	Metal Loss	TBit	SK	Inspection Side
4383	99	29.72	20.87	0.86	0.48	60	Metal Loss	TBit	SK	Inspection Side
4384	99	50.51	14.76	0.71	0.46	62	Metal Loss	TBit	SK	Inspection Side
4385	99	20.83	16.54	1.69	0.71	62	Metal Loss	TBit	SK	Inspection Side
4386	99	18.15	25.28	0.56	0.38	64	Metal Loss	TBit	SK	Inspection Side
4387	99	29.33	64.09	0.31	0.34	65	Metal Loss	TBit	SK / CA	Inspection Side
4388	99	32.44	42.44	0.92	0.44	70	Metal Loss	TBit	SK	Inspection Side
4389	99	53.43	13.07	1.02	0.31	72	Metal Loss	TBit	SK	Inspection Side
4390	99	15.83	23.50	1.33	1.10	76	Metal Loss	TBit	SK	Inspection Side
4391	99	15.87	27.44	1.35	0.75	88	Metal Loss	TBit	SK	Inspection Side
4392	100	45.83	195.94	0.72	0.51	49	Metal Loss	TBit	SK	Inspection Side
4393	100	45.51	14.21	0.87	0.26	49	Metal Loss	TBit	SK	Inspection Side
4394	100	44.61	115.75	1.16	0.32	49	Metal Loss	TBit	SK	Inspection Side
4395	100	42.52	203.11	1.22	0.92	49	Metal Loss	TBit	SK	Inspection Side
4396	100	17.48	25.43	0.44	0.39	50	Metal Loss	TBit	SK	Inspection Side
4397	100	46.61	121.73	0.87	0.26	50	Metal Loss	TBit	SK	Inspection Side
4398	100	52.68	149.92	0.91	0.58	50	Metal Loss	TBit	SK	Inspection Side
4399	100	1.77	168.78	1.17	0.17	50	Metal Loss	TBit	SK	Inspection Side
4400	100	17.68	177.91	1.30	0.66	50	Metal Loss	TBit	SK	Inspection Side
4401	100	7.32	35.59	0.16	0.46	51	Metal Loss	TBit	SK	Inspection Side
4402	100	13.74	97.05	0.44	0.31	51	Metal Loss	TBit	SK	Inspection Side
4403	100	36.26	213.50	0.66	0.42	51	Metal Loss	TBit	SK	Inspection Side
4404	100	55.28	14.57	0.68	0.78	51	Metal Loss	TBit	SK	Inspection Side
4405	100	11.77	72.91	0.72	0.44	51	Metal Loss	TBit	SK	Inspection Side
4406	100	16.30	69.76	0.78	0.45	51	Metal Loss	TBit	SK	Inspection Side
4407	100	1.77	175.75	1.16	0.45	51	Metal Loss	TBit	SK	Inspection Side
4408	100	45.51	125.83	1.20	1.04	51	Metal Loss	TBit	SK	Inspection Side
4409	100	17.83	176.22	1.12	0.29	52	Metal Loss	TBit	SK	Inspection Side
4410	100	5.67	181.73	1.51	0.69	52	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4411	100	56.61	186.73	0.64	0.44	53	Metal Loss	TBit	SK	Inspection Side
4412	100	43.15	212.24	0.70	0.52	53	Metal Loss	TBit	SK	Inspection Side
4413	100	17.52	189.61	0.81	0.25	53	Metal Loss	TBit	SK	Inspection Side
4414	100	30.98	206.30	1.00	0.28	53	Metal Loss	TBit	SK	Inspection Side
4415	100	18.43	215.28	1.02	0.30	53	Metal Loss	TBit	SK	Inspection Side
4416	100	12.44	142.01	2.29	0.85	53	Metal Loss	TBit	SK	Inspection Side
4417	100	50.16	30.28	0.72	0.44	54	Metal Loss	TBit	SK	Inspection Side
4418	100	47.48	217.48	1.04	0.86	54	Metal Loss	TBit	SK	Inspection Side
4419	100	46.61	214.09	1.12	0.70	54	Metal Loss	TBit	SK	Inspection Side
4420	100	17.83	105.87	1.19	0.30	54	Metal Loss	TBit	SK	Inspection Side
4421	100	58.50	178.23	0.75	0.54	55	Metal Loss	TBit	SK	Inspection Side
4422	100	58.74	174.80	0.84	0.42	55	Metal Loss	TBit	SK	Inspection Side
4423	100	3.23	174.17	1.30	0.90	55	Metal Loss	TBit	SK	Inspection Side
4424	100	8.03	34.69	0.57	0.24	56	Metal Loss	TBit	SK	Inspection Side
4425	100	50.83	235.75	0.83	0.44	56	Metal Loss	TBit	SK	Inspection Side
4426	100	53.11	14.02	1.02	0.31	56	Metal Loss	TBit	SK	Inspection Side
4427	100	17.68	84.76	1.22	0.77	56	Metal Loss	TBit	SK	Inspection Side
4428	100	7.24	35.59	0.34	0.44	57	Metal Loss	TBit	SK	Inspection Side
4429	100	9.49	231.85	0.99	0.67	57	Metal Loss	TBit	SK	Inspection Side
4430	100	57.72	11.38	2.15	0.60	57	Metal Loss	TBit	SK	Inspection Side
4431	100	10.28	92.09	1.03	0.76	58	Metal Loss	TBit	SK	Inspection Side
4432	100	51.81	148.82	1.07	0.62	58	Metal Loss	TBit	SK	Inspection Side
4433	100	8.15	166.46	1.18	0.46	58	Metal Loss	TBit	SK	Inspection Side
4434	100	5.47	167.80	0.63	0.47	59	Metal Loss	TBit	SK	Inspection Side
4435	100	54.57	33.94	0.76	0.44	59	Metal Loss	TBit	SK	Inspection Side
4436	100	30.75	181.22	0.94	0.61	59	Metal Loss	TBit	SK	Inspection Side
4437	100	1.85	11.81	1.34	0.82	59	Metal Loss	TBit	SK	Inspection Side
4438	100	10.39	117.56	0.58	0.38	60	Metal Loss	TBit	SK	Inspection Side
4439	100	52.01	24.25	1.02	0.35	61	Metal Loss	TBit	SK	Inspection Side
4440	100	46.77	80.04	1.03	0.52	61	Metal Loss	TBit	SK	Inspection Side
4441	100	46.46	120.47	1.07	0.56	62	Metal Loss	TBit	SK	Inspection Side
4442	100	12.87	19.33	0.34	0.19	63	Metal Loss	TBit	SK	Inspection Side
4443	100	60.71	46.93	1.01	0.46	63	Metal Loss	TBit	SK	Inspection Side
4444	100	47.44	201.77	1.16	0.41	63	Metal Loss	TBit	SK	Inspection Side
4445	100	54.37	31.65	1.18	0.37	64	Metal Loss	TBit	SK	Inspection Side
4446	100	47.32	210.83	0.98	0.43	65	Metal Loss	TBit	SK	Inspection Side
4447	100	18.27	178.07	1.31	0.83	65	Metal Loss	TBit	SK	Inspection Side
4448	100	58.74	181.85	1.02	0.63	66	Metal Loss	TBit	SK	Inspection Side
4449	100	4.84	169.57	0.97	0.45	67	Metal Loss	TBit	SK	Inspection Side
4450	100	18.39	155.35	1.03	0.85	70	Metal Loss	TBit	SK	Inspection Side
4451	100	31.69	227.48	0.97	0.35	71	Metal Loss	TBit	SK	Inspection Side
4452	100	45.39	194.57	0.81	0.42	73	Metal Loss	TBit	SK	Inspection Side
4453	100	58.31	64.61	1.01	0.44	73	Metal Loss	TBit	SK	Inspection Side
4454	100	18.27	211.18	1.01	0.74	76	Metal Loss	TBit	SK	Inspection Side
4455	100	18.43	141.81	0.96	0.20	78	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4456	100	45.39	209.02	0.79	0.41	96	Metal Loss	TBit	SK	Inspection Side
4457	100	46.61	189.80	1.01	0.75	97	Metal Loss	TBit	SK	Inspection Side
4458	100	17.52	184.17	1.52	1.07	98	Metal Loss	TBit	SK	Inspection Side
4459	101	9.09	235.35	0.41	0.31	49	Metal Loss	TBit	SK	Inspection Side
4460	101	59.45	157.80	0.72	0.36	49	Metal Loss	TBit	SK	Non Inspection Side
4461	101	11.81	233.58	1.05	0.79	49	Metal Loss	TBit	SK	Inspection Side
4462	101	6.57	196.42	1.09	0.33	49	Metal Loss	TBit	SK	Inspection Side
4463	101	31.34	121.97	1.13	0.24	49	Metal Loss	TBit	SK	Inspection Side
4464	101	25.55	31.93	1.17	0.98	49	Metal Loss	TBit	SK	Inspection Side
4465	101	34.84	127.44	1.36	0.87	49	Metal Loss	TBit	SK	Inspection Side
4466	101	65.39	233.46	1.92	2.36	49	Metal Loss	TBit	SK	Non Inspection Side
4467	101	7.01	177.09	1.93	1.39	49	Metal Loss	TBit	SK	Non Inspection Side
4468	101	7.99	137.64	2.97	0.88	49	Metal Loss	TBit	SK	Inspection Side
4469	101	54.80	197.24	0.83	0.41	50	Metal Loss	TBit	SK	Inspection Side
4470	101	32.87	170.12	0.84	0.33	50	Metal Loss	TBit	SK	Inspection Side
4471	101	4.06	236.89	1.02	0.29	50	Metal Loss	TBit	SK	Inspection Side
4472	101	5.51	183.46	1.57	0.37	50	Metal Loss	TBit	SK	Inspection Side
4473	101	61.93	33.78	1.02	0.93	51	Metal Loss	TBit	SK	Inspection Side
4474	101	31.34	36.69	1.08	0.44	51	Metal Loss	TBit	SK	Inspection Side
4475	101	62.83	10.39	1.38	1.49	51	Metal Loss	TBit	SK	Non Inspection Side
4476	101	12.87	127.48	2.21	1.36	51	Metal Loss	TBit	SK	Inspection Side
4477	101	62.91	32.83	4.59	1.25	51	Metal Loss	TBit	SK	Inspection Side
4478	101	25.67	236.38	0.65	0.37	52	Metal Loss	TBit	SK	Inspection Side
4479	101	49.33	237.60	0.81	0.47	52	Metal Loss	TBit	SK	Non Inspection Side
4480	101	4.72	233.74	0.87	0.43	52	Metal Loss	TBit	SK	Inspection Side
4481	101	32.09	98.19	1.46	1.07	52	Metal Loss	TBit	SK	Non Inspection Side
4482	101	48.15	8.66	1.46	0.54	52	Metal Loss	TBit	SK	Inspection Side
4483	101	66.02	88.54	1.70	0.89	52	Metal Loss	TBit	SK	Inspection Side
4484	101	34.21	180.63	0.72	0.23	53	Metal Loss	TBit	SK	Inspection Side
4485	101	10.79	62.24	0.90	0.96	53	Metal Loss	TBit	SK	Inspection Side
4486	101	37.13	25.94	1.12	2.19	53	Metal Loss	TBit	SK	Non Inspection Side
4487	101	6.65	58.27	1.55	0.27	53	Metal Loss	TBit	SK	Inspection Side
4488	101	6.89	101.97	2.00	0.71	53	Metal Loss	TBit	SK	Inspection Side
4489	101	27.13	227.40	0.69	0.43	54	Metal Loss	TBit	SK	Inspection Side
4490	101	13.54	237.60	0.81	0.48	54	Metal Loss	TBit	SK	Inspection Side
4491	101	36.06	107.01	1.31	0.43	54	Metal Loss	TBit	SK	Inspection Side
4492	101	54.21	162.87	1.44	1.80	54	Metal Loss	TBit	SK	Non Inspection Side
4493	101	18.39	41.22	1.57	0.32	54	Metal Loss	TBit	SK	Inspection Side
4494	101	45.79	42.87	1.58	0.29	54	Metal Loss	TBit	SK	Inspection Side
4495	101	11.22	152.80	1.68	0.59	54	Metal Loss	TBit	SK	Inspection Side
4496	101	19.49	186.02	0.80	0.39	55	Metal Loss	TBit	SK	Inspection Side
4497	101	8.03	202.76	0.87	0.32	55	Metal Loss	TBit	SK	Inspection Side
4498	101	47.76	181.77	1.01	0.91	55	Metal Loss	TBit	SK	Inspection Side
4499	101	47.72	78.43	1.36	0.96	55	Metal Loss	TBit	SK	Inspection Side
4500	101	33.31	157.76	1.52	0.62	55	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4501	101	35.63	6.61	1.82	0.75	55	Metal Loss	TBit	SK	Inspection Side
4502	101	57.83	189.06	0.89	0.46	56	Metal Loss	TBit	SK	Inspection Side
4503	101	19.02	15.98	1.12	0.22	56	Metal Loss	TBit	SK	Inspection Side
4504	101	32.05	72.13	1.24	1.10	56	Metal Loss	TBit	SK	Non Inspection Side
4505	101	44.96	122.48	1.26	0.86	56	Metal Loss	TBit	SK	Inspection Side
4506	101	36.22	179.13	1.32	0.40	56	Metal Loss	TBit	SK	Inspection Side
4507	101	45.16	108.74	1.33	0.74	56	Metal Loss	TBit	SK	Inspection Side
4508	101	62.32	85.63	1.34	0.74	56	Metal Loss	TBit	SK	Inspection Side
4509	101	60.98	185.63	0.84	0.50	57	Metal Loss	TBit	SK	Non Inspection Side
4510	101	34.76	27.91	0.92	0.41	57	Metal Loss	TBit	SK	Inspection Side
4511	101	42.95	103.98	1.06	0.48	57	Metal Loss	TBit	SK	Inspection Side
4512	101	31.34	103.19	1.23	0.90	57	Metal Loss	TBit	SK	Inspection Side
4513	101	9.21	229.92	1.46	0.58	57	Metal Loss	TBit	SK	Inspection Side
4514	101	63.86	66.42	1.84	0.69	57	Metal Loss	TBit	SK	Inspection Side
4515	101	57.83	115.79	3.39	0.74	57	Metal Loss	TBit	SK	Inspection Side
4516	101	31.38	108.43	1.41	0.75	58	Metal Loss	TBit	SK	Non Inspection Side
4517	101	53.74	97.17	2.92	0.37	58	Metal Loss	TBit	SK	Inspection Side
4518	101	54.45	121.42	4.37	1.29	58	Metal Loss	TBit	SK	Non Inspection Side
4519	101	53.66	76.89	0.70	0.25	59	Metal Loss	TBit	SK	Inspection Side
4520	101	65.31	105.55	1.12	0.50	59	Metal Loss	TBit	SK	Inspection Side
4521	101	31.97	60.16	1.21	0.42	59	Metal Loss	TBit	SK	Inspection Side
4522	101	35.12	125.55	1.42	0.53	59	Metal Loss	TBit	SK	Inspection Side
4523	101	57.24	80.55	1.71	0.35	59	Metal Loss	TBit	SK	Inspection Side
4524	101	59.45	71.14	1.84	1.12	59	Metal Loss	TBit	SK	Non Inspection Side
4525	101	58.86	80.39	3.42	0.51	59	Metal Loss	TBit	SK	Inspection Side
4526	101	45.16	116.06	1.00	0.33	60	Metal Loss	TBit	SK	Inspection Side
4527	101	3.46	223.90	1.12	0.34	60	Metal Loss	TBit	SK	Inspection Side
4528	101	30.35	229.57	1.21	0.43	60	Metal Loss	TBit	SK	Inspection Side
4529	101	63.86	25.67	1.28	0.48	60	Metal Loss	TBit	SK	Inspection Side
4530	101	53.03	202.48	1.55	0.45	60	Metal Loss	TBit	SK	Inspection Side
4531	101	18.19	56.77	1.95	1.62	60	Metal Loss	TBit	SK	Non Inspection Side
4532	101	31.18	25.24	0.82	0.48	61	Metal Loss	TBit	SK	Non Inspection Side
4533	101	39.37	15.00	0.88	0.36	61	Metal Loss	TBit	SK	Inspection Side
4534	101	31.34	85.20	1.28	0.50	61	Metal Loss	TBit	SK	Inspection Side
4535	101	53.27	162.91	2.02	1.09	61	Metal Loss	TBit	SK	Non Inspection Side
4536	101	55.91	10.28	2.13	0.49	61	Metal Loss	TBit	SK	Inspection Side
4537	101	32.52	130.20	1.13	0.48	62	Metal Loss	TBit	SK	Inspection Side
4538	101	44.72	71.10	1.32	0.43	62	Metal Loss	TBit	SK	Inspection Side
4539	101	45.75	154.84	0.95	0.35	63	Metal Loss	TBit	SK	Inspection Side
4540	101	10.16	223.39	1.39	0.45	63	Metal Loss	TBit	SK	Inspection Side
4541	101	46.93	137.64	2.29	0.73	63	Metal Loss	TBit	SK	Inspection Side
4542	101	54.13	67.17	2.77	0.31	63	Metal Loss	TBit	SK	Inspection Side
4543	101	37.83	86.61	1.08	0.35	64	Metal Loss	TBit	SK	Inspection Side
4544	101	13.78	88.39	2.43	0.85	64	Metal Loss	TBit	SK	Inspection Side
4545	101	38.86	114.29	0.99	0.38	65	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4546	101	32.05	169.72	1.17	0.72	65	Metal Loss	TBit	SK	Non Inspection Side
4547	101	21.42	22.60	1.24	0.70	65	Metal Loss	TBit	SK	Inspection Side
4548	101	57.24	89.69	1.79	0.27	65	Metal Loss	TBit	SK	Inspection Side
4549	101	31.50	116.06	1.59	0.84	66	Metal Loss	TBit	SK	Inspection Side
4550	101	58.43	106.93	1.81	1.49	66	Metal Loss	TBit	SK	Non Inspection Side
4551	101	34.65	38.43	0.81	0.32	67	Metal Loss	TBit	SK	Inspection Side
4552	101	32.05	79.80	1.14	0.32	67	Metal Loss	TBit	SK	Inspection Side
4553	101	57.01	97.72	2.07	0.61	67	Metal Loss	TBit	SK	Inspection Side
4554	101	31.85	170.98	1.19	0.54	68	Metal Loss	TBit	SK	Non Inspection Side
4555	101	54.21	198.70	1.60	0.52	68	Metal Loss	TBit	SK	Inspection Side
4556	101	57.72	196.57	0.94	0.36	69	Metal Loss	TBit	SK	Inspection Side
4557	101	9.09	54.09	3.31	0.81	69	Metal Loss	TBit	SK	Inspection Side
4558	101	10.51	62.05	0.42	0.53	71	Metal Loss	TBit	SK	Inspection Side
4559	101	32.44	65.55	1.04	0.40	71	Metal Loss	TBit	SK	Inspection Side
4560	101	47.24	181.89	1.04	0.59	71	Metal Loss	TBit	SK	Inspection Side
4561	101	32.87	67.95	1.18	0.41	73	Metal Loss	TBit	SK	Inspection Side
4562	101	59.21	34.88	1.64	0.35	73	Metal Loss	TBit	SK	Inspection Side
4563	101	54.88	10.91	1.13	0.69	74	Metal Loss	TBit	SK	Inspection Side
4564	101	33.31	43.62	2.86	0.74	74	Metal Loss	TBit	SK	Inspection Side
4565	101	47.44	73.58	1.91	0.53	75	Metal Loss	TBit	SK	Non Inspection Side
4566	101	48.23	8.90	1.49	0.36	76	Metal Loss	TBit	SK	Inspection Side
4567	101	46.54	102.05	1.36	0.44	77	Metal Loss	TBit	SK	Inspection Side
4568	101	55.24	33.74	0.70	0.28	78	Metal Loss	TBit	SK	Inspection Side
4569	101	33.86	74.80	1.17	0.48	80	Metal Loss	TBit	SK	Inspection Side
4570	101	35.59	33.46	1.23	0.98	81	Metal Loss	TBit	SK	Inspection Side
4571	101	8.27	93.11	2.36	0.28	82	Metal Loss	TBit	SK	Inspection Side
4572	101	57.24	84.53	1.89	0.52	83	Metal Loss	TBit	SK	Inspection Side
4573	101	34.02	16.73	2.01	0.35	84	Metal Loss	TBit	SK	Inspection Side
4574	101	33.31	156.34	1.34	0.70	85	Metal Loss	TBit	SK	Inspection Side
4575	101	12.01	145.87	1.01	0.30	93	Metal Loss	TBit	SK	Inspection Side
4576	101	52.05	11.18	1.19	0.53	95	Metal Loss	TBit	SK	Inspection Side
4577	101	20.12	14.49	1.20	0.33	97	Metal Loss	TBit	SK	Inspection Side
4578	101	59.57	34.88	1.33	0.78	97	Metal Loss	TBit	SK	Inspection Side
4579	101	47.36	118.46	1.14	0.76	98	Metal Loss	TBit	SK	Inspection Side
4580	102	55.75	54.21	0.42	0.27	49	Metal Loss	TBit	SK	Inspection Side
4581	102	41.65	13.27	0.61	0.52	49	Metal Loss	TBit	SK	Inspection Side
4582	102	19.61	228.35	1.53	0.64	49	Metal Loss	TBit	SK	Non Inspection Side
4583	102	23.66	131.30	0.58	0.46	50	Metal Loss	TBit	SK	Inspection Side
4584	102	12.64	181.97	0.77	0.59	50	Metal Loss	TBit	SK	Inspection Side
4585	102	21.77	148.78	0.82	0.46	50	Metal Loss	TBit	SK	Inspection Side
4586	102	29.72	31.81	0.88	0.55	50	Metal Loss	TBit	SK	Inspection Side
4587	102	53.98	181.30	1.07	0.67	50	Metal Loss	TBit	SK	Inspection Side
4588	102	35.16	17.09	1.28	0.65	50	Metal Loss	TBit	SK	Non Inspection Side
4589	102	45.94	12.17	0.47	0.39	51	Metal Loss	TBit	SK	Inspection Side
4590	102	13.31	60.39	0.78	0.50	51	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4591	102	57.20	204.09	1.18	1.04	51	Metal Loss	TBit	SK	Inspection Side
4592	102	17.28	163.74	0.86	0.35	52	Metal Loss	TBit	SK	Inspection Side
4593	102	39.65	104.92	0.93	0.43	52	Metal Loss	TBit	SK	Inspection Side
4594	102	17.20	161.38	0.96	0.38	52	Metal Loss	TBit	SK	Inspection Side
4595	102	18.07	151.69	0.81	0.56	53	Metal Loss	TBit	SK	Inspection Side
4596	102	16.22	222.95	0.92	0.45	53	Metal Loss	TBit	SK	Inspection Side
4597	102	30.31	49.17	0.99	0.98	53	Metal Loss	TBit	SK	Inspection Side
4598	102	59.29	20.12	1.02	0.48	53	Metal Loss	TBit	SK	Inspection Side
4599	102	12.09	142.60	0.53	0.32	54	Metal Loss	TBit	SK	Inspection Side
4600	102	16.02	186.89	0.59	0.41	54	Metal Loss	TBit	SK	Inspection Side
4601	102	45.16	40.59	0.70	2.49	54	Metal Loss	TBit	SK	Non Inspection Side
4602	102	22.36	145.75	0.75	0.34	54	Metal Loss	TBit	SK	Inspection Side
4603	102	32.17	136.61	1.51	0.51	54	Metal Loss	TBit	SK	Non Inspection Side
4604	102	41.06	203.43	0.68	0.29	55	Metal Loss	TBit	SK	Inspection Side
4605	102	52.60	15.39	1.28	0.38	55	Metal Loss	TBit	SK	Inspection Side
4606	102	54.45	118.66	0.39	0.27	56	Metal Loss	TBit	SK	Non Inspection Side
4607	102	20.20	150.16	0.48	0.41	56	Metal Loss	TBit	SK	Inspection Side
4608	102	15.04	27.05	1.68	0.68	56	Metal Loss	TBit	SK	Inspection Side
4609	102	39.13	108.66	0.60	0.44	57	Metal Loss	TBit	SK	Inspection Side
4610	102	30.28	72.72	0.63	0.63	57	Metal Loss	TBit	SK	Inspection Side
4611	102	46.38	65.55	0.87	0.47	57	Metal Loss	TBit	SK	Inspection Side
4612	102	44.65	100.55	0.94	0.90	57	Metal Loss	TBit	SK	Inspection Side
4613	102	36.26	55.12	0.39	0.35	58	Metal Loss	TBit	SK	Inspection Side
4614	102	16.14	222.87	0.79	0.36	59	Metal Loss	TBit	SK	Inspection Side
4615	102	45.59	148.66	0.80	0.40	59	Metal Loss	TBit	SK	Inspection Side
4616	102	54.09	57.87	0.94	0.37	59	Metal Loss	TBit	SK	Inspection Side
4617	102	18.70	16.97	0.94	0.65	60	Metal Loss	TBit	SK	Inspection Side
4618	102	15.98	132.28	0.89	0.47	61	Metal Loss	TBit	SK	Inspection Side
4619	102	28.15	131.85	0.92	0.71	61	Metal Loss	TBit	SK	Inspection Side
4620	102	30.12	17.09	0.80	0.28	63	Metal Loss	TBit	SK	Inspection Side
4621	102	52.87	180.79	0.95	0.34	63	Metal Loss	TBit	SK	Inspection Side
4622	102	52.44	58.03	0.97	0.55	64	Metal Loss	TBit	SK	Inspection Side
4623	102	35.08	14.06	0.48	0.42	66	Metal Loss	TBit	SK	Inspection Side
4624	102	15.79	140.63	1.18	0.72	69	Metal Loss	TBit	SK	Inspection Side
4625	102	45.24	43.23	1.73	0.50	70	Metal Loss	TBit	SK	Inspection Side
4626	102	17.09	56.97	1.03	0.55	73	Metal Loss	TBit	SK	Inspection Side
4627	102	17.17	64.13	1.18	0.64	97	Metal Loss	TBit	SK	Inspection Side
4628	102	52.56	202.09	1.20	0.83	97	Metal Loss	TBit	SK	Inspection Side
4629	102	17.20	86.93	1.21	0.75	97	Metal Loss	TBit	SK	Inspection Side
4630	102	15.98	82.48	1.77	0.69	98	Metal Loss	TBit	SK	Inspection Side
4631	103	33.82	56.06	0.51	0.38	49	Metal Loss	TBit	SK	Inspection Side
4632	103	5.67	18.19	0.90	0.65	50	Metal Loss	TBit	SK	Inspection Side
4633	103	20.39	65.24	0.89	0.46	51	Metal Loss	TBit	SK / CA	Inspection Side
4634	103	32.72	84.06	0.52	0.36	52	Metal Loss	TBit	SK / CA	Inspection Side
4635	103	49.61	54.13	0.60	0.40	52	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4636	103	57.24	36.34	0.37	0.39	53	Metal Loss	TBit	SK	Inspection Side
4637	103	57.20	49.41	0.66	0.33	53	Metal Loss	TBit	SK	Inspection Side
4638	103	26.89	65.83	0.70	0.40	54	Metal Loss	TBit	SK / CA	Inspection Side
4639	103	20.94	56.50	1.43	0.31	57	Metal Loss	TBit	SK / CA	Inspection Side
4640	103	23.11	66.02	0.71	0.41	58	Metal Loss	TBit	SK / CA	Inspection Side
4641	103	17.95	63.98	1.05	0.24	60	Metal Loss	TBit	SK / CA	Inspection Side
4642	103	46.97	73.11	0.74	0.43	64	Metal Loss	TBit	SK	Inspection Side
4643	103	32.32	44.37	0.58	0.41	65	Metal Loss	TBit	SK	Inspection Side
4644	103	23.98	52.60	0.98	0.50	66	Metal Loss	TBit	SK	Inspection Side
4645	103	43.43	76.30	0.61	0.33	69	Metal Loss	TBit	SK	Inspection Side
4646	103	17.13	62.60	1.37	0.38	90	Metal Loss	TBit	SK / CA	Inspection Side
4647	103	53.78	41.69	0.84	0.50	97	Metal Loss	TBit	SK	Inspection Side
4648	103	45.31	82.01	1.86	0.50	97	Metal Loss	TBit	SK / CA	Inspection Side
4649	104	38.82	75.39	0.64	0.36	49	Metal Loss	TBit	SK	Inspection Side
4650	104	10.63	26.77	0.73	0.47	49	Metal Loss	TBit	SK / CA	Inspection Side
4651	104	34.76	10.20	0.84	0.53	49	Metal Loss	TBit	SK	Inspection Side
4652	104	49.37	12.56	0.84	0.44	49	Metal Loss	TBit	SK	Inspection Side
4653	104	35.98	74.84	0.91	0.53	49	Metal Loss	TBit	SK	Inspection Side
4654	104	50.43	40.91	1.09	0.52	49	Metal Loss	TBit	SK	Inspection Side
4655	104	51.93	59.17	1.20	2.28	49	Metal Loss	TBit	SK	Inspection Side
4656	104	18.78	15.63	0.66	0.46	50	Metal Loss	TBit	SK	Inspection Side
4657	104	40.12	70.47	0.86	0.34	51	Metal Loss	TBit	SK	Inspection Side
4658	104	13.46	46.14	1.06	0.33	51	Metal Loss	TBit	SK / CA	Inspection Side
4659	104	54.33	103.11	1.26	0.59	51	Metal Loss	TBit	SK	Inspection Side
4660	104	15.31	7.48	0.63	0.39	52	Metal Loss	TBit	SK	Inspection Side
4661	104	57.48	10.67	0.87	0.51	52	Metal Loss	TBit	SK	Inspection Side
4662	104	51.93	40.00	0.90	0.55	52	Metal Loss	TBit	SK	Inspection Side
4663	104	33.31	77.60	0.91	0.51	52	Metal Loss	TBit	SK / CA	Inspection Side
4664	104	45.51	89.45	1.09	0.45	52	Metal Loss	TBit	SK	Inspection Side
4665	104	59.25	118.94	0.59	0.43	53	Metal Loss	TBit	SK / CA	Inspection Side
4666	104	55.83	92.87	0.85	0.40	53	Metal Loss	TBit	SK	Inspection Side
4667	104	19.72	68.98	1.08	1.54	53	Metal Loss	TBit	SK / CA	Non Inspection Side
4668	104	53.46	82.28	0.87	0.24	54	Metal Loss	TBit	SK	Inspection Side
4669	104	23.66	40.71	0.96	0.70	54	Metal Loss	TBit	SK	Inspection Side
4670	104	27.17	52.76	1.11	0.49	54	Metal Loss	TBit	SK	Inspection Side
4671	104	54.57	78.27	1.28	0.50	54	Metal Loss	TBit	SK	Inspection Side
4672	104	53.94	47.32	1.28	0.50	54	Metal Loss	TBit	SK	Inspection Side
4673	104	32.01	89.02	1.39	0.27	54	Metal Loss	TBit	SK / CA	Inspection Side
4674	104	25.35	32.64	0.71	0.38	55	Metal Loss	TBit	SK	Inspection Side
4675	104	14.96	24.45	0.78	0.72	55	Metal Loss	TBit	SK	Inspection Side
4676	104	60.12	14.76	0.93	0.59	55	Metal Loss	TBit	SK	Inspection Side
4677	104	13.82	41.57	0.68	0.24	56	Metal Loss	TBit	SK / CA	Inspection Side
4678	104	53.35	15.08	0.71	0.52	56	Metal Loss	TBit	SK	Inspection Side
4679	104	28.62	47.91	0.99	0.37	56	Metal Loss	TBit	SK	Inspection Side
4680	104	18.86	60.47	1.15	0.73	56	Metal Loss	TBit	SK / CA	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4681	104	20.43	18.54	2.12	0.34	56	Metal Loss	TBit	SK	Inspection Side
4682	104	27.52	49.84	0.74	0.35	57	Metal Loss	TBit	SK	Inspection Side
4683	104	56.42	107.95	0.97	0.38	57	Metal Loss	TBit	SK	Inspection Side
4684	104	21.73	30.20	1.04	0.38	57	Metal Loss	TBit	SK	Inspection Side
4685	104	16.97	9.17	1.12	0.42	57	Metal Loss	TBit	SK	Inspection Side
4686	104	58.62	76.50	1.33	0.81	57	Metal Loss	TBit	SK	Non Inspection Side
4687	104	11.93	23.07	1.12	0.42	58	Metal Loss	TBit	SK	Inspection Side
4688	104	54.25	101.10	1.23	0.56	58	Metal Loss	TBit	SK	Inspection Side
4689	104	31.02	67.91	1.35	0.52	58	Metal Loss	TBit	SK / CA	Inspection Side
4690	104	55.75	88.74	1.52	0.80	58	Metal Loss	TBit	SK	Inspection Side
4691	104	28.82	49.61	0.95	0.27	59	Metal Loss	TBit	SK	Inspection Side
4692	104	11.42	51.34	1.49	0.72	59	Metal Loss	TBit	SK / CA	Inspection Side
4693	104	53.19	119.09	1.06	0.29	60	Metal Loss	TBit	SK / CA	Inspection Side
4694	104	19.76	31.14	1.26	0.61	60	Metal Loss	TBit	SK	Inspection Side
4695	104	53.23	19.57	1.94	0.78	60	Metal Loss	TBit	SK	Inspection Side
4696	104	52.24	88.58	0.64	0.41	61	Metal Loss	TBit	SK	Inspection Side
4697	104	60.12	126.69	0.87	0.25	61	Metal Loss	TBit	SK / CA	Inspection Side
4698	104	52.56	102.56	0.94	0.82	62	Metal Loss	TBit	SK	Inspection Side
4699	104	49.88	124.17	1.45	0.53	62	Metal Loss	TBit	SK / CA	Inspection Side
4700	104	20.04	68.35	0.84	0.46	64	Metal Loss	TBit	SK / CA	Inspection Side
4701	104	36.42	31.57	1.22	0.48	65	Metal Loss	TBit	SK	Inspection Side
4702	104	52.87	15.87	0.94	0.67	66	Metal Loss	TBit	SK	Inspection Side
4703	104	44.29	109.72	1.05	0.48	67	Metal Loss	TBit	SK / CA	Inspection Side
4704	104	37.40	60.35	1.10	0.73	69	Metal Loss	TBit	SK	Inspection Side
4705	104	54.13	116.61	1.20	0.40	69	Metal Loss	TBit	SK / CA	Inspection Side
4706	104	8.03	29.84	0.93	0.36	70	Metal Loss	TBit	SK / CA	Inspection Side
4707	104	20.91	19.80	1.04	0.32	70	Metal Loss	TBit	SK	Inspection Side
4708	104	11.10	15.94	0.94	0.50	72	Metal Loss	TBit	SK	Inspection Side
4709	104	21.46	57.99	1.06	0.51	72	Metal Loss	TBit	SK / CA	Inspection Side
4710	104	31.26	47.36	1.22	0.33	72	Metal Loss	TBit	SK	Inspection Side
4711	104	57.17	85.20	1.64	0.89	76	Metal Loss	TBit	SK	Inspection Side
4712	104	26.97	59.53	0.97	0.36	77	Metal Loss	TBit	SK / CA	Inspection Side
4713	104	22.44	47.05	1.08	0.40	77	Metal Loss	TBit	SK	Inspection Side
4714	104	56.06	96.42	1.17	0.35	77	Metal Loss	TBit	SK	Inspection Side
4715	104	53.39	70.04	1.21	0.46	82	Metal Loss	TBit	SK	Inspection Side
4716	104	53.78	71.73	0.95	0.47	87	Metal Loss	TBit	SK	Inspection Side
4717	104	60.94	14.76	0.91	0.48	97	Metal Loss	TBit	SK	Inspection Side
4718	104	21.26	43.74	1.05	0.48	97	Metal Loss	TBit	SK	Inspection Side
4719	104	33.46	89.76	2.11	0.57	97	Metal Loss	TBit	SK / CA	Inspection Side
4720	105	57.24	17.13	0.43	0.33	49	Metal Loss	TBit	SK	Inspection Side
4721	105	54.84	113.74	0.59	0.35	49	Metal Loss	TBit	SK	Inspection Side
4722	105	56.42	184.25	0.83	0.34	49	Metal Loss	TBit	SK	Inspection Side
4723	105	55.94	159.53	0.94	0.78	49	Metal Loss	TBit	SK	Inspection Side
4724	105	48.86	95.55	1.01	0.44	49	Metal Loss	TBit	SK	Inspection Side
4725	105	32.36	173.19	1.16	0.52	49	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4726	105	56.61	195.63	0.51	0.48	50	Metal Loss	TBit	SK	Inspection Side
4727	105	46.26	230.63	0.70	0.33	50	Metal Loss	TBit	SK	Inspection Side
4728	105	25.43	212.32	0.95	0.61	50	Metal Loss	TBit	SK	Inspection Side
4729	105	62.05	33.19	1.17	0.19	50	Metal Loss	TBit	SK	Inspection Side
4730	105	49.88	28.82	1.58	0.87	50	Metal Loss	TBit	SK	Inspection Side
4731	105	56.06	18.70	0.78	0.21	51	Metal Loss	TBit	SK	Inspection Side
4732	105	44.13	113.90	1.19	0.62	51	Metal Loss	TBit	SK	Inspection Side
4733	105	19.37	195.28	1.26	0.91	51	Metal Loss	TBit	SK	Inspection Side
4734	105	29.09	92.44	1.39	0.45	51	Metal Loss	TBit	SK	Inspection Side
4735	105	23.03	76.65	1.75	0.54	51	Metal Loss	TBit	SK	Inspection Side
4736	105	56.97	17.01	0.57	0.38	52	Metal Loss	TBit	SK	Inspection Side
4737	105	55.79	162.80	0.81	0.77	52	Metal Loss	TBit	SK	Inspection Side
4738	105	17.09	145.91	0.96	0.31	52	Metal Loss	TBit	SK	Inspection Side
4739	105	37.83	16.81	1.19	2.55	52	Metal Loss	TBit	SK	Inspection Side
4740	105	32.28	167.09	1.09	0.20	53	Metal Loss	TBit	SK	Inspection Side
4741	105	55.75	159.49	1.09	0.81	53	Metal Loss	TBit	SK	Inspection Side
4742	105	27.76	52.87	0.80	0.43	54	Metal Loss	TBit	SK	Inspection Side
4743	105	19.21	41.89	1.30	0.83	54	Metal Loss	TBit	SK	Inspection Side
4744	105	19.88	175.31	1.86	0.69	54	Metal Loss	TBit	SK	Inspection Side
4745	105	54.72	134.25	1.13	0.45	55	Metal Loss	TBit	SK	Inspection Side
4746	105	54.37	38.98	1.18	0.50	55	Metal Loss	TBit	SK	Inspection Side
4747	105	47.95	229.13	0.81	0.50	56	Metal Loss	TBit	SK	Inspection Side
4748	105	18.78	60.55	0.93	0.52	56	Metal Loss	TBit	SK	Inspection Side
4749	105	61.06	157.76	0.95	0.47	56	Metal Loss	TBit	SK	Inspection Side
4750	105	60.00	73.31	1.26	0.31	56	Metal Loss	TBit	SK	Inspection Side
4751	105	59.96	13.98	1.00	1.10	57	Metal Loss	TBit	SK	Inspection Side
4752	105	17.48	82.95	1.59	0.44	57	Metal Loss	TBit	SK	Inspection Side
4753	105	25.98	205.63	0.58	0.38	58	Metal Loss	TBit	SK	Inspection Side
4754	105	54.53	113.90	0.62	0.38	58	Metal Loss	TBit	SK	Inspection Side
4755	105	55.94	162.68	0.69	0.39	59	Metal Loss	TBit	SK	Inspection Side
4756	105	55.28	24.37	1.05	0.86	59	Metal Loss	TBit	SK	Inspection Side
4757	105	30.04	56.57	1.38	0.91	59	Metal Loss	TBit	SK	Inspection Side
4758	105	60.47	35.12	0.70	0.47	61	Metal Loss	TBit	SK	Inspection Side
4759	105	31.34	163.54	0.88	0.36	61	Metal Loss	TBit	SK	Inspection Side
4760	105	15.16	184.37	1.82	0.43	61	Metal Loss	TBit	SK	Inspection Side
4761	105	54.37	30.20	1.80	0.81	62	Metal Loss	TBit	SK	Inspection Side
4762	105	34.72	228.43	1.15	0.36	63	Metal Loss	TBit	SK	Inspection Side
4763	105	53.11	134.88	1.24	0.88	63	Metal Loss	TBit	SK	Inspection Side
4764	105	38.35	84.92	0.72	0.35	64	Metal Loss	TBit	SK	Inspection Side
4765	105	18.66	10.39	0.79	0.71	64	Metal Loss	TBit	SK	Inspection Side
4766	105	60.63	208.50	0.84	0.63	64	Metal Loss	TBit	SK	Inspection Side
4767	105	15.79	162.83	1.10	0.66	65	Metal Loss	TBit	SK	Inspection Side
4768	105	54.25	24.13	1.07	0.62	66	Metal Loss	TBit	SK	Inspection Side
4769	105	15.75	148.50	1.09	0.50	66	Metal Loss	TBit	SK	Inspection Side
4770	105	54.06	93.94	1.14	0.36	67	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4771	105	30.35	88.11	0.87	1.04	68	Metal Loss	TBit	SK	Inspection Side
4772	105	29.96	89.21	0.90	0.41	68	Metal Loss	TBit	SK	Inspection Side
4773	105	45.47	113.35	1.13	0.64	69	Metal Loss	TBit	SK	Inspection Side
4774	105	15.79	184.61	0.95	0.58	71	Metal Loss	TBit	SK	Inspection Side
4775	105	53.66	202.32	1.37	0.77	72	Metal Loss	TBit	SK	Inspection Side
4776	105	32.44	203.62	1.02	0.58	73	Metal Loss	TBit	SK	Inspection Side
4777	105	57.99	17.24	0.77	0.41	74	Metal Loss	TBit	SK	Inspection Side
4778	105	54.88	28.54	0.97	0.48	75	Metal Loss	TBit	SK	Inspection Side
4779	105	55.94	90.04	0.60	0.34	78	Metal Loss	TBit	SK	Inspection Side
4780	105	60.79	189.57	0.89	0.45	79	Metal Loss	TBit	SK	Inspection Side
4781	105	61.06	14.49	1.45	0.86	85	Metal Loss	TBit	SK	Inspection Side
4782	105	29.49	208.07	1.31	0.59	89	Metal Loss	TBit	SK	Inspection Side
4783	105	61.46	29.21	1.33	1.04	92	Metal Loss	TBit	SK	Inspection Side
4784	105	16.30	169.53	1.49	0.44	92	Metal Loss	TBit	SK	Inspection Side
4785	105	30.47	49.96	0.96	0.44	97	Metal Loss	TBit	SK	Inspection Side
4786	105	54.84	30.55	1.58	0.68	98	Metal Loss	TBit	SK	Inspection Side
4787	105	54.09	30.04	1.89	0.71	98	Metal Loss	TBit	SK	Inspection Side
4788	105	31.18	157.64	3.54	1.72	98	Metal Loss	TBit	SK	Inspection Side
4789	106	35.59	231.30	0.52	0.39	49	Metal Loss	TBit	SK	Inspection Side
4790	106	15.43	67.05	0.72	0.46	49	Metal Loss	TBit	SK	Inspection Side
4791	106	48.15	212.17	0.74	0.47	49	Metal Loss	TBit	SK	Inspection Side
4792	106	57.24	93.31	0.85	0.30	49	Metal Loss	TBit	SK	Inspection Side
4793	106	55.79	83.86	0.87	0.54	49	Metal Loss	TBit	SK	Inspection Side
4794	106	28.46	145.39	0.96	0.42	49	Metal Loss	TBit	SK	Inspection Side
4795	106	16.89	45.39	1.09	0.38	49	Metal Loss	TBit	SK	Inspection Side
4796	106	60.20	93.19	1.11	0.63	49	Metal Loss	TBit	SK	Inspection Side
4797	106	56.81	189.09	1.17	0.36	49	Metal Loss	TBit	SK	Inspection Side
4798	106	54.37	35.12	1.33	0.49	49	Metal Loss	TBit	SK	Inspection Side
4799	106	15.94	37.99	1.61	0.77	49	Metal Loss	TBit	SK	Inspection Side
4800	106	26.57	26.65	1.73	0.79	49	Metal Loss	TBit	SK	Inspection Side
4801	106	22.17	71.69	0.65	0.33	50	Metal Loss	TBit	SK	Inspection Side
4802	106	24.06	142.56	0.97	0.29	50	Metal Loss	TBit	SK	Inspection Side
4803	106	55.79	64.21	1.03	0.43	50	Metal Loss	TBit	SK	Inspection Side
4804	106	37.91	25.59	1.11	0.34	50	Metal Loss	TBit	SK	Inspection Side
4805	106	56.93	81.34	1.17	0.52	50	Metal Loss	TBit	SK	Inspection Side
4806	106	48.78	146.06	1.26	0.43	50	Metal Loss	TBit	SK	Inspection Side
4807	106	16.26	141.46	1.27	0.56	50	Metal Loss	TBit	SK	Inspection Side
4808	106	50.75	10.51	1.85	0.91	50	Metal Loss	TBit	SK	Inspection Side
4809	106	31.77	235.71	2.34	0.54	50	Metal Loss	TBit	SK	Inspection Side
4810	106	13.94	145.35	0.76	0.45	51	Metal Loss	TBit	SK	Inspection Side
4811	106	61.38	80.20	0.80	0.95	51	Metal Loss	TBit	SK	Inspection Side
4812	106	59.33	167.32	0.80	0.46	51	Metal Loss	TBit	SK	Inspection Side
4813	106	55.12	71.46	0.92	0.41	51	Metal Loss	TBit	SK	Inspection Side
4814	106	53.43	12.32	1.18	0.23	51	Metal Loss	TBit	SK	Inspection Side
4815	106	14.76	150.98	0.55	0.39	52	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4816	106	48.78	149.49	0.69	0.52	52	Metal Loss	TBit	SK	Inspection Side
4817	106	17.95	214.76	0.84	0.79	52	Metal Loss	TBit	SK	Inspection Side
4818	106	17.20	64.02	1.00	0.22	52	Metal Loss	TBit	SK	Inspection Side
4819	106	23.86	56.26	1.02	0.44	52	Metal Loss	TBit	SK	Inspection Side
4820	106	59.96	69.45	1.06	0.49	52	Metal Loss	TBit	SK	Inspection Side
4821	106	49.37	142.76	1.49	0.41	52	Metal Loss	TBit	SK	Inspection Side
4822	106	58.11	161.61	0.63	0.26	53	Metal Loss	TBit	SK	Inspection Side
4823	106	54.57	149.33	1.08	0.67	53	Metal Loss	TBit	SK	Inspection Side
4824	106	17.48	56.69	1.30	0.24	53	Metal Loss	TBit	SK	Inspection Side
4825	106	28.58	78.70	0.68	0.39	54	Metal Loss	TBit	SK	Inspection Side
4826	106	59.92	162.36	0.77	0.68	54	Metal Loss	TBit	SK	Inspection Side
4827	106	50.43	47.83	0.82	0.48	54	Metal Loss	TBit	SK	Inspection Side
4828	106	57.87	80.59	0.82	0.48	54	Metal Loss	TBit	SK	Inspection Side
4829	106	23.62	74.72	1.02	0.59	54	Metal Loss	TBit	SK	Inspection Side
4830	106	23.31	41.14	1.22	0.41	54	Metal Loss	TBit	SK	Inspection Side
4831	106	46.46	26.34	1.24	1.18	54	Metal Loss	TBit	SK	Inspection Side
4832	106	48.90	200.87	1.27	0.69	54	Metal Loss	TBit	SK	Inspection Side
4833	106	25.31	71.54	0.53	0.38	55	Metal Loss	TBit	SK	Inspection Side
4834	106	24.41	162.17	0.67	0.36	55	Metal Loss	TBit	SK	Inspection Side
4835	106	20.00	142.13	0.73	0.45	55	Metal Loss	TBit	SK	Inspection Side
4836	106	25.31	233.78	0.74	0.47	55	Metal Loss	TBit	SK	Inspection Side
4837	106	57.36	156.93	0.74	0.44	55	Metal Loss	TBit	SK	Inspection Side
4838	106	21.50	51.85	0.82	0.39	55	Metal Loss	TBit	SK	Inspection Side
4839	106	57.95	79.33	0.93	0.65	55	Metal Loss	TBit	SK	Inspection Side
4840	106	49.88	144.37	1.02	0.39	55	Metal Loss	TBit	SK	Inspection Side
4841	106	53.43	81.85	1.22	0.54	55	Metal Loss	TBit	SK	Inspection Side
4842	106	27.91	78.70	0.34	0.46	56	Metal Loss	TBit	SK	Inspection Side
4843	106	53.74	130.20	0.36	0.32	56	Metal Loss	TBit	SK	Inspection Side
4844	106	10.67	138.35	0.70	0.44	56	Metal Loss	TBit	SK	Inspection Side
4845	106	55.24	85.87	0.93	0.39	56	Metal Loss	TBit	SK	Inspection Side
4846	106	31.97	195.87	1.01	0.28	56	Metal Loss	TBit	SK	Inspection Side
4847	106	32.48	49.49	1.09	0.63	56	Metal Loss	TBit	SK	Inspection Side
4848	106	21.50	73.31	1.12	0.50	56	Metal Loss	TBit	SK	Inspection Side
4849	106	47.17	31.14	0.80	0.41	57	Metal Loss	TBit	SK	Inspection Side
4850	106	22.60	70.20	0.85	0.34	57	Metal Loss	TBit	SK	Inspection Side
4851	106	17.48	88.50	0.91	0.40	57	Metal Loss	TBit	SK	Inspection Side
4852	106	17.17	157.32	0.93	0.23	57	Metal Loss	TBit	SK	Inspection Side
4853	106	58.11	168.98	1.33	0.44	57	Metal Loss	TBit	SK	Inspection Side
4854	106	41.50	21.89	1.80	0.40	57	Metal Loss	TBit	SK	Inspection Side
4855	106	55.71	51.69	0.70	0.40	58	Metal Loss	TBit	SK	Inspection Side
4856	106	7.83	80.43	0.80	0.48	58	Metal Loss	TBit	SK	Inspection Side
4857	106	16.50	141.73	1.13	0.27	58	Metal Loss	TBit	SK	Inspection Side
4858	106	58.90	141.81	1.41	0.43	58	Metal Loss	TBit	SK	Inspection Side
4859	106	34.41	195.59	0.67	0.36	59	Metal Loss	TBit	SK	Inspection Side
4860	106	55.91	167.83	0.93	0.23	59	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4861	106	50.24	77.68	1.00	0.79	59	Metal Loss	TBit	SK	Inspection Side
4862	106	62.05	83.35	1.16	0.74	59	Metal Loss	TBit	SK	Inspection Side
4863	106	56.02	151.42	1.47	0.44	59	Metal Loss	TBit	SK	Inspection Side
4864	106	16.73	73.07	0.91	0.30	60	Metal Loss	TBit	SK	Inspection Side
4865	106	58.62	142.68	1.28	0.39	60	Metal Loss	TBit	SK	Inspection Side
4866	106	28.15	141.89	1.69	0.45	60	Metal Loss	TBit	SK	Inspection Side
4867	106	20.12	77.36	0.67	0.36	61	Metal Loss	TBit	SK	Inspection Side
4868	106	58.35	47.17	0.99	0.64	61	Metal Loss	TBit	SK	Inspection Side
4869	106	32.36	141.65	1.38	0.45	61	Metal Loss	TBit	SK	Inspection Side
4870	106	56.65	72.28	1.92	0.52	61	Metal Loss	TBit	SK	Inspection Side
4871	106	56.18	46.69	0.68	0.41	62	Metal Loss	TBit	SK	Inspection Side
4872	106	23.07	157.76	0.73	0.33	63	Metal Loss	TBit	SK	Inspection Side
4873	106	50.28	154.13	0.78	0.47	63	Metal Loss	TBit	SK	Inspection Side
4874	106	60.87	16.10	0.88	0.38	63	Metal Loss	TBit	SK	Inspection Side
4875	106	53.98	130.20	0.73	0.34	64	Metal Loss	TBit	SK	Inspection Side
4876	106	60.00	166.42	0.85	0.41	64	Metal Loss	TBit	SK	Inspection Side
4877	106	52.76	143.70	0.97	0.53	64	Metal Loss	TBit	SK	Inspection Side
4878	106	32.40	34.02	1.26	0.33	64	Metal Loss	TBit	SK	Inspection Side
4879	106	22.60	68.74	0.72	0.38	65	Metal Loss	TBit	SK	Inspection Side
4880	106	21.30	158.50	0.88	0.34	65	Metal Loss	TBit	SK	Inspection Side
4881	106	51.38	167.20	1.00	0.43	65	Metal Loss	TBit	SK	Inspection Side
4882	106	17.68	138.58	1.06	0.43	65	Metal Loss	TBit	SK	Inspection Side
4883	106	16.38	41.89	1.19	0.69	65	Metal Loss	TBit	SK	Inspection Side
4884	106	20.20	62.01	1.21	0.44	65	Metal Loss	TBit	SK	Inspection Side
4885	106	40.47	74.06	0.96	0.40	66	Metal Loss	TBit	SK	Inspection Side
4886	106	16.42	51.77	1.05	0.72	66	Metal Loss	TBit	SK	Inspection Side
4887	106	55.12	47.40	0.95	0.36	67	Metal Loss	TBit	SK	Inspection Side
4888	106	6.93	67.56	0.68	0.34	68	Metal Loss	TBit	SK	Inspection Side
4889	106	53.50	97.64	1.13	0.41	68	Metal Loss	TBit	SK	Inspection Side
4890	106	53.86	48.66	1.72	0.93	68	Metal Loss	TBit	SK	Inspection Side
4891	106	21.61	202.83	1.32	0.35	69	Metal Loss	TBit	SK	Inspection Side
4892	106	38.54	70.67	0.80	0.41	70	Metal Loss	TBit	SK	Inspection Side
4893	106	53.54	157.99	0.66	0.38	71	Metal Loss	TBit	SK	Inspection Side
4894	106	43.46	205.63	1.20	0.44	72	Metal Loss	TBit	SK	Inspection Side
4895	106	51.18	67.68	1.21	0.79	72	Metal Loss	TBit	SK	Inspection Side
4896	106	56.06	155.00	0.77	0.39	73	Metal Loss	TBit	SK	Inspection Side
4897	106	17.60	132.56	0.93	0.41	73	Metal Loss	TBit	SK	Inspection Side
4898	106	54.53	78.94	0.74	0.35	74	Metal Loss	TBit	SK	Inspection Side
4899	106	52.56	159.02	0.75	0.34	74	Metal Loss	TBit	SK	Inspection Side
4900	106	55.98	151.38	1.33	0.38	74	Metal Loss	TBit	SK	Inspection Side
4901	106	53.50	94.57	1.10	0.36	75	Metal Loss	TBit	SK	Inspection Side
4902	106	59.96	33.11	1.16	0.69	75	Metal Loss	TBit	SK	Inspection Side
4903	106	35.43	205.47	1.28	0.59	76	Metal Loss	TBit	SK	Inspection Side
4904	106	12.01	81.97	0.88	0.37	78	Metal Loss	TBit	SK	Inspection Side
4905	106	23.31	140.94	0.86	0.42	82	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4906	106	32.48	177.44	1.17	1.03	82	Metal Loss	TBit	SK	Inspection Side
4907	106	54.96	143.46	1.09	0.35	83	Metal Loss	TBit	SK	Inspection Side
4908	106	16.10	145.71	1.20	0.44	86	Metal Loss	TBit	SK	Inspection Side
4909	106	58.94	61.57	1.33	0.97	88	Metal Loss	TBit	SK	Inspection Side
4910	106	17.60	84.09	1.89	0.55	88	Metal Loss	TBit	SK	Inspection Side
4911	106	37.36	203.15	1.08	0.62	90	Metal Loss	TBit	SK	Inspection Side
4912	106	32.36	51.65	1.17	0.38	91	Metal Loss	TBit	SK	Inspection Side
4913	106	53.43	148.19	1.35	0.33	92	Metal Loss	TBit	SK	Inspection Side
4914	106	17.95	58.82	1.72	0.50	93	Metal Loss	TBit	SK	Inspection Side
4915	106	51.93	220.31	1.16	0.98	97	Metal Loss	TBit	SK	Inspection Side
4916	106	58.46	56.46	1.28	0.65	97	Metal Loss	TBit	SK	Inspection Side
4917	106	17.95	81.93	1.44	0.59	98	Metal Loss	TBit	SK	Inspection Side
4918	107	20.51	84.72	0.49	0.31	49	Metal Loss	TBit	SK	Inspection Side
4919	107	20.04	12.76	0.63	0.34	49	Metal Loss	TBit	SK	Inspection Side
4920	107	26.61	96.22	0.53	0.35	50	Metal Loss	TBit	SK / CA	Inspection Side
4921	107	26.22	19.02	0.69	0.49	51	Metal Loss	TBit	SK	Inspection Side
4922	107	52.87	13.94	0.98	0.44	51	Metal Loss	TBit	SK	Inspection Side
4923	107	16.06	69.84	1.39	0.63	51	Metal Loss	TBit	SK	Inspection Side
4924	107	49.41	37.01	0.46	0.35	52	Metal Loss	TBit	SK	Inspection Side
4925	107	23.03	25.79	0.83	0.47	54	Metal Loss	TBit	SK	Inspection Side
4926	107	44.84	64.21	0.88	0.39	54	Metal Loss	TBit	SK / CA	Inspection Side
4927	107	48.78	48.62	0.91	0.47	54	Metal Loss	TBit	SK / CA	Inspection Side
4928	107	50.59	70.16	1.39	0.60	54	Metal Loss	TBit	SK / CA	Inspection Side
4929	107	21.93	23.46	0.56	0.43	55	Metal Loss	TBit	SK	Inspection Side
4930	107	17.99	41.65	1.18	0.35	55	Metal Loss	TBit	SK	Inspection Side
4931	107	47.68	30.67	1.48	0.53	55	Metal Loss	TBit	SK	Inspection Side
4932	107	52.28	52.32	1.15	0.49	56	Metal Loss	TBit	SK / CA	Inspection Side
4933	107	18.62	84.76	1.20	0.35	57	Metal Loss	TBit	SK	Inspection Side
4934	107	16.10	56.26	1.49	0.52	60	Metal Loss	TBit	SK	Inspection Side
4935	107	47.87	16.22	1.59	0.43	60	Metal Loss	TBit	SK	Inspection Side
4936	107	41.65	83.62	0.78	0.42	62	Metal Loss	TBit	SK / CA	Inspection Side
4937	107	44.69	85.51	0.82	0.37	62	Metal Loss	TBit	SK / CA	Inspection Side
4938	107	17.99	47.95	1.08	0.36	62	Metal Loss	TBit	SK	Inspection Side
4939	107	16.14	80.55	1.03	0.55	64	Metal Loss	TBit	SK	Inspection Side
4940	107	24.57	35.35	0.61	0.42	65	Metal Loss	TBit	SK	Inspection Side
4941	107	23.66	21.57	1.21	0.39	65	Metal Loss	TBit	SK	Inspection Side
4942	107	18.27	47.95	1.08	0.40	79	Metal Loss	TBit	SK	Inspection Side
4943	107	20.47	83.43	1.09	0.48	79	Metal Loss	TBit	SK	Inspection Side
4944	107	47.20	9.88	0.79	0.32	89	Metal Loss	TBit	SK	Inspection Side
4945	108	15.98	68.98	1.14	0.67	56	Metal Loss	TBit	SK	Inspection Side
4946	108	21.81	58.31	1.12	0.51	57	Metal Loss	TBit	SK	Inspection Side
4947	108	17.91	107.44	1.33	0.50	57	Metal Loss	TBit	SK / CA	Inspection Side
4948	108	30.28	35.75	1.48	0.60	70	Metal Loss	TBit	SK / CA	Inspection Side
4949	108	18.74	72.60	0.84	0.38	71	Metal Loss	TBit	SK	Inspection Side
4950	108	18.31	47.60	0.98	0.37	71	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4951	109	21.14	19.45	0.53	0.44	49	Metal Loss	TBit	SK	Inspection Side
4952	109	182.83	45.35	0.70	0.75	49	Metal Loss	TBit	SK / CA	Inspection Side
4953	109	170.35	50.04	0.81	0.55	49	Metal Loss	TBit	SK / CA	Inspection Side
4954	109	200.16	48.11	0.81	0.35	49	Metal Loss	TBit	SK / CA	Inspection Side
4955	109	161.73	48.43	1.06	0.78	49	Metal Loss	TBit	SK / CA	Inspection Side
4956	109	156.34	41.65	0.90	0.54	50	Metal Loss	TBit	SK / CA	Inspection Side
4957	109	10.71	12.76	1.03	0.50	50	Metal Loss	TBit	SK	Inspection Side
4958	109	208.62	8.07	1.09	0.65	50	Metal Loss	TBit	SK	Inspection Side
4959	109	199.45	28.07	1.33	0.68	50	Metal Loss	TBit	SK	Inspection Side
4960	109	159.65	49.61	1.87	0.87	50	Metal Loss	TBit	SK / CA	Inspection Side
4961	109	108.82	56.14	0.51	0.40	51	Metal Loss	TBit	SK / CA	Inspection Side
4962	109	180.98	47.76	0.58	0.33	51	Metal Loss	TBit	SK / CA	Inspection Side
4963	109	14.76	21.93	0.72	0.43	51	Metal Loss	TBit	SK	Inspection Side
4964	109	15.04	27.20	0.91	0.45	51	Metal Loss	TBit	SK	Inspection Side
4965	109	157.32	18.90	0.92	0.51	51	Metal Loss	TBit	SK	Inspection Side
4966	109	45.63	14.69	1.15	0.43	51	Metal Loss	TBit	SK	Inspection Side
4967	109	75.24	56.50	1.16	0.73	51	Metal Loss	TBit	SK / CA	Inspection Side
4968	109	97.36	22.68	1.19	0.50	51	Metal Loss	TBit	SK	Inspection Side
4969	109	23.62	40.43	1.33	0.64	51	Metal Loss	TBit	SK / CA	Inspection Side
4970	109	142.56	21.97	1.64	0.57	51	Metal Loss	TBit	SK	Inspection Side
4971	109	209.96	2.09	2.25	0.69	51	Metal Loss	TBit	SK	Inspection Side
4972	109	119.29	42.40	0.94	0.57	52	Metal Loss	TBit	SK / CA	Inspection Side
4973	109	162.68	49.41	0.99	0.81	52	Metal Loss	TBit	SK / CA	Inspection Side
4974	109	55.51	16.06	1.30	0.48	52	Metal Loss	TBit	SK	Inspection Side
4975	109	140.24	44.09	1.60	0.73	52	Metal Loss	TBit	SK / CA	Inspection Side
4976	109	107.80	50.91	1.65	0.88	52	Metal Loss	TBit	SK / CA	Inspection Side
4977	109	103.54	55.51	1.91	0.90	52	Metal Loss	TBit	SK / CA	Inspection Side
4978	109	210.08	8.58	2.08	0.29	52	Metal Loss	TBit	SK	Inspection Side
4979	109	150.59	52.05	0.54	0.40	53	Metal Loss	TBit	SK / CA	Inspection Side
4980	109	155.04	52.28	0.95	0.70	53	Metal Loss	TBit	SK / CA	Inspection Side
4981	109	137.17	44.09	1.28	0.64	53	Metal Loss	TBit	SK / CA	Inspection Side
4982	109	52.91	56.10	1.28	0.78	53	Metal Loss	TBit	SK / CA	Inspection Side
4983	109	10.12	14.92	1.85	0.65	53	Metal Loss	TBit	SK	Non Inspection Side
4984	109	92.68	42.32	0.64	0.37	54	Metal Loss	TBit	SK	Inspection Side
4985	109	20.94	17.40	0.65	0.28	54	Metal Loss	TBit	SK	Inspection Side
4986	109	20.75	21.93	0.83	0.36	54	Metal Loss	TBit	SK	Inspection Side
4987	109	186.81	15.28	0.87	0.24	54	Metal Loss	TBit	SK	Inspection Side
4988	109	38.35	31.22	0.99	0.53	54	Metal Loss	TBit	SK	Inspection Side
4989	109	131.30	41.42	2.03	0.86	54	Metal Loss	TBit	SK	Inspection Side
4990	109	148.70	46.22	0.77	0.51	55	Metal Loss	TBit	SK / CA	Inspection Side
4991	109	26.42	17.24	0.89	0.50	55	Metal Loss	TBit	SK	Inspection Side
4992	109	18.03	15.12	0.90	0.47	55	Metal Loss	TBit	SK	Inspection Side
4993	109	148.03	30.16	1.31	1.29	55	Metal Loss	TBit	SK	Inspection Side
4994	109	10.35	0.75	1.46	0.88	55	Metal Loss	TBit	SK	Inspection Side
4995	109	186.18	22.56	1.43	1.71	56	Metal Loss	TBit	SK	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
4996	109	19.57	9.49	1.80	0.55	56	Metal Loss	TBit	SK	Inspection Side
4997	109	12.40	22.68	2.42	0.44	56	Metal Loss	TBit	SK	Inspection Side
4998	109	155.24	42.87	0.78	0.31	58	Metal Loss	TBit	SK / CA	Inspection Side
4999	109	33.94	16.97	0.86	0.40	59	Metal Loss	TBit	SK	Inspection Side
5000	109	151.38	43.31	0.86	0.54	59	Metal Loss	TBit	SK / CA	Inspection Side
5001	109	182.40	41.97	0.86	0.57	59	Metal Loss	TBit	SK / CA	Inspection Side
5002	109	94.69	42.01	1.11	0.86	59	Metal Loss	TBit	SK	Inspection Side
5003	109	168.03	47.91	1.20	0.64	59	Metal Loss	TBit	SK / CA	Inspection Side
5004	109	137.05	18.74	1.25	0.69	60	Metal Loss	TBit	SK	Inspection Side
5005	109	185.28	47.76	1.34	1.01	60	Metal Loss	TBit	SK / CA	Inspection Side
5006	109	21.77	21.46	0.80	0.38	61	Metal Loss	TBit	SK	Inspection Side
5007	109	16.26	15.59	1.45	0.55	61	Metal Loss	TBit	SK	Inspection Side
5008	109	18.43	16.81	0.46	0.31	62	Metal Loss	TBit	SK	Inspection Side
5009	109	159.72	52.32	2.43	0.79	64	Metal Loss	TBit	SK / CA	Inspection Side
5010	109	155.94	51.42	1.55	0.63	65	Metal Loss	TBit	SK / CA	Inspection Side
5011	109	19.37	16.93	1.15	0.34	66	Metal Loss	TBit	SK	Inspection Side
5012	109	180.91	46.81	1.00	0.62	67	Metal Loss	TBit	SK / CA	Inspection Side
5013	109	169.25	49.09	0.69	0.47	68	Metal Loss	TBit	SK / CA	Inspection Side
5014	109	192.32	9.21	0.84	0.35	68	Metal Loss	TBit	SK	Inspection Side
5015	109	186.54	48.31	1.24	0.93	69	Metal Loss	TBit	SK / CA	Inspection Side
5016	109	65.00	16.65	1.53	0.87	70	Metal Loss	TBit	SK	Inspection Side
5017	109	11.46	15.00	2.03	0.71	72	Metal Loss	TBit	SK	Inspection Side
5018	109	193.98	30.63	1.12	0.46	73	Metal Loss	TBit	SK	Inspection Side
5019	109	25.87	15.35	1.17	0.31	75	Metal Loss	TBit	SK	Inspection Side
5020	109	104.69	16.14	1.41	0.78	76	Metal Loss	TBit	SK	Inspection Side
5021	109	206.81	16.02	1.56	0.63	76	Metal Loss	TBit	SK	Inspection Side
5022	109	91.89	15.43	1.10	0.88	78	Metal Loss	TBit	SK	Inspection Side
5023	109	21.97	17.09	0.74	0.33	80	Metal Loss	TBit	SK	Inspection Side
5024	109	193.74	42.60	0.89	0.55	82	Metal Loss	TBit	SK / CA	Inspection Side
5025	109	74.88	17.68	1.33	1.12	86	Metal Loss	TBit	SK	Inspection Side
5026	110	32.36	40.94	1.17	0.63	49	Metal Loss	TBit	SK / CA	Inspection Side
5027	110	41.30	15.20	1.19	0.56	49	Metal Loss	TBit	SK	Inspection Side
5028	110	39.33	14.88	1.19	0.67	49	Metal Loss	TBit	SK	Inspection Side
5029	110	16.57	43.39	1.70	0.85	49	Metal Loss	TBit	SK / CA	Inspection Side
5030	110	90.55	30.20	0.60	0.29	50	Metal Loss	TBit	SK / CA	Inspection Side
5031	110	84.41	30.20	0.88	0.81	50	Metal Loss	TBit	SK / CA	Inspection Side
5032	110	41.77	43.70	0.95	0.58	50	Metal Loss	TBit	SK / CA	Non Inspection Side
5033	110	122.52	13.98	1.12	0.48	50	Metal Loss	TBit	SK / CA	Inspection Side
5034	110	47.76	39.29	1.19	0.57	50	Metal Loss	TBit	SK / CA	Inspection Side
5035	110	102.52	19.17	0.65	0.51	51	Metal Loss	TBit	SK / CA	Inspection Side
5036	110	50.00	30.47	0.77	0.18	51	Metal Loss	TBit	SK / CA	Inspection Side
5037	110	63.50	18.43	0.93	0.47	51	Metal Loss	TBit	SK	Inspection Side
5038	110	62.20	27.80	1.06	0.35	51	Metal Loss	TBit	SK / CA	Inspection Side
5039	110	44.33	37.40	1.09	0.56	51	Metal Loss	TBit	SK / CA	Inspection Side
5040	110	128.62	18.03	1.54	0.46	51	Metal Loss	TBit	SK / CA	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -


Feature List

Metal loss 49 % - 100 % ; Size 0.0 in. - 39.4 in.
All Plates ; All Types ; All Methods (the accuracy of feature pos. is +/- 2 in.)
Feature List - Inspection side: 4725, non inspection side: 352

No.	Plate No.	X Pos. [in.]	Y Pos. [in.]	X Size [in.]	Y Size [in.]	Depth [%]	Type	Method	Location	Classification
5041	110	15.28	10.79	1.72	0.64	51	Metal Loss	TBit	SK	Inspection Side
5042	110	74.41	17.68	0.59	0.33	52	Metal Loss	TBit	SK	Inspection Side
5043	110	23.98	41.50	1.58	0.73	52	Metal Loss	TBit	SK / CA	Inspection Side
5044	110	54.49	32.52	0.66	0.31	53	Metal Loss	TBit	SK / CA	Inspection Side
5045	110	35.55	40.39	1.52	0.62	54	Metal Loss	TBit	SK / CA	Inspection Side
5046	110	32.56	23.46	0.66	0.54	55	Metal Loss	TBit	SK	Inspection Side
5047	110	13.86	11.65	0.75	0.40	55	Metal Loss	TBit	SK	Inspection Side
5048	110	83.66	24.29	0.79	0.32	55	Metal Loss	TBit	SK / CA	Inspection Side
5049	110	27.91	16.18	1.30	0.55	55	Metal Loss	TBit	SK	Inspection Side
5050	110	50.24	24.37	0.53	0.44	56	Metal Loss	TBit	SK	Inspection Side
5051	110	42.05	33.03	1.18	0.70	56	Metal Loss	TBit	SK / CA	Inspection Side
5052	110	50.12	21.10	0.69	0.47	57	Metal Loss	TBit	SK	Inspection Side
5053	110	10.20	40.08	1.02	0.28	57	Metal Loss	TBit	SK / CA	Non Inspection Side
5054	110	23.82	7.60	1.96	0.91	58	Metal Loss	TBit	SK	Inspection Side
5055	110	34.41	34.72	0.97	0.35	59	Metal Loss	TBit	SK / CA	Inspection Side
5056	110	84.88	24.37	1.20	0.46	59	Metal Loss	TBit	SK / CA	Inspection Side
5057	110	51.30	30.67	0.66	0.46	60	Metal Loss	TBit	SK / CA	Inspection Side
5058	110	82.24	27.28	0.73	0.51	60	Metal Loss	TBit	SK / CA	Inspection Side
5059	110	65.63	17.68	0.95	0.46	60	Metal Loss	TBit	SK	Inspection Side
5060	110	51.14	17.68	0.69	0.38	61	Metal Loss	TBit	SK	Inspection Side
5061	110	11.85	14.49	0.71	0.57	61	Metal Loss	TBit	SK	Non Inspection Side
5062	110	32.24	38.78	0.90	0.64	61	Metal Loss	TBit	SK / CA	Non Inspection Side
5063	110	42.72	26.38	0.79	0.49	62	Metal Loss	TBit	SK	Inspection Side
5064	110	19.57	28.43	1.29	0.82	62	Metal Loss	TBit	SK	Inspection Side
5065	110	14.41	29.96	1.34	0.68	62	Metal Loss	TBit	SK	Inspection Side
5066	110	137.05	17.91	2.10	0.79	62	Metal Loss	TBit	SK / CZ / CA	Inspection Side
5067	110	18.58	13.82	1.05	0.47	63	Metal Loss	TBit	SK	Inspection Side
5068	110	96.65	23.39	1.00	0.37	65	Metal Loss	TBit	SK / CA	Inspection Side
5069	110	53.31	37.95	0.76	0.42	67	Metal Loss	TBit	SK / CA	Inspection Side
5070	110	45.20	20.91	0.87	0.47	68	Metal Loss	TBit	SK	Inspection Side
5071	110	131.97	13.43	4.17	0.55	68	Metal Loss	TBit	SK / CA	Inspection Side
5072	110	13.66	40.31	1.53	0.86	69	Metal Loss	TBit	SK / CA	Inspection Side
5073	110	57.09	30.28	1.05	0.43	71	Metal Loss	TBit	SK / CA	Inspection Side
5074	110	36.02	33.74	1.37	0.80	81	Metal Loss	TBit	SK / CA	Inspection Side
5075	110	15.35	20.28	2.38	1.47	90	Metal Loss	TBit	SK	Inspection Side
5076	110	43.54	32.36	0.88	0.46	97	Metal Loss	TBit	SK / CA	Inspection Side
5077	110	13.54	42.13	2.05	0.96	97	Metal Loss	TBit	SK / CA	Inspection Side

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Floor Map (Repair Recommendations)

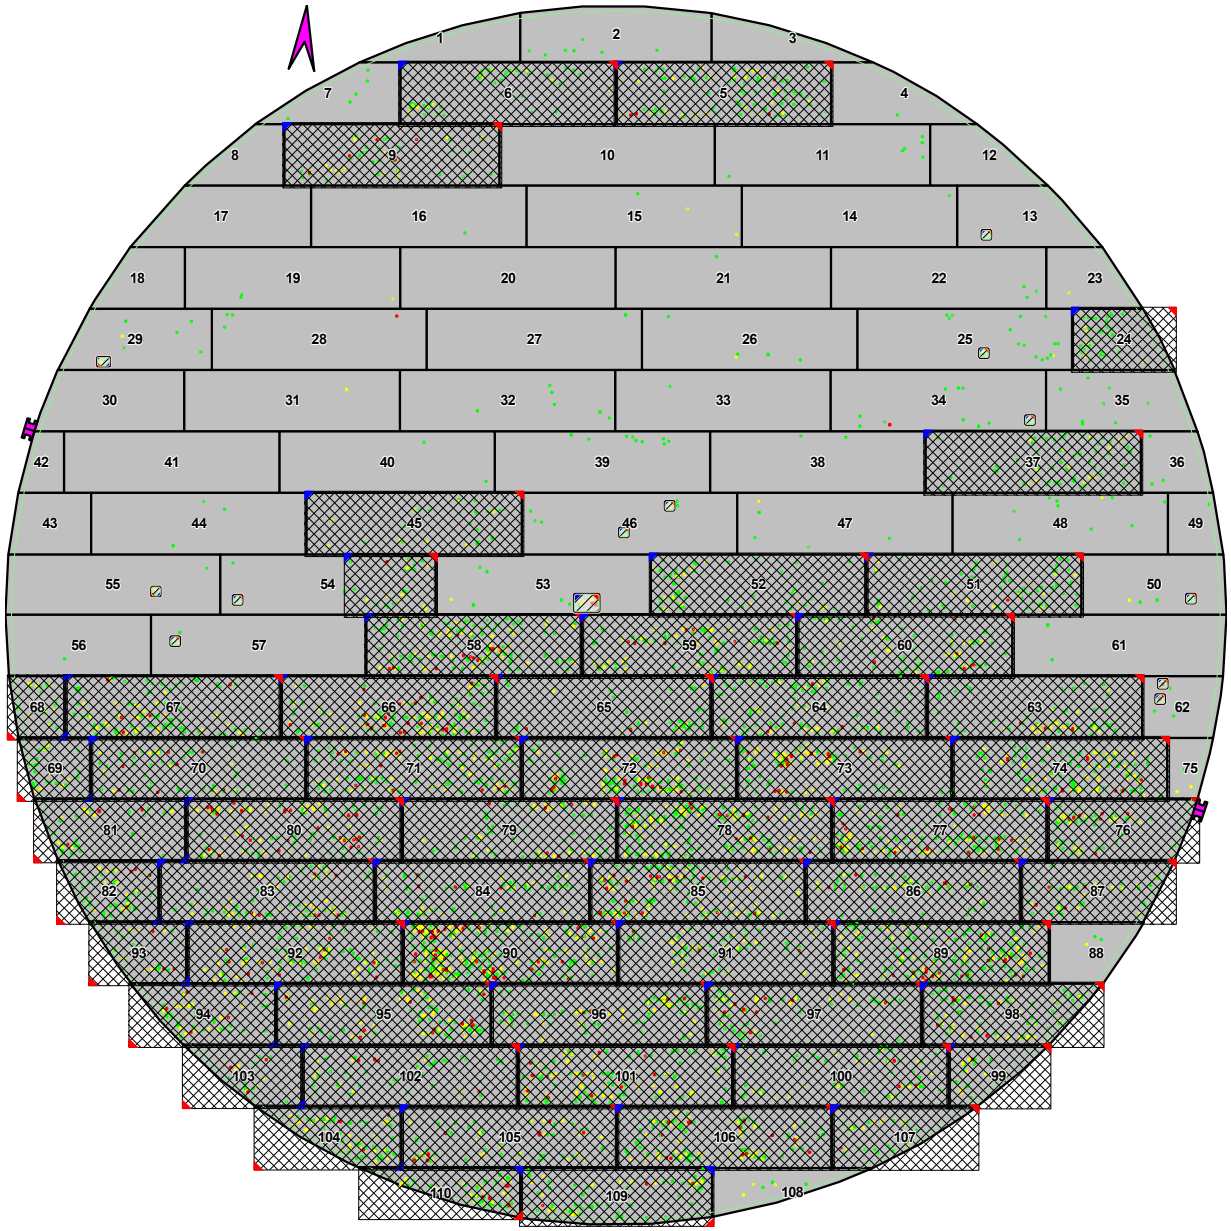

Classification

Feature

0	20 %
142	40 %
18	60 %
2	80 %
	100%

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair summary

Blue corner is position 1 and red corner is position 2
point of all repair patch types

patch area : 941845.88 sq in.
weld length : 34325.4 in.

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

List of Repair Patches/Plates

total repaired area : 941845.881 sq in.

total weld length : 34325.36 in.

Replacement Plate/Patch List - Repair plates: 56, partial repair plates: 1, patches: 13

No.	Type	Plate No.	X Pos.[in.]	Y Pos.[in.]	X Dir.[in.]	Y Dir.[in.]	X Dim.[in.]	Y Dim.[in.]	Angle to Y[°]
1	Replacement plate	5	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
2	Replacement plate	6	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
3	Replacement plate	9	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	75 (2.00)	251 (2.00)	0
4	Replacement plate	24	-1.93	-1.97	-1.93 (2.00)	118.15 (2.00)	75 (2.00)	121 (2.00)	0
5	Replacement plate	37	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
6	Replacement plate	45	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
7	Replacement plate	51	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	74 (2.00)	251 (2.00)	0
8	Replacement plate	52	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	74 (2.00)	251 (2.00)	0
9	Replacement plate	58	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
10	Replacement plate	59	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
11	Replacement plate	60	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
12	Replacement plate	63	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
13	Replacement plate	64	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
14	Replacement plate	65	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
15	Replacement plate	66	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
16	Replacement plate	67	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
17	Replacement plate	68	-2.01	-1.97	-2.01 (2.00)	66.77 (2.00)	75 (2.00)	69 (2.00)	0
18	Replacement plate	69	-2.01	-1.97	-2.01 (2.00)	84.69 (2.00)	75 (2.00)	87 (2.00)	0
19	Replacement plate	70	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
20	Replacement plate	71	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
21	Replacement plate	72	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
22	Replacement plate	73	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
23	Replacement plate	74	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
24	Replacement plate	76	-1.93	-1.97	-1.93 (2.00)	174.06 (2.00)	75 (2.00)	177 (2.00)	0
25	Replacement plate	77	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
26	Replacement plate	78	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
27	Replacement plate	79	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
28	Replacement plate	80	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
29	Replacement plate	81	-2.01	-1.97	-2.01 (2.00)	175.24 (2.00)	75 (2.00)	178 (2.00)	0
30	Replacement plate	82	-2.01	-1.97	-2.01 (2.00)	117.95 (2.00)	75 (2.00)	120 (2.00)	0
31	Replacement plate	83	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
32	Replacement plate	84	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
33	Replacement plate	85	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
34	Replacement plate	86	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
35	Replacement plate	87	-1.93	-1.97	-1.93 (2.00)	177.80 (2.00)	75 (2.00)	180 (2.00)	0
36	Replacement plate	89	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
37	Replacement plate	90	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
38	Replacement plate	91	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
39	Replacement plate	92	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
40	Replacement plate	93	-2.01	-1.97	-2.01 (2.00)	112.83 (2.00)	75 (2.00)	115 (2.00)	0
41	Replacement plate	94	-2.01	-1.97	-2.01 (2.00)	168.54 (2.00)	75 (2.00)	171 (2.00)	0
42	Replacement plate	95	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
43	Replacement plate	96	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
44	Replacement plate	97	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
45	Replacement plate	98	-1.93	-1.97	-1.93 (2.00)	208.11 (2.00)	75 (2.00)	211 (2.00)	0

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

List of Repair Patches/Plates

total repaired area : 941845.881 sq in.

total weld length : 34325.36 in.

Replacement Plate/Patch List - Repair plates: 56, partial repair plates: 1, patches: 13

No.	Type	Plate No.	X Pos.[in.]	Y Pos.[in.]	X Dir.[in.]	Y Dir.[in.]	X Dim.[in.]	Y Dim.[in.]	Angle to Y[°]
46	Replacement plate	99	-1.93	-1.97	-1.93 (2.00)	116.77 (2.00)	75 (2.00)	119 (2.00)	0
47	Replacement plate	100	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
48	Replacement plate	101	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
49	Replacement plate	102	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
50	Replacement plate	103	-2.01	-1.97	-2.01 (2.00)	137.64 (2.00)	75 (2.00)	140 (2.00)	0
51	Replacement plate	104	-2.01	-1.97	-2.01 (2.00)	169.13 (2.00)	75 (2.00)	172 (2.00)	0
52	Replacement plate	105	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
53	Replacement plate	106	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)	0
54	Replacement plate	107	-1.93	-1.97	-1.93 (2.00)	167.56 (2.00)	75 (2.00)	170 (2.00)	0
55	Replacement plate	109	-1.97	-1.97	-1.97 (2.00)	66.50 (2.00)	223 (2.00)	69 (2.00)	0
56	Replacement plate	110	-1.97	-1.97	-1.97 (2.00)	58.70 (2.00)	188 (2.00)	61 (2.00)	0
57	Rounded Rectangle	13	49.72	27.24	49.72	39.06	12	12	0
58	Rounded Rectangle	25	44.69	138.62	44.69	150.43	12	12	0
59	Rounded Rectangle	29	4.02	116.02	4.02	132.01	12	16	0
60	Rounded Rectangle	34	50.79	221.57	50.79	233.39	12	12	0
61	Rounded Rectangle	46	38.78	110.63	38.78	122.44	12	12	0
62	Rounded Rectangle	46	8.35	162.95	8.35	174.76	12	12	0
63	Rounded Rectangle	50	44.21	119.29	44.21	131.10	12	12	0
64	Rounded Rectangle	53	44.17	157.91	44.17	187.99	22	31	0
65	Partial replacement plate	54	-1.65	142.13	-1.65	248.50	74	107	0
66	Rounded Rectangle	54	45.75	13.74	45.75	25.55	12	12	0
67	Rounded Rectangle	55	21.18	68.03	21.18	79.84	12	12	0
68	Rounded Rectangle	57	23.82	21.57	23.82	33.39	12	12	0
69	Rounded Rectangle	62	2.24	17.36	2.24	29.17	12	12	0
70	Rounded Rectangle	62	19.76	14.57	19.76	26.38	12	12	0

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Repair Patch/Plate Summary

total repaired area : 941845.881 sq in.


total weld length : 34325.36 m

Repair Summary List - Repair plates: 56, partial repair plates: 1, patches: 13

	Type	Total number of repairs	length [in.]	width [in.]
1	Replacement plate	21	75	251
2	Replacement plate	1	75	251
3	Replacement plate	1	75	121
4	Replacement plate	13	75	251
5	Replacement plate	1	74	251
6	Replacement plate	1	74	251
7	Replacement plate	1	75	69
8	Replacement plate	1	75	87
9	Replacement plate	1	75	177
10	Replacement plate	1	75	178
11	Replacement plate	1	75	120
12	Replacement plate	1	75	180
13	Replacement plate	1	75	115
14	Replacement plate	1	75	171
15	Replacement plate	1	75	211
16	Replacement plate	1	75	119
17	Replacement plate	3	75	251
18	Replacement plate	1	75	140
19	Replacement plate	1	75	172
20	Replacement plate	1	75	170
21	Replacement plate	1	223	69
22	Replacement plate	1	188	61
23	Rounded Rectangle	11	12	12
24	Rounded Rectangle	1	12	16
25	Rounded Rectangle	1	22	31
26	Partial replacement plate	1	74	107

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 2 (1 of 2)

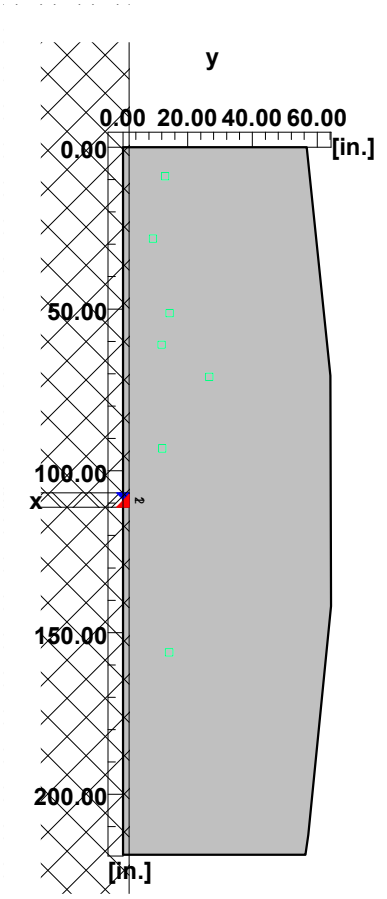

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
1	5	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
2	6	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
7	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 2 (2 of 2)

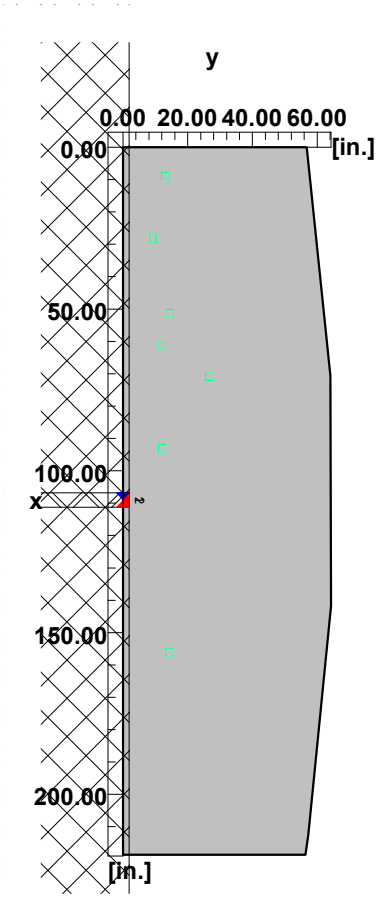

Replacement Plate/Patch List

No.	Angle to Y [°]
1	90
2	90

Classification

Feature

0	20 %
7	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 4 (1 of 2)

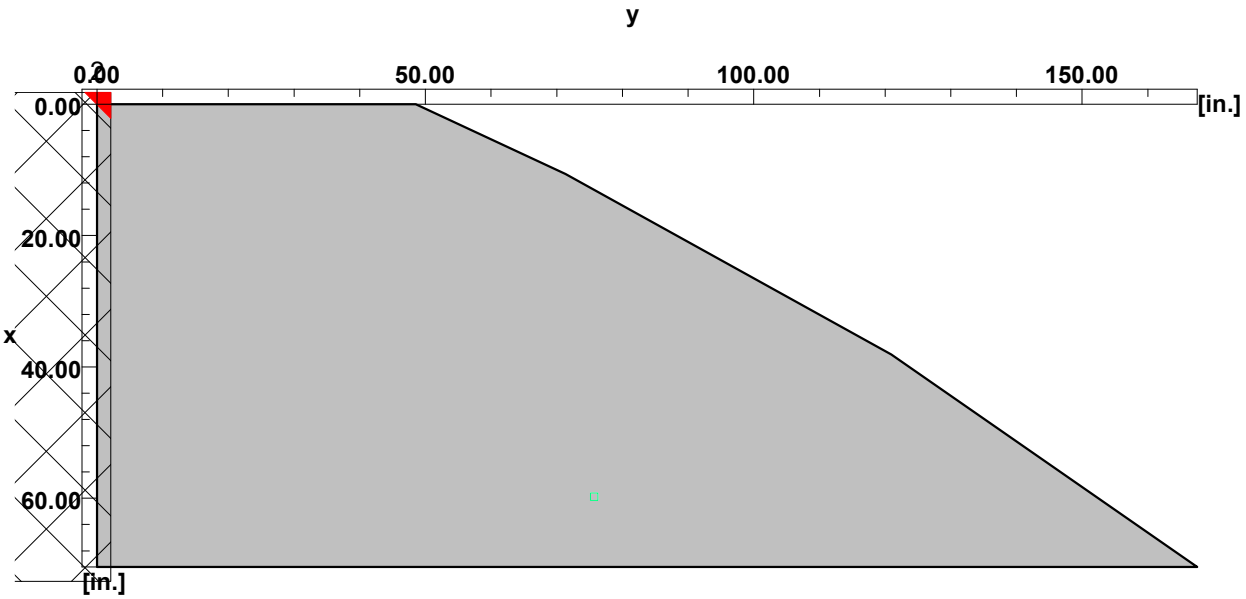

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
1	5	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 4 (2 of 2)

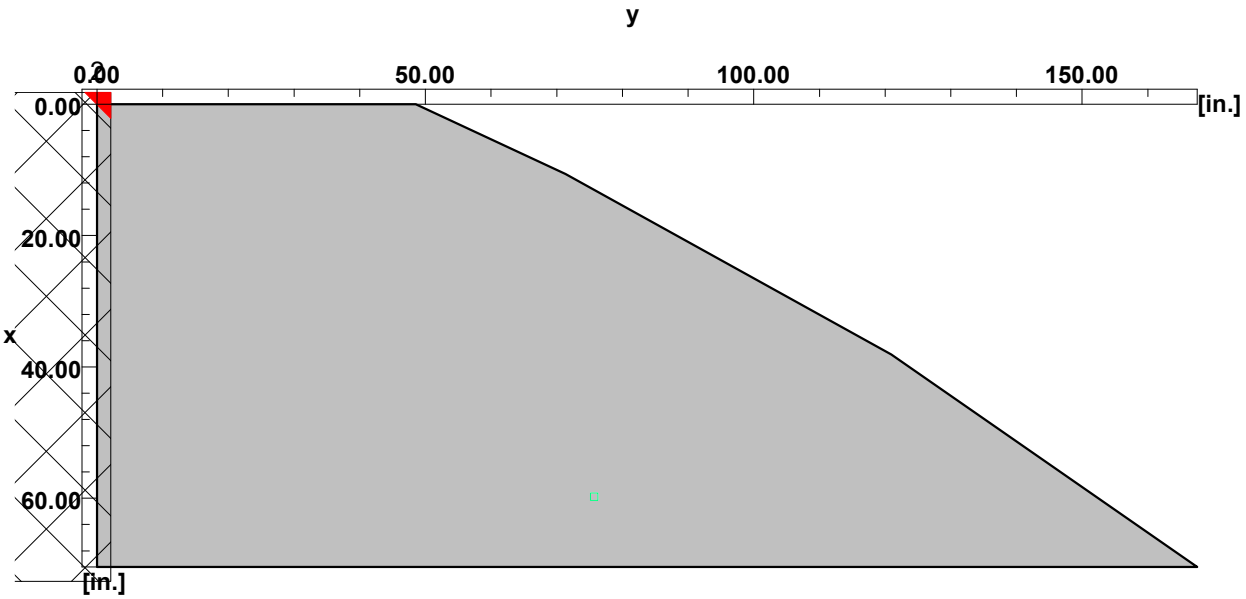

Replacement Plate/Patch List

No.	Angle to Y [°]
1	0

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 5 (1 of 2)

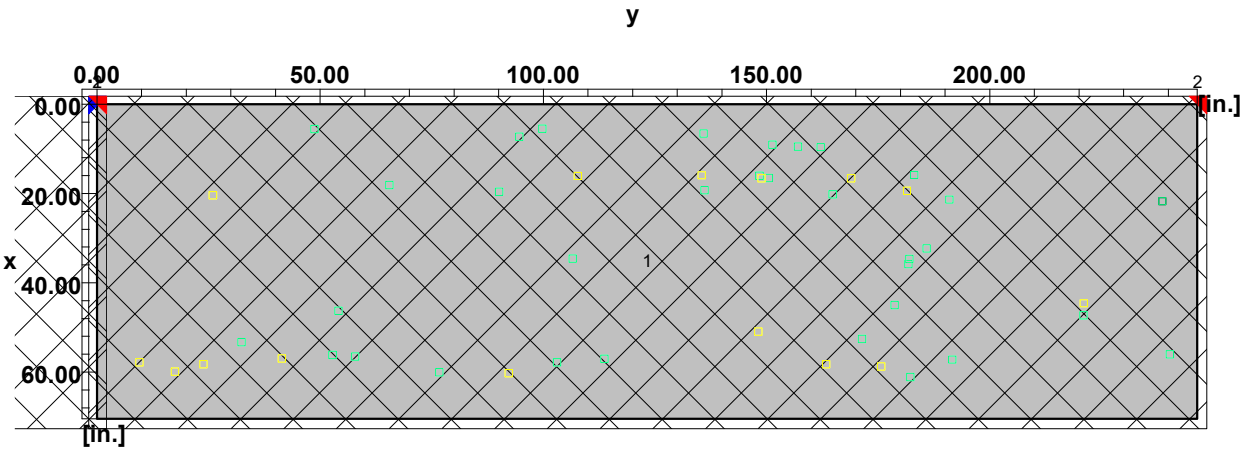

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
1	5	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
2	6	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 5 (2 of 2)

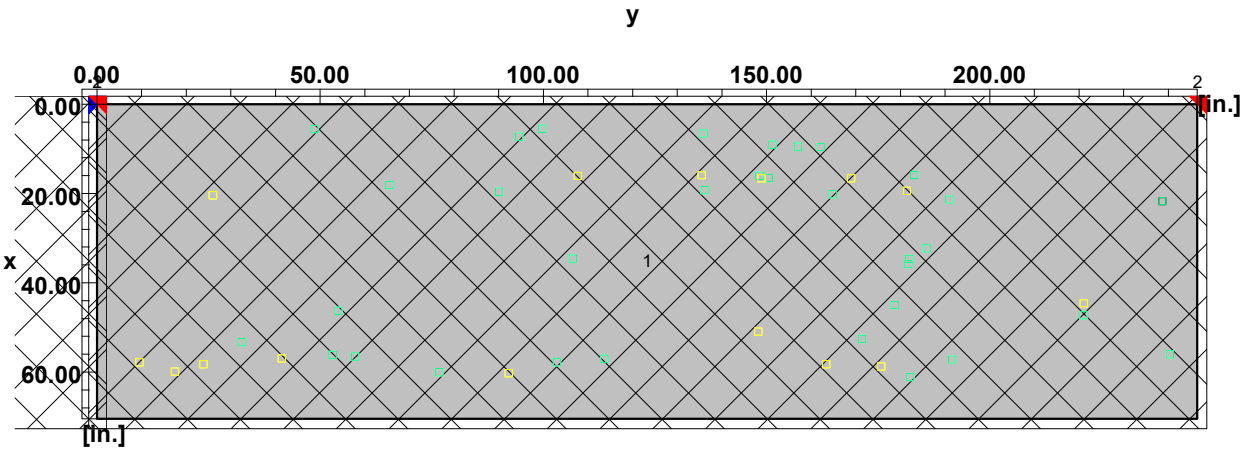

Replacement Plate/Patch List

No.	Angle to Y [°]
1	0
2	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 6 (1 of 2)

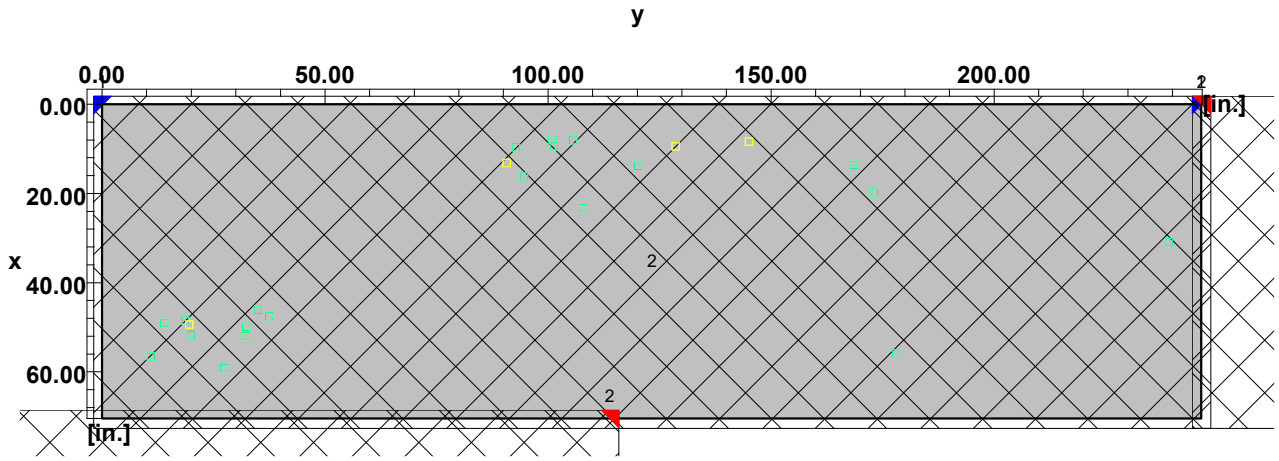

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
1	5	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
2	6	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
3	9	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 6 (2 of 2)

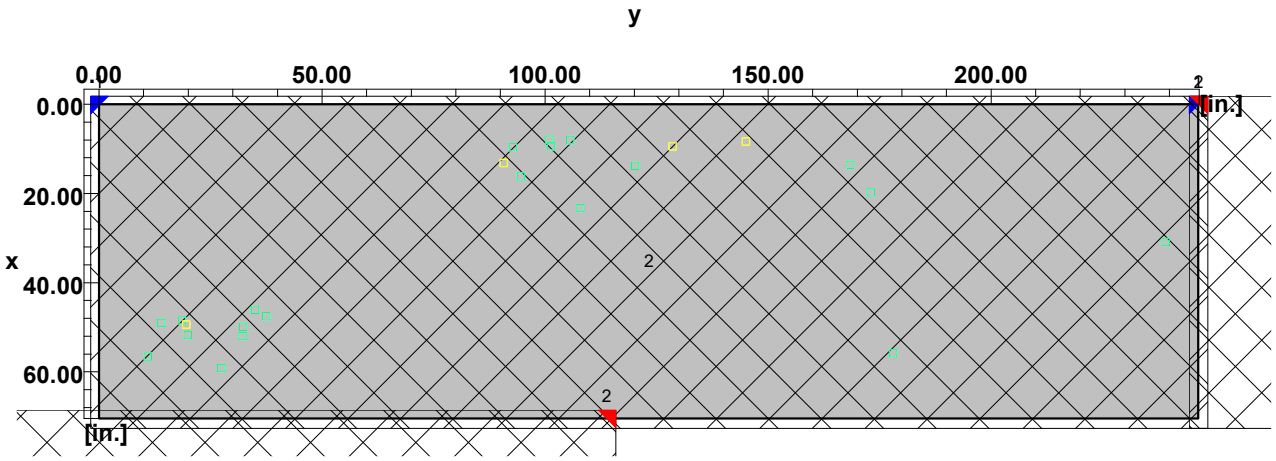

Replacement Plate/Patch List

No.	Angle to Y [°]
1	0
2	0
3	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 7 (1 of 2)

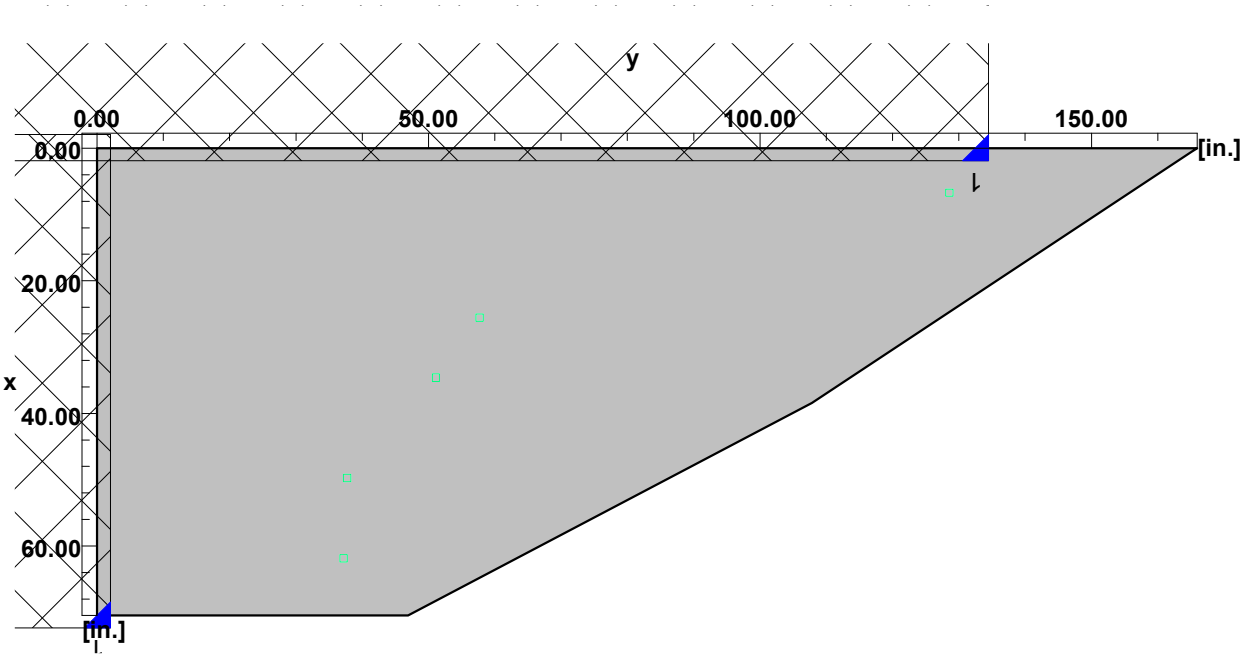

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
2	6	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
3	9	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
5	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 7 (2 of 2)

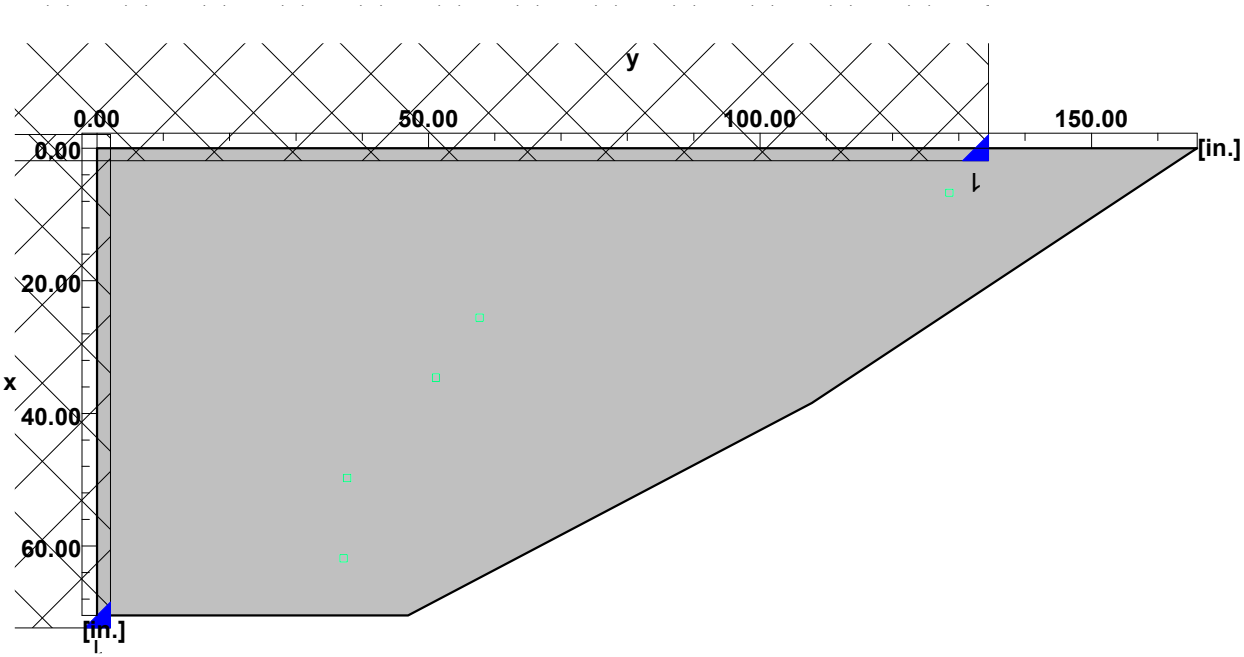

Replacement Plate/Patch List

No.	Angle to Y [°]
2	180
3	180

Classification

Feature

0	20 %
5	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 9 (1 of 2)

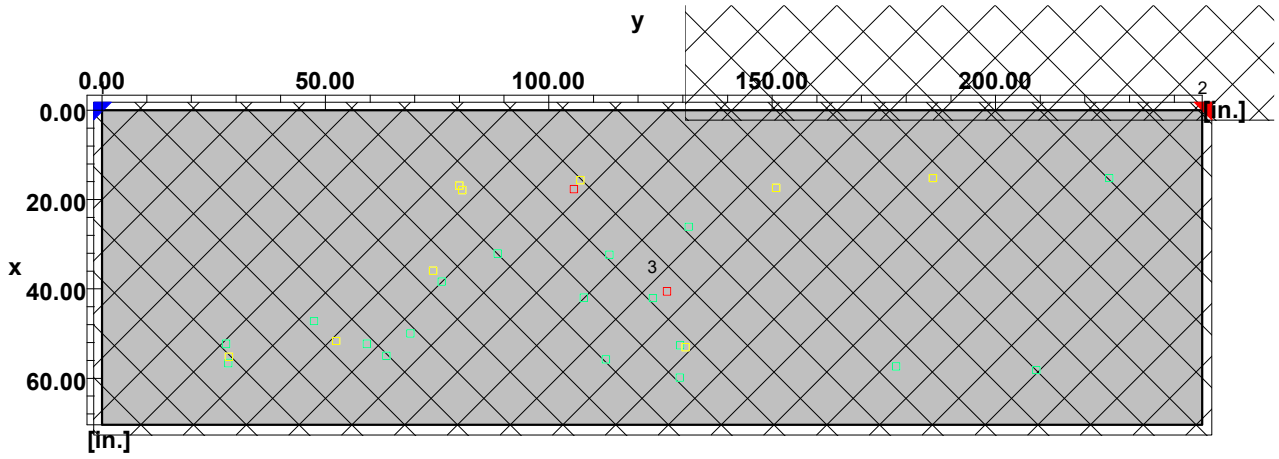

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
2	6	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
3	9	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 9 (2 of 2)

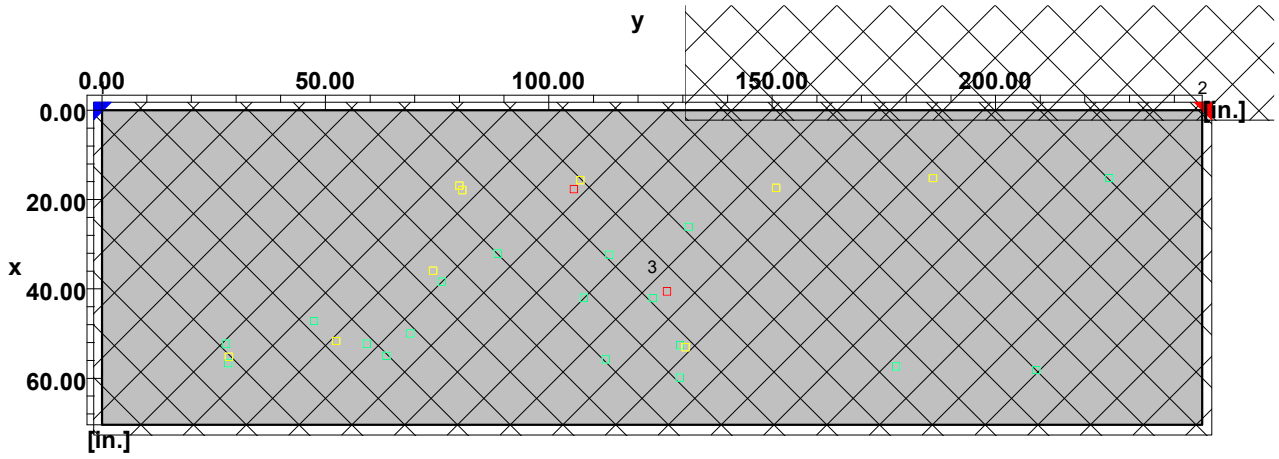

Replacement Plate/Patch List

No.	Angle to Y [°]
2	0
3	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 11 (1 of 2)

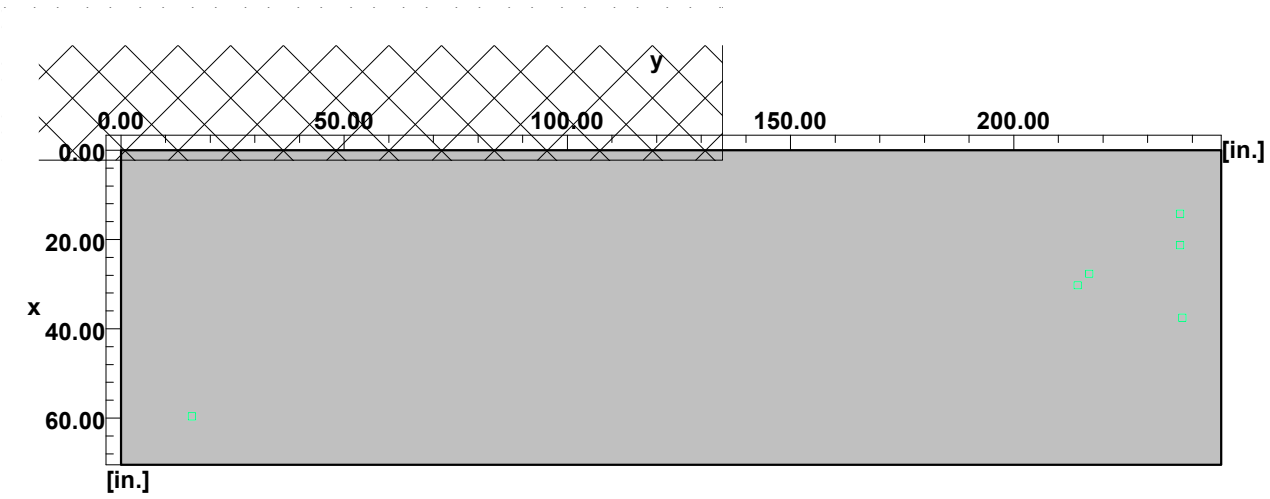

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
1	5	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
6	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 11 (2 of 2)

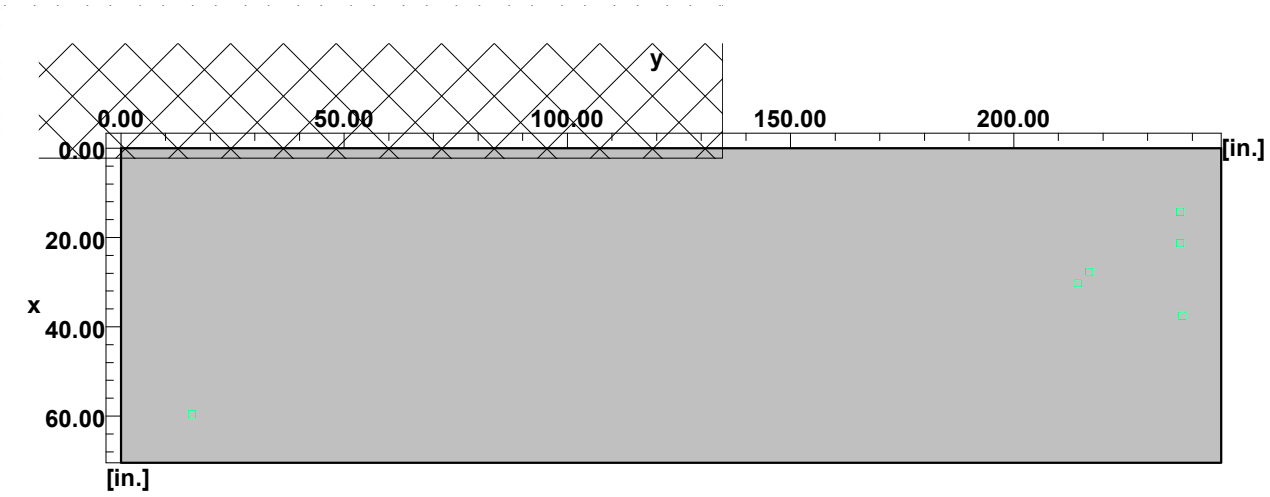

Replacement Plate/Patch List

No.	Angle to Y [°]
1	0

Classification

Feature

0	20 %
6	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 13

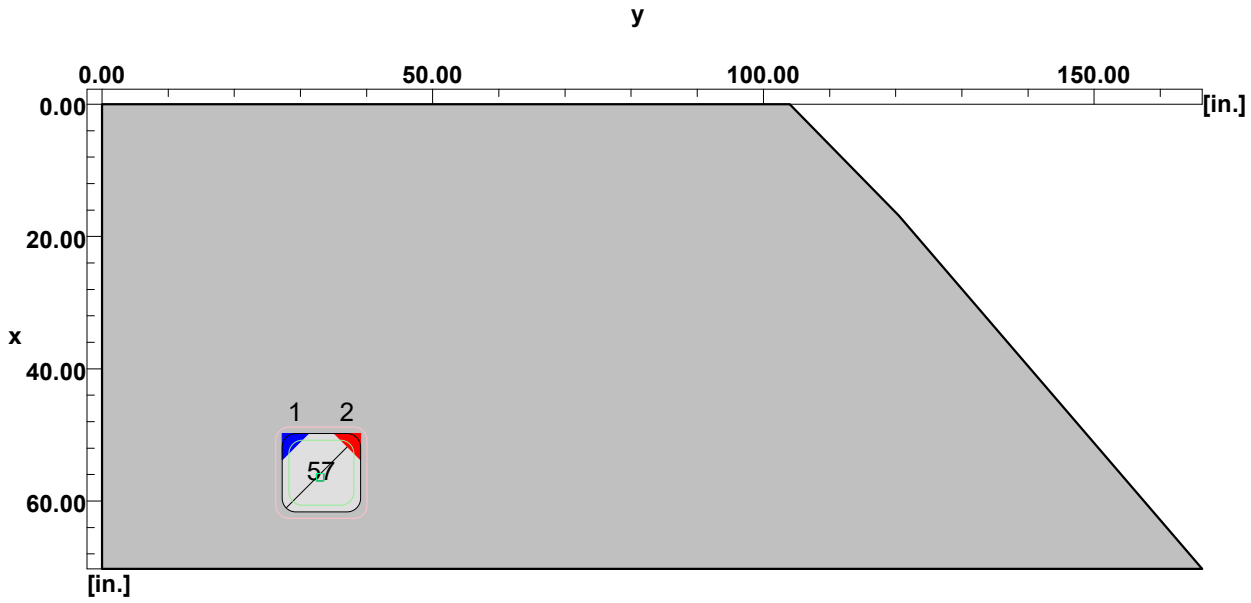

Replacement Plate/Patch List

		Position 1		Position 2		Dimension		Angle to Y
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]	[°]
57	13	49.72	27.24	49.72	39.06	12	12	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 14

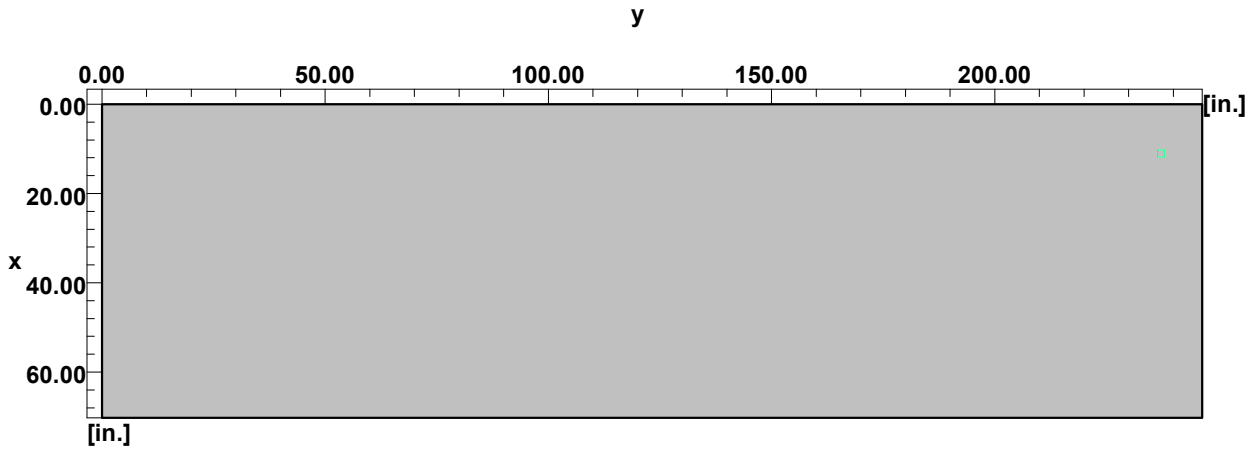

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 15

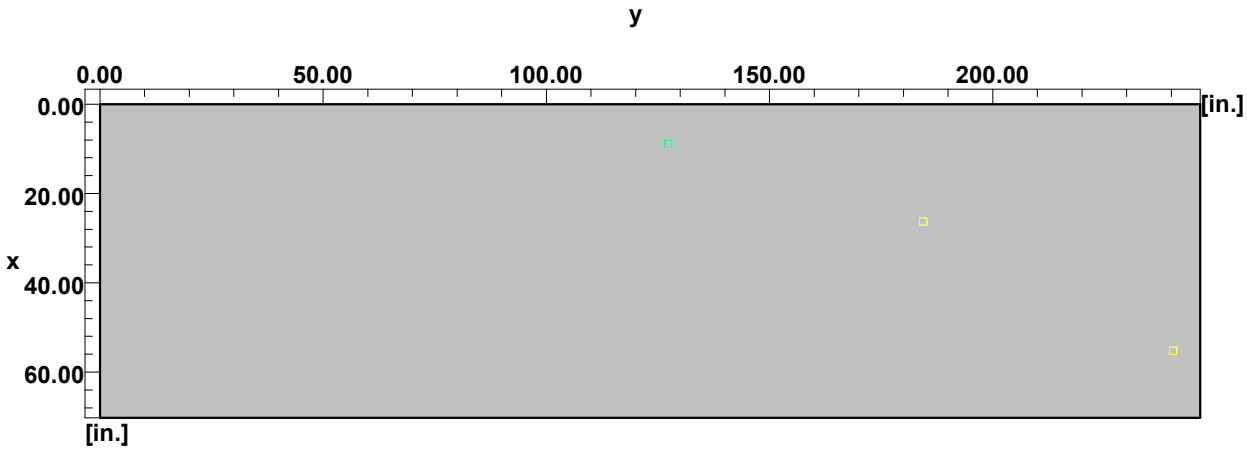

Classification

Feature

0	20 %
1	40 %
2	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 16 (1 of 2)

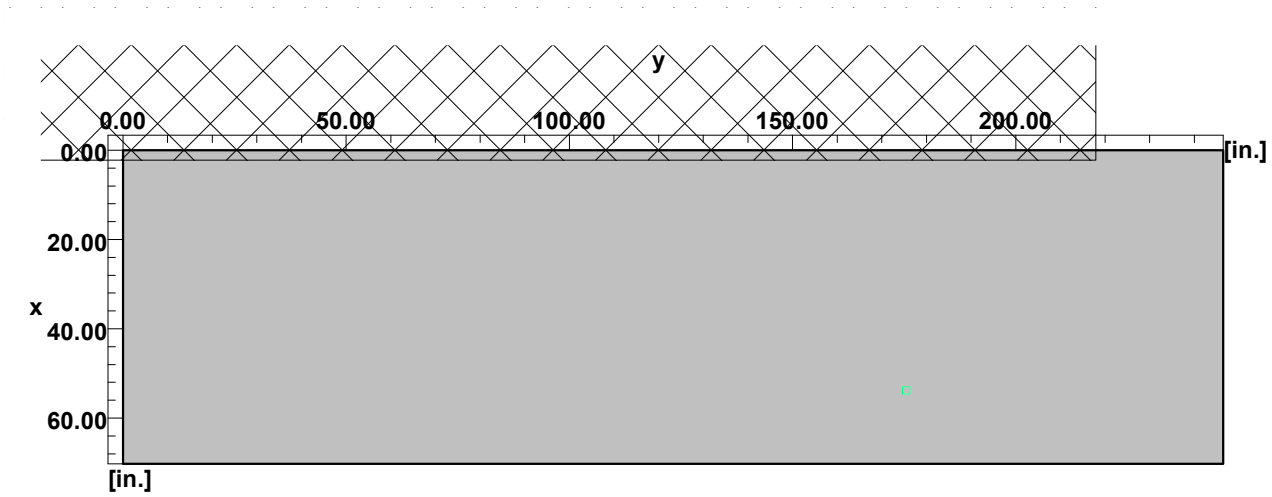

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
3	9	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 16 (2 of 2)

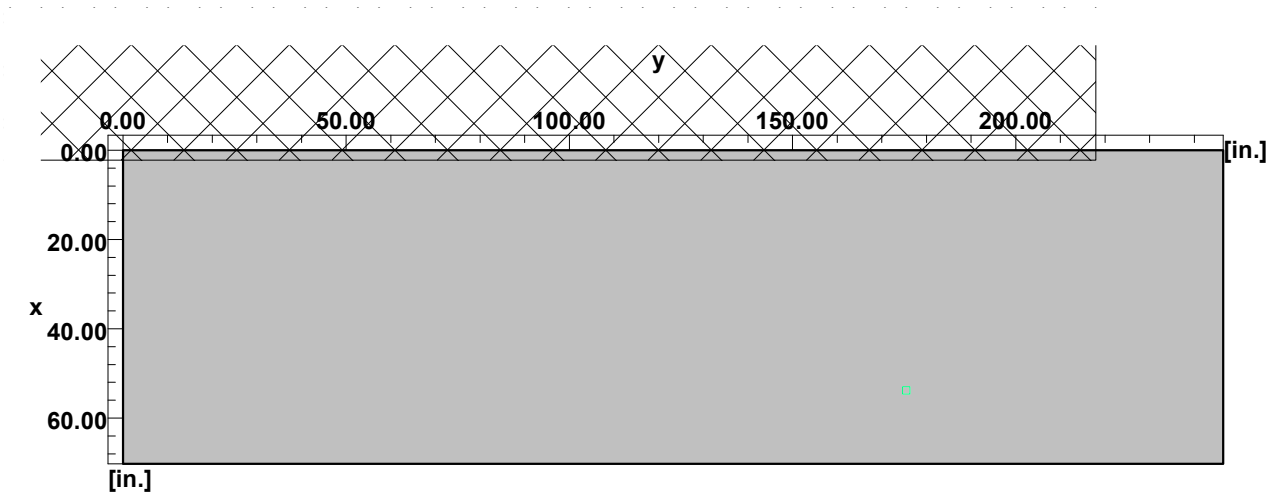

Replacement Plate/Patch List

No.	Angle to Y [°]
3	0

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 19

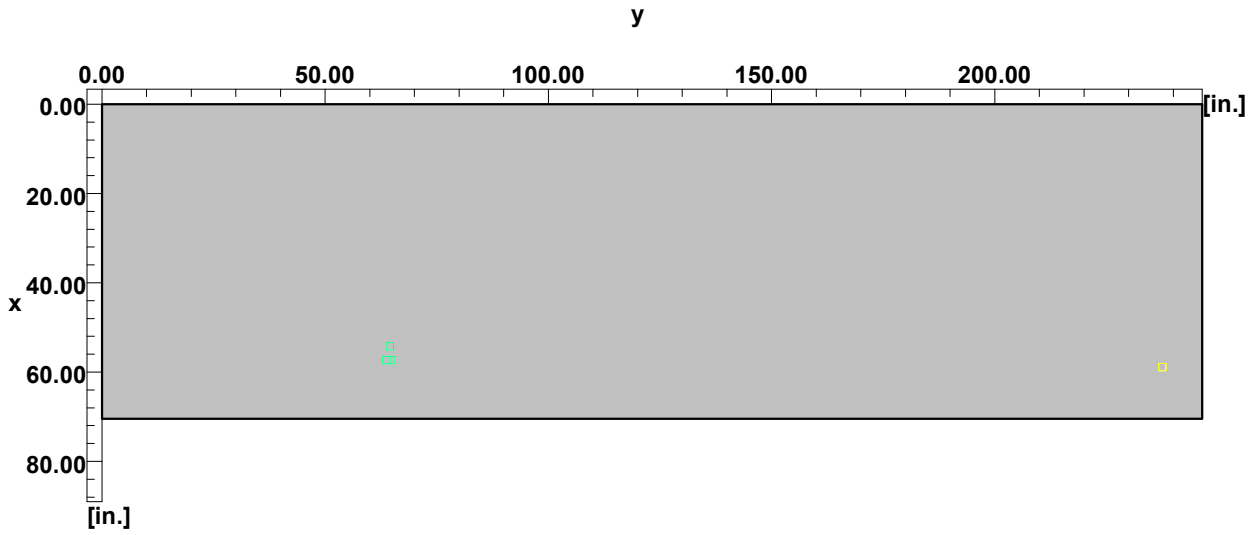

Classification

Feature

0	20 %
3	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 21

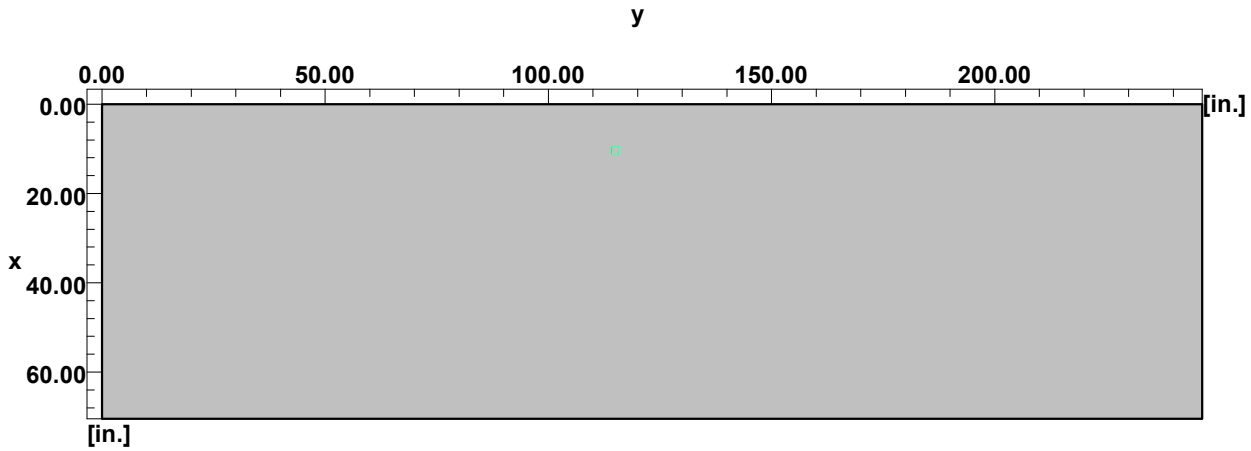

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 22

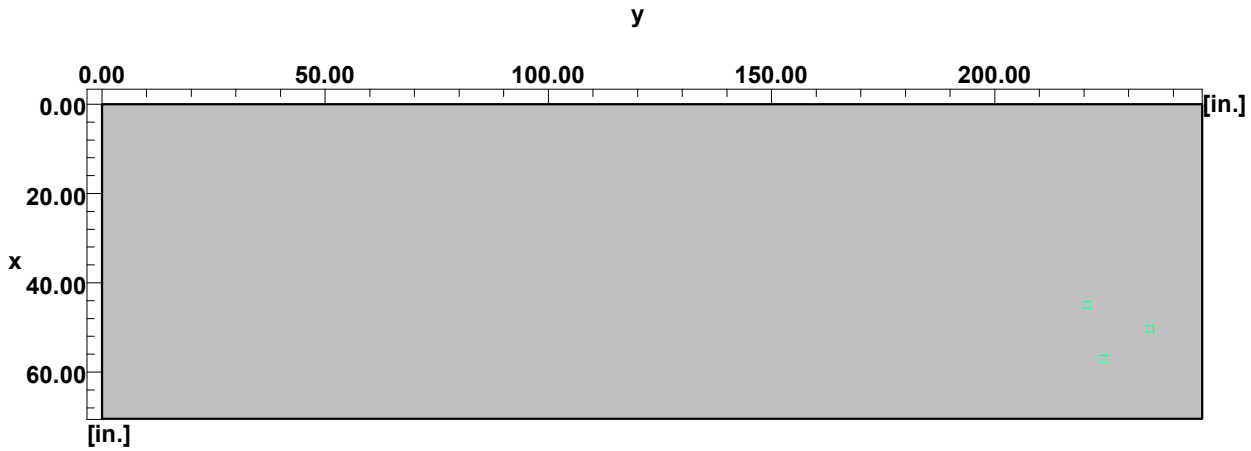

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 23 (1 of 2)

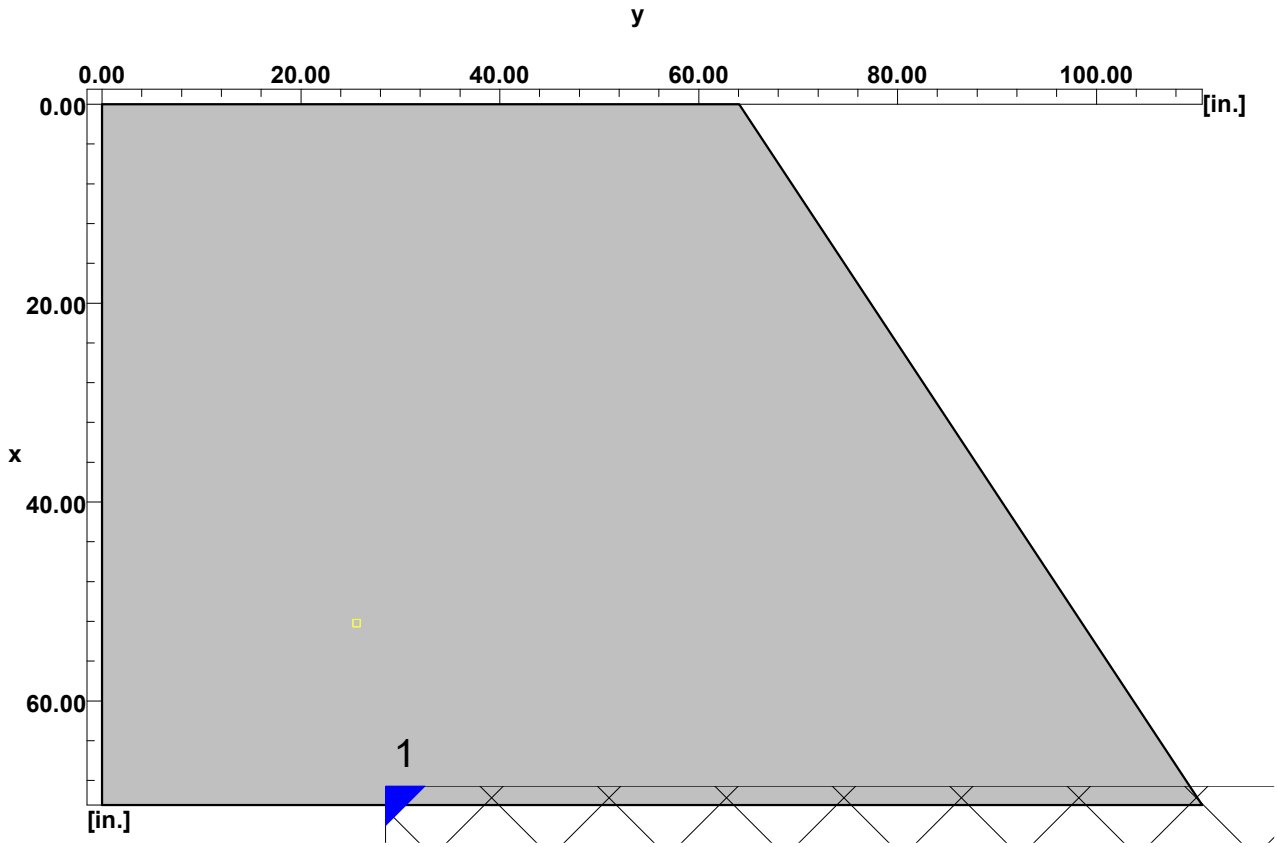

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
4	24	-1.93	-1.97	-1.93 (2.00)	118.15 (2.00)	75 (2.00)	121 (2.00)

Classification

Feature

0	20 %
0	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 23 (2 of 2)

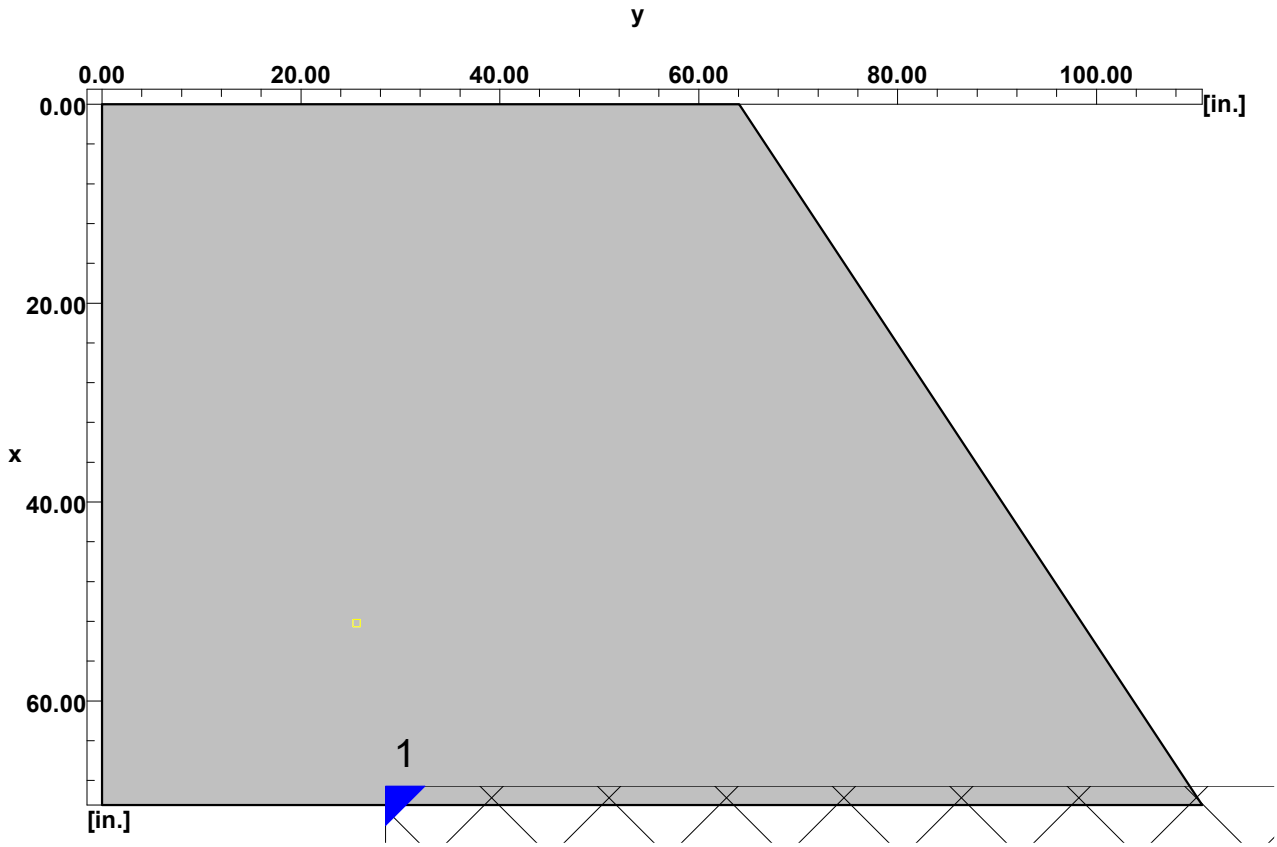

Replacement Plate/Patch List

No.	Angle to Y [°]
4	0

Classification

Feature

0	20 %
0	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 24 (1 of 2)

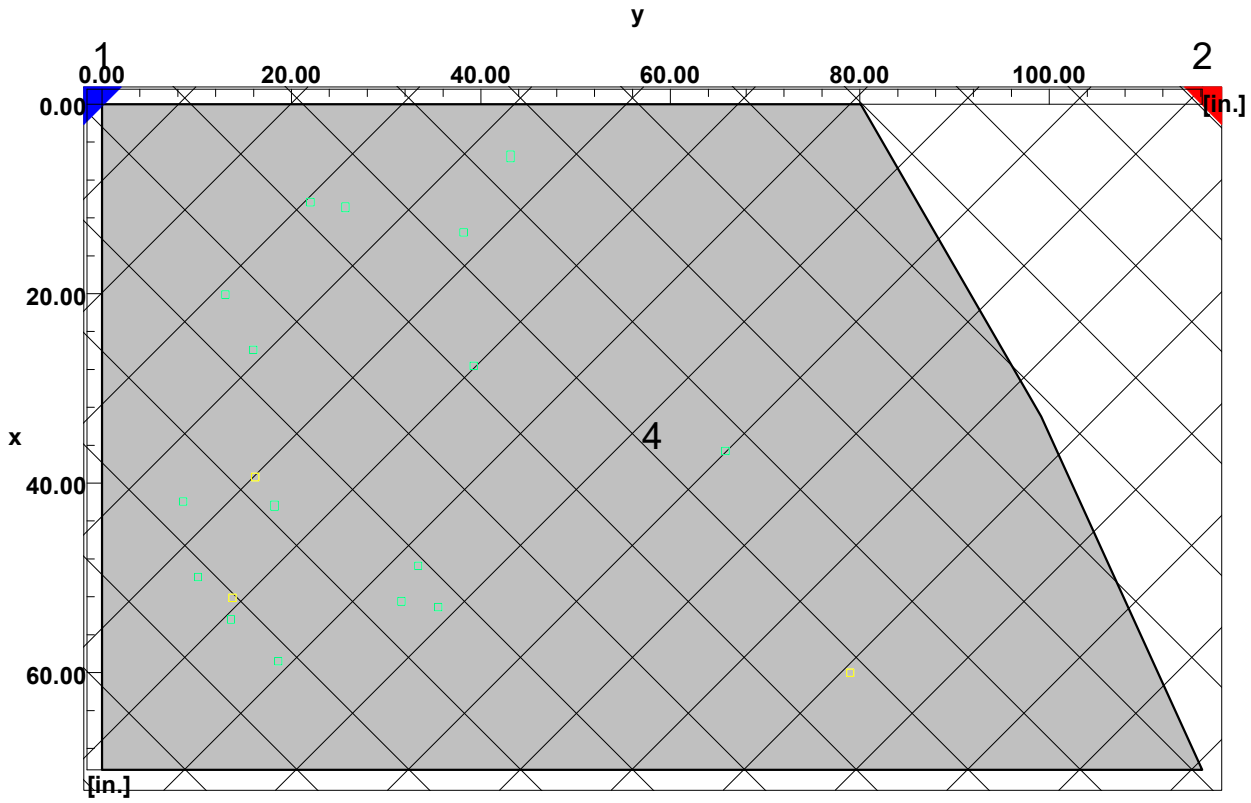

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
4	24	-1.93	-1.97	-1.93 (2.00)	118.15 (2.00)	75 (2.00)	121 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 121.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 24 (2 of 2)

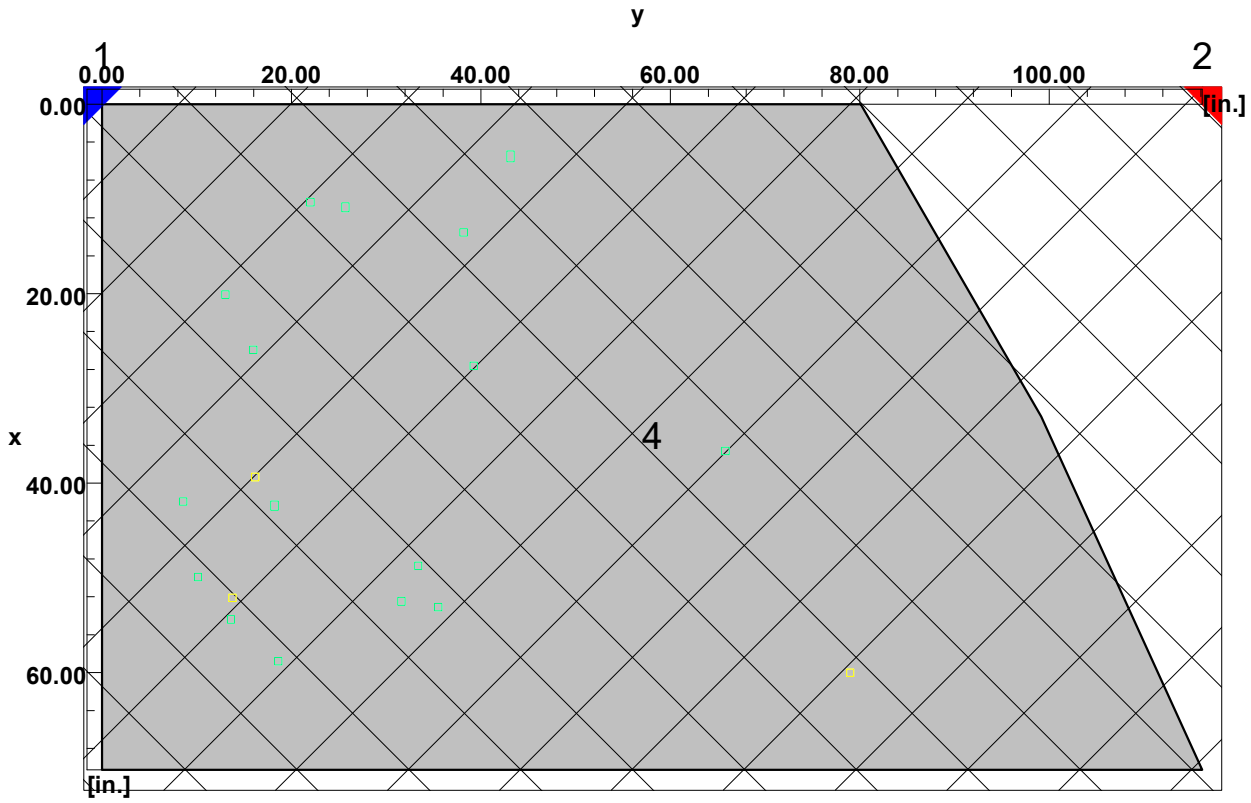

Replacement Plate/Patch List

No.	Angle to Y [°]
4	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 121.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 25 (1 of 2)

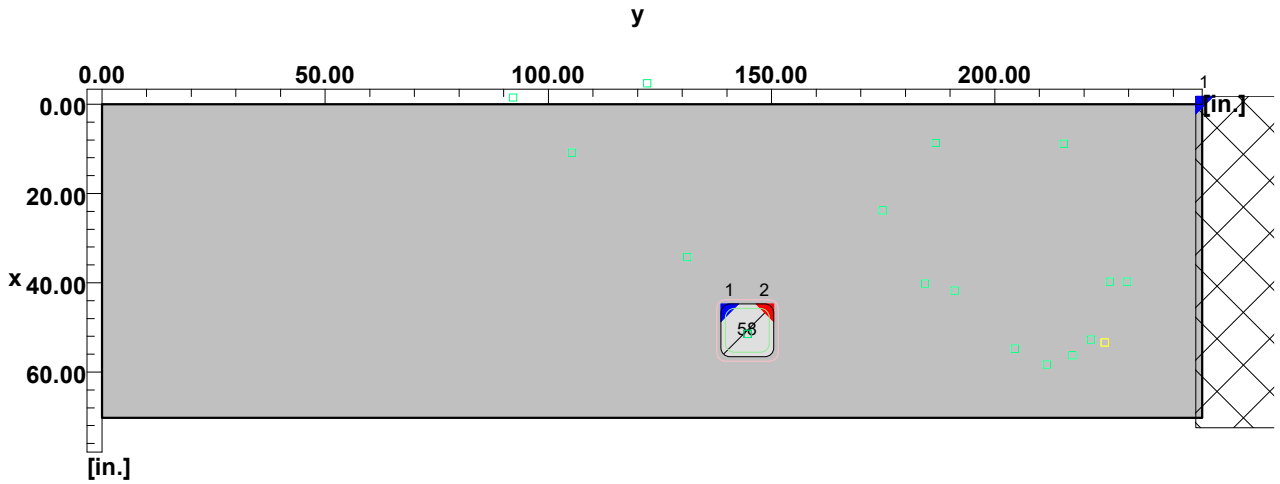

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
4	24	-1.93	-1.97	-1.93 (2.00)	118.15 (2.00)	75 (2.00)	121 (2.00)
58	25	44.69	138.62	44.69	150.43	12	12

Classification

Feature

0	20 %
15	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 25 (2 of 2)

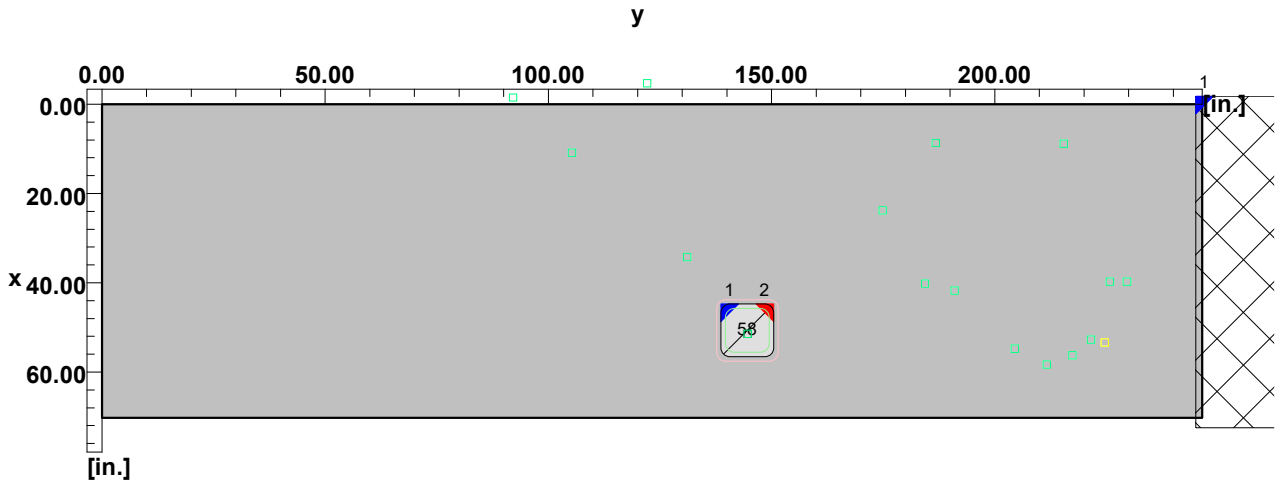

Replacement Plate/Patch List

No.	Angle to Y [°]
4	0
58	0

Classification

Feature

0	20 %
15	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 26

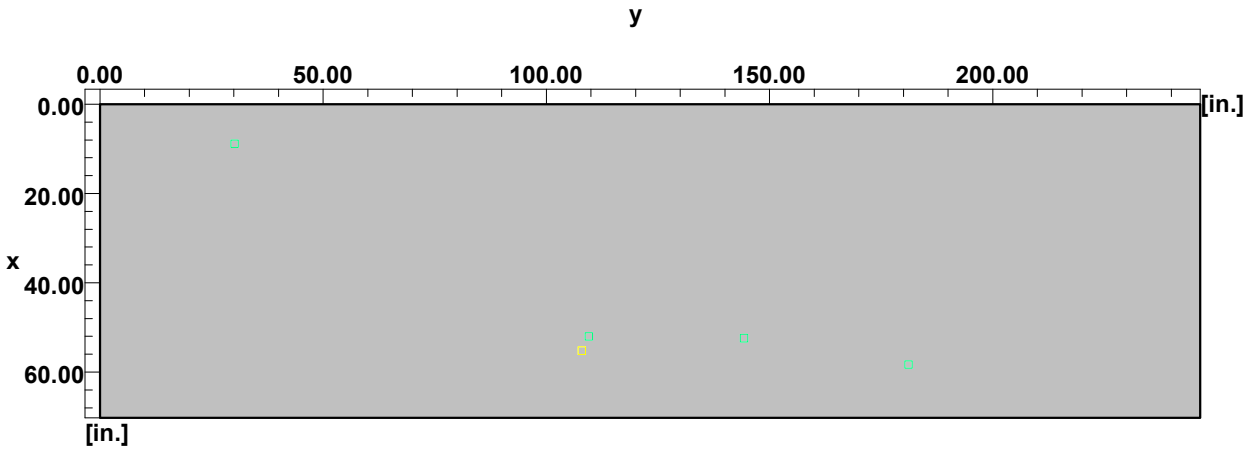

Classification

Feature

0	20 %
4	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 28

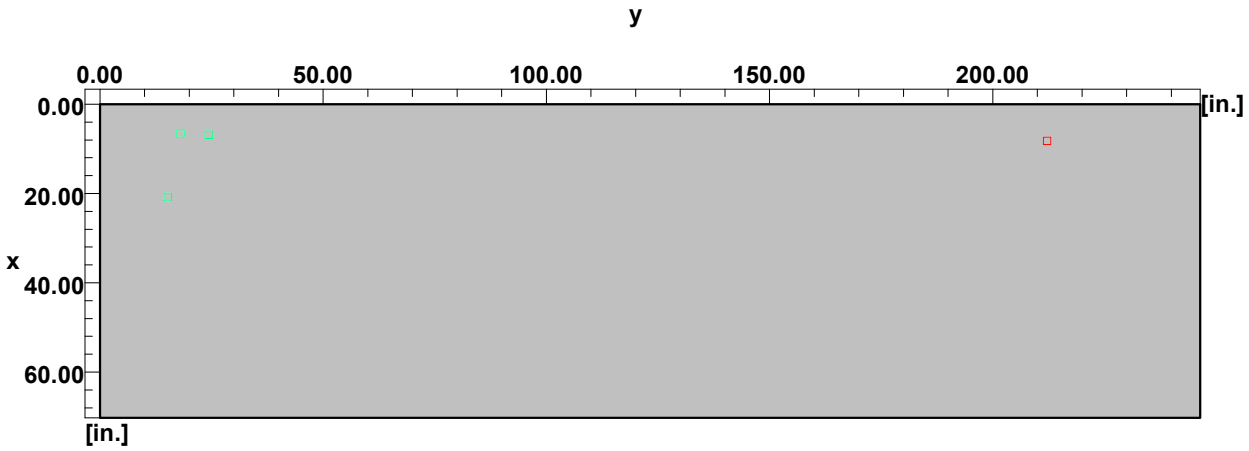

Classification

Feature

0	20 %
3	40 %
0	60 %
1	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 29

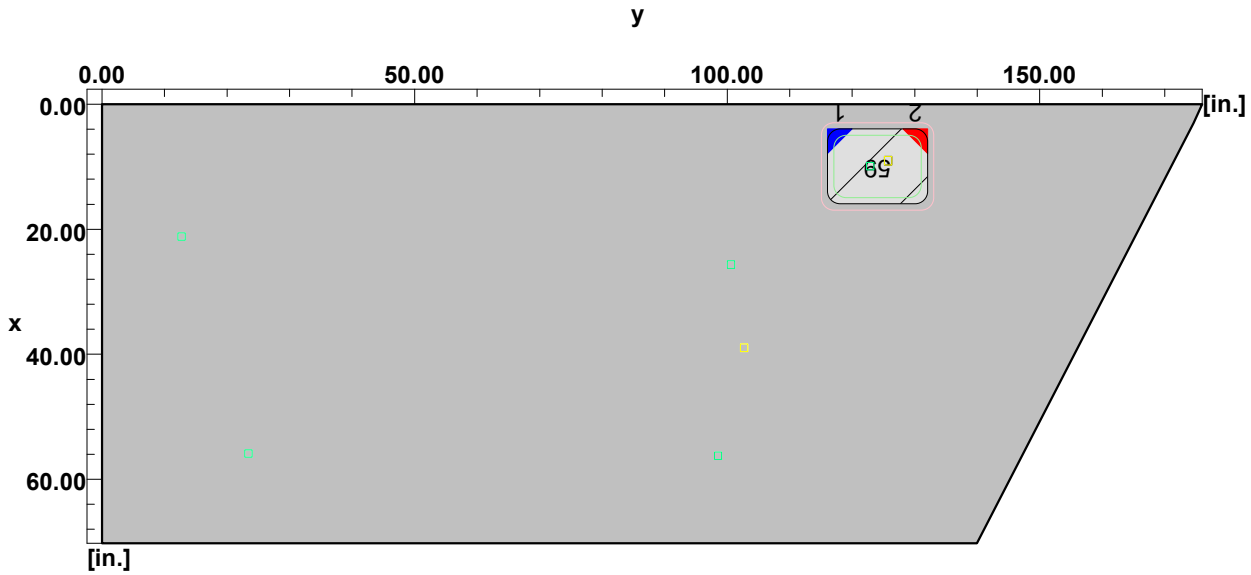

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]	Angle to Y [°]
59	29	4.02	116.02	4.02	132.01	12	16	0

Classification

Feature

0	20 %
4	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 16 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 31

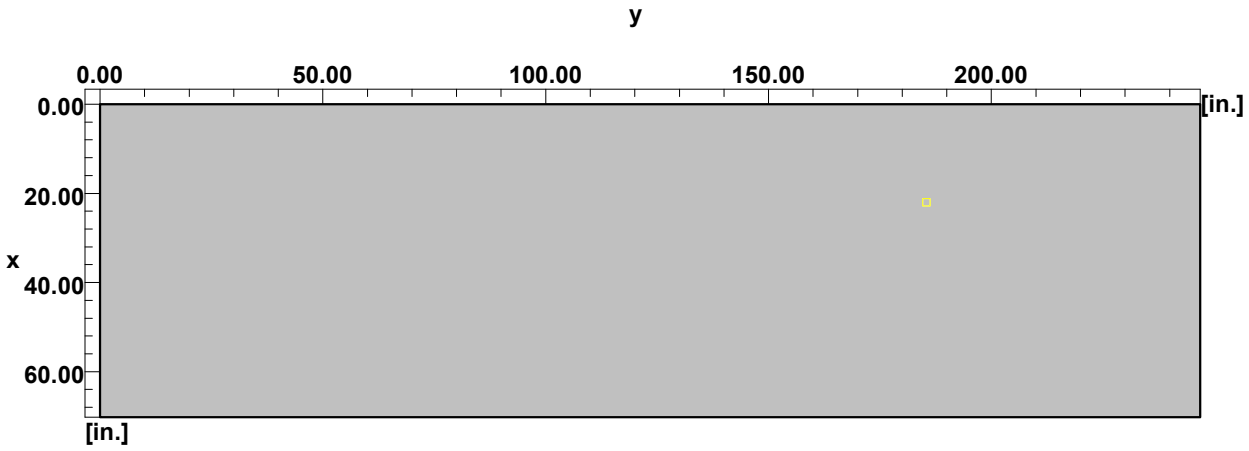

Classification

Feature

0	20 %
0	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 32

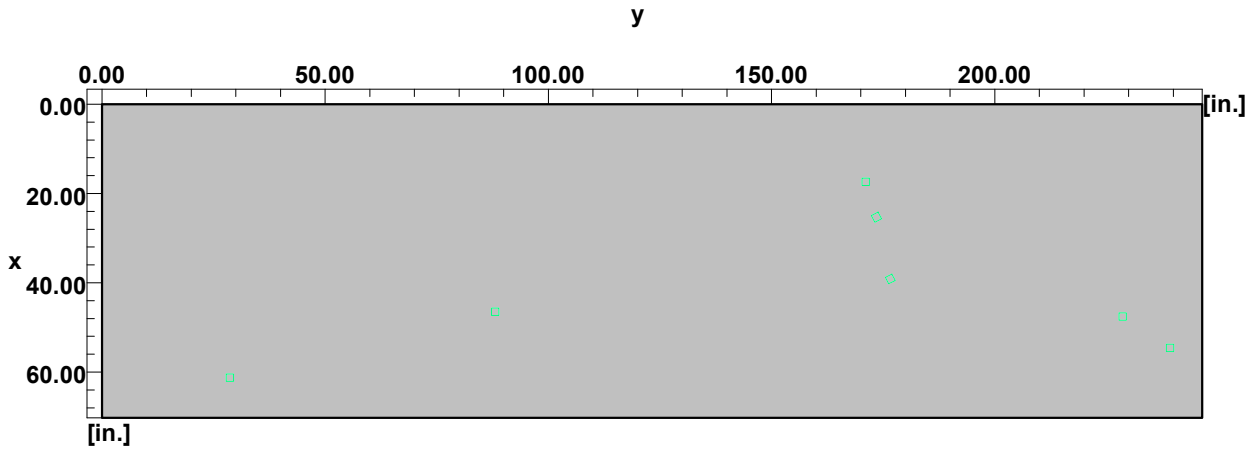

Classification

Feature

0	20 %
7	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 33

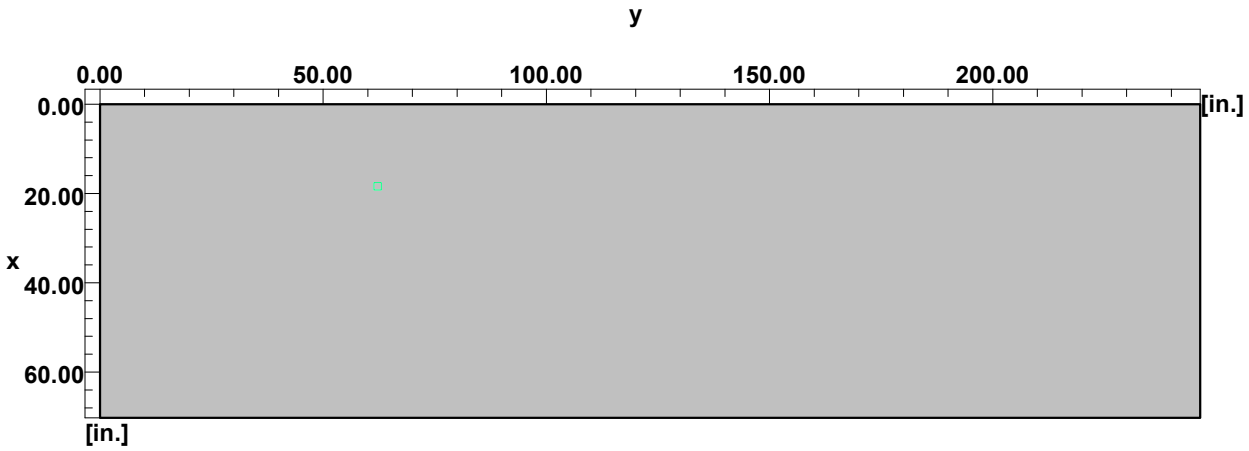

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 34 (1 of 2)

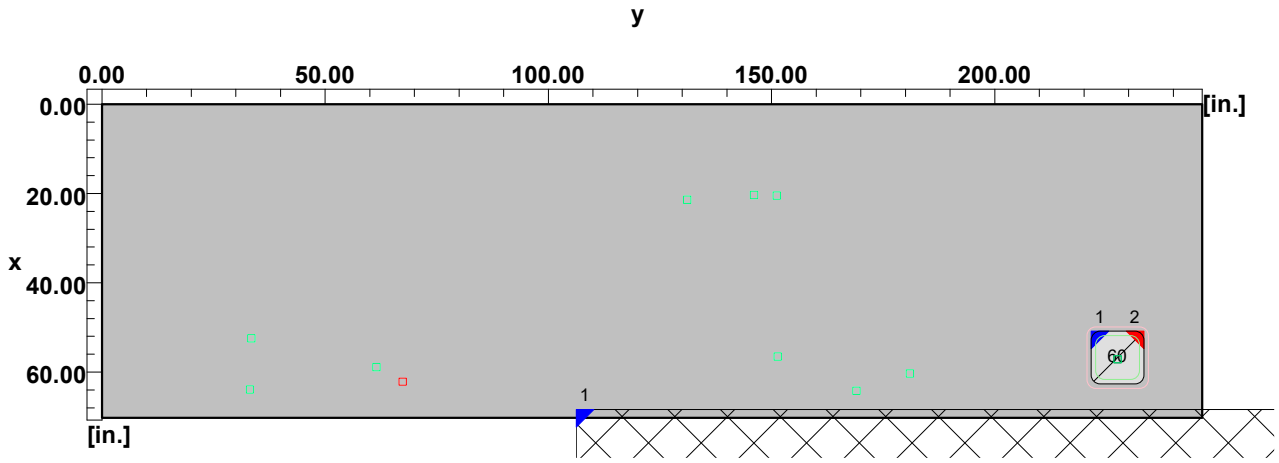

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
5	37	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
60	34	50.79	221.57	50.79	233.39	12	12

Classification

Feature

0	20 %
9	40 %
0	60 %
1	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 34 (2 of 2)

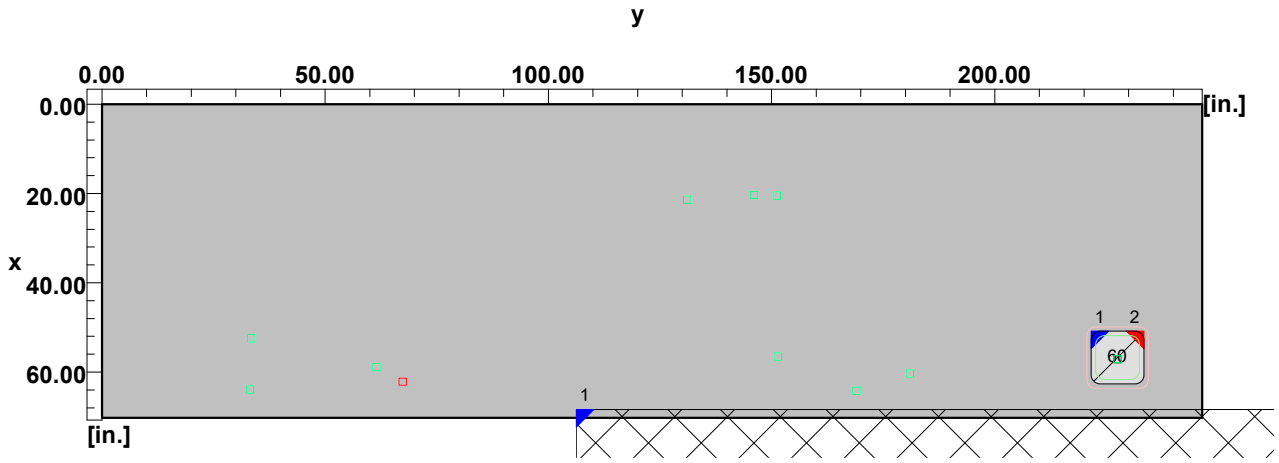

Replacement Plate/Patch List

No.	Angle to Y [°]
5	0
60	0

Classification

Feature

0	20 %
9	40 %
0	60 %
1	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 35 (1 of 2)

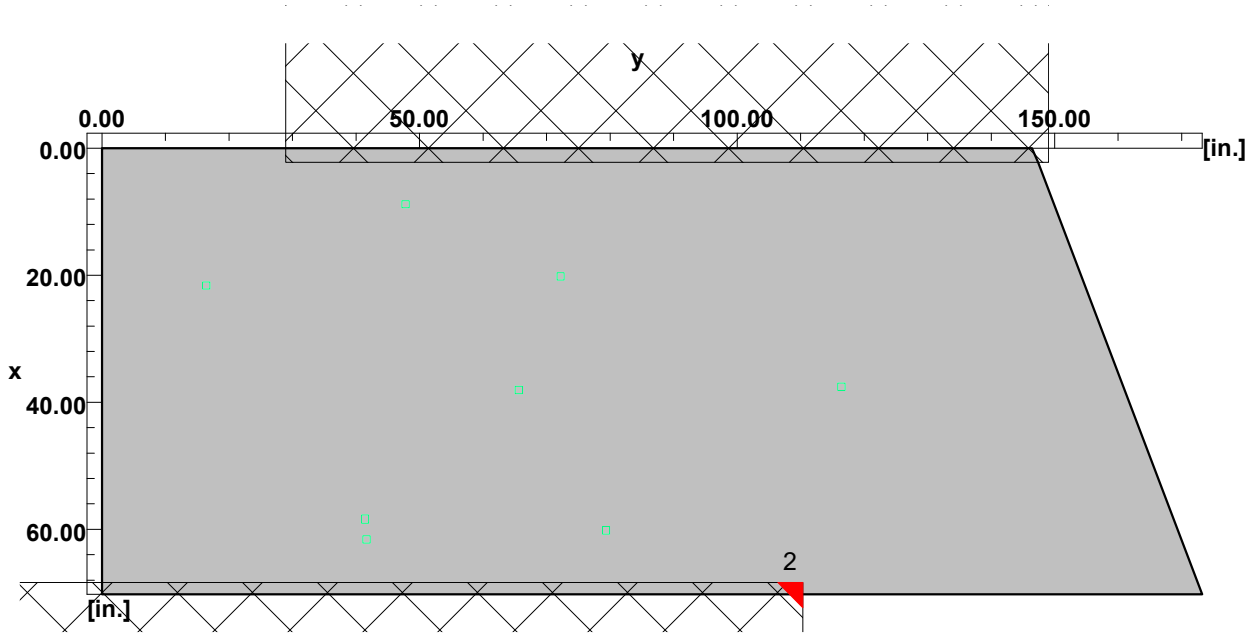

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
4	24	-1.93	-1.97	-1.93 (2.00)	118.15 (2.00)	75 (2.00)	121 (2.00)
5	37	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
8	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 35 (2 of 2)

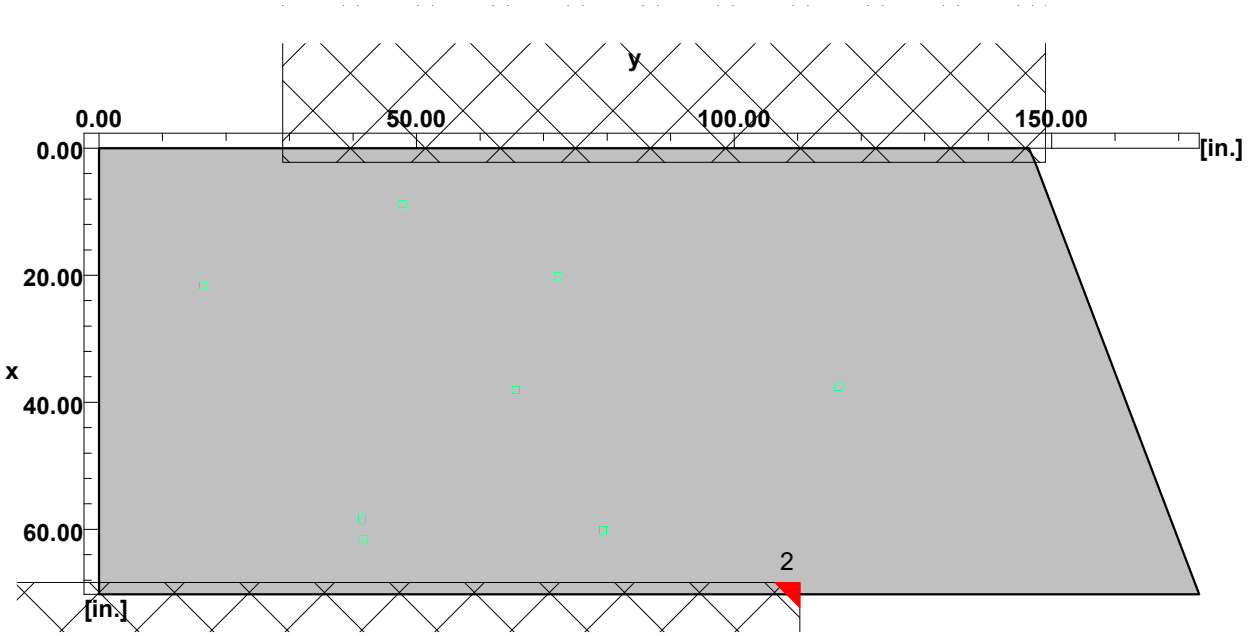

Replacement Plate/Patch List

No.	Angle to Y [°]
4	0
5	0

Classification

Feature

0	20 %
8	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 36 (1 of 2)

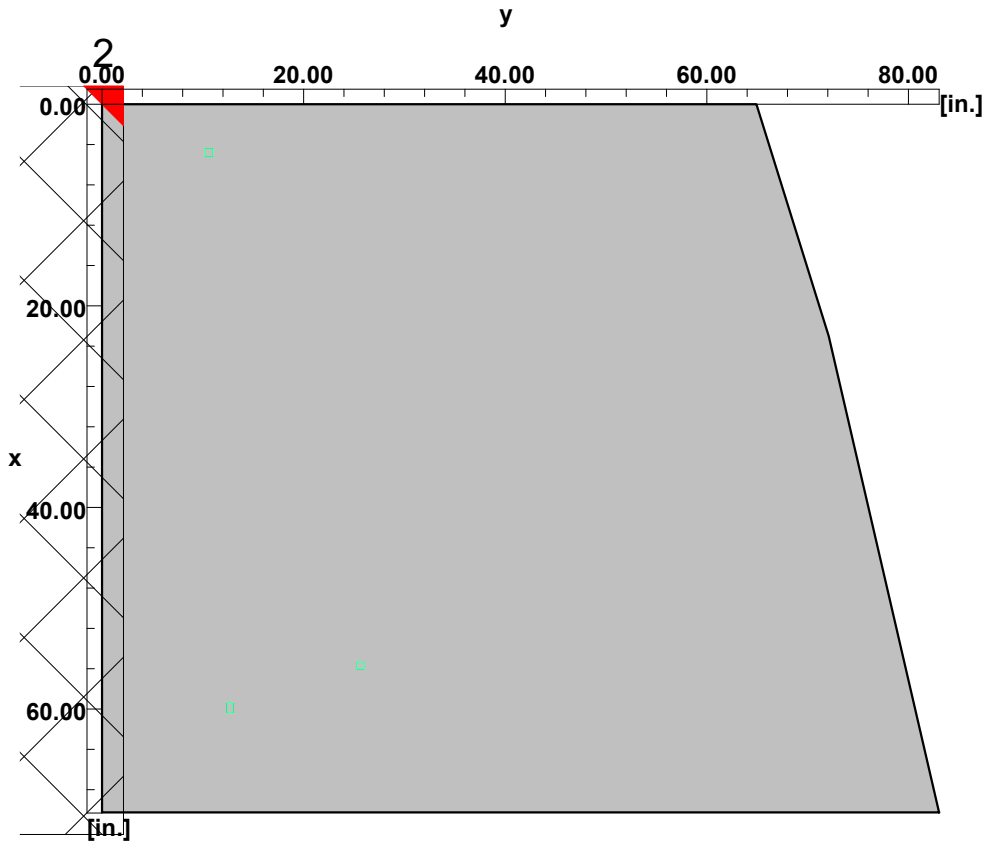

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
5	37	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 36 (2 of 2)

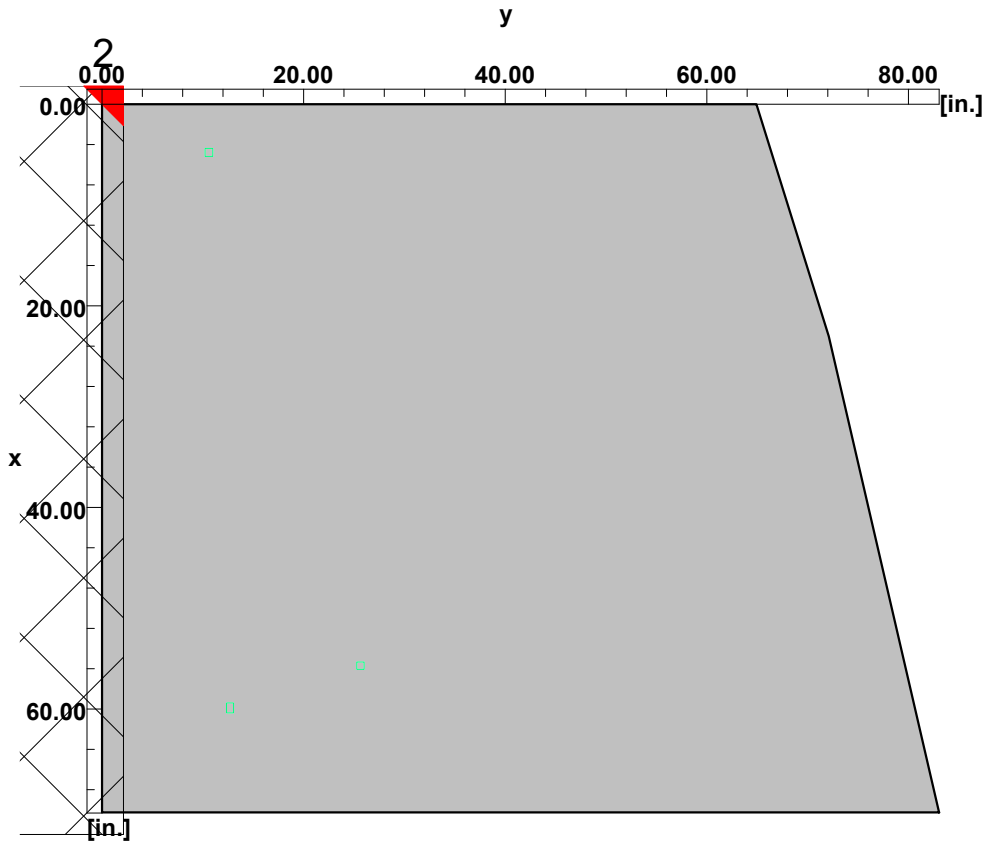

Replacement Plate/Patch List

No.	Angle to Y [°]
5	0

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 37 (1 of 2)

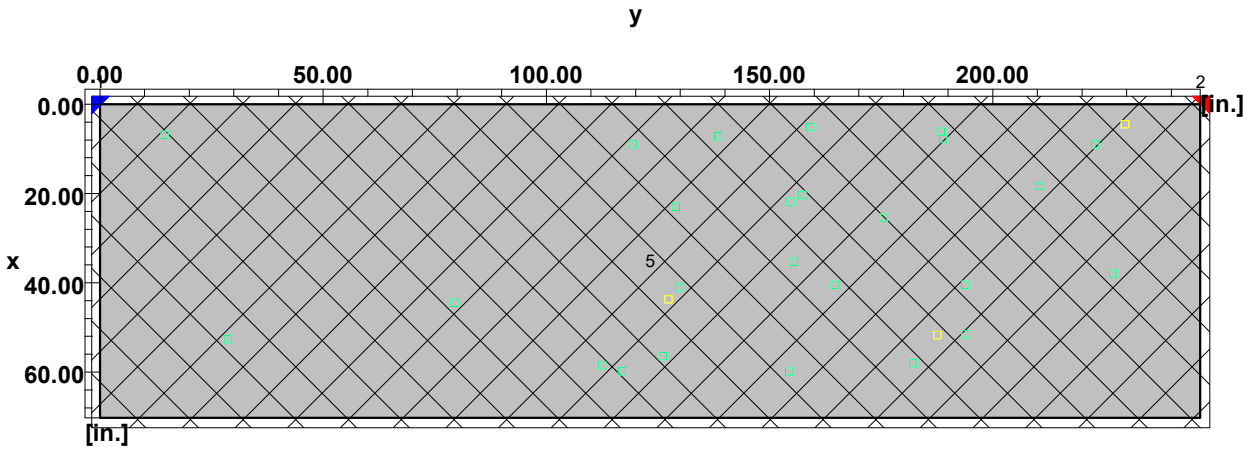

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
5	37	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 37 (2 of 2)

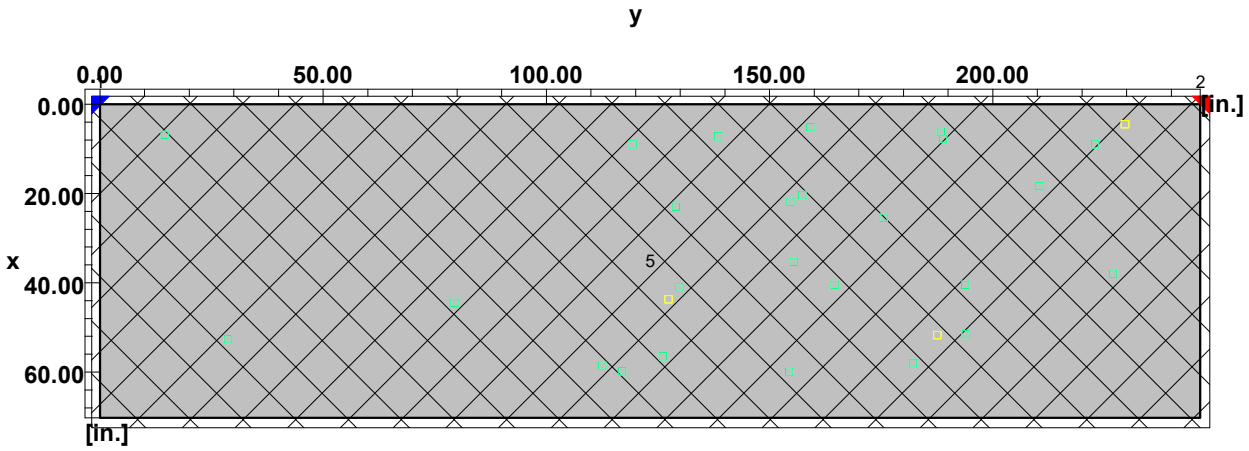

Replacement Plate/Patch List

No.	Angle to Y [°]
5	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 38 (1 of 2)

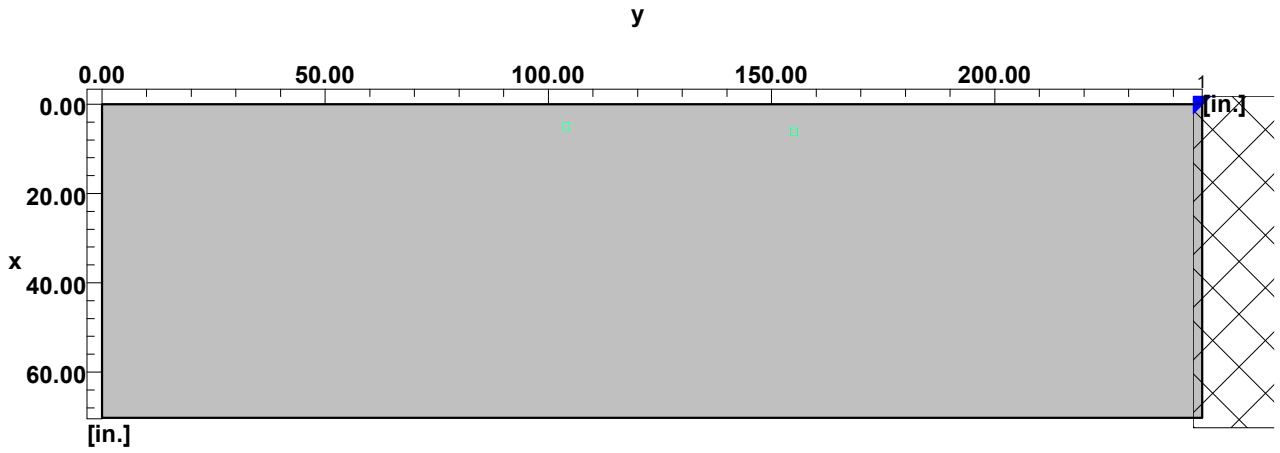

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
5	37	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
2	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 38 (2 of 2)

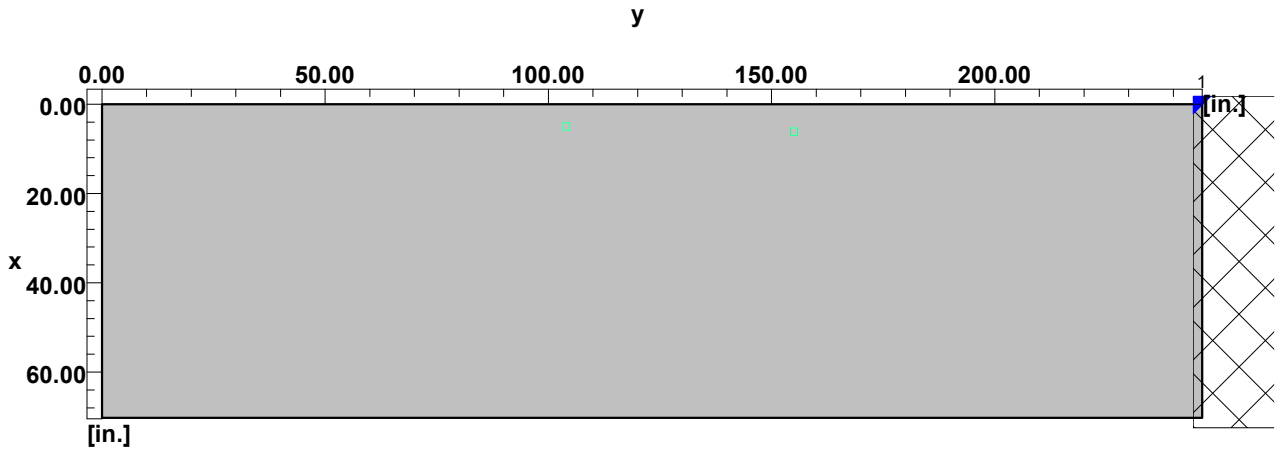

Replacement Plate/Patch List

No.	Angle to Y [°]
5	0

Classification

Feature

0	20 %
2	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 39 (1 of 2)

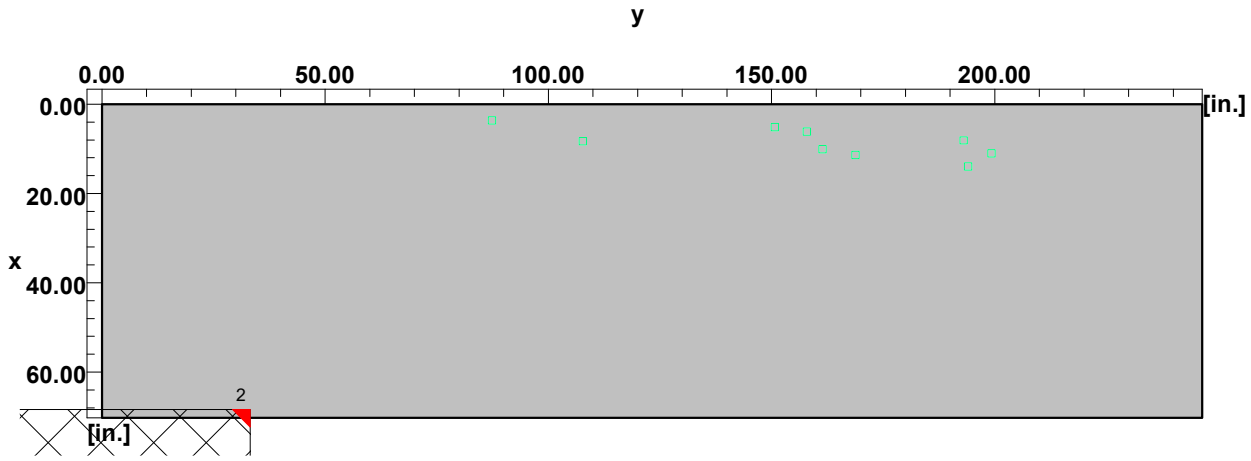

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
6	45	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
9	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 39 (2 of 2)

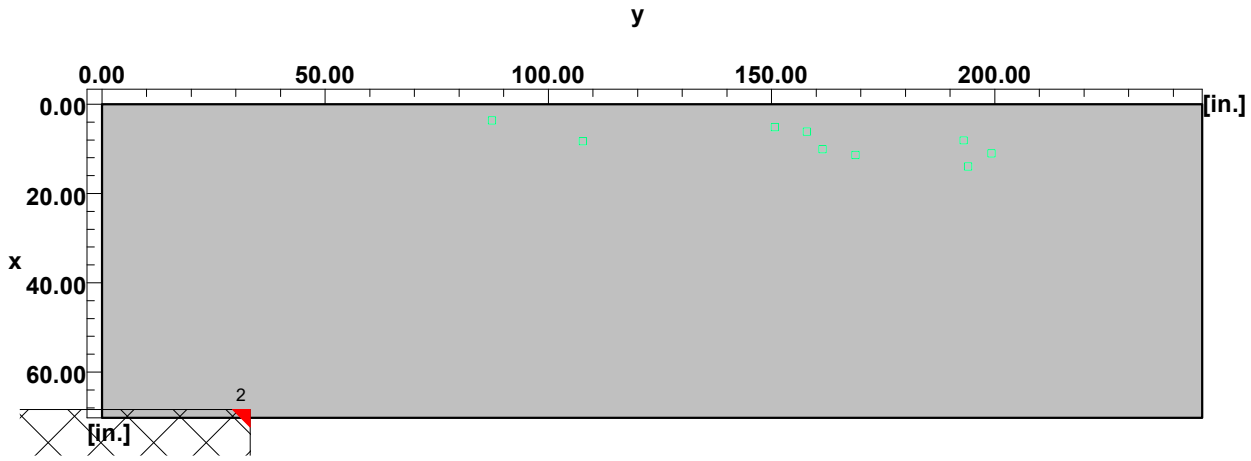

Replacement Plate/Patch List

No.	Angle to Y [°]
6	0

Classification

Feature

0	20 %
9	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 40 (1 of 2)

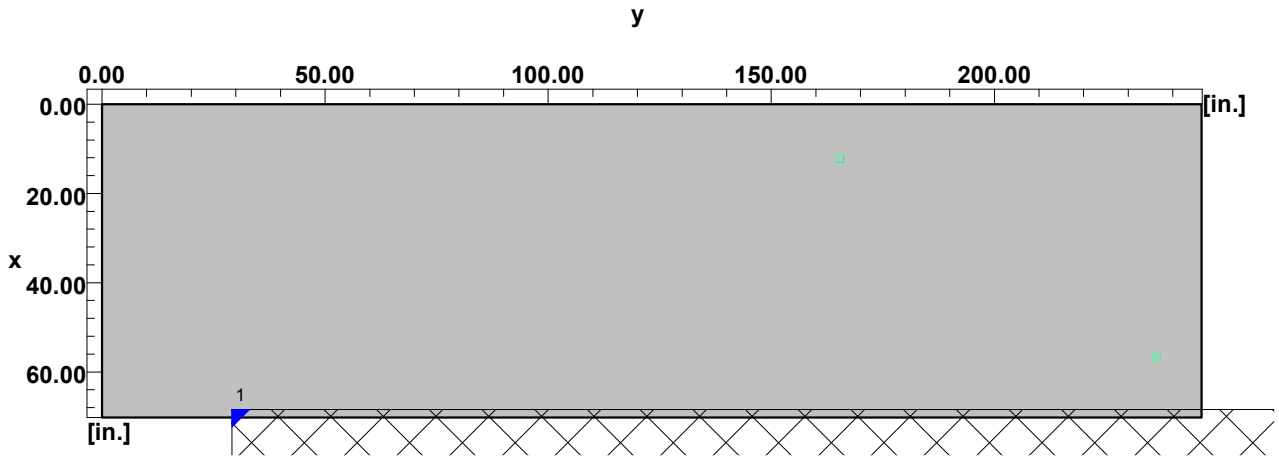

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
6	45	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
2	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 40 (2 of 2)

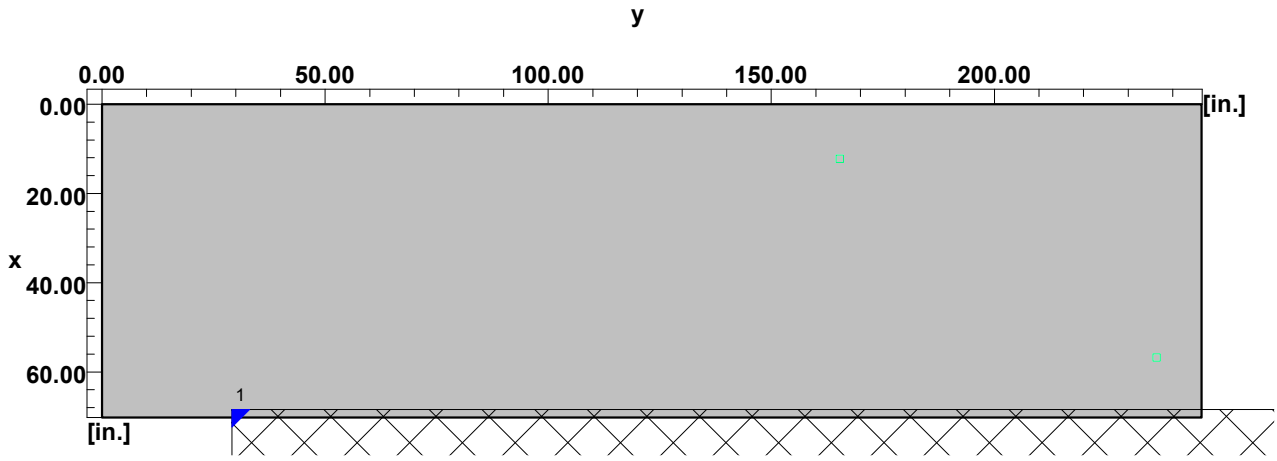

Replacement Plate/Patch List

No.	Angle to Y [°]
6	0

Classification

Feature

0	20 %
2	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 44 (1 of 2)

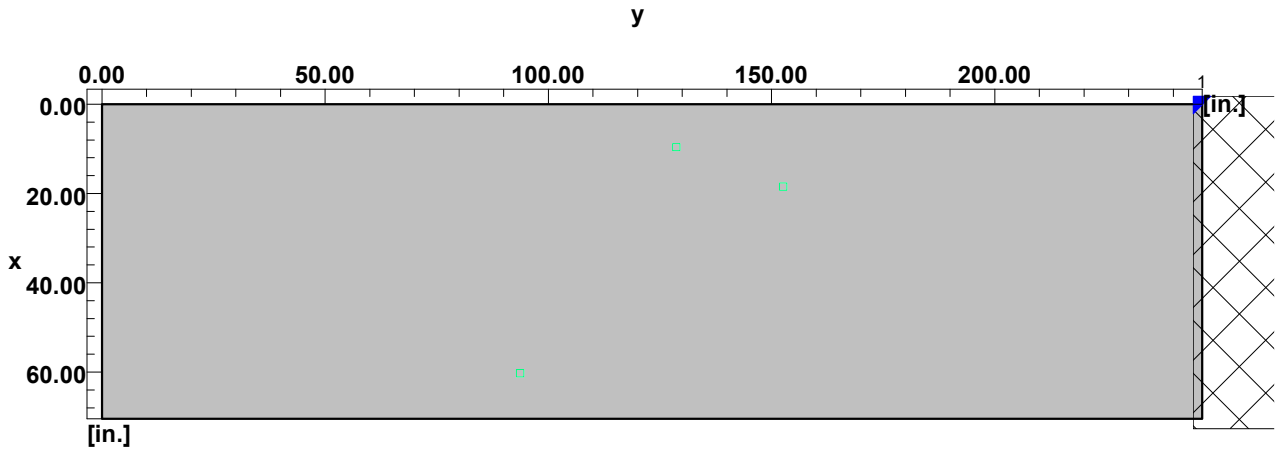

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
6	45	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 44 (2 of 2)

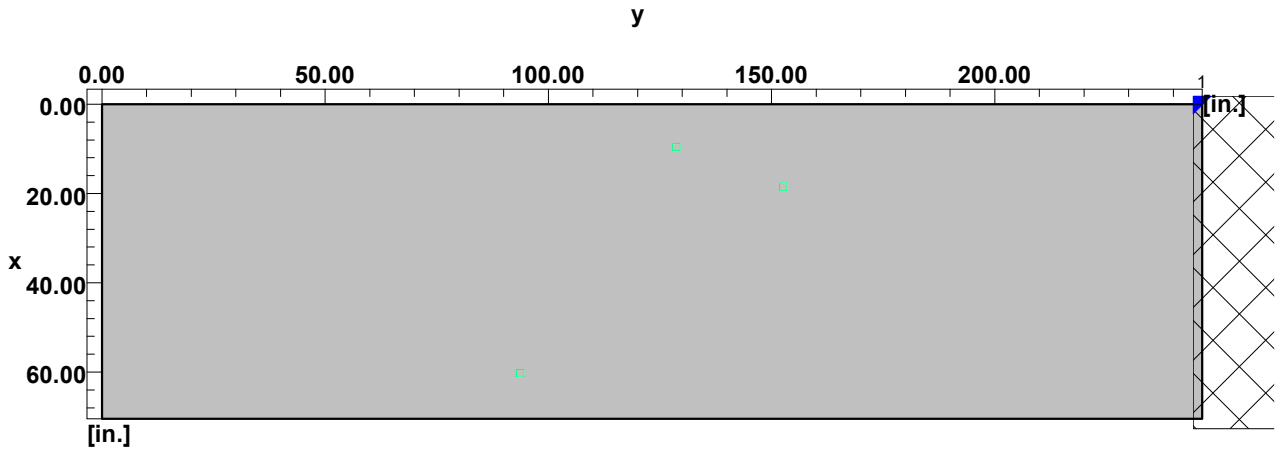

Replacement Plate/Patch List

No.	Angle to Y [°]
6	0

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 45 (1 of 2)

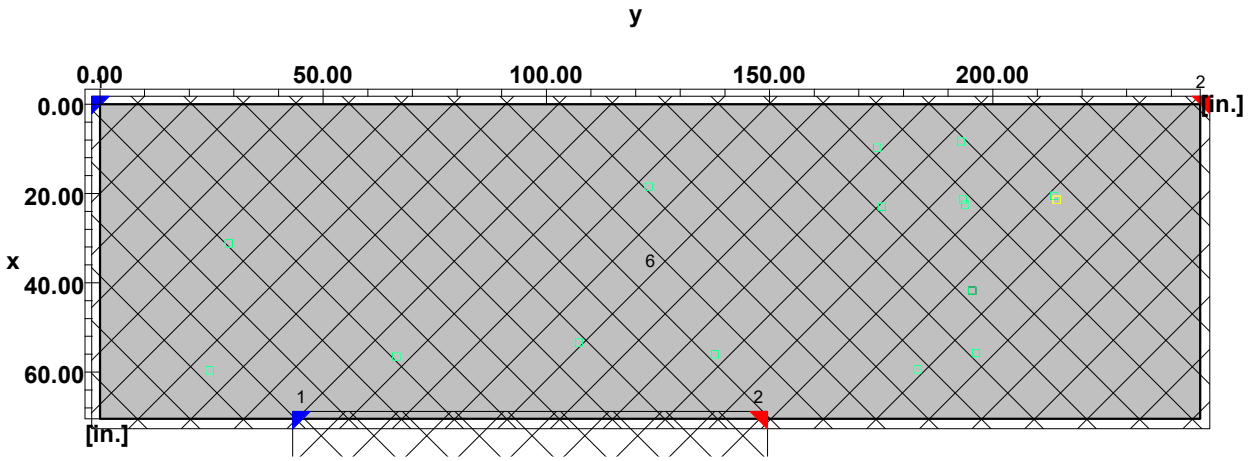

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
6	45	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
65	54	-1.65	142.13	-1.65	248.50	74	107

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 45 (2 of 2)

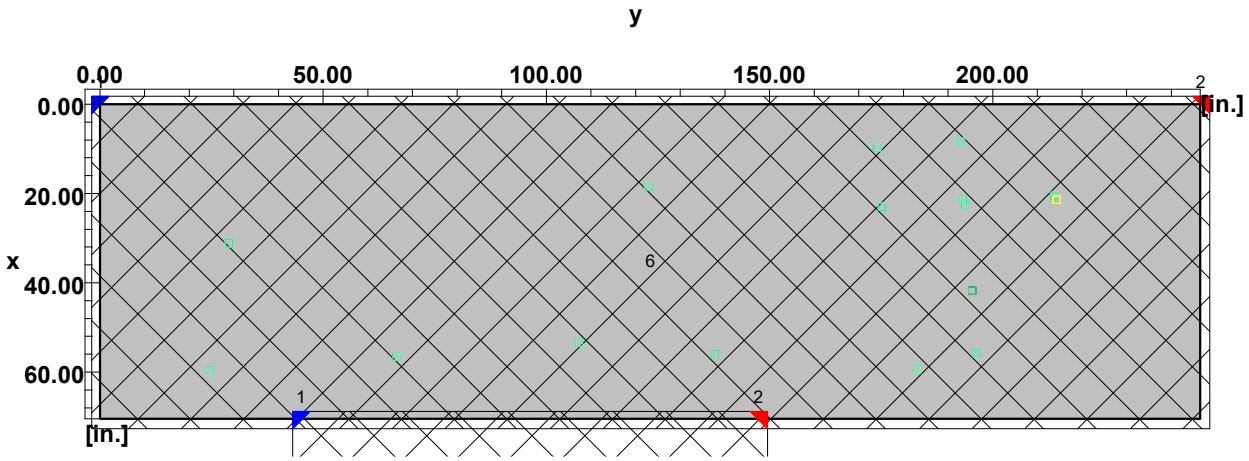

Replacement Plate/Patch List

No.	Angle to Y [°]
6	0
65	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 46 (1 of 2)

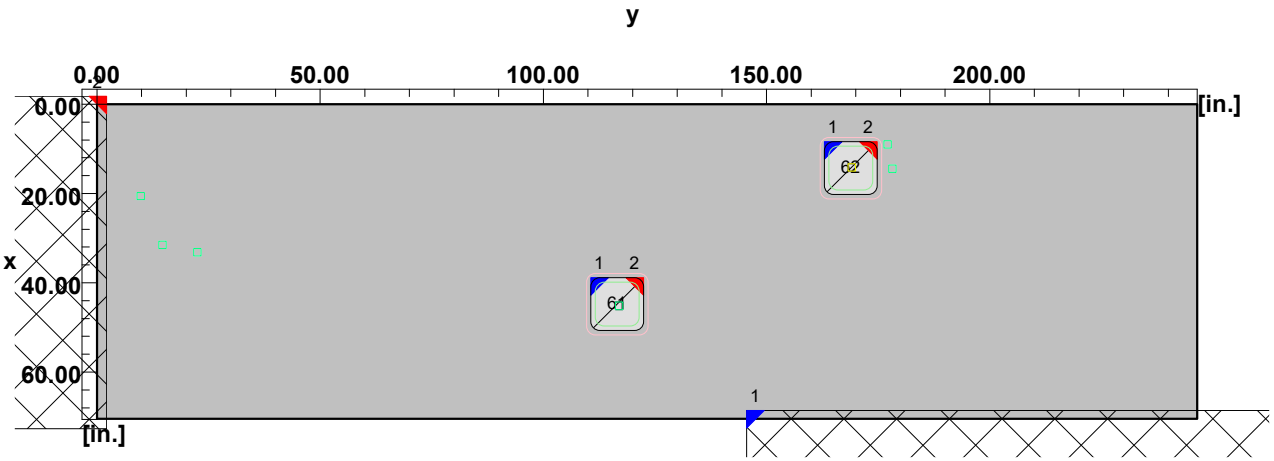

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
6	45	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
8	52	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	74 (2.00)	251 (2.00)
61	46	38.78	110.63	38.78	122.44	12	12
62	46	8.35	162.95	8.35	174.76	12	12

Classification

Feature

0	20 %
5	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

2 patches 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 46 (2 of 2)

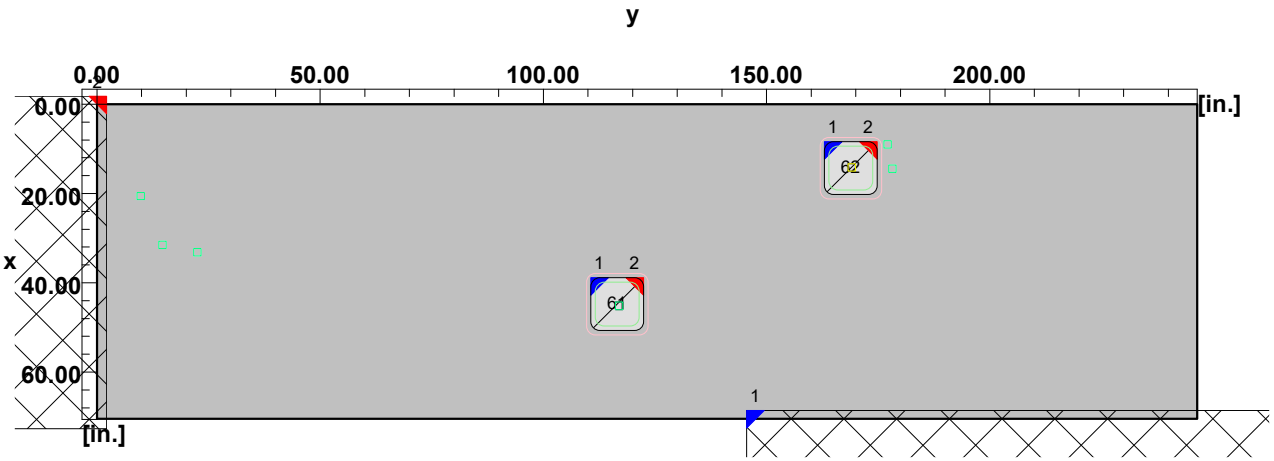

Replacement Plate/Patch List

No.	Angle to Y [°]
6	0
8	0
61	0
62	0

Classification

Feature

0	20 %
5	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

2 patches 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 47 (1 of 2)

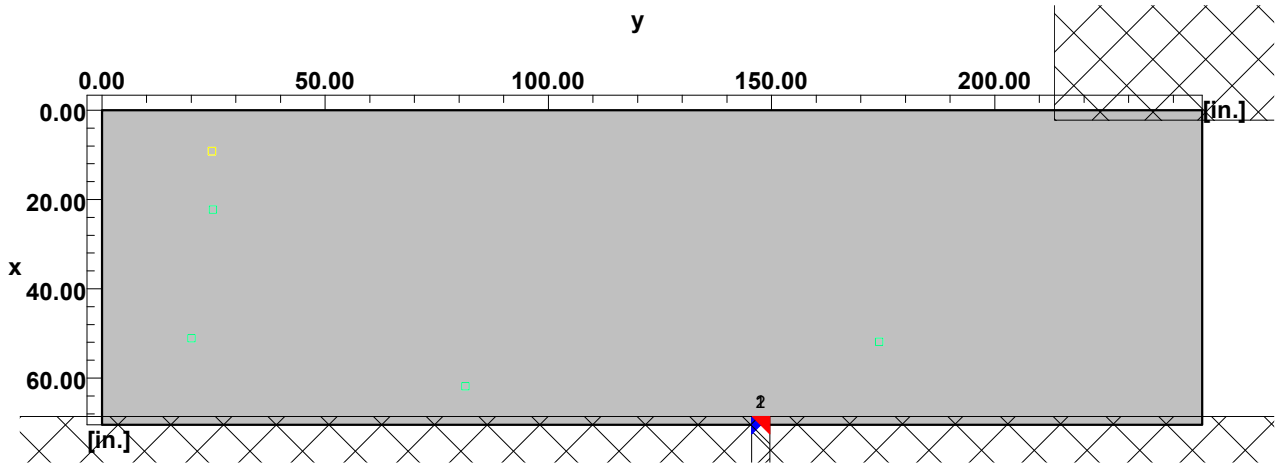

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
5	37	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
7	51	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	74 (2.00)	251 (2.00)
8	52	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	74 (2.00)	251 (2.00)

Classification

Feature

0	20 %
4	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 47 (2 of 2)

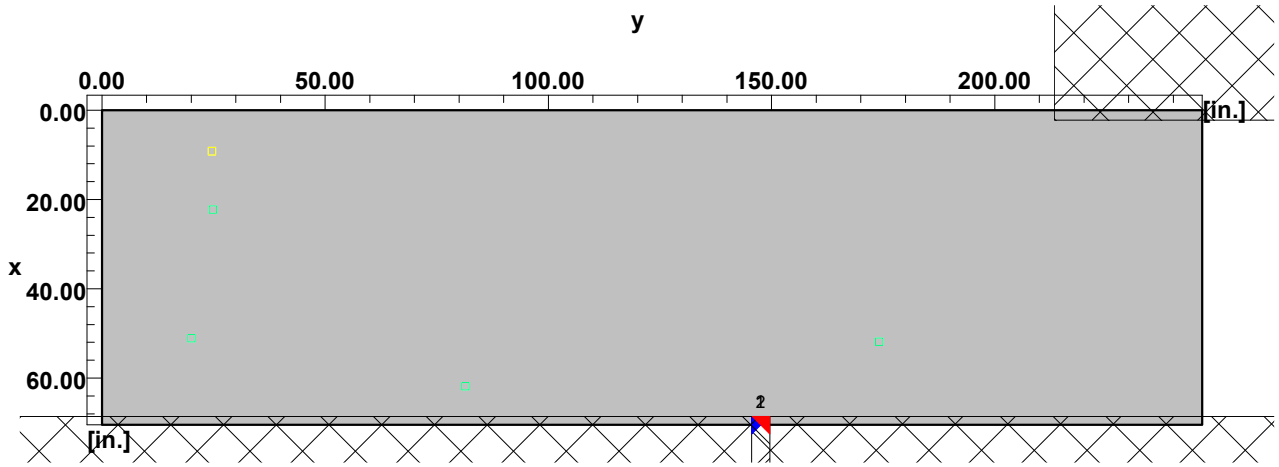

Replacement Plate/Patch List

No.	Angle to Y [°]
5	0
7	0
8	0

Classification

Feature

0	20 %
4	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 48 (1 of 2)

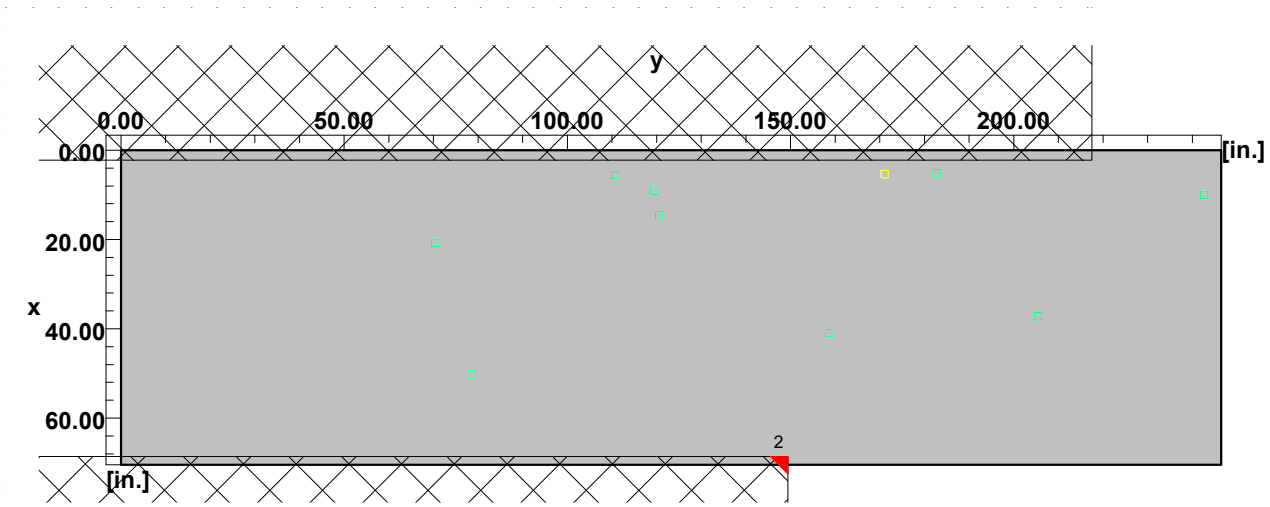

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
5	37	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
7	51	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	74 (2.00)	251 (2.00)

Classification

Feature

0	20 %
9	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 48 (2 of 2)

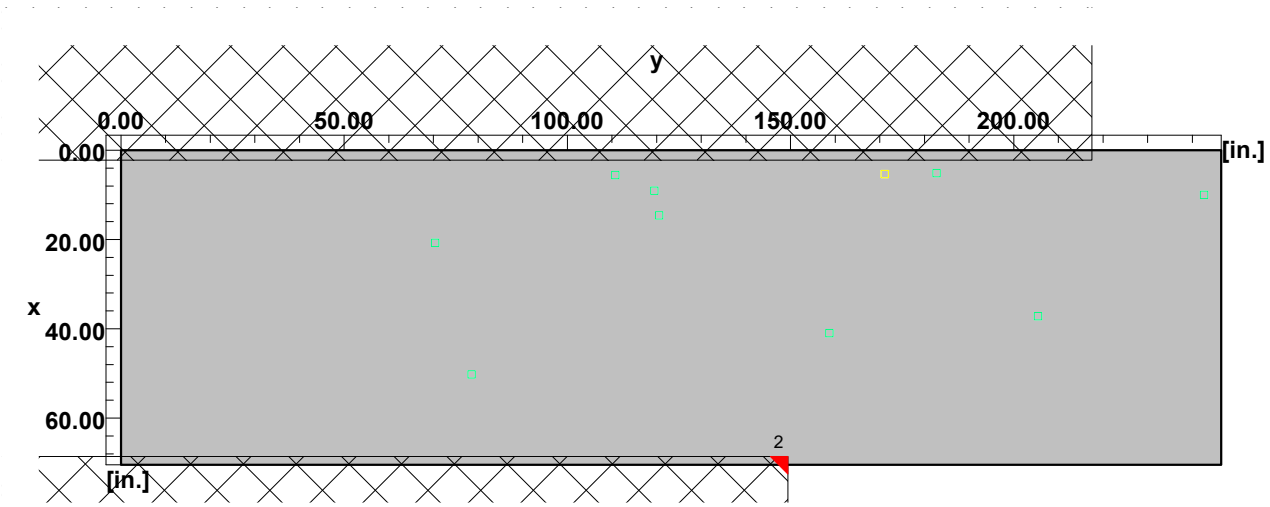

Replacement Plate/Patch List

No.	Angle to Y [°]
5	0
7	0

Classification

Feature

0	20 %
9	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 49

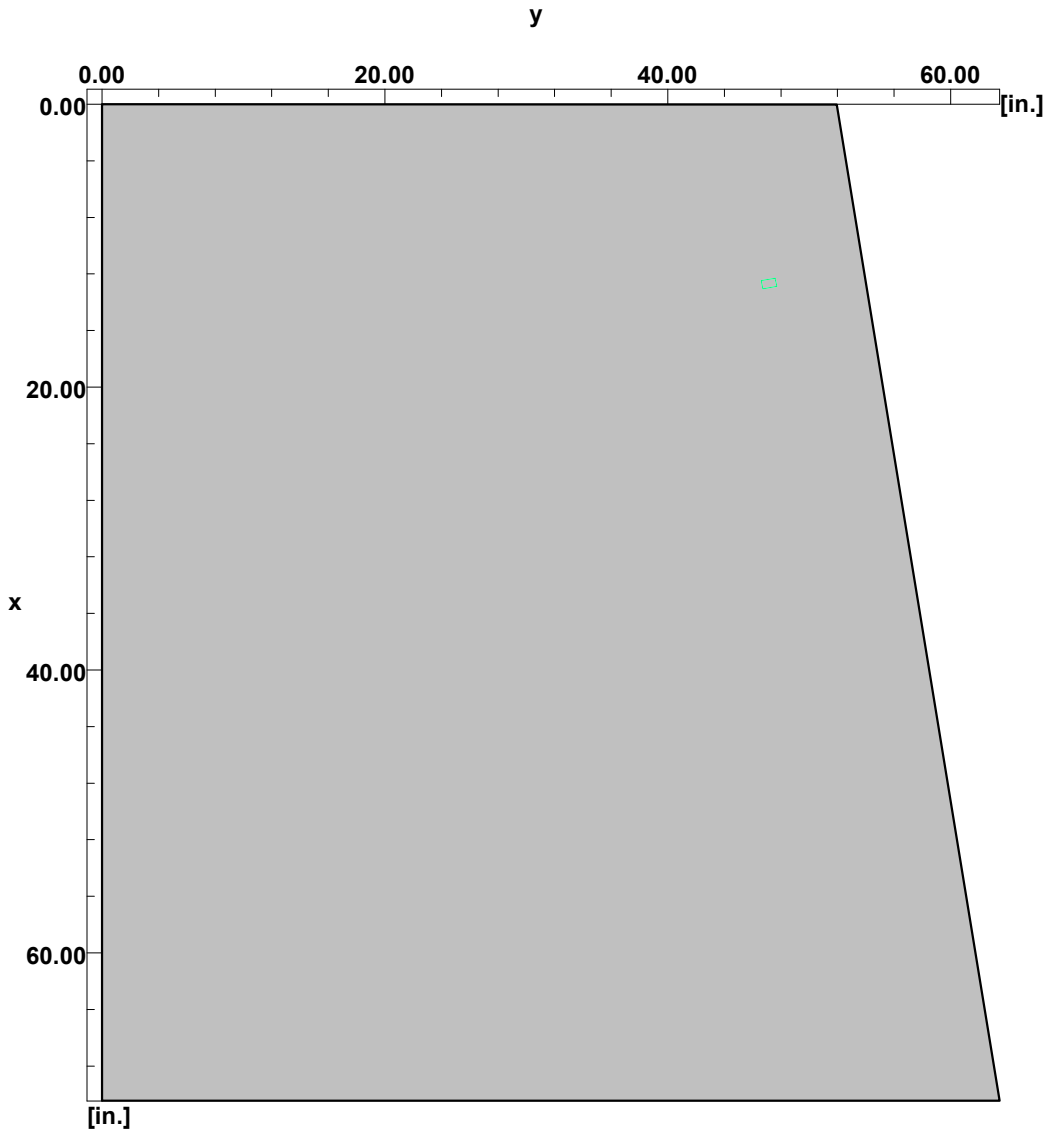

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 50 (1 of 2)

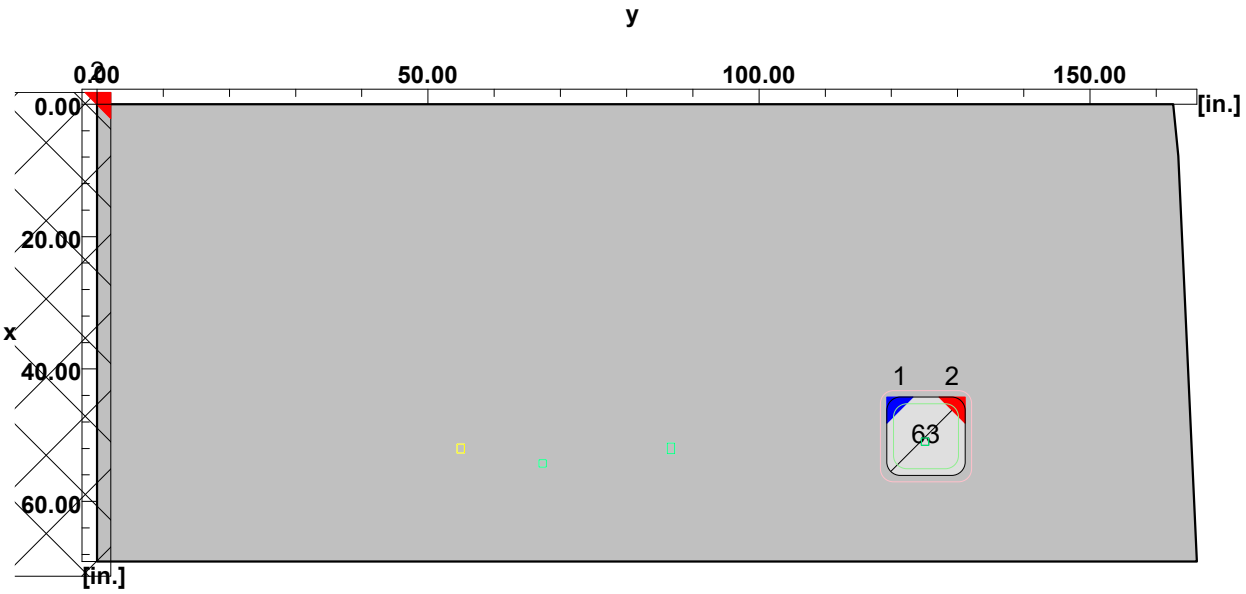

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
7	51	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	74 (2.00)	251 (2.00)
63	50	44.21	119.29	44.21	131.10	12	12

Classification

Feature

0	20 %
2	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 50 (2 of 2)

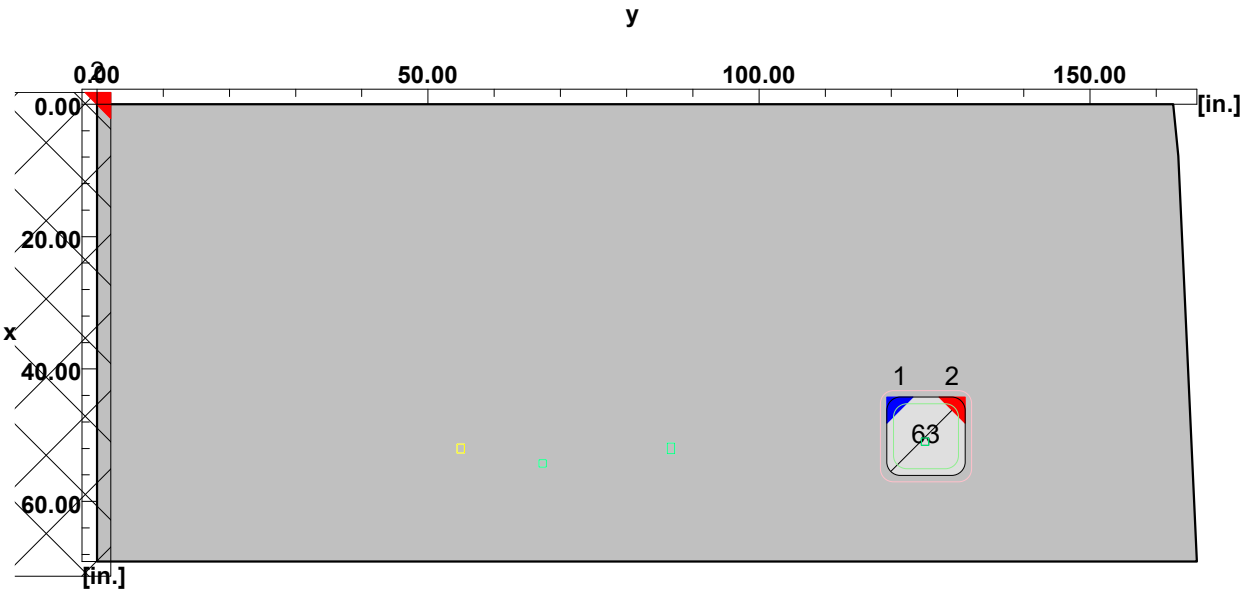

Replacement Plate/Patch List

No.	Angle to Y [°]
7	0
63	0

Classification

Feature

0	20 %
2	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 51 (1 of 2)

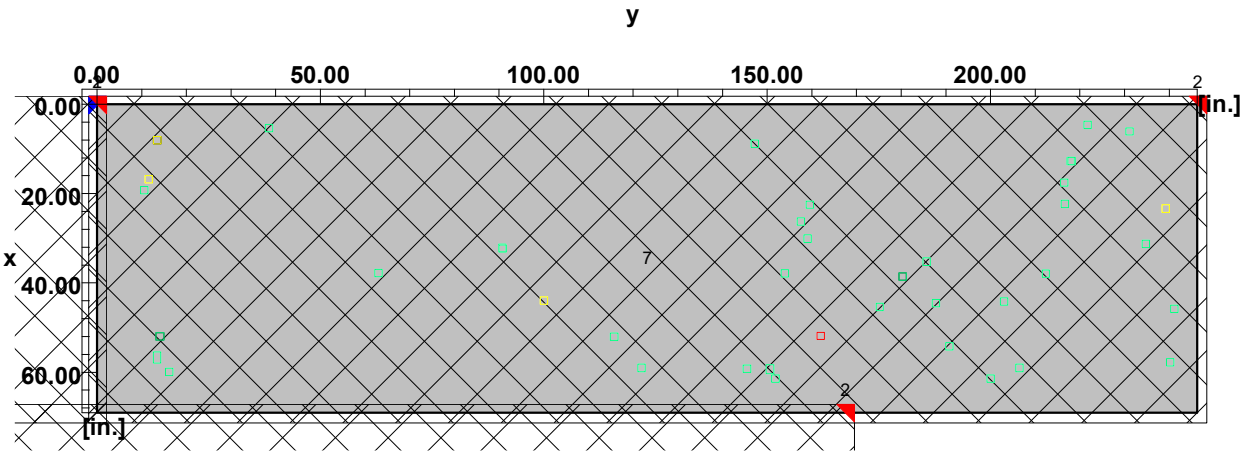

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
7	51	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	74 (2.00)	251 (2.00)
8	52	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	74 (2.00)	251 (2.00)
11	60	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 74.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 51 (2 of 2)

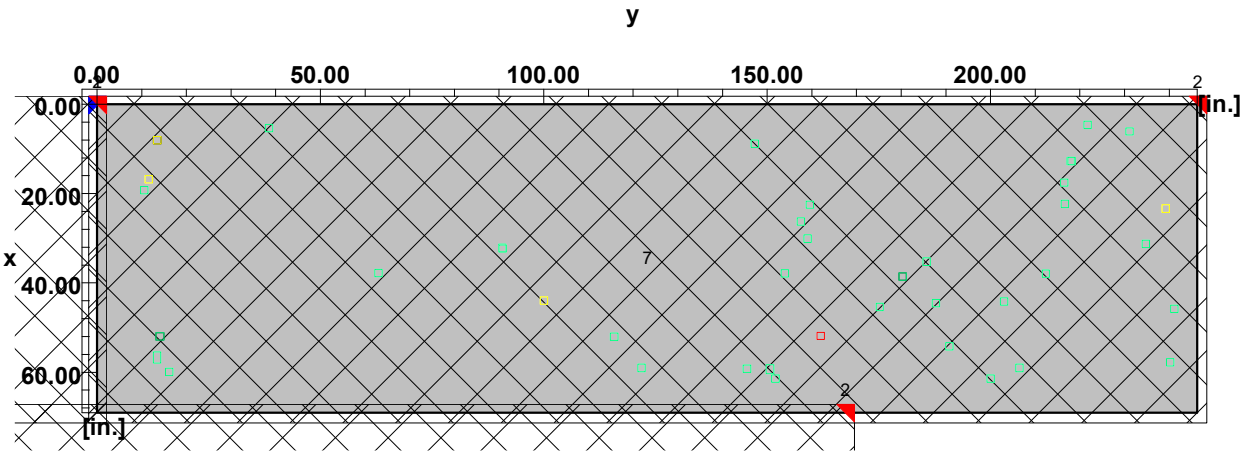

Replacement Plate/Patch List

No.	Angle to Y [°]
7	0
8	0
11	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 74.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 52 (1 of 2)

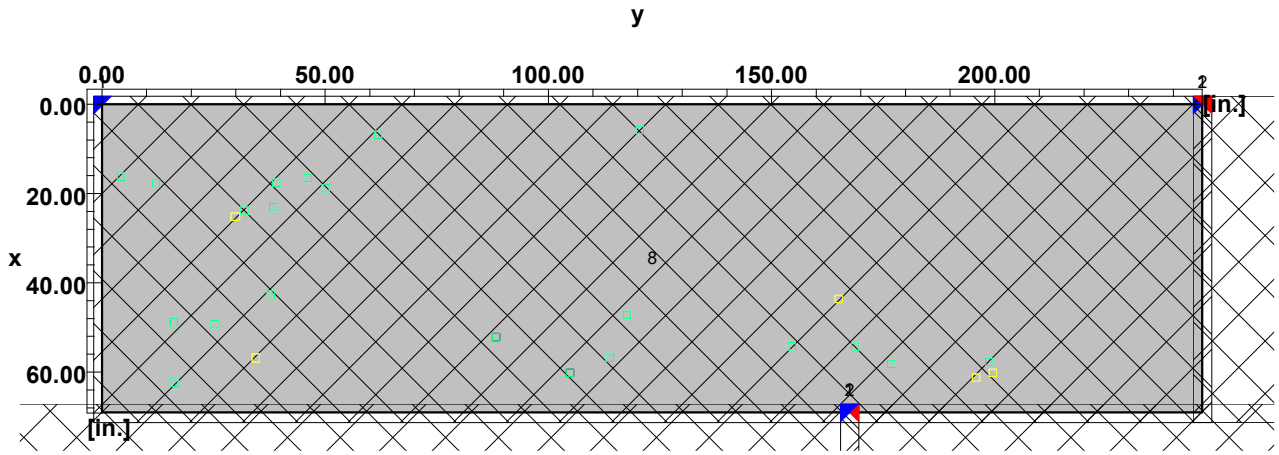

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
7	51	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	74 (2.00)	251 (2.00)
8	52	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	74 (2.00)	251 (2.00)
10	59	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
11	60	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 74.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 52 (2 of 2)

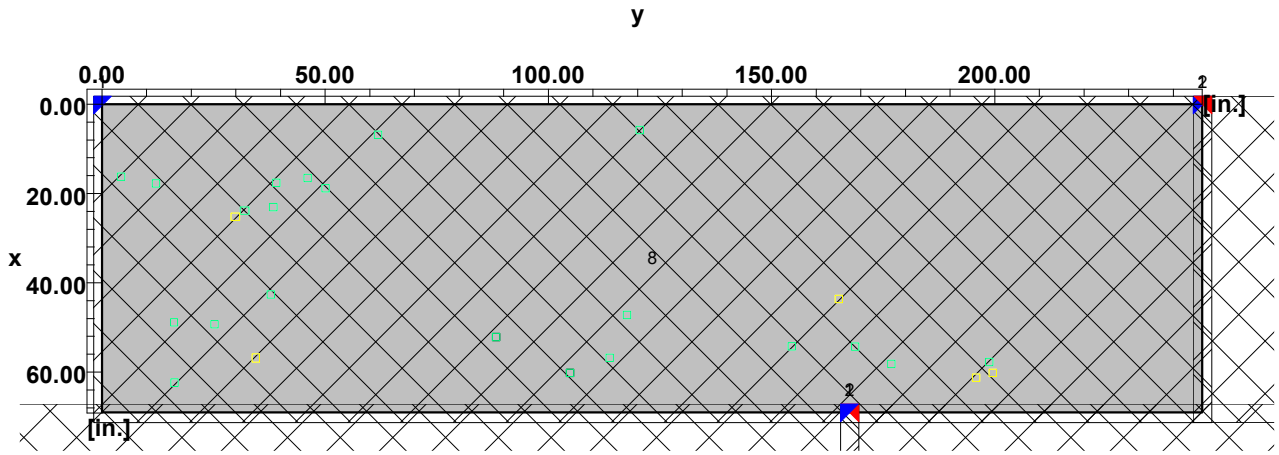

Replacement Plate/Patch List

No.	Angle to Y [°]
7	0
8	0
10	0
11	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 74.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 53 (1 of 2)

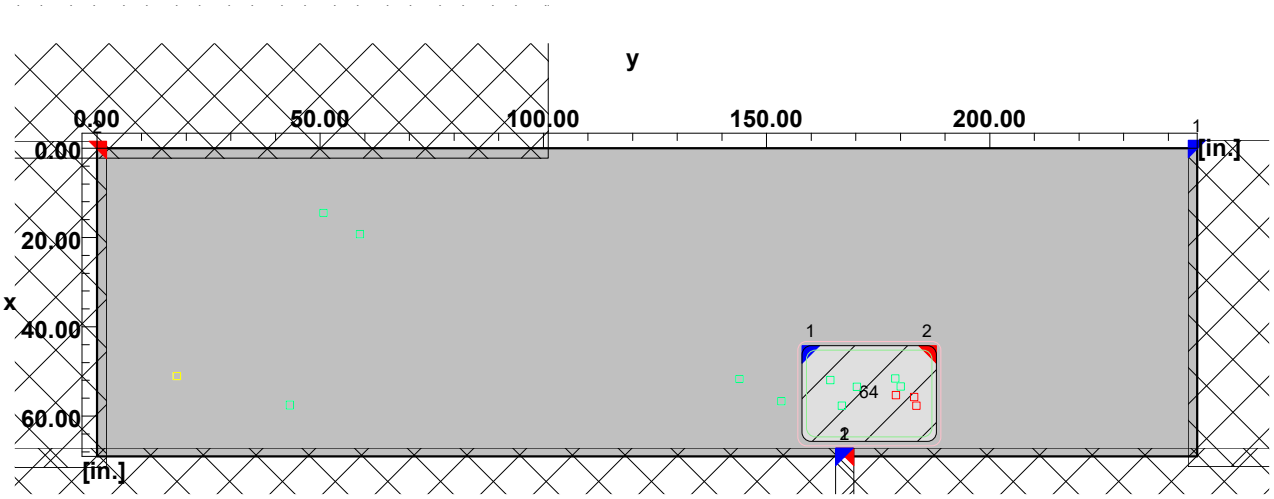

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
6	45	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
8	52	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	74 (2.00)	251 (2.00)
9	58	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
10	59	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
64	53	44.17	157.91	44.17	187.99	22	31
65	54	-1.65	142.13	-1.65	248.50	74	107

Classification

Feature

0	20 %
5	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 22 in. * 31 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 53 (2 of 2)

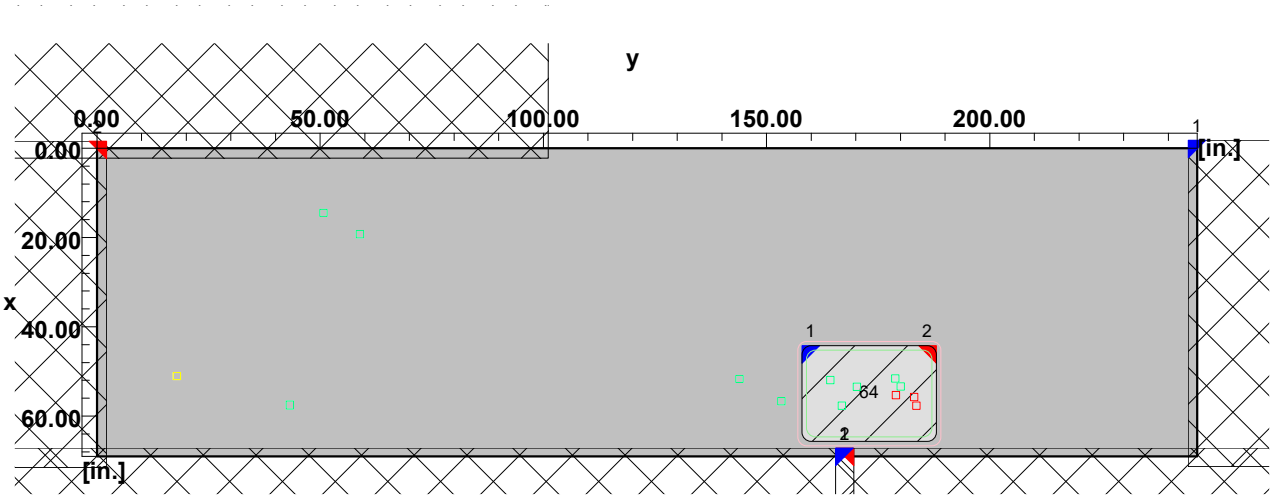

Replacement Plate/Patch List

No.	Angle to Y [°]
6	0
8	0
9	0
10	0
64	0
65	0

Classification

Feature

0	20 %
5	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 22 in. * 31 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 54 (1 of 2)

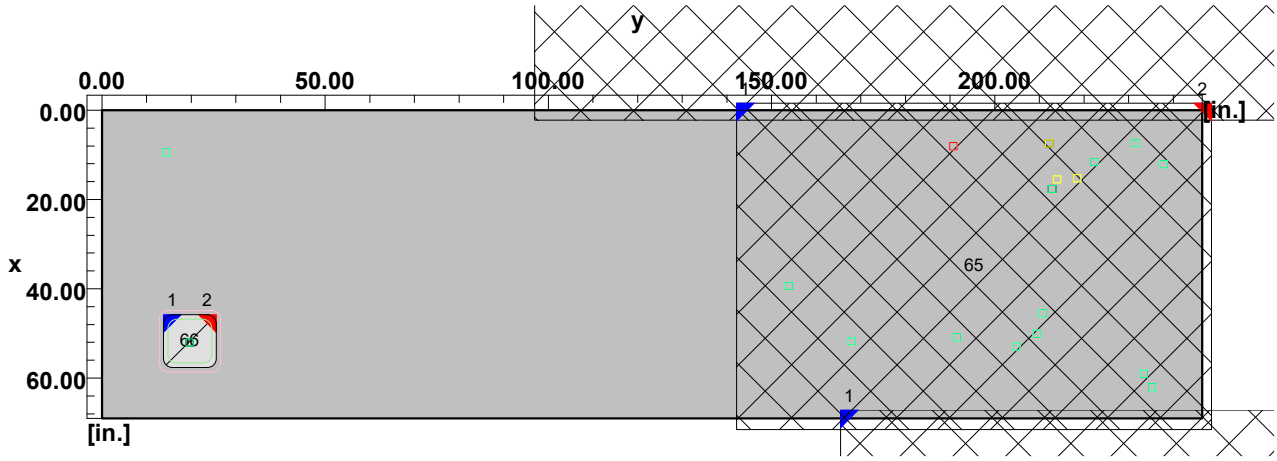

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
6	45	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
9	58	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
65	54	-1.65	142.13	-1.65	248.50	74	107
66	54	45.75	13.74	45.75	25.55	12	12

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded

Repair Patch/Plate


1 patch 'Rounded Rectangle' 12 in. * 12 in.

1 Partial replacement plate 74.00 in. * 107.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 54 (2 of 2)

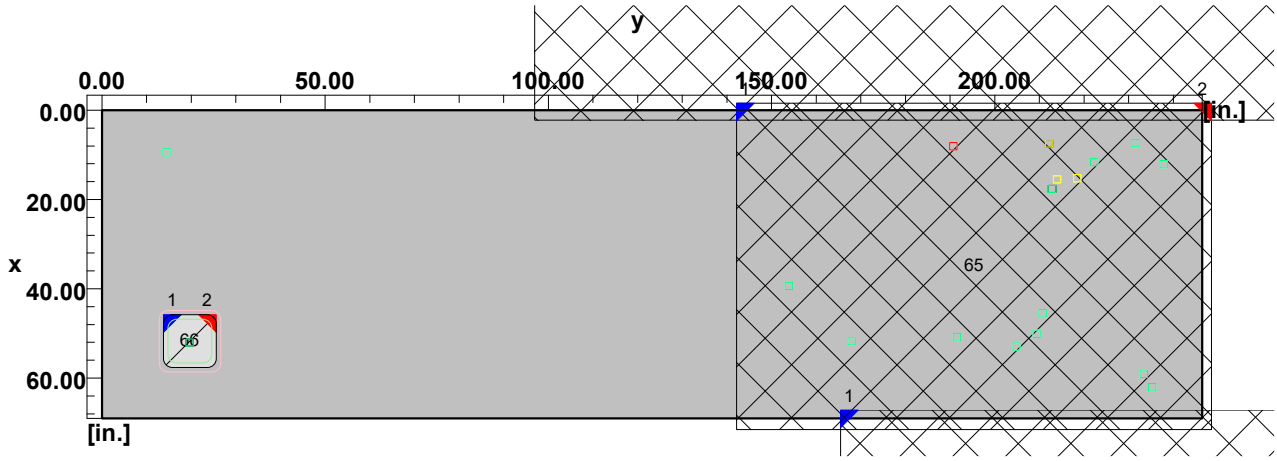

Replacement Plate/Patch List

No.	Angle to Y [°]
6	0
9	0
65	0
66	0

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded

Repair Patch/Plate


1 patch 'Rounded Rectangle' 12 in. * 12 in.

1 Partial replacement plate 74.00 in. * 107.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 55

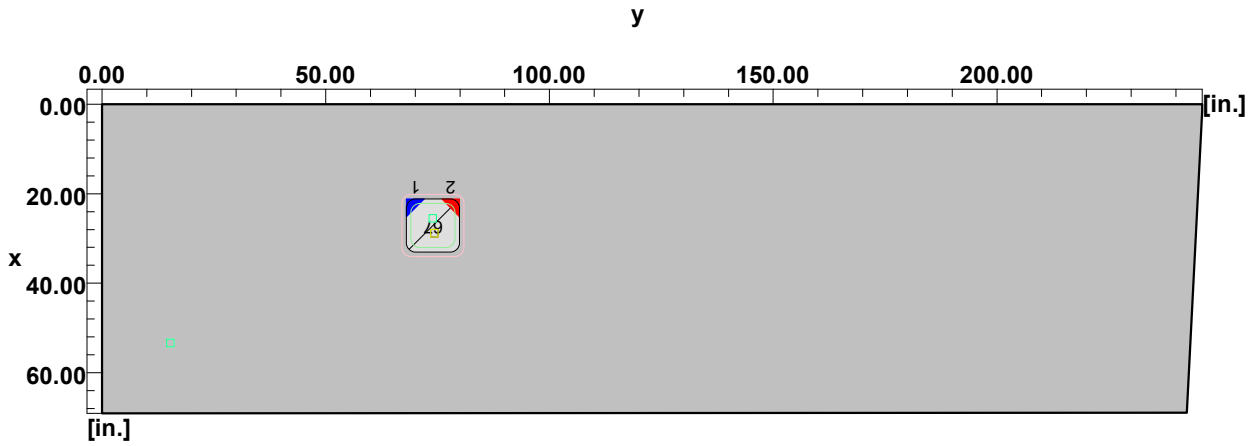

Replacement Plate/Patch List

		Position 1		Position 2		Dimension		Angle to Y
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]	[°]
67	55	21.18	68.03	21.18	79.84	12	12	0

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 56 (1 of 2)

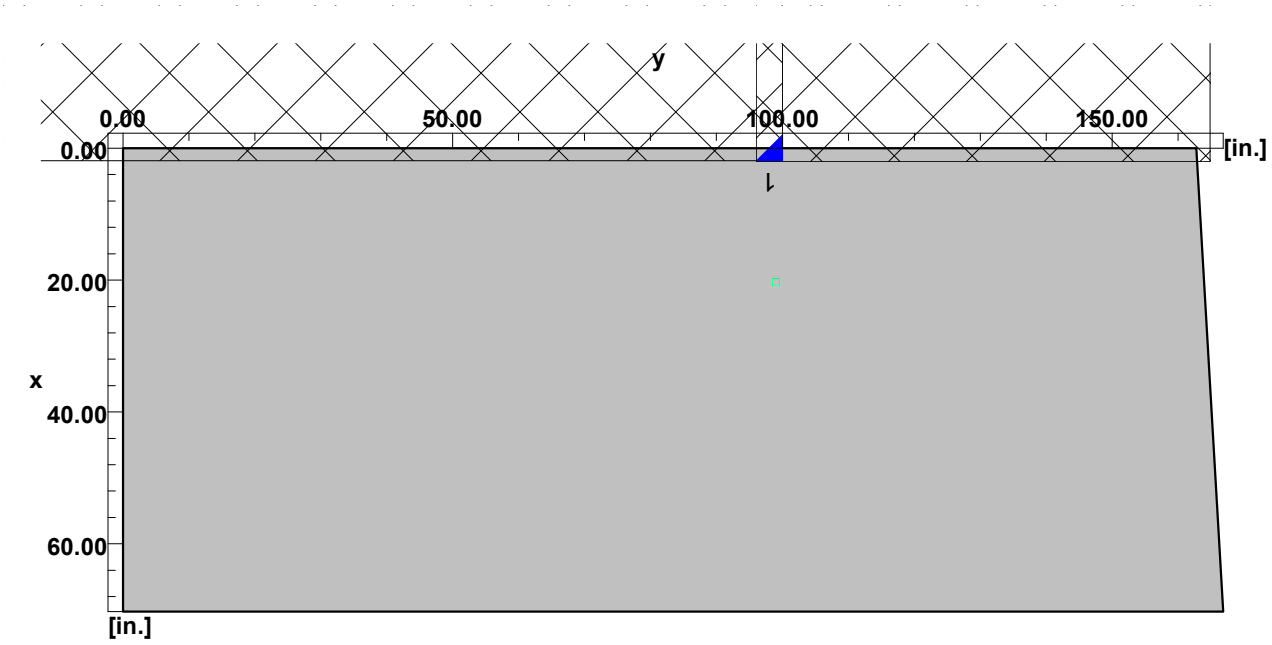

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
16	67	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
17	68	-2.01	-1.97	-2.01 (2.00)	66.77 (2.00)	75 (2.00)	69 (2.00)

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 56 (2 of 2)

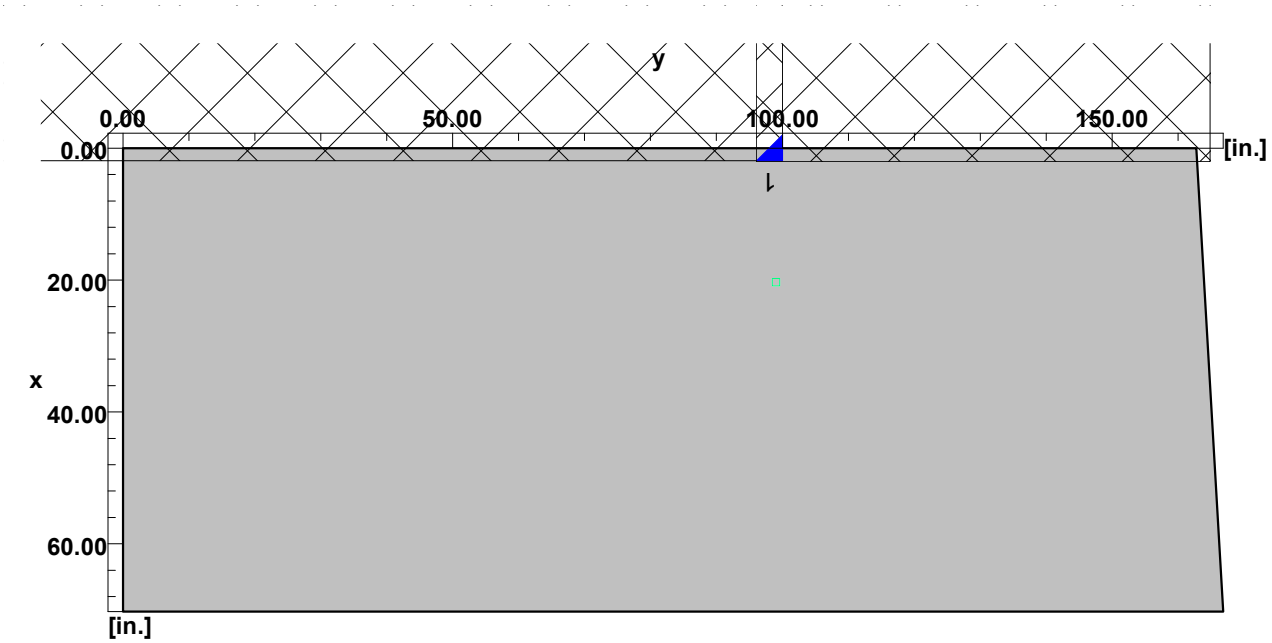

Replacement Plate/Patch List

No.	Angle to Y [°]
16	180
17	0

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 57 (1 of 2)

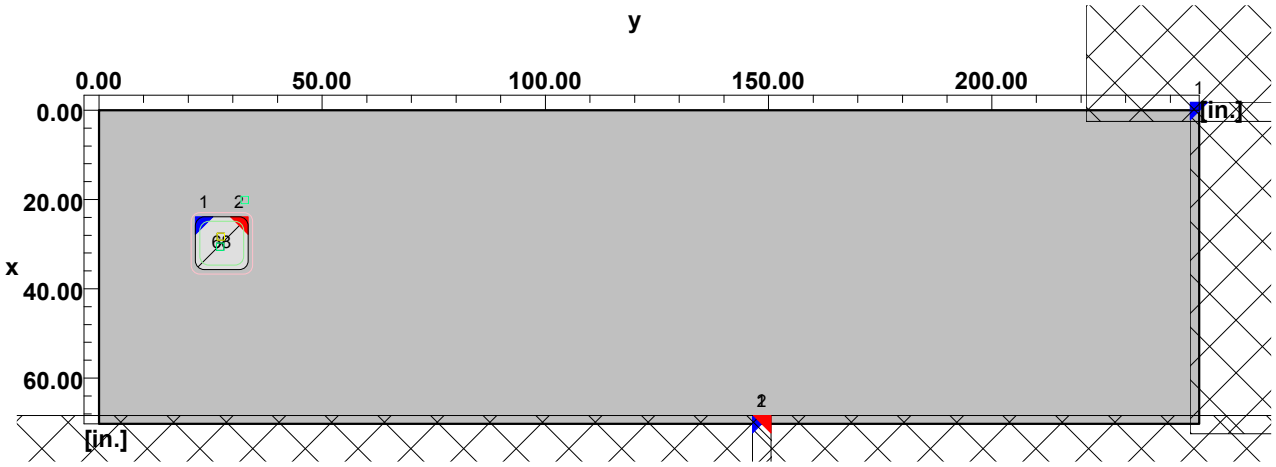

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
9	58	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
15	66	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
16	67	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
65	54	-1.65	142.13	-1.65	248.50	74	107
68	57	23.82	21.57	23.82	33.39	12	12

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 57 (2 of 2)

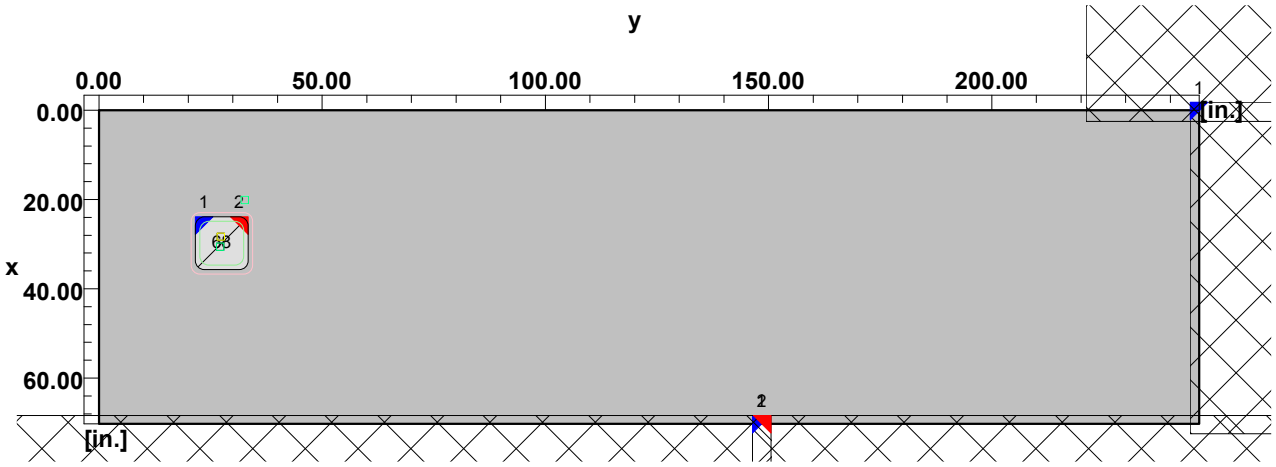

Replacement Plate/Patch List

No.	Angle to Y [°]
9	0
15	0
16	0
65	0
68	0

Classification

Feature

0	20 %
1	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 patch 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 58 (1 of 2)

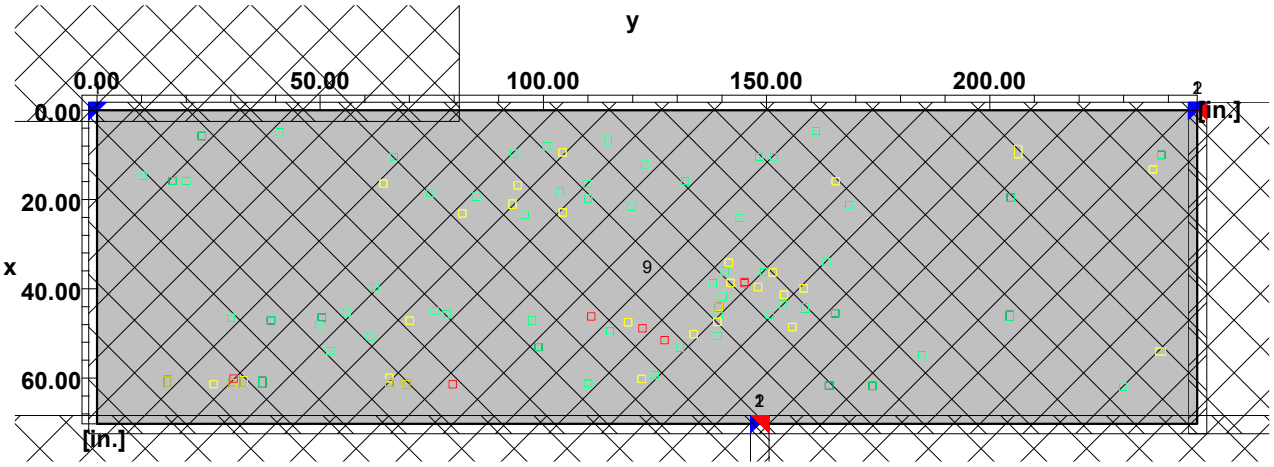

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
9	58	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
10	59	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
14	65	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
15	66	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
65	54	-1.65	142.13	-1.65	248.50	74	107

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 58 (2 of 2)

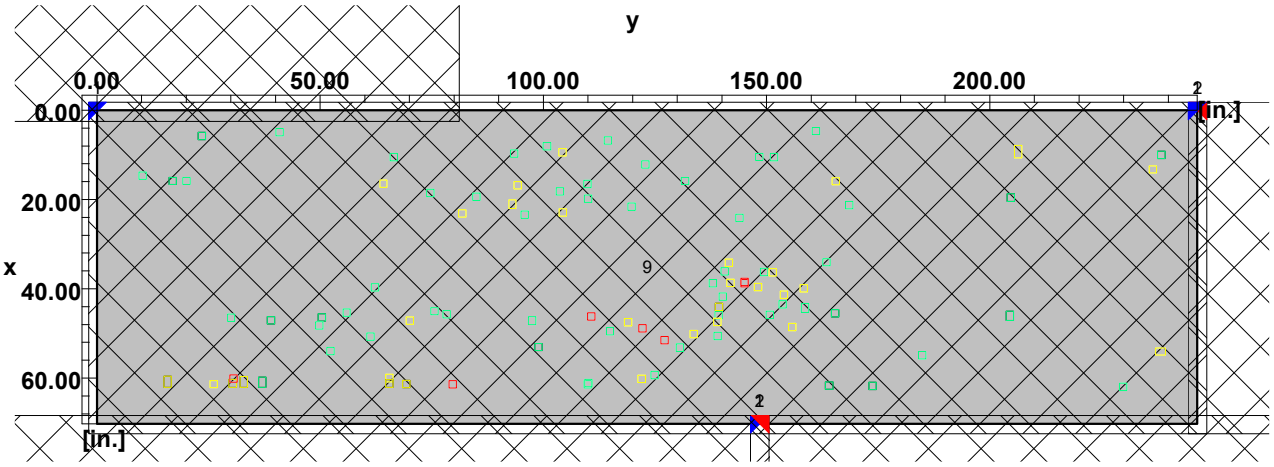

Replacement Plate/Patch List

No.	Angle to Y [°]
9	0
10	0
14	0
15	0
65	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 59 (1 of 2)

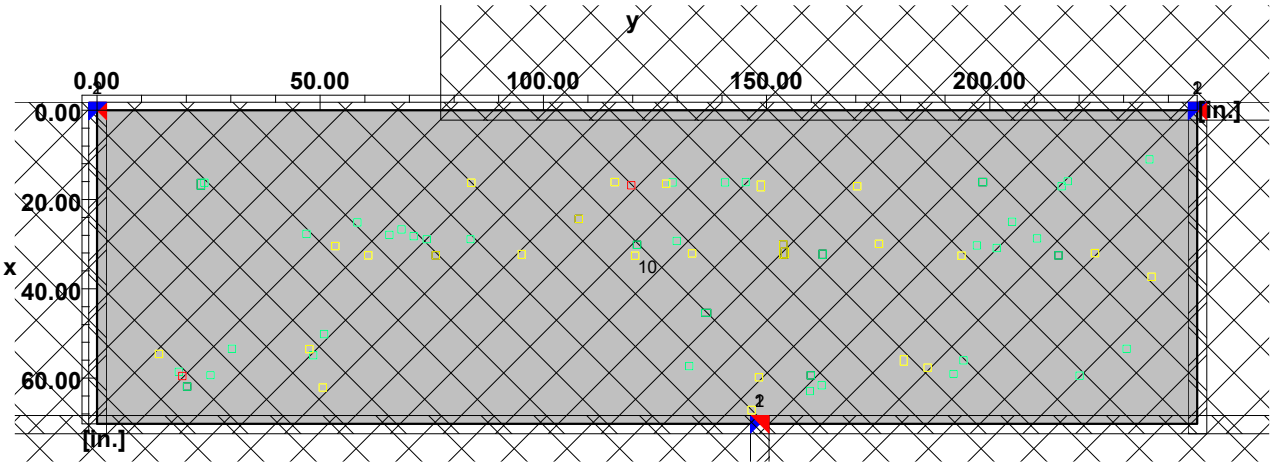

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
8	52	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	74 (2.00)	251 (2.00)
9	58	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
10	59	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
11	60	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
13	64	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
14	65	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 59 (2 of 2)

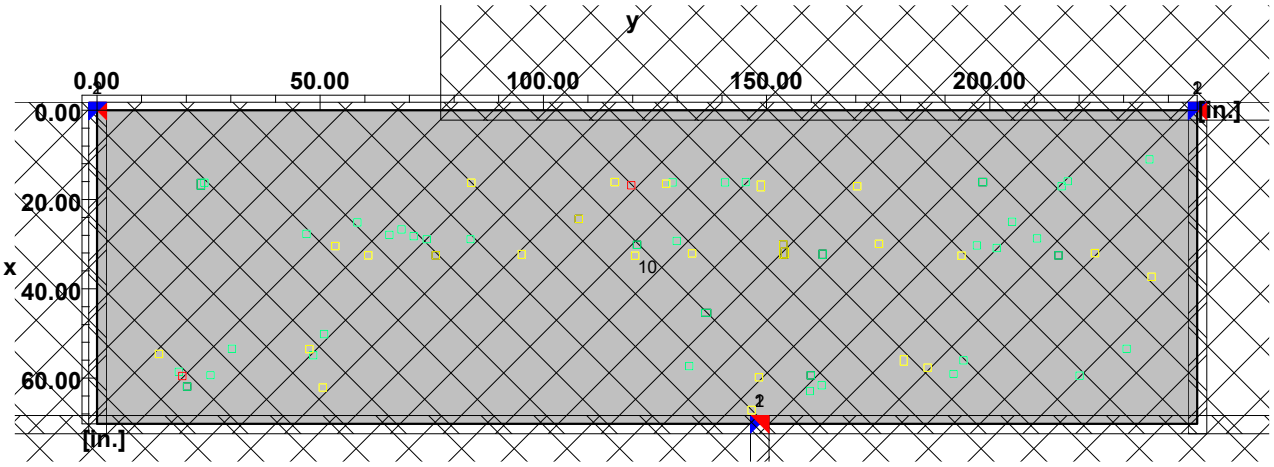

Replacement Plate/Patch List

No.	Angle to Y [°]
8	0
9	0
10	0
11	0
13	0
14	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 60 (1 of 2)

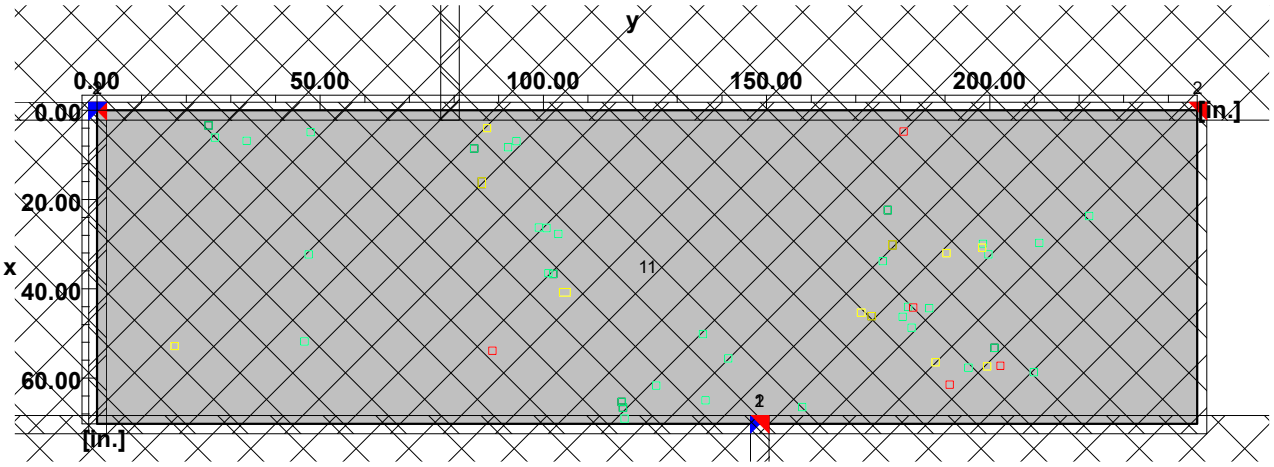

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
7	51	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	74 (2.00)	251 (2.00)
8	52	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	74 (2.00)	251 (2.00)
10	59	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
11	60	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
12	63	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
13	64	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 60 (2 of 2)

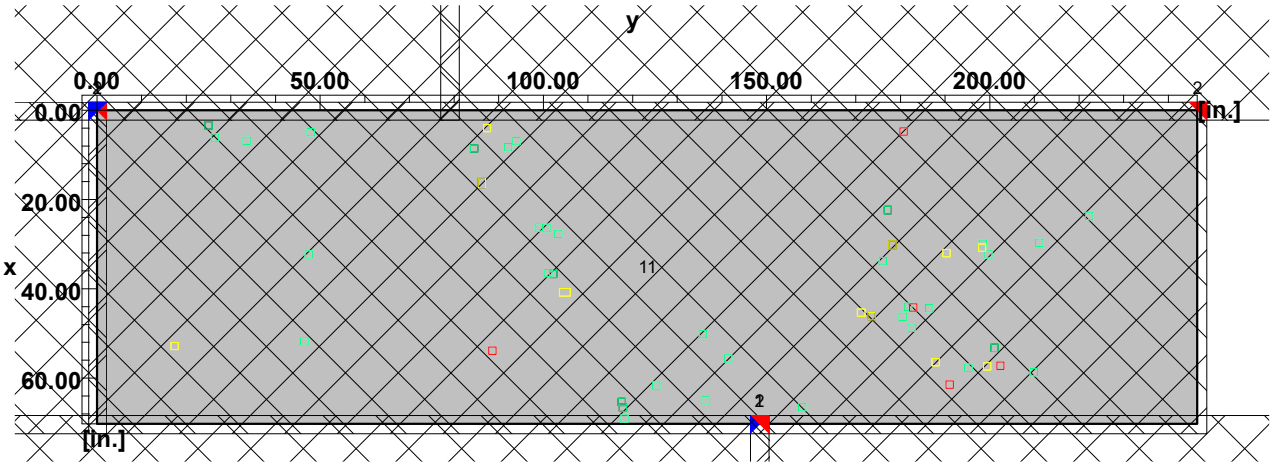

Replacement Plate/Patch List

No.	Angle to Y [°]
7	0
8	0
10	0
11	0
12	0
13	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 61 (1 of 2)

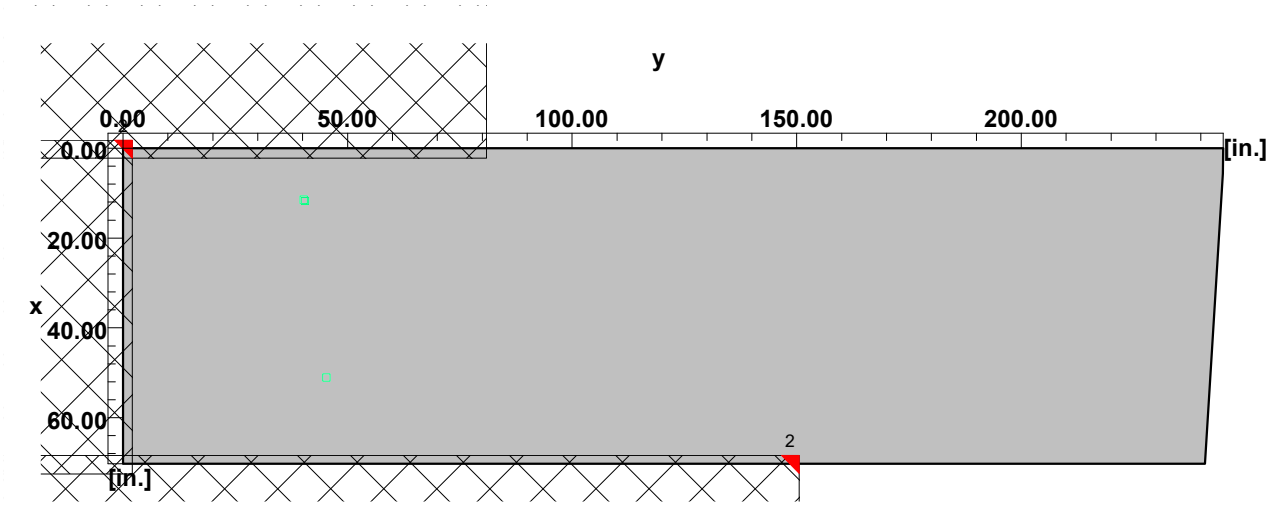

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
7	51	-1.93	-1.97	-1.93 (2.00)	248.27 (2.00)	74 (2.00)	251 (2.00)
11	60	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
12	63	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 61 (2 of 2)

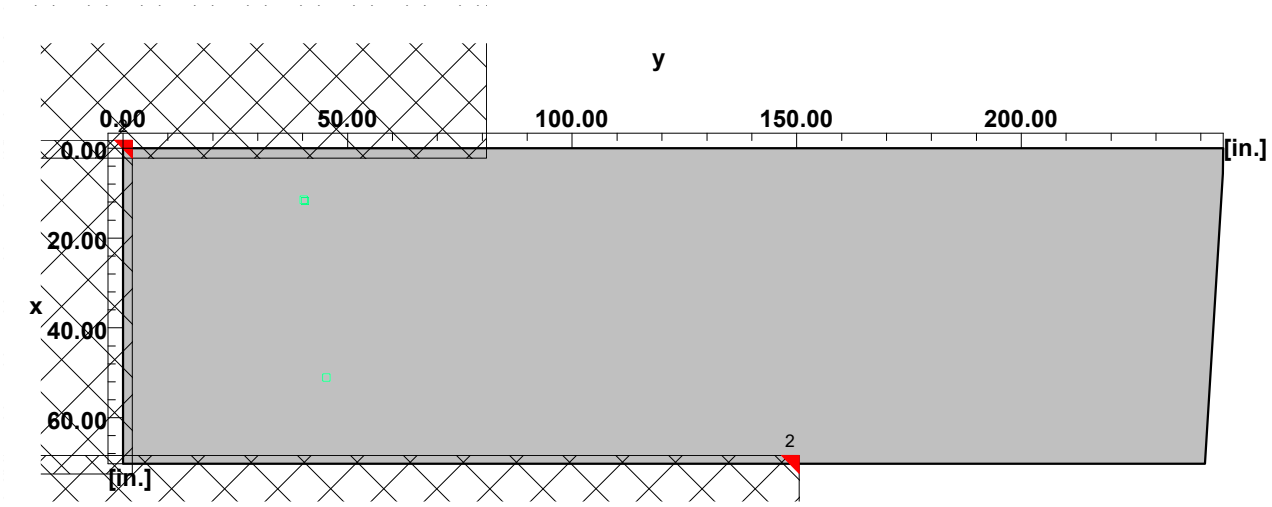

Replacement Plate/Patch List

No.	Angle to Y [°]
7	0
11	0
12	0

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 62 (1 of 4)

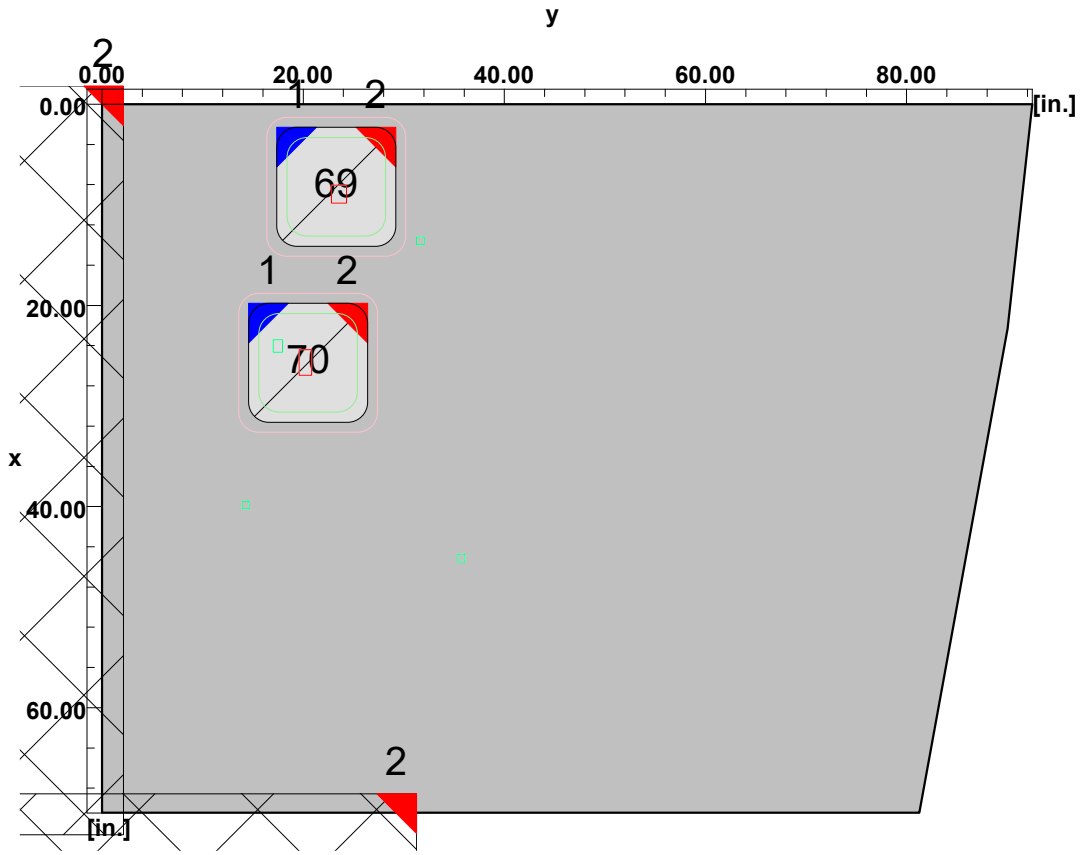

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
12	63	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
23	74	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
69	62	2.24	17.36	2.24	29.17	12	12

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

2 patches 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 62 (2 of 4)

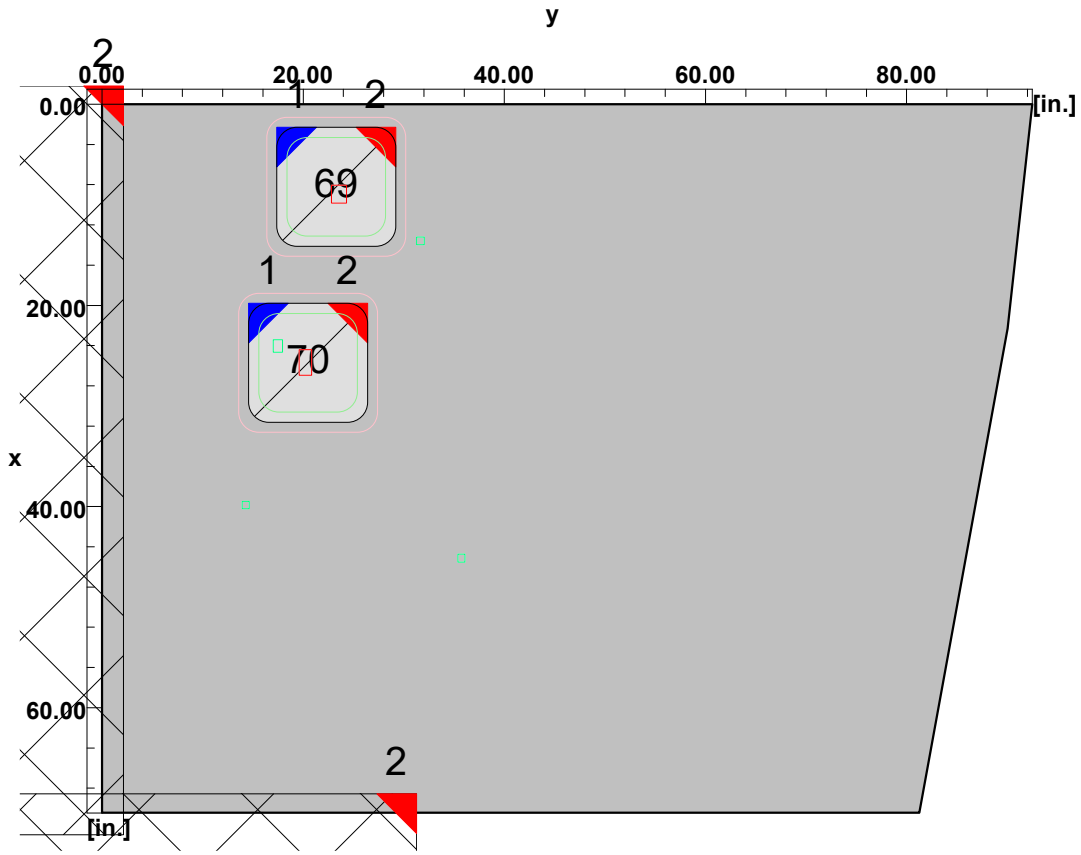

Replacement Plate/Patch List

No.	Angle to Y [°]
12	0
23	0
69	0

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

2 patches 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 62 (3 of 4)

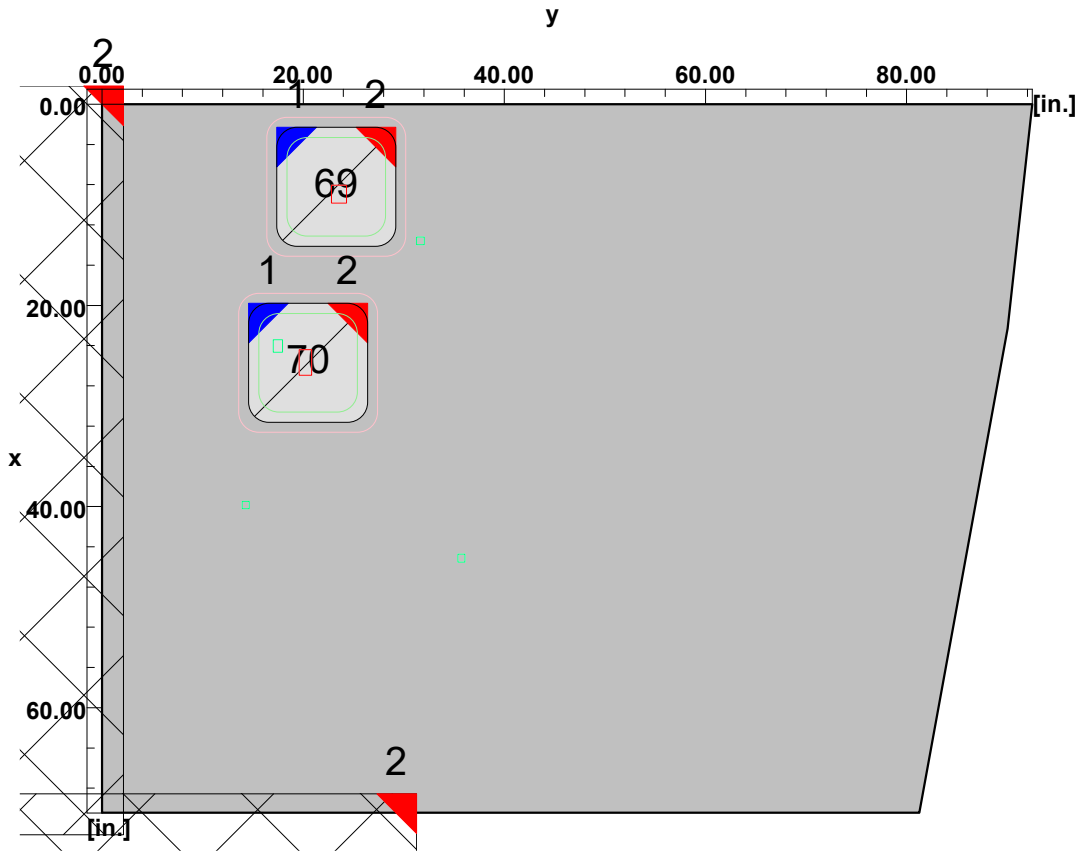

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
70	62	19.76	14.57	19.76	26.38	12	12

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

2 patches 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 62 (4 of 4)

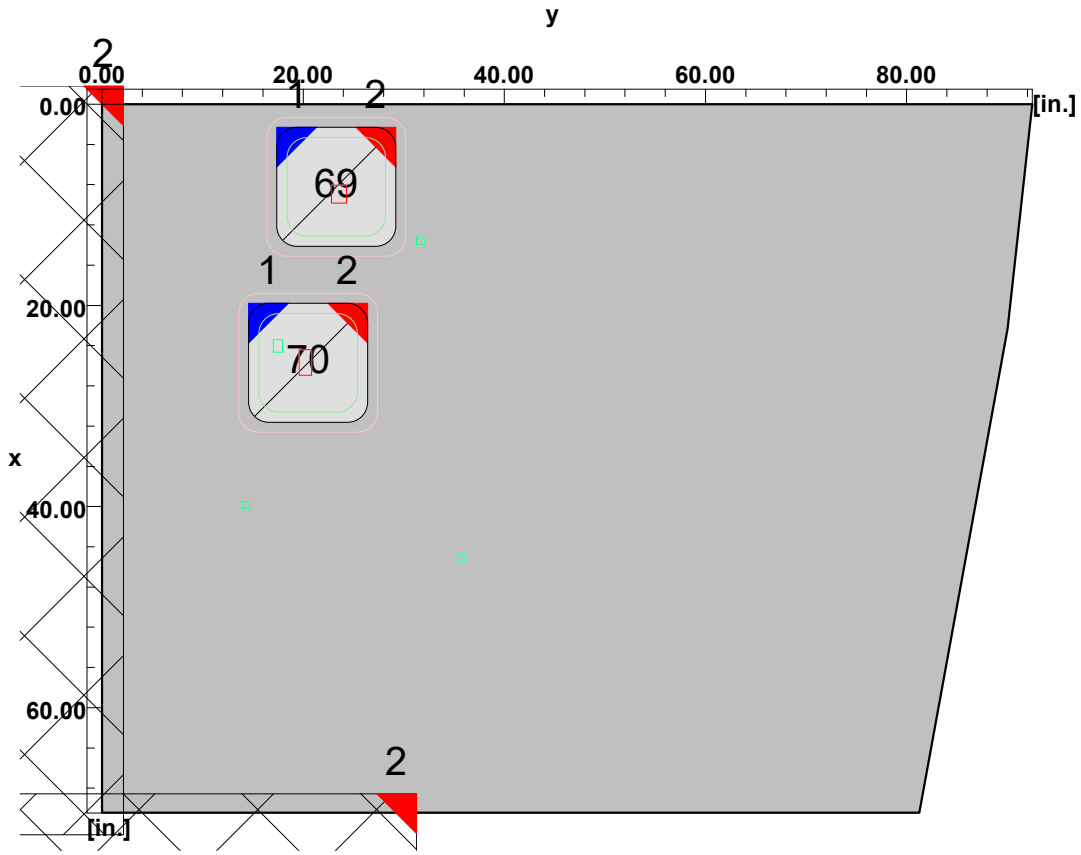

Replacement Plate/Patch List

No.	Angle to Y [°]
70	0

Classification

Feature

0	20 %
3	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

2 patches 'Rounded Rectangle' 12 in. * 12 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 63 (1 of 2)

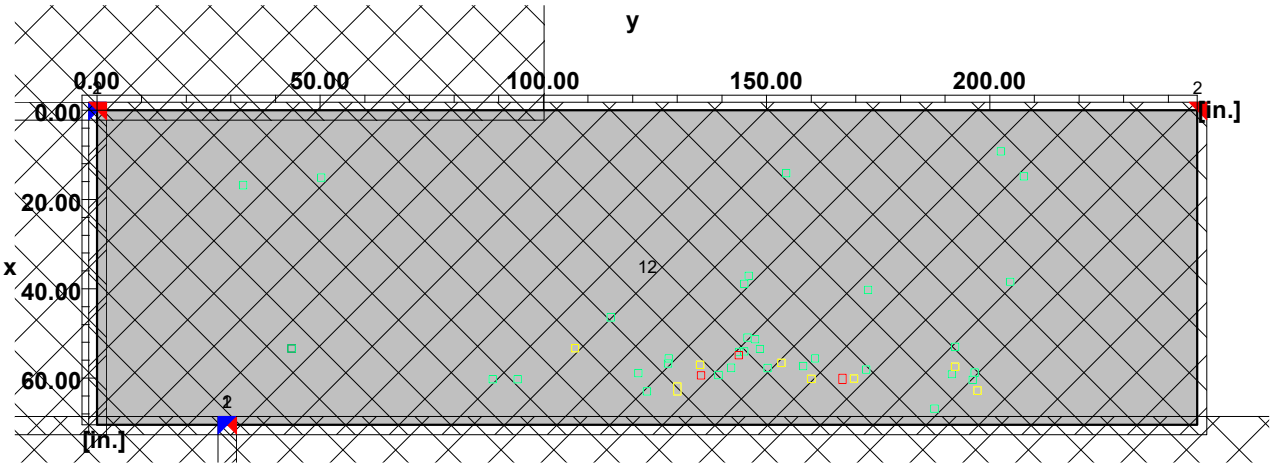

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
11	60	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
12	63	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
13	64	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
22	73	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
23	74	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 63 (2 of 2)

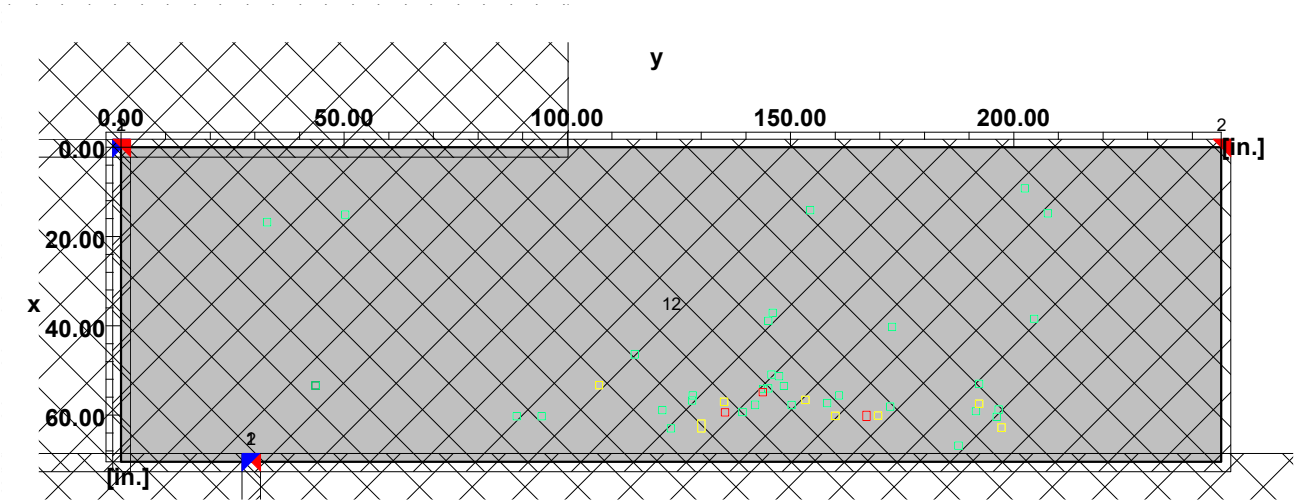

Replacement Plate/Patch List

No.	Angle to Y [°]
11	0
12	0
13	0
22	0
23	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 64 (1 of 2)

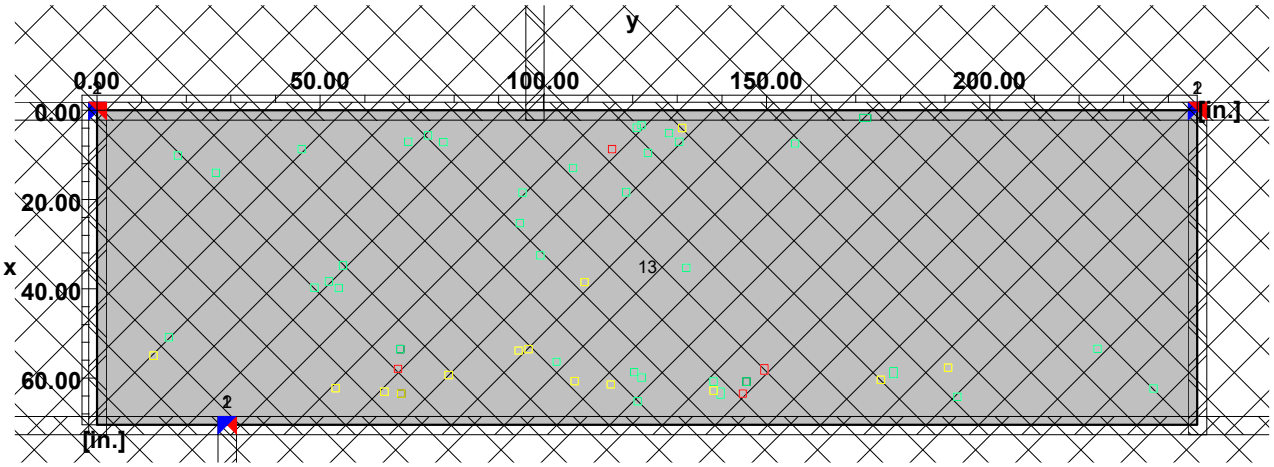

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
10	59	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
11	60	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
12	63	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
13	64	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
14	65	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
21	72	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
22	73	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 64 (2 of 2)

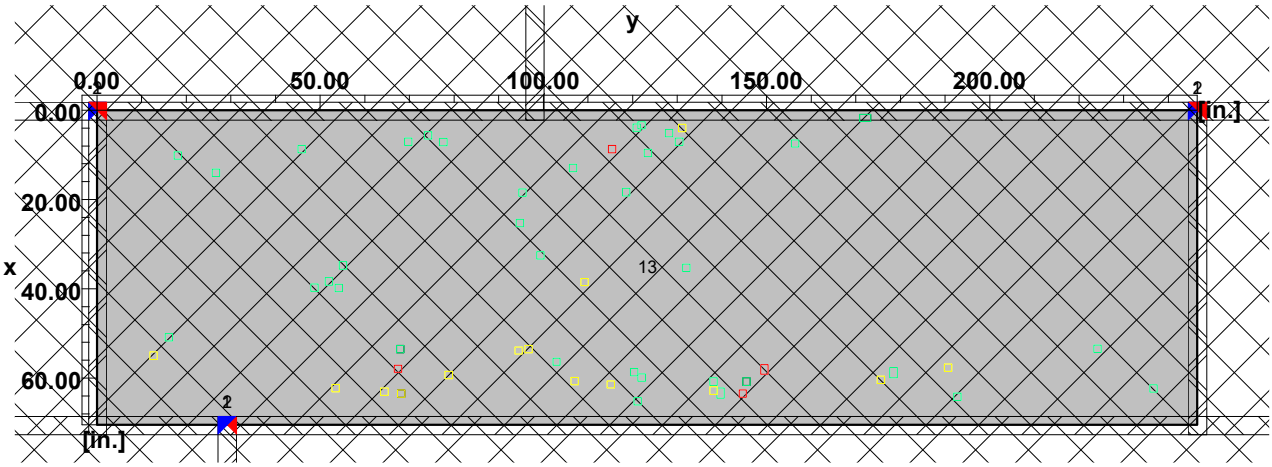

Replacement Plate/Patch List

No.	Angle to Y [°]
10	0
11	0
12	0
13	0
14	0
21	0
22	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 65 (1 of 2)

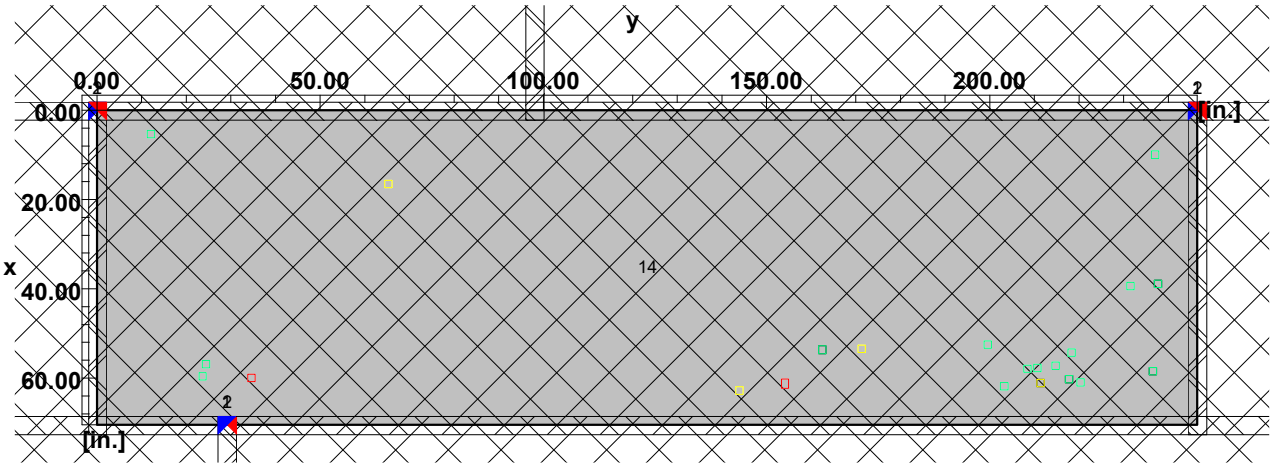

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
9	58	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
10	59	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
13	64	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
14	65	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
15	66	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
20	71	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
21	72	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 65 (2 of 2)

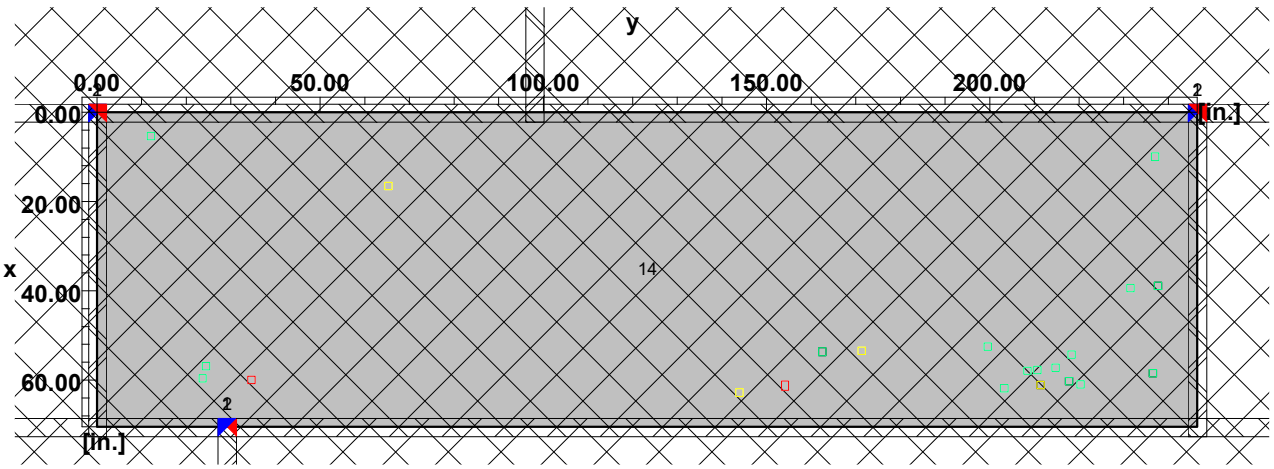

Replacement Plate/Patch List

No.	Angle to Y [°]
9	0
10	0
13	0
14	0
15	0
20	0
21	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 66 (1 of 2)

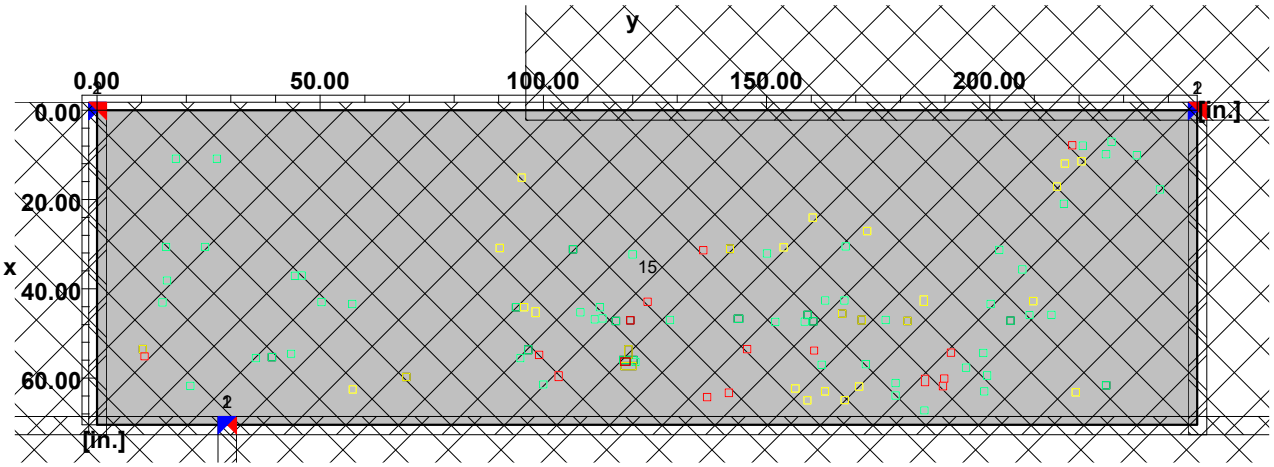

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
9	58	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
14	65	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
15	66	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
16	67	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
19	70	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
20	71	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 66 (2 of 2)

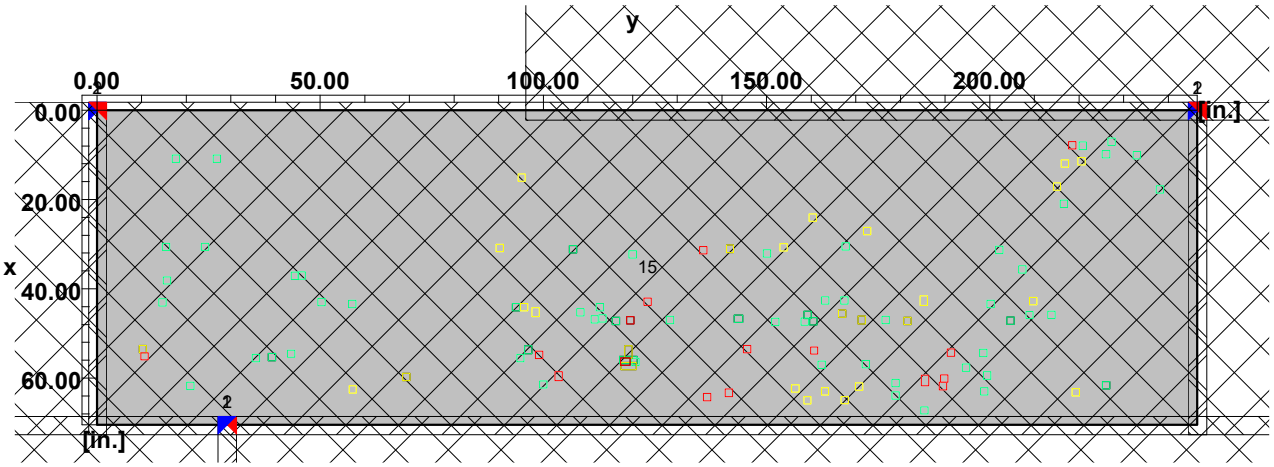

Replacement Plate/Patch List

No.	Angle to Y [°]
9	0
14	0
15	0
16	0
19	0
20	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 67 (1 of 2)

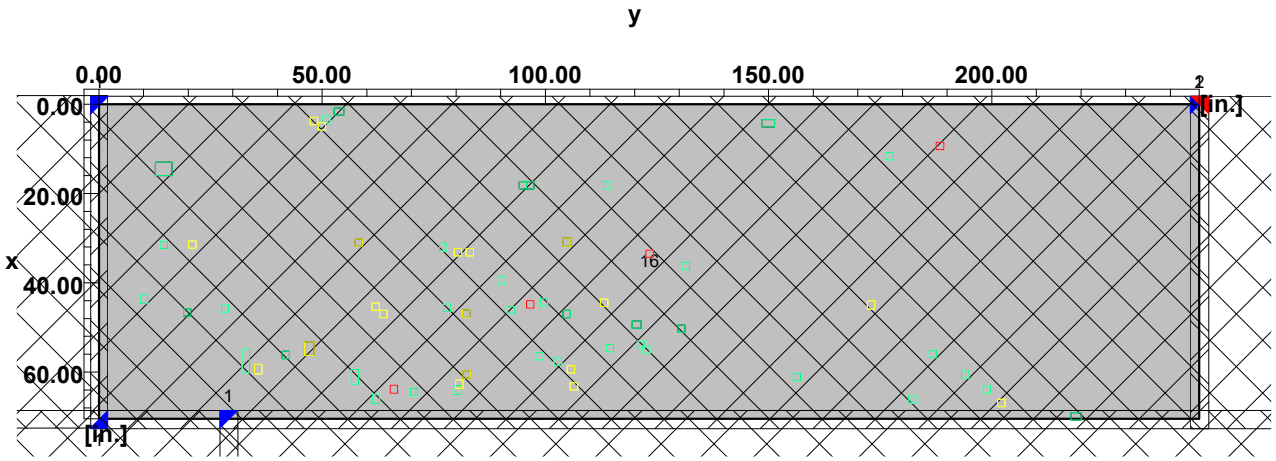

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
15	66	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
16	67	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
17	68	-2.01	-1.97	-2.01 (2.00)	66.77 (2.00)	75 (2.00)	69 (2.00)
18	69	-2.01	-1.97	-2.01 (2.00)	84.69 (2.00)	75 (2.00)	87 (2.00)
19	70	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 67 (2 of 2)

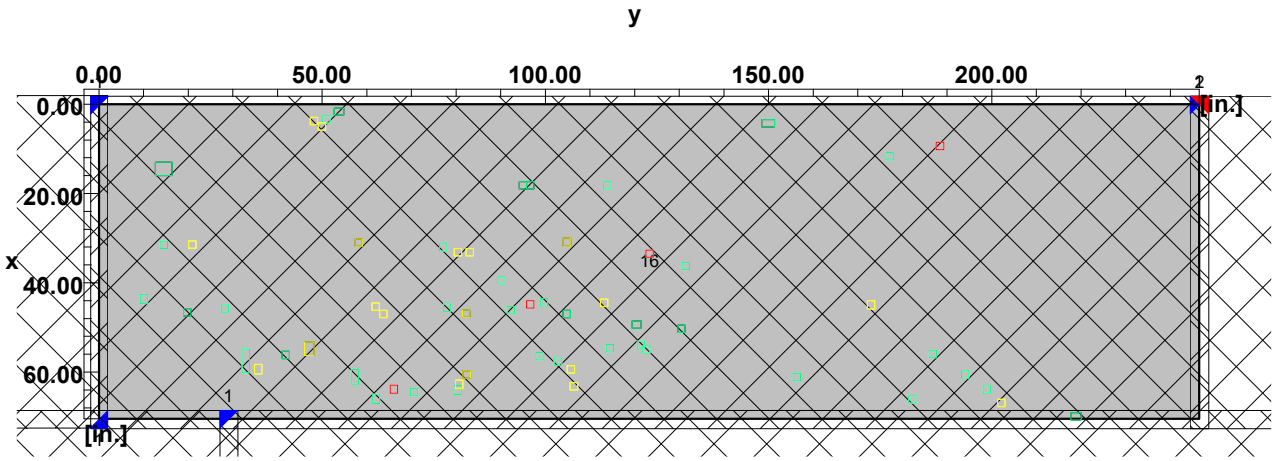

Replacement Plate/Patch List

No.	Angle to Y [°]
15	0
16	0
17	180
18	180
19	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 68 (1 of 2)

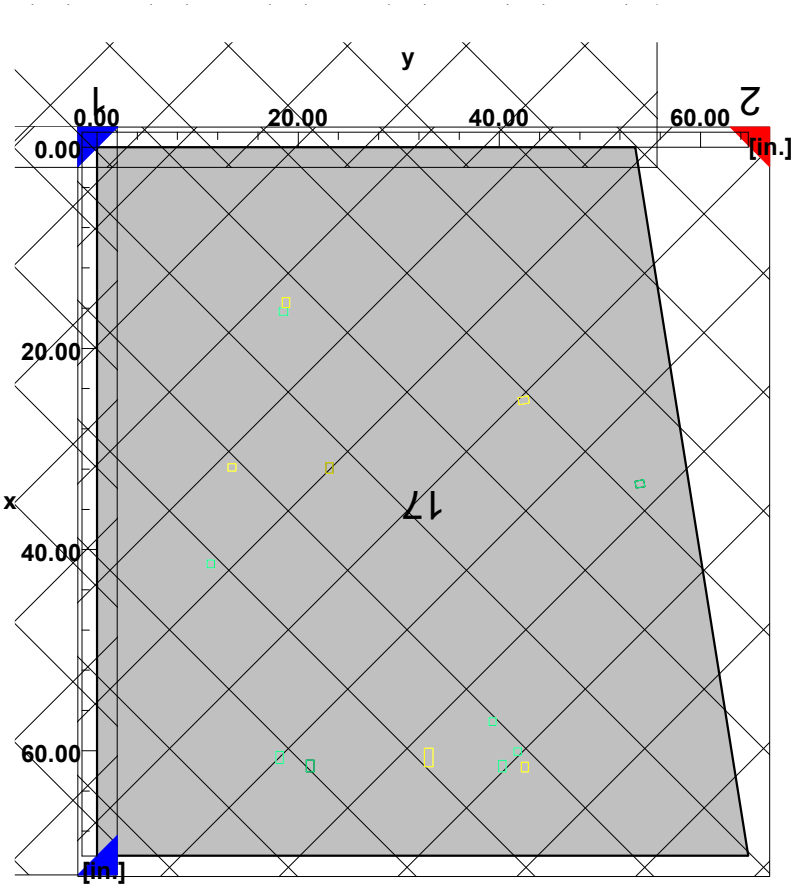

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
16	67	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
17	68	-2.01	-1.97	-2.01 (2.00)	66.77 (2.00)	75 (2.00)	69 (2.00)
18	69	-2.01	-1.97	-2.01 (2.00)	84.69 (2.00)	75 (2.00)	87 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 69.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 68 (2 of 2)

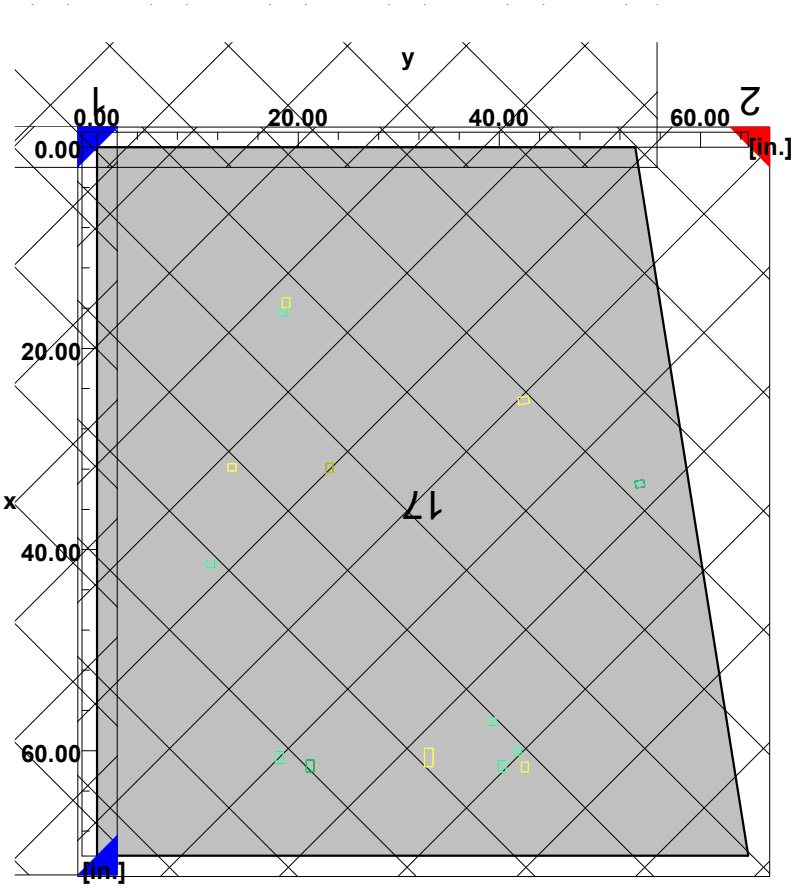

Replacement Plate/Patch List

No.	Angle to Y [°]
16	180
17	0
18	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 69.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 69 (1 of 4)

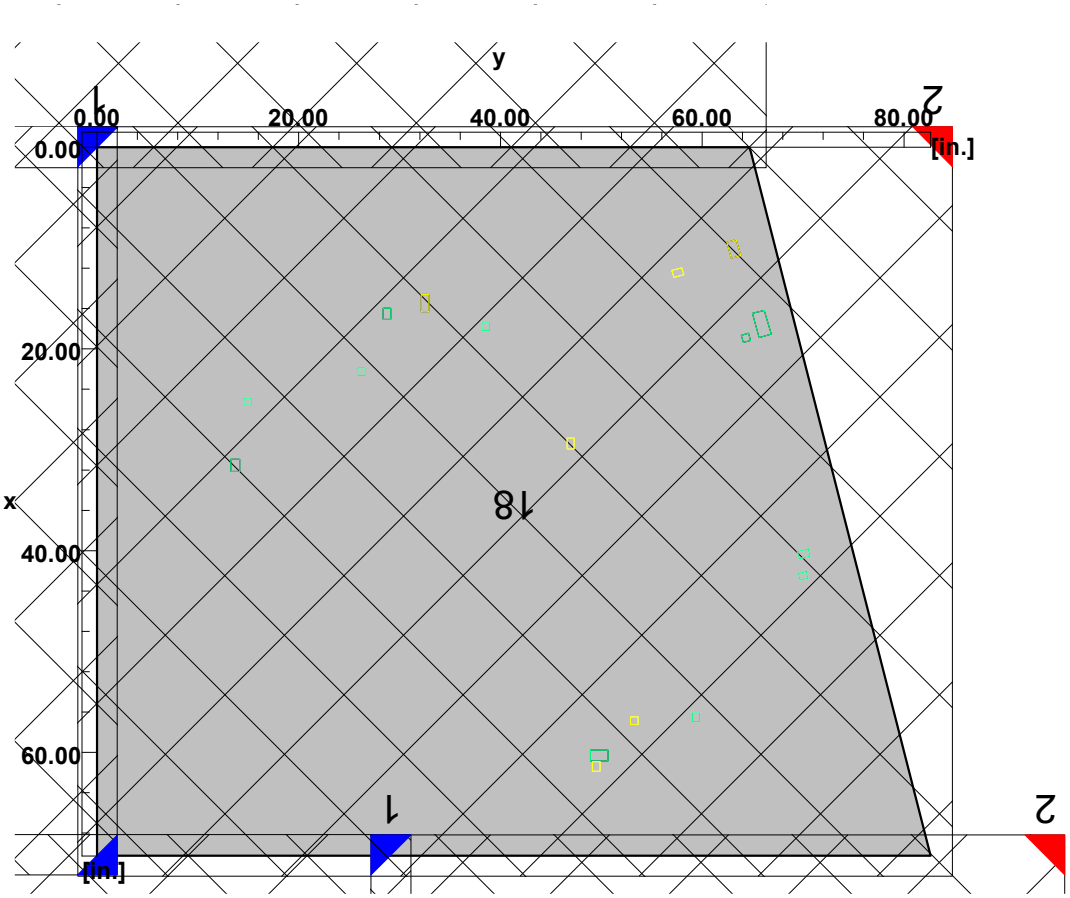

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
16	67	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
17	68	-2.01	-1.97	-2.01 (2.00)	66.77 (2.00)	75 (2.00)	69 (2.00)
18	69	-2.01	-1.97	-2.01 (2.00)	84.69 (2.00)	75 (2.00)	87 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 87.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 69 (2 of 4)

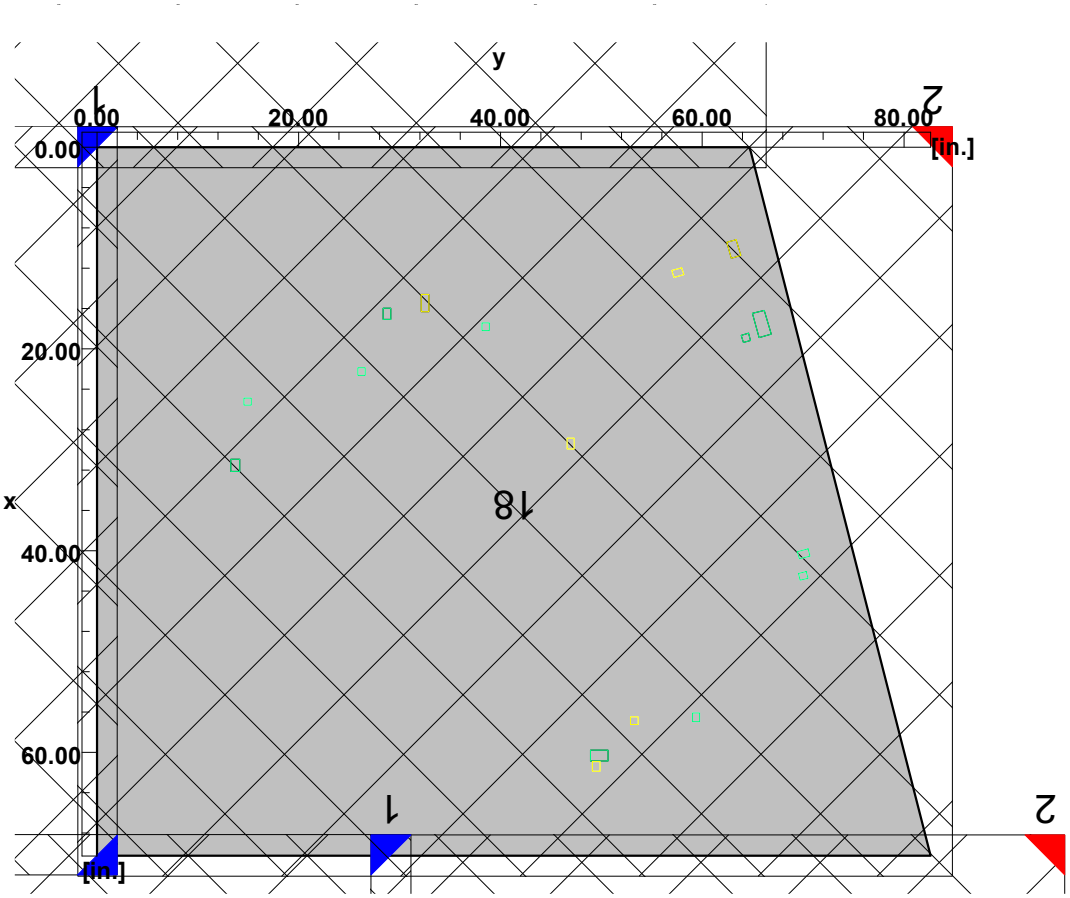

Replacement Plate/Patch List

No.	Angle to Y [°]
16	180
17	0
18	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 87.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 69 (3 of 4)

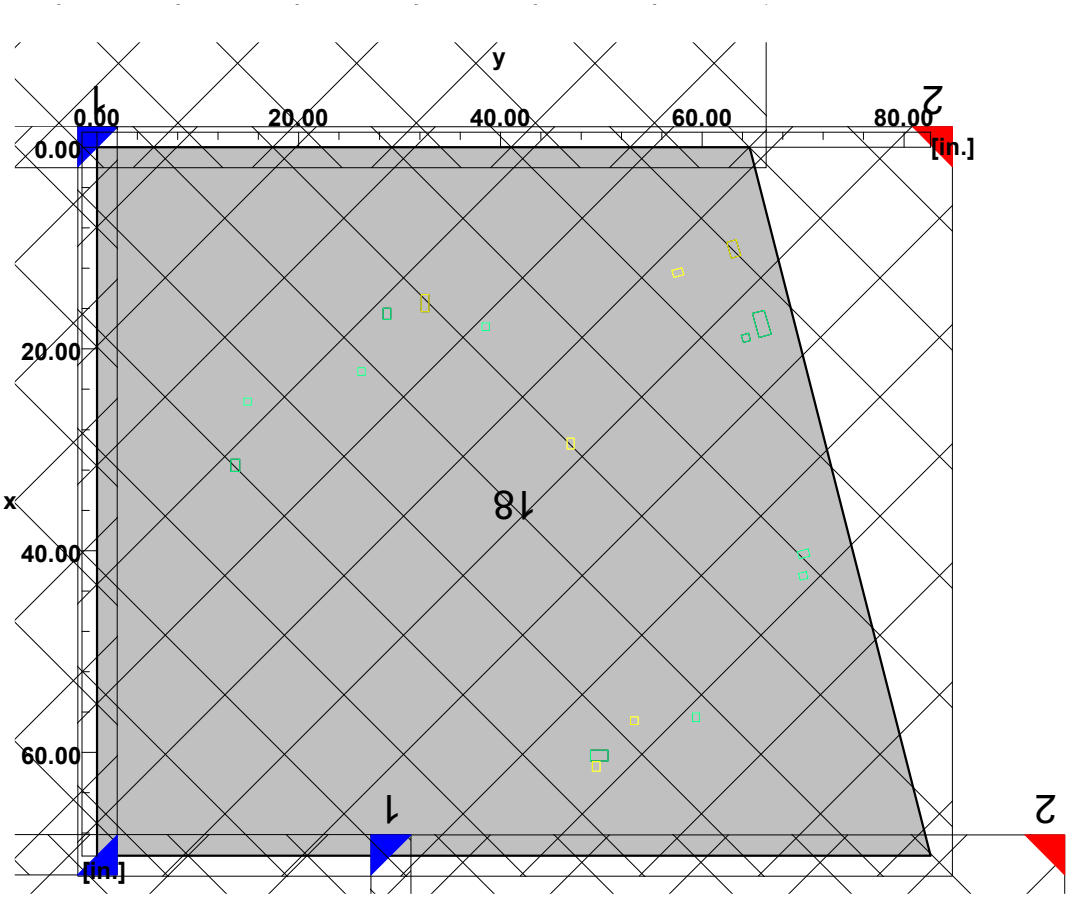

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
19	70	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
29	81	-2.01	-1.97	-2.01 (2.00)	175.24 (2.00)	75 (2.00)	178 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 87.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 69 (4 of 4)

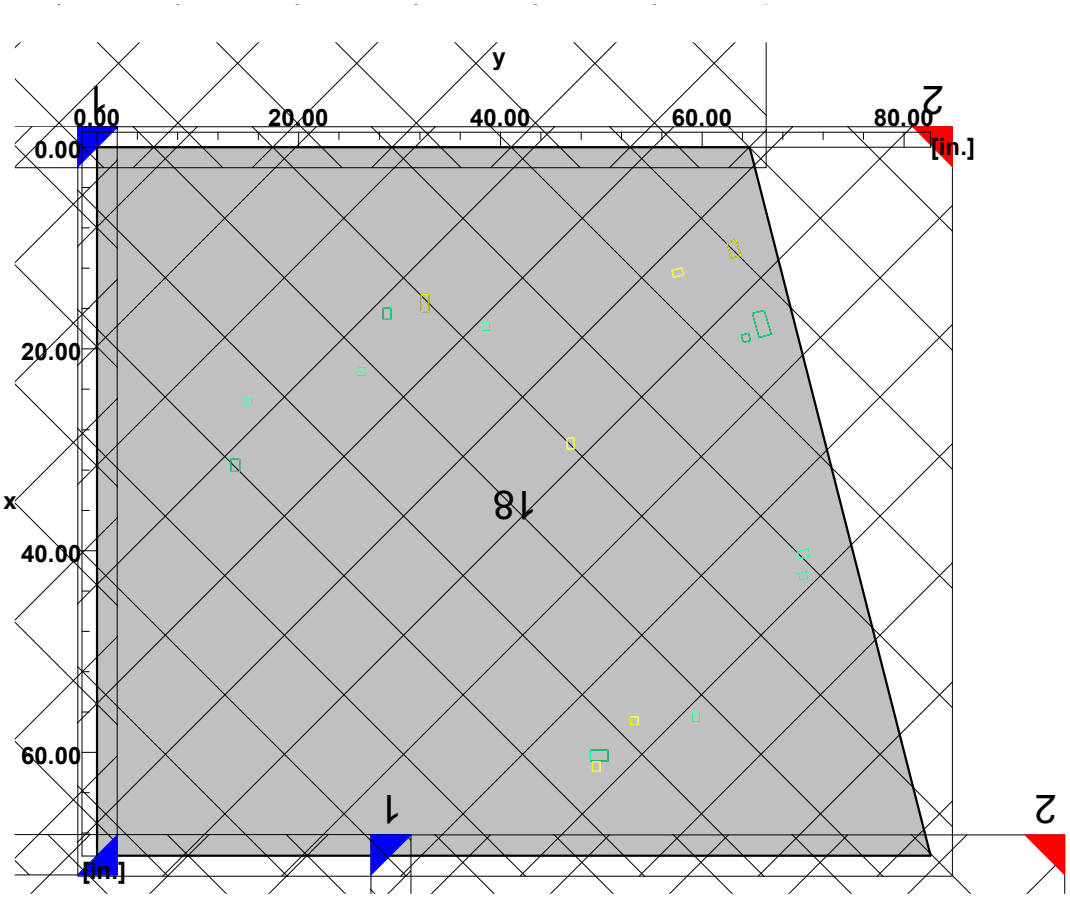

Replacement Plate/Patch List

No.	Angle to Y [°]
19	180
29	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 87.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 70 (1 of 2)

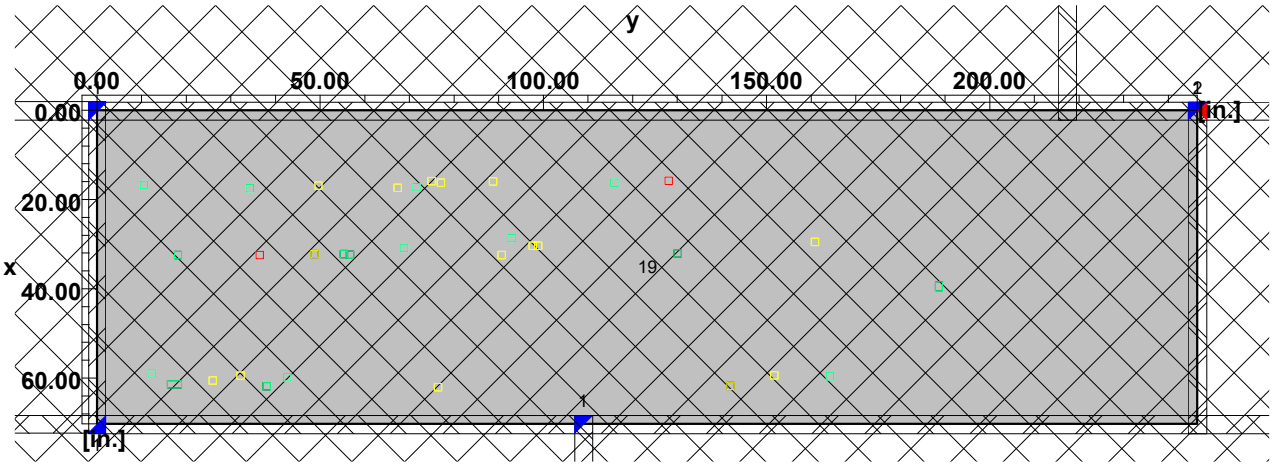

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
15	66	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
16	67	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
18	69	-2.01	-1.97	-2.01 (2.00)	84.69 (2.00)	75 (2.00)	87 (2.00)
19	70	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
20	71	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
28	80	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
29	81	-2.01	-1.97	-2.01 (2.00)	175.24 (2.00)	75 (2.00)	178 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 70 (2 of 2)

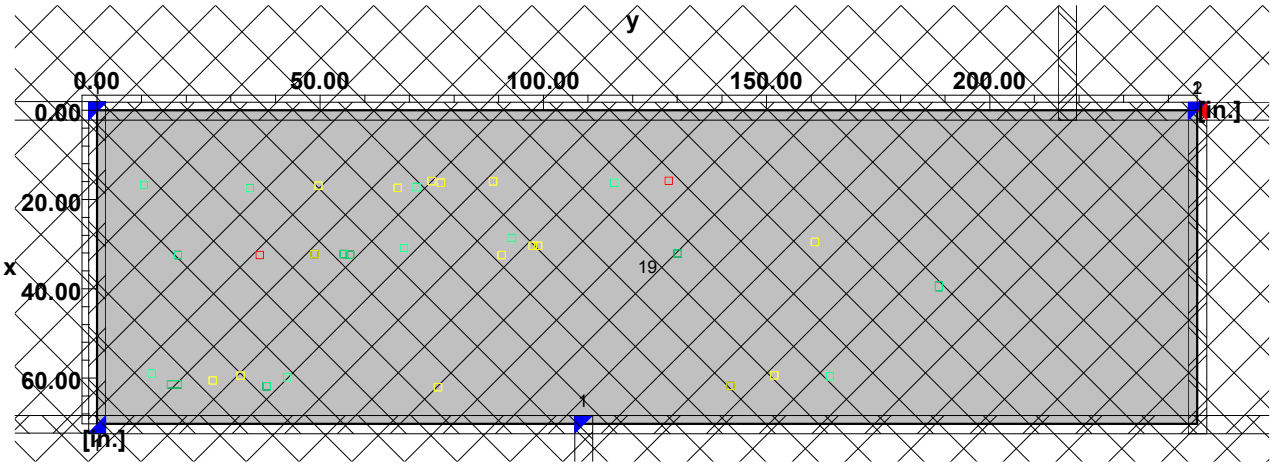

Replacement Plate/Patch List

No.	Angle to Y [°]
15	0
16	0
18	180
19	0
20	0
28	0
29	180

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 71 (1 of 2)

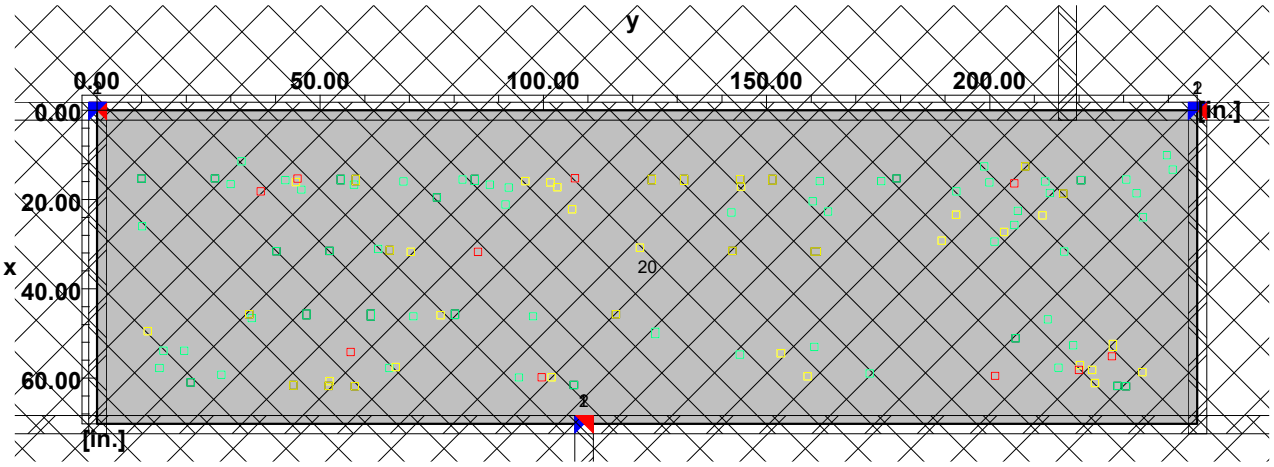

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
14	65	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
15	66	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
19	70	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
20	71	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
21	72	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
27	79	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
28	80	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 71 (2 of 2)

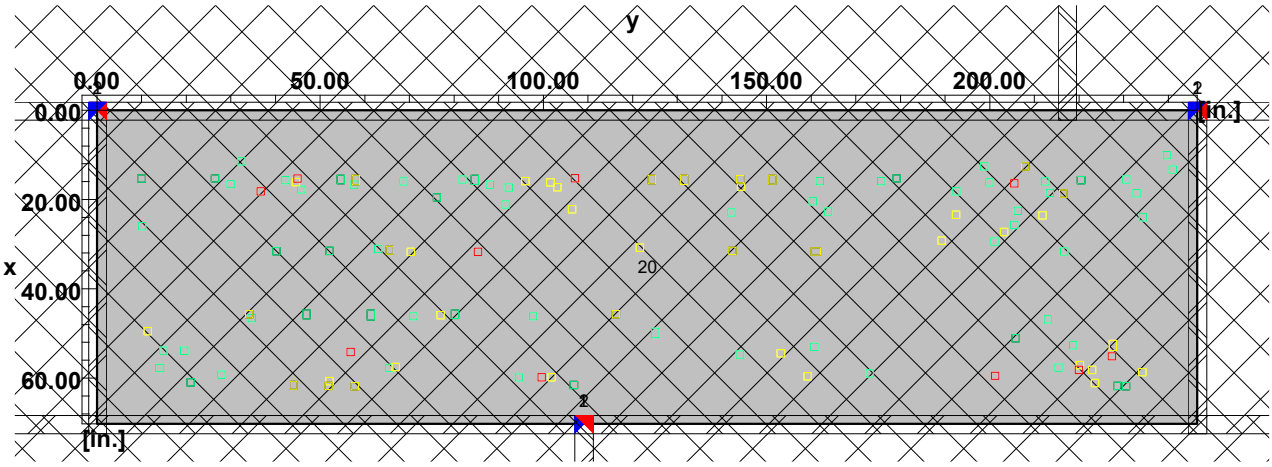

Replacement Plate/Patch List

No.	Angle to Y [°]
14	0
15	0
19	0
20	0
21	0
27	0
28	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 72 (1 of 2)

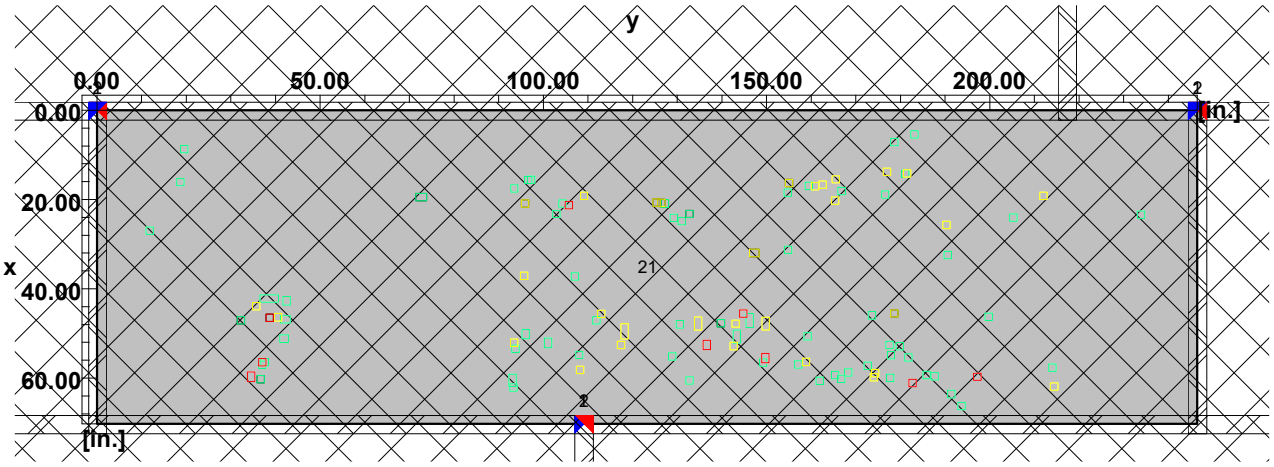

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
13	64	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
14	65	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
20	71	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
21	72	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
22	73	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
26	78	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
27	79	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 72 (2 of 2)

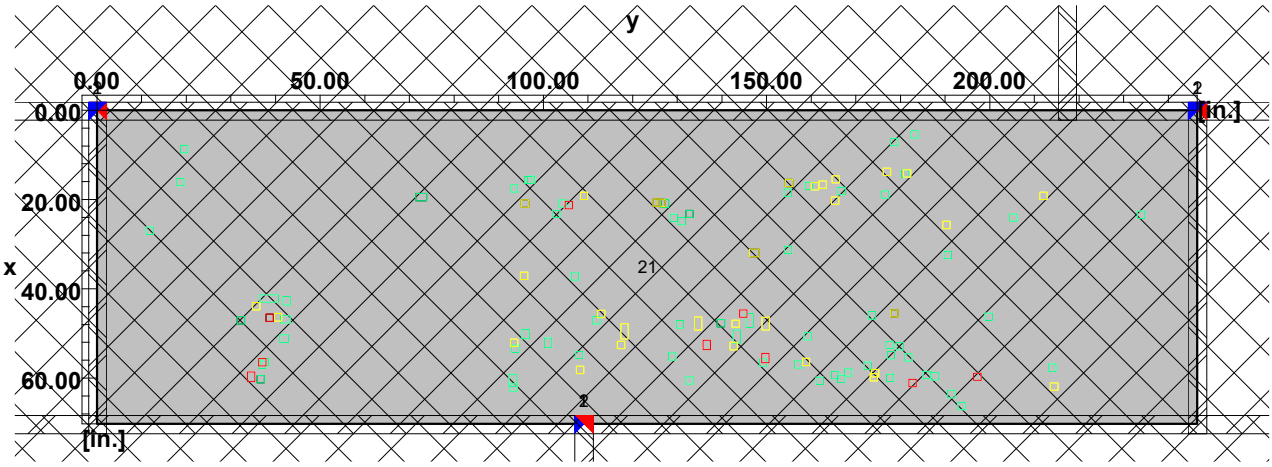

Replacement Plate/Patch List

No.	Angle to Y [°]
13	0
14	0
20	0
21	0
22	0
26	0
27	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 73 (1 of 2)

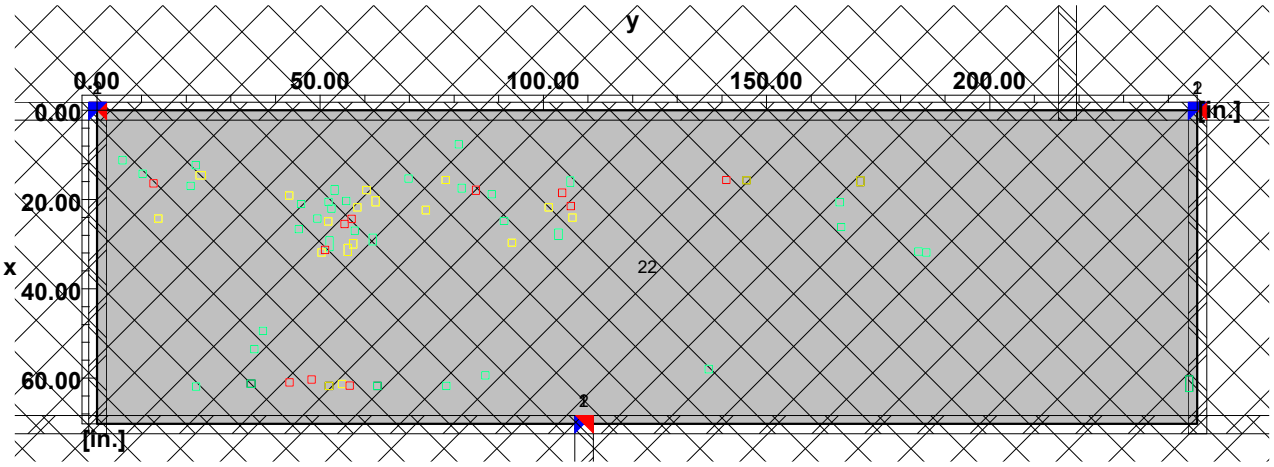

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
12	63	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
13	64	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
21	72	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
22	73	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
23	74	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
25	77	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
26	78	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 73 (2 of 2)

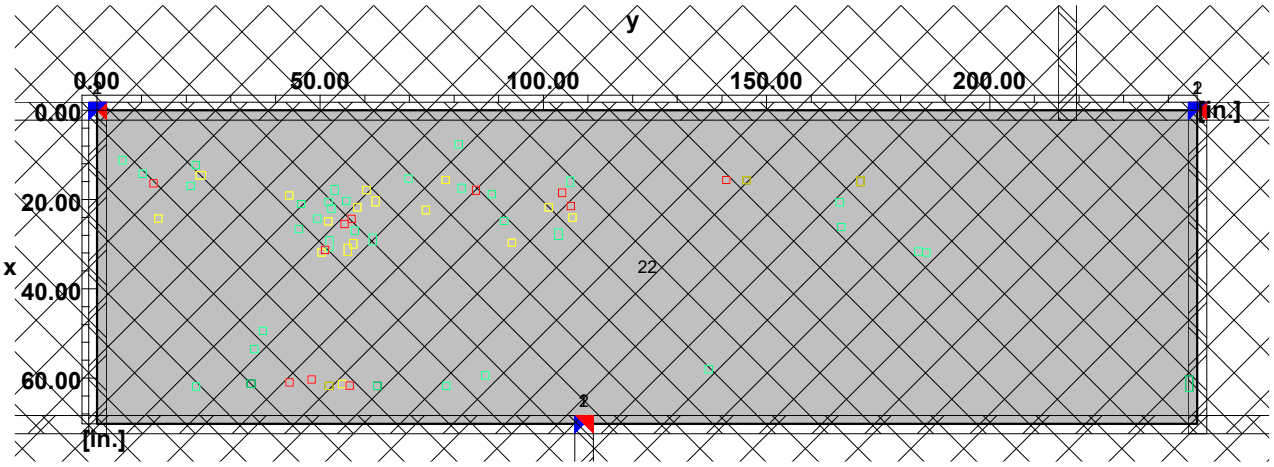

Replacement Plate/Patch List

No.	Angle to Y [°]
12	0
13	0
21	0
22	0
23	0
25	0
26	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 74 (1 of 2)

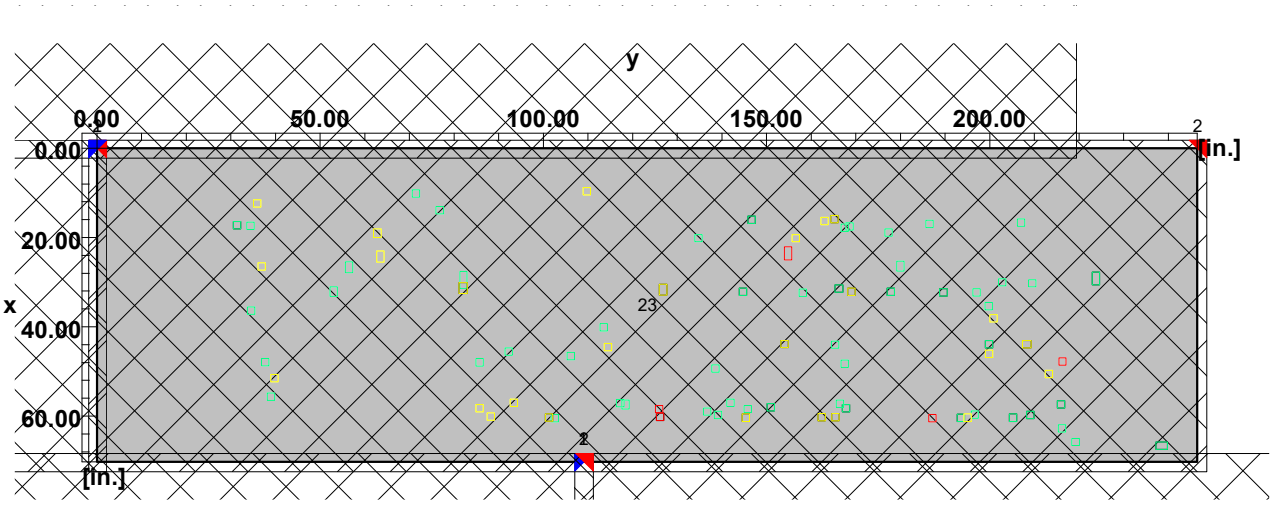

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
12	63	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
22	73	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
23	74	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
24	76	-1.93	-1.97	-1.93 (2.00)	174.06 (2.00)	75 (2.00)	177 (2.00)
25	77	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 74 (2 of 2)

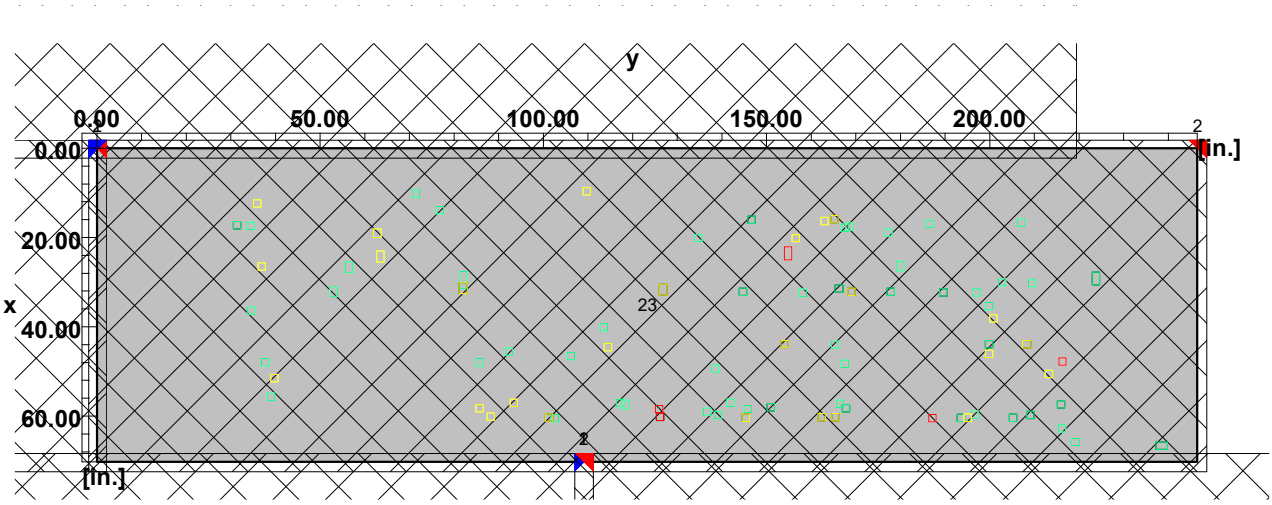

Replacement Plate/Patch List

No.	Angle to Y [°]
12	0
22	0
23	0
24	0
25	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 75 (1 of 2)

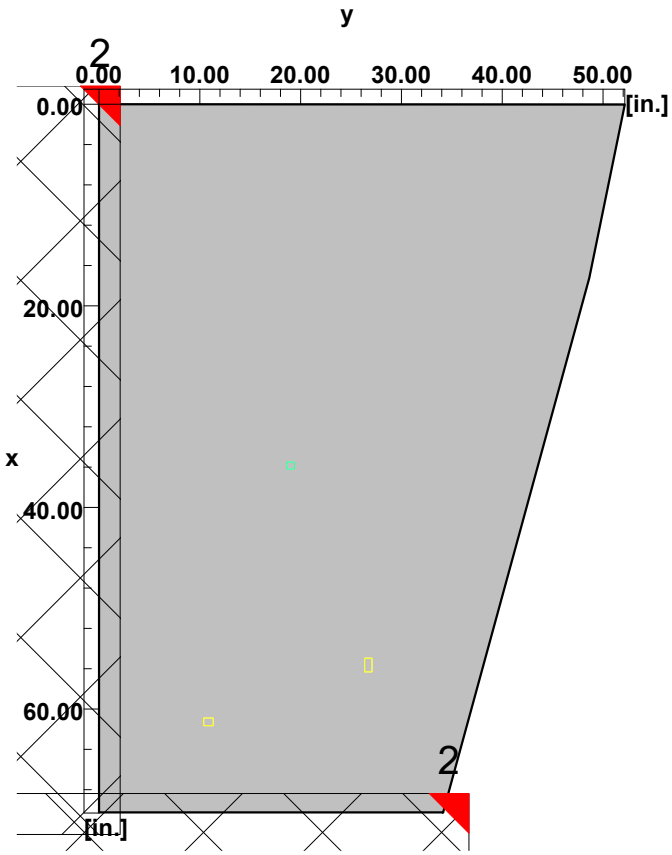

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
23	74	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
24	76	-1.93	-1.97	-1.93 (2.00)	174.06 (2.00)	75 (2.00)	177 (2.00)

Classification

Feature

0	20 %
1	40 %
2	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 75 (2 of 2)

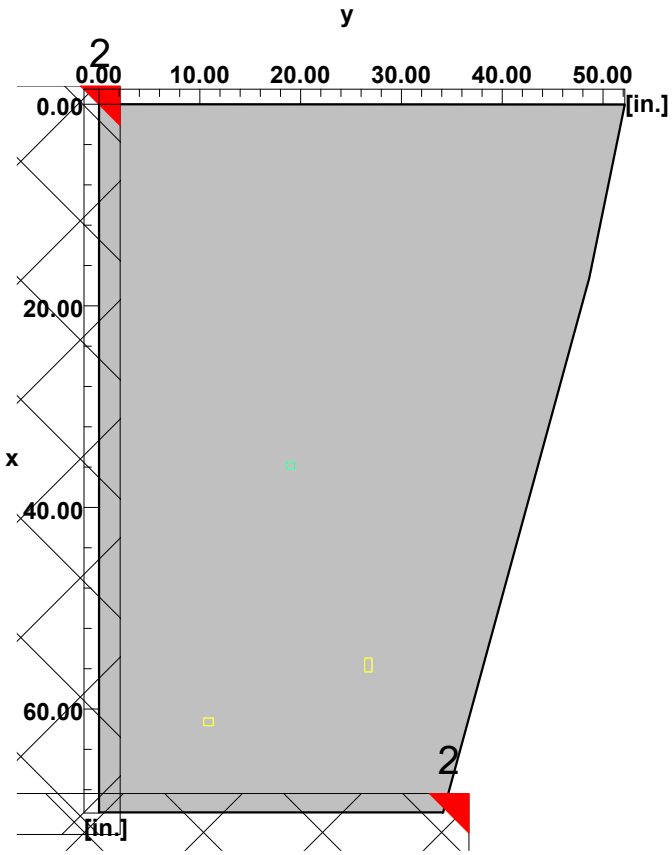

Replacement Plate/Patch List

No.	Angle to Y [°]
23	0
24	0

Classification

Feature

0	20 %
1	40 %
2	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 76 (1 of 2)

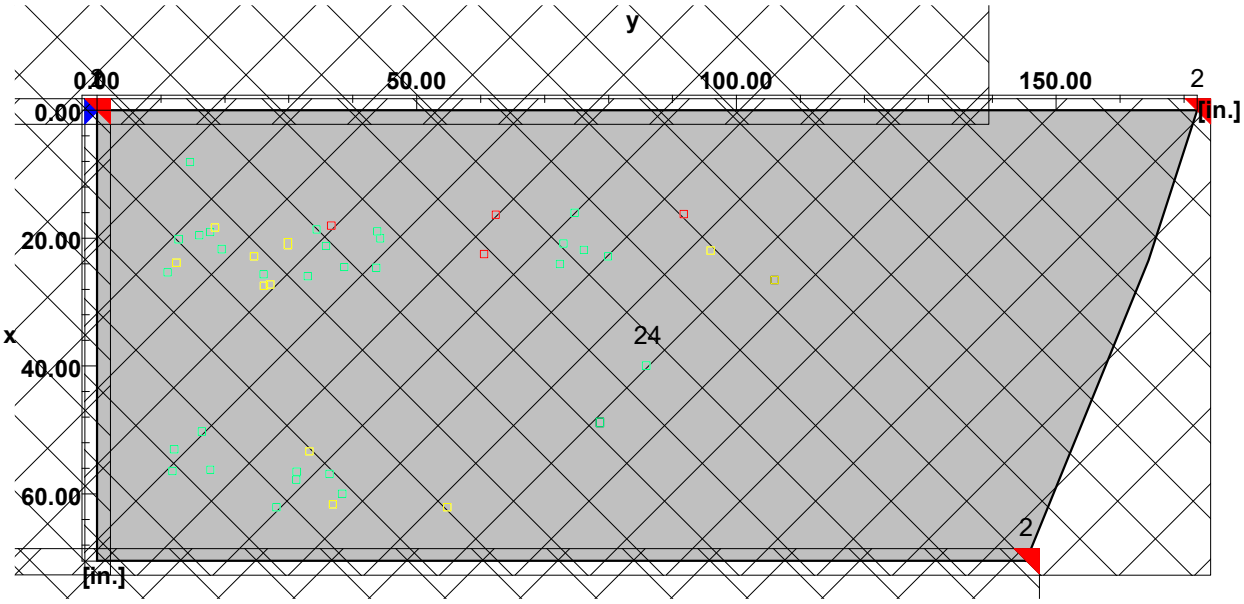

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
23	74	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
24	76	-1.93	-1.97	-1.93 (2.00)	174.06 (2.00)	75 (2.00)	177 (2.00)
25	77	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
35	87	-1.93	-1.97	-1.93 (2.00)	177.80 (2.00)	75 (2.00)	180 (2.00)

Classification

Feature

0 20 %
0 40 %
0 60 %
0 80 %
0 100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 177.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 76 (2 of 2)

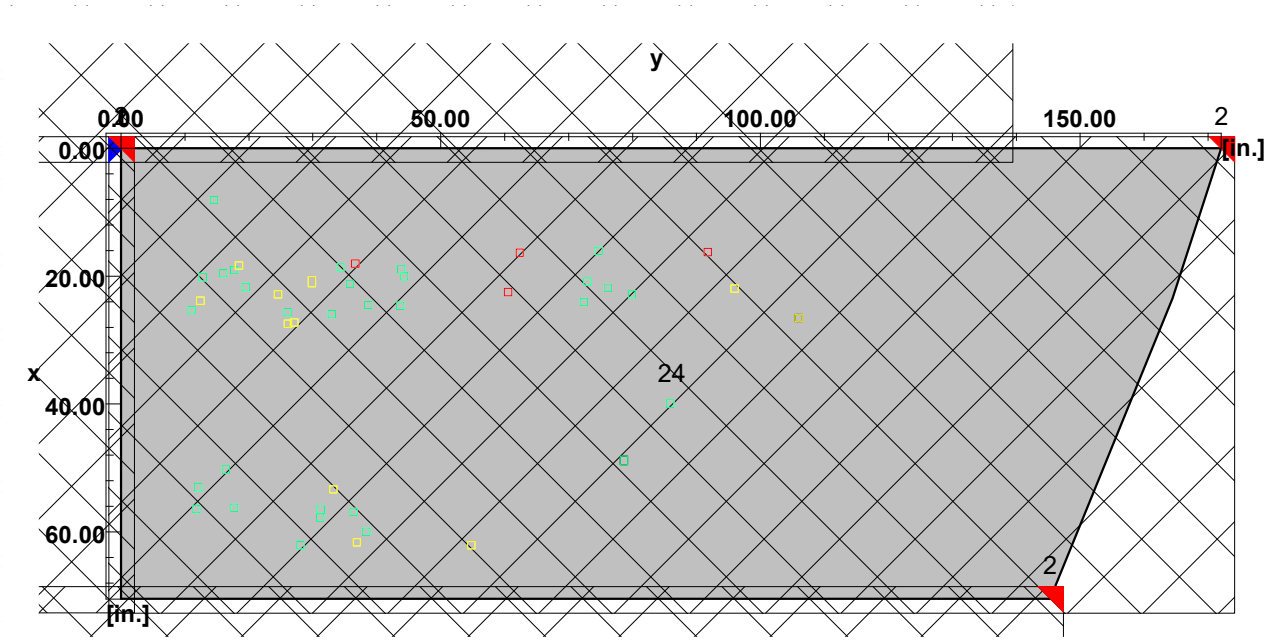

Replacement Plate/Patch List

No.	Angle to Y [°]
23	0
24	0
25	0
35	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 177.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 77 (1 of 2)

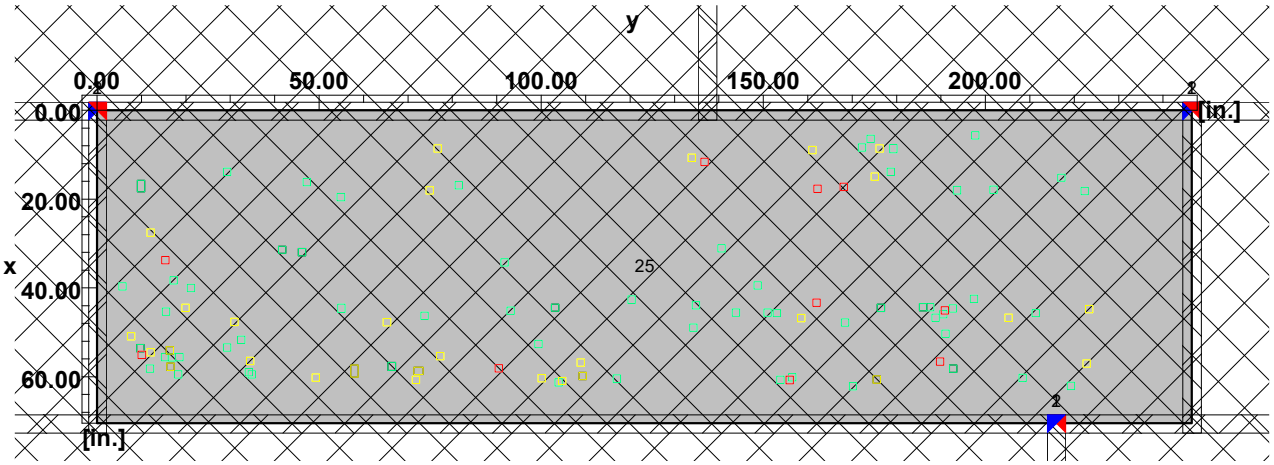

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
22	73	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
23	74	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
24	76	-1.93	-1.97	-1.93 (2.00)	174.06 (2.00)	75 (2.00)	177 (2.00)
25	77	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
26	78	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
34	86	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
35	87	-1.93	-1.97	-1.93 (2.00)	177.80 (2.00)	75 (2.00)	180 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 77 (2 of 2)

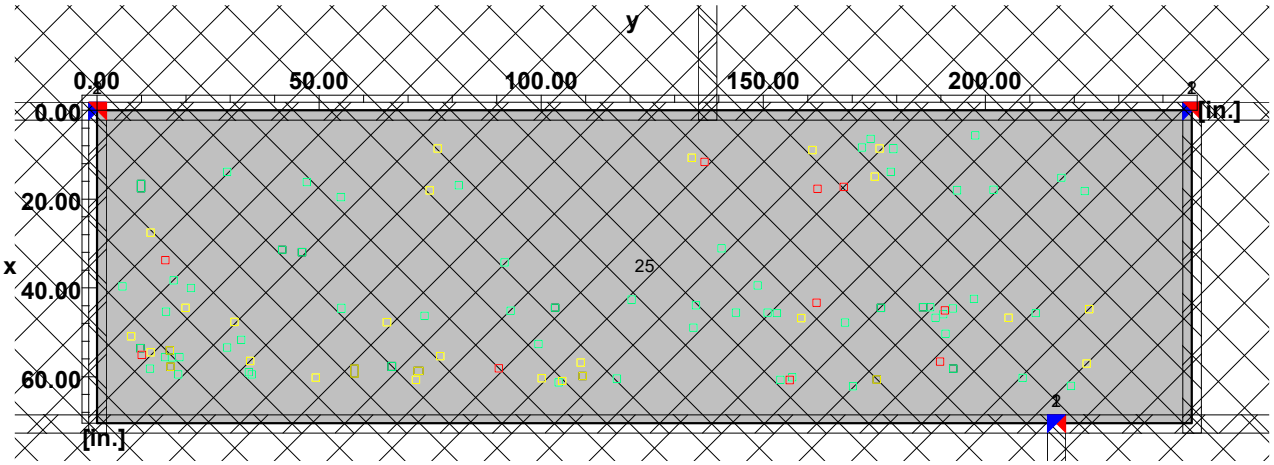

Replacement Plate/Patch List

No.	Angle to Y [°]
22	0
23	0
24	0
25	0
26	0
34	0
35	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 78 (1 of 2)

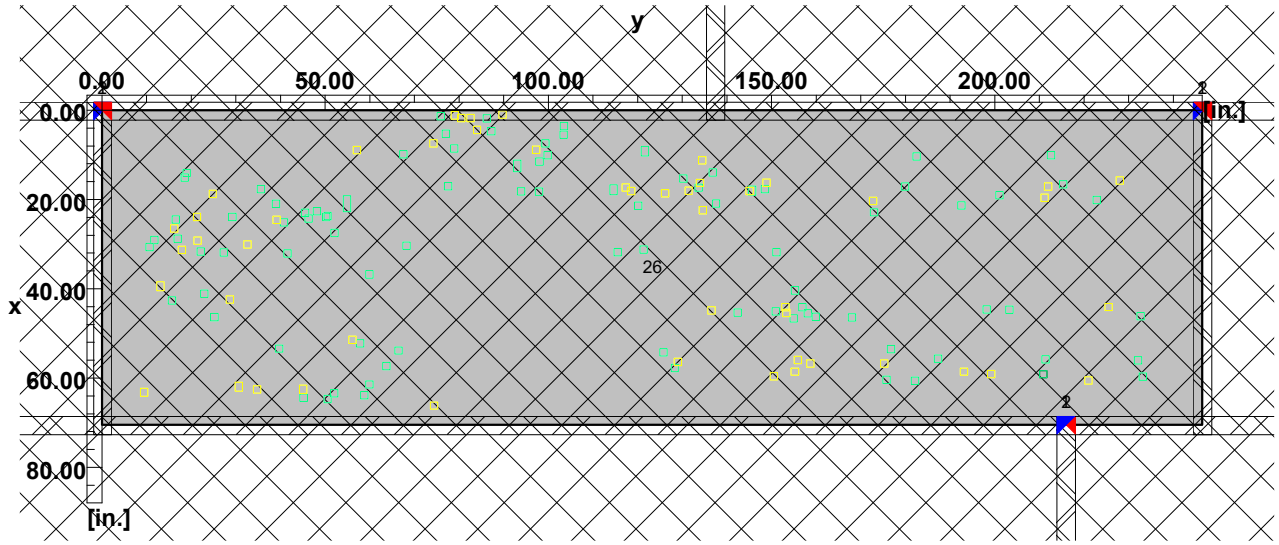

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
21	72	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
22	73	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
25	77	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
26	78	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
27	79	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
33	85	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
34	86	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 78 (2 of 2)

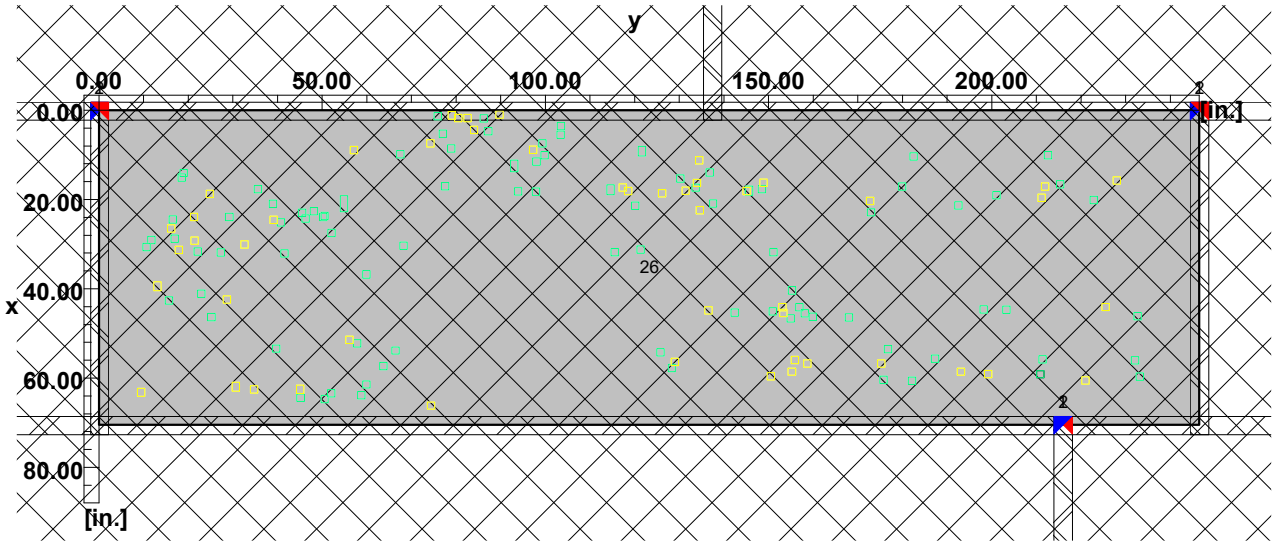

Replacement Plate/Patch List

No.	Angle to Y [°]
21	0
22	0
25	0
26	0
27	0
33	0
34	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 79 (1 of 2)

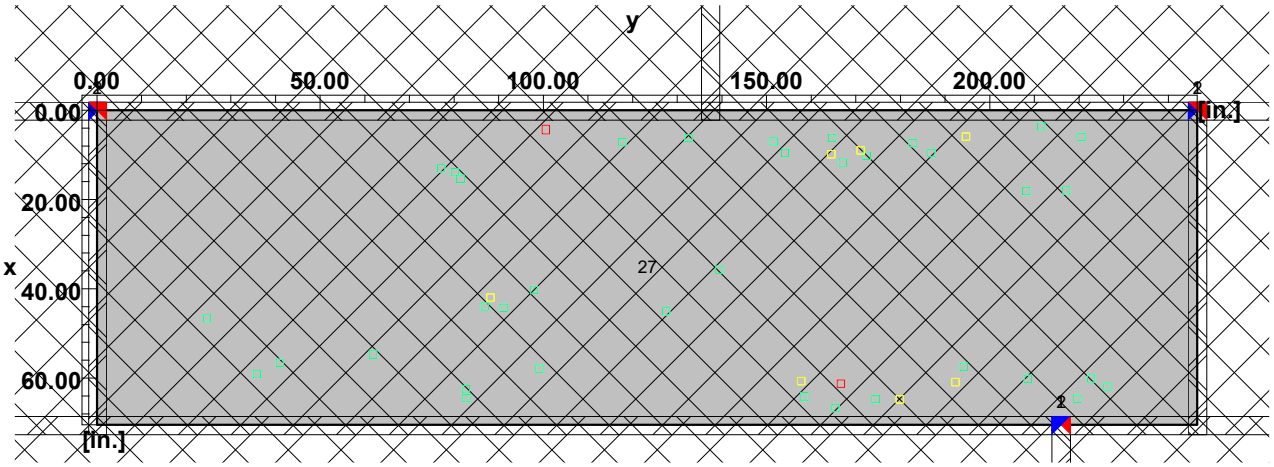

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
20	71	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
21	72	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
26	78	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
27	79	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
28	80	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
32	84	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
33	85	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 79 (2 of 2)

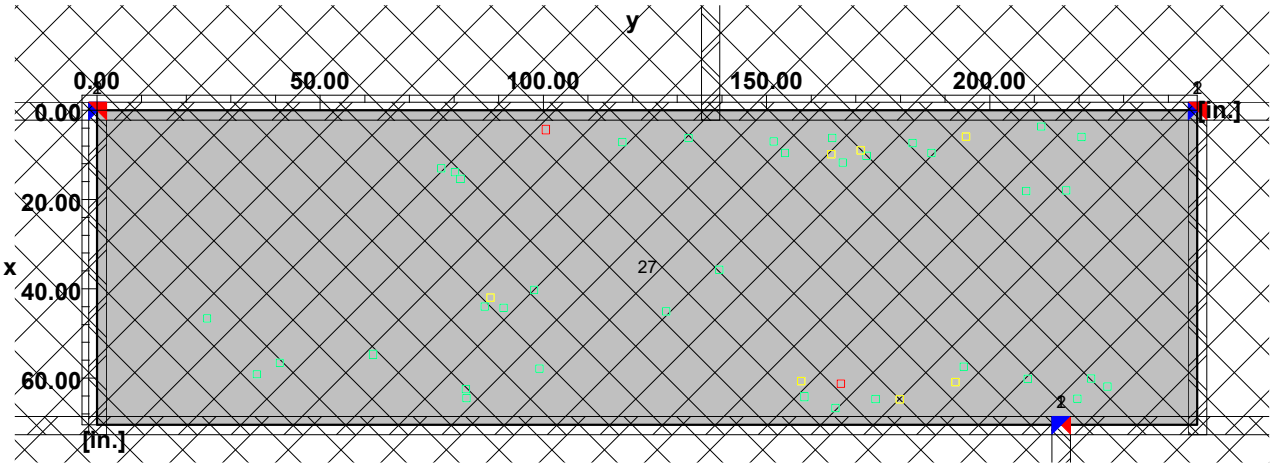

Replacement Plate/Patch List

No.	Angle to Y [°]
20	0
21	0
26	0
27	0
28	0
32	0
33	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 80 (1 of 2)

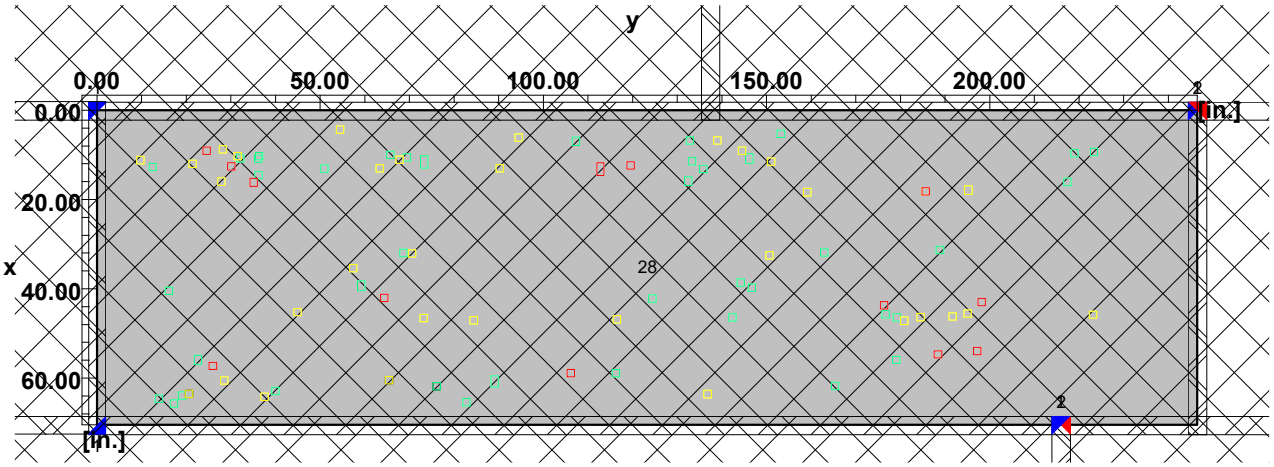

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
19	70	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
20	71	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
27	79	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
28	80	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
29	81	-2.01	-1.97	-2.01 (2.00)	175.24 (2.00)	75 (2.00)	178 (2.00)
31	83	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
32	84	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 80 (2 of 2)

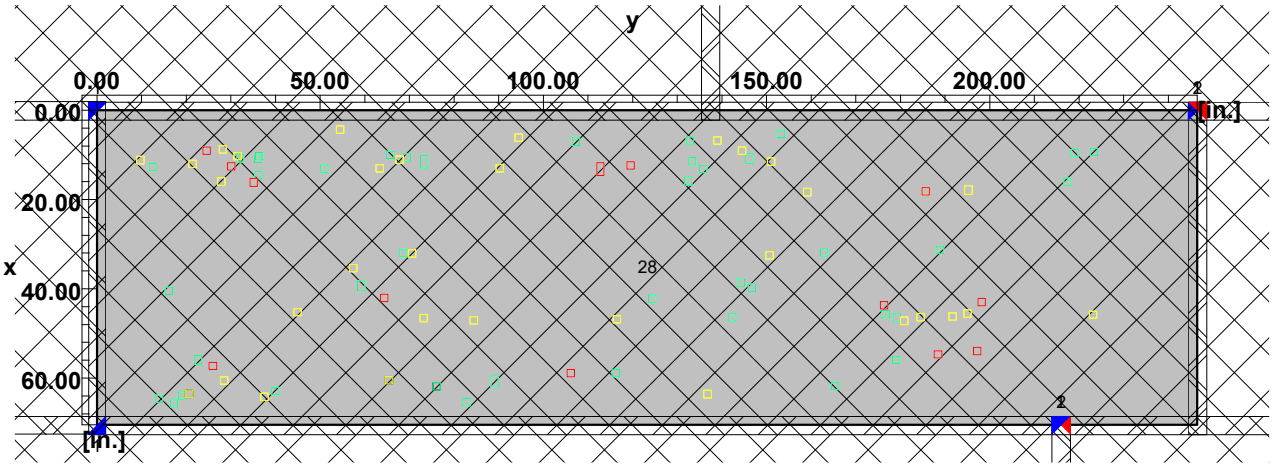

Replacement Plate/Patch List

No.	Angle to Y [°]
19	0
20	0
27	0
28	0
29	180
31	0
32	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 81 (1 of 2)

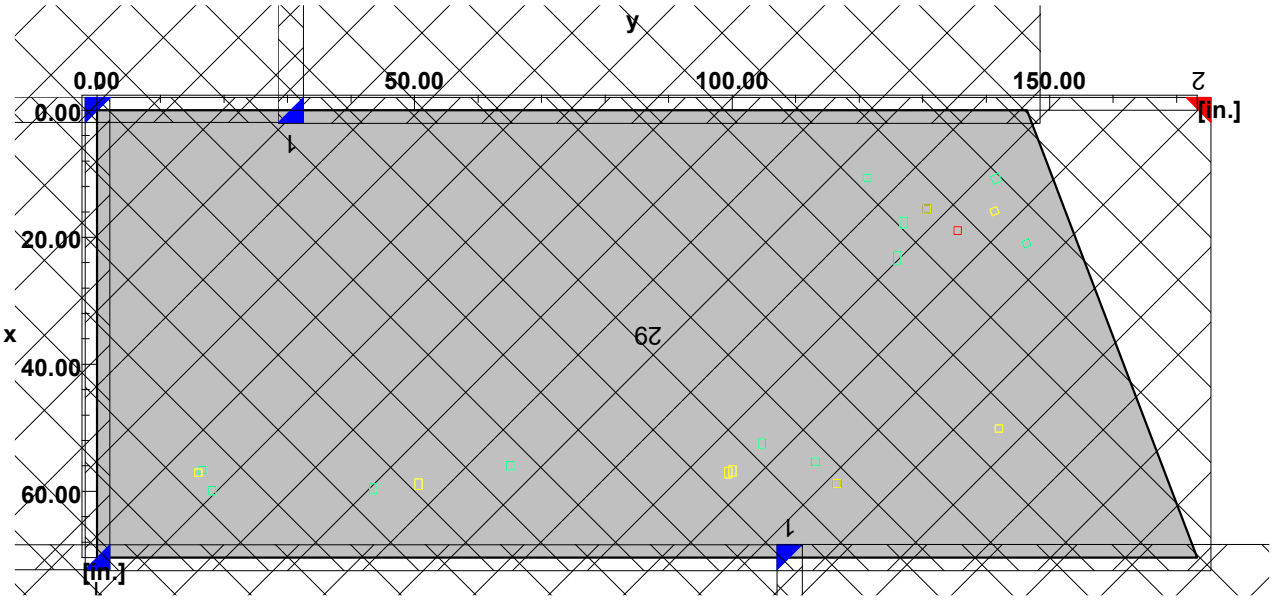

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
18	69	-2.01	-1.97	-2.01 (2.00)	84.69 (2.00)	75 (2.00)	87 (2.00)
19	70	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
28	80	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
29	81	-2.01	-1.97	-2.01 (2.00)	175.24 (2.00)	75 (2.00)	178 (2.00)
30	82	-2.01	-1.97	-2.01 (2.00)	117.95 (2.00)	75 (2.00)	120 (2.00)
31	83	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 178.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 81 (2 of 2)

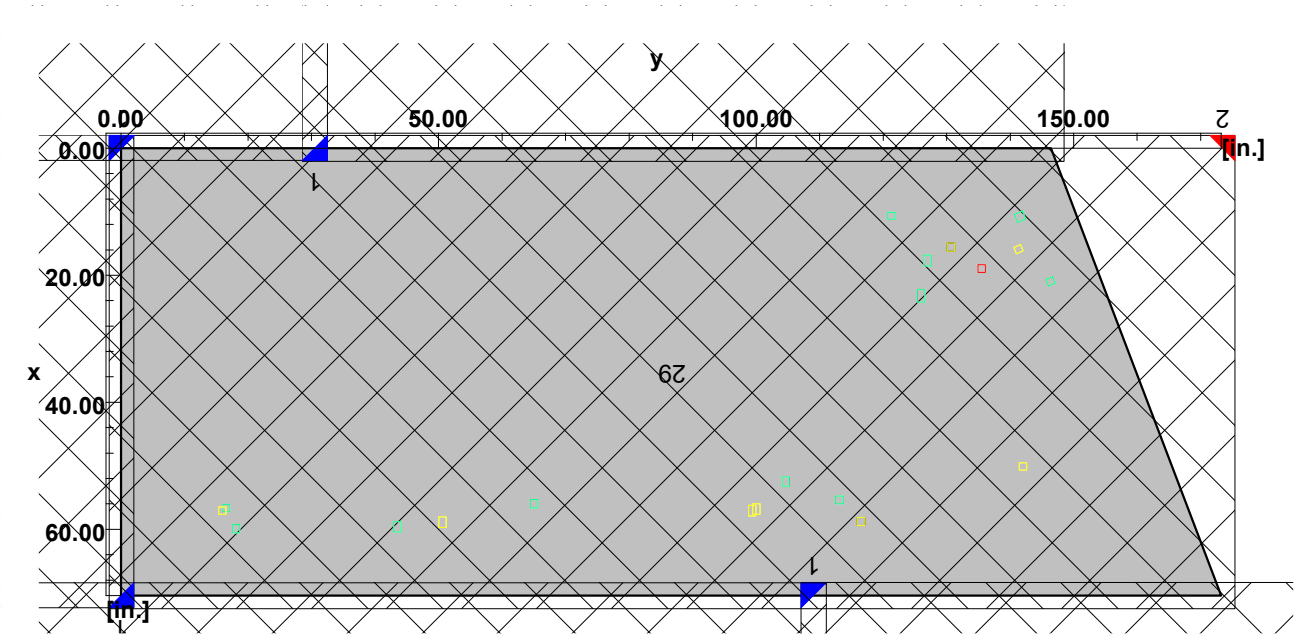

Replacement Plate/Patch List

No.	Angle to Y [°]
18	0
19	180
28	180
29	0
30	0
31	180

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 178.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 82 (1 of 2)

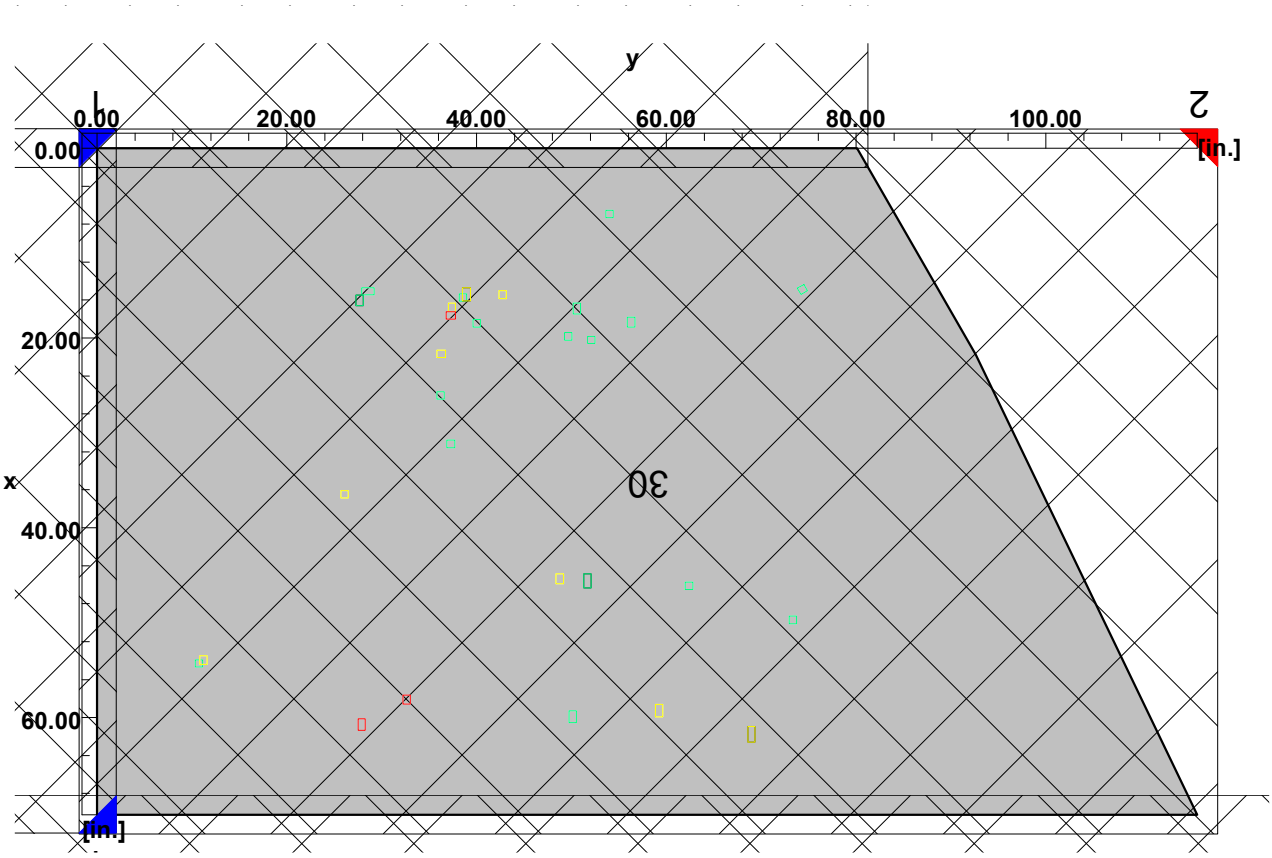

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
29	81	-2.01	-1.97	-2.01 (2.00)	175.24 (2.00)	75 (2.00)	178 (2.00)
30	82	-2.01	-1.97	-2.01 (2.00)	117.95 (2.00)	75 (2.00)	120 (2.00)
31	83	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
40	93	-2.01	-1.97	-2.01 (2.00)	112.83 (2.00)	75 (2.00)	115 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 120.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 82 (2 of 2)

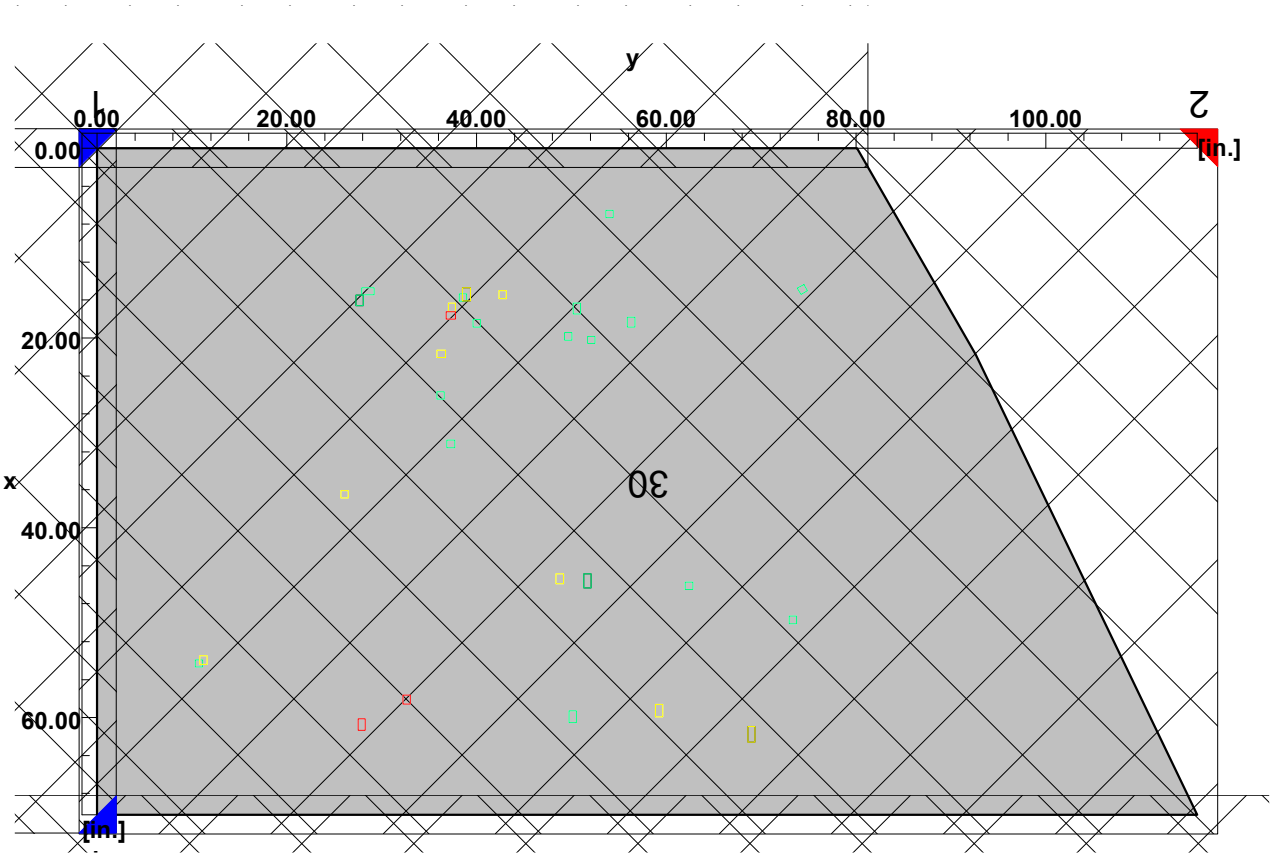

Replacement Plate/Patch List

No.	Angle to Y [°]
29	0
30	0
31	180
40	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 120.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 83 (1 of 2)

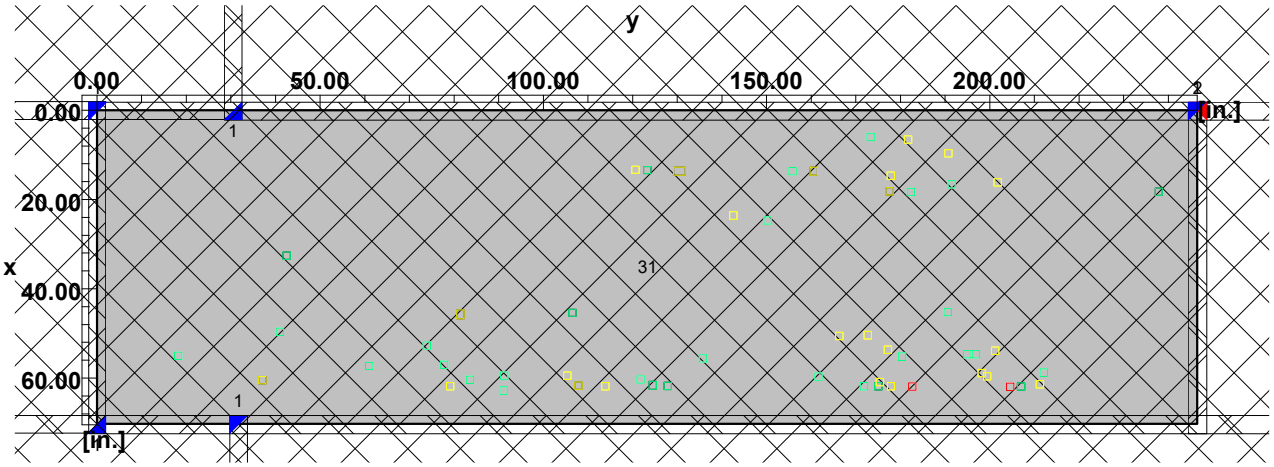

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
28	80	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
29	81	-2.01	-1.97	-2.01 (2.00)	175.24 (2.00)	75 (2.00)	178 (2.00)
30	82	-2.01	-1.97	-2.01 (2.00)	117.95 (2.00)	75 (2.00)	120 (2.00)
31	83	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
32	84	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
39	92	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
40	93	-2.01	-1.97	-2.01 (2.00)	112.83 (2.00)	75 (2.00)	115 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 83 (2 of 2)

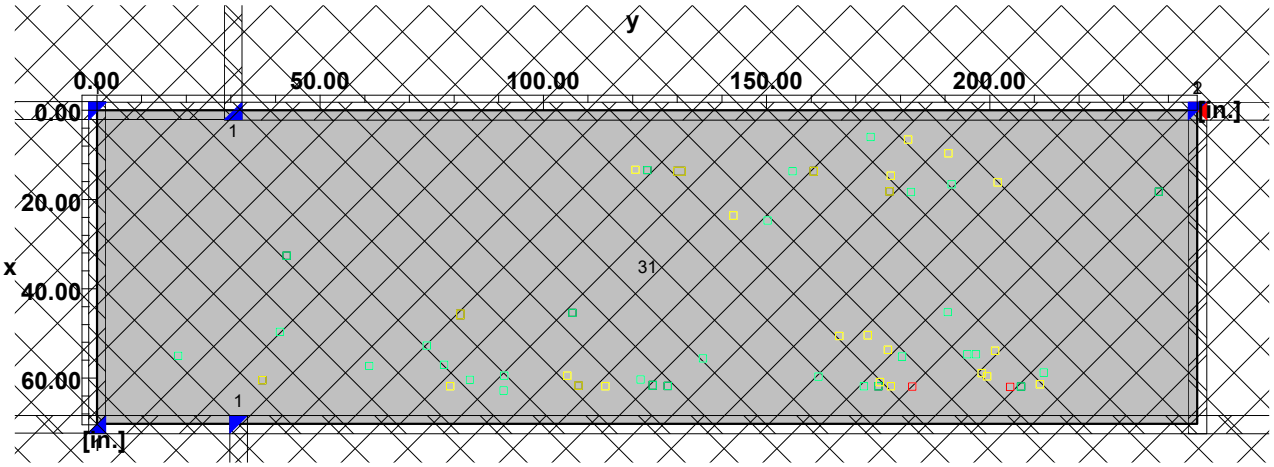

Replacement Plate/Patch List

No.	Angle to Y [°]
28	0
29	180
30	180
31	0
32	0
39	0
40	180

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 84 (1 of 2)

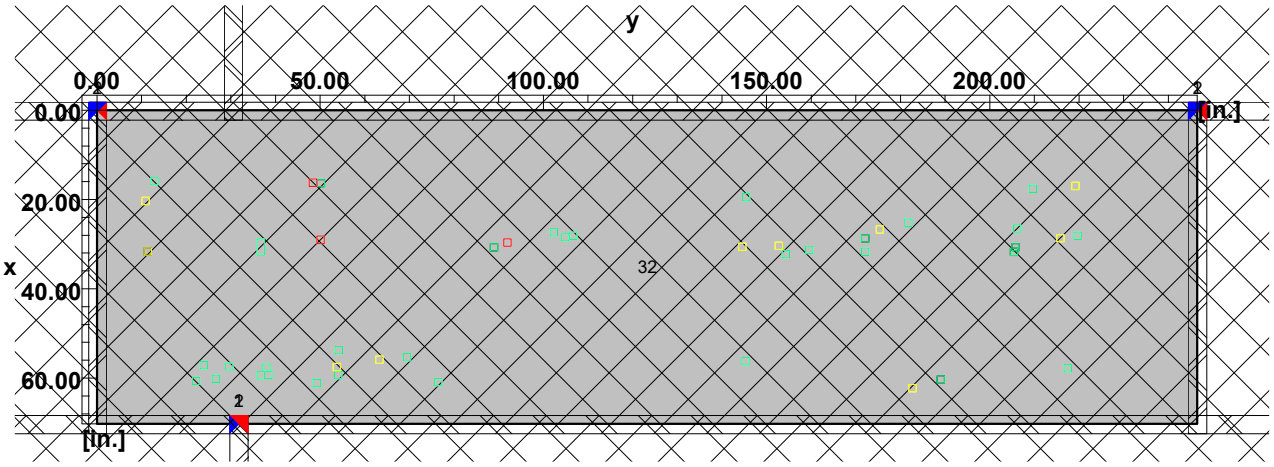

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
27	79	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
28	80	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
31	83	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
32	84	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
33	85	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
37	90	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
39	92	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 84 (2 of 2)

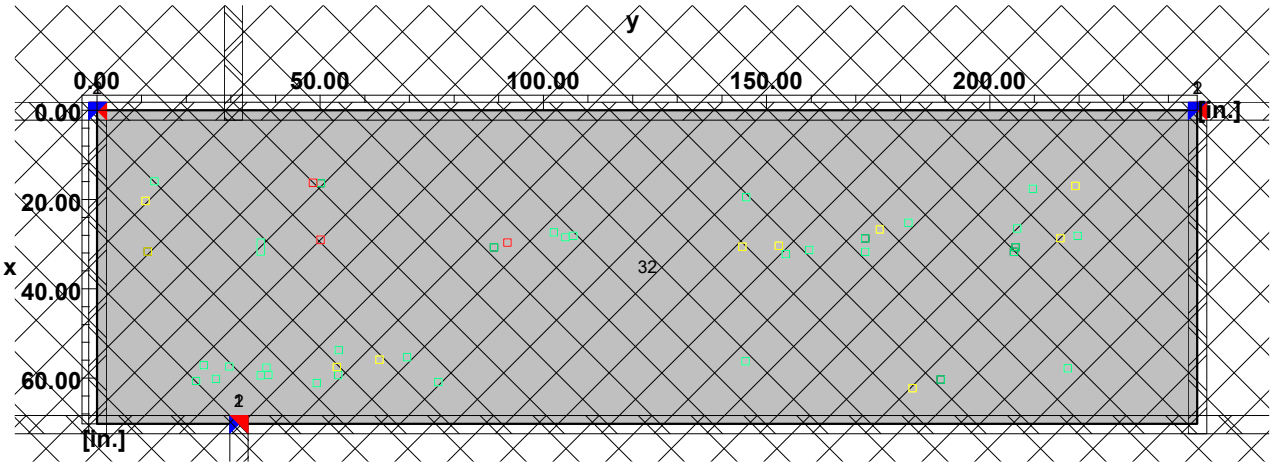

Replacement Plate/Patch List

No.	Angle to Y [°]
27	0
28	0
31	0
32	0
33	0
37	0
39	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 85 (1 of 2)

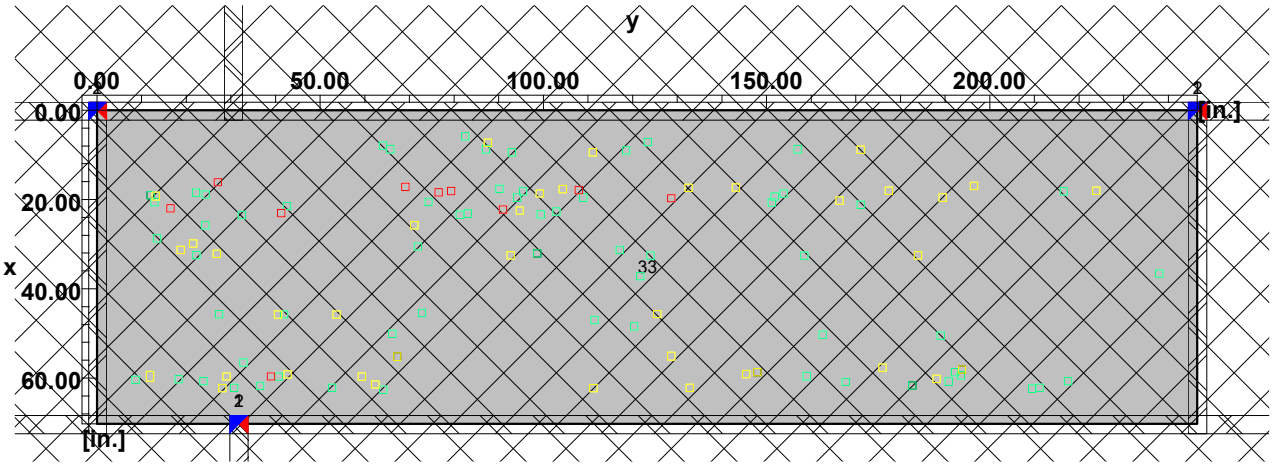

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
26	78	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
27	79	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
32	84	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
33	85	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
34	86	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
37	90	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
38	91	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 85 (2 of 2)

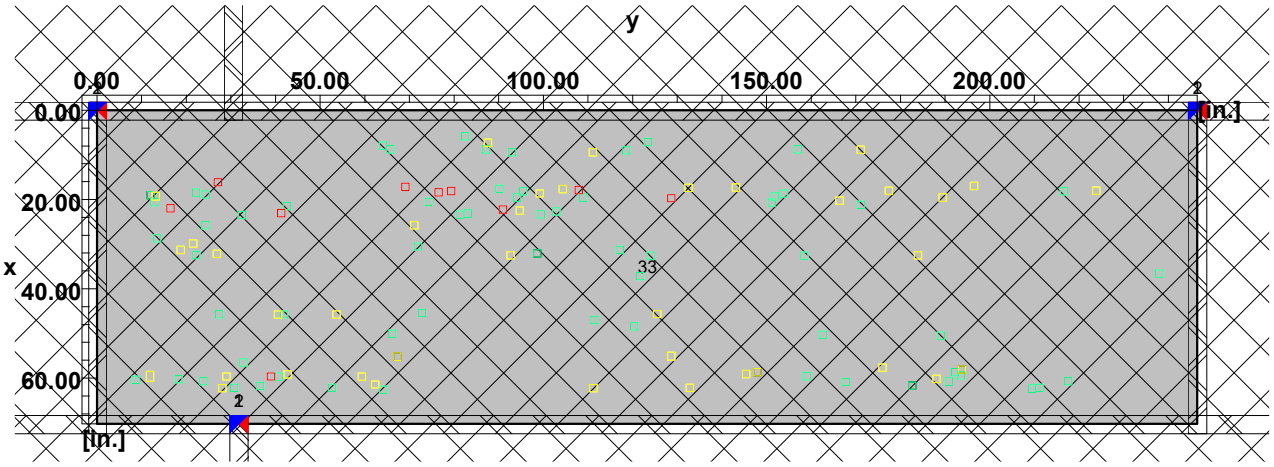

Replacement Plate/Patch List

No.	Angle to Y [°]
26	0
27	0
32	0
33	0
34	0
37	0
38	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 86 (1 of 2)

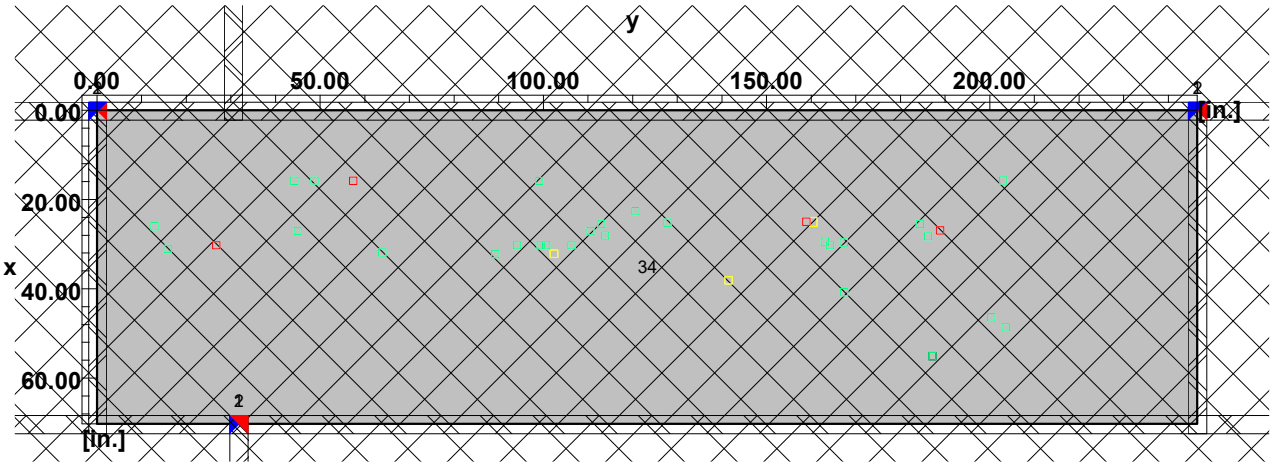

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
25	77	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
26	78	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
33	85	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
34	86	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
35	87	-1.93	-1.97	-1.93 (2.00)	177.80 (2.00)	75 (2.00)	180 (2.00)
36	89	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
38	91	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 86 (2 of 2)

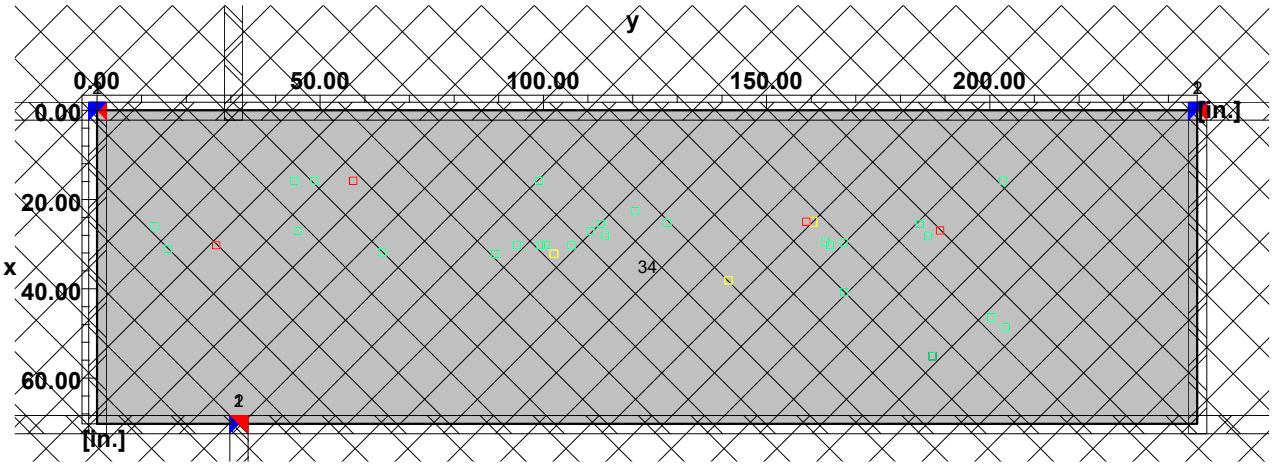

Replacement Plate/Patch List

No.	Angle to Y [°]
25	0
26	0
33	0
34	0
35	0
36	0
38	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 87 (1 of 2)

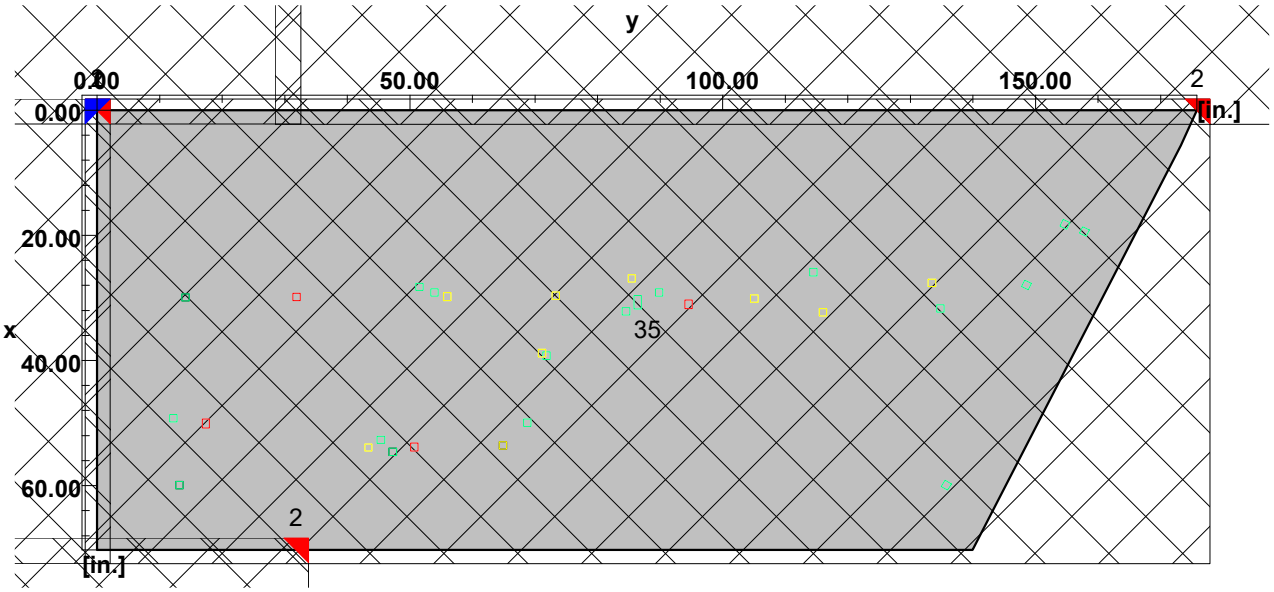

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
24	76	-1.93	-1.97	-1.93 (2.00)	174.06 (2.00)	75 (2.00)	177 (2.00)
25	77	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
34	86	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
35	87	-1.93	-1.97	-1.93 (2.00)	177.80 (2.00)	75 (2.00)	180 (2.00)
36	89	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 180.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 87 (2 of 2)

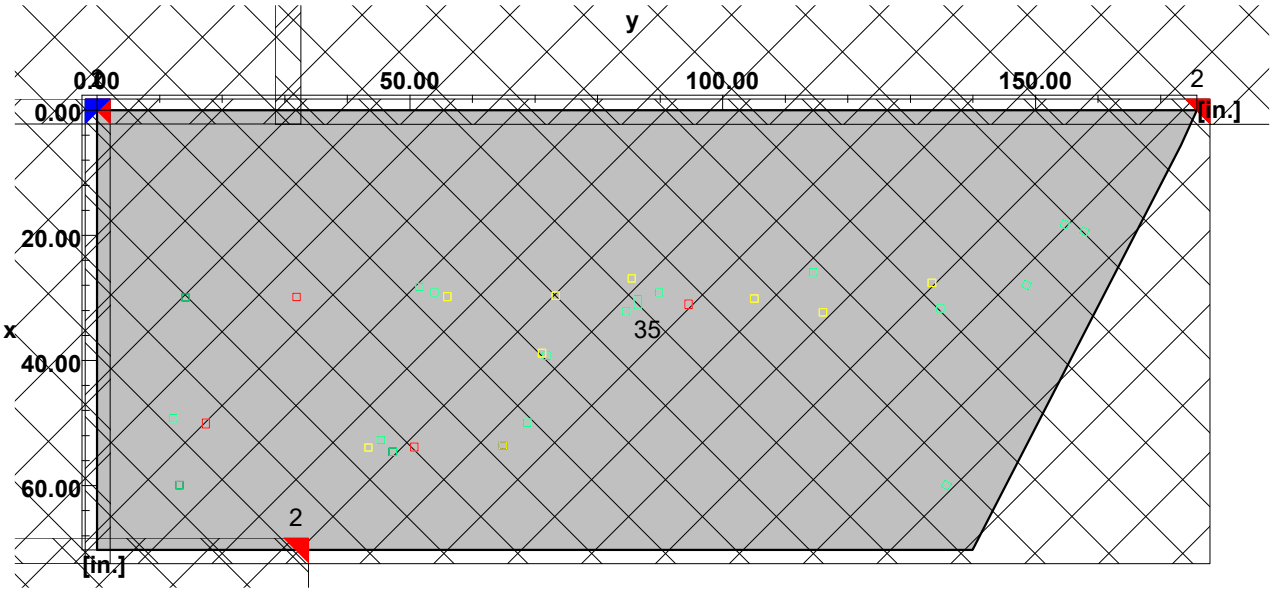

Replacement Plate/Patch List

No.	Angle to Y [°]
24	0
25	0
34	0
35	0
36	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 180.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 88 (1 of 2)

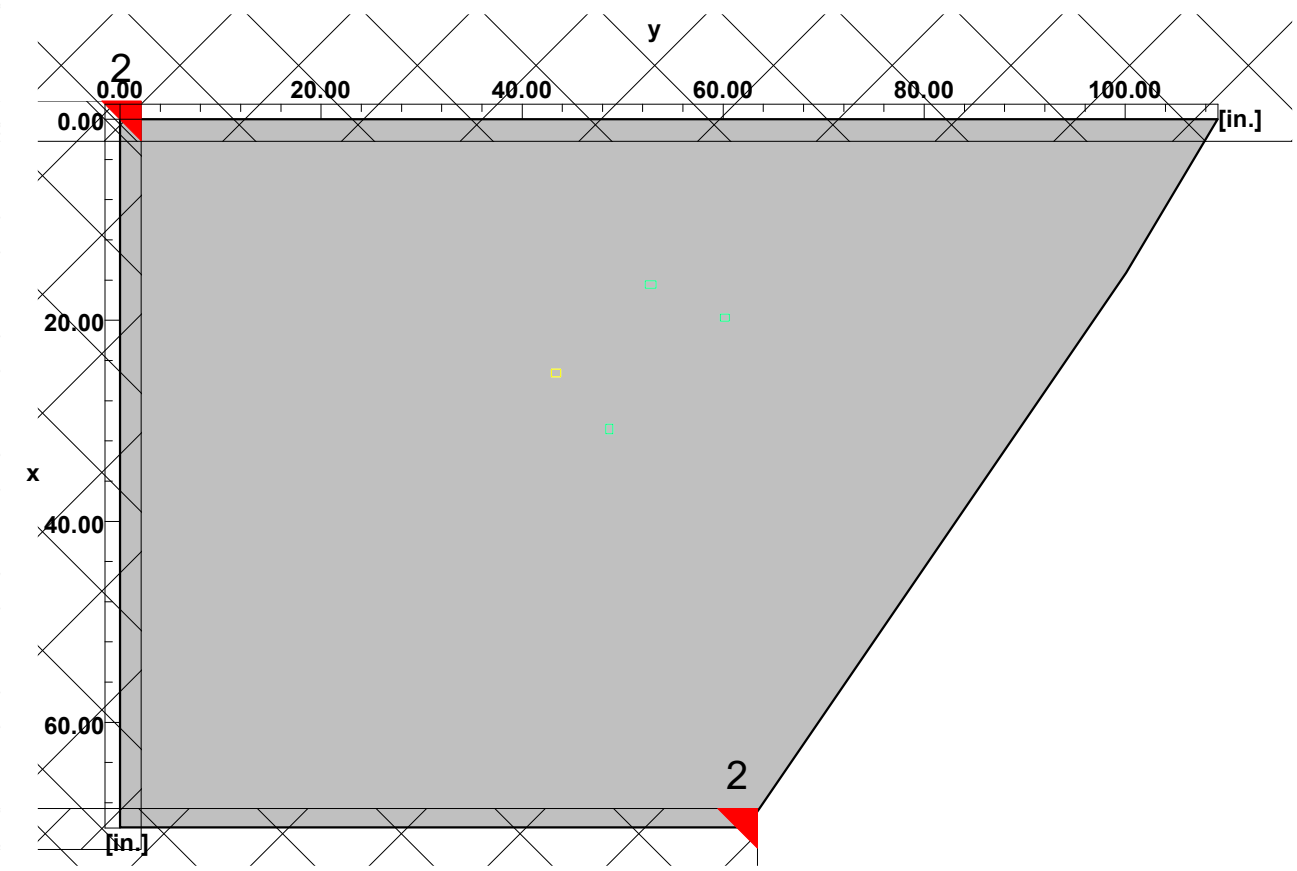

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
35	87	-1.93	-1.97	-1.93 (2.00)	177.80 (2.00)	75 (2.00)	180 (2.00)
36	89	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
45	98	-1.93	-1.97	-1.93 (2.00)	208.11 (2.00)	75 (2.00)	211 (2.00)

Classification

Feature

0	20 %
3	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 88 (2 of 2)

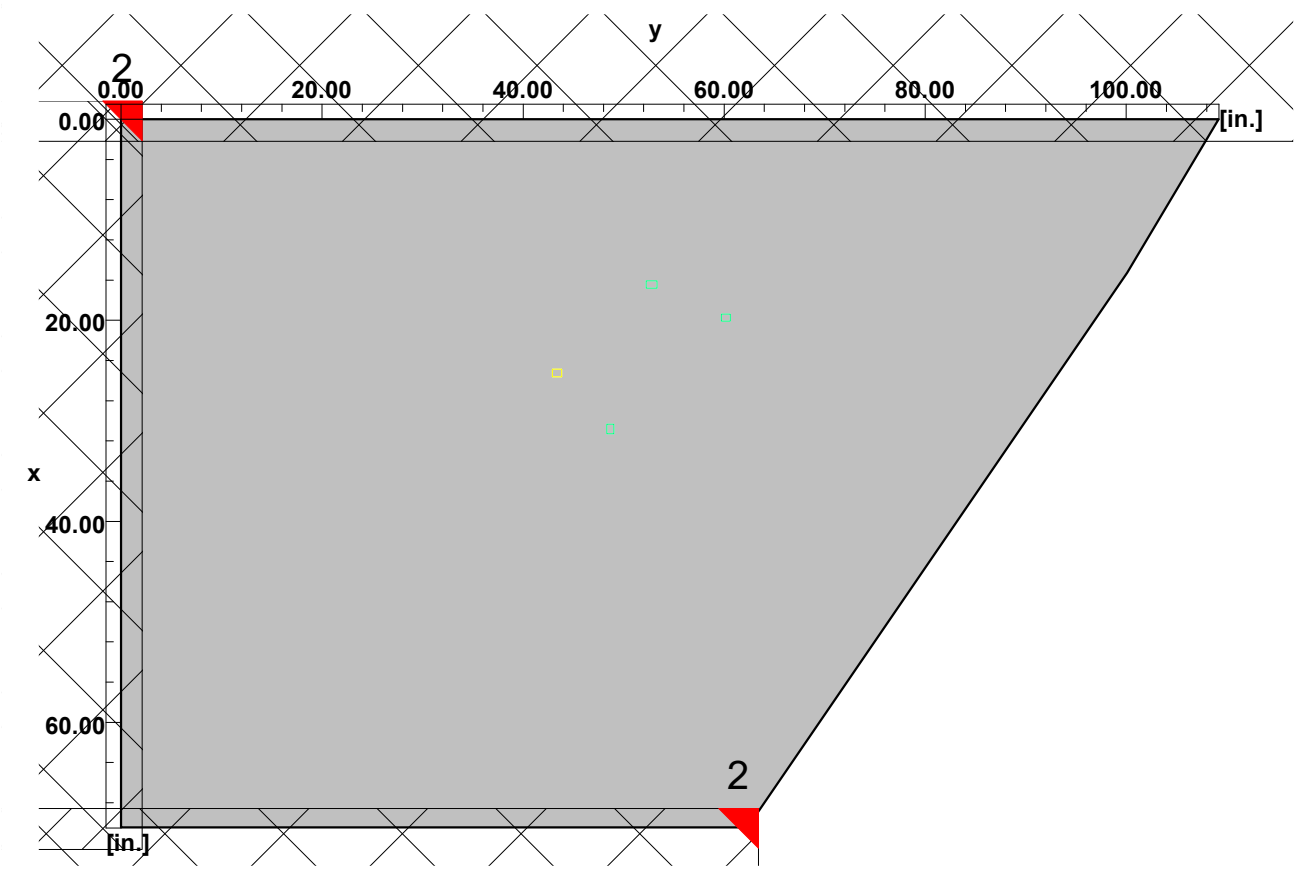

Replacement Plate/Patch List

No.	Angle to Y [°]
35	0
36	0
45	0

Classification

Feature

0	20 %
3	40 %
1	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 89 (1 of 2)

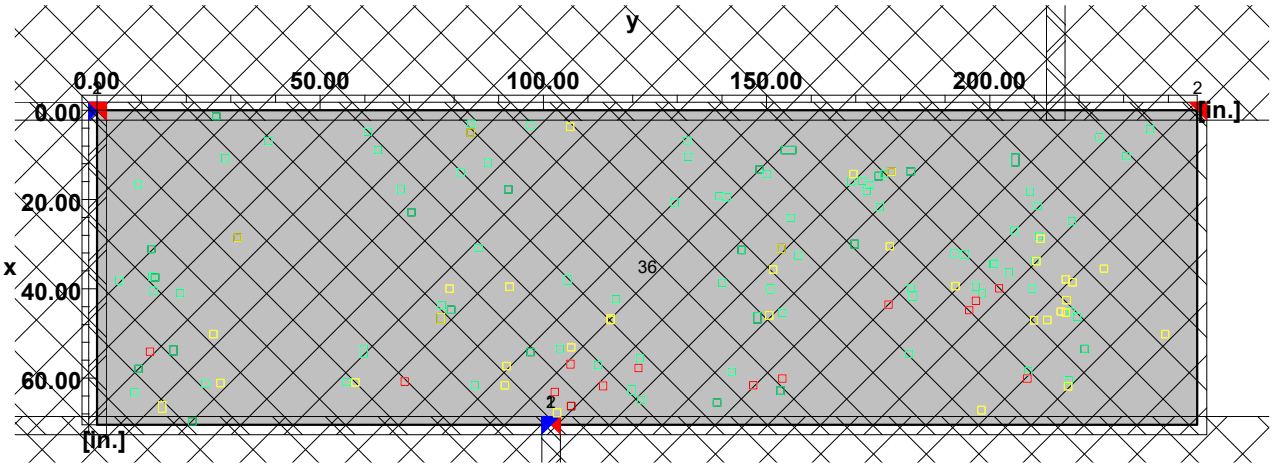

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
34	86	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
35	87	-1.93	-1.97	-1.93 (2.00)	177.80 (2.00)	75 (2.00)	180 (2.00)
36	89	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
38	91	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
44	97	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
45	98	-1.93	-1.97	-1.93 (2.00)	208.11 (2.00)	75 (2.00)	211 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 89 (2 of 2)

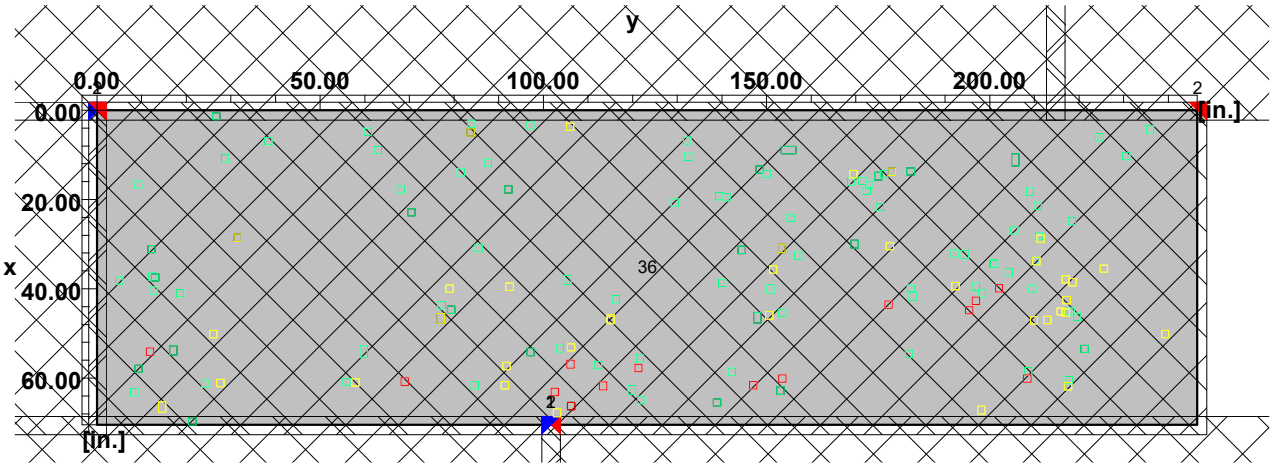

Replacement Plate/Patch List

No.	Angle to Y [°]
34	0
35	0
36	0
38	0
44	0
45	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 90 (1 of 2)

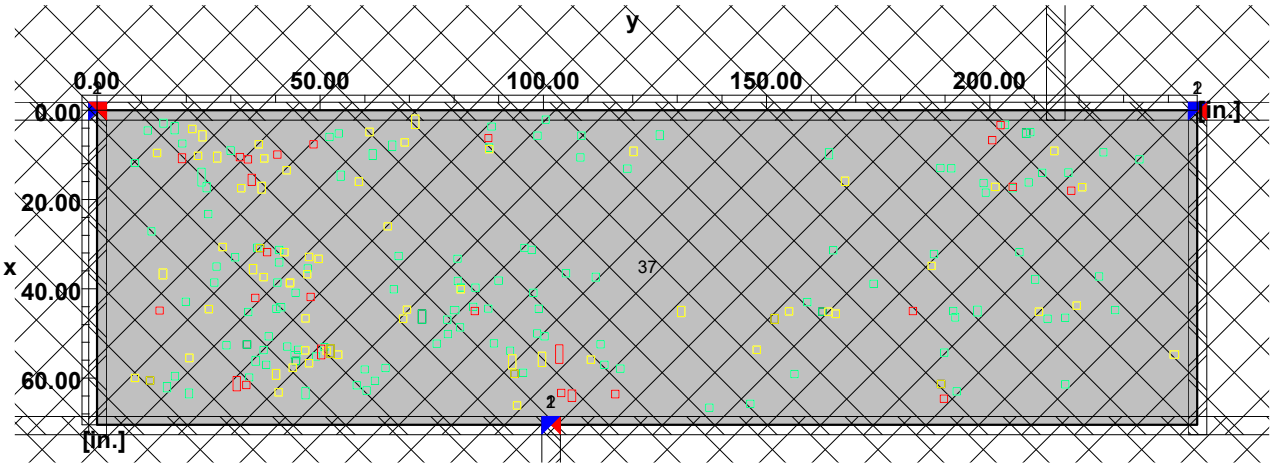

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
32	84	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
33	85	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
37	90	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
38	91	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
39	92	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
42	95	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
43	96	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 90 (2 of 2)

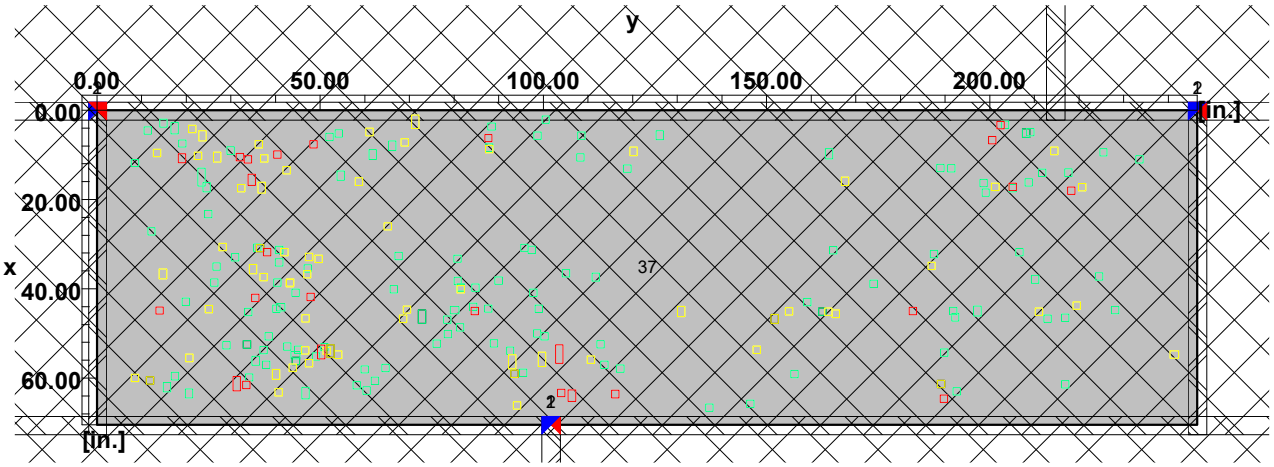

Replacement Plate/Patch List

No.	Angle to Y [°]
32	0
33	0
37	0
38	0
39	0
42	0
43	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 91 (1 of 2)

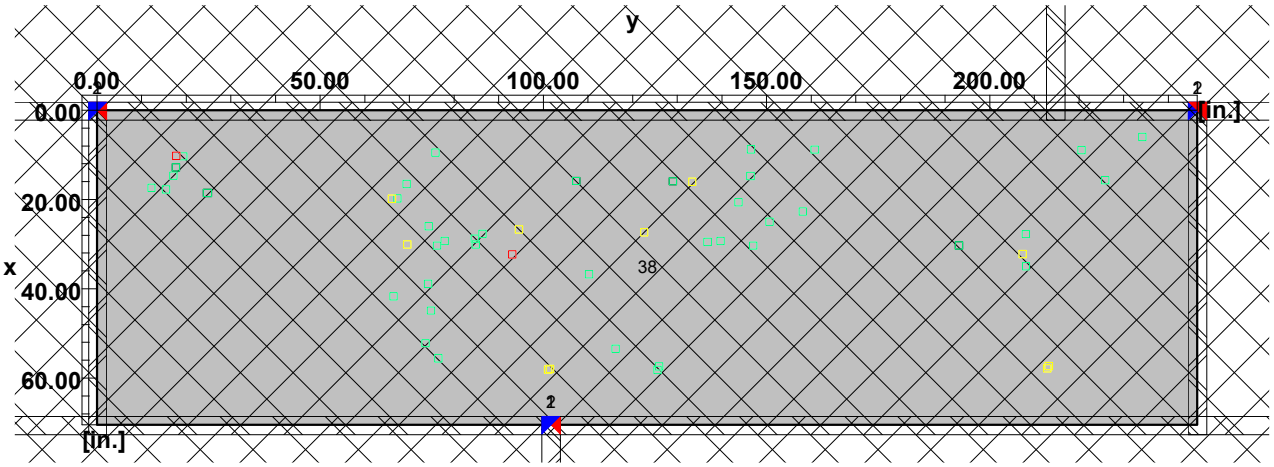

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
33	85	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
34	86	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
36	89	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
37	90	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
38	91	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
43	96	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
44	97	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 91 (2 of 2)

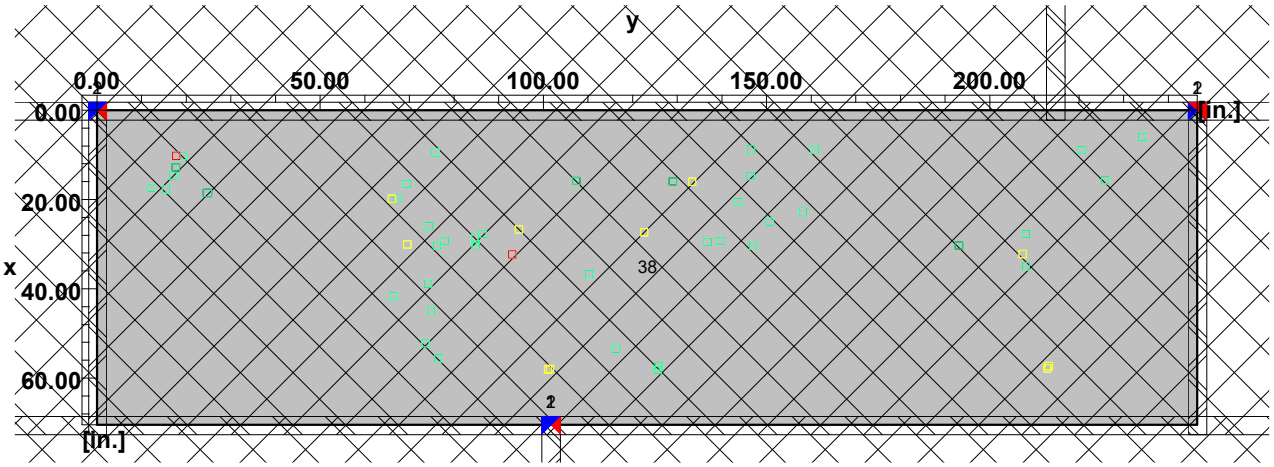

Replacement Plate/Patch List

No.	Angle to Y [°]
33	0
34	0
36	0
37	0
38	0
43	0
44	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 92 (1 of 2)

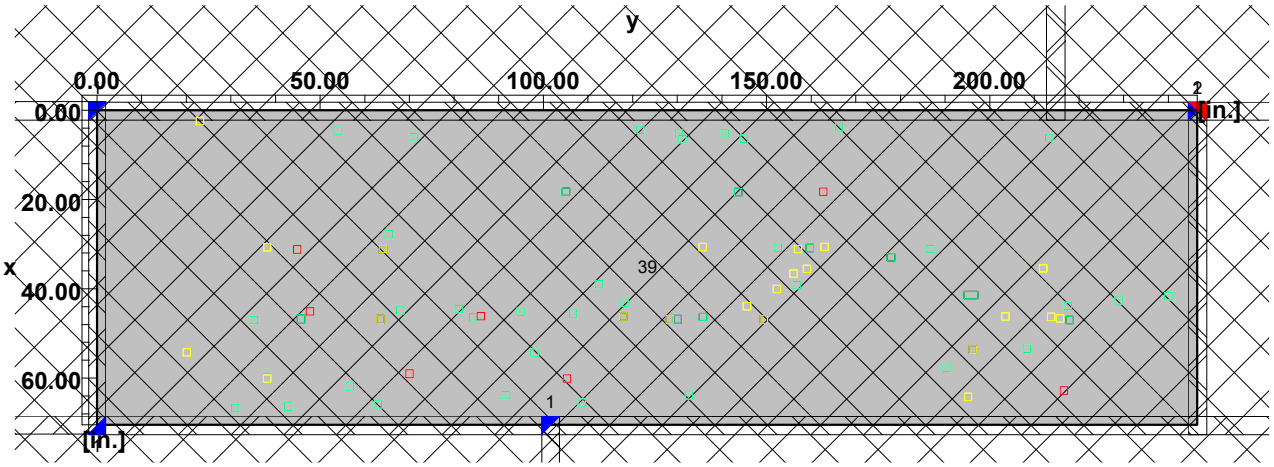

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
31	83	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
32	84	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
37	90	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
39	92	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
40	93	-2.01	-1.97	-2.01 (2.00)	112.83 (2.00)	75 (2.00)	115 (2.00)
41	94	-2.01	-1.97	-2.01 (2.00)	168.54 (2.00)	75 (2.00)	171 (2.00)
42	95	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 92 (2 of 2)

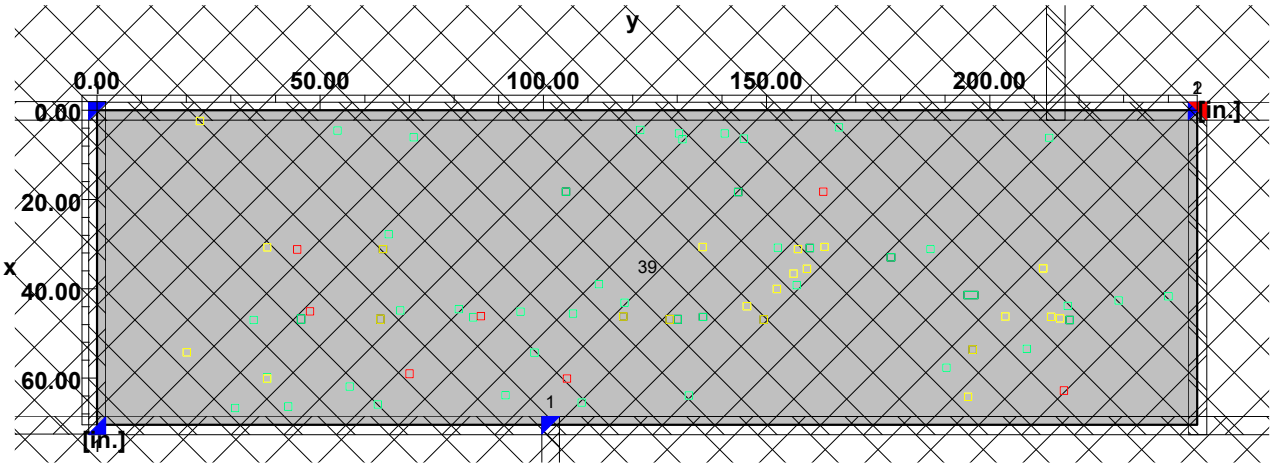

Replacement Plate/Patch List

No.	Angle to Y [°]
31	0
32	0
37	0
39	0
40	180
41	180
42	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 93 (1 of 4)

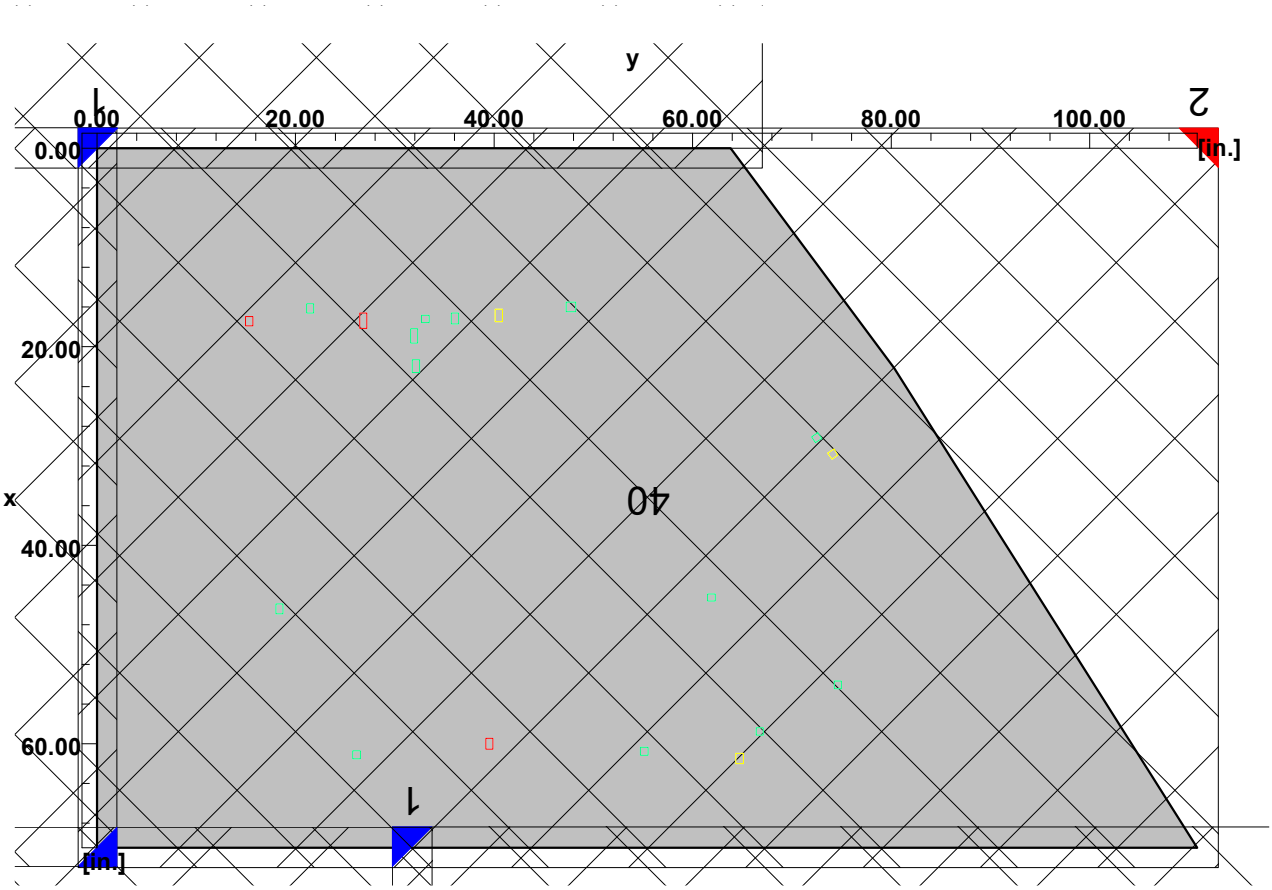

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
30	82	-2.01	-1.97	-2.01 (2.00)	117.95 (2.00)	75 (2.00)	120 (2.00)
31	83	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
39	92	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 115.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 93 (2 of 4)

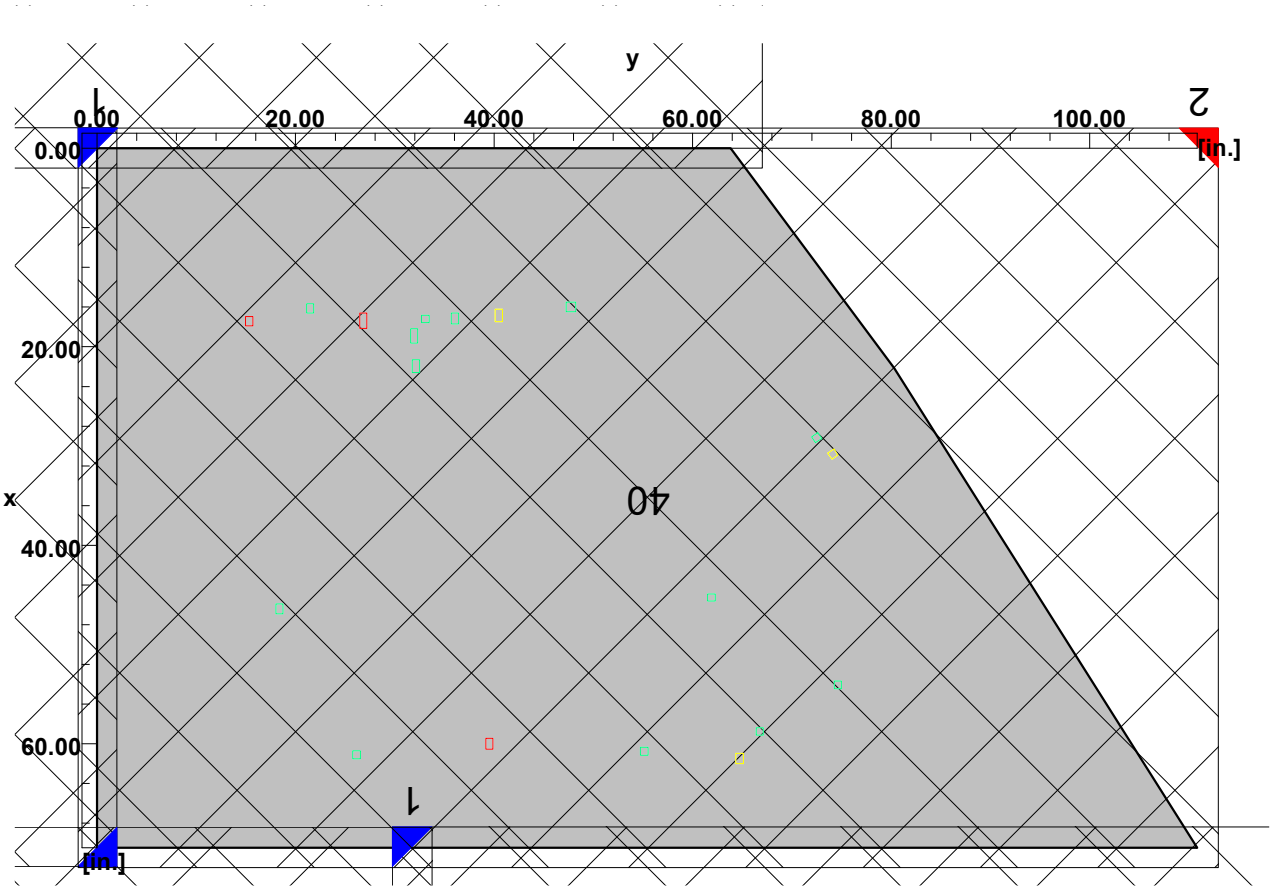

Replacement Plate/Patch List

No.	Angle to Y [°]
30	0
31	180
39	180

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 115.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 93 (3 of 4)

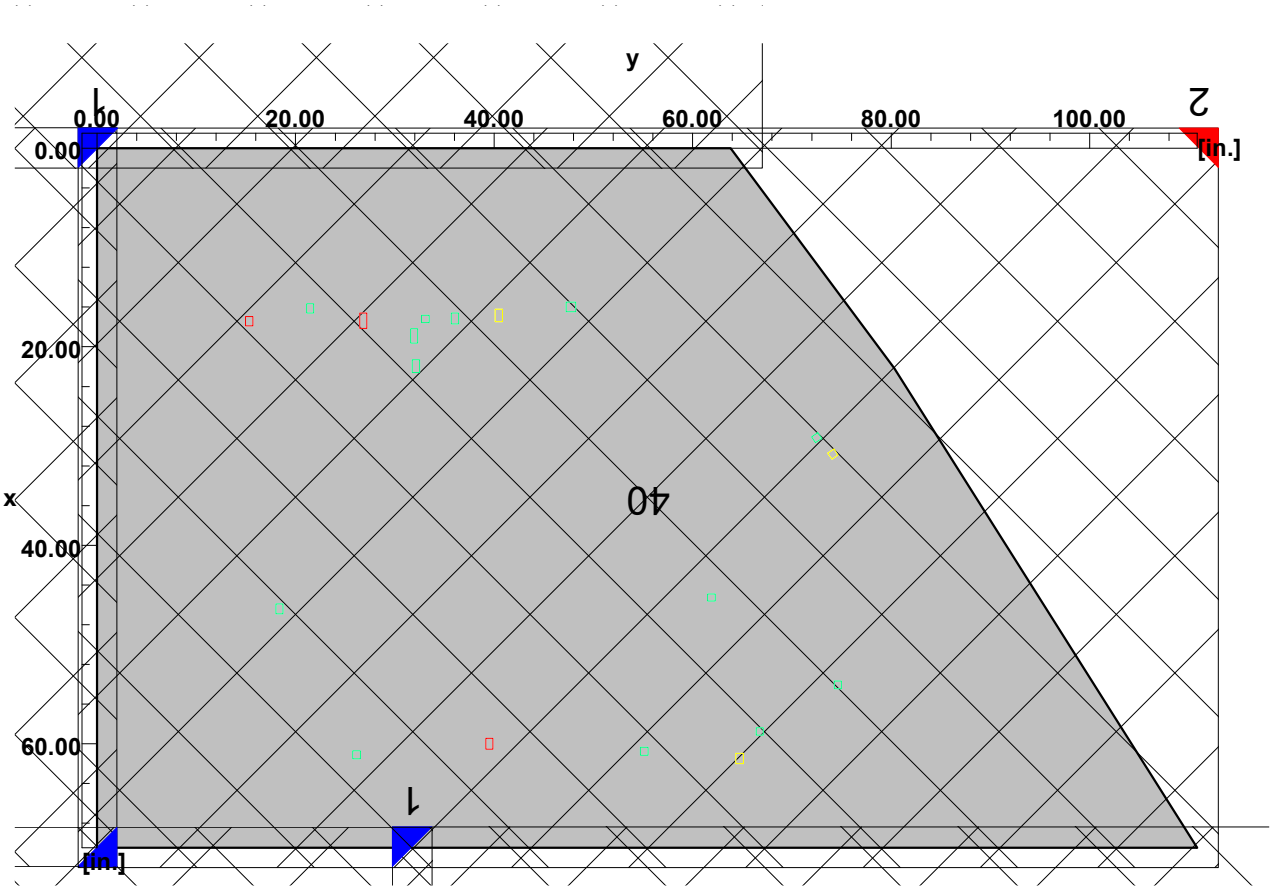

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
40	93	-2.01	-1.97	-2.01 (2.00)	112.83 (2.00)	75 (2.00)	115 (2.00)
41	94	-2.01	-1.97	-2.01 (2.00)	168.54 (2.00)	75 (2.00)	171 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 115.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 93 (4 of 4)

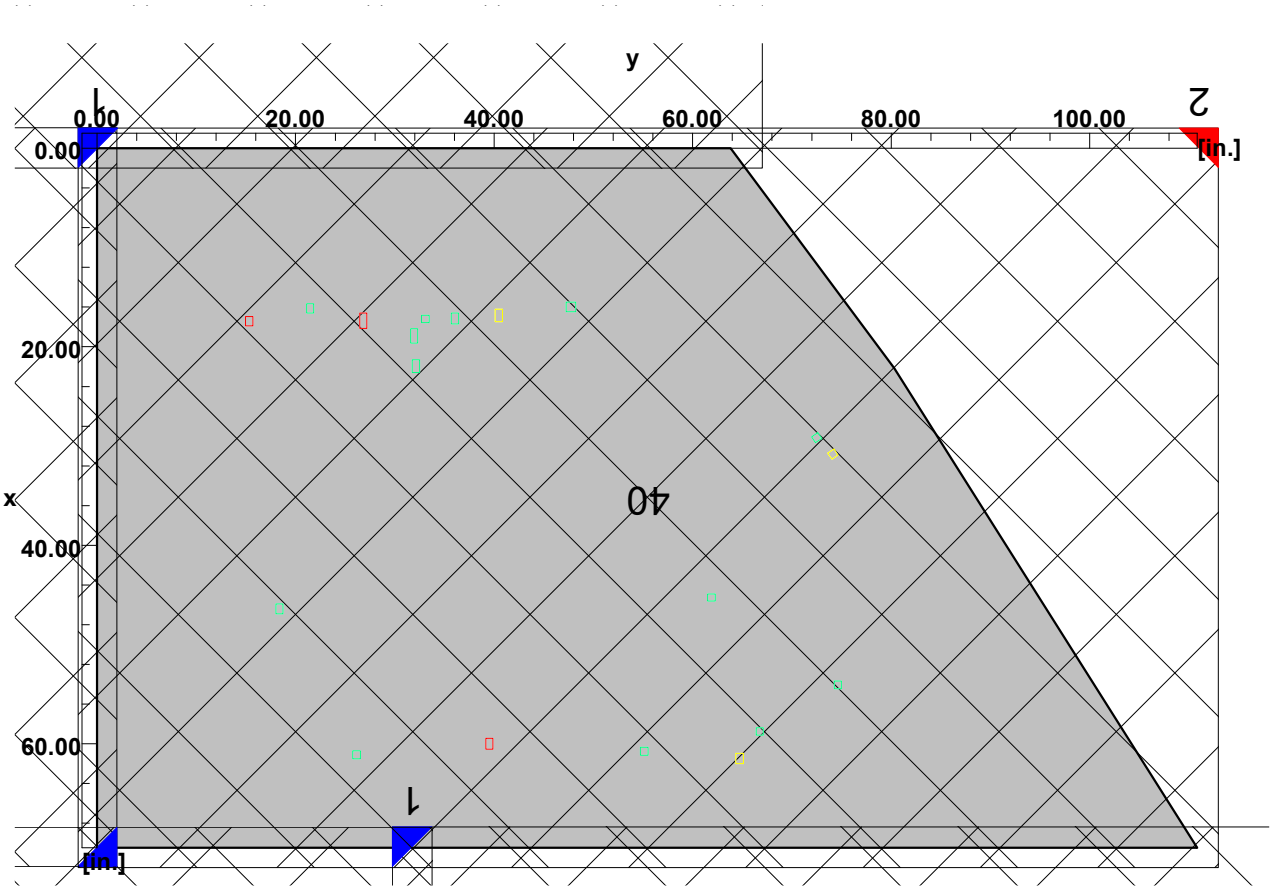

Replacement Plate/Patch List

No.	Angle to Y [°]
40	0
41	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 115.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 94 (1 of 2)

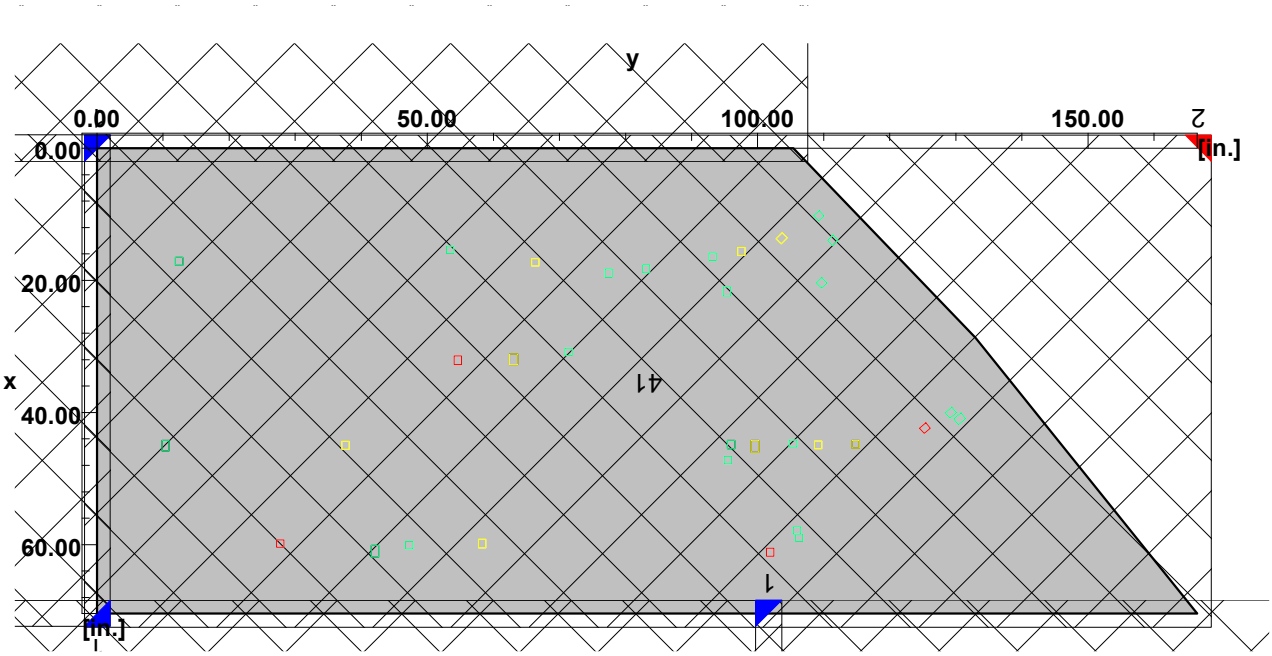

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
39	92	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
40	93	-2.01	-1.97	-2.01 (2.00)	112.83 (2.00)	75 (2.00)	115 (2.00)
41	94	-2.01	-1.97	-2.01 (2.00)	168.54 (2.00)	75 (2.00)	171 (2.00)
42	95	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
50	103	-2.01	-1.97	-2.01 (2.00)	137.64 (2.00)	75 (2.00)	140 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 171.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 94 (2 of 2)

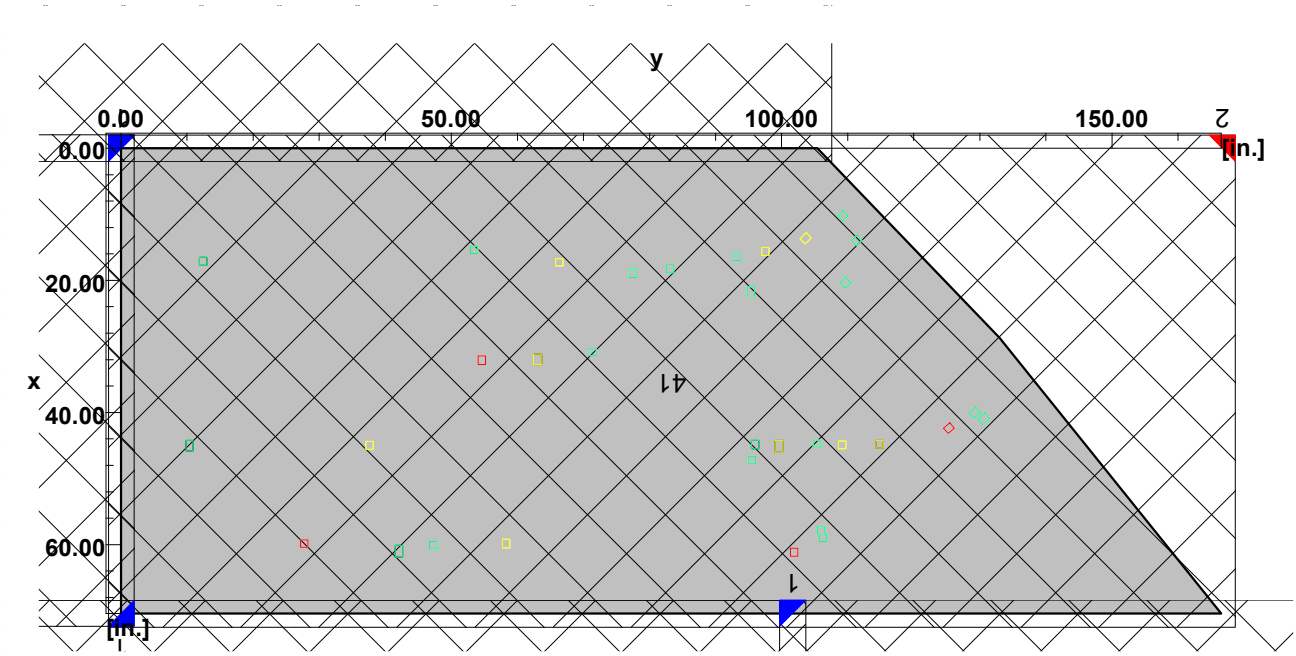

Replacement Plate/Patch List

No.	Angle to Y [°]
39	180
40	0
41	0
42	180
50	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 171.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 95 (1 of 2)

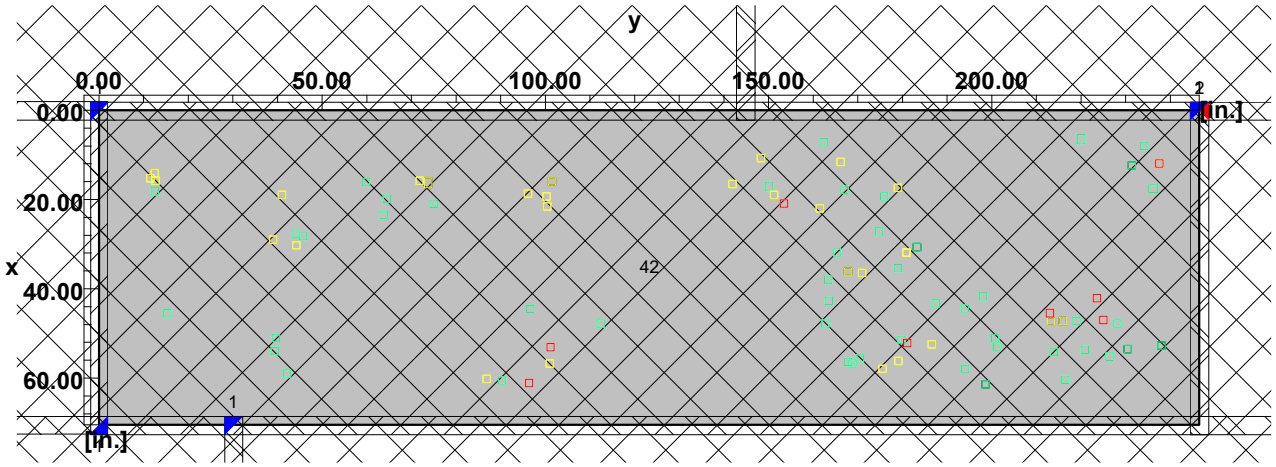

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
37	90	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
39	92	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
41	94	-2.01	-1.97	-2.01 (2.00)	168.54 (2.00)	75 (2.00)	171 (2.00)
42	95	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
43	96	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
49	102	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
50	103	-2.01	-1.97	-2.01 (2.00)	137.64 (2.00)	75 (2.00)	140 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 95 (2 of 2)

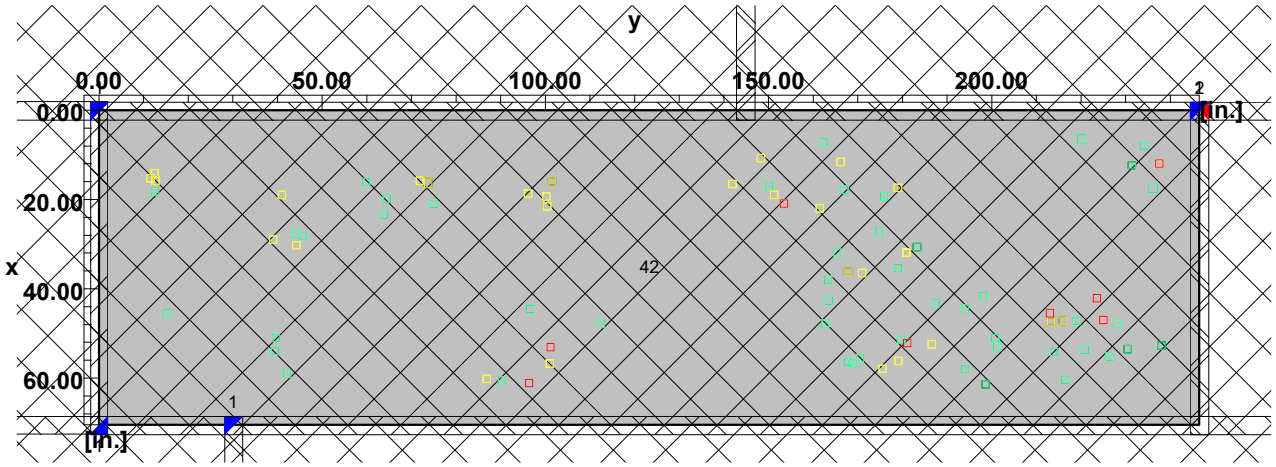

Replacement Plate/Patch List

No.	Angle to Y [°]
37	0
39	0
41	180
42	0
43	0
49	0
50	180

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 96 (1 of 2)

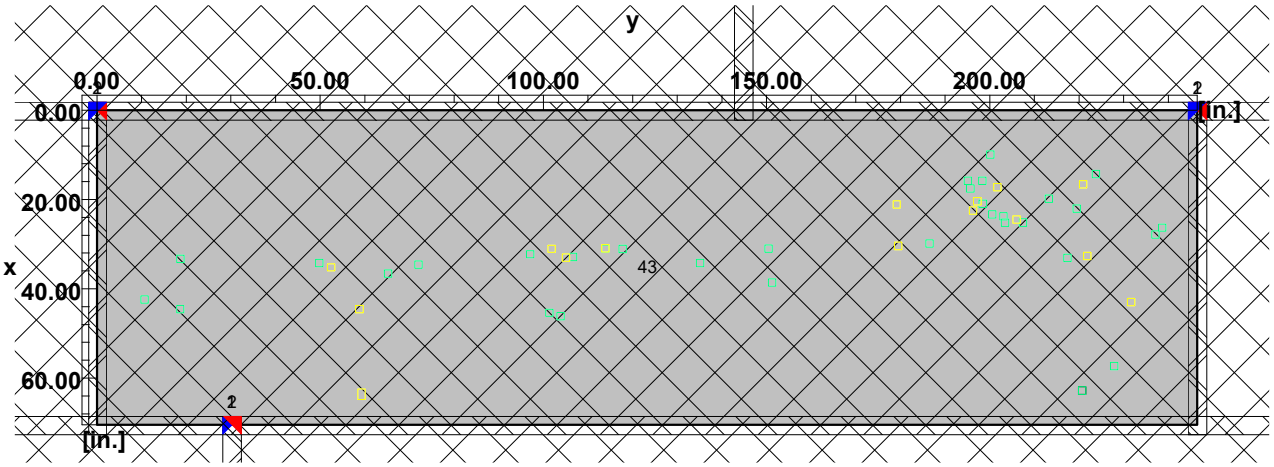

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
37	90	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
38	91	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
42	95	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
43	96	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
44	97	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
48	101	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
49	102	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 96 (2 of 2)

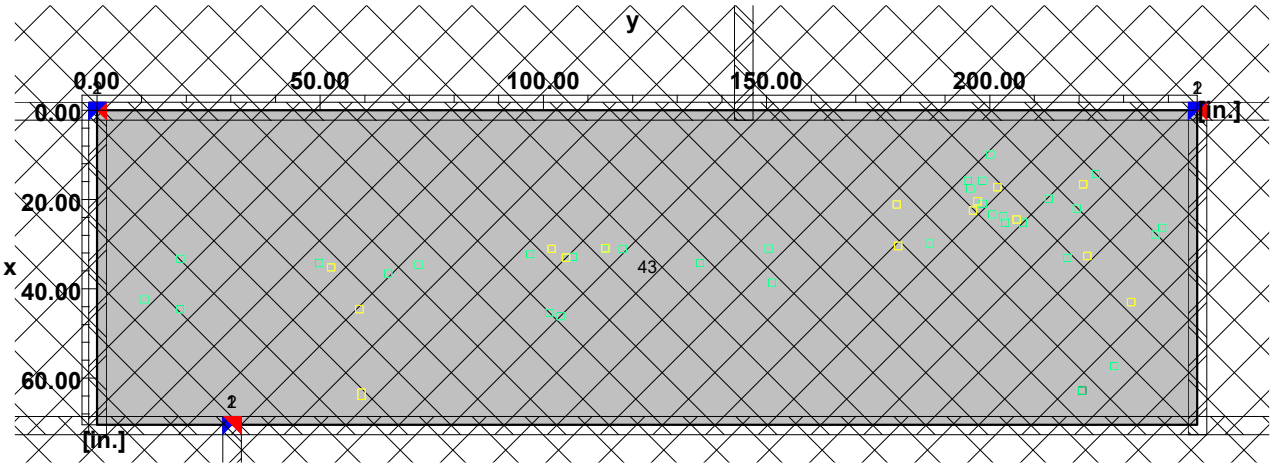

Replacement Plate/Patch List

No.	Angle to Y [°]
37	0
38	0
42	0
43	0
44	0
48	0
49	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 97 (1 of 2)

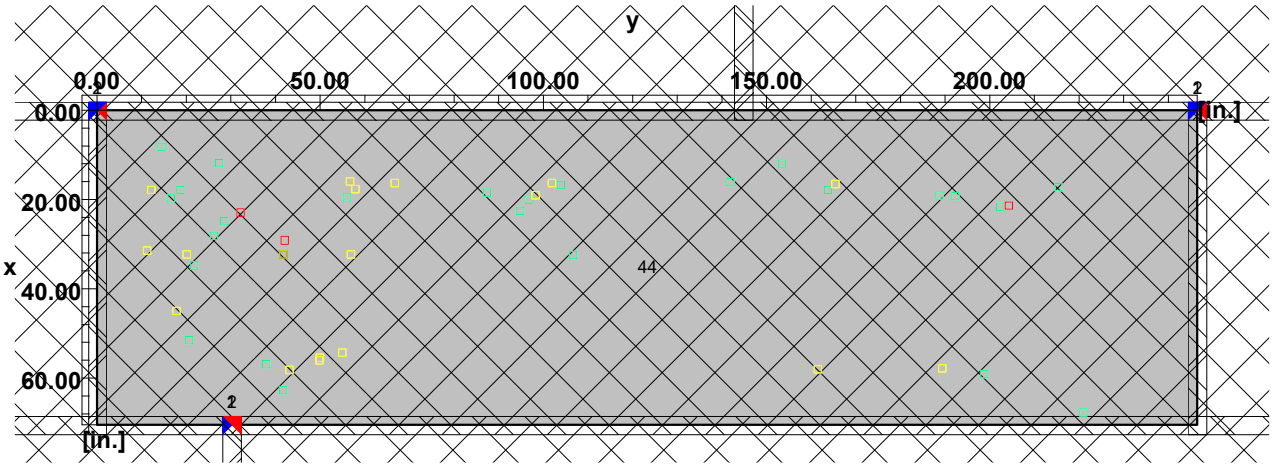

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
36	89	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
38	91	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
43	96	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
44	97	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
45	98	-1.93	-1.97	-1.93 (2.00)	208.11 (2.00)	75 (2.00)	211 (2.00)
47	100	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
48	101	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 97 (2 of 2)

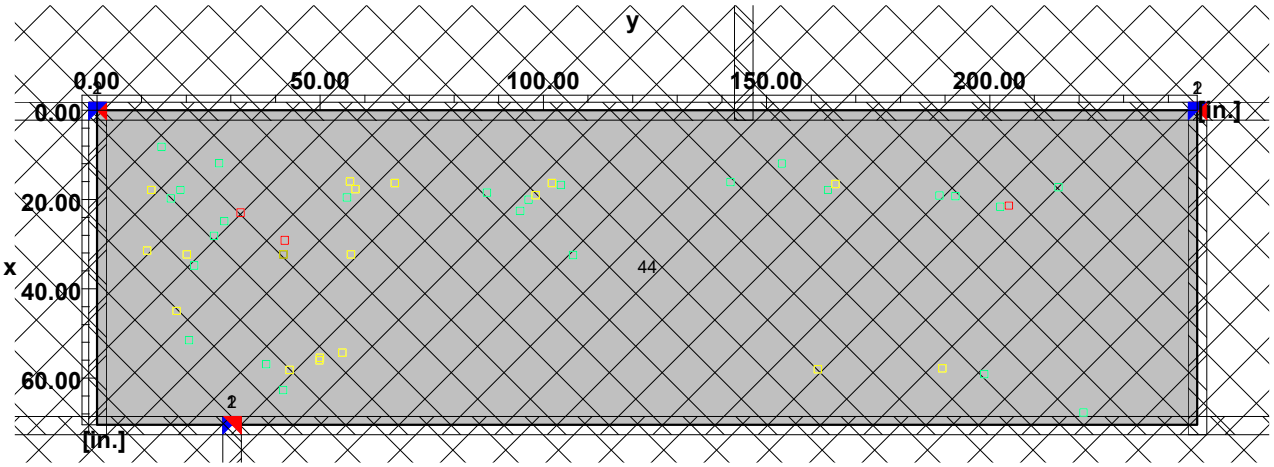

Replacement Plate/Patch List

No.	Angle to Y [°]
36	0
38	0
43	0
44	0
45	0
47	0
48	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 98 (1 of 2)

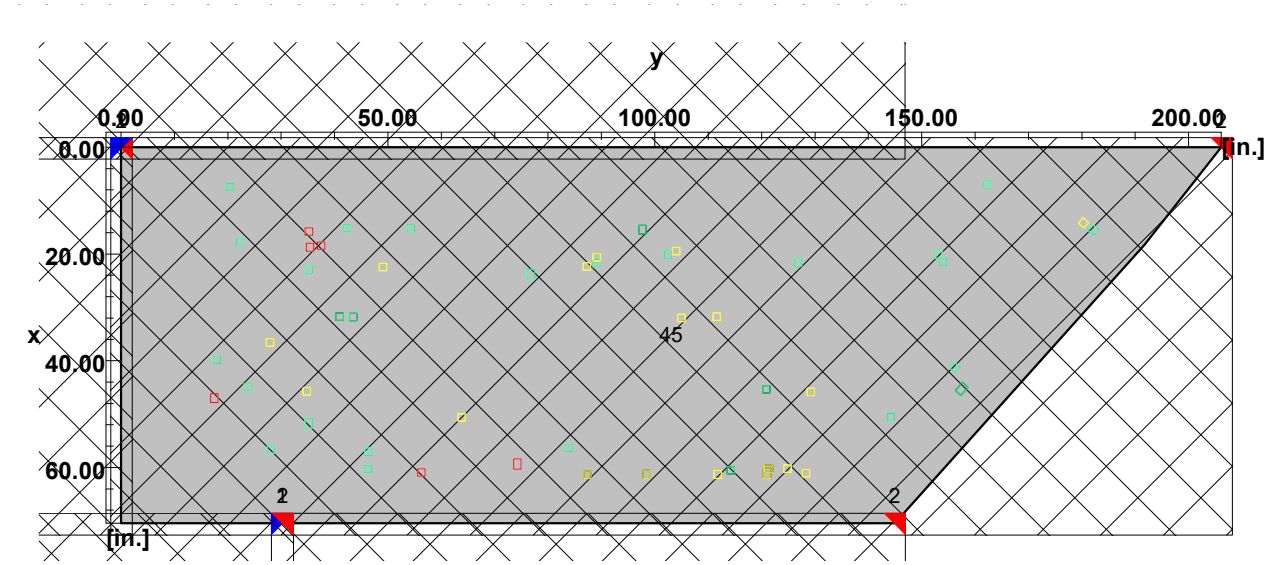

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
36	89	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
44	97	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
45	98	-1.93	-1.97	-1.93 (2.00)	208.11 (2.00)	75 (2.00)	211 (2.00)
46	99	-1.93	-1.97	-1.93 (2.00)	116.77 (2.00)	75 (2.00)	119 (2.00)
47	100	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 211.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 98 (2 of 2)

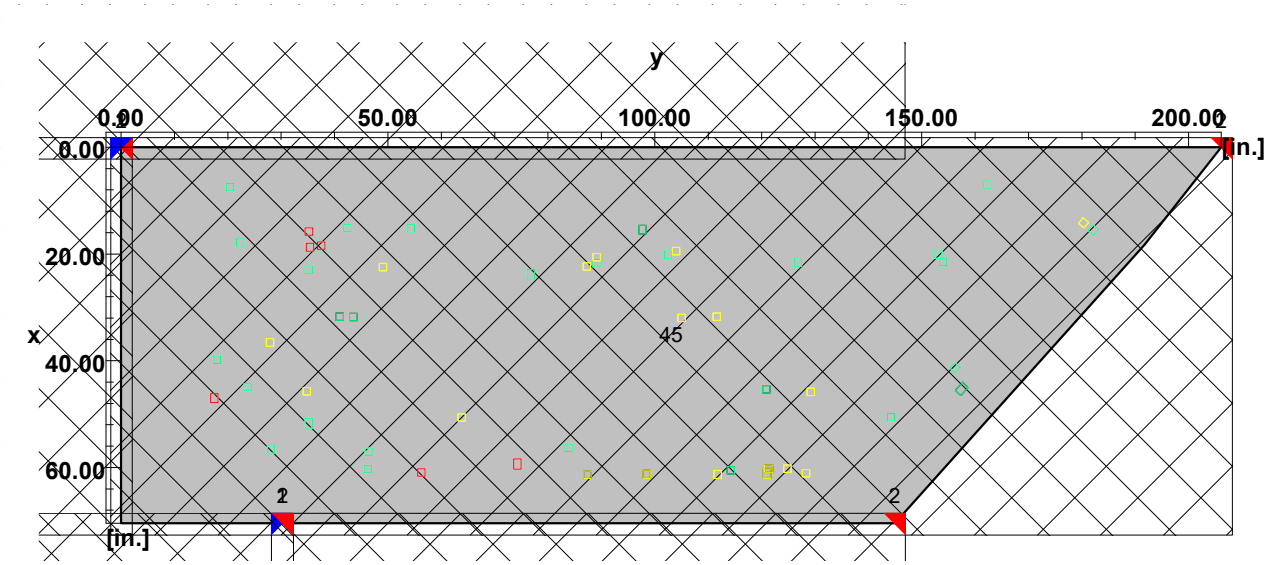

Replacement Plate/Patch List

No.	Angle to Y [°]
36	0
44	0
45	0
46	0
47	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 211.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 99 (1 of 2)

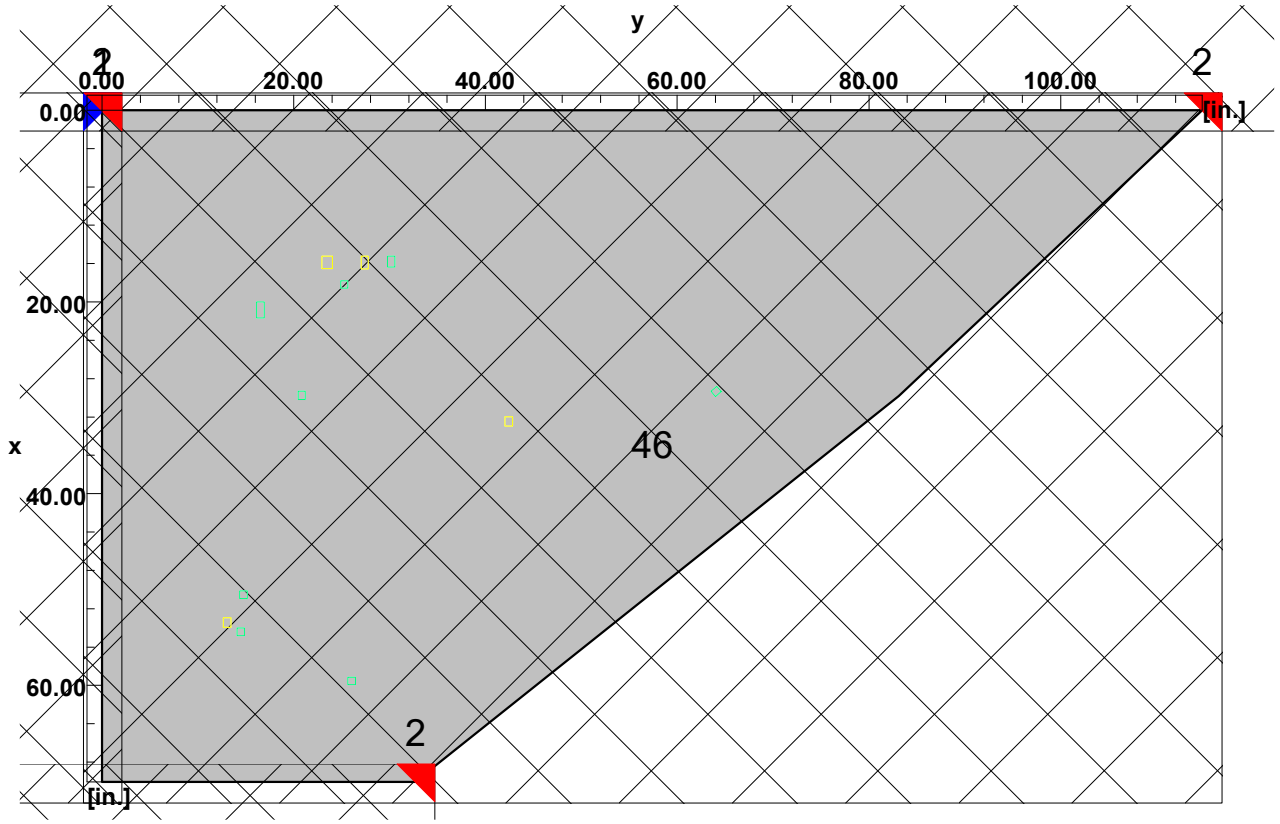

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
45	98	-1.93	-1.97	-1.93 (2.00)	208.11 (2.00)	75 (2.00)	211 (2.00)
46	99	-1.93	-1.97	-1.93 (2.00)	116.77 (2.00)	75 (2.00)	119 (2.00)
47	100	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
54	107	-1.93	-1.97	-1.93 (2.00)	167.56 (2.00)	75 (2.00)	170 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 119.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 99 (2 of 2)

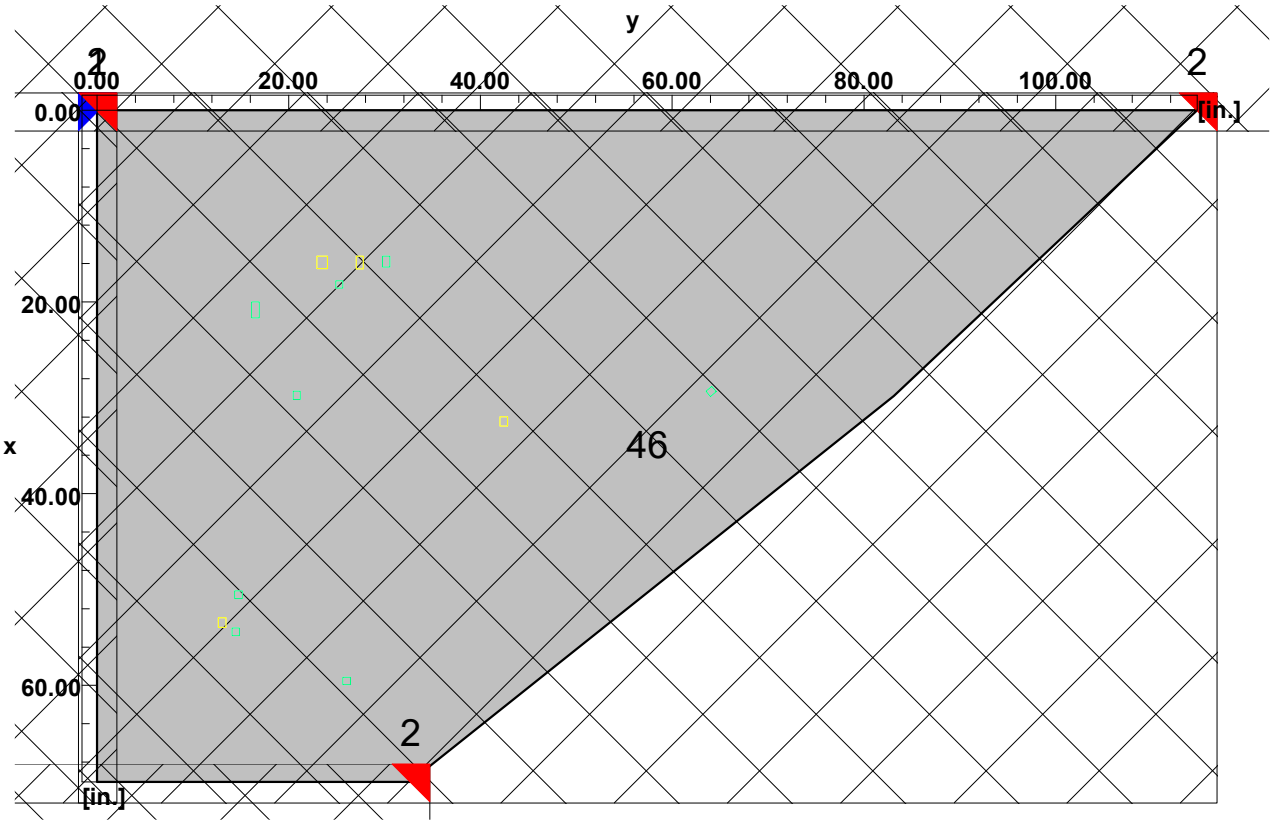

Replacement Plate/Patch List

No.	Angle to Y [°]
45	0
46	0
47	0
54	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 119.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 100 (1 of 2)

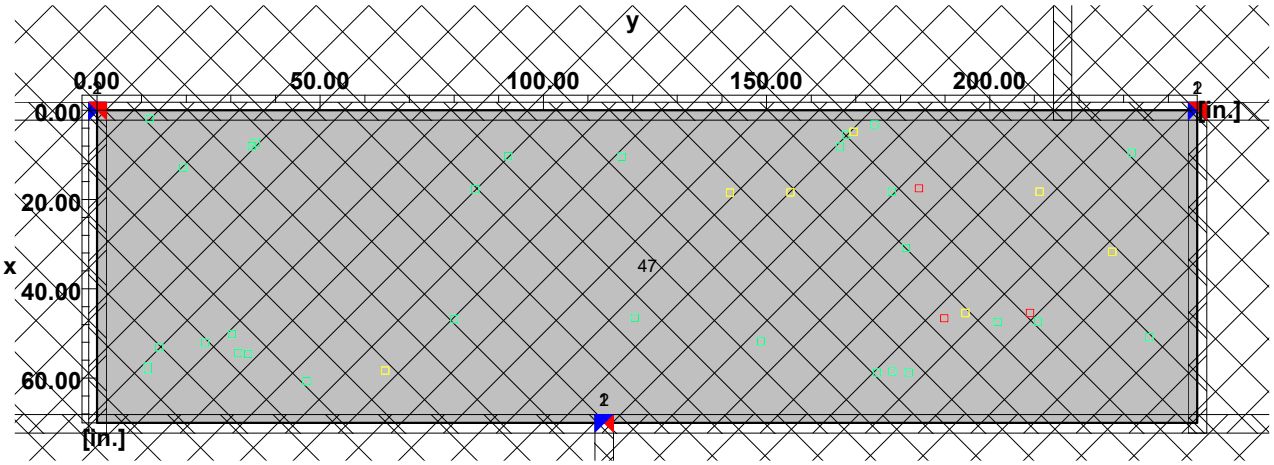

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
44	97	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
45	98	-1.93	-1.97	-1.93 (2.00)	208.11 (2.00)	75 (2.00)	211 (2.00)
46	99	-1.93	-1.97	-1.93 (2.00)	116.77 (2.00)	75 (2.00)	119 (2.00)
47	100	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
48	101	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
53	106	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
54	107	-1.93	-1.97	-1.93 (2.00)	167.56 (2.00)	75 (2.00)	170 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 100 (2 of 2)

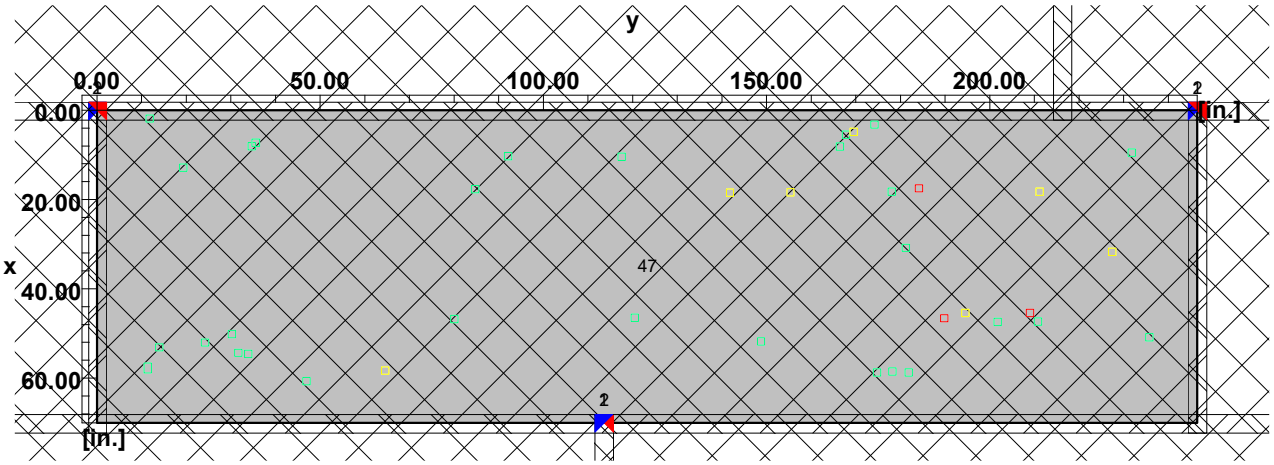

Replacement Plate/Patch List

No.	Angle to Y [°]
44	0
45	0
46	0
47	0
48	0
53	0
54	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 101 (1 of 2)

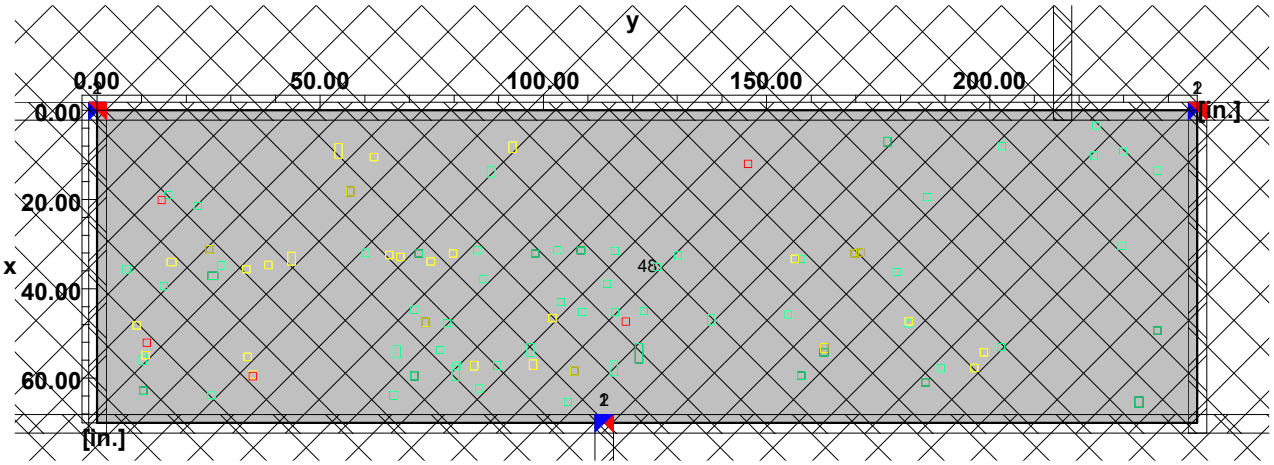

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
43	96	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
44	97	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
47	100	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
48	101	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
49	102	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
52	105	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
53	106	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 101 (2 of 2)

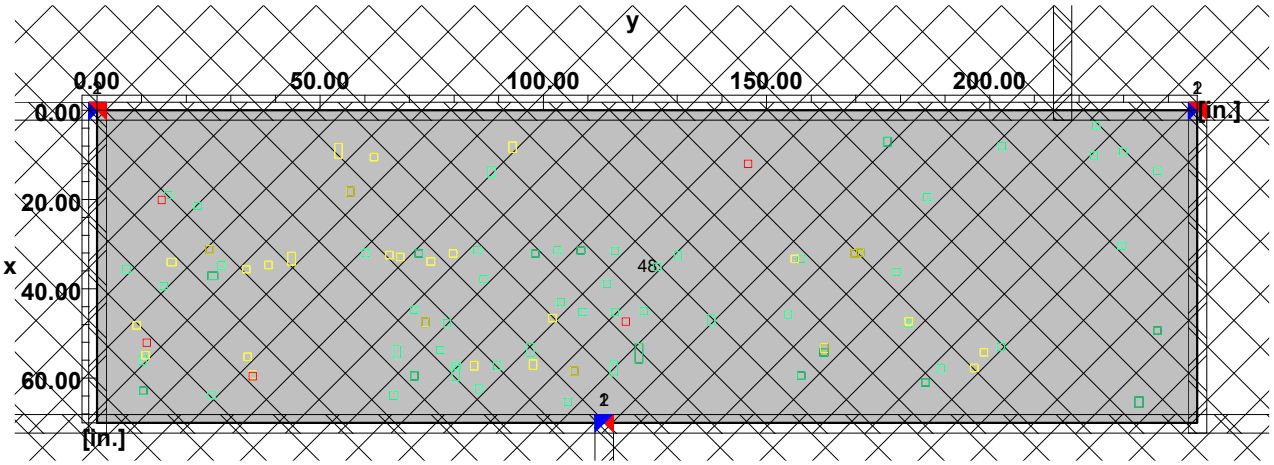

Replacement Plate/Patch List

No.	Angle to Y [°]
43	0
44	0
47	0
48	0
49	0
52	0
53	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 102 (1 of 2)

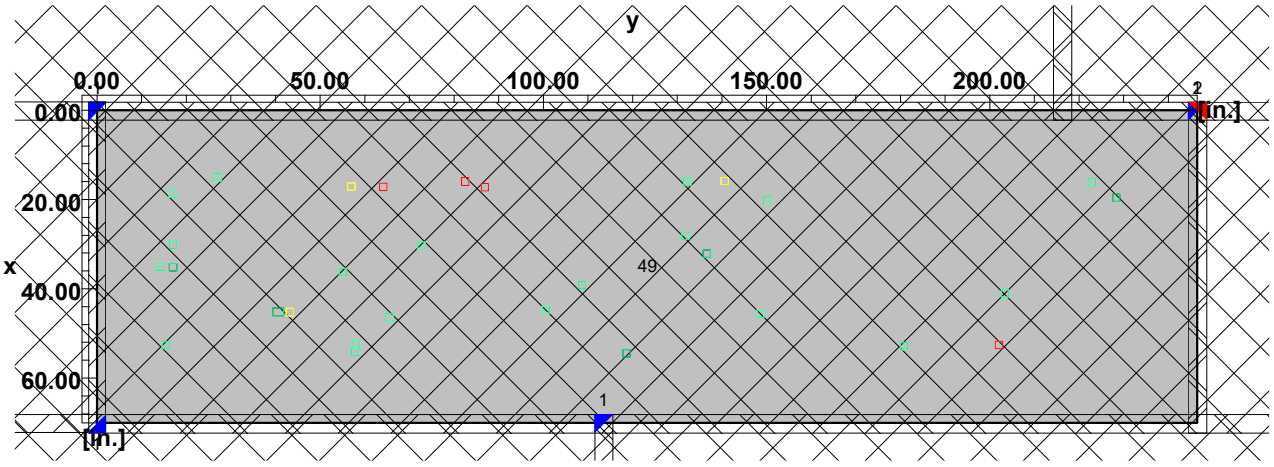

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
42	95	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
43	96	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
48	101	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
49	102	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
50	103	-2.01	-1.97	-2.01 (2.00)	137.64 (2.00)	75 (2.00)	140 (2.00)
51	104	-2.01	-1.97	-2.01 (2.00)	169.13 (2.00)	75 (2.00)	172 (2.00)
52	105	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 102 (2 of 2)

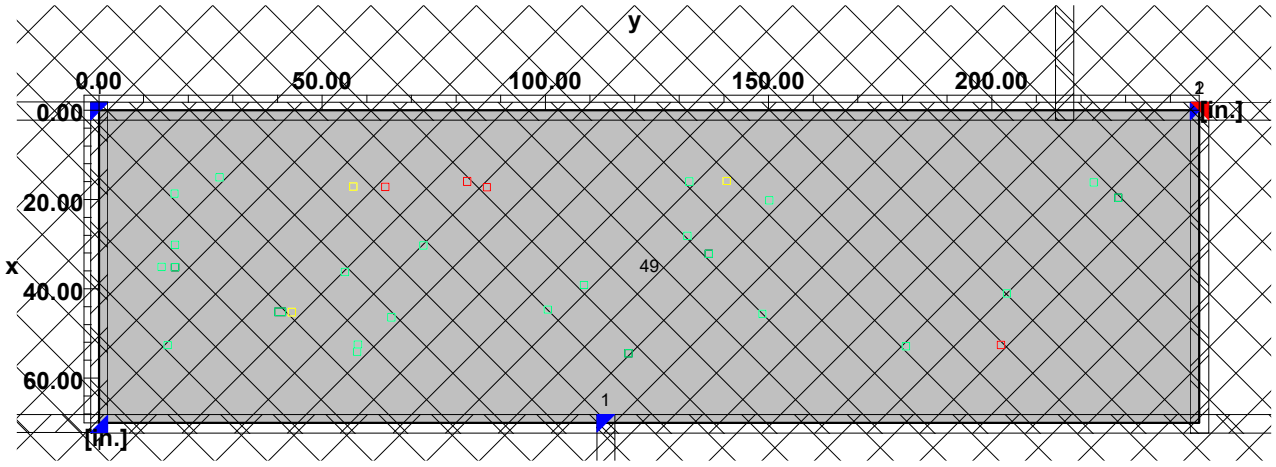

Replacement Plate/Patch List

No.	Angle to Y [°]
42	0
43	0
48	0
49	0
50	180
51	180
52	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 103 (1 of 2)

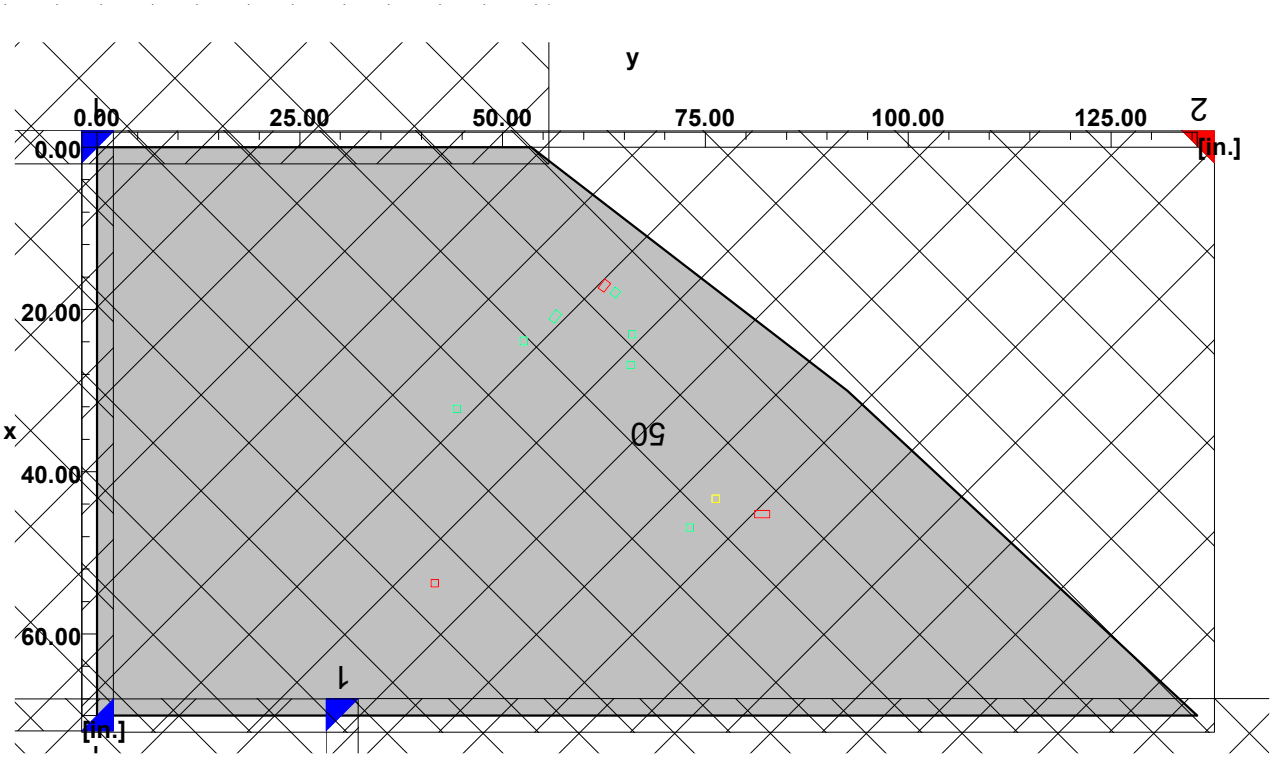

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
41	94	-2.01	-1.97	-2.01 (2.00)	168.54 (2.00)	75 (2.00)	171 (2.00)
42	95	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
49	102	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
50	103	-2.01	-1.97	-2.01 (2.00)	137.64 (2.00)	75 (2.00)	140 (2.00)
51	104	-2.01	-1.97	-2.01 (2.00)	169.13 (2.00)	75 (2.00)	172 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 140.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 103 (2 of 2)

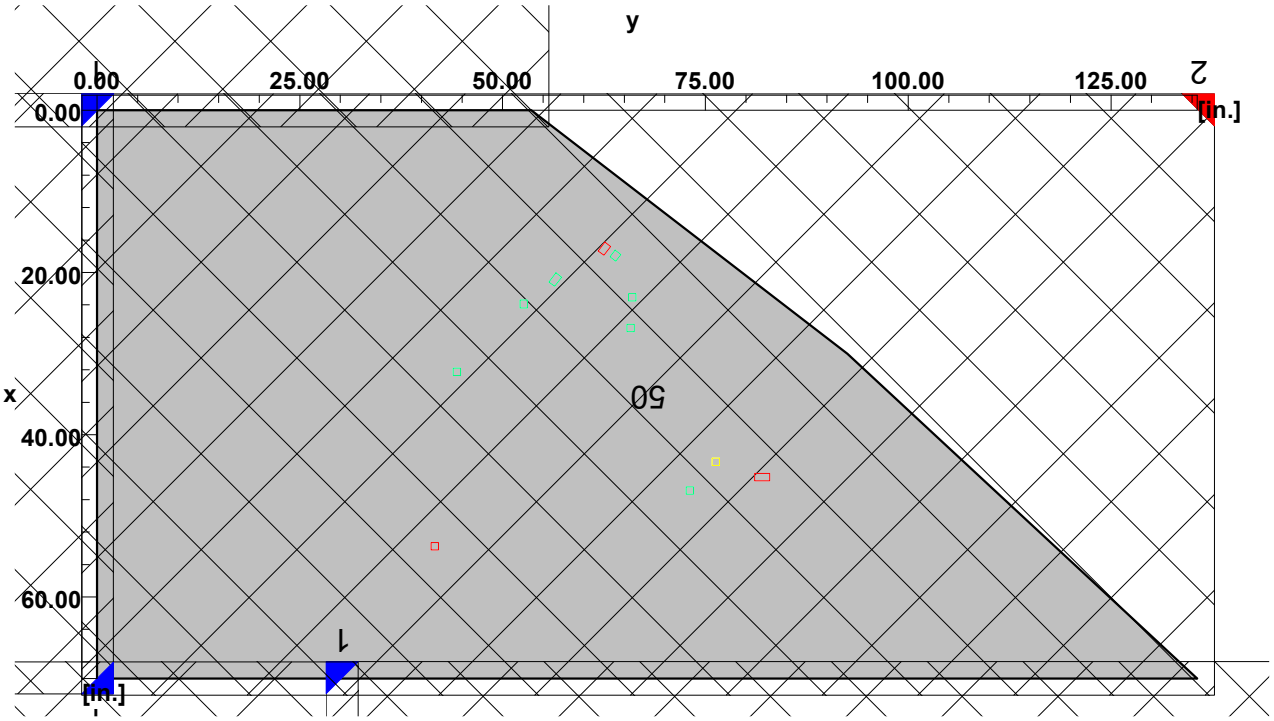

Replacement Plate/Patch List

No.	Angle to Y [°]
41	0
42	180
49	180
50	0
51	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 140.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 104 (1 of 2)

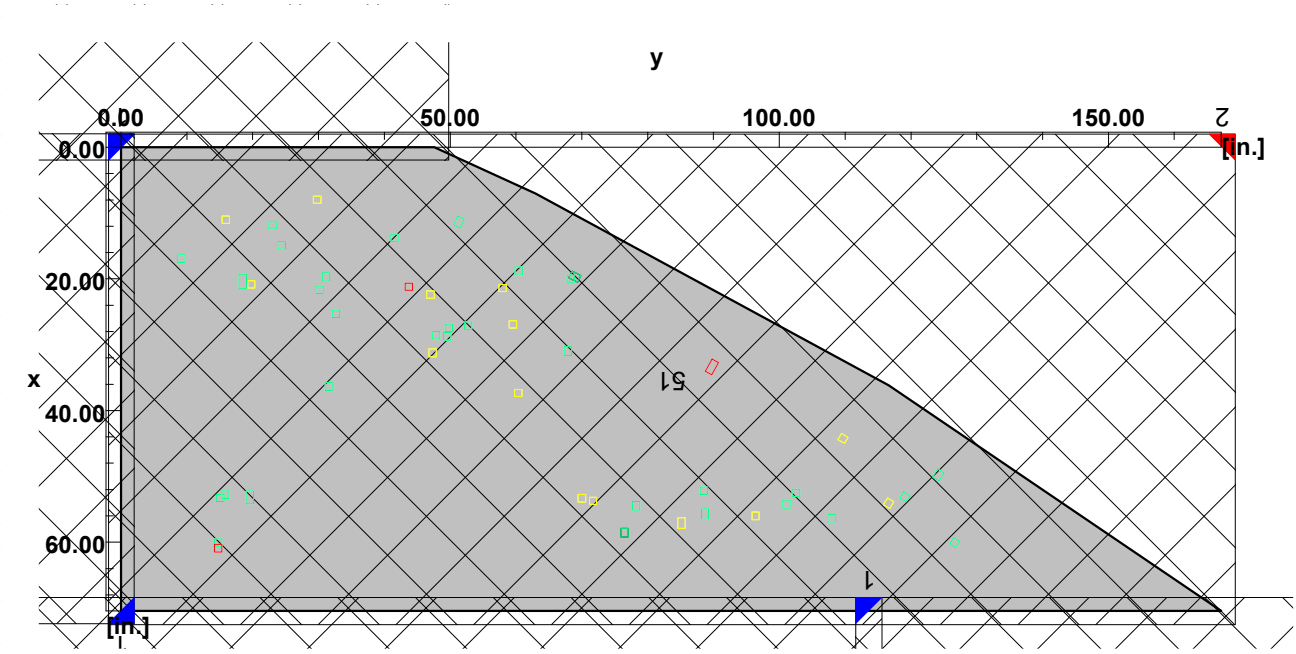

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
49	102	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
50	103	-2.01	-1.97	-2.01 (2.00)	137.64 (2.00)	75 (2.00)	140 (2.00)
51	104	-2.01	-1.97	-2.01 (2.00)	169.13 (2.00)	75 (2.00)	172 (2.00)
52	105	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
56	110	-1.97	-1.97	-1.97 (2.00)	58.70 (2.00)	188 (2.00)	61 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 172.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 104 (2 of 2)

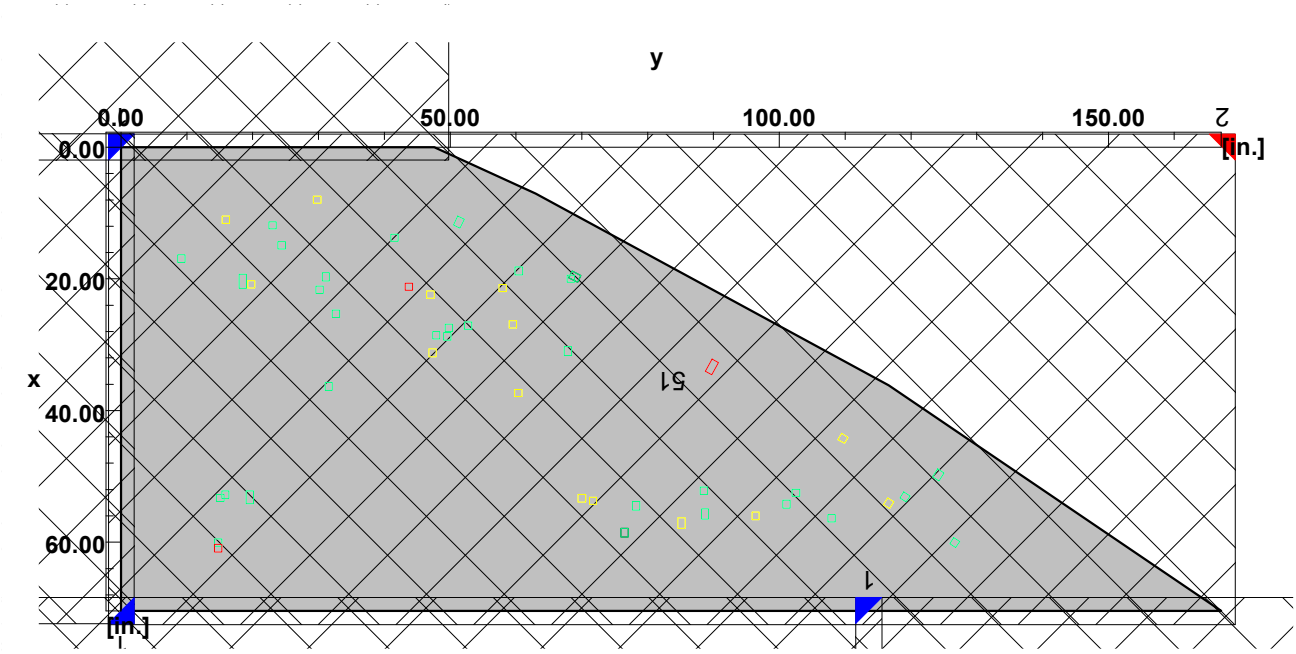

Replacement Plate/Patch List

No.	Angle to Y [°]
49	180
50	0
51	0
52	180
56	270

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 172.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 105 (1 of 2)

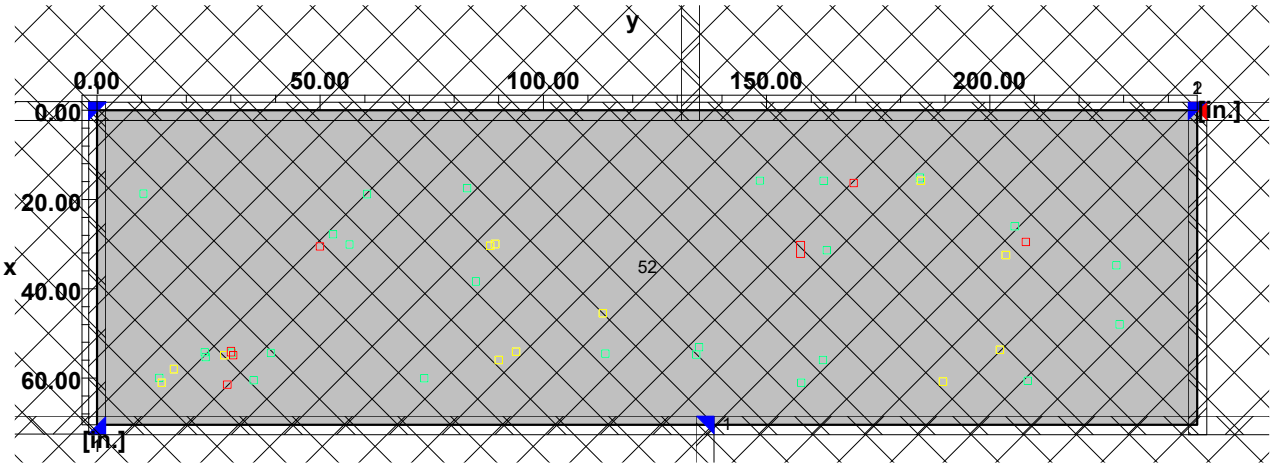

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
48	101	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
49	102	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
51	104	-2.01	-1.97	-2.01 (2.00)	169.13 (2.00)	75 (2.00)	172 (2.00)
52	105	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
53	106	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
55	109	-1.97	-1.97	-1.97 (2.00)	66.50 (2.00)	223 (2.00)	69 (2.00)
56	110	-1.97	-1.97	-1.97 (2.00)	58.70 (2.00)	188 (2.00)	61 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 105 (2 of 2)

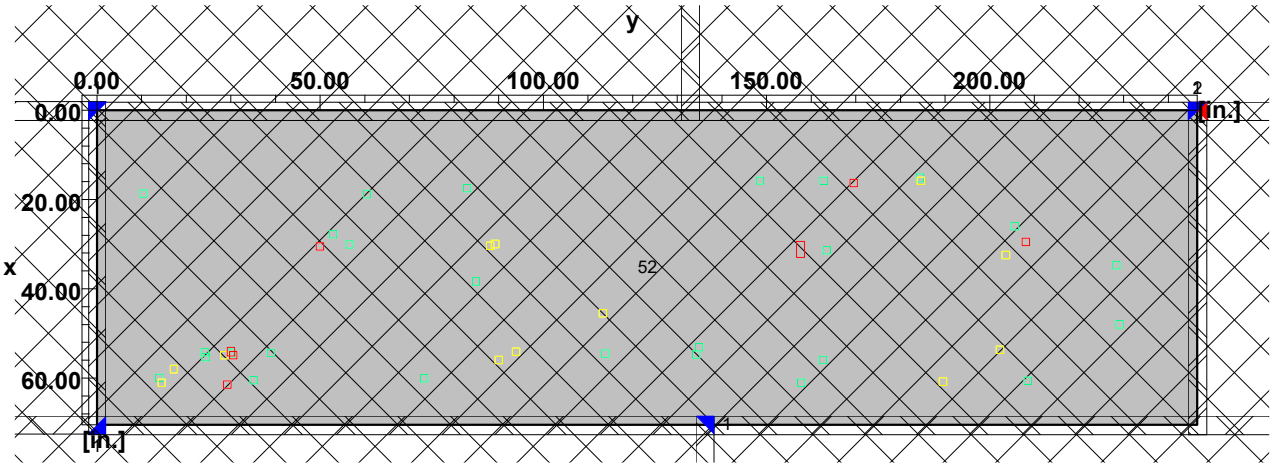

Replacement Plate/Patch List

No.	Angle to Y [°]
48	0
49	0
51	180
52	0
53	0
55	90
56	90

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 106 (1 of 2)

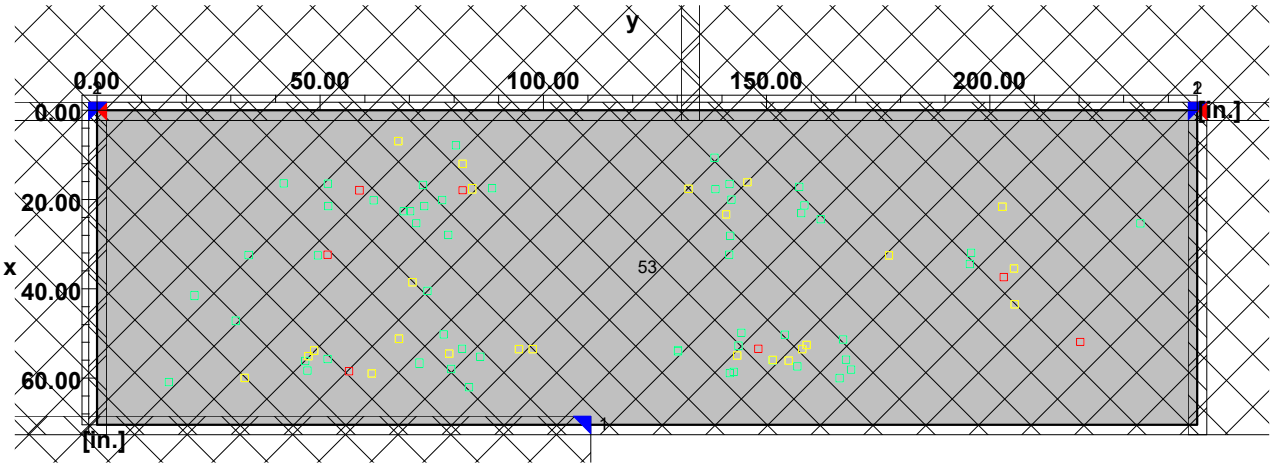

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
47	100	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
48	101	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
52	105	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
53	106	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
54	107	-1.93	-1.97	-1.93 (2.00)	167.56 (2.00)	75 (2.00)	170 (2.00)
55	109	-1.97	-1.97	-1.97 (2.00)	66.50 (2.00)	223 (2.00)	69 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 106 (2 of 2)

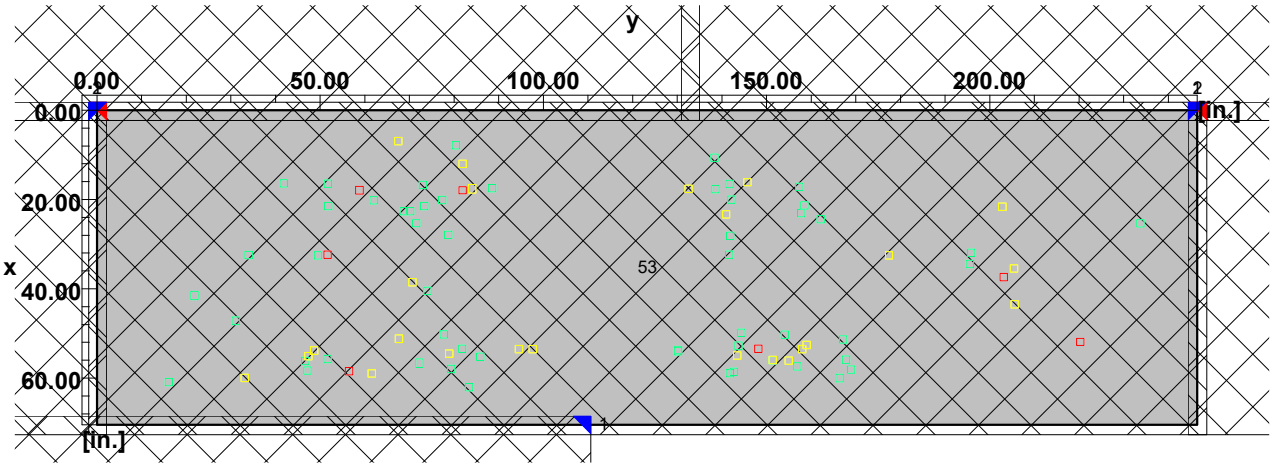

Replacement Plate/Patch List

No.	Angle to Y [°]
47	0
48	0
52	0
53	0
54	0
55	90

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %

Size 0.0 in. - 39.4 in.

All Plates

All Feature Types

All Methods

Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 251.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 107 (1 of 2)

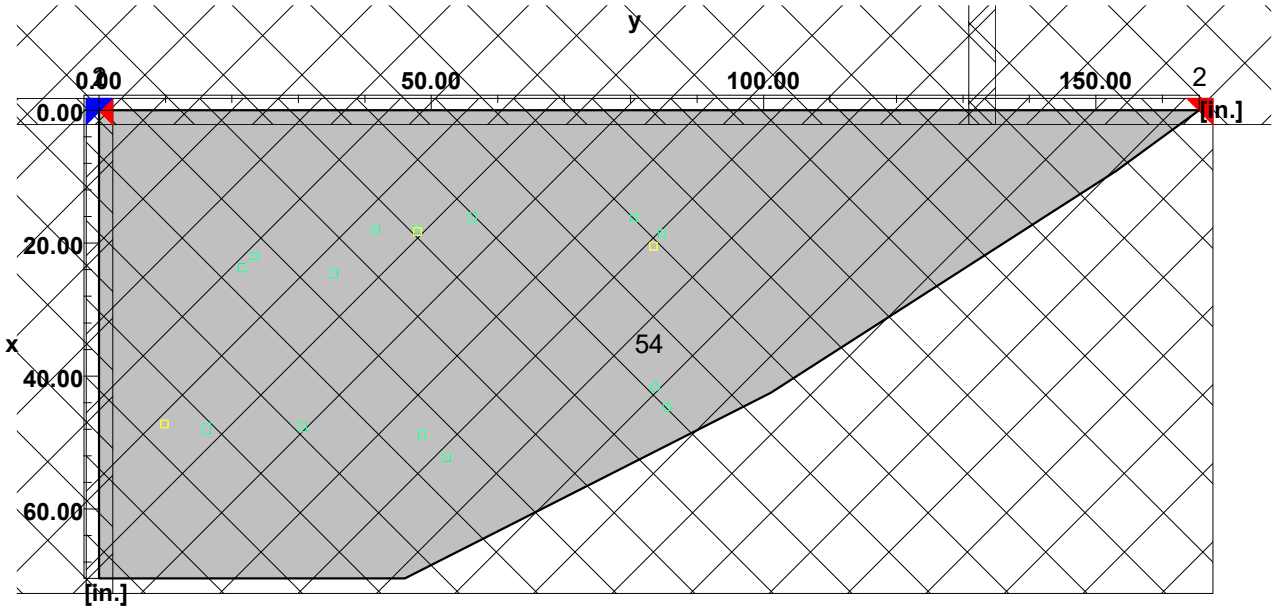

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
46	99	-1.93	-1.97	-1.93 (2.00)	116.77 (2.00)	75 (2.00)	119 (2.00)
47	100	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
53	106	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
54	107	-1.93	-1.97	-1.93 (2.00)	167.56 (2.00)	75 (2.00)	170 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 170.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 107 (2 of 2)

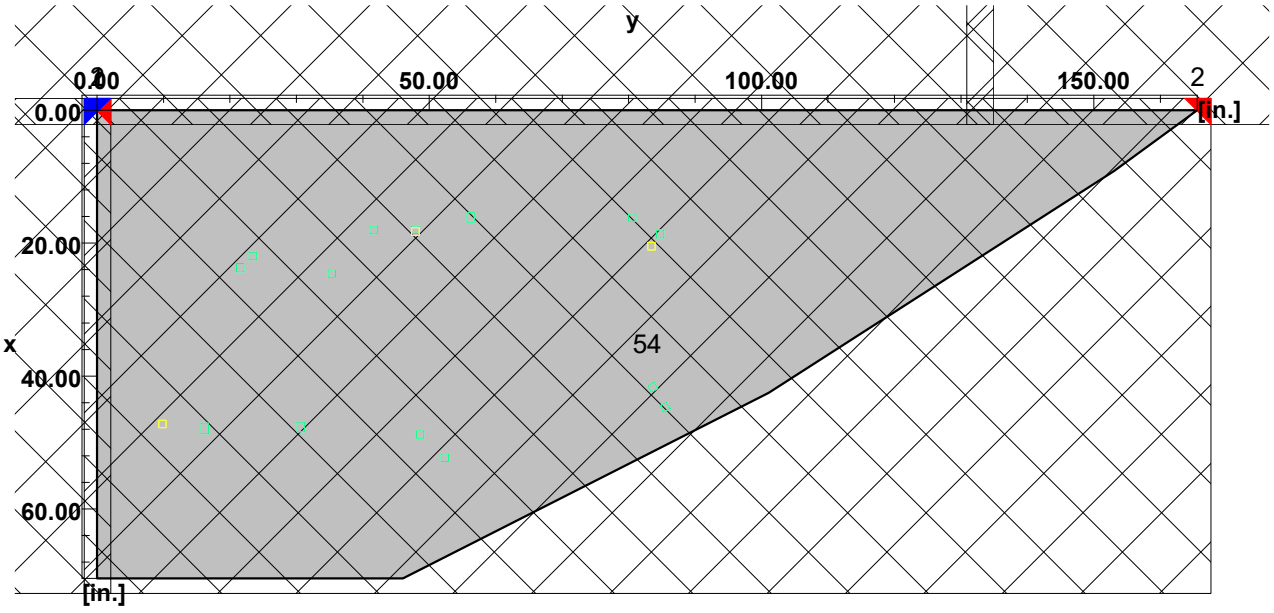

Replacement Plate/Patch List

No.	Angle to Y [°]
46	0
47	0
53	0
54	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 75.00 in. * 170.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 108 (1 of 2)

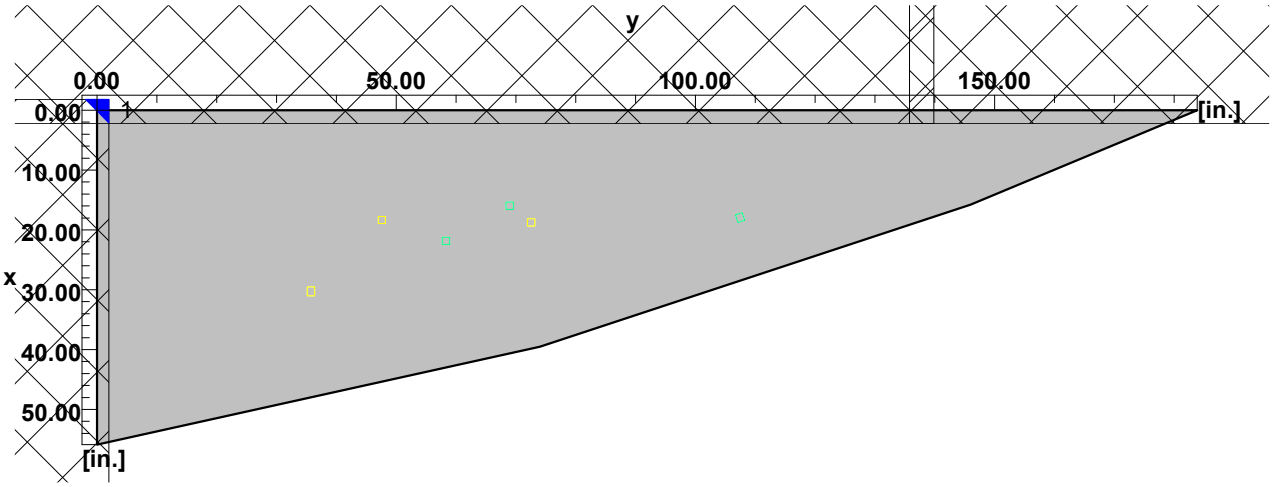

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
53	106	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
54	107	-1.93	-1.97	-1.93 (2.00)	167.56 (2.00)	75 (2.00)	170 (2.00)
55	109	-1.97	-1.97	-1.97 (2.00)	66.50 (2.00)	223 (2.00)	69 (2.00)

Classification

Feature

0	20 %
3	40 %
3	60 %
0	80 %
	100%

White Border: Inspection Side Features
Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 108 (2 of 2)

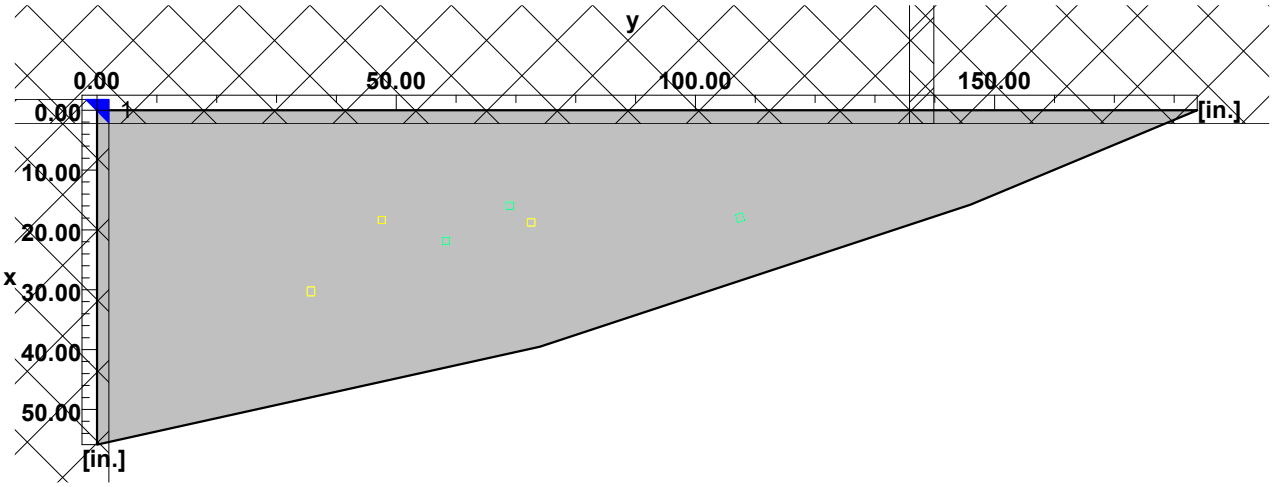

Replacement Plate/Patch List

No.	Angle to Y [°]
53	0
54	0
55	90

Classification

Feature

0	20 %
3	40 %
3	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings


Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

No patches on this plate

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 109 (1 of 4)

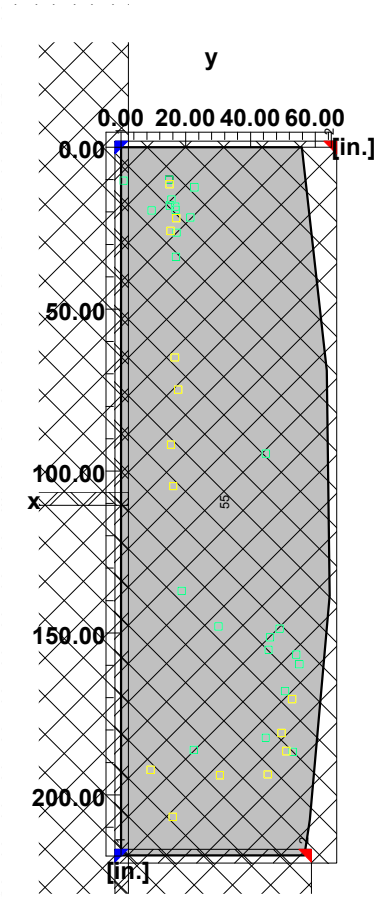

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
52	105	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
53	106	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
55	109	-1.97	-1.97	-1.97 (2.00)	66.50 (2.00)	223 (2.00)	69 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 223.00 in. * 69.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 109 (2 of 4)

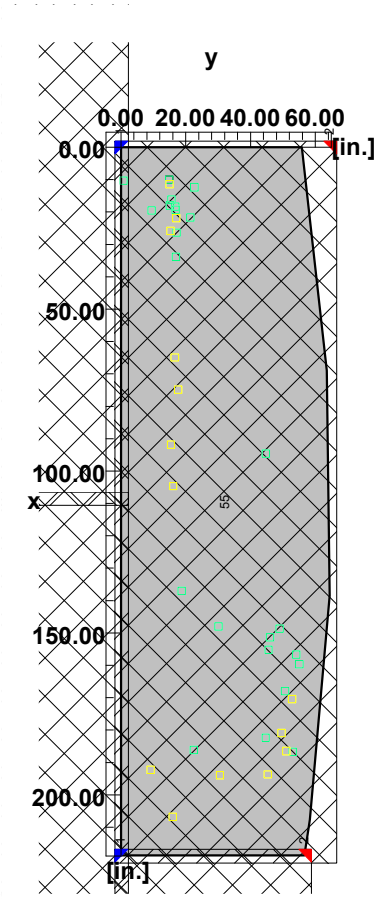

Replacement Plate/Patch List

No.	Angle to Y [°]
52	270
53	270
55	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 223.00 in. * 69.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 109 (3 of 4)

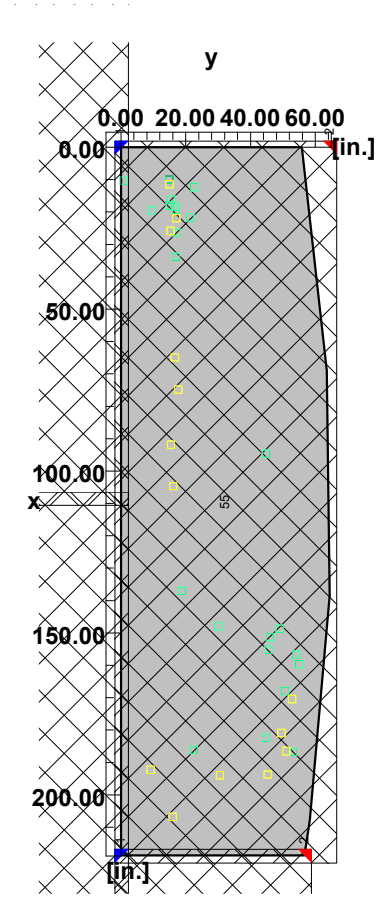

Replacement Plate/Patch List

No.	Plate No.	Position 1 X[in.]	Position 1 Y[in.]	Position 2 X[in.]	Position 2 Y[in.]	Dimension X[in.]	Dimension Y[in.]
56	110	-1.97	-1.97	-1.97 (2.00)	58.70 (2.00)	188 (2.00)	61 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 223.00 in. * 69.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 109 (4 of 4)

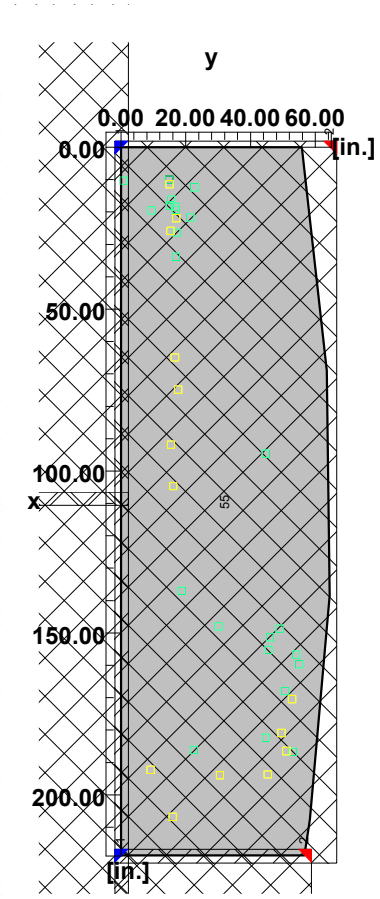

Replacement Plate/Patch List

No.	Angle to Y [°]
56	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 223.00 in. * 69.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 110 (1 of 4)

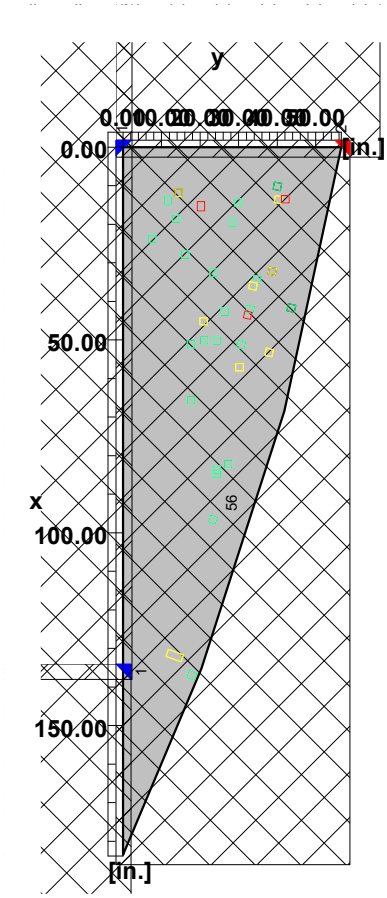

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
51	104	-2.01	-1.97	-2.01 (2.00)	169.13 (2.00)	75 (2.00)	172 (2.00)
52	105	-1.93	-1.97	-1.93 (2.00)	248.46 (2.00)	75 (2.00)	251 (2.00)
55	109	-1.97	-1.97	-1.97 (2.00)	66.50 (2.00)	223 (2.00)	69 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 188.00 in. * 61.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 110 (2 of 4)

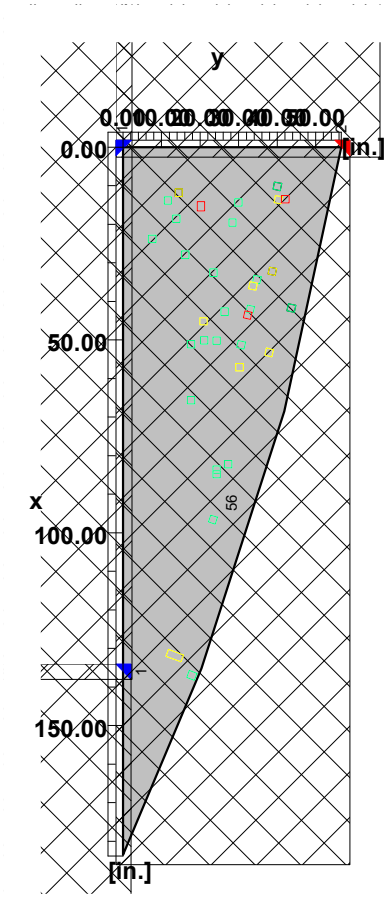

Replacement Plate/Patch List

No.	Angle to Y [°]
51	90
52	270
55	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 188.00 in. * 61.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 110 (3 of 4)

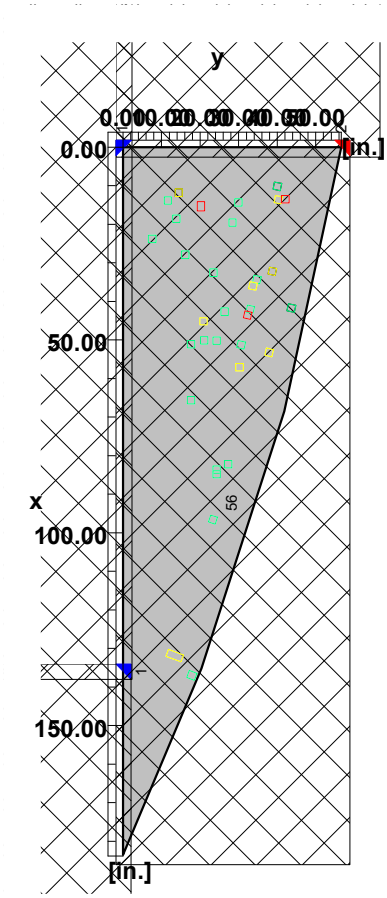

Replacement Plate/Patch List

		Position 1		Position 2		Dimension	
No.	Plate No.	X[in.]	Y[in.]	X[in.]	Y[in.]	X[in.]	Y[in.]
56	110	-1.97	-1.97	-1.97 (2.00)	58.70 (2.00)	188 (2.00)	61 (2.00)

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded


Repair Patch/Plate

1 Replacement plate 188.00 in. * 61.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
ROSEN Proj. No.: 0-1000-18486
ROSEN Tank Name: TK 201
Inspection Type: API 653 Inspection
Inspection Date: July 31, 2026, d. 116 ft.
Report Date: -

Plate 110 (4 of 4)

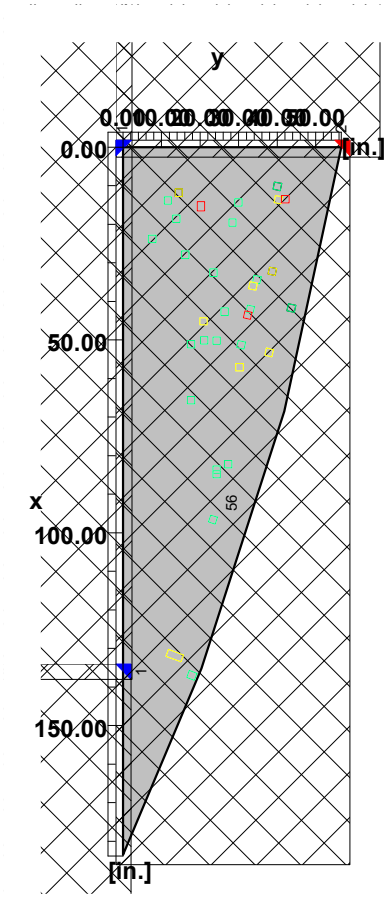

Replacement Plate/Patch List

No.	Angle to Y [°]
56	0

Classification

Feature

0	20 %
0	40 %
0	60 %
0	80 %
	100%

White Border: Inspection Side Features

Black Border: Non Inspection Side Features

Feature Filter Settings

Metal loss 49 % - 100 %
Size 0.0 in. - 39.4 in.
All Plates
All Feature Types
All Methods
Repaired Features excluded

Repair Patch/Plate

1 Replacement plate 188.00 in. * 61.00 in.

Blue corner is patch position 1 of all patch types
Red corner is patch position 2 of all patch types

Client: TransMontaigne
Date: July 31, 2026
Tank No.: 201
ROSEN Project No.: 0-1000-18486
Site: Port Everglades, Fl (North)

Bottom Assesment with Coating (Rejection Limits)

Mechanical Parameters

Original Sketch Plate Thickness	WTc	inch	0.2500
Original Bottom Plate Thickness	WTs	inch	0.2500
Tank Diameter	D	feet	117.0
Number of Years Installed	dt	years	93
Thickness Bottom Shell Course (Avg.)	ts	inch	0.592
Intended Next Service Period	Or	years	20

Mitigation Measures

Reinforced Internal Lining?	Yes/No	No
Leak Detection System?	Yes/No	No
Secondary Containment?	Yes/No	No
Is the Bottom Coated?	Yes/No	Yes

Note: *API Inspector will follow up with the Owner/Operator to understand the expected life of the current internal bottom coating or if new coating will be installed. Therefore, if the expected life of the coating equals to or exceeds the expected interval then use StPr = 0.*

1 - Rejection Limit as per API Standard 653, Sections 4.4.5.4, 4.4.6.2, and Table 4.4

Compliance Code to be Used:	API Standard 653		
Critical Zone	WTc,min.	inch	0.1250
Critical Area	WTa,min.	inch	0.100
Bottom Plates	WTs,min.	inch	0.100

2 - Repair threshold as per API Standard 653, Section 4.4.5.1

Repair Strategy with Coating

Bottom Plates

35%	40%	45%	49%	51%	54%	56%	Repair
0.163	0.150	0.138	0.128	0.123	0.115	0.110	RTbc
0.163	0.150	0.138	0.128	0.123	0.115	0.110	RTip
0.100	0.100	0.100	0.100	0.100	0.100	0.100	MRT
0.00094	0.00108	0.00121	0.00132	0.00137	0.00145	0.00151	Upr
0.00000	0.00000	0.00000	0.00000	0.00000	0.00000	0.00000	StPr

66.43	46.50	31.00	20.88	16.41	10.33	6.64	Or

Client:	TransMontaigne
Date:	July 31, 2026
Tank No.:	201
ROSEN Project No.:	0-1000-18486
Site:	Port Everglades, Fl (North)

Differential Settlement

Mechanical Data

Tank Diameter	D	feet	117.00	
Tank Height	H	feet	41.25	
Min. Number of Settlement Points		[-]	12	
No. Settlement Points Used		[-]	12	
Location of 1st Measurement Point		degrees	0	
Distance Between Settlement Points		feet	30.63	*Maximum 32 feet*
Material Yield	Y	PSI	30000	
Young's Modulus	E	PSI	28800000	

Differential Settlement API Standard 653, Appendix B

Location [Deg]	Settlement Readings [inch]	Relative Elevation [inch]	Planar Tilt [inch]	Settlement [inch]	Deflection [inch]
0	19.000	2.00	1.78	0.22	0.06
30	18.625	1.63	1.00	0.63	0.60
60	17.250	0.25	0.43	-0.18	-0.38
90	17.000	0.00	0.21	-0.21	-0.17
120	17.500	0.50	0.42	0.08	0.31
150	17.750	0.75	0.99	-0.24	-0.14
180	18.500	1.50	1.76	-0.26	-0.37
210	20.000	3.00	2.54	0.46	0.40
240	20.500	3.50	3.12	0.38	0.19
270	20.250	3.25	3.33	-0.08	-0.02
300	19.625	2.63	3.12	-0.50	-0.31
330	19.250	2.25	2.56	-0.31	-0.17

The following formula is used in calculating maximum permissible deflection:

$$|S| = \frac{L^2 * Y * 11}{2 * E * H} * 12$$

where

S = Critical deflection [inch]

L = Arc Length [feet]

E = Young's modulus [PSI]


Y = Yield strength [PSI]

H = Tank height [feet]


Critical deflection [inch]: 1.56

OK

Shell Settlement Elevation Graph [inch]

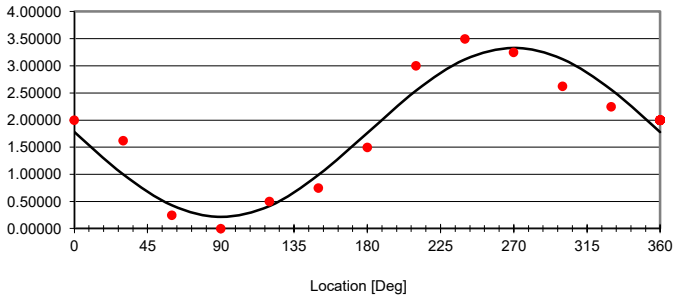

Shell Settlement Deflection Graph [inch]

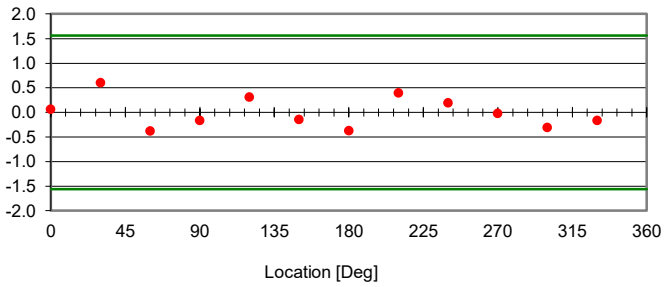

Client: TransMontaigne
Date: July 31, 2026
Tank No.: 201
ROSEN Project No.: 0-1000-18486
Site: Port Everglades, Fl (North)

ROSEN
empowered by technology

Liquid Load Condition

Mechanical Parameters

Design Code			API12C
Tank Type			FRT
Shell Main Material			Unknown
Year of Construction	DOB	yr	1933
Tank Diameter	D	ft	117.00
Tank Height	H	ft	41.25
No. Shell Courses			7
Temp. Correction Factor	φ	*Note 1*	1.000
Nominal Capacity	Vbrut	bbls	78989
Riveted Tank	*Note 3*	y/n	Yes
Joint Efficiency	E		0.90
Evaluation Method	*Note 5*		1-foot

API Standard 653, Sections 4.3.3 and 4.3.4

The following formulas are used in calculating the required minimal thickness of shell courses:

$$t_d = \frac{2.6D(H-1)G}{E.\varphi.S_d}$$

$$t_t = \frac{2.6D(H-1)}{E.S_t}$$

Note 1: Use API Standard 650, Appendix M, in case of operation at elevated temperature (default is 1.0).

Note 2: If material is unknown use Y=30000 / T=55000 and if E is unknown use Table 4.2 of API Standard 653.

Note 3: For riveted tanks use S = 21000 PSI, unless otherwise specified.

Note 4: Allowable stress S is calculated according to API Standard 653, Sections 4.3.3.1, 4.3.3.2, and Table 4.1.

Note 5:

Recommended Evaluation Method: 1-foot

1. The 1-foot method calculates the thickness required at design points (1 ft. above the bottom of each shell course).

2. The 1-foot method shall not be used for tanks with D > 200 ft.

Product Conditions (t_d)

Specific Gravity	G	[-]	0.88
Filling Height	*h*	ft	36.60
Maximum Safe Filling Height	*h*	ft	36.60

Course No.	Course Height [feet]	Product Height [feet]	Material Yield Y [PSI]	Material Tensile T [PSI]	Allowable Stress S [PSI]	Joint Efficiency Factor E	Minimum Calculated t [inch]	Minimum Allowable t [inch]	Measured t min [inch]	Integrity Check
7	5.50	0.85	30000	55000	21000	0.60	-0.003	0.100	0.228	OK
6	5.88	6.73	30000	55000	21000	0.60	0.122	0.122	0.236	OK
5	5.79	12.52	30000	55000	21000	0.70	0.210	0.210	0.312	OK
4	5.42	17.93	30000	55000	21000	0.70	0.308	0.308	0.401	OK
3	5.96	23.89	30000	55000	21000	0.75	0.389	0.389	0.401	OK
2	6.21	30.10	30000	55000	21000	0.90	0.412	0.412	0.478	OK
1	6.50	36.60	30000	55000	21000	0.90	0.504	0.504	0.585	OK

Client: TransMontaigne
Date: July 31, 2026
Tank No.: 201
ROSEN Project No.: 0-1000-18486
Site: Port Everglades, FI (North)

ROSEN
empowered by technology

Liquid Load Condition, contd.

Hydrotest Conditions (t_t)

Specific Gravity	G	[-]	1.00
Max Fill Height for Hydrotest	*h*	ft	34.47

Course No.	Course Height [feet]	Product Height [feet]	Material Yield Y [PSI]	Material Tensile T [PSI]	Allowable Stress S [PSI]	Joint Efficiency Factor E	Calculated t min [inch]	Min. Allowable t [inch]	Measured t min [inch]	Integrity Check
7	5.50	0.00	30000	55000	21000	0.60	-0.024	0.100	0.228	OK
6	5.88	4.60	30000	55000	21000	0.60	0.087	0.100	0.236	OK
5	5.79	10.39	30000	55000	21000	0.70	0.194	0.194	0.312	OK
4	5.42	15.80	30000	55000	21000	0.70	0.306	0.306	0.401	OK
3	5.96	21.76	30000	55000	21000	0.75	0.401	0.401	0.401	OK
2	6.21	27.97	30000	55000	21000	0.90	0.434	0.434	0.478	OK
1	6.50	34.47	30000	55000	21000	0.90	0.539	0.539	0.585	OK

Yield Strength Reduction Factors (API Standard 650 - Appendix M)
For operating temperatures above 200 °F, the allowable stress shall be multiplied by the applicable reduction factor as given in the following table:

	Minimum Specified Yield Strength [PSI]		
Temp. [°F]	< 45,000 [PSI]	≥ 45,000 to < 55,000 [PSI]	≥ 55,000 [PSI]
201	0.91	0.88	0.92
300	0.88	0.81	0.87
400	0.85	0.75	0.83
500	0.80	0.70	0.79


Note: Linear interpolation shall be applied for intermediate values.

Joint Efficiency Factors

Type of Joint	No. of Rivet Rows	Joint Efficiency *E*
Lap	1	0.45 [0.60]
Lap	2	0.60 [0.73]
Lap	3	0.70 [0.73]
Lap	4	0.75
Butt	2	0.75
Butt	3	0.85
Butt	4	0.90 [0.87]
Butt	5	0.91 [0.91]
Butt	6	0.92

Butt-welded tanks — Use table 4.2 of API Standard 653
Lap-welded tanks — Use table 4.2 of API Standard 653 or use E=0.75

Riveted tanks — Use the following table (conforms to API Standard 653 Table 4.3)



Butt: i.e. number of rows on each side of joint center line

Client: TransMontaigne
Date: July 31, 2026
Tank No.: 201
ROSEN Project No.: 0-1000-18486
Site: Port Everglades, Fl (North)

ROSEN
empowered by technology

Shell Assessment (Minimum Allowable Shell Thickness)

Mechanical Parameters

Installation Date DOB year 1933
Last Inspection Date LID year 2026 Intended Next Service Period years 20

Minimum Allowable Shell Thickness for Load Case Liquid Load and Roof Load:

Course No.	min t Allowable Roof Load [inch]	min t Allowable Liq. Load [inch]	Min. Allowable [inch]	min Thickness Measured [inch]	Integrity Check
7	0.007	0.100	**0.100**	0.228	OK
6	0.045	0.122	**0.122**	0.236	OK
5	0.063	0.210	**0.210**	0.312	OK
4	0.081	0.308	**0.308**	0.401	OK
3	0.098	0.389	**0.389**	0.401	OK
2	0.114	0.412	**0.412**	0.478	OK
1	0.131	0.504	**0.504**	0.585	OK

Note 1: Minimum allowable thickness for roof load has been calculated for fa=Fa.

Conclusion:
Minimum uniform thickness as measured for the individual shell courses are greater than as required for the liquid load and uniform roof load. Thus, OK.

Remaining Life Assessment and Inspection Frequency

API Standard 653, Section 6.3.2 - External Inspection

6.3.2.1 All tanks shall be given a visual external inspection by an authorized inspector. This inspection shall be called the external inspection and must be conducted at least every five years or RCA/4N years (where RCA is the difference between the measured shell thickness and the minimum required thickness in mils, and N is the shell corrosion rate in mils per year) whichever is less. Tanks may be in operation during this inspection.

API Standard 653, Section 6.3.3 - Ultrasonic Thickness Inspection

6.3.3.1 External, ultrasonic thickness measurements of the shell can be a means of determining a rate of uniform general corrosion while the tank is in service, and can provide an indication of the integrity of the shell. The extent of such measurements shall be determined by the owner/operator.
6.3.3.2 When used, the ultrasonic thickness measurements shall be made at intervals not to exceed the following.
a) When the corrosion rate is not known, the maximum interval shall be five years. Corrosion rates may be estimated from tanks in similar service based on thickness measurements taken at an interval not exceeding five years.
b) When the corrosion rate is known, the maximum interval shall be the smaller of RCA/2N years (where RCA is the difference between the measured shell thickness and the minimum required thickness in mils, and N is the shell corrosion rate in mils per year) or 15 years.

Course No.	Original WT Assumed [in]	Min. WT Measured [in]	CR Measured [in/yr]	WT Min. Allowable [in]	CA [in]	RL (CA/CR) [years]	External Inspection (CA/4CR) [years]	UT Inspection (CA/2CR) [years]
7	0.250	0.228	0.000237	0.100	0.128	541	135.3	270.5
6	0.250	0.236	0.000151	0.122	0.114	760	189.9	379.9
5	0.375	0.312	0.000677	0.210	0.102	151	37.7	75.5
4	0.438	0.401	0.000392	0.308	0.093	236	59.0	118.0
3	0.438	0.401	0.000392	0.389	0.012	30	7.6	15.2
2	0.500	0.478	0.000237	0.412	0.066	278	69.6	139.1
1	0.625	0.585	0.000430	0.504	0.081	188	46.9	93.9
		Maximum CR:	0.000677		Minimum Allowable:		5.0	15.0

Recommendations:

Since the intended next service period is 20 years, the following interval is to be considered.

Next External inspection by an authorized inspector should be carried out not later than: 2031.


Next External UT inspection of the shell (and roof) should be carried out not later than: 2041.

NB: Local regulations/conditions may have affect on the above recommendations.

Client: TransMontaigne
Date: July 31, 2026
ROSEN Project No.: 0-1000-18486
Tank Number: 201

ROSEN
empowered by technology

Shell Thickness Measurements

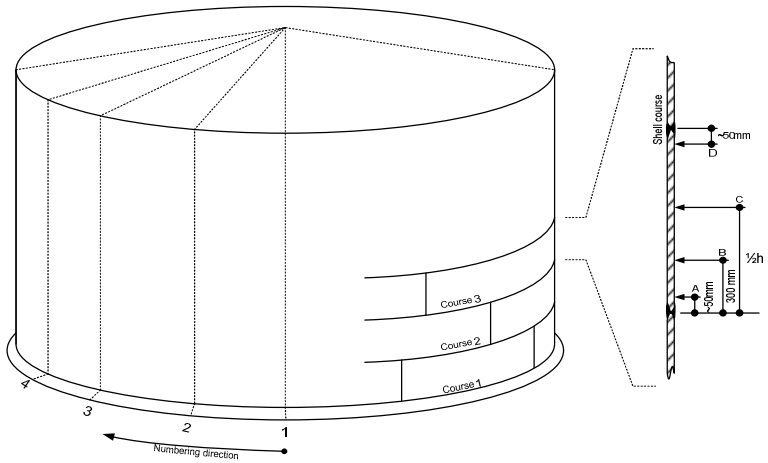

NORTH

Course	Height [ft]
7	5.50
6	5.88
5	5.79
4	5.42
3	5.96
2	6.21
1	6.50
Total [ft]	**41.25**


Location		Pos. 1	Pos. 2	Pos. 3	Pos. 4		
Course	Pos.	[in]	[in]	[in]	[in]		
7	A	0.228	-	-	-	Min	**0.228**
	B	0.229	-	-	-	Max	**0.229**
	C	0.228	-	-	-	Average	**0.228**
	D	0.228	-	-	-	STDEV	**0.001**
6	A	0.236	-	-	-	Min	**0.236**
	B	0.237	-	-	-	Max	**0.238**
	C	0.238	-	-	-	Average	**0.237**
	D	0.237	-	-	-	STDEV	**0.001**
5	A	0.318	-	-	-	Min	**0.312**
	B	0.312	-	-	-	Max	**0.318**
	C	0.315	-	-	-	Average	**0.315**
	D	0.314	-	-	-	STDEV	**0.003**
4	A	0.406	-	-	-	Min	**0.401**
	B	0.404	-	-	-	Max	**0.406**
	C	0.404	-	-	-	Average	**0.404**
	D	0.401	-	-	-	STDEV	**0.002**
3	A	0.407	-	-	-	Min	**0.401**
	B	0.407	-	-	-	Max	**0.411**
	C	0.411	-	-	-	Average	**0.407**
	D	0.401	-	-	-	STDEV	**0.004**
2	A	0.478	-	-	-	Min	**0.478**
	B	0.481	-	-	-	Max	**0.482**
	C	0.481	-	-	-	Average	**0.481**
	D	0.482	-	-	-	STDEV	**0.002**
1	A	0.588	0.591	0.588	0.585	Min	**0.585**
	B	0.592	0.594	0.593	0.597	Max	**0.597**
	C	0.594	0.592	0.591	0.591	Average	**0.592**
	D	0.593	0.593	0.595	0.595	STDEV	**0.003**

Client: TransMontaigne
Date: July 31, 2026
ROSEN Project No.: 0-1000-18486
Tank Number: 201

ROSEN
empowered by technology


Shell Appurtenances

ID Legend	
SP	Support
SV	Shell Vent
M	Manway
N	Nozzle
FL	Fire Line
G	Grounding Lug
ANC	Anchor
SWB	Stairway - Bottom
SWT	Stairway - Top
CW	Catwalk

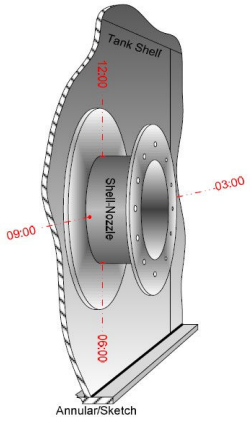


ID (from legend)	ID	Nozzle	Nozzle Neck					Flange	Reinforcing Plate				Weld Spacing	
		Function	NPS [in]	12:00 [in]	03:00 [in]	06:00 [in]	09:00 [in]	WT [in]	WT [in]	Shape	H [in]	W [in]	H-1 [in]	H-2 [in]
M	A	Manway	24.00	0.364	0.362	0.362	0.366	0.484	0.513	C	48.00	50.00	8.00	30.00
N	B	Blank Nozzle	8.00	0.322	0.321	0.321	0.319	1.133	0.512	C	24.00	28.00	28.00	40.00
N	C	Threaded Capped Pipe	2.00	-	-	-	-	-	-	-	-	-	0.00	2.00
N	D	Water Draw	2.00	0.239	0.242	0.241	0.240	1.557	-	-	-	-	7.00	9.00
N	E	Low Suction	10.00	0.396	0.398	0.398	0.398	1.214	0.513	A	18.00	18.00	15.00	24.00
N	F	High Suction	16.00	0.543	0.539	0.541	0.539	1.488	0.634	B	34.00	42.00	14.00	32.00
N	G	Inlet	10.00	0.775	0.774	0.748	0.748	1.251	0.869	A	16.00	16.00	8.00	16.00
N	H	Analog Temp. Probe	1.50	-	-	-	-	-	-	-	-	-	33.50	35.00
SP	I	Varec Gauge	-	-	-	-	-	-	-	-	-	-	-	64.00
SP	J	Vertical Ladder	-	-	-	-	-	-	-	-	-	-	-	-
SP	K	Vertical Stairway	-	-	-	-	-	-	-	-	-	-	-	-
M	L	Manway	20.00	0.498	0.489	0.500	0.495	0.606	0.761	A	46.00	46.00	6.00	28.00
G	M	Grounding Lug	-	-	-	-	-	-	-	-	-	-	-	20.00
N	N	Outlet To Rack	6.00	0.320	0.321	0.323	0.324	1.214	-	-	-	-	44.00	48.00
N	O	Steam Inlet	2.00	0.201	0.201	0.180	0.199	0.791	-	-	-	-	17.50	19.00
N	P	Steam Inlet	2.00	0.199	0.202	0.200	0.202	0.789	-	-	-	-	17.50	19.00
N	Q	Steam Inlet	2.00	0.200	0.200	0.197	0.192	0.764	-	-	-	-	17.50	19.00
N	R	Steam Inlet	2.00	0.198	0.199	0.204	0.201	0.790	-	-	-	-	17.50	19.00
N	S	Steam Inlet	2.00	0.199	0.199	0.200	0.179	0.767	-	-	-	-	17.50	19.00
N	T	Suction	16.00	0.378	0.374	0.374	0.376	1.496	0.512	B	34.00	42.00	10.00	24.00
N	U	Water Draw	2.00	0.158	0.158	0.183	0.187	0.634	-	-	-	-	7.00	9.00
N	V	Condensate Outlet	2.00	0.196	0.196	0.202	0.200	0.668	-	-	-	-	10.00	12.00
N	W	Condensate Outlet	2.00	0.201	0.195	0.199	0.196	0.664	-	-	-	-	10.00	12.00
N	X	Condensate Outlet	2.00	0.203	0.197	0.195	0.197	0.666	-	-	-	-	10.00	12.00
N	Y	Condensate Outlet	2.00	0.201	0.203	0.200	0.199	0.666	-	-	-	-	10.00	12.00
N	Z	Condensate Outlet	2.00	0.197	0.201	0.196	0.203	0.663	-	-	-	-	10.00	12.00

H-1 is the measurement from the projection plate to the bottom of the reinforcing plate or from the projection plate to the bottom of the nozzle.
H-2 is the measurement from the projection plate to the center of the nozzle.

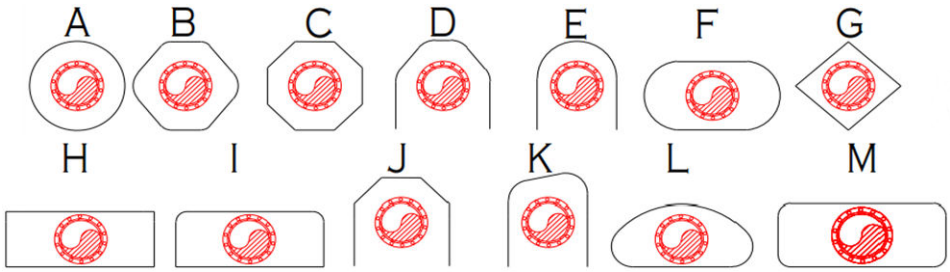

Client: TransMontaigne
Date: July 31, 2026
ROSEN Project No.: 0-1000-18486
Tank Number: 201

Fixed Roof Appurtenances

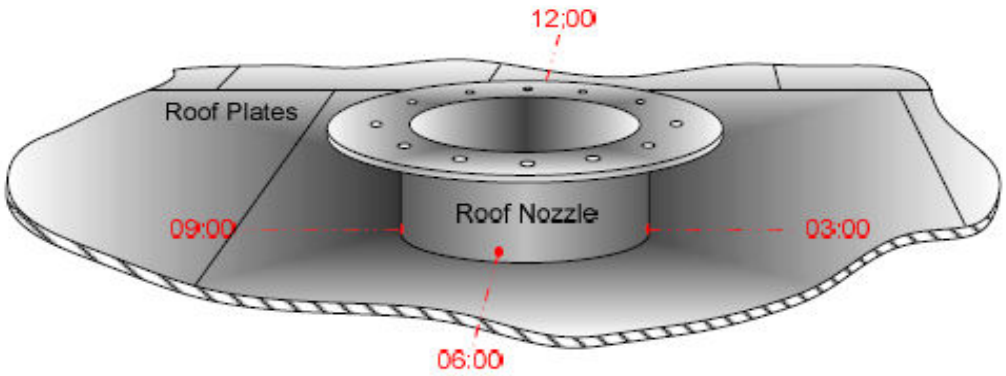

ID	Nozzle	Nozzle Neck					Flange	Reinforcing Plate	
	Function	NPS [in]	12:00 [in]	03:00 [in]	06:00 [in]	09:00 [in]	WT [in]	WT [in]	Diameter [in]
A	Manway	24.00	0.204	0.199	0.201	0.206	0.189	-	-
B	Blank Nozzle	3.00	0.154	0.149	0.141	0.149	0.819	0.241	10.00
C	Blank Nozzle	3.00	0.146	0.144	0.140	0.142	0.820	0.246	10.00
D	Gauge Tape Wire	1.50	-	-	-	-	-	-	-
E	Gauge Tape Float	2.00	-	-	-	-	-	-	-
F	Gauge Tape Wire	1.50	-	-	-	-	-	-	-
G	Gooseneck Vent	12.00	0.250	0.246	0.249	0.243	1.304	0.231	24.00
H	Atmospheric Vent	12.00	0.487	0.484	0.490	0.487	-	0.244	24.00
I	Atmospheric Vent	12.00	0.481	0.483	0.487	0.491	-	0.239	24.00
J	Tank Radar	8.00	0.241	0.238	0.243	0.249	0.967	0.230	18.00
K	Level Alarm	8.00	0.244	0.241	0.240	0.238	0.984	0.234	18.00
L	Gauge Hatch	8.00	0.254	0.249	0.247	0.251	1.028	0.240	18.00
M	Scaffold Support	4.00	0.170	0.169	0.164	0.167	-	0.264	10.00