


PIC GPIO: 2 destinations still missing

U4 / PIC16F18855 / 28-pin SOIC | Pin numbers are physical package numbers, not schematic drawing order.

Orange = onward destination unknown Grey = already represented, sometimes still inferred

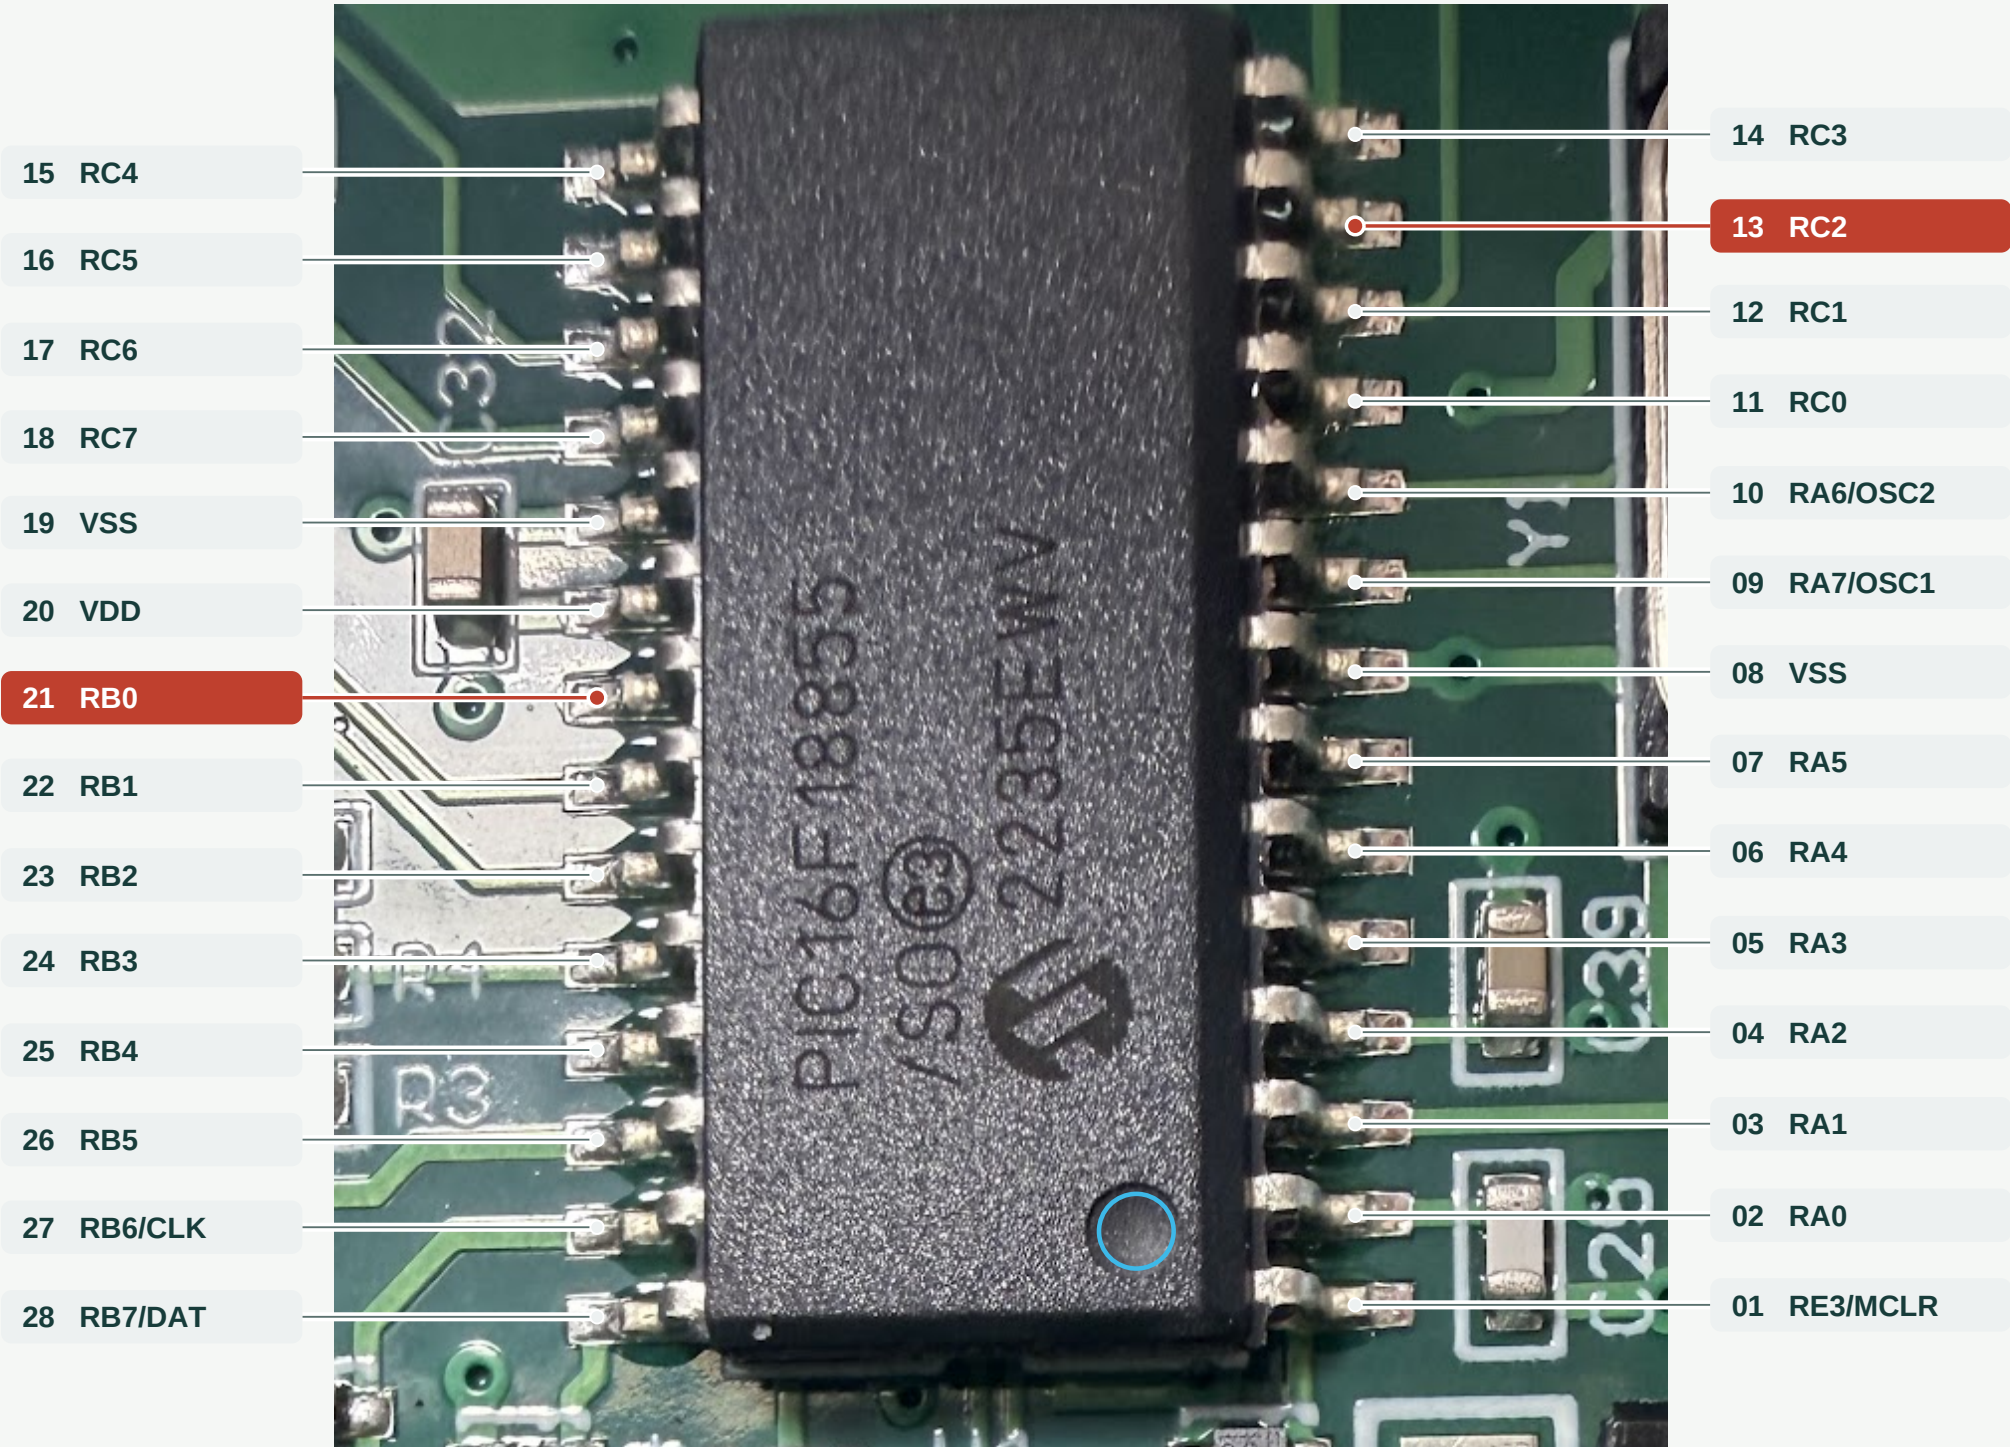

Orientation: pin 1 is at the lower right, beside the round moulded dot (blue ring).

Right row: bottom to top 1-14. Left row: top to bottom 15-28. Do not mirror the image.

Unpowered checks: disconnect battery and programmer. Compare low readings with your shorted-probe baseline (about 0.5 ohm).

Reply example: U4.3 -> Rxx, left pad -> 0.7 ohm. A visual trace is useful too. Give exact pads and actual ohms, rather than only a beep.

Orange lines are callout leaders, not traced copper. Source: your new close-up; original photograph pixels retained.

Pinout: Microchip DS40001802G, page 4. Current schematic: v0.9.6. Date: 2026-10-08. Full details: evidence/pic_gpio_request.json.

Connection checklist

Two local vias known; onward destinations missing.

Pin	GPIO	Current observation
13	RC2	V049; onward unknown
21	RB0	V026; onward unknown

Tuning controls resolved: 5/RA3 -> R14 (V036-V108); 6/RA4 -> R15 (V037-V102); 7/RA5 -> R16 (V039-V097); 11/RC0 -> R11 (V047-V091). Existing 17/RC6 -> R13 retained.

Motor controls resolved: 15/RC4 -> U5.2 INA (V022-V016); 16/RC5 -> U5.3 INB (V023-V019). User-reported connections.

User meter + visual trace: 3-R28/R29/TP7; 17-R13; 22-TP2; 23-TP1; 25-TP4. 26-TP10 corroborated. Numerical ohms not supplied.

12: VREF/V053 | 2: C25 | 4: C39 | 14: TP11 | 18: TP17 | 24: R4 | 26: TP10/R35 | 27/28: ICSP nodes.

These are not included in the orange pins. No visible route is not proof of NC. No no-connect flags were added. RP7 wording interpreted as photographed TP7.