

Customer: RALEC KUNSHAN		Date: 26-May-16	Time: 14:30
Participant From Maruwa	Participant From Organizer	Report To	
1. Mr Ogawa MM MD	1. Mr Spring R&D Chief	1. Mr.Anthony,Mr.Ogawa	
2. Mr Takimoto Shanghai Sales	2. Ms Lee IQC SUPV	2. Mr.Seeni,Mr.Naga,Mr.Sinna	
3. Mr Matsumoto JM Sales	3. Mr Gao IQC Chief	3. Mr.Theva,Mr.Shahrudin,Mr.Fauzi	
4. Sivakumar MMSB QA	4	4 Mr. Matsumoto	
5. Ronny Fang Shanghai Sales	5.	5.	


Agenda

Meeting started of with Quality group.

RALEC facing 2 technical problem


1. RA12-4

Slit line width unbalance

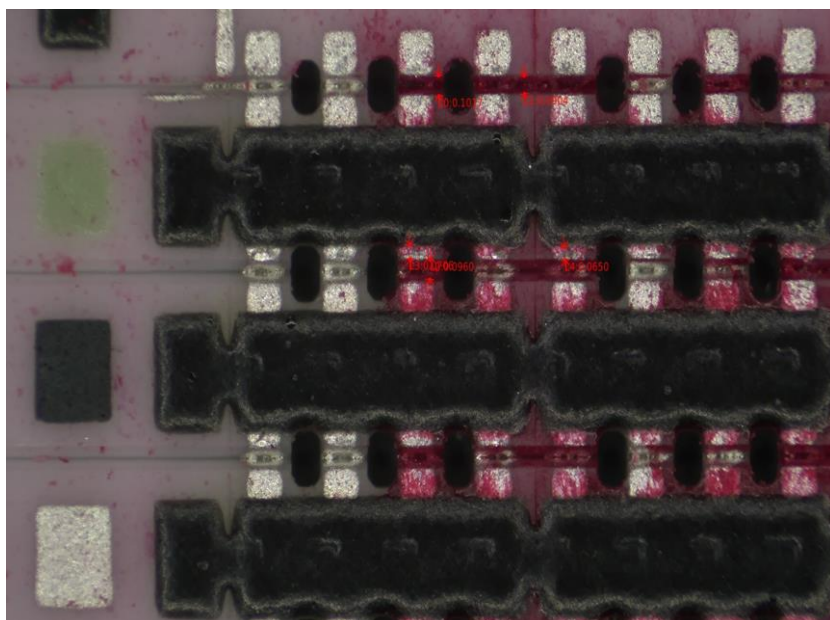


1st Slit & 2nd Slit shows the width imbalance. Potential Failure is

a. Slit's V Groove different size

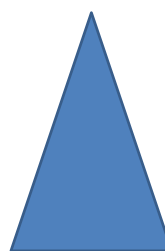

1st Slit

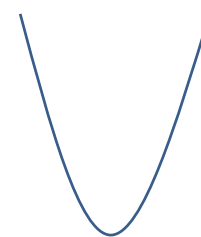

Centre slit


=> Mould 1st slit repaired after pressing some qty

=> Noticed shedder mark on product

This causes need to be checked before concluding

PIC: Mr Prasan
Mr Izumo & Mr Naga

2. MA02-4C/2C - Printing shifted

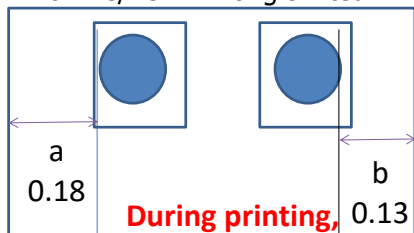

There is no abnormal on the product base from the drawing.

MARUWA need to check back the thru hole shifted measurement where currently control max 30u but need to be changed to 20~ 25u

Need to confirm with process capability

MARUWA calculation

$$a-b = c/2 < 30u$$

$$0.18 - 0.13 = 0.05/2 = 0.025$$

=> Need to confirm by mould capability to control the spec below 20u

PIC: Mr Muto/Mr Naga

3. 7910M- R & L evaluation

RALEC approved the 5000pcs sample and requested to ship additional 50kpcs in June'16


Total Return

MA02-2C	5000pcs	June'16
---------	---------	---------

Meeting adjourned at 4:30pm

Conclusion & Opinion

Current issue at RALEC is on the technical issue. Need to focus more especially manual press product (HIGH VALUE) & mould control

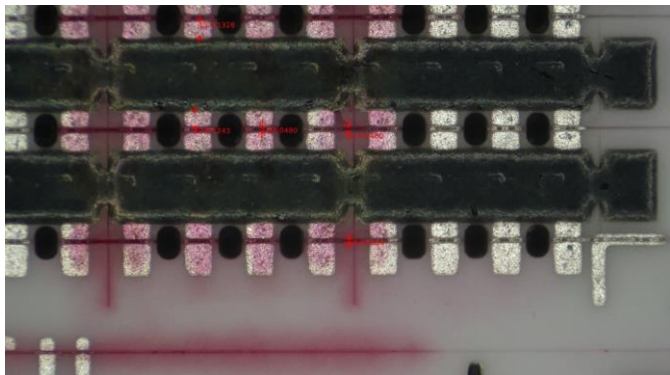No	Complaint / Request	Product	Image	Details	MARUWA Comment	PIC	DATE
1	Slit width NG	RA12-4		Slit size different compare to the standard size. Standard: 40u Actual: 110u Failure % : 30%	Received NG Sample and will review the NG Suspected: a. Mould overshoot b. Slit unbalance - 1st slit repaired	Mr Izumo Mr Naga	ASAP
2	Lot No indication	All product			Maruwa will include small label on bundle from April 16 shipment onwards	Mr Peter (warehouse)	April 2016 shipment
3	Printing unbalance	MA02-2C MA02-4C		After printing, printing area no balance between the hole.	Need to confirm the thru hole shifted spec from 30u to 20u	Mr Muto Mr Naga	ASAP
4	Angle (+/-)	7910M		5K Sample evaluated => Result OK Request : 50kpcs	Result OK	Mr Nazli	June'16