

Supplier Visit #2

CDCQ Press/Mould– Foshan

Date: 18/Feb

Time : 8:30am ~ 12:30pm

CONFIDENTIAL

New 20ton (2U/2D) Press machine

Review –
Changes & Improvement point

日邦客户机台20T-C06计划表交期2025. 03.

序号	工作内容	开始时间		完成时间		所用时间		负责人
		计划时间	实际时间	计划时间	实际时间	计划天数	实际天数	
1	技术出图	PLAN	ACTUAL	12-15	12-15	7		奉延宇
2	机架交期	12-16	12-16	2-21		67		黄万长
3	钣金交期	12-16	12-16	2-21		67		黄万长
4	烤漆时间	2-22		2-27		5		黄万长
5	电机交期	12-16	12-16	2-28		74		范钦云
6	丝杆交期	12-15	12-15	3-10		85		范钦云
7	零配件制作时间	12-16	12-16	2-23		69		黄万长
8	生产组装	3-11		3-18		7		向友华
9	程序调试	3-19		3-23		4		向友华
10	设备检测	3-24		3-28		4		向友华
11	设备交付	3-29		3-30		1		晚宜

Plan to reduce by 7 days

Current ETD :30/Mar

New Schedule : 24/Mar


Leadtime will reduce by 7 days

Improvement point

Powder rubbish hopper - Need to add in

回复：20T-C06机型上追加

Re: Added on the 20T-C06 model

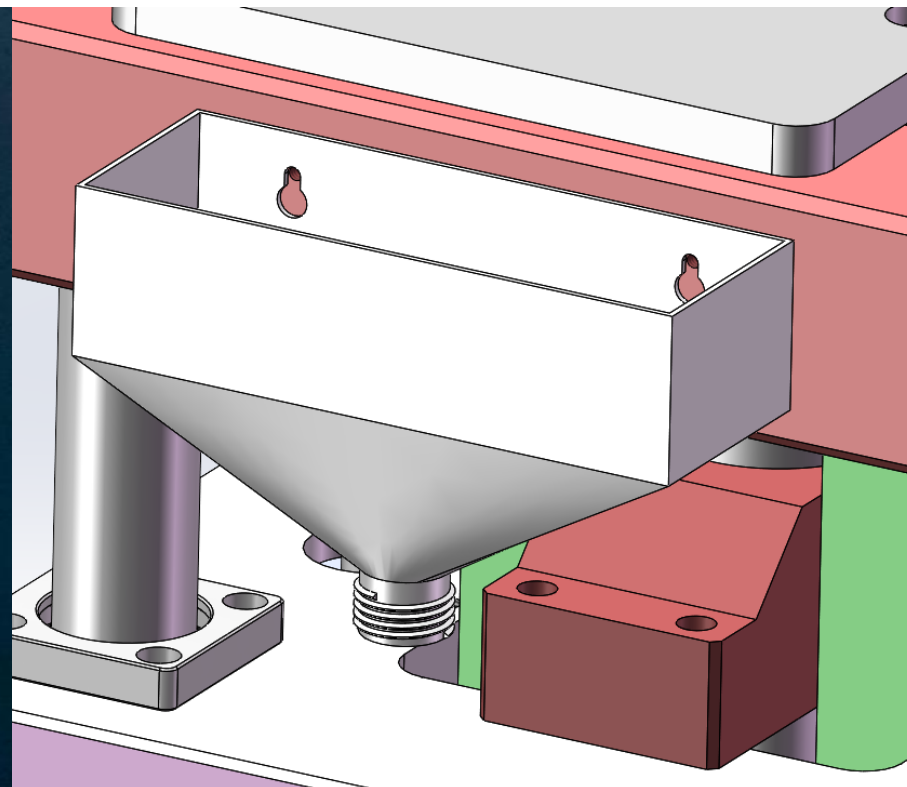


OK

Increase the hopper capacity to 80KG
将料斗容量增加到80公斤

20KG

回复: **80KG**太大没有位置放
料斗容量变更为**40KG**

Re: 80KG is too big and there is no place to put it
Hopper capacity change to 40kg

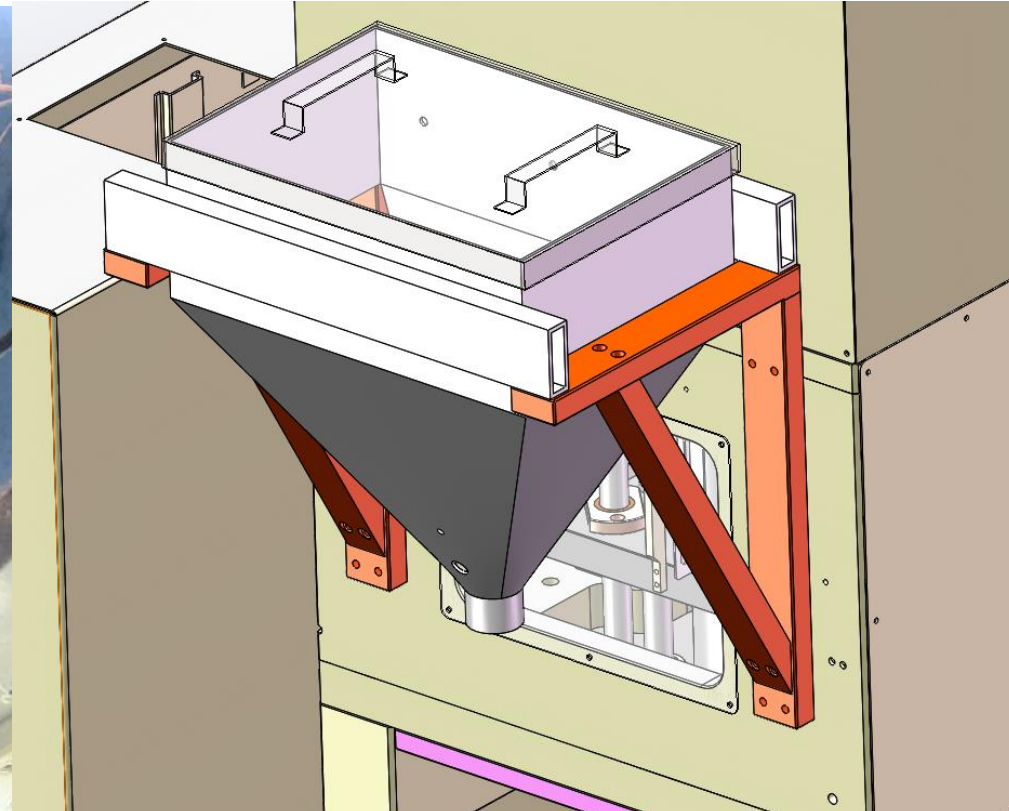


OK

- The alignment shifts during pressing or after exceeding the maximum load by double pressing. The screws come loose (M6 -> M8).
- When setting up the upper punch, it is difficult to align the screw by turning it downwards.


Require similar like Tamagawa

TAMAGAWA

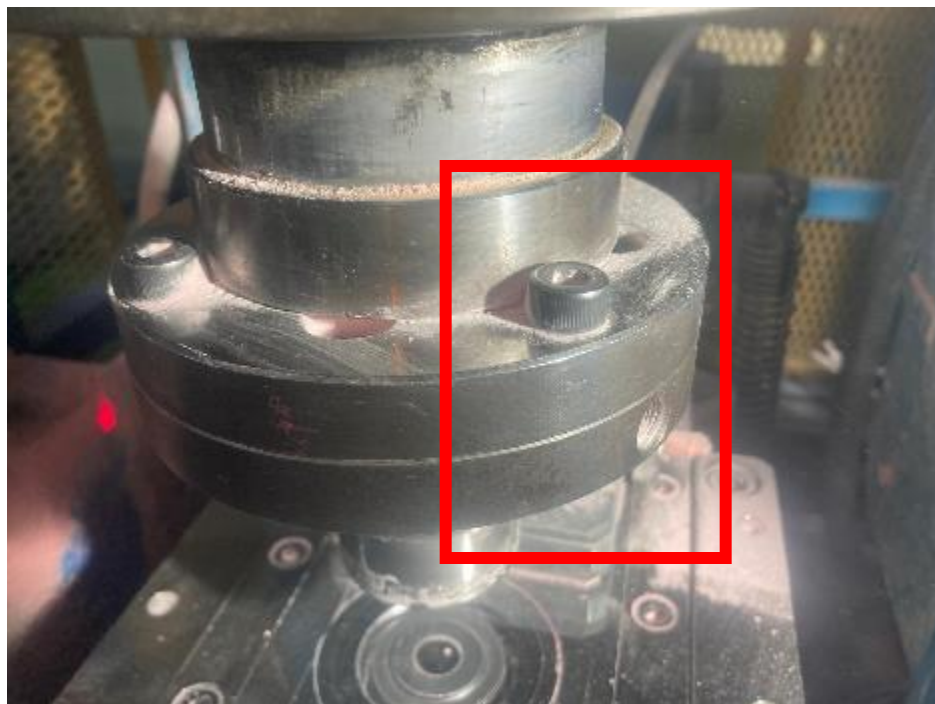

回复：創芯旗

Re: Will comply as per
Maruwa request

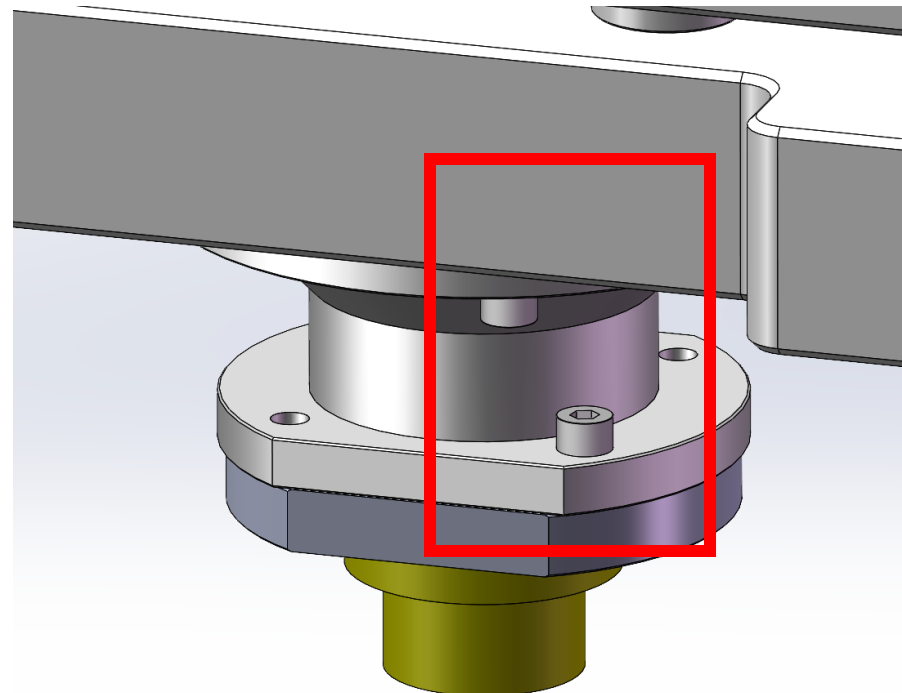


OK

d. Equipment – panel position 回复: 取料机建议放到机台左侧, 方便换模具及操作机台
 Re: It is recommended to put the reclaimer on the left side of the machine to facilitate the change of mold and the operation of the machine

**Please provide the layout drawing*

(Separate image will be send out)

示意图

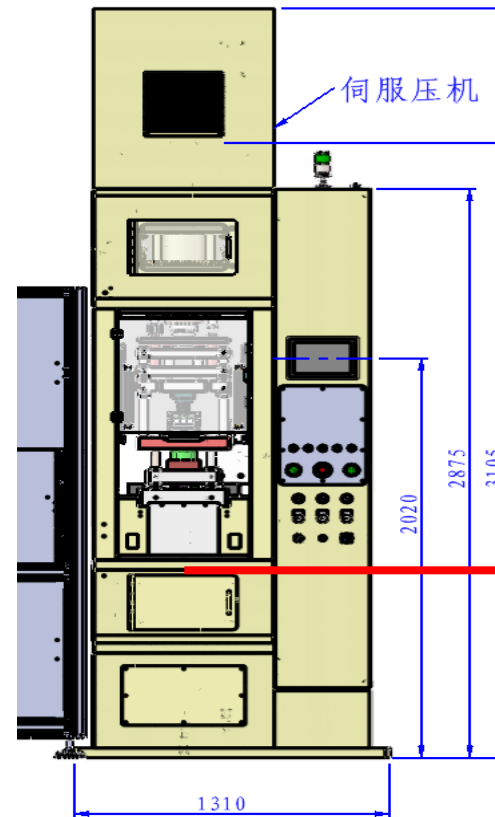

Max limit
 → No any gauge
 below this line

OK

Maruwa requesting the die plate groove angle to be in the range of $6.6^{\circ} \sim 7.0^{\circ}$
=> Final angle will be 6.8°

**OK**


The operator mistook it for the mold cleaning counter and reset it.

→ A confirmation screen is required for mould cleaning

→ Relocate – mould cleaning button separately : operator always mistake

回复：位置更新，后续会出示意图

Re: Location update, intent will be shown later

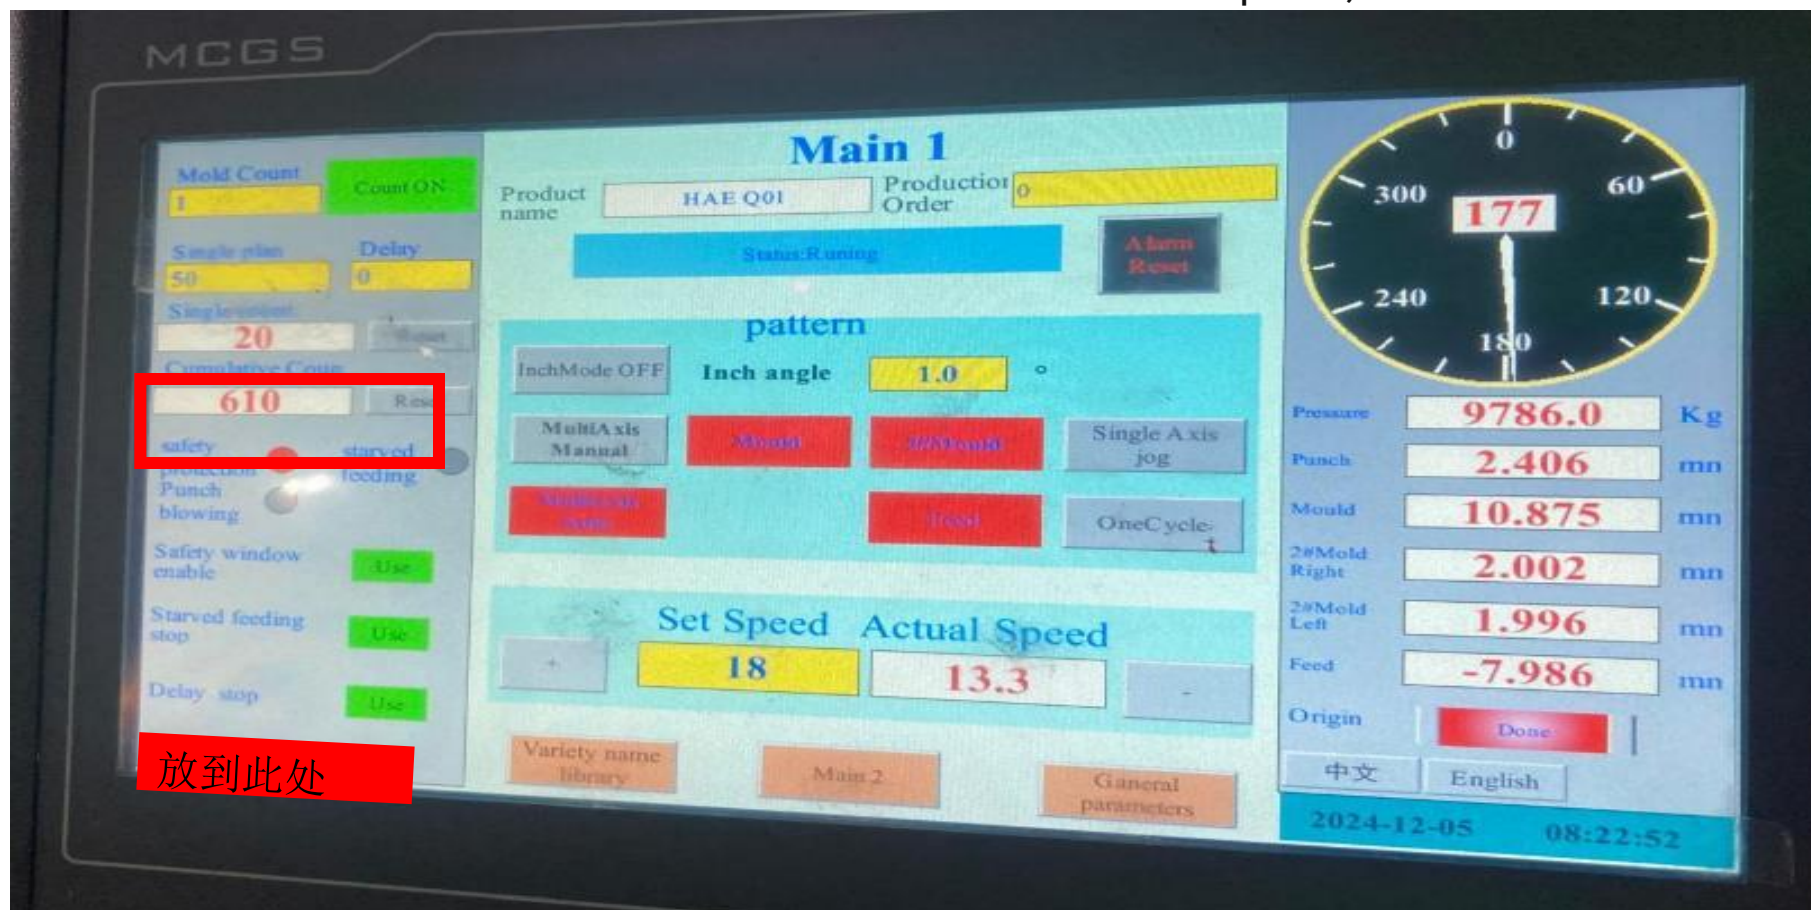

OK

Current problem



- powder filling unbalanced after increased machine speed
- Abnormal sound from feeder box when feeder go front (The time when pressure is high)

回复：跟粉料的流动性有关系，新机的粉盒要高\

Re: It has something to do with the fluidity of the powder, and the powder cartridge of the new machine should be high

售后跟踪，新机处理好才出机

After-sales tracking, the new machine is processed before it is released

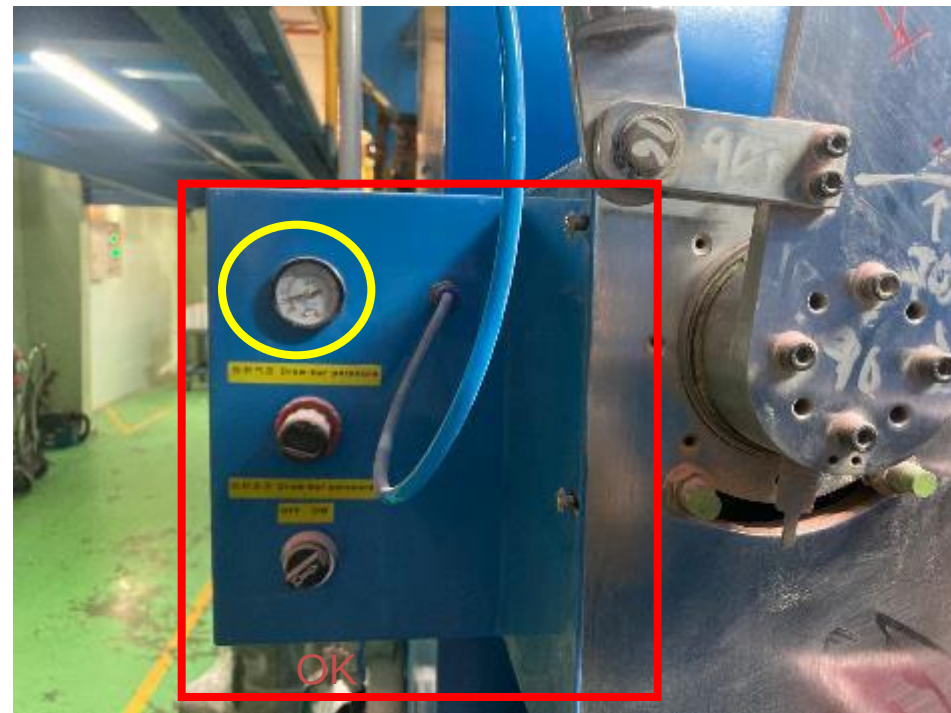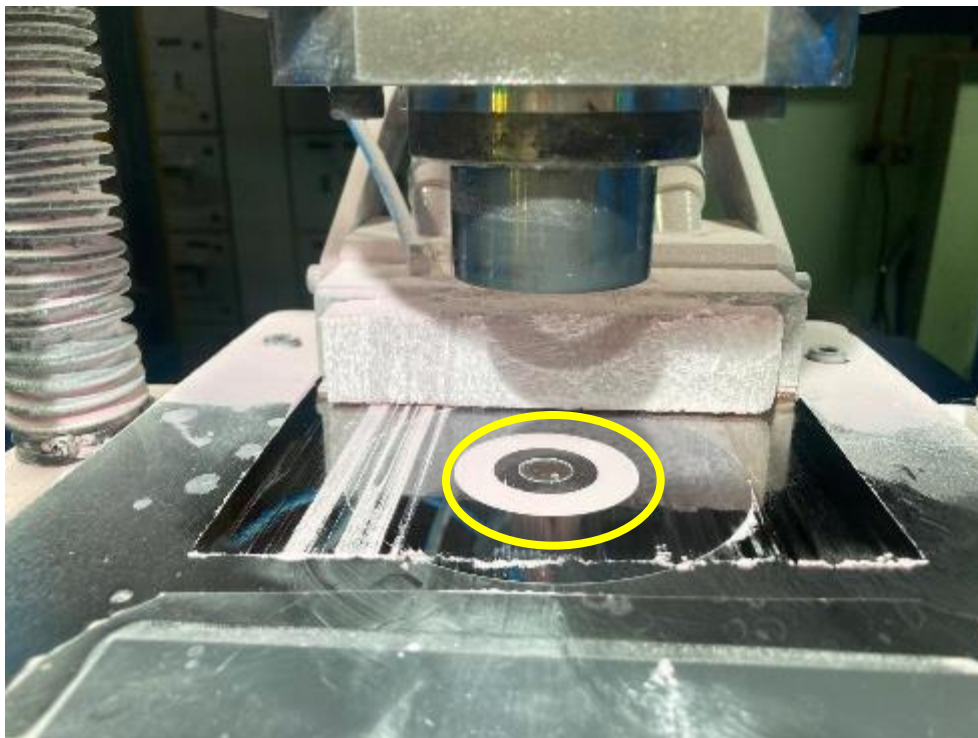

OK

- It will be possible to control the pressure input.
- It will make an emergency stop the moment the pressure reaches this level or exceeds this level. The current function is slow to stop, and will only make an emergency stop once the pressure reaches 15 tons, 19 tons or more.



? **Need to add in auto stop when exceed setting spec**

回复: 售后跟踪, 新机处理好才出机

Re: The pressure setting not activated → will update the software for to enable & disable

Similar software will be update for DP21

All parameter setting will be protected with password where the login will be recorded in the log

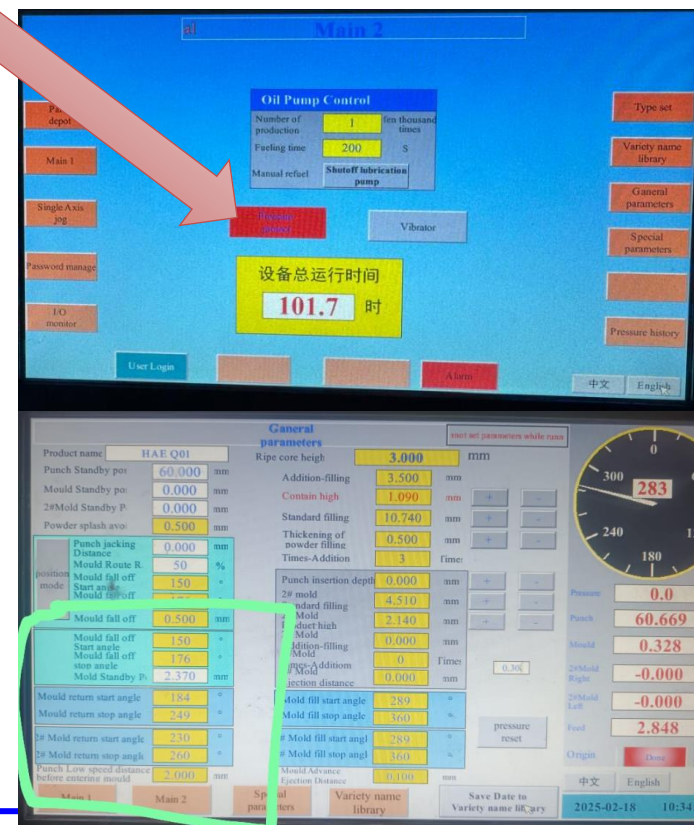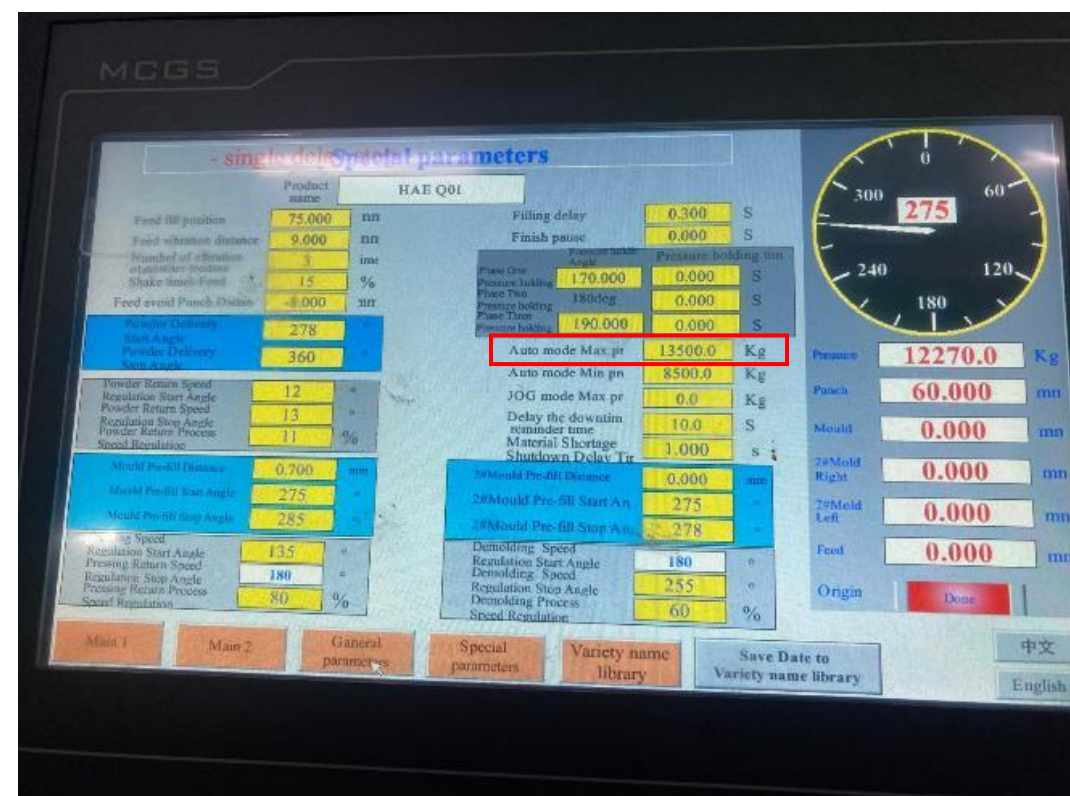

OK

Other requirement

a.Hopper powder heater 回复: 在料斗上只能做到局部加热, 无法让粉末温度均匀, 建议不追加。 Re: Only local heating can be achieved on the hopper, and the powder cannot be evenly heated, so it is recommended not to add it. (OK)


b.Barrier sensor – Custain sensor 回复: 新设备安装安全光栅 (OK)

c.Double punch sensor 回复: 新设备有1个产品检测传感器
The new device has 1 product detection sensor (Location of the sensor & function timing) (OK)

回复: 激光位移传感器可上下移动, 也可以旋转

1.5ms/5ms/10ms可切换

Re: The laser displacement sensor can be moved up and down as well as rotated
1.5ms/5ms/10ms switchable

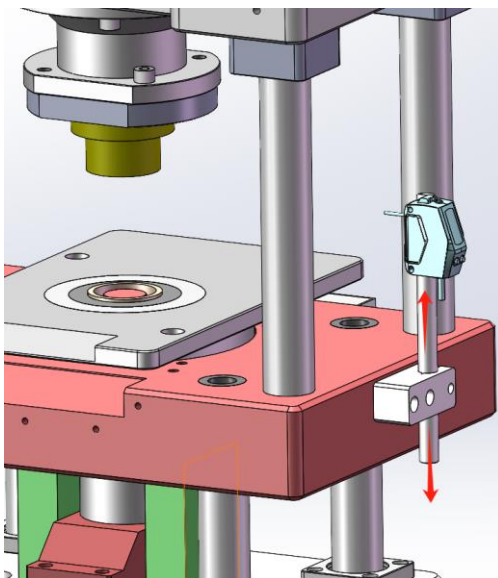

Current Maruwa double punch sensor

Discuss internally to apply similar method

lot Requirement

- * Data transfer parameter


IoT – PLC Setting Parameter Info

IP address : 192.168.3.123
Subnet : 255.255.255.0
Gateway: 192.168.3.254
Port No : **Not available**
Tag No : **Not Available**

Current : DP21
Modbus

New Machine
PLC : Keyence

* Requested to add on LAN port

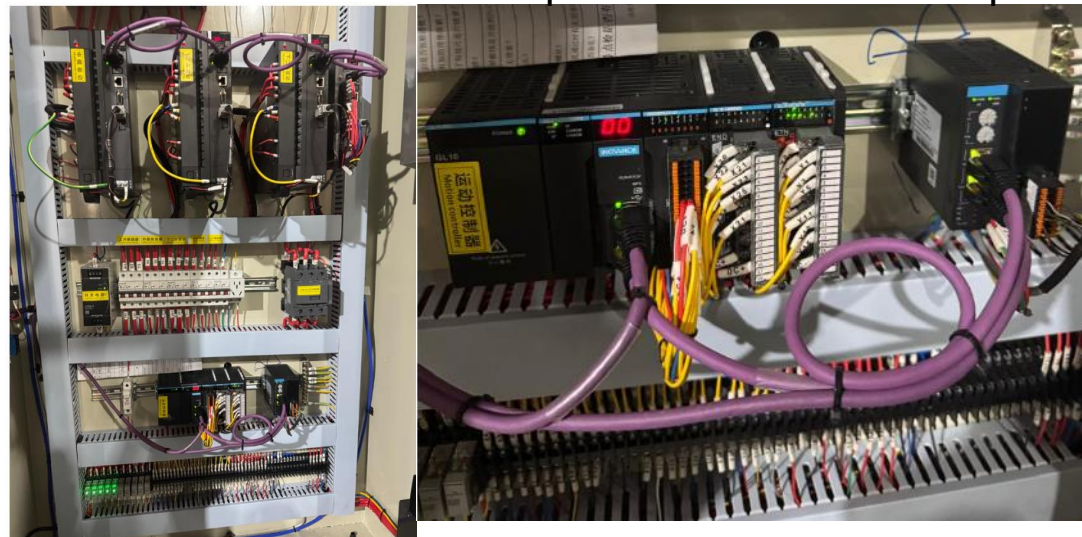

Example – Tag No

FX5S充磁摆盘机
软件名 Chinese Simplified/简
M0 复位
M1 复位标志
M2 自动运行
M7 清零
M8 启动
M9 复位
M10 暂停
M11 模拟运行
M17 HM上料电机
M18 夹紧气缸HMI
M19 夹紧气缸AUTO
M20 充磁HMI
M21 振动盘
M22 输送带
M23 切料气缸HMI
M24 移栽气缸HMI
M25 上下气缸HMI
M26 旋转气缸HMI
M27 推料气缸HMI
M28 轴JOG+
M29 轴JOG-
M30 充磁自动
M31 振动盘
M32 输送带
M33 切料气缸AUTO

CDCQ – Understood & provided

Name	Modbus address	Data type
Mold Count	2050	UDINT
Count OFF/ON	1001.8	BOOL
Single plan	2052	UDINT
Delay	2054	UDINT
Single count	2056	UDINT
Reset	1001.13	BOOL
Cumulative Count	2058	UDINT
Reset	1001.14	BOOL
Safety window enable	1010.0	BOOL
Starved feeding	1010.1	BOOL
stop	1010.3	BOOL
Delay stop	1010.3	BOOL

Address provided
➔ Test on 25/Feb

Mould

CV Mould

MPS276-D02 : MOEN Fix

⇒ No abnormal on dimension

⇒ Sharp edge on upper punch

Quality – par with Tokai

Pricing – Lower by 30% (review)

MPS363 – W01

Drawing – confirmation done

Pricing – Similar with Tung Ho

Mould will be installed in DP23 & 24


Verification : machine buyoff (24/Mar)



Maruwa – Required study by CDCQ
CV/HAE mould coating

→ HAE mould cleaning frequency :
150/cleaning

CDCQ : Will review the coating &
test at new 20ton Press machine

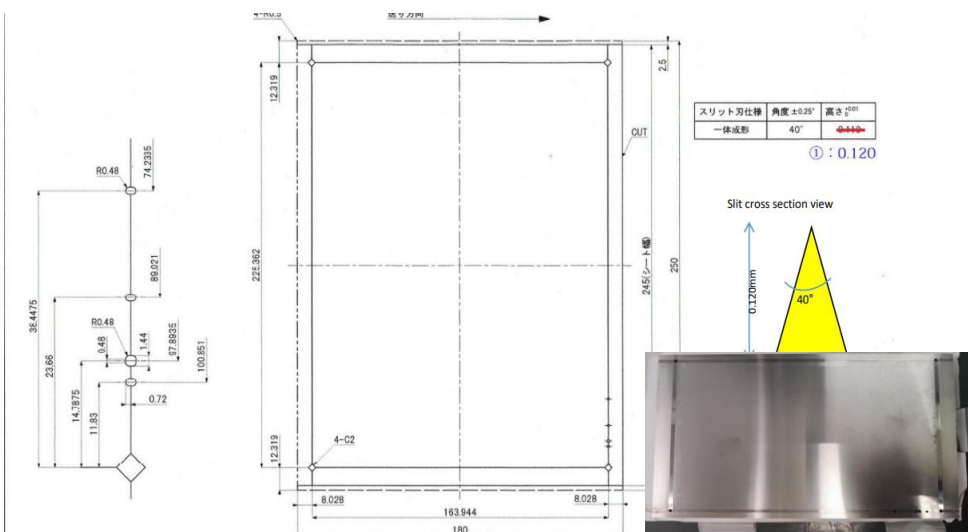

New Project

TPH Shedder Mould : CDCQ (Nippoh)

Mould Engineer :

Have capability to repair TPH mould

→ Evaluate on 0.38d shedder

(Applying exemption)

1st Stage : Confirm the quality (Loose Slit Block)

2nd Stage : Pricing

Pick & Place CV Grinding Machine

Pick & Place For CV/ HAE Grinding

Provided info on the requirement

CDCQ → Will carry out internal discussion to check on this

Proposal – 26/Feb

THANK YOU