

Supplier Visit #2

CDCQ Press/Mould– Foshan

Date: 18/Mar

Time : 8:30am ~ 12:30pm

CONFIDENTIAL

New 20ton (2U/2D) Press machine

Review –
Changes & Improvement point

日邦客户机台20T-C06计划表交期2025.03.

序号	工作内容	开始时间		完成时间		所用时间		主要负责人
		计划时间	实际时间	计划时间	实际时间	计划天数	实际天数	
1	技术出图	12-8	12-8	12-15	12-15	7		奉延宇
2	机架交期	12-16	12-16	2-21		67		黄万长
3	钣金交期	12-16	12-16	2-21		67		黄万长
4	烤漆时间	2-22		2-27		5		黄万长
5	电机交期	12-16	12-16	2-28		74		范钦云
6	丝杆交期	12-15	12-15	3-10		85		范钦云
7	零配件制作时间	12-16	12-16	2-23		69		黄万长
8	生产组装	3-11		3-18		7		向友华
9	程序调试	3-19		3-23		4		向友华
10	设备检测	3-24		3-28		4		向友华
11	设备交付	3-29		3-30		1		晚宜

Updated schedule

Final confirmation : 28.Mar

Packing : 03.Apr

ETD Shenzhen Port : 10.Apr

ETA Port Klang : 17.Apr

ETA MM : 21.Apr


Installation : 23.Apr ~ 04.May

Verification Improvement point


Powder rubbish hopper - Need to add in

回复: 20T-C06机型上追加

Re: Added on the 20T-C06 model

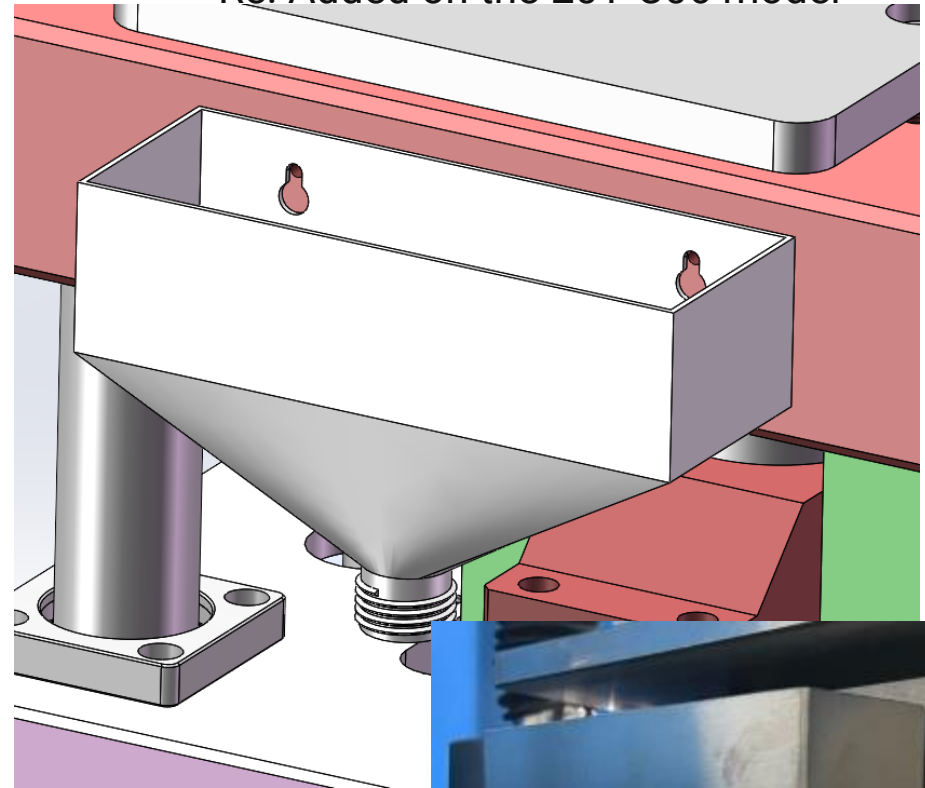

Fix as per
requested

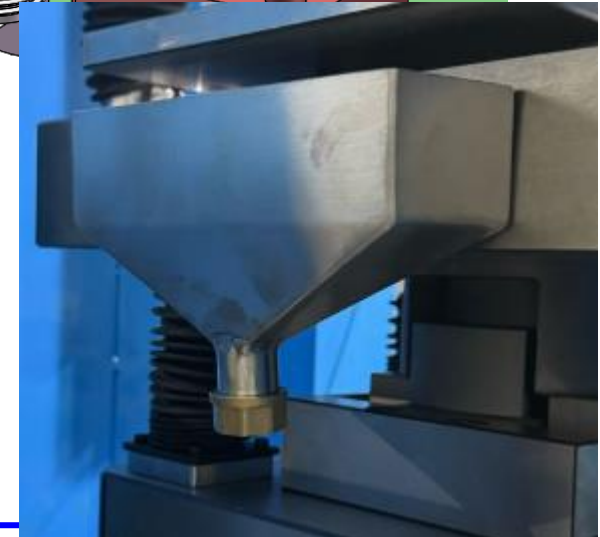


Increase the hopper capacity to 80KG
将料斗容量增加到80公斤

20KG



回复: **80KG**太大没有位置放
料斗容量变更为**40KG**

Re: 80KG is too big and there is no place to put it
Hopper capacity change to 40kg

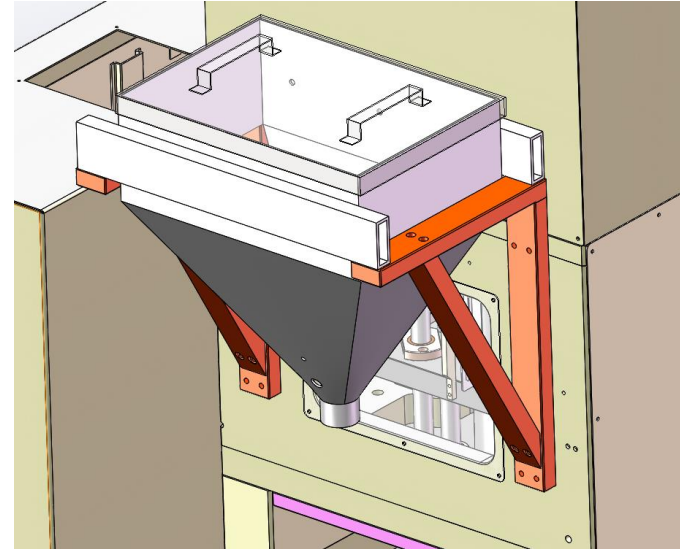


**OK
Completed**

- The alignment shifts during pressing or after exceeding the maximum load by double pressing. The screws come loose (M6 -> M8).
- When setting up the upper punch, it is difficult to align the screw by turning it downwards.


Require similar like Tamagawa

TAMAGAWA

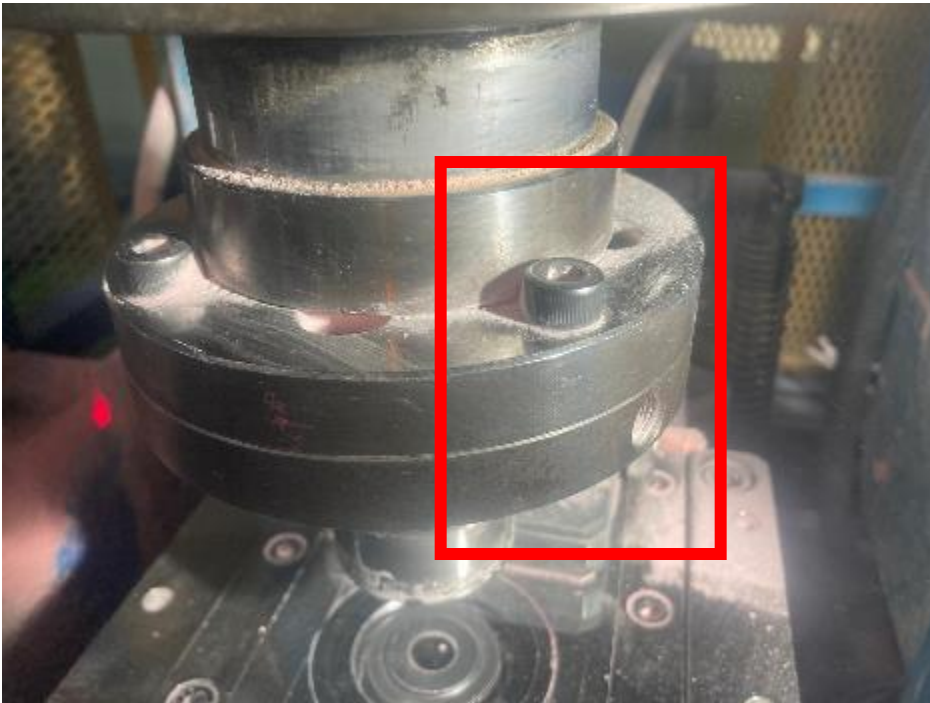

回复：創芯旗

Re: Will comply as per Maruwa request

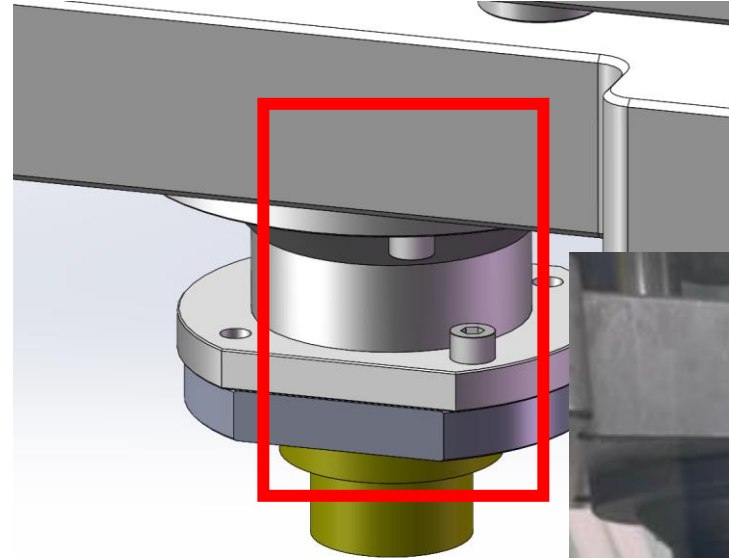

Screw direction changes OK




d. Equipment – panel position 回复: 取料机建议放到机台左侧, 方便换模具及操作机台
 Re: It is recommended to put the reclaimer on the left side of the machine to facilitate the change of mold and the operation of the machine

**Please provide the layout drawing*

(Separate image will be send out)


示意图

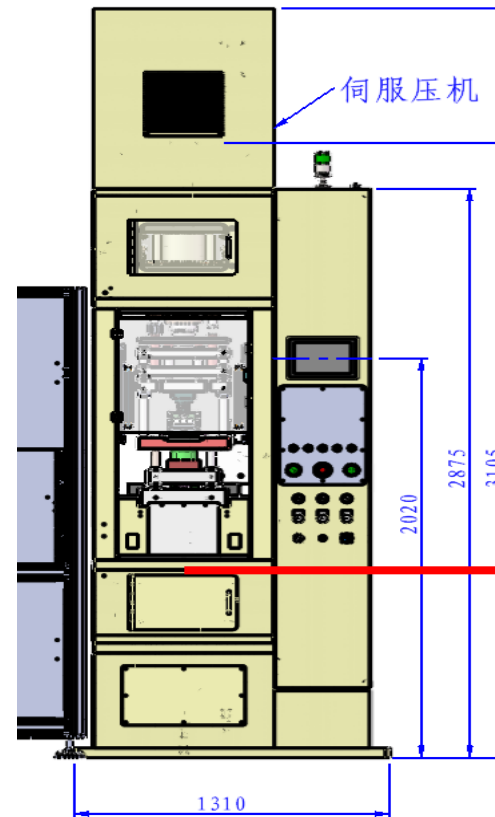

Max limit
 → No any gauge below this line

OK

Maruwa requesting the die plate groove angle to be in the range of $6.6^{\circ} \sim 7.0^{\circ}$
=> Final angle will be 6.8°

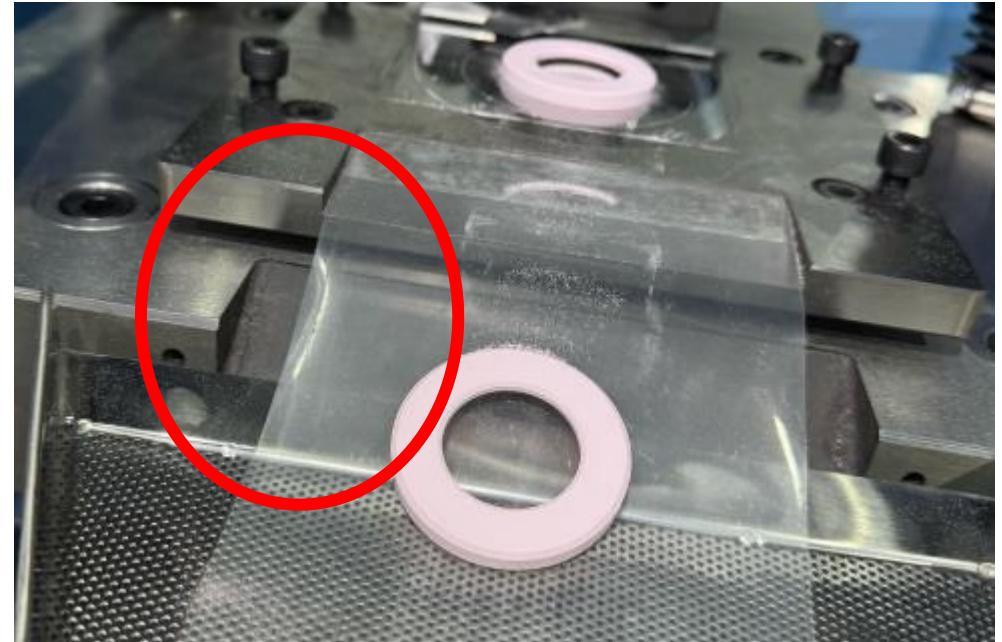

Completed the modification
Angle : 6.8°


The operator mistook it for the mold cleaning counter and reset it.

→ A confirmation screen is required for mould cleaning

→ Relocate – mould cleaning button separately : operator always mistake

回复：位置更新，后续会出示意图

Re: Location update, intent will be shown later

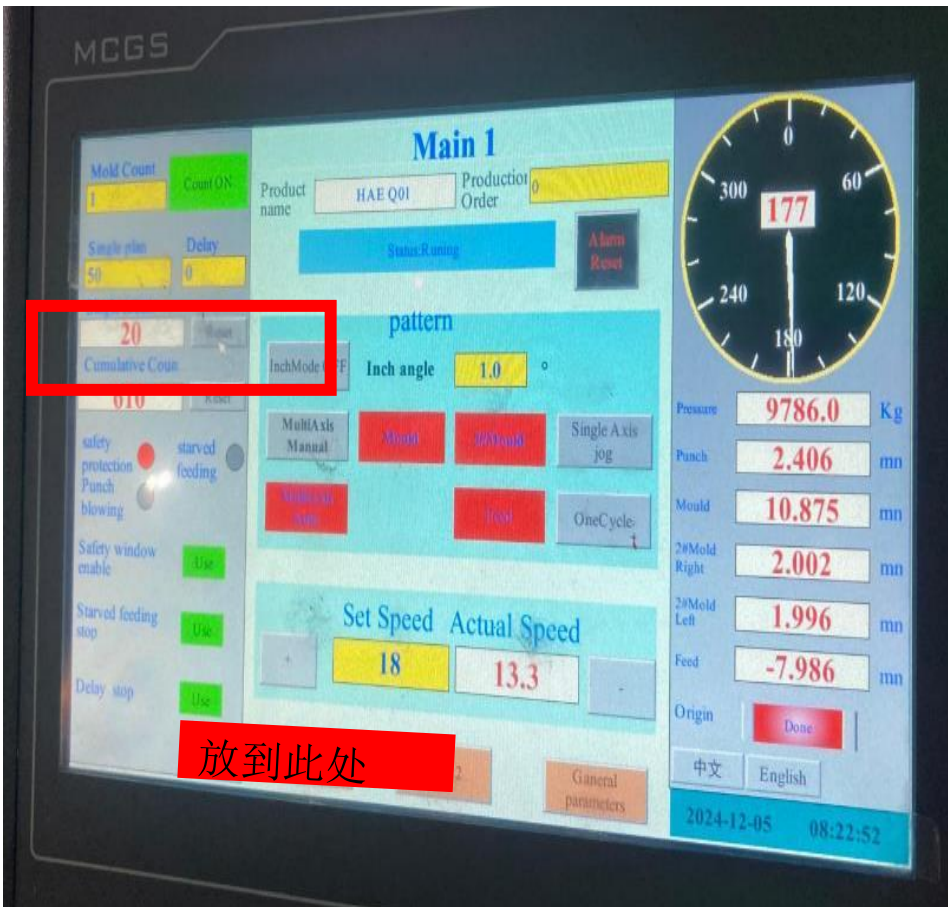

Mould cleaning reset button separate with quantity reset

- It will be possible to control the pressure input.
- It will make an emergency stop the moment the pressure reaches this level or exceeds this level. The current function is slow to stop, and will only make an emergency stop once the pressure reaches 15 tons, 19 tons or more.



Need to add in auto stop when exceed setting spec

回复：售后跟踪，新机处理好才出机

Re: The pressure setting not activated → will update the software for to enable & disable

Similar software will be update for DP21

All parameter setting will be protected with password where the login will be recorded in the log

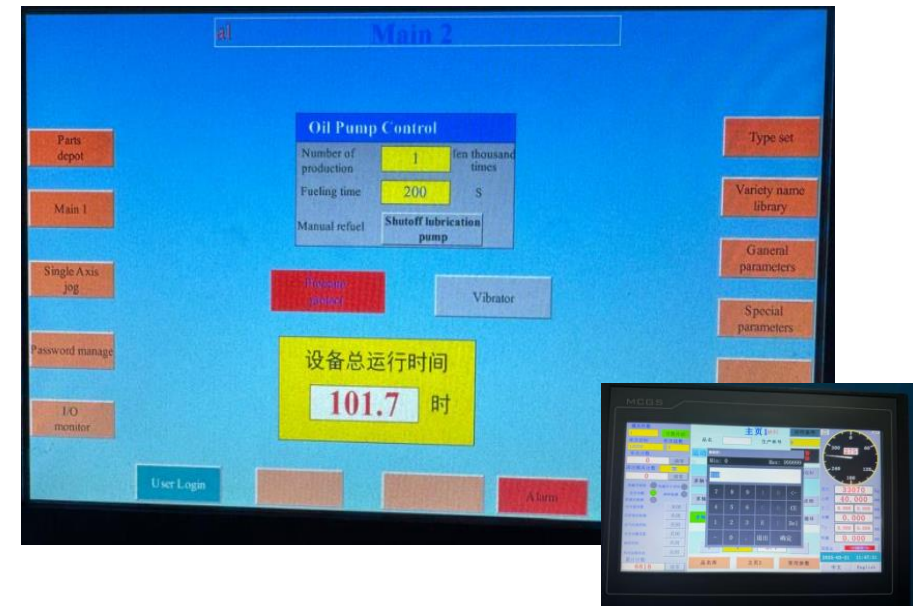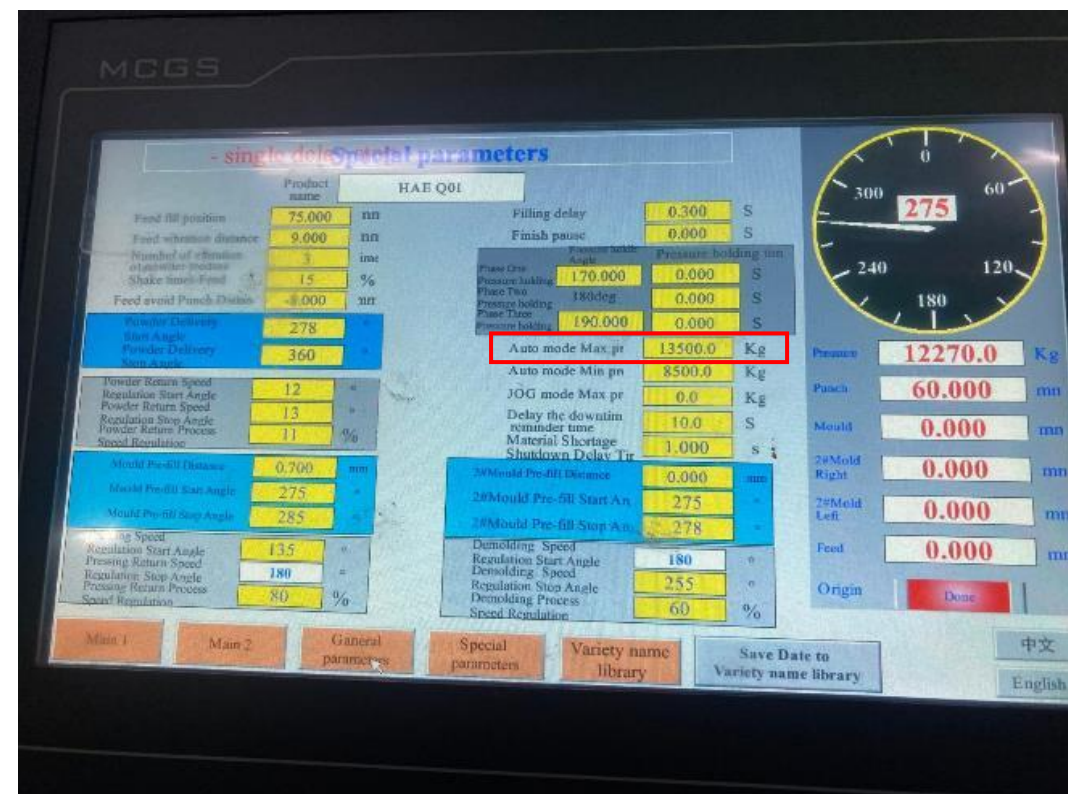

Parameter setting => password protected

Other requirement

a. Hopper powder heater 回复: 在料斗上只能做到局部加热, 无法让粉末温度均匀, 建议不追加。 *Re: Only local heating can be achieved on the hopper, and the powder cannot be evenly heated, so it is recommended not to add it. (OK)*

b. Barrier sensor – Custain sensor 回复: 新设备安装安全光栅 (OK)




Completed barrier sensor

Other requirement

c. Double punch sensor ? Upper & Lower punch 回复: 新设备有1个产品检测传感器

The new device has 1 product detection sensor (Location of the sensor & function timing) (OK)

Required for additional installation for the current machine – will be carry out during installation

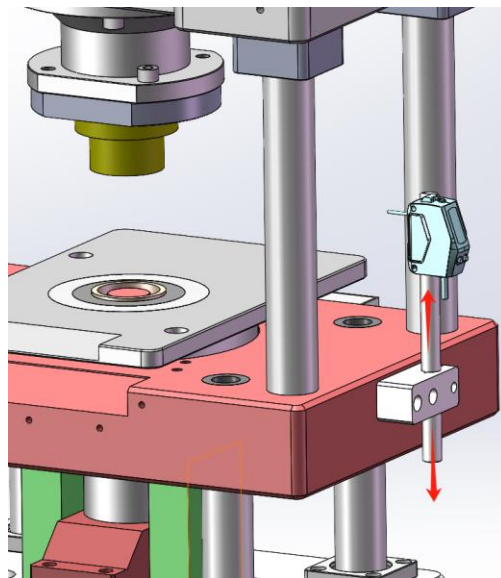

回复: 激光位移传感器可上下移动, 也可以旋转

1.5ms/5ms/10ms可切换

Re: The laser displacement sensor can be moved up and down as well as rotated
1.5ms/5ms/10ms switchable



Current Maruwa double punch sensor

Discuss internally to apply similar method

lot Requirement

- * Data transfer parameter

IoT – PLC Setting

Parameter Info

IP address : 192.168.3.124 & 125

Subnet : 255.255.255.0

Gateway: 192.168.3.254


Port No : **8005**

Tag No : **provide later**

PLC : **keyence**

Current : DP21

Modbus

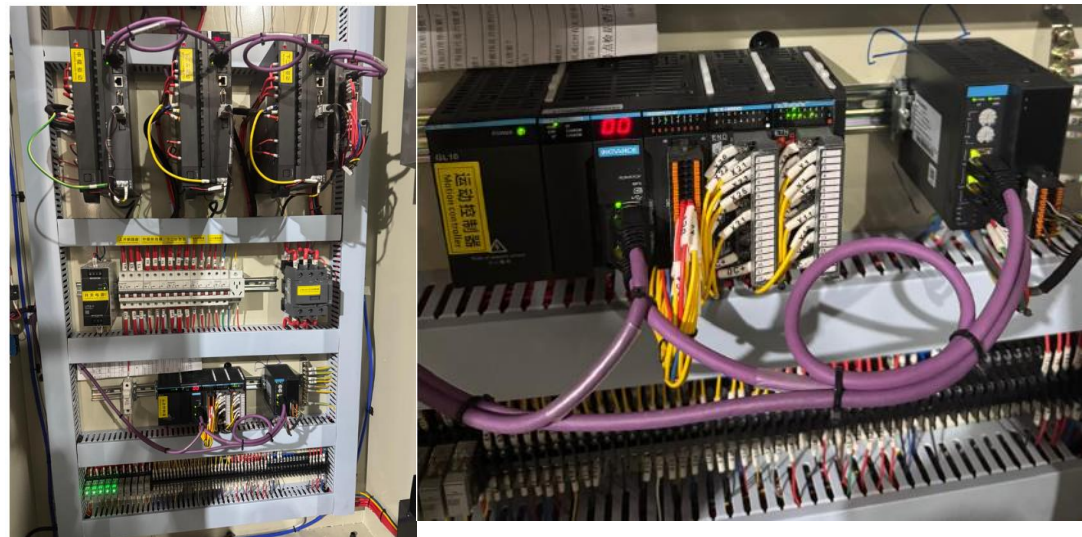




Example – Tag No

FX5S充磁摆盘机

软件名 Chinese Simplified/简

M0	复位
M1	复位标志
M2	自动运行
M7	清零
M8	启动
M9	复位
M10	暂停
M11	模拟运行
M17	HM上料电机
M18	夹紧气缸HMI
M19	夹紧气缸AUTO
M20	充磁HMI
M21	振动盘
M22	输送带
M23	切料气缸HMI
M24	移载气缸HMI
M25	上下气缸HMI
M26	旋转气缸HMI
M27	推料气缸HMI
M28	轴JOG+
M29	轴JOG-
M30	充磁自动
M31	振动盘
M32	输送带
M33	切料气缸AUTO

CDCQ – Understood & provided

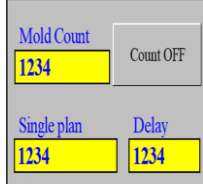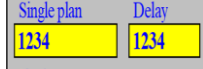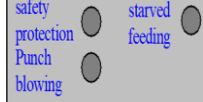	Name	Modbus address	Data type
	Mold Count	2050	UDINT
	Count OFF/ON	1001.8	BOOL
	Single plan	2052	UDINT
	Delay	2054	UDINT
	Single count	2056	UDINT
	Reset	1001.13	BOOL
	Cumulative Count	2058	UDINT
	Reset	1001.14	BOOL
	Safety window enable	1010.0	BOOL
	Starved feeding stop	1010.1	BOOL
	Delay stop	1010.3	BOOL

add another 4 in the front

Mould

CV Mould

MPS276-D02 : MOEN Fix

⇒ No abnormal on dimension

⇒ Sharp edge on upper punch

Quality – par with Tokai

Pricing – Lower by 30% (review)

MPS363 – W01

⇒ No abnormal on dimension

⇒ No abnormal chipping

Quality – par with TungHo

Pricing – Similar

- New request to change the Carbide grade for

- U/Punch & 2nd Lower → VA80

- Lower Punch → VG5



Maruwa – Required study by CDCQ
CV/HAE mould coating

→ HAE mould cleaning frequency :
150/cleaning

CDCQ : Will review the coating &
test at new 20ton Press machine

New Project

They able to do FM mould

Evaluate for BB type & MO type (Repair mould)

- Mould material – Non magnetic carbide

Sample mould shipout : 25/Mar

THANK YOU