Solar ESS Co., Ltd.
53 Moo 2, Nang Lae, Mueang, Chiang Rai 57100, Thailand
Tel. 063 151 6694, 089 632 5829 · LINE: solaress1
www.solaress.org · www.โซลาร์เอสส์.com

MONTHLY REPORT · OCTOBER 2026 · HUAWEI FUSIONSOLAR

Optimizer review: all 8 panels healthy

Module-level check of the 5.12 kWp health centre plant · Chiang Mai province · lifetime, 2026 and October 2026



8 × 640 W · 8 optimizers

VERDICT

All 8 optimizers healthy

Every panel is within ±1.4% of the average, and the order has stayed the same in every period. There is no weak, shaded or failing panel.

WHAT IT MEANS

The 2026 dip is array-wide

Because all 8 panels dropped together, the cause is dust across the whole array (or weather), not one panel. Clean the whole array.

At a glance

OPTIMIZERS ONLINE **8 of 8** Huawei SUN2000-600W-P	LIFETIME (DC) **12,513 kWh** sum of all 8 optimizers	SPREAD **2.4%** best to weakest panel	
BEST PANEL **1.1.7** +1.4% above average	WEAKEST PANEL **1.1.2** −1.0%, within tolerance	INVERTER VS OPTIMIZERS **94%** check DC connections	


Each panel on the roof

Panels on the roof, with each optimizer's lifetime yield (blue = within ±1% of the average)



Same order in every period

A failing panel or optimizer drifts further below the others over time. Here 1.1.7 always leads and 1.1.2 always trails by the same small margin, which is normal factory tolerance in panel power.

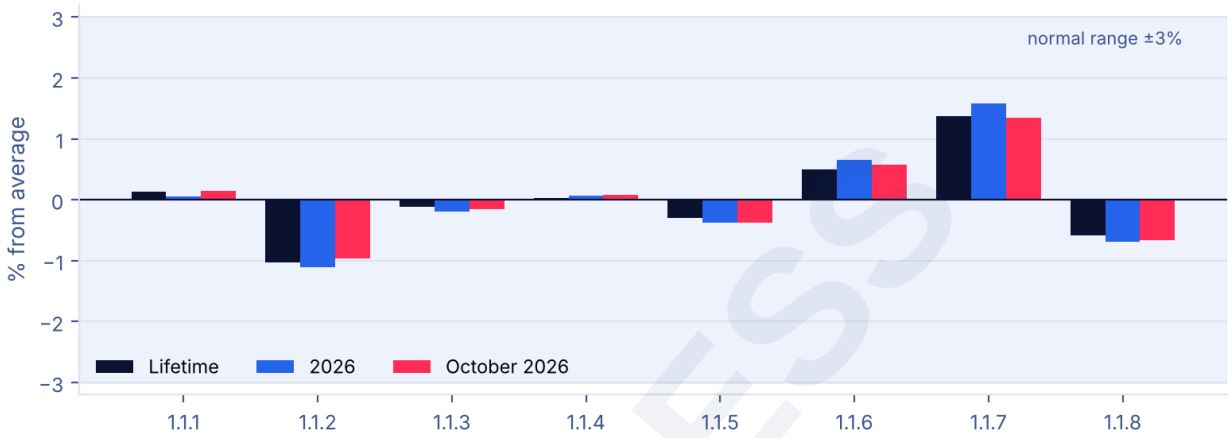

Optimizer readings


Optimizer	Lifetime (kWh)	2026 (kWh)	October (kWh)	Against average
1.1.1	1,566.1	797.8	78.7	+0.1%
1.1.2	1,548.0	788.5	77.8	**−1.0% (lowest)**
1.1.3	1,562.2	795.9	78.5	−0.1%
1.1.4	1,564.6	797.9	78.6	0.0%
1.1.5	1,559.5	794.4	78.3	−0.3%
1.1.6	1,571.9	802.6	79.0	+0.5%
1.1.7	1,585.6	810.0	79.6	**+1.4% (highest)**
1.1.8	1,554.9	791.9	78.1	−0.6%
Total	12,512.6	6,378.9	628.5	spread 2.4%

SOLAR ESS www.solaress.org

Solar ESS Co., Ltd.
53 Moo 2, Nang Lae, Mueang, Chiang Rai 57100, Thailand
Tel. 063 151 6694, 089 632 5829 · LINE: solaress1
www.solaress.org · www.โซลาร์เอสส์.com

From the panels to the inverter

The inverter records about 94% of the energy the optimizers report, the same in every period. About 96–97% is typical, so roughly 3% is unaccounted for. It may be a difference between the two meters, but it is worth tightening the DC connectors and checking the cable run on the next visit.

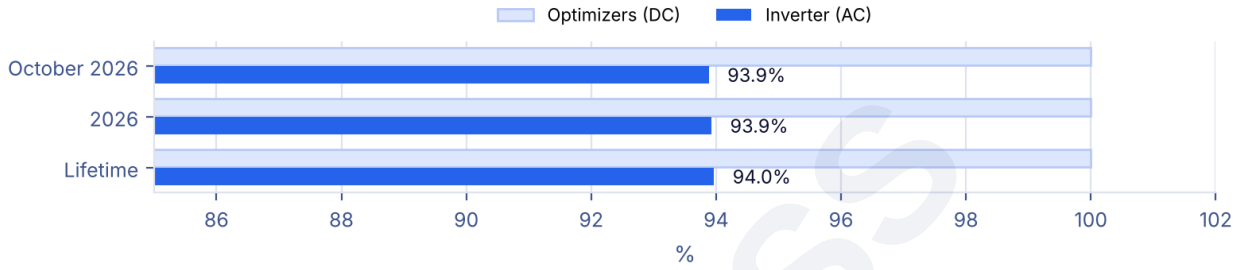

Next steps

1 · CLEAN
Whole array
All 8 panels share the 2026 dip

2 · CHECK
DC connectors and cable
Look for the missing ~3%

3 · WATCH
Panel 1.1.2
Flag it if the gap passes 3%

Data from Huawei FusionSolar optimizer view (module-level), read on 29 October 2026. Site name and location removed. For panel cleaning, an I-V curve test or a system check, book a consultation at www.solaress.org or LINE: solaress1.

Sources: Huawei FusionSolar

SOLAR ESS www.solaress.org