COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Window Up Circuit	4 and 6	Up	Closed Circuit
	2 and 7	Up	Closed Circuit
Window Down Circuit	4 and 2	Down	Closed Circuit
	6 and 3	Down	Closed Circuit
Master Window Control Circuit	3 and 6	At rest	Closed Circuit
	7 and 2	At rest	Closed Circuit

TERMINALS

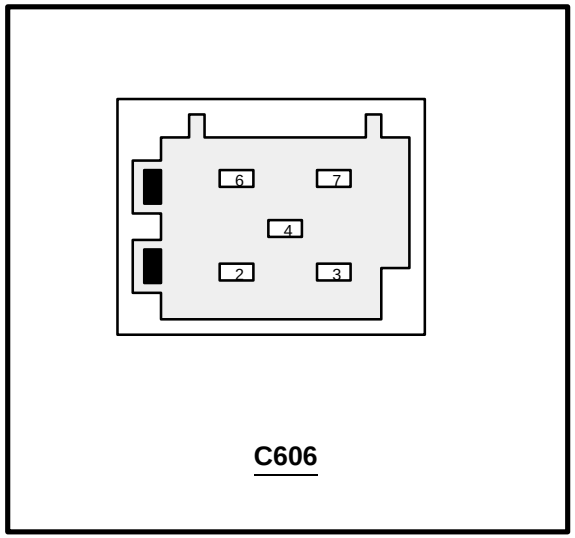
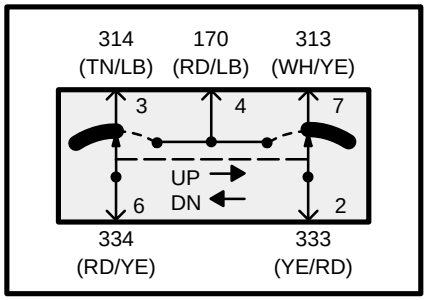
SCHEMATIC