4R100

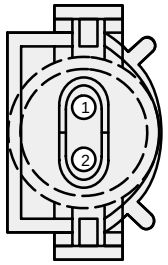

C187

OUTPUT SHAFT SPEED (OSS) SENSOR

PIN	CIRCUIT	CIRCUIT FUNCTION
1	136 (DB/YE)	Output Shaft Speed Sensor (OSS) Signal to PCM
2	1202 (BN/LG)	Signal Return

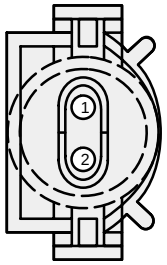

C1024

TURBINE SHAFT SPEED (TSS) SENSOR

PIN	CIRCUIT	CIRCUIT FUNCTION
1	970 (DG/WH)	Turbine Shaft Speed (TSS) Sensor Signal Return
2	971 (PK/BK)	Signal Return

CONNECTOR REFERENCE LIST

CONNECTOR	SECTION-PAGE
C174	24-9, 25-9
C243	13-28
C1026	25-11