Multifunction switch

Schematic

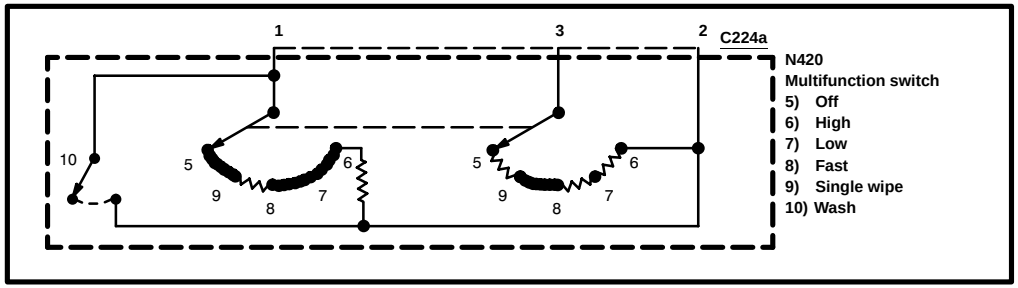

Terminal locations

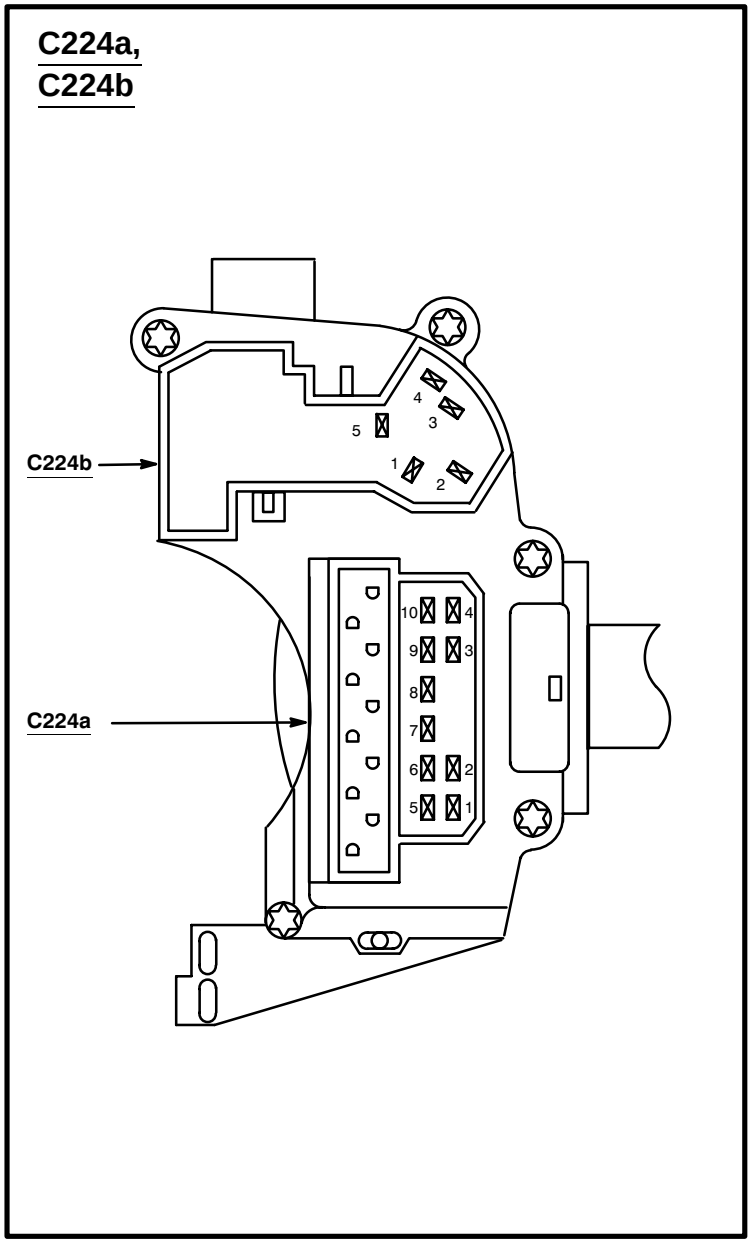

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	1, C224a and 2, C224a	Off, switch depressed	Closed circuit
		Off, switch, Normal	103.3KΩ
Wiper switch circuit	3, C224a and 2, C224a	Off	47.6KΩ
		Fast	11.33KΩ
		Low	4.08KΩ
		High	Closed circuit
Intermittent wiper circuit	1, C224a and 2, C224a	Fast, Off	Rotate control toward Off; ohmmeter will show smoothly increasing resistance from 3.3kOhm minimum to 103.3kOhm maximum.
		Low, High	3.3KΩ