COMPONENT TESTING: LR POWER WINDOW SWITCH 149-10

TERMINALS

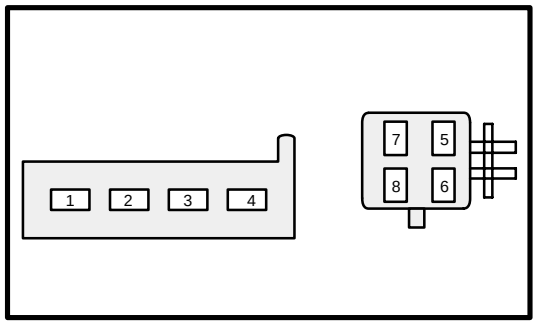

SCHEMATIC

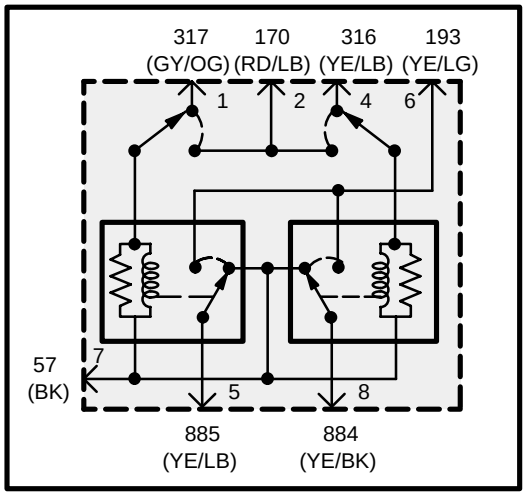

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Window Down Circuit	6 and 5 First connect 2 to power and 7 to ground	Down	Continuity
Window Up Circuit	6 and 8 First connect 2 to power and 7 to ground	Up	Continuity
Window Down Circuit	6 and 5 First connect 1 to power and 7 to ground	At Rest	Continuity
Window Up Circuit	6 and 8 First connect 4 to power and 7 to ground	At Rest	Continuity