## COMPONENT TESTING PROCEDURE

| TO TEST | Connect Self-Powered Test Light or Ohmmeter to Terminals | Move Switch to These Positions | A Good Switch Will Indicate |
|---|---|---|---|
| **Window Up Circuit** | 3 and 5 | Up | Closed Circuit |
| | 1 and 2 | Up | Closed Circuit |
| **Window Down Circuit** | 2 and 3 | Down | Closed Circuit |
| | 5 and 6 | Down | Closed Circuit |
| **Master Window Control Circuit** | 1 and 2 | At rest | Closed Circuit |
| | 5 and 6 | At rest | Closed Circuit |

## TERMINALS

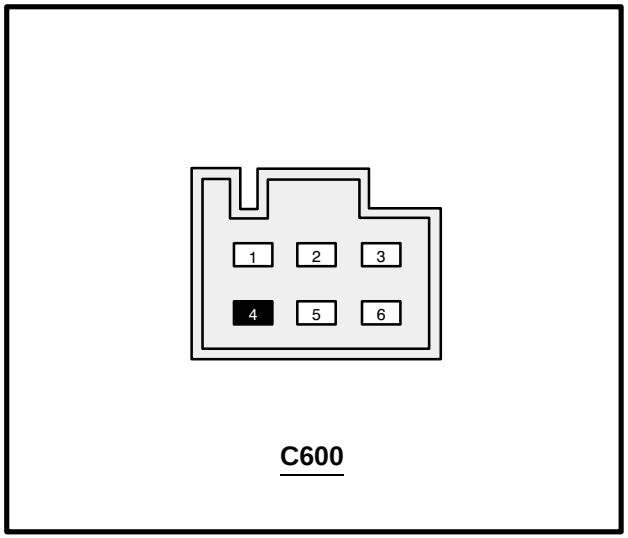

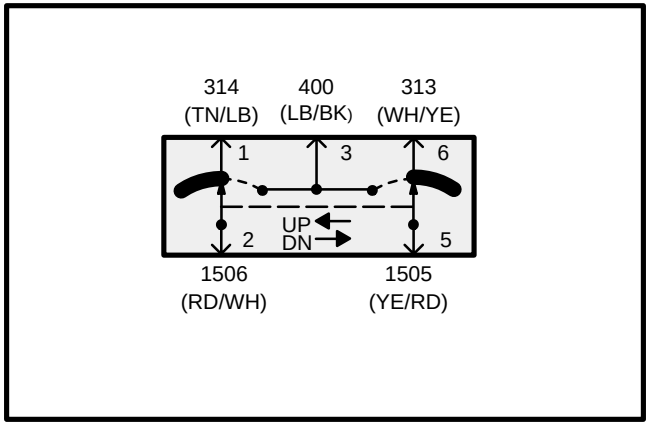
## SCHEMATIC